

2006 2007 2008

Count of VIN		Model Year				
Sort Field One	Time In Service	2006	2007	2008	Grand Total	
1	0	2	2		4	
	1	1		1	2	
	2		2		2	
	3		1		1	
	4		2	1	3	
	5	1	1		2	
	6		3	2	5	
	7		8		8	
	8		7	1	8	
	9	1	7	2	10	
	10	1	6		7	
	11	1	10	2	13	
	12	1	11		12	
	13		16	1	17	
	14		22	1	23	
	15		23	3	26	
	16	1	36	3	40	
	17		15	2	17	
	18	1	11	1	13	
	19		9		9	
	20	1	4		5	
	23		1		1	
	26		1		1	
	(blank)		1	2	3	
	1 Total		12	200	20	232
	Grand Total		12	200	20	232

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Friday, September 12, 2008 1:23 PM  
**To:** Ott, David (D.J.); Jansen, Michael (M.R.); Mayberry, Debbie (Debra L.)  
**Subject:** Valve stems

**Attachments:** Valve stems DI.xls

















Valve stems  
DI.xls (1 MB)

*Bryce Kircheis*

Group Leader  
Ford Digital Imaging  
6 Sigma Center  
15080 Commerce Dr. N  
Dearborn MI, 48120  
313-206-2017

7KEAB010	HD	20071105	20061218	20070301	02934	Roy O'Brien, Inc. Jack,Onofrey	(586) 776-7600	426222	2007	1FMYU03Z17K	MR	16809	ESCAP2	2.3L 4V	306201	CHASS.	TIRES/WHEELS
8B3AD178	HD	20080229	20061222	20070530	04584	Champion Ford Steve,McAliley	(361) 994-6200	429955	2007	1ZVFT82H2752	MS	10761	MUST	MOD 4.6L	306200	CHASS.	TIRES/WHEELS
8C1AC013	HD	20080327	20070413	20070601	04843	Maroone Ford of brian,stahl	(954) 564-3221	25690	2007	1ZVFT82H8753	MS	10348	MUST	MOD 4.6L	306201	CHASS.	TIRES/WHEELS
8C1AC137	HD	20080327	20070226	20070531	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38006	2007	1FTRF12237NA	FL	8702	F150X2	4.2L EFI	306201	CHASS.	TIRES/WHEELS
8DJAH140	HD	20080410	20070220	20070502	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38205	2007	2FMDK39C87BA	EA	6021	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8DXAN074	HD	20080424	20070201	20070314	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38399	2007	1FMFK17537LA	6 EN	19016	EXPDX2	MOD 5.4 3V	306201	CHASS.	TIRES/WHEELS
8EFBT306	HD	20080506	20061220	20070127	01203	Fred Beans Ford Bruce,Paynter	(215) 348-2900	494352	2007	1ZVHT82H275	MS	15044	MUST	MOD 4.6L	306700	CHASS.	TIRES/WHEELS
8EMAR096	HD	20080513	20070118	20070216	05439	Fiesta Ford, Inc. Daniel,Henderson	(760) 772-8000	62414	2007	3FAHP07Z57R	ZM	3110	FUSION	2.3L4V EFI	306201	CHASS.	TIRES/WHEELS
8FFAE233	HD	20080606	20070117	20070327	20337	Holmes Tuttle Fc JARAD,CHAPPUE	(520) 292-3675	711258	2007	3LNHM26T27R	ZM	5704	ZEPMKZ	DURATEC 35	306299	CHASS.	TIRES/WHEELS
8FKBD563	HD	20080611	20070309	20070514	05439	Fiesta Ford, Inc. Daniel,Henderson	(760) 772-8000	64744	2007	2MHHM75V97X	RC	2724	GRDMRQ	4.6 SOHC F	306200	CHASS.	TIRES/WHEELS
8FQCL033	HD	20080617	20061219	20070312	05439	Fiesta Ford, Inc. Tracy,Lowry	(760) 772-8000	65114	2007	1FAFP31N17W	FC	9725	FOCUSN	2.0L 4V	306609	CHASS.	TIRES/WHEELS
8G4A5331	HD	20080730	20070124	20070327	04160	Brinson Ford Lin Renee,Schedule	(903) 676-5200	39163	2007	2FMDK38C37BA	EA	26469	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8GCB5172	HD	20080703	20061206	20070106	02938	Palm Bay Ford, I DARRYL,SUTPHIN	(321) 722-9000	184970	2007	1FTPX12V27NA	FL	18038	F150X2	5.4L 3V FF	306609	CHASS.	TIRES/WHEELS
8IDBH176	HD	20080904	20061207	20061207	04808	Kelly Ford JIM,WILLARD	(321) 254-4283	148635	2007	1FMCU02Z77	MR	20599	ESCAP2	2.3L 4V	306609	CHASS.	TIRES/WHEELS
8IIB1158	HD	20080909	20070215	20070502	02549	Silsbee Ford Lin Syvella,Reese	(409) 385-3724	200810	2007	2MEFM75V87X	RC	14152	GRDMRQ	4.6 SOHC F	306602	CHASS.	TIRES/WHEELS

AIR LOSS	SLOW LEAK	Processed	MPOPEJ ,	 <b>CONCER:</b> left frt., right frt., and right rear tire valve cores are cracking atthe base of the cores. replace def. cores <b>RECOMM:</b> DI prior approval not needed for tire valve stems. Thanks, Mark P.
AIR LOSS		Processed	SYERK	 <b>CONCER:</b> CUST.STATES VALVE STEEMS ARE DRYROTTED. ONE BLEW OUT CAUSEING A FLAT ON THE INTERSTATE
AIR LOSS	SLOW LEAK	Processed	LLOMBA	 <b>CONCER:</b> valve stems and tires do not require di approval. thanks, scott
AIR LOSS	SLOW LEAK	Approved - PAA3W	SYERK	 <b>CONCER:</b> All four wheels, valve stems are dry rotting and cracked resultine in air loss from tire. Passenger side rear tire suddenly
AIR LOSS	SLOW LEAK	Approved - PAA3W	SYERK	 <b>CONCER:</b> ALL FOUR VALVE STEAMS ARE CUT AND LEAKING AIR <b>RECOMM:</b> must have clear and focused close up images
AIR LOSS	SLOW LEAK	Approved - PAA3W	SYERK	 <b>CONCER:</b> All four tire stems are cracked. Left front leaking air. Request replacement of all stems. <b>RECOMM:</b> You can not use
AIR LOSS	SLOW LEAK	Approved - PAA7Z	SYERK	 <b>CONCER:</b> Right rear and left fron tire stems cracked and leaking. Customer hadleft rear stem replaced 1/12/08 at Tires Plus
APPEARANCE		Approved - PAARZ	GBUSH5	 <b>CONCER:</b> customer request to replace cracking valve stems, tech verified cracking on all 4 stems, no visible rub marks on stems or
AIR LOSS	SLOW LEAK	Processed	SYERK	 <b>CONCER:</b> cust states while driving right side rear tire went flat and was damaged while coming to a stop, dis-mounted tire to
AIR LOSS	NOT LISTED	APPROVED TIRE	LLOMBA ,,	 <b>CONCER:</b> C/S WHILE DRIVING, THE CAR PULLED TO THE RIGHT AND STARTED WOBBLING. HAD TO DRIVE TO A SPOT
AIR LOSS		Approved - PAA3X	SYERK	 <b>CONCER:</b> while driving on freeway tire went flat due to valve stem failure tirewas damaged while coming to safe stop, tech
TIRE FAILURE	VALVE STEM	Approved - PAAAV	BKIRCHE ,	 <b>CONCER:</b> valve stem leaking, customer did not know tire low on air and drove onit damage side wall , need
AIR LOSS	SLOW LEAK	Processed	TZELEC	 <b>CONCER:</b> CUSTOMER STATES TIRE LEAKING AIR AT VALVE STEM AREA AND HAS GONE FLAT.VALVE STEM ON RT
TIRE FAILURE	VALVE STEM	Approved - PAAKR	LLOMBA ,	 <b>CONCER:</b> RIGHT FRONT TIRE VALVE STEM, CRACKING. LOST ALL THE AIR FOR THAT TIRE WENT FLAT, DAMAGED SIDE
TIRE FAILURE	VALVE STEM	VALVE STEM SPLIT IN RUBBER	GBUSH5	 <b>REPAIR:</b> CHECKED L/R,R/F AND R/R VALVE STEM CRACKED AND LEAKING AIR RECOMMEND TO REPLACE 3 OF THE
TIRE FAILURE	BLOWOUT	Denied	MSAMPL ,	 <b>CONCER:</b> CUSTOMER STATES POSSIBLE VALVE STEMS WERE LEAKING CAUSING THE TIRE TO LEAK THE AIR

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Friday, September 12, 2008 1:23 PM  
**To:** Ott, David (D.J.); Jansen, Michael (M.R.); Mayberry, Debbie (Debra L.)  
**Subject:** Valve stems

**Attachments:** Valve stems DI.xls









Valve stems  
DI.xls (1 MB)

*Bryce Kircheis*










Group Leader  
Ford Digital Imaging  
6 Sigma Center  
15080 Commerce Dr. N  
Dearborn MI, 48120  
313-206-2017







7KEAB010	HD	20071105	20061218	20070301	02934	Roy O'Brien, Inc. Jack,Onofrey	(586) 776-7600	426222	2007	1FMYU03Z17K	MR	16809	ESCAP2	2.3L 4V	306201	CHASS.	TIRES/WHEELS
8B3AD178	HD	20080229	20061222	20070530	04584	Champion Ford Steve,McAliley	(361) 994-6200	429955	2007	1ZVFT82H275	MS	10761	MUST	MOD 4.6L	306200	CHASS.	TIRES/WHEELS
8C1AC013	HD	20080327	20070413	20070601	04843	Maroone Ford of brian,stahl	(954) 564-3221	25690	2007	1ZVFT82H875	MS	10348	MUST	MOD 4.6L	306201	CHASS.	TIRES/WHEELS
8C1AC137	HD	20080327	20070226	20070531	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38006	2007	1FTRF12237N	FL	8702	F150X2	4.2L EFI	306201	CHASS.	TIRES/WHEELS
8DJAH140	HD	20080410	20070220	20070502	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38205	2007	2FMDK39C87B	EA	6021	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8DXAN074	HD	20080424	20070201	20070314	09555	Gulf Breeze Forc Debbi,Helm	(850) 934-8366	38399	2007	1FMFK17537L	EN	19016	EXPDX2	MOD 5.4 3V	306201	CHASS.	TIRES/WHEELS
8EFBT306	HD	20080506	20061220	20070127	01203	Fred Beans Ford Bruce,Paynter	(215) 348-2900	494352	2007	1ZVHT82H275	MS	15044	MUST	MOD 4.6L	306700	CHASS.	TIRES/WHEELS
8EMAR096	HD	20080513	20070118	20070216	05439	Fiesta Ford, Inc. Daniel,Henderson	(760) 772-8000	62414	2007	3FAHP07Z57R	ZM	3110	FUSION	2.3L4V EFI	306201	CHASS.	TIRES/WHEELS
8FFAE233	HD	20080606	20070117	20070327	20337	Holmes Tuttle Fc JARAD,CHAPPUE	(520) 292-3675	711258	2007	3LNHM26T27R	ZM	5704	ZEPMKZ	DURATEC 35	306299	CHASS.	TIRES/WHEELS
8FKBD563	HD	20080611	20070309	20070514	05439	Fiesta Ford, Inc. Daniel,Henderson	(760) 772-8000	64744	2007	2MHHM75V97X	RC	2724	GRDMRQ	4.6 SOHC F	306200	CHASS.	TIRES/WHEELS
8FQCL033	HD	20080617	20061219	20070312	05439	Fiesta Ford, Inc. Tracy,Lowry	(760) 772-8000	65114	2007	1FAFP31N17W	FC	9725	FOCUSN	2.0L 4V	306609	CHASS.	TIRES/WHEELS
8G4A5331	HD	20080730	20070124	20070327	04160	Brinson Ford Lin Renee,Schedule	(903) 676-5200	39163	2007	2FMDK38C37B	EA	26469	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8GCB5172	HD	20080703	20061206	20070106	02938	Palm Bay Ford, I DARRYL,SUTPHIN	(321) 722-9000	184970	2007	1FTPX12V27N	FL	18038	F150X2	5.4L 3V FF	306609	CHASS.	TIRES/WHEELS
8IDBH176	HD	20080904	20061207	20061207	04808	Kelly Ford JIM,WILLARD	(321) 254-4283	148635	2007	1FMCU02Z77K	MR	20599	ESCAP2	2.3L 4V	306609	CHASS.	TIRES/WHEELS
8IIB1158	HD	20080909	20070215	20070502	02549	Silsbee Ford Lin Syvella,Reese	(409) 385-3724	200810	2007	2MEFM75V87X	RC	14152	GRDMRQ	4.6 SOHC F	306602	CHASS.	TIRES/WHEELS




AIR LOSS	SLOW LEAK	Processed	MPOPEJ ,	<b>CONCER:</b> left frt., right frt., and right rear tire valve cores are cracking atthe base of the cores. replace def. cores <b>RECOMM:</b> DI prior approval not needed for tire valve stems. Thanks, Mark P.
AIR LOSS		Processed	SYERK 	<b>CONCER:</b> CUST.STATES VALVE STEEMS ARE DRYROTTED. ONE BLEW OUT CAUSEING A FLAT ON THE INTERSTATE
AIR LOSS	SLOW LEAK	Processed	LLOMBA 	<b>CONCER:</b> valve stems and tires do not require di approval. thanks, scott
AIR LOSS	SLOW LEAK	Approved - PAA3W	SYERK 	<b>CONCER:</b> All four wheels, valve stems are dry rotting and cracked resultine in air loss from tire. Passenger side rear tire suddenly
AIR LOSS	SLOW LEAK	Approved - PAA3W	SYERK 	<b>CONCER:</b> pressure while customer was on highway, resulting in destruction of tire. Remedy is replacement of all four valve stems, cement of passenger side rear tire. <b>RECOMM:</b> Tires are not yet on the DI program. Thx Loretta 3-27-08
AIR LOSS	SLOW LEAK	Approved - PAA7Z	SYERK 	<b>CONCER:</b> ALL FOUR VALVE STEAMS ARE CUT AND LEAKING AIR <b>RECOMM:</b> must have clear and focused close up images and the required overall images of all four valve stems. thanks, Scott warranty approved to replace all four wheel valve stems. thanks scott
AIR LOSS	SLOW LEAK	Approved - PAA7Z	JTOLBE1 	<b>CONCER:</b> All four tire stems are cracked. Left front leaking air. Request replacement of all stems. <b>RECOMM:</b> You can not use warranty to replace parts to prevent future possible failures per Warranty and Policies. So, the left front valve stem can be replaced does not need approval because it is under the part and labor limits. Thanks, Jerry
APPEARANCE		Approved - PAARZ	GBUSH5 	<b>CONCER:</b> Right rear and left fron tire stems cracked and leaking. Customer hadleft rear stem replaced 1/12/08 at Tires Plus use flat occured traveling out of town and no dealership was available. Right front tire sustained damage due to flat caused by LF stem replacement and new tire. Also may need new tire sensor if damaged. <b>RECOMM:</b> warranty approved to replace the lt frt and rt rear valve stems, tiresdo not require di approval at this time. thanks, Scott
AIR LOSS	SLOW LEAK	Approved - PAARZ	GBUSH5 	<b>CONCER:</b> customer request to replace cracking valve stems, tech verified cracking on all 4 stems, no visible rub marks on stems or
AIR LOSS	SLOW LEAK	Approved - PAARZ	SYERK 	<b>CONCER:</b> cust states while driving right side rear tire went flat and was damaged while coming to a stop, dis-mounted tire to ect for road hazard, none found, found valve stem cracked and leaking, request aprpto replace (1) tire due to failed valve stem. thanks daniel <b>RECOMM:</b> the valve stem is under the dollar amount, di approval not required, and tires do not require di approval. thanks. Scott
AIR LOSS	NOT LISTED	APPROVED TIRE	LLOMBA ,,	<b>CONCER:</b> C/S WHILE DRIVING, THE CAR PULLED TO THE RIGHT AND STARTED WOBBLING. HAD TO DRIVE TO A SPOT WHERE HE COULD PULL OVER. WHEN HE PULLED OVER, HE NOTICED THERE WAS NO VALVE STEM IN THE WHEEL. REQUEST NEW VALVE STEM AND NEW TIRE 225/50/17 MICHELLIN <b>RECOMM:</b> Warranty denied to replace tire and stem. This is caused from driving on the tire while flat. I reviewed claim with my team leader, George. thx Loretta 6-6-08 <b>REPAIR:</b> DENIAL OVERTURNED TO APPORVED DUE TO VALVE STEM FAILURE, REVIEWED WITHGROUP LEADER (BRYCE KIRCHIES)
AIR LOSS		Approved - PAA3X	SYERK 	<b>CONCER:</b> while driving on freeway tire went flat due to valve stem failure tirewas damaged while coming to safe stop, tech ected found no signs of road hazard, request approval to replace tire thank you daniel right front tire <b>RECOMM:</b> please specify which tire. frt, rear, rt or lt. thanks, scott warranty approved to replace the rt frt tire and valve stem. the valvestem will be called back for engineering study, please removed with great care as to keep the valve stem intact, if not able to do so please keep all pieces. thanks Scott
TIRE FAILURE	VALVE STEM	Approved - PAAAV	BKIRCHE ,	<b>CONCER:</b> valve stem leaking, customer did not know tire low on air and drove onit damage side wall , need tire <b>RECOMM:</b> Approved to replace the valve stem and tire. Engineering would like the valve stem back for study, please remove it carefully. A 700 tag will be issued for the tire and valve stem. Thanks Bryce
AIR LOSS	SLOW LEAK	Approved - PAAAV	TZELEC 	<b>CONCER:</b> CUSTOMER STATES TIRE LEAKING AIR AT VALVE STEM AREA AND HAS GONE FLAT.VALVE STEM ON RT TIRE AGE CRACKED AND LEAKING. SUGGESTED REPAIR,REPLACE VALVE STEM. <b>RECOMM:</b> Renee, Valve stems on the component list, and parts and loaborare under dealer cap. you may continue with repairs. Thanks Tom
TIRE FAILURE	VALVE STEM	Approved - PAAKR	LLOMBA ,	<b>CONCER:</b> RIGHT FRONT TIRE VALVE STEM, CRACKING. LOST ALL THE AIR FOR THAT TIRE WENT FLAT, DAMAGED SIDE WALL. TWO OTHER VALVE STEMS CRACKING, NEED TO REPLACE ONE TIRE AND REMAINING FLAT STEMS. <b>RECOMM:</b> approval to replace right front tire and 2 valve stems. cracking. PHOTOS ARE VERY BLURRY. FOR CLEAREST CLOSE UP, Try taking a step back,use close up function and let camera auto focus, press shutter button 1/2 way down, let camera focus then take pic. thx Loretta 7-3-08
TIRE FAILURE	VALVE STEM	VALVE STEM SPLIT IN RUBBER	GBUSH5 	<b>REPAIR:</b> CHECKED L/R,R/F AND R/R VALVE STEM CRACKED AND LEAKING AIR RECOMMEND TO REPLACE 3 OF THE DUR VALVE STEMS <b>RECOMM:</b> REPLACE ALL 4 VALVE STEMS.
TIRE FAILURE	BLOWOUT	Denied	MSAMPL ,	<b>CONCER:</b> CUSTOMER STATES POSSIBLE VALVE STEMS WERE LEAKING CAUSING THE TIRE TO LEAK THE AIR PRESSURE DOWN AND DAMAGING THE TIRES. SIDE WALLS HAD BLOWN OUT. CUSTOMER REQUEST REPLACEMENT TIRES AND OR REFUND FOR THE TIRES THEY REPLACED. ALL 4. THANKS ANN R. <b>RECOMM:</b> Warranty denied to replace all four tires. Based on the provided images, this is the result of damage.



Rpt Nbr	PGM	Rpt Date	Prod Date	Year Strt Date	&A Cod	Dealer Name	Dealer Name (first, last)	Dealer Phone Num	Inv Num	Year	Vin	St	Mileage	Veh	Engine	sym Cod	Cat	Q1
7KEAB010	HD	20071105	20061218	20070301	02934	Roy O'Brien, Inc.	Jack,Onofrey	(586) 776-7600	426222	2007	1FMYU03Z17K	MR	16809	ESCAP2	2.3L 4V	306201	CHASS.	TIRES/WHEELS
8B3AD178	HD	20080229	20061222	20070530	04584	Champion Ford	Steve,McAliley	(361) 994-6200	429955	2007	1ZVFT82H275	MS	10761	MUST	MOD 4.6L	306200	CHASS.	TIRES/WHEELS
8C1AC013	HD	20080327	20070413	20070601	04843	Maroone Ford of	brian,stahl	(954) 564-3221	25690	2007	1ZVFT82H875	MS	10348	MUST	MOD 4.6L	306201	CHASS.	TIRES/WHEELS
8C1AC137	HD	20080327	20070226	20070531	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38006	2007	1FTRF12237N	FL	8702	F150X2	4.2L EFI	306201	CHASS.	TIRES/WHEELS
8DJAH140	HD	20080410	20070220	20070502	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38205	2007	2FMDK39C87B	EA	6021	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8DXAN074	HD	20080424	20070201	20070314	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38399	2007	1FMFK17537L	EN	19016	EXPDX2	MOD 5.4 3V	306201	CHASS.	TIRES/WHEELS
8EFBT306	HD	20080506	20061220	20070127	01203	Fred Beans Ford	Bruce,Paynter	(215) 348-2900	494352	2007	1ZVHT82H275	MS	15044	MUST	MOD 4.6L	306700	CHASS.	TIRES/WHEELS
8EMAR096	HD	20080513	20070118	20070216	05439	Fiesta Ford, Inc.	Daniel,Henderson	(760) 772-8000	62414	2007	3FAHP07Z57P	ZM	3110	FUSION	2.3L4V EFI	306201	CHASS.	TIRES/WHEELS
8FFAE233	HD	20080606	20070117	20070327	20337	Holmes Tuttle Fo	JARAD,CHAPPUE	(520) 292-3675	711258	2007	3LNHM26T27R	ZM	5704	ZEPMKZ	DURATEC 35	306299	CHASS.	TIRES/WHEELS
8FKBD563	HD	20080611	20070309	20070514	05439	Fiesta Ford, Inc.	Daniel,Henderson	(760) 772-8000	64744	2007	2MHHM75V97X	RC	2724	GRDMRC	4.6 SOHC F	306200	CHASS.	TIRES/WHEELS
8FQCL033	HD	20080617	20061219	20070312	05439	Fiesta Ford, Inc.	Tracy,Lowry	(760) 772-8000	65114	2007	1FAFP31N17W	FC	9725	FOCUSN	2.0L 4V	306609	CHASS.	TIRES/WHEELS
8G4A5331	HD	20080730	20070124	20070327	04160	Brinson Ford Linc	Renee,Schedule	(903) 676-5200	39163	2007	2FMDK38C37B	EA	26469	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS
8GCB5172	HD	20080703	20061206	20070106	02938	Palm Bay Ford, Ir	DARRYL,SUTPHIN	(321) 722-9000	184970	2007	1FTPX12V27N	FL	18038	F150X2	5.4L 3V FF	306609	CHASS.	TIRES/WHEELS
8IDBH176	HD	20080904	20061207	20061207	04808	Kelly Ford	JIM,WILLARD	(321) 254-4283	148635	2007	1FMCU02Z77K	MR	20599	ESCAP2	2.3L 4V	306609	CHASS.	TIRES/WHEELS
8IIB1158	HD	20080909	20070215	20070502	02549	Silsbee Ford Linc	Syvella,Reese	(409) 385-3724	200810	2007	2MEFM75V87X	RC	14152	GRDMRC	4.6 SOHC F	306602	CHASS.	TIRES/WHEELS

Q2	Q3	tom Vent Cont swa	Addl Sym	art N	aus	CDSID	Image	Comments
AIR LOSS	SLOW LEAK		Processed			MPOPEJO2,		<b>CONCER:</b> left frt., right frt., and right rear tire valve cores are cracking at the base of the cores. replace def. cores <b>RECOMM:</b> DI prior approval not needed for tire valve stems. Thanks, Mark P.
AIR LOSS			Processed			SYERK		<b>CONCER:</b> CUST.STATES VALVE STEEMS ARE DRYROTTED. ONE BLEW OUT CAUSEING A FLAT ON THE INTERSTATE DAMAGEING THE
AIR LOSS	SLOW LEAK		Processed			LLOMBAR1		<b>RECOMM:</b> valve stems and tires do not require di approval. thanks, scott <b>CONCER:</b> All four wheels, valve stems are dry rotting and cracked resultine in air loss from tire. Passenger side rear tire suddenly lost pressure while customer s on highway, resulting in destruction of tire. Remedy is replacement of all four valve stems, replacement of passenger side rear tire. <b>RECOMM:</b> Tires are not on the DI program. Thx Loretta 3-27-08
AIR LOSS	SLOW LEAK		Approved - I			SYERK		<b>CONCER:</b> ALL FOUR VALVE STEAMS ARE CUT AND LEAKING AIR <b>RECOMM:</b> must have clear and focused close up images and the required overall images of all four valve stems. thanks, Scott warranty approved to replace all four wheel valve stems. thanks, scott
AIR LOSS	SLOW LEAK		Processed			JTOLBE17		<b>CONCER:</b> All four tire stems are cracked. Left front leaking air. Request replacement of all stems. <b>RECOMM:</b> You can not use warranty to replace parts to event future possible failures per Warranty and Policies. So, the left front valve stem can be replaced but does not need approval because it is under the part and labor limits. Thanks, Jerry
AIR LOSS	SLOW LEAK		Approved - I			SYERK		<b>CONCER:</b> Right rear and left fron tire stems cracked and leaking. Customer had left rear stem replaced 1/12/08 at Tires Plus because flat occured traveling out of town and no dealership was available. Right front tire sustained damage due to flat caused by leak in stem this past Sunday. Again customer was traveling out of town and no dealership was available for repair. Request RR and LF stem replacement and new tire. Also may need new tire sensor if damaged. <b>RECOMM:</b> warranty approved to replace the lt frt and rt rear valve stems, tires do not require di approval at this time. thanks, Scott
APPEARANCE			Approved - I			GBUSH5		<b>CONCER:</b> customer request to replace cracking valve stems, tech verified cracking on all 4 stems, no visible rub marks on stems or signs of damage,customer longer waiting <b>RECOMM:</b> approved to replace 4 valve stems. thanks gary
AIR LOSS	SLOW LEAK		Processed			SYERK		<b>CONCER:</b> cust states while driving right side rear tire went flat and was damaged while coming to a stop, dis-mounted tire to inspect for road hazard, none found, and valve stem cracked and leaking, request apprto replace (1) tire due to failed valve stem. thanks daniel <b>RECOMM:</b> the valve stem is under the dollar amount, di approval not required, and tires do not require di approval. thanks, Scott
AIR LOSS	NOT LISTED		APPROVED			LLOMBAR1 ,,		<b>CONCER:</b> C/S WHILE DRIVING, THE CAR PULLED TO THE RIGHT AND STARTED WOBBLING. HAD TO DRIVE TO A SPOT WHERE HE COULD PULL OVER. WHEN HE PULLED OVER, HE NOTICED THERE WAS NO VALVE STEM IN THE WHEEL. REQUEST NEW VALVE STEM AND NEW TIRE 225/50/17 MICHELLIN <b>RECOMM:</b> Warranty denied to replace tire and stem. This is caused from driving on the tire while flat. I reviewed claim with my team leader, George. thx Loretta 6-6-08 <b>REPAIR:</b> DENIAL OVERTURNED TO APPORVED DUE TO VALVE STEM FAILURE, REVIEWED WITHGROUP LEADER (BRYCE KIRCHIES) APPROVED P87N9 WAS ISSUED TO JAREDS PARTNER JERRY AT DEALERSHIP
AIR LOSS			Approved - I			SYERK		<b>CONCER:</b> while driving on freeway tire went flat due to valve stem failure tire was damaged while coming to safe stop, tech inspected found no signs of road hazard, request approval to replace tire thank you daniel right front tire <b>RECOMM:</b> please specify which tire. frt, rear, rt or lt. thanks, scott warranty approved to replace the rt frt tire and valve stem. the valvestem will be called back for engineering study, please removed with great care as to keep the valve stem intact, if not able to do so please keep all pieces. thanks, Scott
TIRE FAILURE	VALVE STEM		Approved - I			BKIRCHEI ,		<b>CONCER:</b> valve stem leaking, customer did not know tire low on air and drove onit damage side wall , need tire <b>RECOMM:</b> Approved to replace the valve stem and tire. Engineering would like the valve stem back for take study, please remove it carfully. A 700 tag will be issued for the tire and valve stem. Thanks Bryce
AIR LOSS	SLOW LEAK		Processed			TZELECKI		<b>CONCER:</b> CUSTOMER STATES TIRE LEAKING AIR AT VALVE STEM AREA AND HAS GONE FLAT.VALVE STEM ON RT REAR TIRE AGE CRACKED AND LEAKING. SUGGESTED REPAIR,REPLACE VALVE STEM. <b>RECOMM:</b> Renee, Valve stems are not on the component list, and parts and loaborare under dealer you may continue with repairs. Thanks Tom
TIRE FAILURE	VALVE STEM		Approved - I			LLOMBAR1 ,		<b>CONCER:</b> RIGHT FRONT TIRE VALVE STEM, CRACKING. LOST ALL THE AIR FOR THAT TIRE WENT FLAT, DAMAGED SIDE WALL. TWO OTHER VALVE STEMS CRACKING, NEED TO REPLACE ONE TIRE AND REMAINING VALVE STEMS. <b>RECOMM:</b> approval to replace right front tire and 2 valve stems. cracking. PHOTOS ARE VERY BLURRY. FOR CLAREST CLOSE UP, Try taking a step back,use close up function and let camera auto focus, press shutter button 1/2 way down, let camera focus then take pic. thx Loretta 7-3-08
TIRE FAILURE	VALVE STEM		VALVE STE			GBUSH5		<b>REPAIR:</b> CHECKED L/R,R/F AND R/R VALVE STEM CRACKED AND LEAKING AIR RECOMMEND TO REPLACE 3 OF THE FOUR VALVE STEMS <b>RECOMM:</b> REPLACE ALL 4 VALVE STEMS.
TIRE FAILURE	BLOWOUT		Denied			MSAMPLE1 ,		<b>CONCER:</b> CUSTOMER STATES POSSIBLE VALVE STEMS WERE LEAKING CAUSING THE TIRE TO LEAK THE AIR PRESSURE DOWN AND DAMAGING THE TIRES. SIDE WALLS HAD BLOWN OUT. CUSTOMER REQUEST REPLACEMENT TIRES AND OR REFUND FOR THE TIRES THEY REPLACED. ALL 4. THANKS ANN R. <b>RECOMM:</b> Warranty denied to replace all four tires. Based on the provided images, this is the result of damage.

Rpt Nbr	PGM	Rpt Date	Prod Date	War Strt Date	P&A Code	Dealer Name	Caller Name (first, last)	Dealer Phone Number	Claim Number	Year	Vin	Veh Fam	Mileage	Veh	Engine	Sym Code	Cat	Q1	Q2	Q3	Symptom Verified	Intermittent Concern	ABA component swap verification	Addl Sym	Part Nbr	Causal	CDSID	Image	Comments
7KEAB010	HD	20071105	20061218	20070301	02934	Roy O'Brien, Inc.	Jack,Onofrey	(586) 776-7600	426222	2007	1FMYU03Z17K	MR	16809	ESCAP2	2.3L 4V	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Processed			MPOPEJ02		<b>CONCER:</b> left frt., right frt., and right rear tire valve cores are cracking at the base of the cores. replace def. cores <b>RECOMM:</b> DI prior approval not needed for tire valve stems. Thanks, Mark P.
8B3AD178	HD	20080229	20061222	20070530	04584	Champion Ford	Steve,McAliley	(361) 994-6200	429955	2007	1ZVFT82H27	MS	10761	MUST	MOD 4.6L	306200	CHASS.	TIRES/WHEELS	AIR LOSS				Processed			SYERK		<b>CONCER:</b> CUST.STATES VALVE STEEMS ARE DRYROTTED. ONE BLEW OUT CAUSING A FLAT ON THE INTERSTATE DAMAGEING THE TIRE <b>RECOMM:</b> valve stems and tires do not require di approval. thanks, scott	
8C1AC013	HD	20080327	20070413	20070601	04843	Maroone Ford of Fort Lauderdale	brian,stahl	(954) 564-3221	25690	2007	1ZVFT82H8	MS	10348	MUST	MOD 4.6L	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Processed			LLOMBAR1		<b>CONCER:</b> All four wheels, valve stems are dry rotting and cracked resultine in air loss from tire. Passenger side rear tire suddenly lost pressure while customer was on highway, resulting in destruction of tire. Remedy is replacement of all four valve stems, replacement of passenger side rear tire. <b>RECOMM:</b> Tires are not yet on the DI program. Thx Loretta 3-27-08
8C1AC137	HD	20080327	20070226	20070531	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38006	2007	1FTRF12237	FL	8702	F150X2	4.2L EFI	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Approved - PAA3W			SYERK		<b>CONCER:</b> ALL FOUR VALVE STEAMS ARE CUT AND LEAKING AIR <b>RECOMM:</b> must have clear and focused close up images and the required overall images of all four valve stems. thanks, Scott warranty approved to replace all four wheel valve stems. thanks, scott
8DJAH140	HD	20080410	20070220	20070502	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38205	2007	2FMDK39C8	EA	6021	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Processed			JTOLBE17		<b>CONCER:</b> All four tire stems are cracked. Left front leaking air. Request replacement of all stems. <b>RECOMM:</b> You can not use warranty to replace parts to prevent future possible failures per Warranty and Policies. So, the left front valve stem can be replaced but does not need approval because it is under the part and labor limits. Thanks, Jerry
8DXAN074	HD	20080424	20070201	20070314	09555	Gulf Breeze Ford	Debbi,Helm	(850) 934-8366	38399	2007	1FMFK17537	EN	19016	EXPDX2	MOD 5.4 3V	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Approved - PAA7Z			SYERK		<b>CONCER:</b> Right rear and left front tire stems cracked and leaking. Customer had left rear stem replaced 1/12/08 at Tires Plus because flat occurred traveling out of town and no dealership was available. Right front tire sustained damage due to flat caused by leak in stem this past Sunday. Again customer was traveling out of town and no dealership was available for repair. Request RR and LF stem replacement and new tire. Also may need new tire sensor if
8EFBT306	HD	20080506	20061220	20070127	01203	Fred Beans Ford-Lincoln-Mercur	Bruce,Paynter	(215) 348-2900	494352	2007	1ZVHT82H27	MS	15044	MUST	MOD 4.6L	306700	CHASS.	TIRES/WHEELS	APPEARANCE				Approved - PAARZ			GBUSH5		<b>CONCER:</b> customer request to replace cracking valve stems, tech verified cracking on all 4 stems, no visible rub marks on stems or signs of damage,customer no longer waiting <b>RECOMM:</b> approved to replace 4 valve stems. thanks gary	
8EMAR096	HD	20080513	20070118	20070216	05439	Fiesta Ford, Inc.	Daniel,Henderson	(760) 772-8000	62414	2007	3FAHP07Z57	ZM	3110	FUSION	2.3L4V EFI	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK				Processed			SYERK		<b>CONCER:</b> cust states while driving right side rear tire went flat and was damaged while coming to a stop, dis-mounted tire to inspect for road hazard, none found, found valve stem cracked and leaking, request appto replace (1) tire due to failed valve stem. thanks daniel <b>RECOMM:</b> the valve stem is under the dollar amount, di approval not required, and tires do not require di approval. thanks, Scott

8FFAE233	HD	20080606	20070117	20070327	20337	Holmes Tuttle Ford, Lincoln-Me	JARAD,CHAPPUE	(520) 292-3675	711258	2007	3LNHM26T27R	ZM	5704	ZEPMKZ	DURATEC 35	306299	CHASS.	TIRES/WHEELS	AIR LOSS	NOT LISTED							APPROVED TIRE			LLOMBARI		<b>CONCER:</b> C/S WHILE DRIVING, THE CAR PULLED TO THE RIGHT AND STARTED WOBBLING. HAD TO DRIVE TO A SPOT WHERE HE COULD PULL OVER. WHEN HE PULLED OVER, HE NOTICED THERE WAS NO VALVE STEM IN THE WHEEL. REQUEST NEW VALVE STEM AND NEW TIRE 225/50/17 MICHELLIN <b>RECOMM:</b> Warranty denied to replace tire and stem. This is caused from driving on the tire while flat. I reviewed claim with my team leader, George. thx Loretta 6-6-08 <b>REPAIR:</b> DENIAL
8FKBD563	HD	20080611	20070309	20070514	05439	Fiesta Ford, Inc.	Daniel,Henderson	(760) 772-8000	64744	2007	2MHM75V97X	RC	2724	GRDMRQ	4.6 SOHC F	306200	CHASS.	TIRES/WHEELS	AIR LOSS								Approved - PAA3X			SYERK		<b>CONCER:</b> while driving on freeway tire went flat due to valve stem failure tire was damaged while coming to safe stop, tech inspected found no signs of road hazard, request approval to replace tire thank you daniel right front tire <b>RECOMM:</b> please specify which tire. frt, rear, rt or lt. thanks. scott warranty approved to replace the rt frt tire and valve stem. the valvestem will be called back for engineering study, please removed with great care as to keep the valve stem intact, if not able to do so please keep all pieces. thanks, Scott
8FQCL033	HD	20080617	20061219	20070312	05439	Fiesta Ford, Inc.	Tracy,Lowry	(760) 772-8000	65114	2007	1FAPP31N17W	FC	9725	FOCUS N	2.0L 4V	306609	CHASS.	TIRES/WHEELS	TIRE FAILURE	VALVE STEM							Approved - PAAAV			BKIRCHE		<b>CONCER:</b> valve stem leaking, customer did not know tire low on air and drove on it damage side wall . need tire <b>RECOMM:</b> Approved to replace the valve stem and tire. Engineering would like the valve stem back for study, please remove it carefully. A 700 tag will be issued for the tire and valve stem. Thanks Bryce
8G4A5331	HD	20080730	20070124	20070327	04160	Brinson Ford Lincoln-Mercury o	Renee,Schedule	(903) 676-5200	39163	2007	2FMKD38C37B	EA	26469	EDGE	DURATEC 35	306201	CHASS.	TIRES/WHEELS	AIR LOSS	SLOW LEAK							Processed			TZELECKI	 C:\CQ15\8G4A5331.jpg	<b>CONCER:</b> CUSTOMER STATES TIRE LEAKING AIR AT VALVE STEM AREA AND HAS GONE FLAT.VALVE STEM ON RT REAR TIRE AGE CRACKED AND LEAKING. SUGGESTED REPAIR,REPLACE VALVE STEM. <b>RECOMM:</b> Renee, Valve stems are not on the component list, and parts and labor are under dealer cap. you may continue with repairs. Thanks Tom
8GCB5172	HD	20080703	20061206	20070106	02938	Palm Bay Ford, Inc.	DARRYL,SUTPHIN	(321) 722-9000	184970	2007	1FTPX12V27N	FL	18038	F150X2	5.4L 3V FF	306609	CHASS.	TIRES/WHEELS	TIRE FAILURE	VALVE STEM							Approved - PAAKR			LLOMBARI		<b>CONCER:</b> RIGHT FRONT TIRE VALVE STEM, CRACKING. LOST ALL THE AIR FOR THAT TIRE WENT FLAT, DAMAGED SIDE WALL. TWO OTHER VALVE STEMS CRACKING, NEED TO REPLACE ONE TIRE AND REMAINING VALVE STEMS. <b>RECOMM:</b> approval to replace right front tire and 2 valve stems. cracking. PHOTOS ARE VERY BLURRY. FOR CLEAREST CLOSE UP, Try taking a step back,use close up function and let camera auto focus. press shutter button 1/2 way down, let camera focus then take pic. thx Loretta 7-3-08
8IDBH176	HD	20080904	20061207	20061207	04808	Kelly Ford	JIM,WILLARD	(321) 254-4283	148635	2007	1FMCU02Z77K B95764	MR	20599	ESCAP2	2.3L 4V	306609	CHASS.	TIRES/WHEELS	TIRE FAILURE	VALVE STEM						VALVE STEM SPLIT IN RUBBER			GBUSH5	 C:\CQ15\8IDBH176.jpg	<b>REPAIR:</b> CHECKED L/R,R/F AND R/R VALVE STEM CRACKED AND LEAKING AIR RECOMMEND TO REPLACE 3 OF THE FOUR VALVE STEMS <b>RECOMM:</b> REPLACE ALL 4 VALVE STEMS.	

8IB1158	HD	20080909	20070215	20070502	02549	Silsbee Ford Lincoln Mercury.	Syvella, Rees e	(409) 385- 3724	200810	2007	2MEFM75V87X [REDACTED]	RC	14152	GRDMR Q	4.6 SOHC F	306602	CHASS.	TIRES/W HEELS	TIRE FAILU RE	BLOW OUT					Denied			MSAMPL E1	<b>CONCER:</b> CUSTOMER STATES POSSIBLE VALVE STEMS WERE LEAKING CAUSING THE TIRE TO LEAK THE AIR PRESSURE DOWN AND DAMAGING THE TIRES. SIDE WALLS HAD BLOWN OUT. CUSTOMER REQUEST REPLACEMENT TIRES AND OR REFUND FOR THE TIRES THEY REPLACED. ALL 4. THANKS ANN R. <b>RECOMM:</b> Warranty denied to replace all four tires. Based on the provided images, this is the result of damage.
---------	----	----------	----------	----------	-------	--	--------------------	--------------------	--------	------	---------------------------	----	-------	------------	---------------	--------	--------	------------------	---------------------	-------------	--	--	--	--	--------	--	--	--------------	--

2FMMDK38C37BA

**RINSON**  
Ford  
Lincoln · Mercury  
Corsicana


THENS, TX 75751  
FAX (903) 676-5201  
RENDER  
IN/OUT

IN/OUT	TAG
TT003	
IV. DATE	



07/22/2008 04:21 PM

2MHHM75V97X

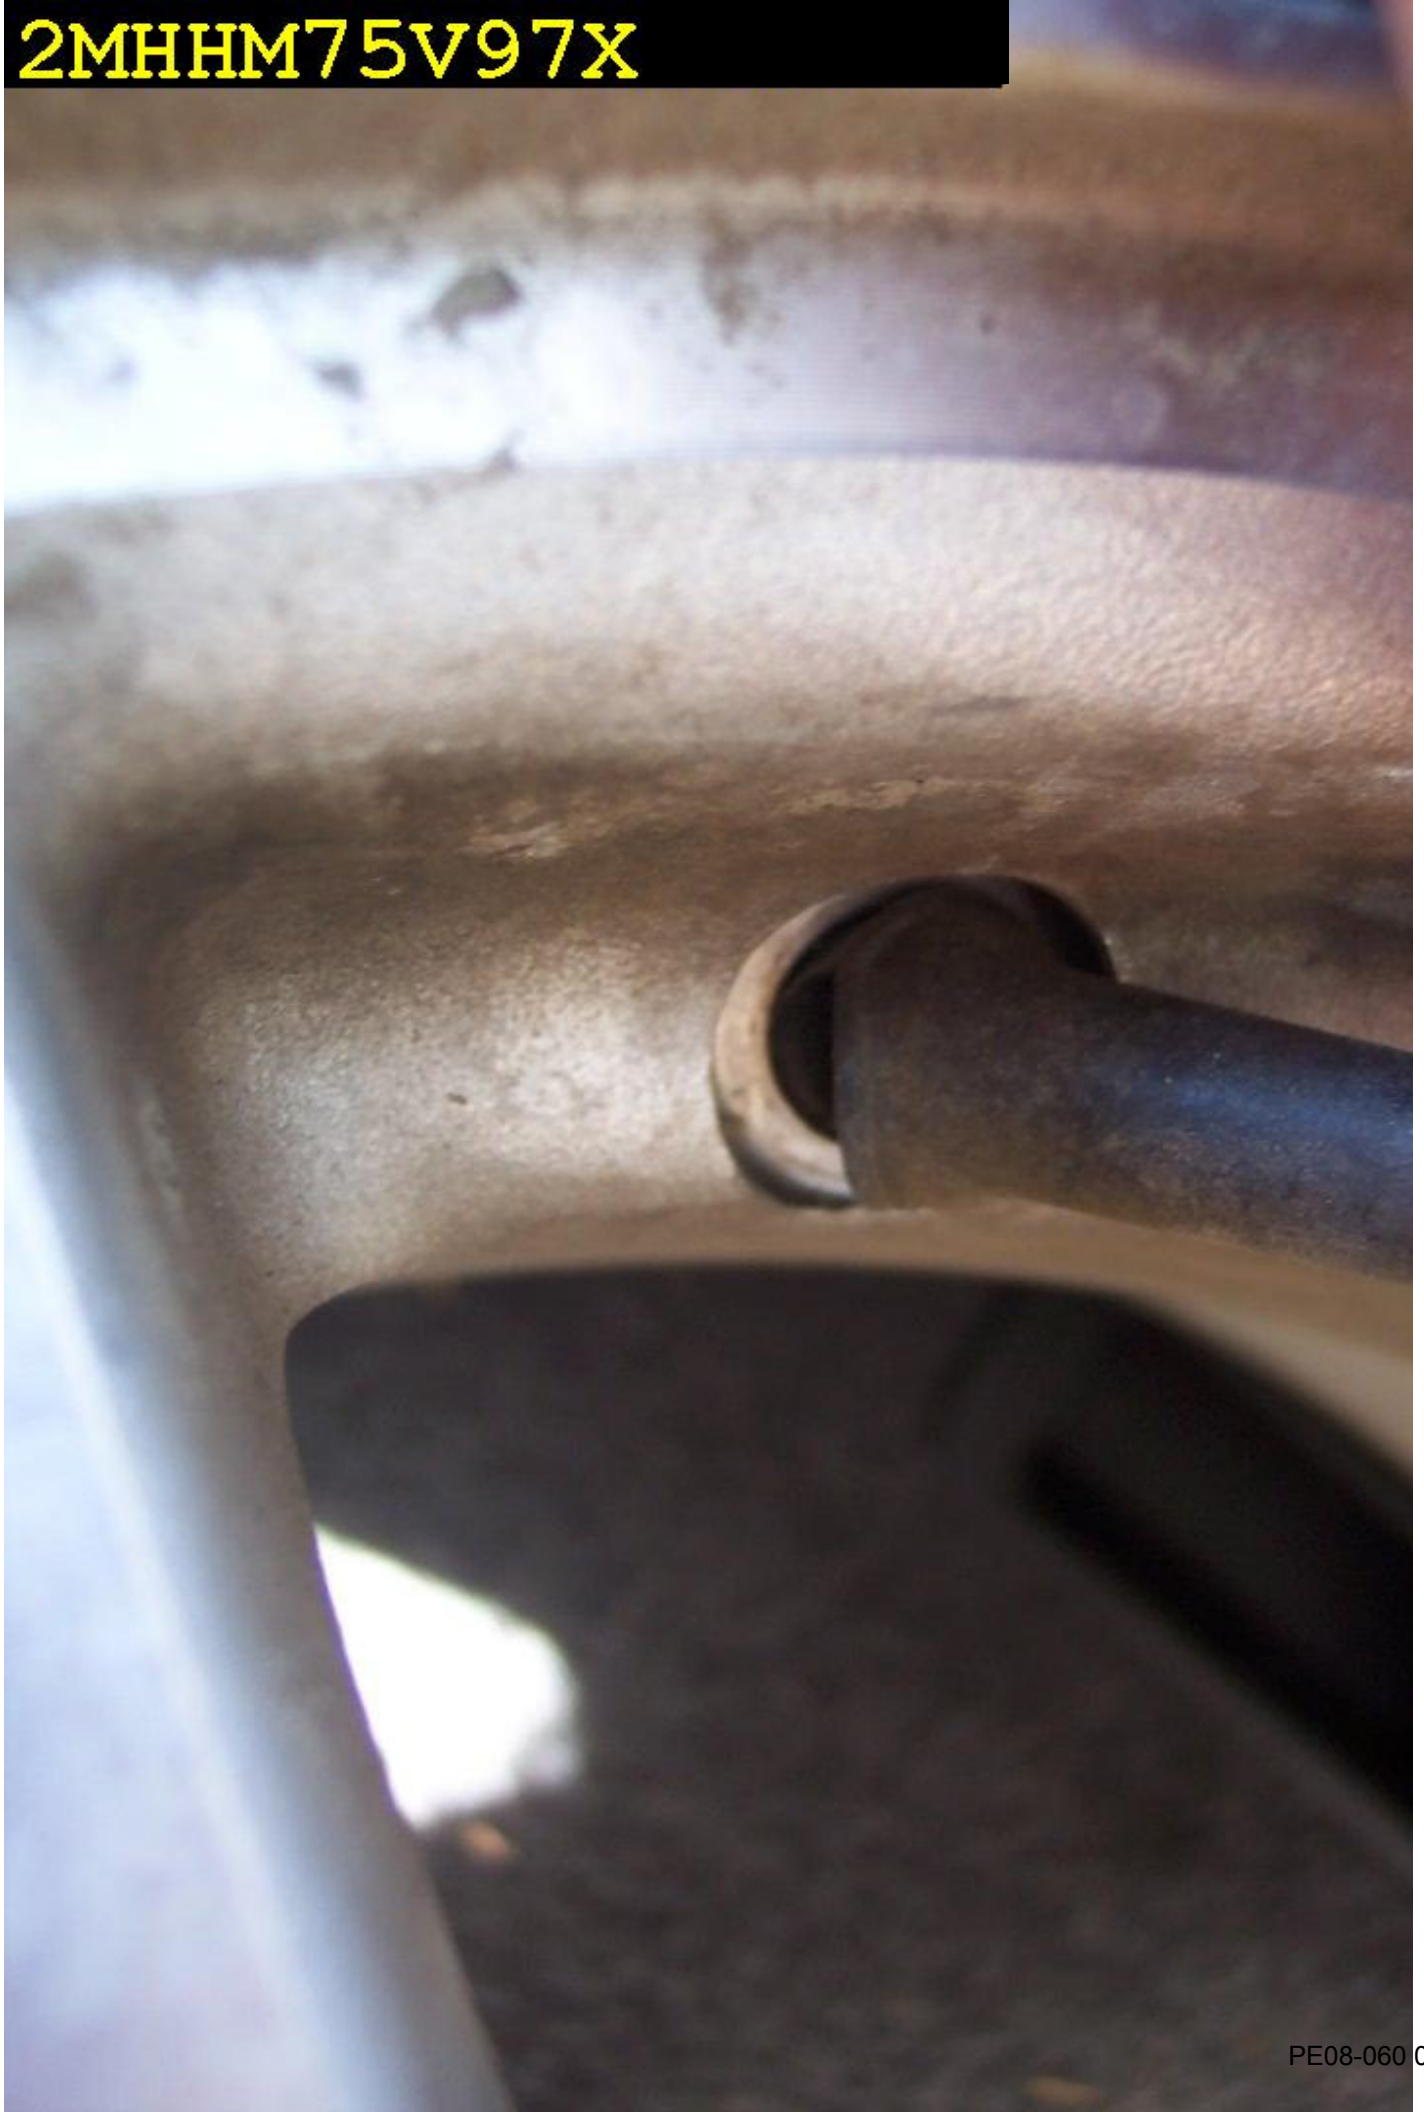

3EAPH07Z57E



1ZVHT82H275



1EMERK1 7537I.



2EMDK39C87B



1ZVE1T82H875



1ZVE1T82H275



1FMCU02277K



PIECE 2  
2 PLY POLYESTER

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Monday, May 19, 2008 9:05 AM  
**To:** Arning, Ralph (R.); Querio, Jennifer (J.)  
**Subject:** Valve stems 1ZVHT82H275 [REDACTED]

FYI

This request was for cracking valve stems. The customer ended up paying for the repair, there are no parts available. We did provide approval, I am not sure why they did not use it.

*Bryce Kircheis*

Group Leader  
Ford Digital Imaging  
6 Sigma Center  
15080 Commerce Dr. N  
Dearborn MI, 48120  
313-206-2017

---

**From:** Witczak, Rich (R.A.) **On Behalf Of** Pears, W (W.)  
**Sent:** Friday, May 16, 2008 3:58 PM  
**To:** Kircheis, Bryce (A.)  
**Subject:** FW: New Model Warranty Parts

FYI

---

**From:** Irwin Brainerd [mailto:[ibrainerd@venchurs.com](mailto:ibrainerd@venchurs.com)]  
**Sent:** Friday, May 16, 2008 3:55 PM  
**To:** Pears, W (W.); Greg Hagen; Jacob Eberhard  
**Subject:** RE: New Model Warranty Parts

Hello:

I called the collision center and found out the repair was paid by the owner of the vehicle no warranty RO is open for the part being requested back. It looks as though there is no part to return.

Thank you,  
**Irwin Brainerd**  
**Venchurs, inc.**  
Operations Technical Support  
[ibrainerd@venchurs.com](mailto:ibrainerd@venchurs.com)  
Phone: 517-266-5781  
Cell 517-270-2573  
Fax: 517-266-1856



---

**From:** Witczak, Rich (R.A.) [mailto:rwitczak@ford.com] **On Behalf Of** Pears, W (W.)  
**Sent:** Friday, May 09, 2008 3:26 PM  
**To:** Greg Hagen; Irwin Brainerd; Jacob Eberhard  
**Subject:** FW: New Model Warranty Parts

---

**From:** wpacwh@ford.com [mailto:wpacwh@ford.com]  
**Sent:** Friday, May 09, 2008 12:00 PM  
**To:** Pears, W (W.)  
**Subject:** New Model Warranty Parts

## Urgent Request/Shipping Authorization Form Warranty Parts

***This form authorizes the dealer to ship the Warranty part listed below directly to the address given (Do Not hold for PEARS disposition direction.) Reason Part is needed:***

The listed component is being requested for analysis to investigate the cause of failure. The analysis is **critical** for ongoing quality and your rapid response will support possible future **quality improvements**.

### Part needed

Does dealer still have part?  
Transportation method SHIP  
by Who? Bryce Kircheis/2062017 Estimated P/U Date:  
**Note: The Bill of lading must be signed at dealership to take possession of the part.**  
Service Part#: 5L3Z-1700-A  
Engineering Part#: 5L341700AA  
Quantity: 4  
Date Ordered(MM/DD/YYYY): 05/09/2008  
V.I.N#: 1ZVHT82H279 [REDACTED]  
Model Year: 2007  
Vehicle Type: Car  
Repair Order#: 494352  
Plant Name: 6-Sigma Center  
Requested By: bkirchei/Bryce Kircheis (2062017)

### Repairing Dealership Information

Dealer P&A Code: 01203  
Dealer Name: FRED BEANS COLLISION CENTER  
Dealer Phone#/Fax# 215-348-2900 / --  
Dealer Email  
Dealer Contact Name: BRUCE PAYNTER

### Directions for Dealership

1. **Complete repair and prepare part to be shipped.**
2. **Place a copy of this form in a clear plastic bag and attach to the part.**
3. **Contact carrier listed below to arrange for shipping as soon as possible.**


Ship to Address:	Attn: PVT/Shop Office (3232381) Auto Alliance Attn: Lin Jeff (J.H.) 1 International Drive Flat Rock, MI, 48134
Method of shipment:	<input type="checkbox"/> Air <input type="checkbox"/> 2nd Day <input checked="" type="checkbox"/> Ground
Carrier Name:	_____
Carrier Phone number:	____ - ____ - _____

4. **Ship component and a copy of the Urgent Auth form. Save original and signed shipping paperwork.**
5. **Fax a copy of this form and signed Bill of Lading including TRACKING # to Nuestro at 517-266-1856.**
6. **Place copy of this form and signed Bill of Lading in warranty parts hold area (hold like you would a warranty component)**
7. **When 700 tag is generated print and attach on top of this form. (Continue to hold in designated warranty hold area.)**
8. **RCRC driver will scan 700 tag. Retain paperwork for your records. DO NOT SHIP PAPERWORK!**
9. **Core credit will be paid through the standard process. \*\*Note: If you do not receive an 700 tag for this part, and you are due a core credit for this part, you must call Nuestro to insure core credit is issued.\*\***

**For questions or concerns call: IRWIN BRAINARD (517) 266-5781**

Ford Motor Company's claim submission and appeal policies apply as published in section 5 of the Warranty and Policy Manual including Hot process "core" credit for those units that do not generate a 700 tag.


Valve Stem AWS Claims Vs TIS - July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

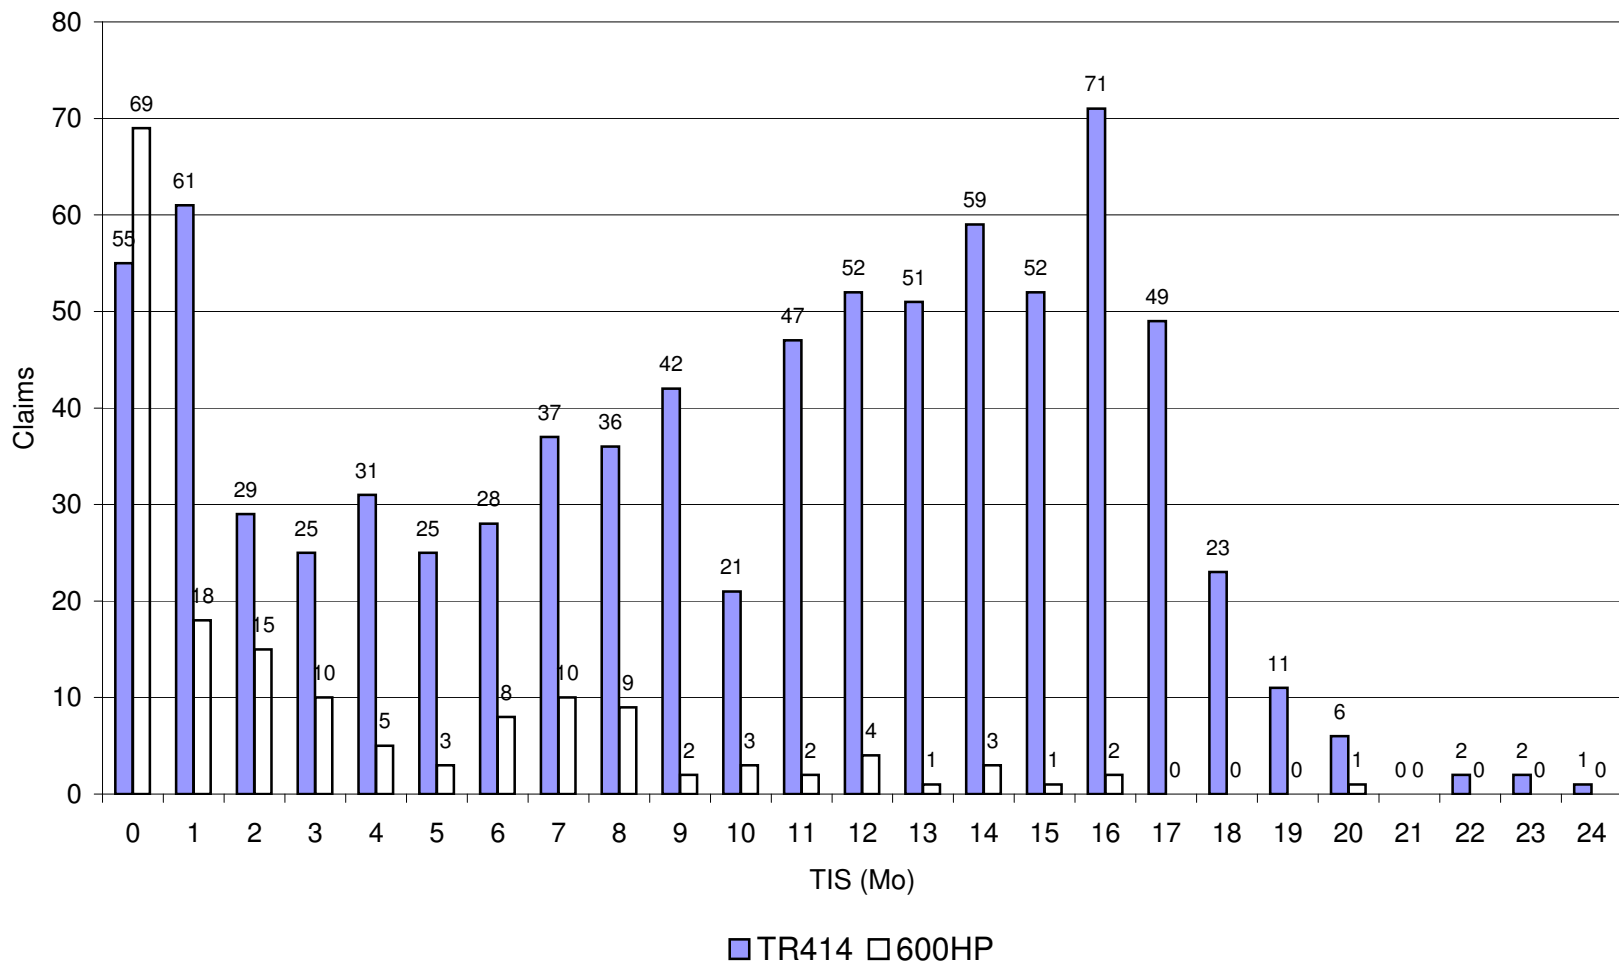


Valve Stem AWS Claims Vs TIS - July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

TIS	Fusion/Milan/ MKZ	F150	Escape	Expedition/N av.	Focus	Explorer	Crwn Vic/Town Car	Taurus/Sable /Freestyle	Ranger	Mustang	Econoline	F250/350 SRW	TR414	600HP
0	12	7	5	2	2	2	8	4	4	9	4	65	55	69
1	23	10	5	0	5	0	9	5	2	2	1	17	61	18
2	5	6	2	2	3	1	4	1	0	5	0	15	29	15
3	5	3	2	2	4	0	3	3	0	3	1	9	25	10
4	6	4	4	2	3	0	6	3	0	3	0	5	31	5
5	5	6	3	1	1	3	1	0	1	4	0	3	25	3
6	3	4	4	0	1	1	4	4	1	6	1	7	28	8
7	5	3	3	2	1	5	6	4	2	6	1	9	37	10
8	8	5	2	0	3	3	6	1	1	7	0	9	36	9
9	4	13	3	2	1	0	5	1	1	12	0	2	42	2
10	1	10	2	2	0	0	0	0	0	6	1	2	21	3
11	6	10	5	5	1	4	3	1	2	10	0	2	47	2
12	2	20	2	5	2	1	7	1	2	10	0	4	52	4
13	0	18	6	5	2	3	5	1	3	8	0	1	51	1
14	4	18	7	10	1	2	5	0	2	10	0	3	59	3
15	7	13	5	5	0	4	2	0	5	11	0	1	52	1
16	5	26	7	6	2	5	5	1	3	11	0	2	71	2
17	4	12	8	5	1	3	7	0	5	4	0	0	49	0
18	4	9	3	0	1	2	1	0	2	1	0	0	23	0
19	0	3	3	2	2	1	0	0	0	0	0	0	11	0
20	0	0	2	1	1	0	1	0	1	0	0	1	6	1
21	0	0	0	0	0	0	0	0	0	0	0	0	0	0
22	1	0	0	0	0	0	1	0	0	0	0	0	2	0
23	0	0	2	0	0	0	0	0	0	0	0	0	2	0
24	0	0	0	0	0	0	1	0	0	0	0	0	1	0
	110	200	85	59	37	40	90	30	37	128	9	157		


Valve Stem AWS Claims by Vehicle Line Vs TIS- July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

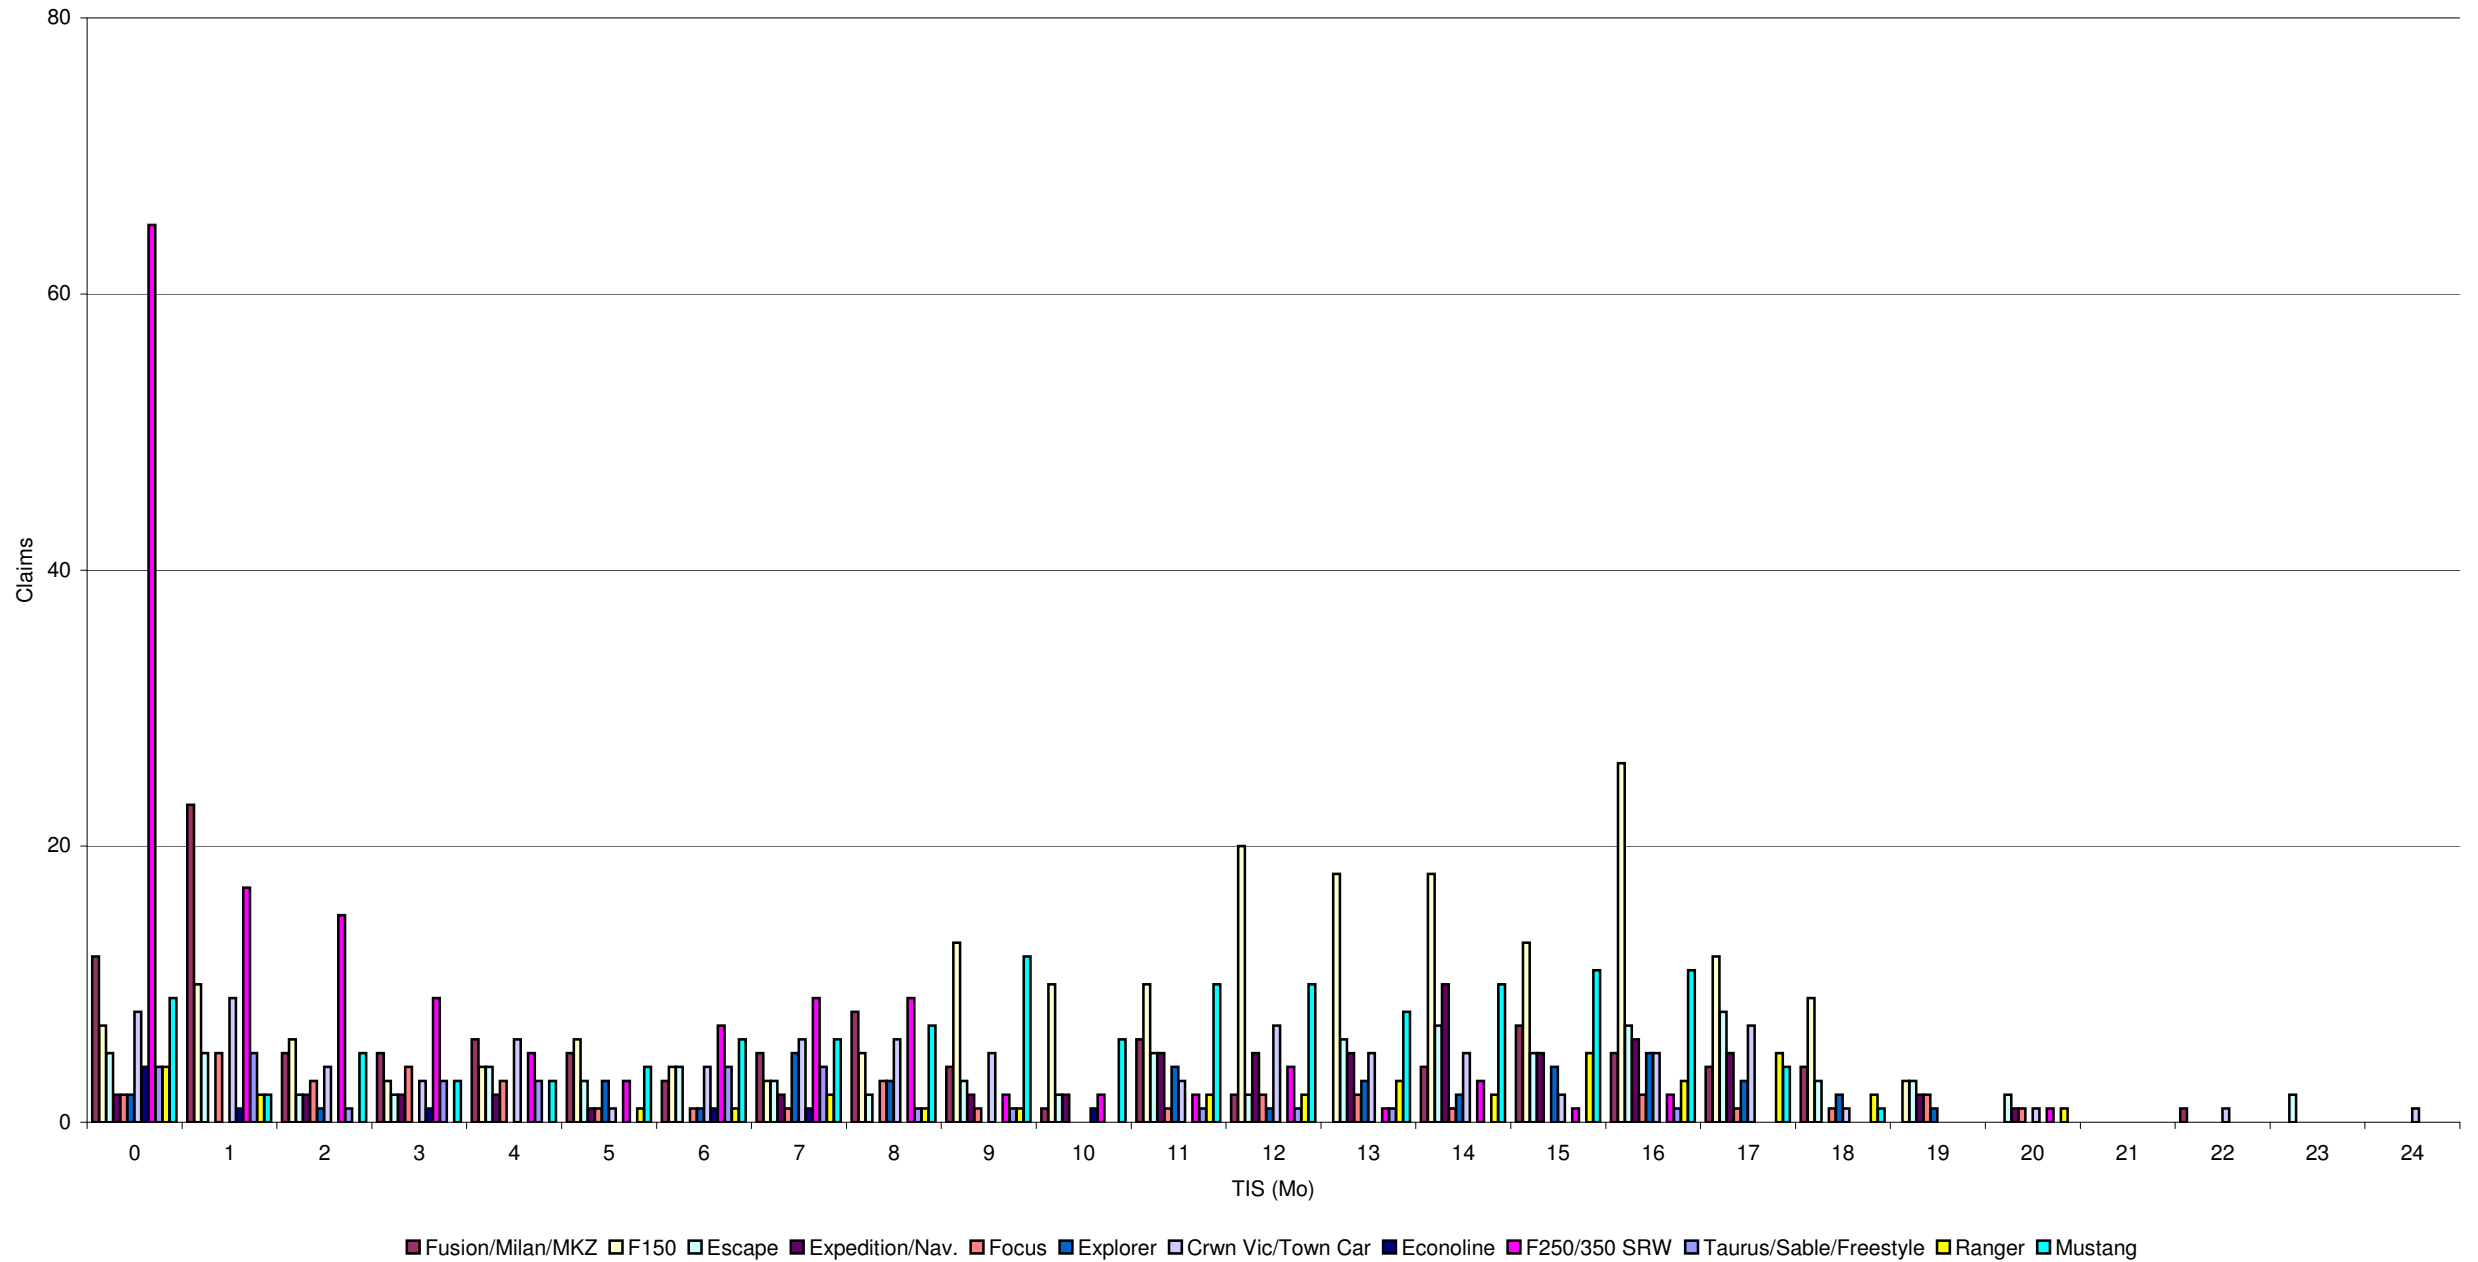

Valve Stem Warranty Claims by State - July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

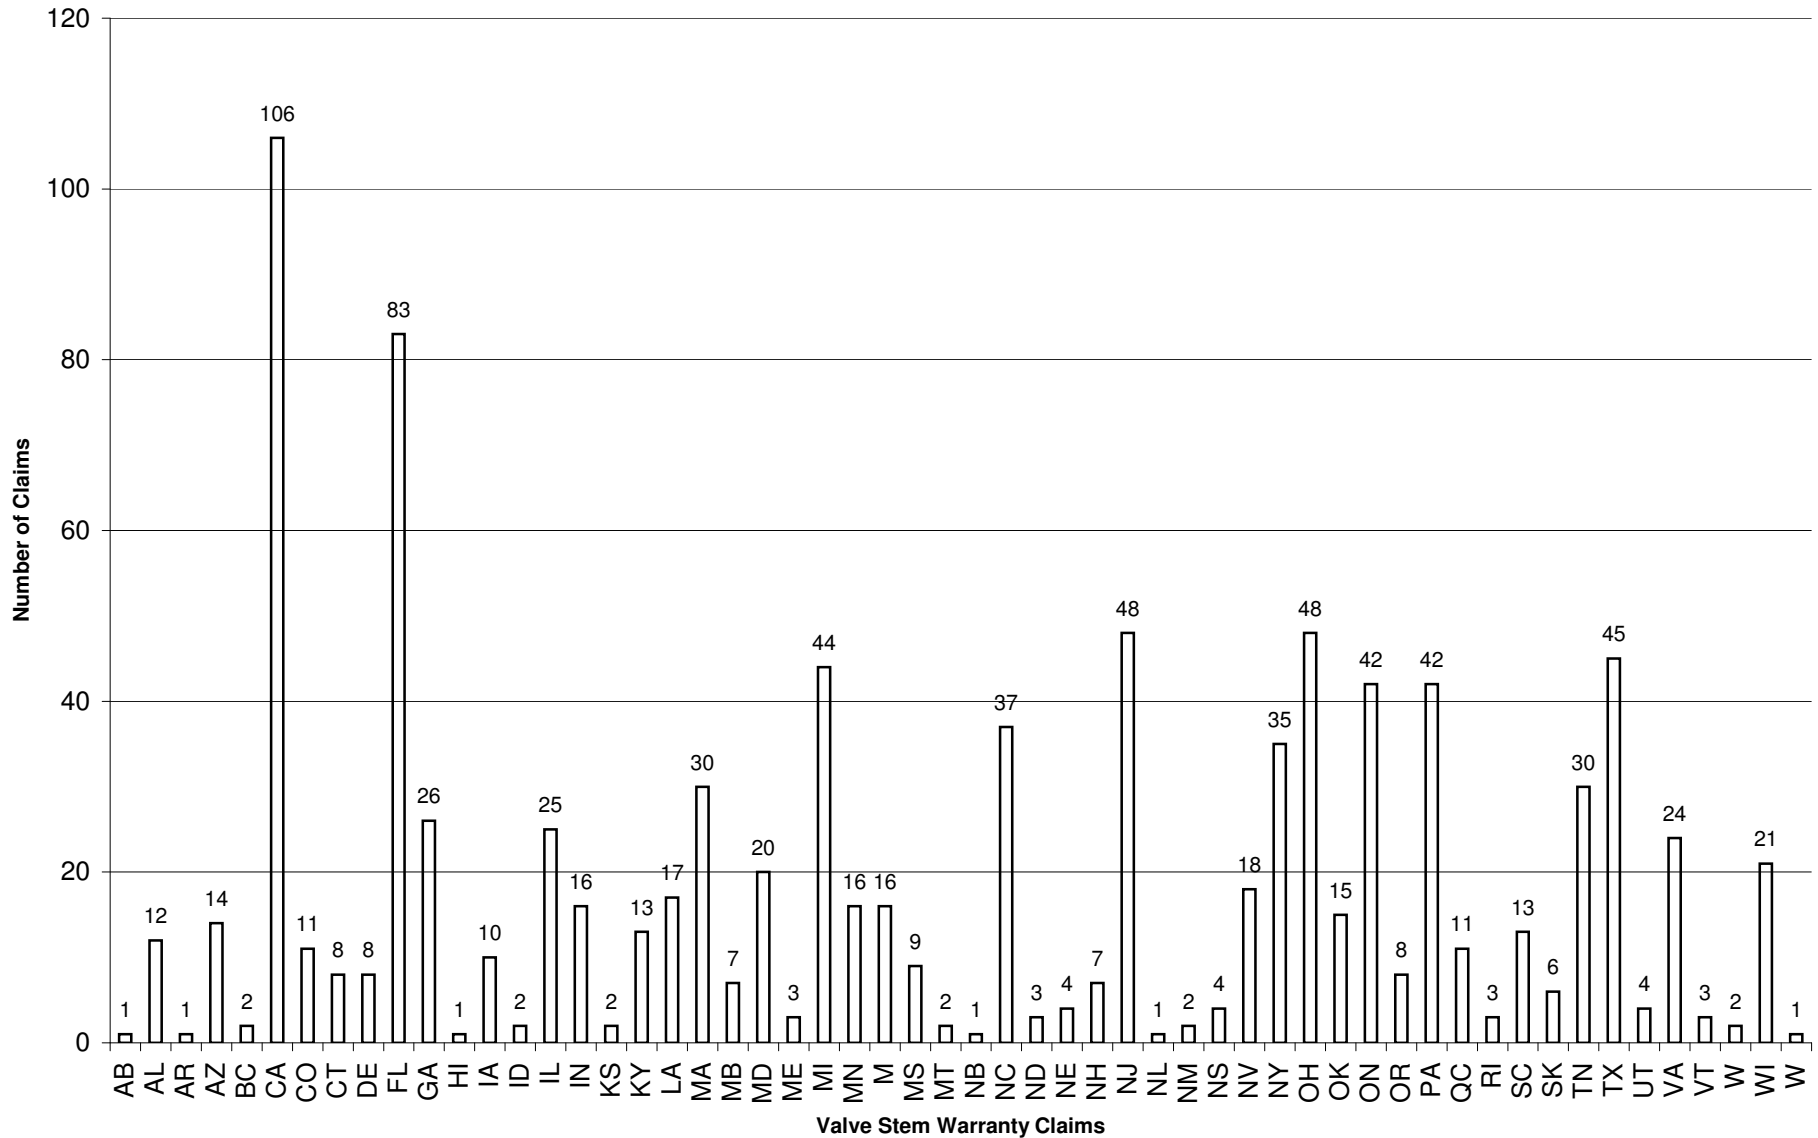

Valve Stem Warranty Claims by Vehicle Line by State -July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

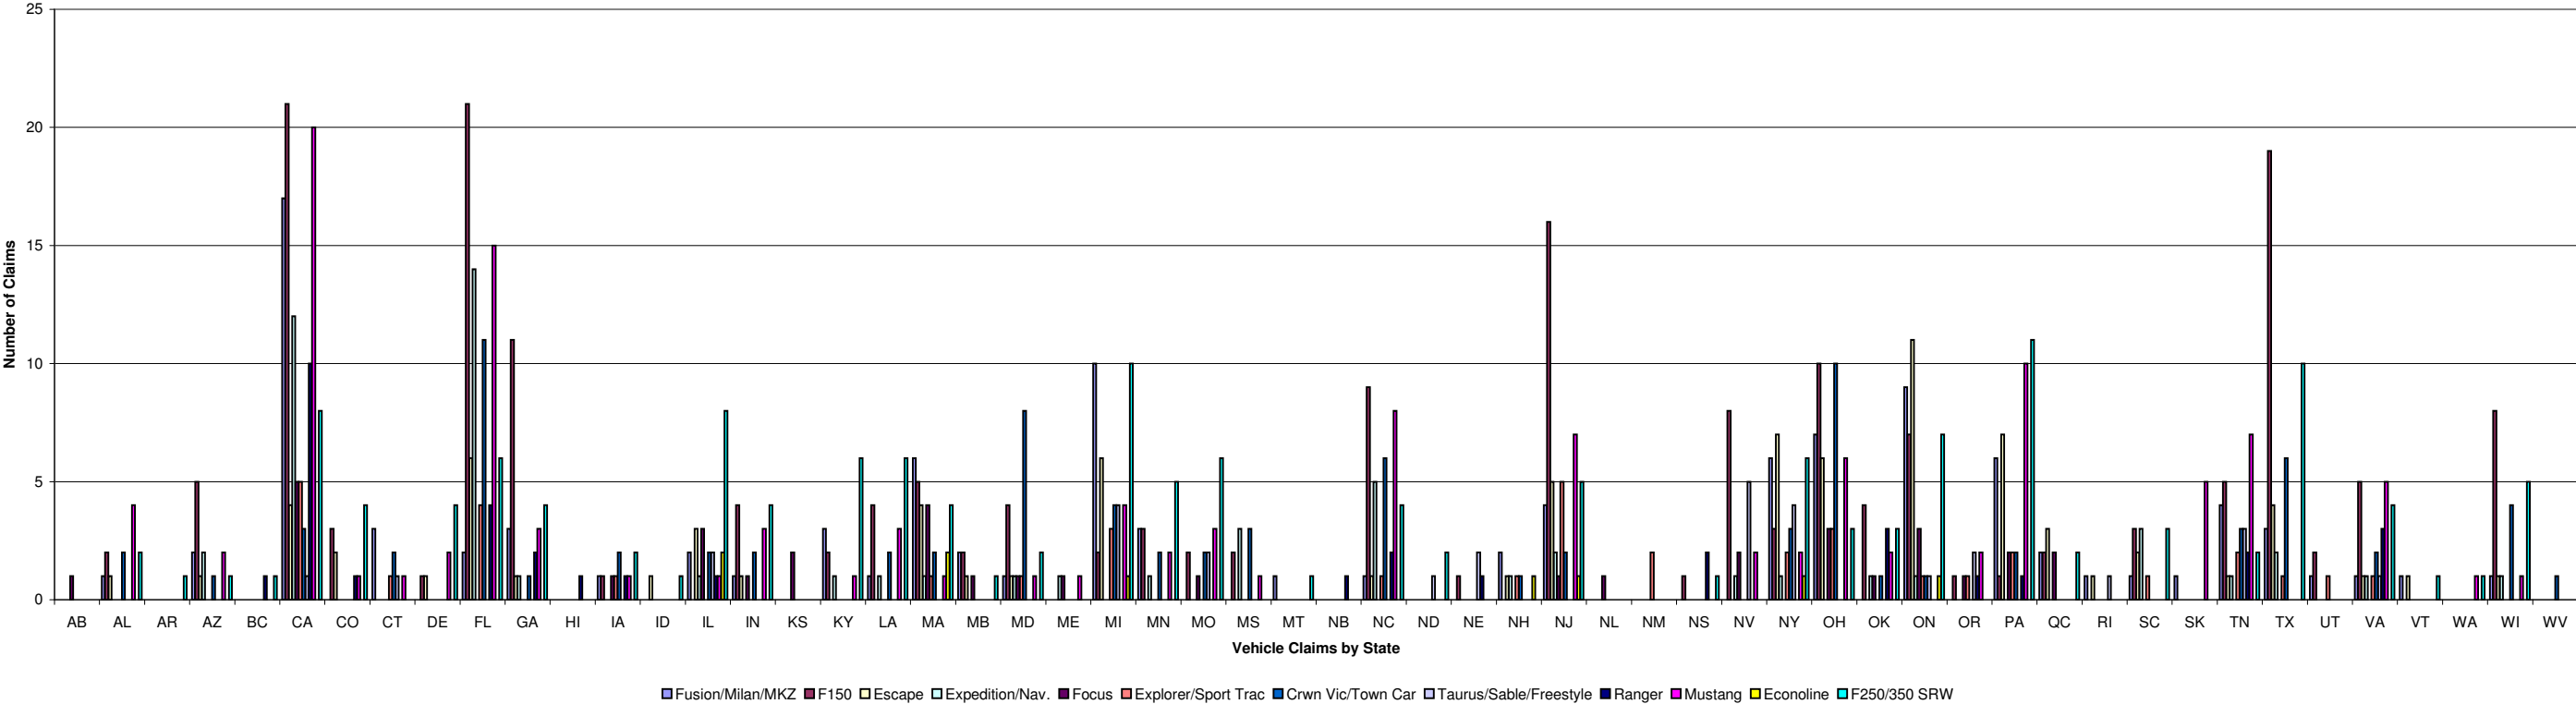


Valve Stem Warranty Claims by Vehicle Line by State - July 2006 Thru July 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

State/Prov	Fusion/Milan/ MKZ	F150	Escape	Expedition/N av.	Focus	Explorer/Spor t Trac	Crwn Vic/Town Car	Taurus/Sable /Freestyle	Ranger	Mustang	Econoline	F250/350 SRW	Total Claims
AB	0	0	0	0	1	0	0	0	0	0	0	0	1
AL	1	2	1	0	0	0	2	0	0	4	0	2	12
AR	0	0	0	0	0	0	0	0	0	0	0	1	1
AZ	2	5	1	2	0	0	1	0	0	2	0	1	14
BC	0	0	0	0	0	0	0	0	1	0	0	1	2
CA	17	21	4	12	5	5	3	1	10	20	0	8	106
CO	0	3	2	0	0	0	0	0	1	1	0	4	11
CT	3	0	0	0	0	1	2	1	0	1	0	0	8
DE	0	1	1	0	0	0	0	0	0	2	0	4	8
FL	2	21	6	14	0	4	11	0	4	15	0	6	83
GA	3	11	1	1	0	0	1	0	2	3	0	4	26
HI	0	0	0	0	0	0	0	0	1	0	0	0	1
IA	1	1	0	0	1	1	2	0	1	1	0	2	10
ID	0	0	1	0	0	0	0	0	0	0	0	1	2
IL	2	0	3	1	3	0	2	2	1	1	2	8	25
IN	1	4	1	0	1	0	2	0	0	3	0	4	16
KS	0	0	0	0	2	0	0	0	0	0	0	0	2
KY	3	2	0	1	0	0	0	0	0	1	0	6	13
LA	1	4	0	1	0	0	2	0	0	3	0	6	17
MA	6	5	4	1	4	1	2	0	1	2	1	4	30
MB	2	2	1	0	1	0	0	0	0	0	0	1	7
MD	1	4	1	1	1	1	8	0	0	1	0	2	20
ME	0	0	0	1	1	0	0	0	0	1	0	0	3
MI	10	2	6	0	0	3	4	4	0	4	1	10	44
MN	3	3	0	1	0	0	2	0	0	2	0	5	16
MO	0	2	0	0	1	0	2	2	0	3	0	6	16
MS	0	2	0	3	0	0	3	0	0	1	0	0	9
MT	1	0	0	0	0	0	0	0	0	0	0	1	2
NB	0	0	0	0	0	0	0	0	1	0	0	0	1
NC	1	9	1	5	0	1	6	0	2	8	0	4	37
ND	0	0	0	0	0	0	0	1	0	0	0	2	3
NE	0	1	0	0	0	0	0	2	1	0	0	0	4
NH	2	0	1	1	0	1	1	0	0	0	1	0	7
NJ	4	16	5	2	1	5	2	0	0	7	1	5	48
NL	0	0	0	0	1	0	0	0	0	0	0	0	1
NM	0	0	0	0	0	2	0	0	0	0	0	0	2
NS	0	1	0	0	0	0	0	0	2	0	0	1	4
NV	0	8	0	1	2	0	0	5	0	2	0	0	18
NY	6	3	7	1	0	2	3	4	0	2	1	6	35
OH	7	10	6	0	3	3	10	0	0	6	0	3	48
OK	0	4	0	1	1	0	1	0	3	2	0	3	15
ON	9	7	11	1	3	1	1	1	0	0	1	7	42
OR	0	1	0	0	1	1	0	2	1	2	0	0	8
PA	6	1	7	0	2	2	2	0	1	10	0	11	42
QC	2	2	3	0	2	0	0	0	0	0	0	2	11
RI	1	0	1	0	0	0	0	1	0	0	0	0	3
SC	1	3	2	3	0	1	0	0	0	0	0	3	13
SK	1	0	0	0	0	0	0	0	0	5	0	0	6
TN	4	5	1	1	0	2	3	3	2	7	0	2	30
TX	3	19	4	2	0	1	6	0	0	0	0	10	45
UT	1	2	0	0	0	1	0	0	0	0	0	0	4
VA	1	5	1	1	0	1	2	1	3	5	0	4	24
VT	1	0	1	0	0	0	0	0	0	0	0	1	3
WA	0	0	0	0	0	0	0	0	0	1	0	1	2
WI	1	8	1	1	0	0	4	0	0	1	0	5	21
WV	0	0	0	0	0	0	1	0	0	0	0	0	1
	110	200	85	59	37	40	91	30	37	128	9	157	



### Valve Stem Warranty Claims by Vehicle Build Date - July 2006 Thru July 2008 Ford North American Vehicle Lines (Except MKX/Edge)


■ Fusion/Milan/MKZ 
 ■ F150 
 ■ Escape 
 ■ Expedition/Nav. 
 ■ Focus 
 ■ Explorer/Sport Trac 
 ■ Crwn Vic/Town Car 
 ■ Econoline 
 ■ F250/350 SRW 
 ■ Taurus/Sable/Freestyle 
 ■ Ranger 
 ■ Mustang

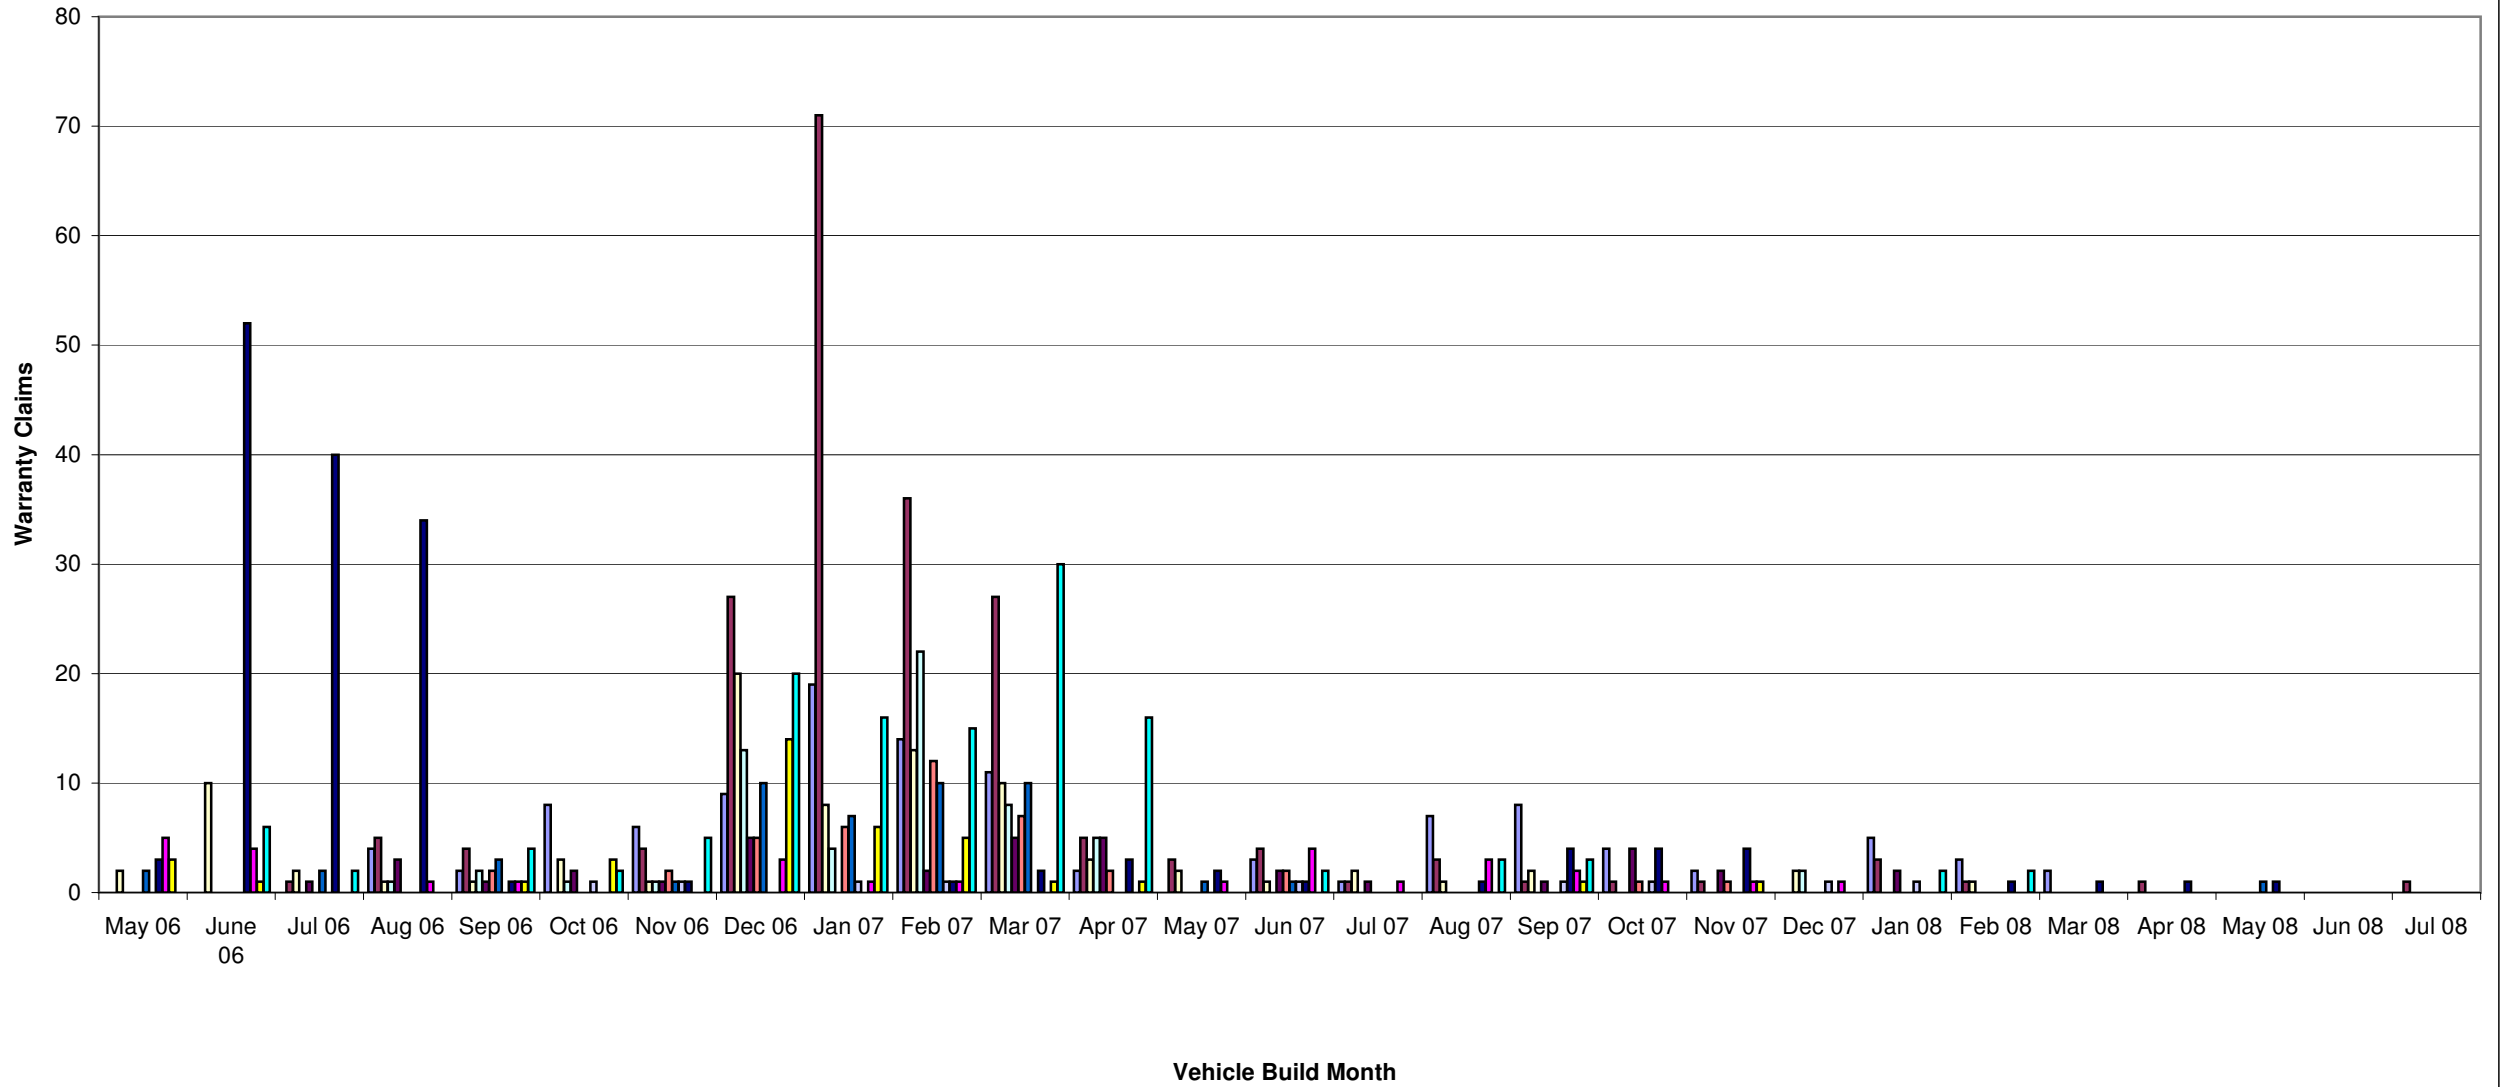

Valve Stem Warranty Claims by Vehicle Build Date - July 2006 Thru July 2008  
Ford North American Vehicle Lines (Except MKX/Edge)

Build Date	Fusion/Milan/ MKZ		F150	Escape	Expedition/N av.		Focus	Explorer/Spo rt Trac		Crwn	Taurus/Sabl e/Freestyle	Ranger	Mustang	Econoline	F250/350		Total Claims
										Vic/Town Car						SRW	
May 06	NA	NA			2 NA			0 NA		2	5	3	0	0		3	15
June 06	NA	NA			10 NA			0 NA		0	4	1	6	0		52	73
Jul 06	0		1		2 NA			1 NA		2	0	0	2	0		40	48
Aug 06	4		5		1	1		3	0	0	1	0	0	0		34	49
Sep 06	2		4		1	2		1	2	3	1	1	4	0		1	22
Oct 06	8		0		3	1		2	0	0	0	3	2	1		0	20
Nov 06	6		4		1	1		1	2	1	0	0	5	1		1	23
Dec 06	9		27		20	13		5	5	10	3	14	20	0		0	126
Jan 07	19		71		8	4		0	6	7	1	6	16	1		0	139
Feb 07	14		36		13	22		2	12	10	1	5	15	1		1	132
Mar 07	11		27		10	8		5	7	10	0	1	30	0		2	111
Apr 07	2		5		3	5		5	2	0	0	1	16	0		3	42
May 07	0		3		2	0		0	0	1	1	0	0	0		2	9
Jun 07	3		4		1	0		2	2	1	4	0	2	1		1	21
Jul 07	1		1		2	0		1	0	0	1	0	0	0		0	6
Aug 07	7		3		1	0		0	0	0	3	0	3	0		1	18
Sep 07	8		1		2	0		1	0	0	2	1	3	1		4	23
Oct 07	4		1		0	0		4	1	0	1	0	0	1		4	16
Nov 07	2		1		0	0		2	1	0	1	1	0	0		4	12
Dec 07	0		0		2	2		0	0	0	1	0	0	1		0	6
Jan 08	5		3		0	0		2	0	0	0	0	2	1		0	13
Feb 08	3		1		1	0		0	0	0	0	0	2	0		1	8
Mar 08	2		0		0	0		0	0	0	0	0	0	0		1	3
Apr 08	0		1		0	0		0	0	0	0	0	0	0		1	2
May 08	0		0		0	0		0	0	1	0	0	0	0		1	2
Jun 08	0		0		0	0		0	0	0	0	0	0	0		0	0
Jul 08	0		1		0	0		0	0	0	0	0	0	0		0	1
		110	200		85	59		37	40	48	30	37	128	9		157	


### Valve Stem Warranty Claims - Percentage of Monthly Production Volume

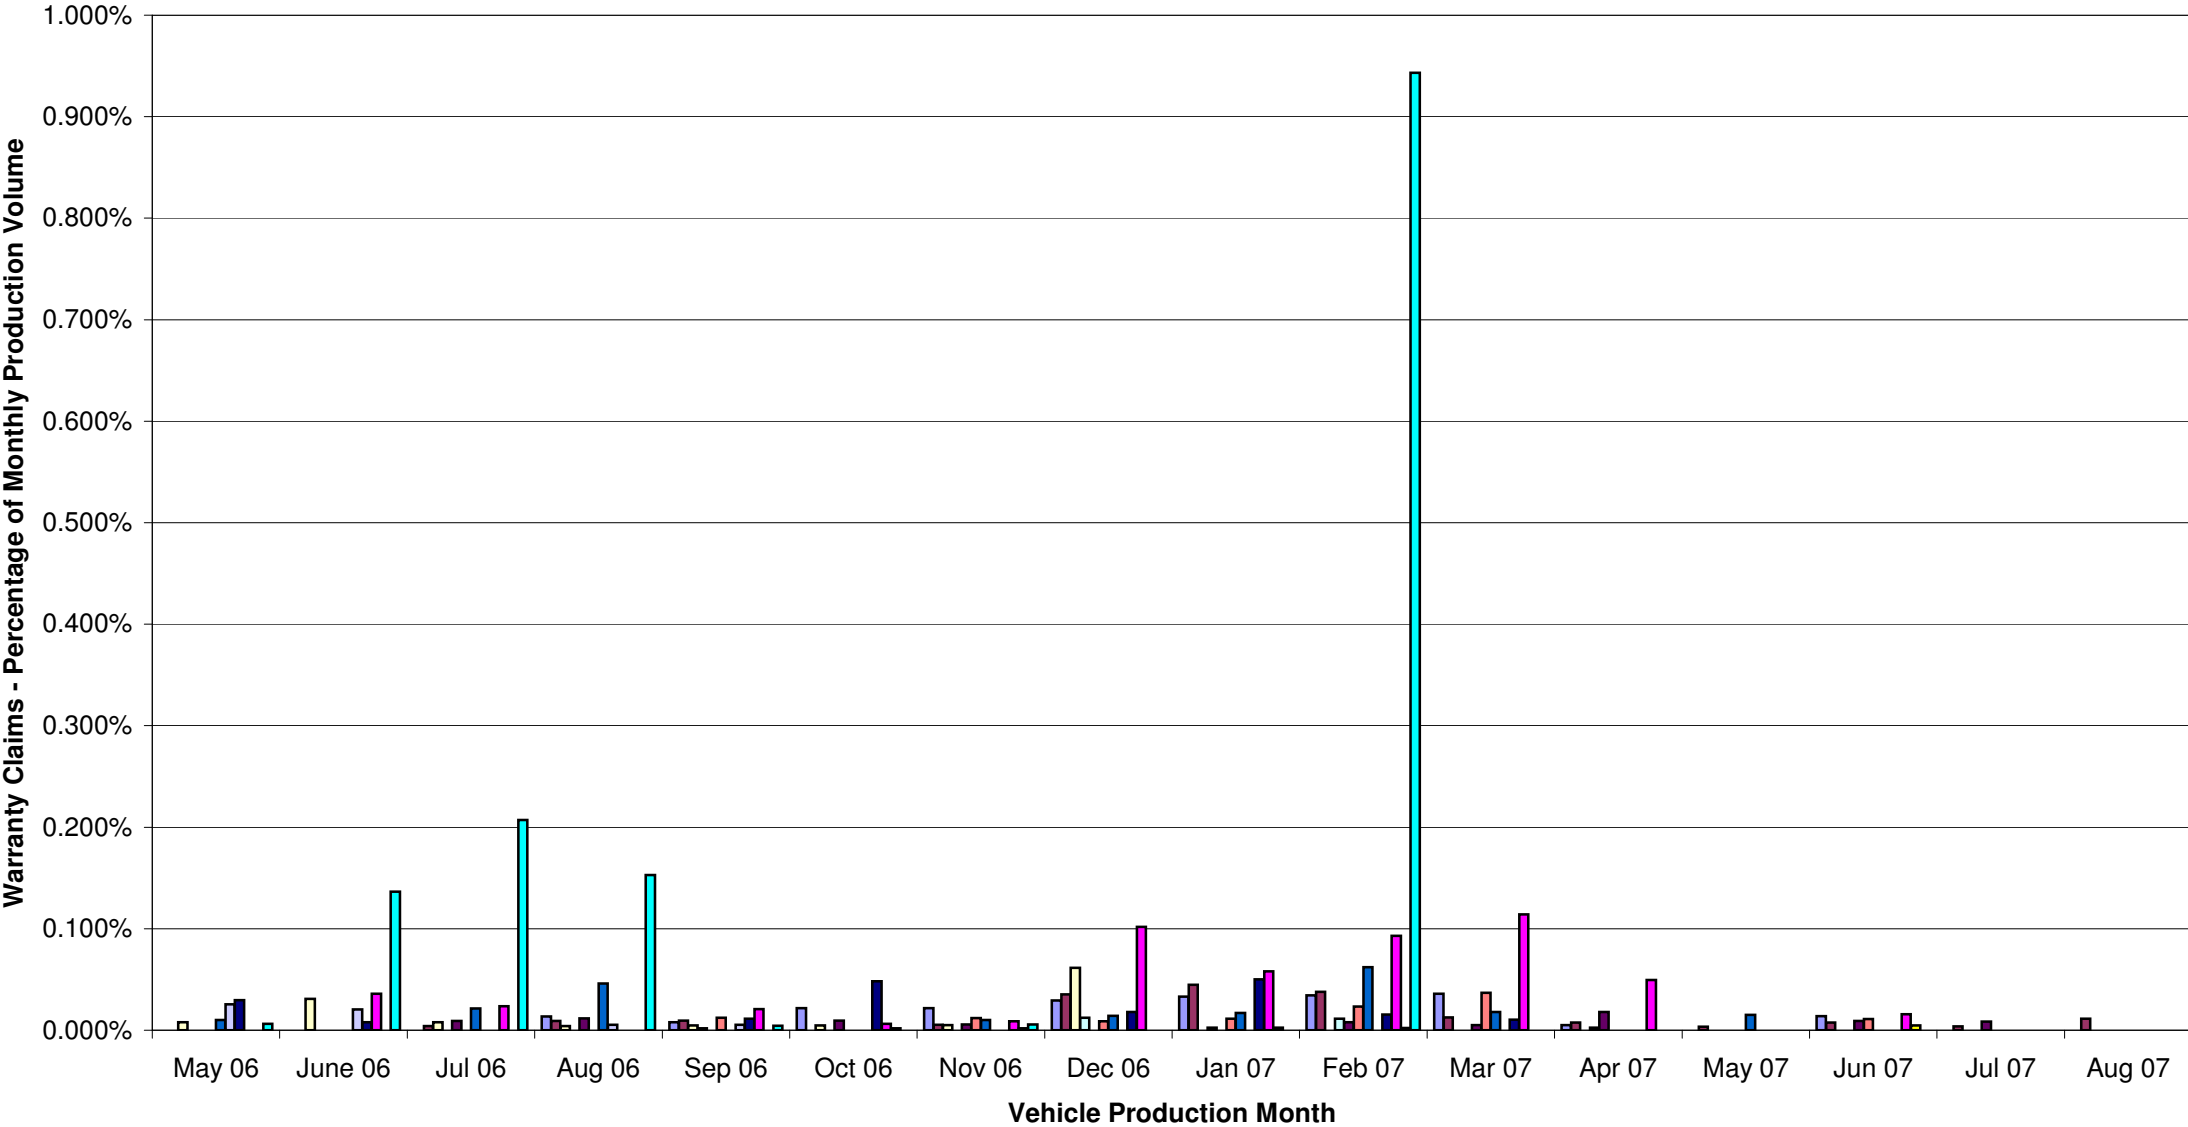

■ Fusion/Milan/MKZ 
 ■ F150 
 ■ Escape 
 ■ Expedition/ Nav. 
 ■ Focus 
 ■ Explorer/Sport Trac 
 ■ Crwn Vic/Town Car 
 ■ Taurus/Sable/Freestyle 
 ■ Ranger 
 ■ Mustang 
 ■ Econoline 
 ■ F250/350 SRW


Build Date	Fusion/Mean/MKZ			F150			Escape			Expedition Nav.			Focus			Explorer/Sport Trac			Crown Vic/Town Car			Taurus/Sable/Freestyle			Ranger			Mustang			Econoline			F250/350 SRW			
	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod. Vol.	Claim rate/Bld Rate				
May 06	NA	28251		NA	59985		2	25132	0.008%	NA	42907		0	19117	0.000%	NA	24084		2	19563	0.010%	0	5538	0.028%	3	10114	0.030%	0	19778	0.000%	0	17867	0.000%	2	32232	0.000%	
June 06	NA	28189		NA	60151		8	25954	0.031%	NA	43428		0	19564	0.000%	NA	23382		0	18966	0.000%	4	5816	0.021%	1	12522	0.008%	0	18718	0.038%	0	18870	0.000%	81	37397	0.138%	
Jul 06	0	1770	0.000%	1	24358	0.004%	1	12691	0.008%	NA	18583		1	10799	0.009%	NA	10723		2	9362	0.021%	0	0	0.000%	0	8450	0.024%	0	759	0.000%	0	759	0.000%	40	19307	0.207%	
Aug 06	4	29810	0.013%	5	54947	0.009%	1	24030	0.004%	0	44260	0.000%	0	25453	0.012%	0	19690	0.000%	3	6521	0.046%	1	3737	0.000%	0	14951	0.000%	0	18620	0.000%	0	14432	0.000%	34	22222	0.153%	
Sep 06	2	25609	0.008%	3	31962	0.009%	1	20900	0.005%	1	5491	0.000%	0	24031	0.000%	2	18460	0.012%	0	12870	0.000%	1	6987	0.000%	1	8698	0.011%	3	14438	0.011%	0	15697	0.000%	1	23384	0.004%	
Oct 06	6	27679	0.022%	0	27972	0.000%	1	20736	0.005%	0	49642	0.000%	2	21357	0.009%	0	8345	0.000%	0	11315	0.000%	0	3047	0.000%	3	6217	0.048%	1	16113	0.006%	1	16286	0.002%	0	17783	0.000%	
Nov 06	8	27510	0.022%	2	36985	0.005%	1	19962	0.005%	0	37507	0.000%	1	18019	0.006%	2	16587	0.012%	1	9994	0.010%	0	3288	0.000%	1	11499	0.009%	1	11499	0.009%	1	14665	0.002%	1	17210	0.006%	
Dec 06	6	20410	0.029%	12	34018	0.035%	9	14652	0.061%	6	48757	0.012%	0	14891	0.000%	1	11231	0.000%	2	14128	0.014%	2	4765	0.000%	1	5577	0.018%	10	8921	0.102%	0	13567	0.000%	0	9562	0.000%	
Jan 07	6	18081	0.033%	21	47001	0.045%	4	14009	0.002%	0	44481	0.011%	1	10562	0.000%	2	17655	0.011%	3	17491	0.017%	1	2948	0.000%	3	5992	0.050%	8	13784	0.058%	1	16833	0.002%	0	2010	0.000%	
Feb 07	7	20356	0.034%	16	42415	0.038%	3	16452	0.008%	0	44481	0.011%	1	10562	0.000%	5	21372	0.023%	8	12881	0.062%	0	2916	0.000%	1	6536	0.015%	11	11848	0.030%	1	17075	0.002%	1	106	0.943%	
Mar 07	6	16747	0.036%	6	47684	0.013%	2	14009	0.002%	0	49146	0.000%	0	19503	0.005%	5	13550	0.037%	4	22258	0.018%	1	1852	0.000%	17	14903	0.114%	0	19225	0.000%	2	2	0.000%	0	0	0.000%	
Apr 07	1	19401	0.005%	3	46413	0.007%	2	14009	0.002%	0	41659	0.002%	3	16662	0.018%	0	19494	0.000%	0	14135	0.000%	3	2948	0.000%	8	8242	0.000%	8	16130	0.050%	0	14892	0.000%	3	3	0.000%	
May 07	0	25088	0.000%	2	55478	0.004%	1	14009	0.002%	0	36053	0.000%	0	18804	0.000%	0	20010	0.000%	1	6561	0.013%	1	0	0.000%	0	8151	0.000%	0	11727	0.000%	0	13478	0.000%	1	1	0.000%	
Jun 07	3	21534	0.014%	4	53545	0.007%	1	14009	0.002%	0	20734	0.000%	2	21671	0.009%	2	18117	0.011%	0	5	0.000%	3	0	0.000%	0	407	0.000%	2	12601	0.016%	1	15351	0.000%	1	1	0.000%	
Jul 07	1	1	0.000%	1	27227	0.044%	1	1	0.000%	0	11973	0.009%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Aug 07	6	1	0.000%	3	26518	0.011%	1	1	0.000%	0	7279	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Sep 07	5	1	0.000%	1	1	0.000%	2	1	0.000%	0	1	0.000%	0	1	0.000%	0	0	0.000%	0	0	0.000%	0	1	0.000%	0	1	0.000%	0	3	1	0.000%	1	1	0.000%	0	0	0.000%
Oct 07	1	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Nov 07	2	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Dec 07	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Jan 08	3	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Feb 08	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Mar 08	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	
Apr 08	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	

MKZ/Milan/Fusion Valve Stem Warranty Claims (Jun 2006 - Jul 2008)

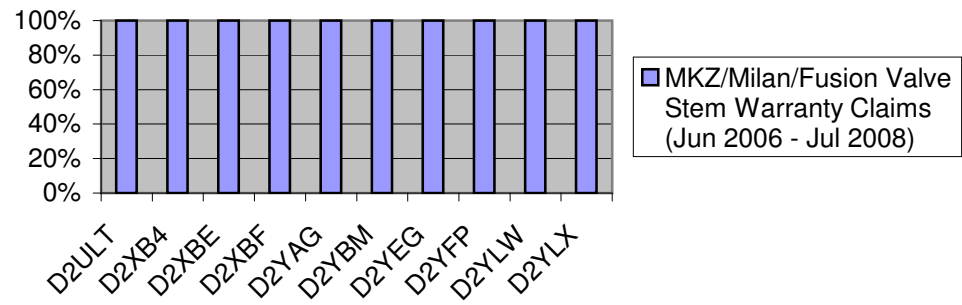


Vehicle	Valve Claims		Total V88 Claims		% valve claims		V88 R/1000		Estimated Valve Stem R/1000		Warranty Costs	
	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY
Fusion	69	25	953	390	7.24%	6.41%	6.30	5.65	0.4561	0.3622		
Milan	9	7	161	63	5.59%	11.11%	4.64	2.62	0.2594	0.2911		
Fusion & Milan	78	32	1114	453	7.00%	7.06%	6.03	6.25	0.4222	0.4415		
F150	189	11	4724	1056	4.00%	1.04%	10.68	5.17	0.4273	0.0539		
Escape	36	32	670	868	5.37%	3.69%	6.34	5.90	0.3407	0.2175		
Mariner	4	13	279	148	1.43%	8.78%	15.26	4.99	0.2188	0.4383		
Escape & Mariner	40	45	949	1016	4.21%	4.43%	7.39	5.93	0.3115	0.2626		
Expedition	49	1	1229	243	3.99%	0.41%	14.61	5.33	0.5825	0.0219		
Navigator	8	1	440	93	1.82%	1.08%	18.22	9.37	0.3313	0.1008		
Expedition & Navigator	57	2	1669	336	3.42%	0.60%	15.32	6.39	0.5232	0.0380		
Explorer	30	1	662	136	4.53%	0.74%	6.47	3.22	0.2932	0.0237		
Mountaineer	8	1	272	74	2.94%	1.35%	17.04	7.39	0.5012	0.0999		
Explorer & Mount	38	2	934	210	4.07%	0.95%	7.67	3.84	0.3121	0.0366		
Focus	28	9	1982	566	1.41%	1.59%	19.46	5.31	0.2749	0.0844		
Crown Vic	14	1	188	92	7.45%	1.09%	3.79	3.25	0.2822	0.0353		
Grand Marquis	29	2	261	97	11.11%	2.06%	6.90	3.77	0.7667	0.0777		
Crown Vic & Grand	43	3	449	189	9.58%	1.59%	5.04	3.47	0.4827	0.0551		
Econoline	11	4	1422	115	0.77%	3.48%	9.92	1.42	0.0767	0.0494		
Super Duty	143	73	2165	2630	6.61%	2.78%	13.99	9.41	0.9241	0.2612		
Ranger	35	2	972	308	3.60%	0.65%	11.05	5.86	0.3979	0.0381		
Mustang	118	10	1550	316	7.61%	3.16%	10.05	4.15	0.7651	0.1313		
Taurus	6	8	1154	242	0.52%	3.31%	19.79	5.73	0.1029	0.1894		
Sable	3	4	172	100	1.74%	4.00%	14.79	6.29	0.2580	0.2516		
Taurus X	7	2	297	84	2.36%	2.38%	8.95	2.88	0.2109	0.0686		
Chicago Assembly	16	14	1623	426	0.99%	3.29%	18.74	5.91	0.1847	0.1942		

Valve Stem AWS Claims Vs TIS - July 2006 Thru April 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

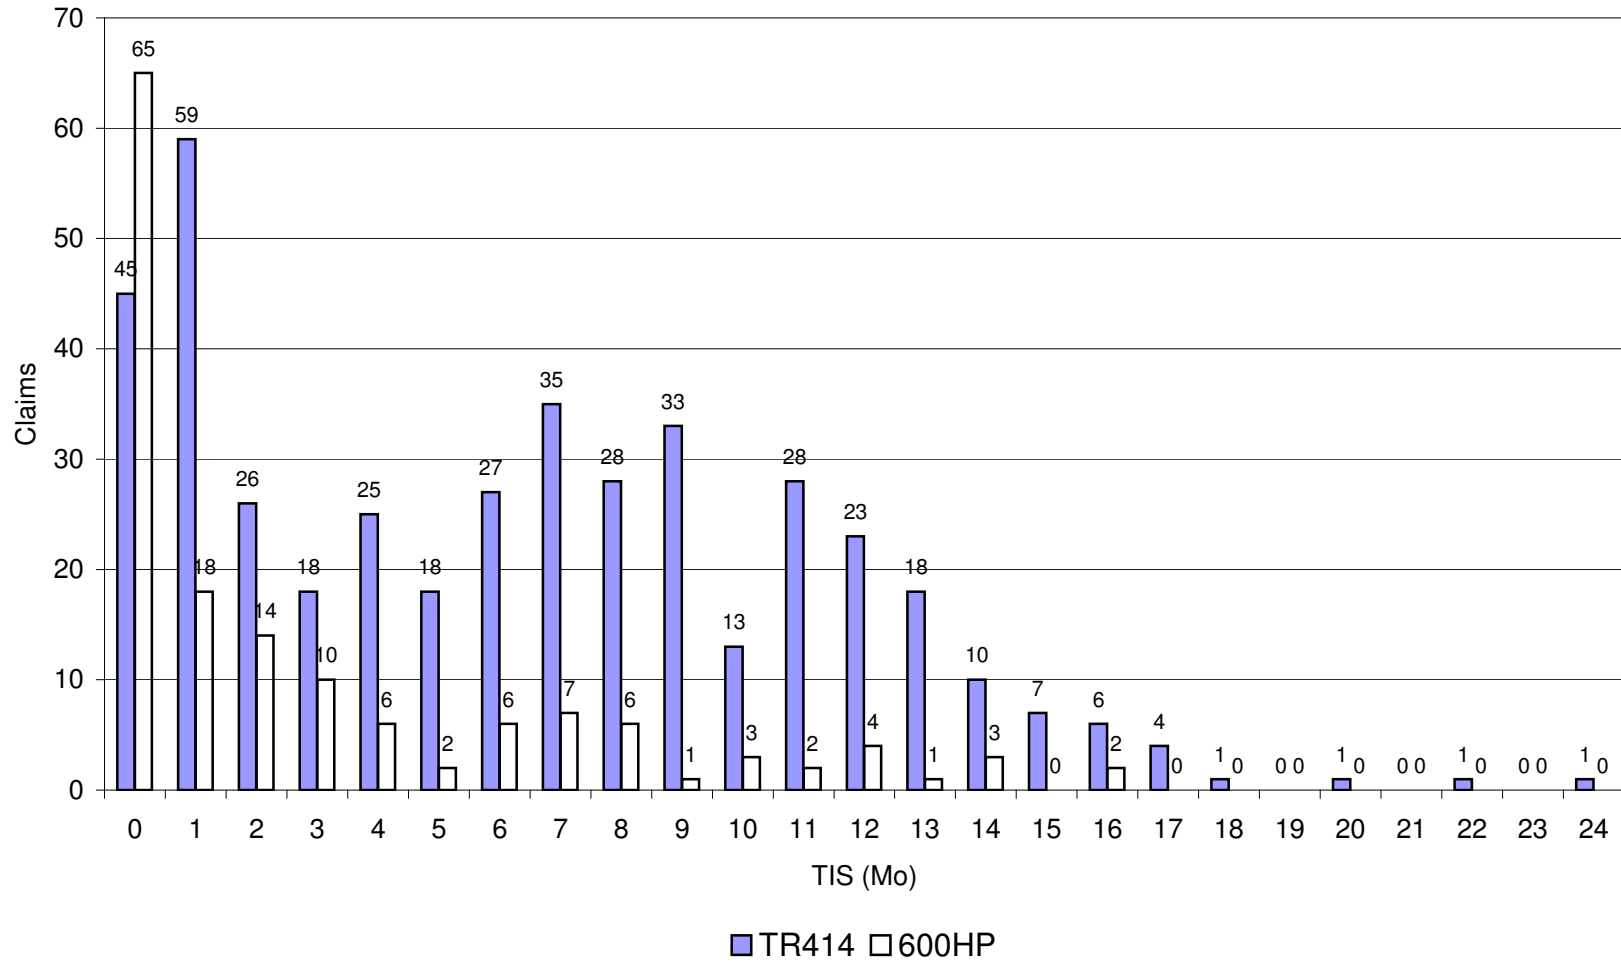


Valve Stem AWS Claims by Vehicle Line Vs TIS- July 2006 Thru April 2008  
Ford North American Vehicle Lines (Except MKX/Edge)

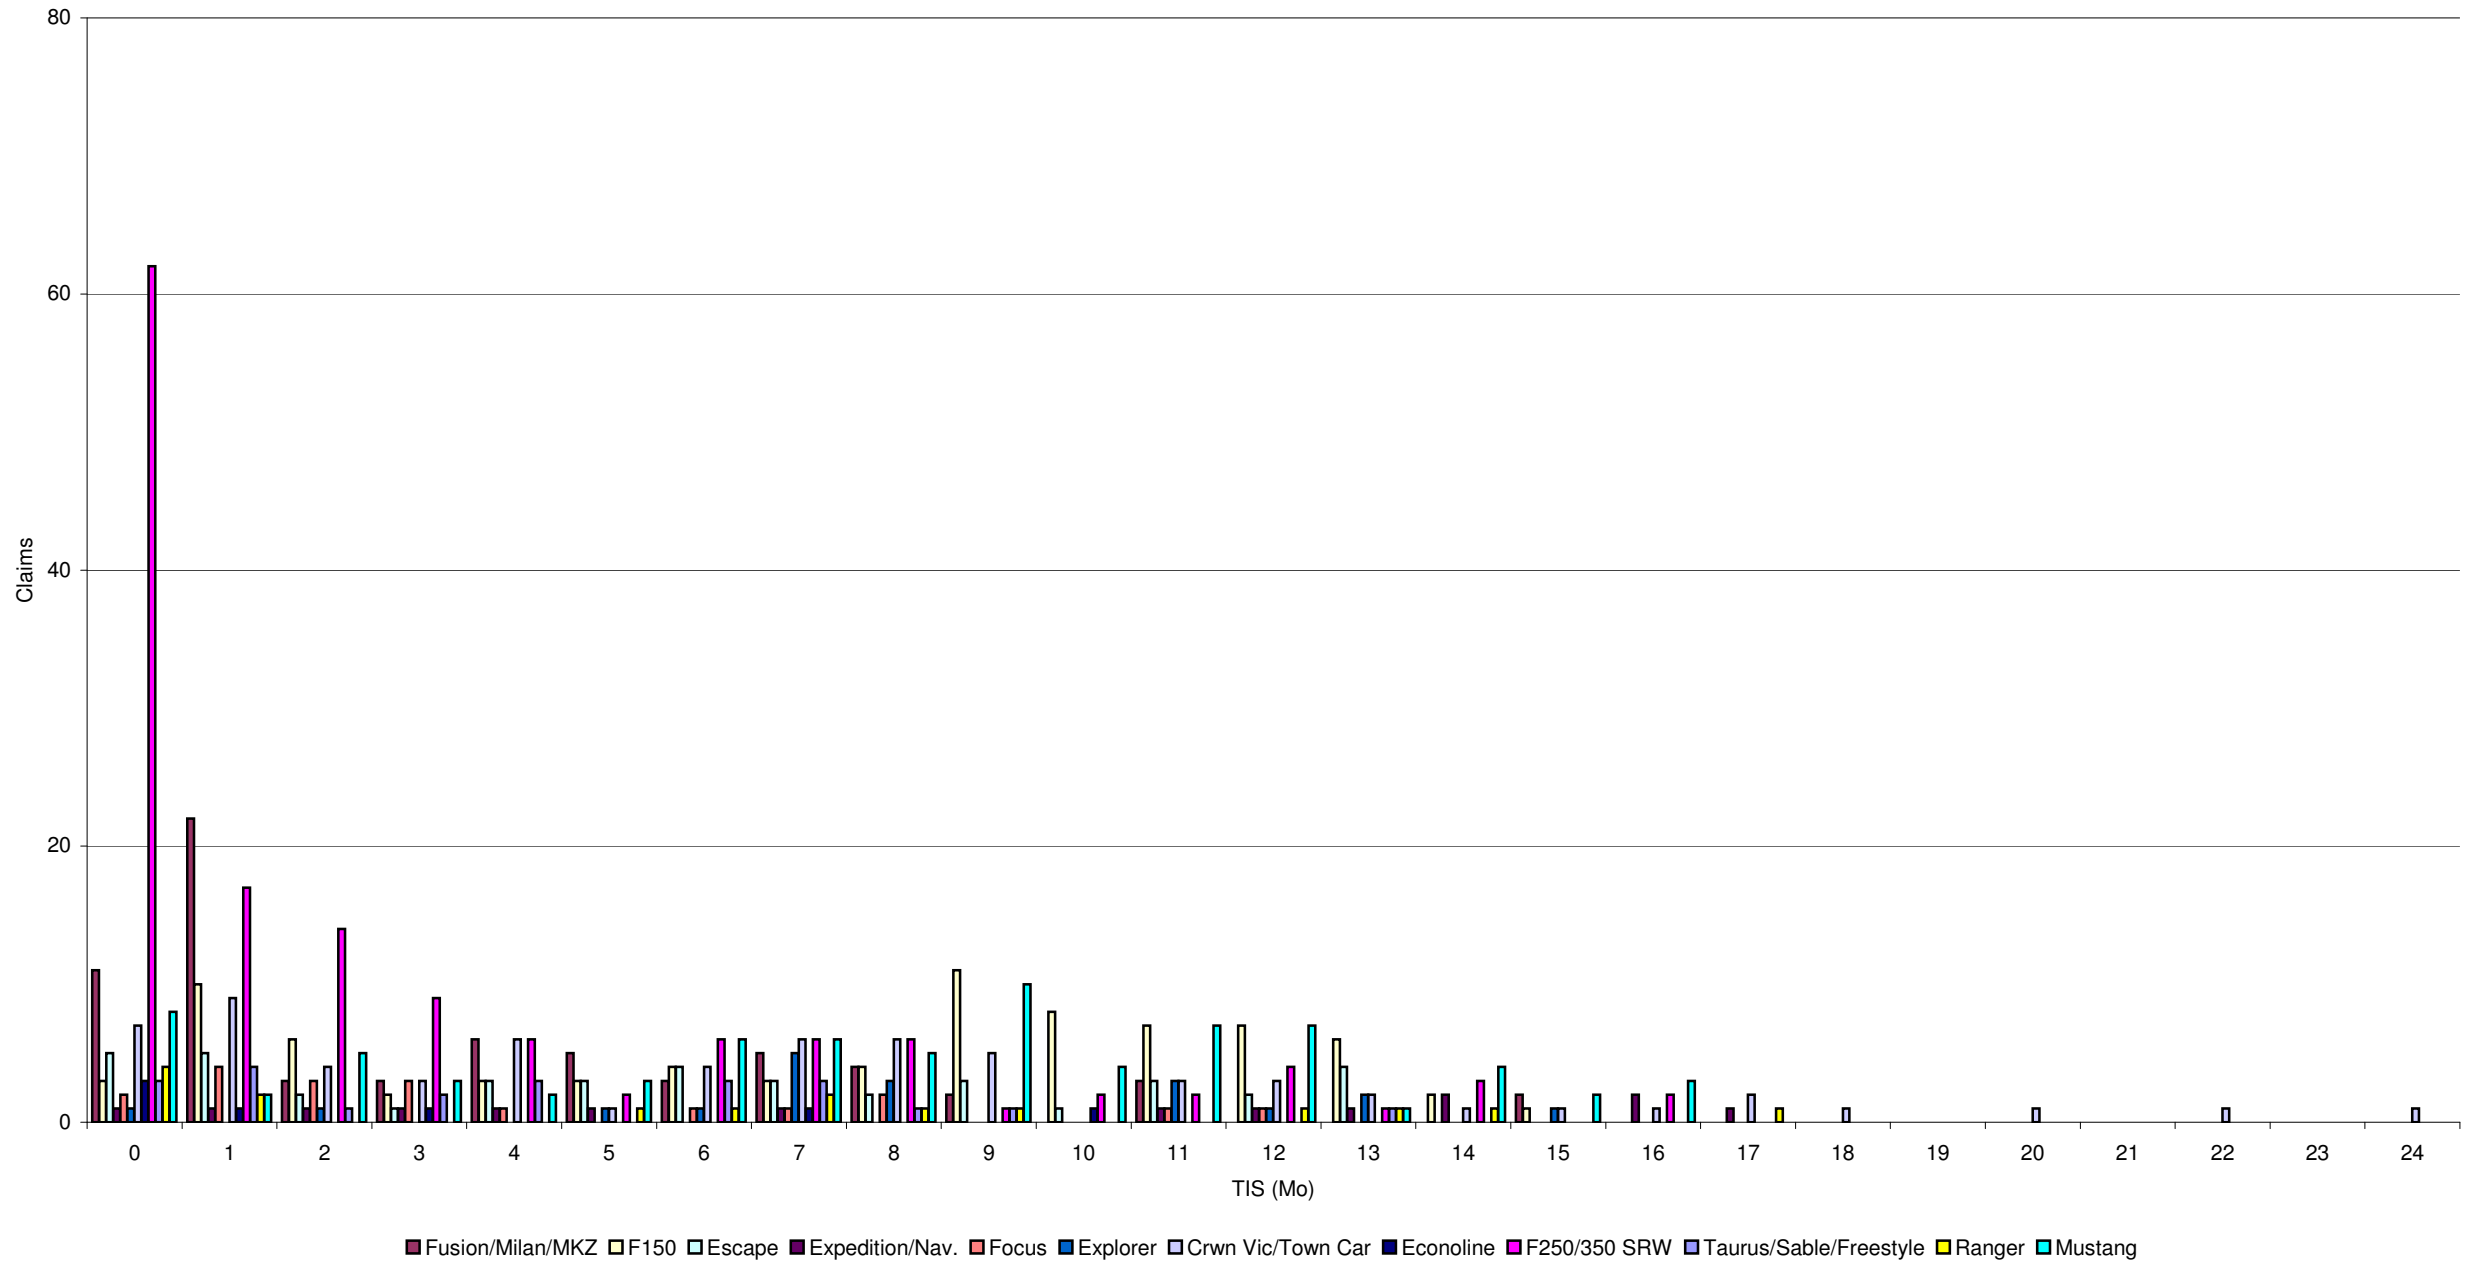




TIS	Fusion/Milan/ MKZ	F150	Escape	Expedition/N av.	Focus	Explorer	Crwn Vic/Town Car	Taurus/Sabi le/Freestyle	Ranger	Mustang	Econoline	F250/350 SRW	TR414	600HP
0	11	3	5	1	2	1	7	3	4	8	3	62	45	65
1	22	10	5	1	4	0	9	4	2	2	1	17	59	18
2	3	6	2	1	3	1	4	1	0	5	0	14	26	14
3	3	2	1	1	3	0	3	2	0	3	1	9	18	10
4	6	3	3	1	1	0	6	3	0	2	0	6	25	6
5	5	3	3	1	0	1	1	0	1	3	0	2	18	2
6	3	4	4	0	1	1	4	3	1	6	0	6	27	6
7	5	3	3	1	1	5	6	3	2	6	1	6	35	7
8	4	4	2	0	2	3	6	1	1	5	0	6	28	6
9	2	11	3	0	0	0	5	1	1	10	0	1	33	1
10	0	8	1	0	0	0	0	0	0	4	1	2	13	3
11	3	7	3	1	1	3	3	0	0	7	0	2	28	2
12	0	7	2	1	1	1	3	0	1	7	0	4	23	4
13	0	6	4	1	0	2	2	1	1	1	0	1	18	1
14	0	2	0	2	0	0	1	0	1	4	0	3	10	3
15	2	1	0	0	0	1	1	0	0	2	0	0	7	0
16	0	0	0	2	0	0	1	0	0	3	0	2	6	2
17	0	0	0	1	0	0	2	0	1	0	0	0	4	0
18	0	0	0	0	0	0	1	0	0	0	0	0	1	0
19	0	0	0	0	0	0	0	0	0	0	0	0	0	0
20	0	0	0	0	0	0	1	0	0	0	0	0	1	0
21	0	0	0	0	0	0	0	0	0	0	0	0	0	0
22	0	0	0	0	0	0	1	0	0	0	0	0	1	0
23	0	0	0	0	0	0	0	0	0	0	0	0	0	0
24	0	0	0	0	0	0	1	0	0	0	0	0	1	0

Valve Stem Warranty Claims by State -July 2006 Thru April 2008  
Ford North American Vehicle Lines (Except MKX/Edge)

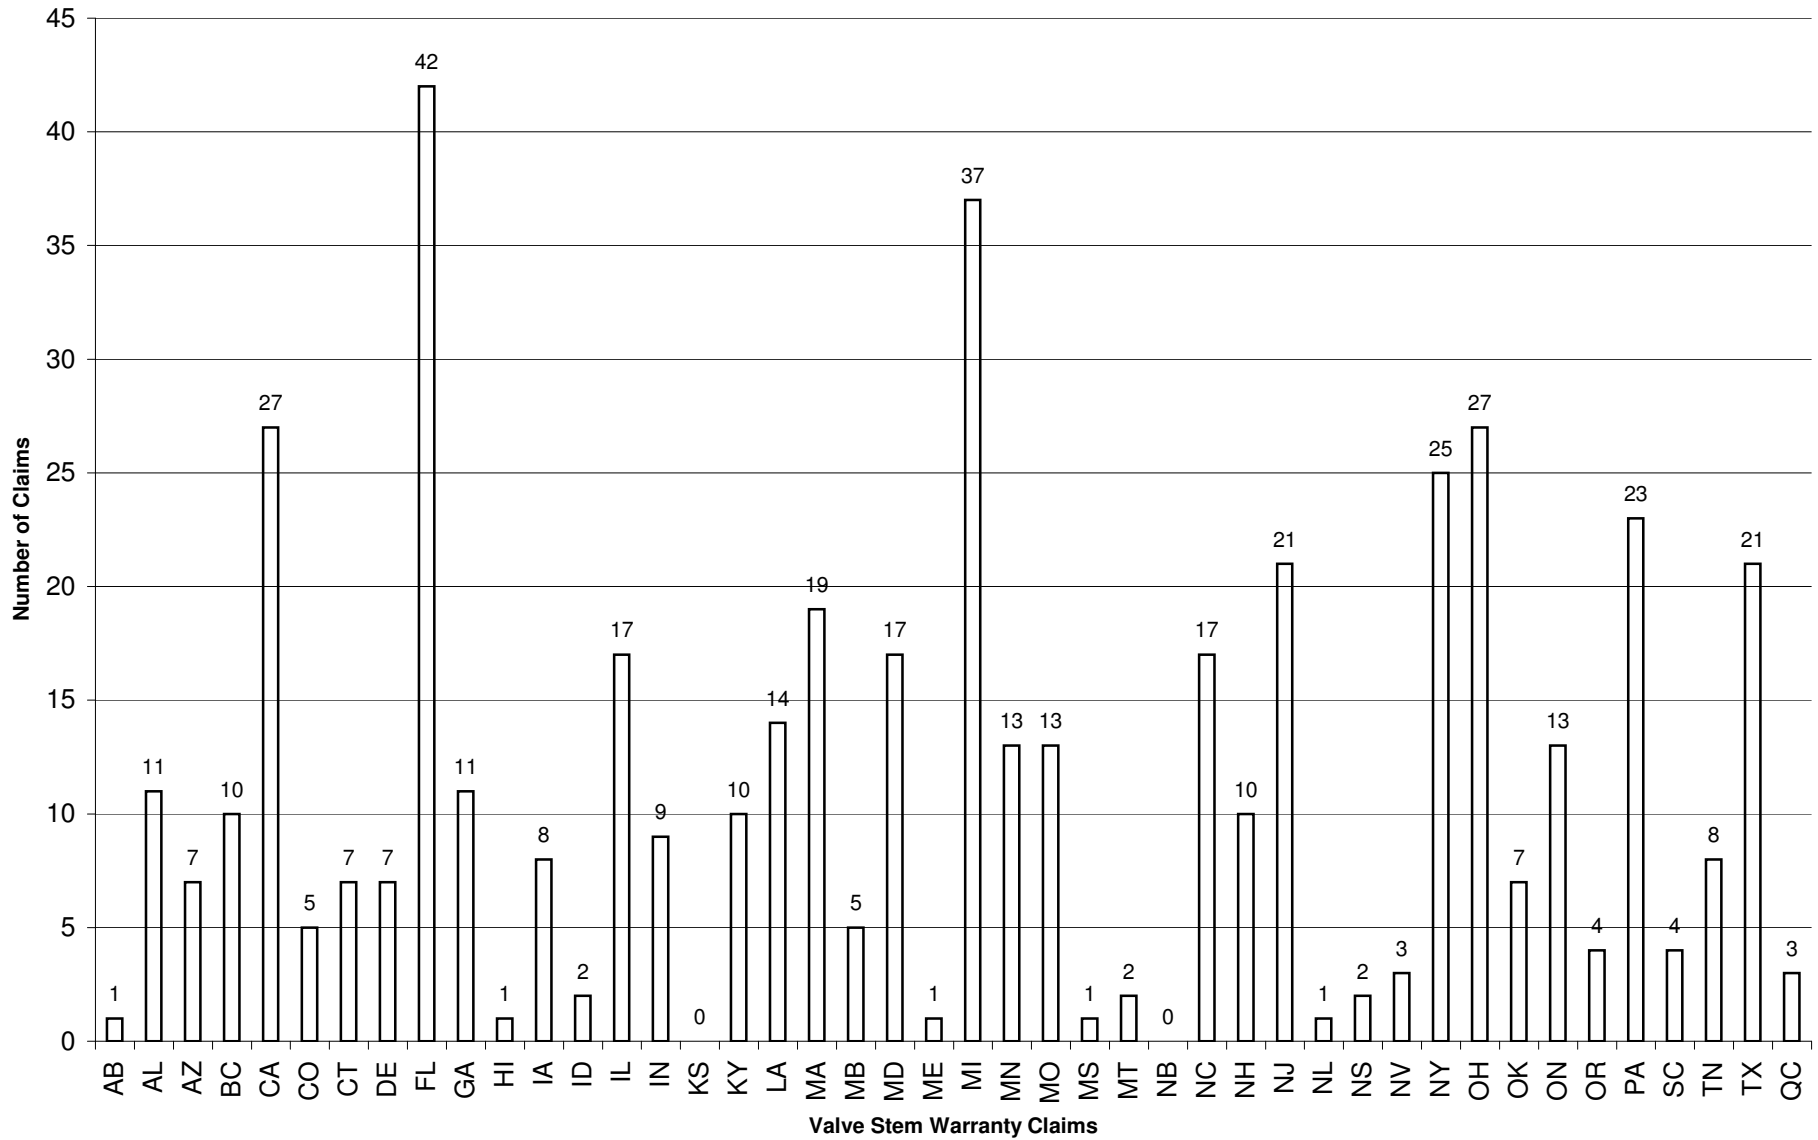


Valve Stem Warranty Claims by Vehicle Line by State - July 2006 Thru April 2008  
 Ford North American Vehicle Lines (Except MKX/Edge)

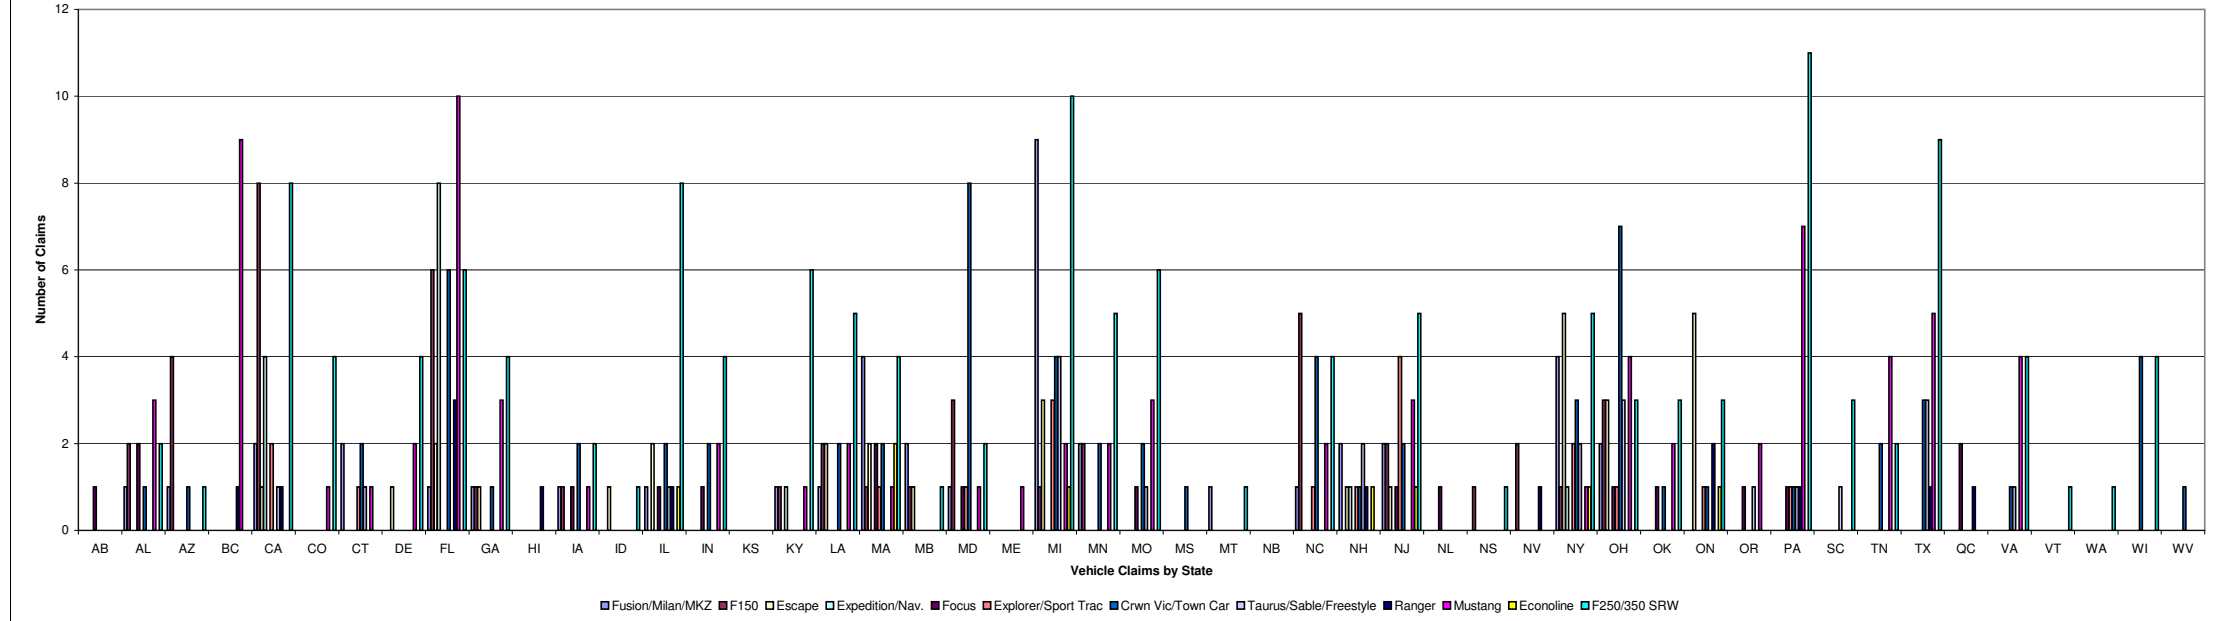


State/Prov	Fusion/Milan/ MKZ	F150	Escape	Expedition/N av.	Focus	Explorer/Spo rt Trac	Crwn Vic/Town Car	Taurus/Sable /Freestyle	Ranger	Mustang	Econoline	F250/350 SRW	Total Claims
AB	0	0	0	0	1	0	0	0	0	0	0	0	1
AL	1	2	0	0	2	0	1	0	0	3	0	2	11
AZ	1	4	0	0	0	0	1	0	0	0	0	1	7
BC	0	0	0	0	0	0	0	0	1	9	0	0	10
CA	2	8	1	4	0	2	0	1	1	0	0	8	27
CO	0	0	0	0	0	0	0	0	0	1	0	4	5
CT	2	0	0	0	0	1	2	1	0	1	0	0	7
DE	0	0	1	0	0	0	0	0	0	2	0	4	7
FL	1	6	2	8	0	0	6	0	3	10	0	6	42
GA	1	1	1	0	0	0	1	0	0	3	0	4	11
HI	0	0	0	0	0	0	0	0	1	0	0	0	1
IA	1	1	0	0	1	0	2	0	0	1	0	2	8
ID	0	0	1	0	0	0	0	0	0	0	0	1	2
IL	1	0	2	0	1	0	2	1	1	0	1	8	17
IN	0	0	0	0	1	0	2	0	0	2	0	4	9
KS	0	0	0	0	0	0	0	0	0	0	0	0	0
KY	1	1	0	1	0	0	0	0	0	1	0	6	10
LA	1	2	2	0	0	0	2	0	0	2	0	5	14
MA	4	1	2	0	2	1	2	0	0	1	2	4	19
MB	2	1	1	0	0	0	0	0	0	0	0	1	5
MD	1	3	0	0	1	1	8	0	0	1	0	2	17
ME	0	0	0	0	0	0	0	0	0	1	0	0	1
MI	9	1	3	0	0	3	4	4	0	2	1	10	37
MN	2	2	0	0	0	0	2	0	0	2	0	5	13
MO	0	0	0	0	1	0	2	1	0	3	0	6	13
MS	0	0	0	0	0	0	1	0	0	0	0	0	1
MT	1	0	0	0	0	0	0	0	0	0	0	1	2
NB	0	0	0	0	0	0	0	0	0	0	0	0	0
NC	1	5	0	0	0	1	4	0	0	2	0	4	17
NH	2	0	1	1	0	1	1	2	1	0	1	0	10
NJ	2	2	1	0	1	4	2	0	0	3	1	5	21
NL	0	0	0	0	1	0	0	0	0	0	0	0	1
NS	0	1	0	0	0	0	0	0	0	0	0	1	2
NV	0	2	0	0	0	0	0	0	1	0	0	0	3
NY	4	1	5	1	0	2	3	2	0	1	1	5	25
OH	2	3	3	0	1	1	7	3	0	4	0	3	27
OK	0	0	0	0	1	0	1	0	0	2	0	3	7
ON	0	0	5	0	0	1	1	0	2	0	1	3	13
OR	0	0	0	0	1	0	0	1	0	2	0	0	4
PA	0	0	0	0	1	1	1	1	1	7	0	11	23
SC	0	0	0	0	0	0	0	1	0	0	0	3	4
TN	0	0	0	0	0	0	2	0	0	4	0	2	8
TX	0	0	0	0	0	0	3	3	1	5	0	9	21
QC	0	0	0	0	2	0	0	0	1	0	0	0	3
VA	0	0	0	0	0	0	1	1	0	4	0	4	10
VT	0	0	0	0	0	0	0	0	0	0	0	1	1
WA	0	0	0	0	0	0	0	0	0	0	0	1	1
WI	0	0	0	0	0	0	4	0	0	0	0	4	8
WV	0	0	0	0	0	0	1	0	0	0	0	0	1

### Valve Stem Warranty Claims by Vehicle Build Date - July 2006 Thru April 2008 Ford North American Vehicle Lines (Except MKX/Edge)

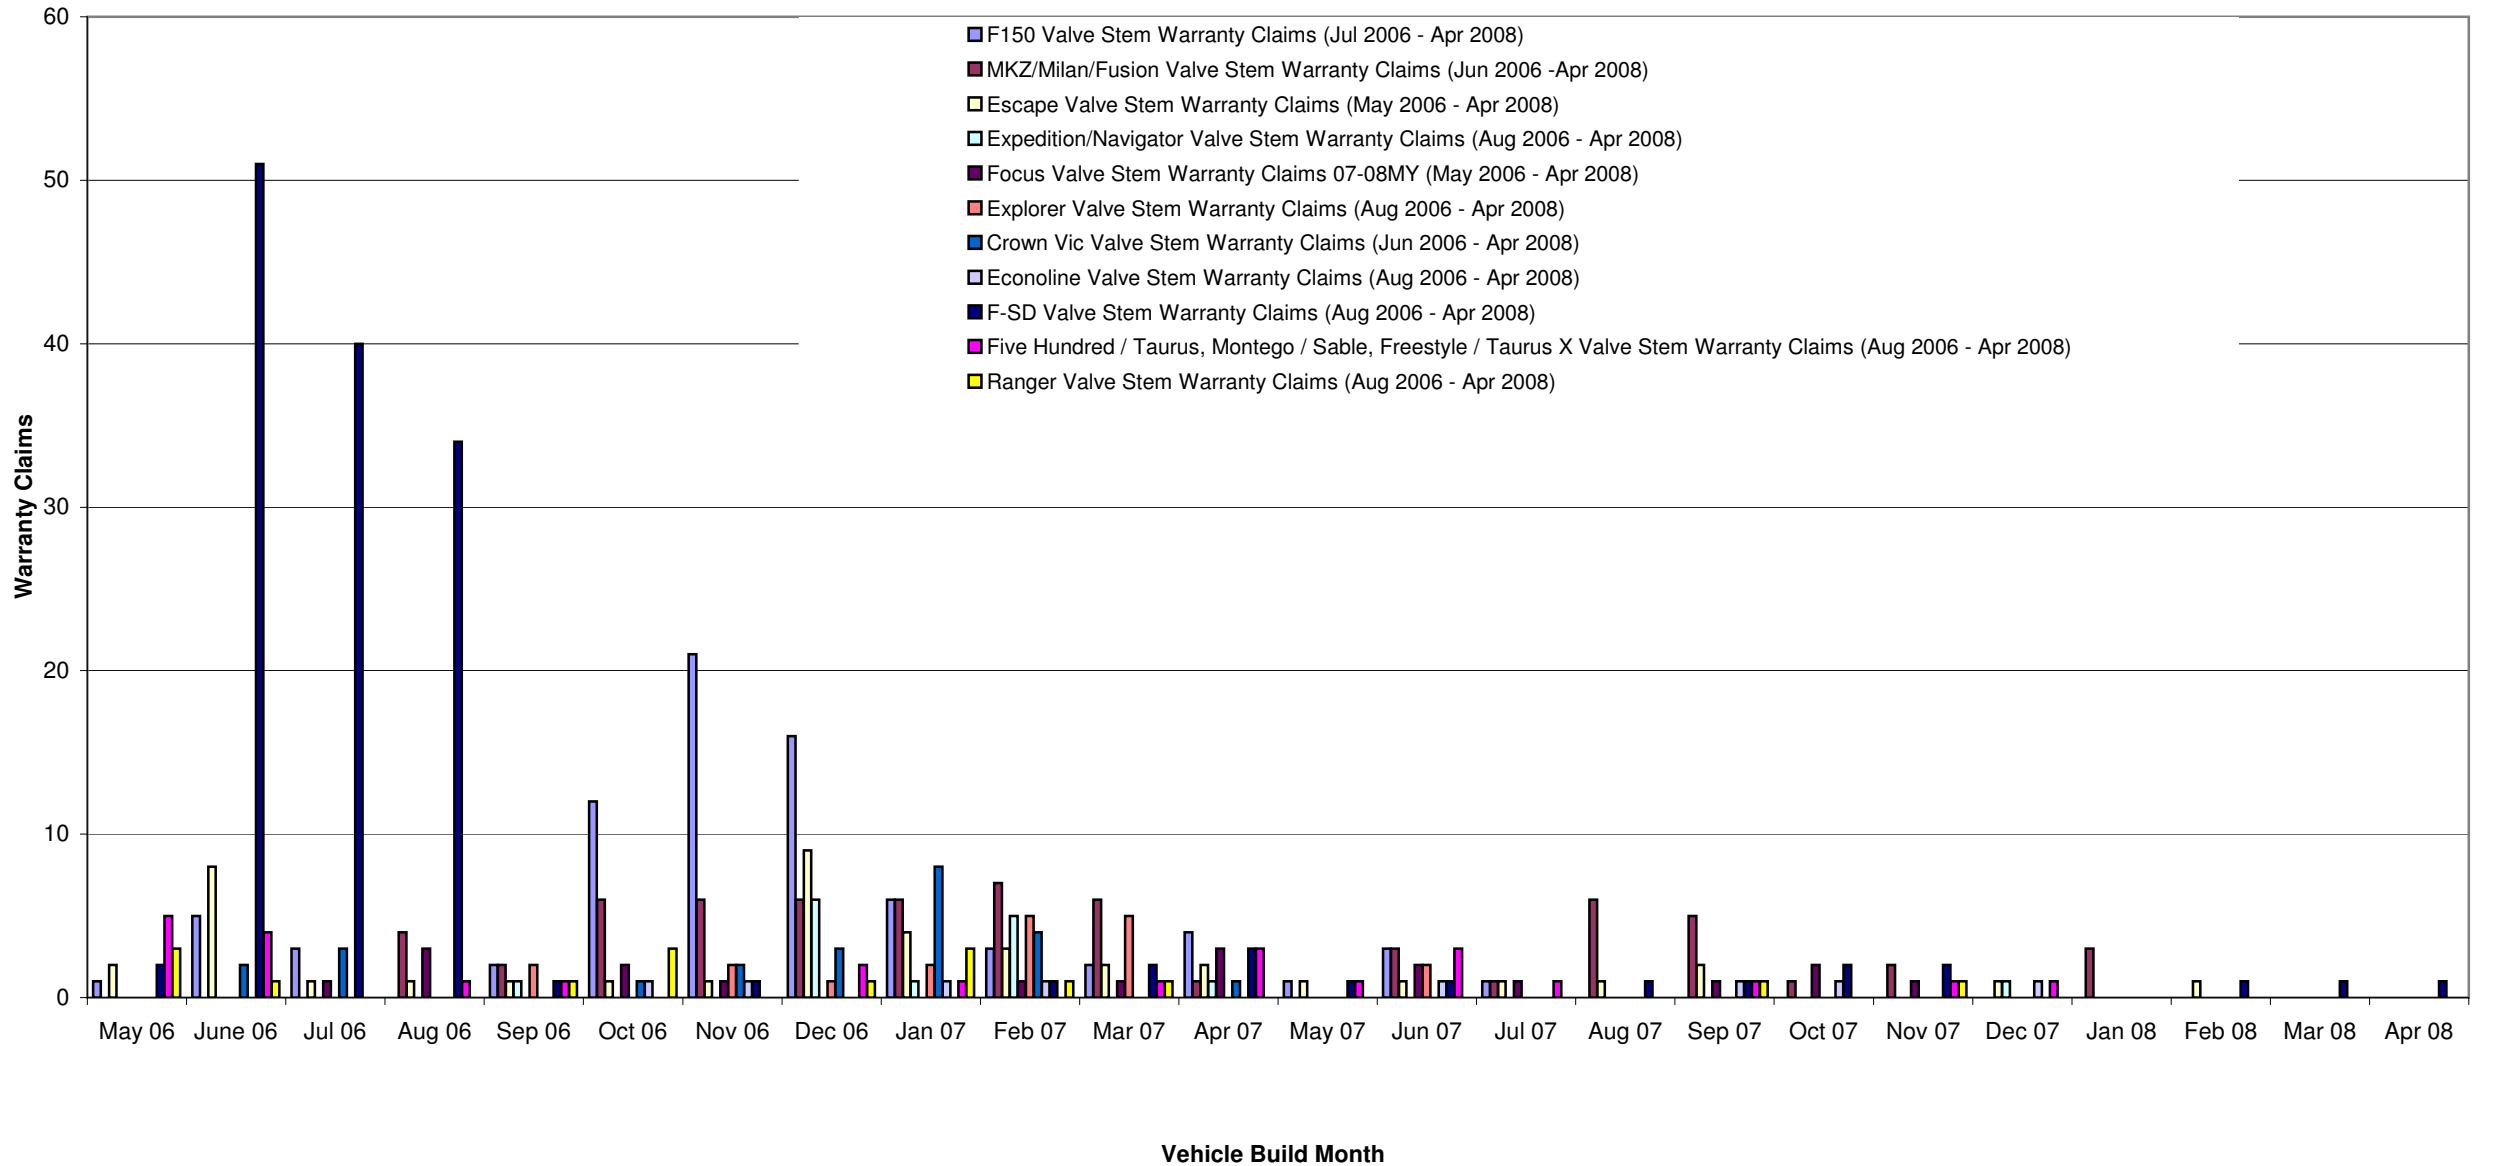

Build Date	Fusion/Milan/ MKZ	F150	Escape	Expedition/N av.	Focus	Explorer/Spo rt Trac	Crwn Vic/Town Car	Taurus/Sable /Freestyle	Ranger	Mustang	Econoline	F250/350 SRW	Total Claims	Number of Claims
May 06	NA	NA		2 NA		0 NA		2	5	3				
June 06	NA	NA		8 NA		0 NA		0	4	1				
Jul 06		0	1	1 NA		1 NA		2	0	0				
Aug 06		4	5	1	0	3	0	3	1	0				
Sep 06		2	3	1	1	0	2	0	1	1				
Oct 06		6	0	1	0	2	0	0	0	3				
Nov 06		6	2	1	0	1	2	1	0	0				
Dec 06		6	12	9	6	0	1	2	2	1				
Jan 07		6	21	4	1	0	2	3	1	3				
Feb 07		7	16	3	5	1	5	8	0	1				
Mar 07		6	6	2	0	1	5	4	1	1				
Apr 07		1	3	2	1	3	0	0	3	0				
May 07		0	2	1	0	0	0	1	1	0				
Jun 07		3	4	1	0	2	2	0	3	0				
Jul 07		1	1	1	0	1	0	0	1	0				
Aug 07		6	3	1	0	0	0	0	0	0				
Sep 07		5	1	2	0	1	0	0	1	1				
Oct 07		1	0	0	0	2	0	0	0	0				
Nov 07		2	0	0	0	1	0	0	1	1				
Dec 07		0	0	1	1	0	0	0	1	0				
Jan 08		3	0	0	0	0	0	0	0	0				
Feb 08		0	0	1	0	0	0	0	0	0				
Mar 08		0	0	0	0	0	0	0	0	0				
Apr 08		0	0	0	0	0	0	0	0	0				

### Valve Stem Warranty Claims - Percentage of Monthly Production Volume

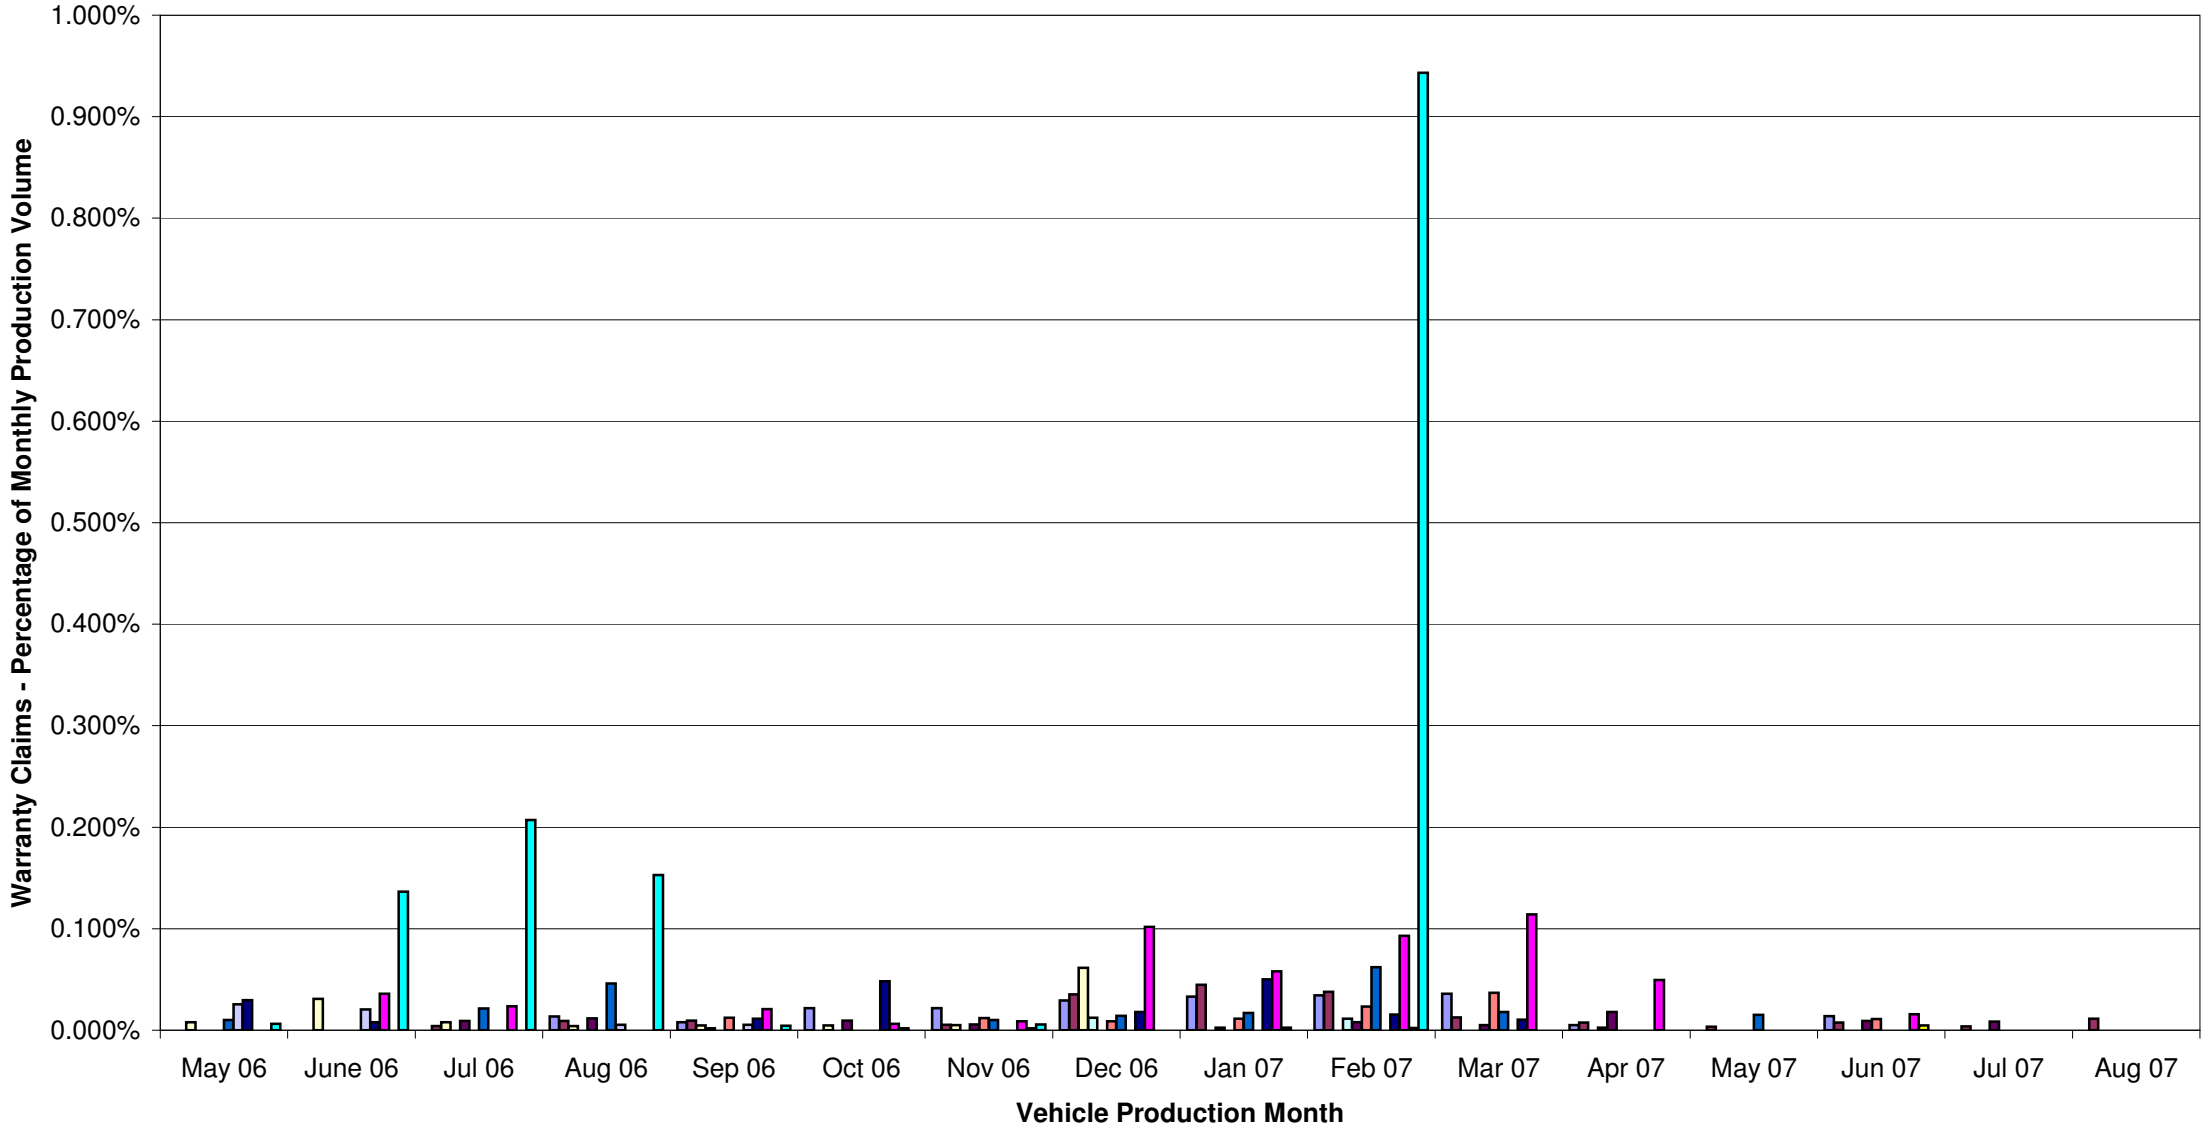

■ Fusion/Milan/MKZ 
 ■ F150 
 ■ Escape 
 ■ Expedition/ Nav. 
 ■ Focus 
 ■ Explorer/Sport Trac 
 ■ Crwn Vic/Town Car 
 ■ Taurus/Sable/Freestyle 
 ■ Ranger 
 ■ Mustang 
 ■ Econoline 
 ■ F250/350 SRW

Build Date	Fusion/Mean/MKZ			F150			Escape			Expedition Nav.			Focus			Explorer/Sport Trac			Crown Vic/Town Car			Taurus/Sable/Freestyle			Ranger			Mustang			Econoline			F250/350 SRW		
	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate	Claims/Mo	Mo. Prod Vol.	Claim rate/Bld Rate			
May 06	NA	28251		NA	59985		2	25132	0.008%	NA	42907		0	19117	0.000%	NA	24084		2	19563	0.010%	0	5538	0.028%	3	10114	0.030%	0	19778	0.000%	0	17867	0.000%	2	32232	0.006%
June 06	NA	28189		NA	60151		8	23504	0.031%	NA	43428		0	19564	0.000%	NA	23382		0	18966	0.000%	4	5816	0.021%	1	12522	0.008%	0	18718	0.008%	0	18870	0.000%	81	37397	0.138%
Jul 06	0	1770	0.000%	1	24358	0.004%	1	12691	0.008%	NA	18583		1	10799	0.009%	NA	10723		2	9062	0.021%	0	0	0.000%	0	789	0.000%	2	8450	0.024%	0	7559	0.000%	40	19307	0.207%
Aug 06	4	29810	0.013%	5	54947	0.009%	1	24030	0.004%	0	44260	0.000%	0	25453	0.012%	0	19690	0.000%	3	6521	0.046%	1	3737	0.000%	0	14951	0.000%	0	18620	0.000%	0	14432	0.000%	34	22222	0.153%
Sep 06	2	25609	0.008%	3	31962	0.009%	1	20900	0.005%	1	54091	0.000%	0	24031	0.000%	2	18460	0.012%	0	12870	0.000%	1	6087	0.000%	1	8698	0.011%	3	14438	0.011%	0	15697	0.000%	1	23384	0.004%
Oct 06	6	27679	0.022%	0	27972	0.000%	1	20736	0.005%	0	49642	0.000%	2	21357	0.009%	0	8345	0.000%	0	11315	0.000%	0	3047	0.000%	3	6217	0.048%	1	16113	0.006%	1	16286	0.002%	0	17783	0.000%
Nov 06	8	27510	0.022%	2	36985	0.005%	1	19962	0.005%	0	37507	0.000%	1	18019	0.006%	2	16587	0.012%	1	9994	0.010%	0	3288	0.000%	1	11499	0.009%	1	11499	0.009%	1	14665	0.002%	1	17210	0.006%
Dec 06	6	20410	0.009%	12	34018	0.005%	9	14652	0.061%	6	48757	0.012%	0	14891	0.000%	1	11231	0.000%	2	14128	0.014%	2	4765	0.000%	1	5577	0.018%	10	8921	0.102%	0	13567	0.000%	0	9562	0.000%
Jan 07	6	18081	0.033%	21	47001	0.045%	4	1	40089	0.002%	0	10562	0.000%	2	17655	0.011%	3	17491	0.017%	1	2848	0.000%	3	5992	0.050%	8	13784	0.058%	1	16833	0.002%	0	2010	0.000%		
Feb 07	7	20356	0.034%	16	42415	0.038%	3	1	44481	0.011%	1	12682	0.008%	5	21372	0.023%	8	12881	0.062%	0	2916	0.000%	1	6536	0.015%	11	11848	0.030%	1	17075	0.002%	1	106	0.943%		
Mar 07	6	16747	0.036%	6	47684	0.013%	2	1	49146	0.000%	0	19503	0.005%	5	13550	0.037%	4	22258	0.018%	1	1852	0.010%	17	14903	0.114%	0	19223	0.000%	2	1	0.000%	0	1	0.000%		
Apr 07	1	19401	0.005%	3	46413	0.007%	2	1	41659	0.002%	3	16662	0.018%	0	19494	0.000%	0	14135	0.000%	3	2948	0.000%	8	8242	0.000%	8	16130	0.050%	0	14892	0.000%	3	3	0.000%		
May 07	0	25088	0.000%	2	55478	0.004%	1	0	36053	0.000%	0	18804	0.000%	0	20010	0.000%	1	6561	0.013%	1	0	0.000%	0	8151	0.000%	0	11727	0.000%	0	13478	0.000%	1	1	0.000%		
Jun 07	3	21534	0.014%	4	53545	0.007%	1	0	20734	0.000%	2	21671	0.009%	2	18117	0.011%	0	5	0.000%	3	0	0.000%	0	407	0.000%	2	12601	0.016%	1	15351	0.000%	1	1	0.000%		
Jul 07	1	1	0.000%	1	27227	0.044%	1	0	11973	0.009%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Aug 07	6	1	0.000%	3	26518	0.011%	1	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Sep 07	5	1	0.000%	1	0	0.000%	2	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	1	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Oct 07	1	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Nov 07	2	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Dec 07	0	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Jan 08	3	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Feb 08	0	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Mar 08	0	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		
Apr 08	0	0	0.000%	0	0	0.000%	0	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%	0	0	0.000%		



Vehicle	Valve Claims		Total V88 Claims		% valve claims		V88 R/1000		Estimated Valve Stem R/1000		Warranty Costs	
	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY	2007MY	2008MY
Fusion	41	15	804	204	5.10%	7.35%	5.52	4.41	0.2815	0.3243	\$1,665.37	\$705.22
Milan	6	7	135	32	4.44%	21.88%	3.90	2.79	0.1733	0.6103	\$202.83	\$239.70
Fusion & Milan	47	22	939	236	5.01%	9.32%	5.26	4.15	0.2633	0.3869	\$1,868.20	\$944.92
F150	77	5	4119	558	1.87%	0.90%	10.43	4.35	0.1950	0.0390	\$3,735.76	\$110.38
Escape	21	14	577	535	3.64%	2.62%	5.63	4.27	0.2049	0.1117	\$791.51	\$467.94
Mariner	3	5	220	95	1.36%	5.26%	12.19	4.40	0.1662	0.2316	\$68.64	\$334.87
Escape & Mariner	24	19	797	630	3.01%	3.02%	6.36	4.34	0.1915	0.1309	\$860.15	\$802.81
Expedition	15	1	1063	133	1.41%	0.75%	13.55	4.33	0.1912	0.0326	\$799.22	\$6.85
Navigator	5	0	366	55	1.37%	0.00%	17.03	6.47	0.2327	0.0000	\$595.38	\$0.00
Expedition & Navigator	20	1	1429	188	1.40%	0.53%	21.33	4.82	0.2985	0.0256	\$1,394.60	\$6.85
Explorer	15	0	534	74	2.81%	0.00%	6.17	2.46	0.1733	0.0000	\$394.90	\$0.00
Mountaineer	4	0	189	27	2.12%	0.00%	11.52	4.01	0.2438	0.0000	\$118.69	\$0.00
Explorer & Mount	19	0	723	101	2.63%	0.00%	7.03	2.72	0.1847	0.0000	\$513.59	\$0.00
Focus	15	4	1157	215	1.30%	1.86%	16.31	3.42	0.2115	0.0636	\$641.13	\$167.21
Crown Vic	11	0	150	52	7.33%	0.00%	3.29	3.47	0.2413	0.0000	\$818.71	\$0.00
Grand Marquis	12	1	202	60	5.94%	1.67%	6.24	3.27	0.3707	0.0545	\$760.22	\$66.19
Crown Vic & Grand	23	1	352	112	6.53%	0.89%	4.47	3.39	0.2921	0.0303	\$1,578.93	\$66.19
Econoline	11	3	1384	68	0.79%	4.41%	9.68	0.85	0.0769	0.0375	\$578.57	\$129.32
Super Duty	140	58	2088	2096	6.70%	2.77%	13.51	9.42	0.9058	0.2607	\$6,819.65	\$3,041.30
Ranger	14	2	845	164	1.66%	1.22%	9.66	4.17	0.1600	0.0509	\$428.06	\$100.50
Mustang	71	8	1303	186	5.45%	4.30%	8.55	3.93	0.4659	0.1690	\$6,573.89	\$567.29
Taurus	6	6	939	154	0.64%	3.90%	17.43	4.79	0.1114	0.1866	\$130.22	\$179.45
Sable	3	1	119	53	2.52%	1.89%	13.51	4.67	0.3406	0.0881	\$80.92	\$43.73
Taurus X	5	1	234	50	2.14%	2.00%	6.68	3.00	0.1427	0.0600	\$154.91	\$54.13
Chicago Assembly	14	8	1292	257	1.08%	3.11%	16.40	4.35	0.1777	0.1354	\$366.05	\$277.31

---

**From:** Jones, Rick (W.P.)  
**Sent:** Monday, June 09, 2008 10:14 AM  
**To:** Ray, Mike (A.)  
**Subject:** Valve Stem File  
**Signed By:** rjones6@ford.com  
**Attachments:** 2007 Valve Stems 6 3 08.xls


Hi Mike , here it is. <<...>>

Selection Summary

source system key AWS;  
pnbb code 1700;  
make Ford LM;  
model year 2007;  
Selections chassis - wheel assy -> Total  
Selections unknown - -> Total

Disclaimer:

This data is for use as one of several potential awareness indicators for the Ford Motor Co. Enhanced Concern Identification System. It is unverified, draft, summary data generated from a computer word search of customer and technician symptom comments. Supplier data, technician and customer comments are unverified and actual root cause of any potential issue is not established by this summary

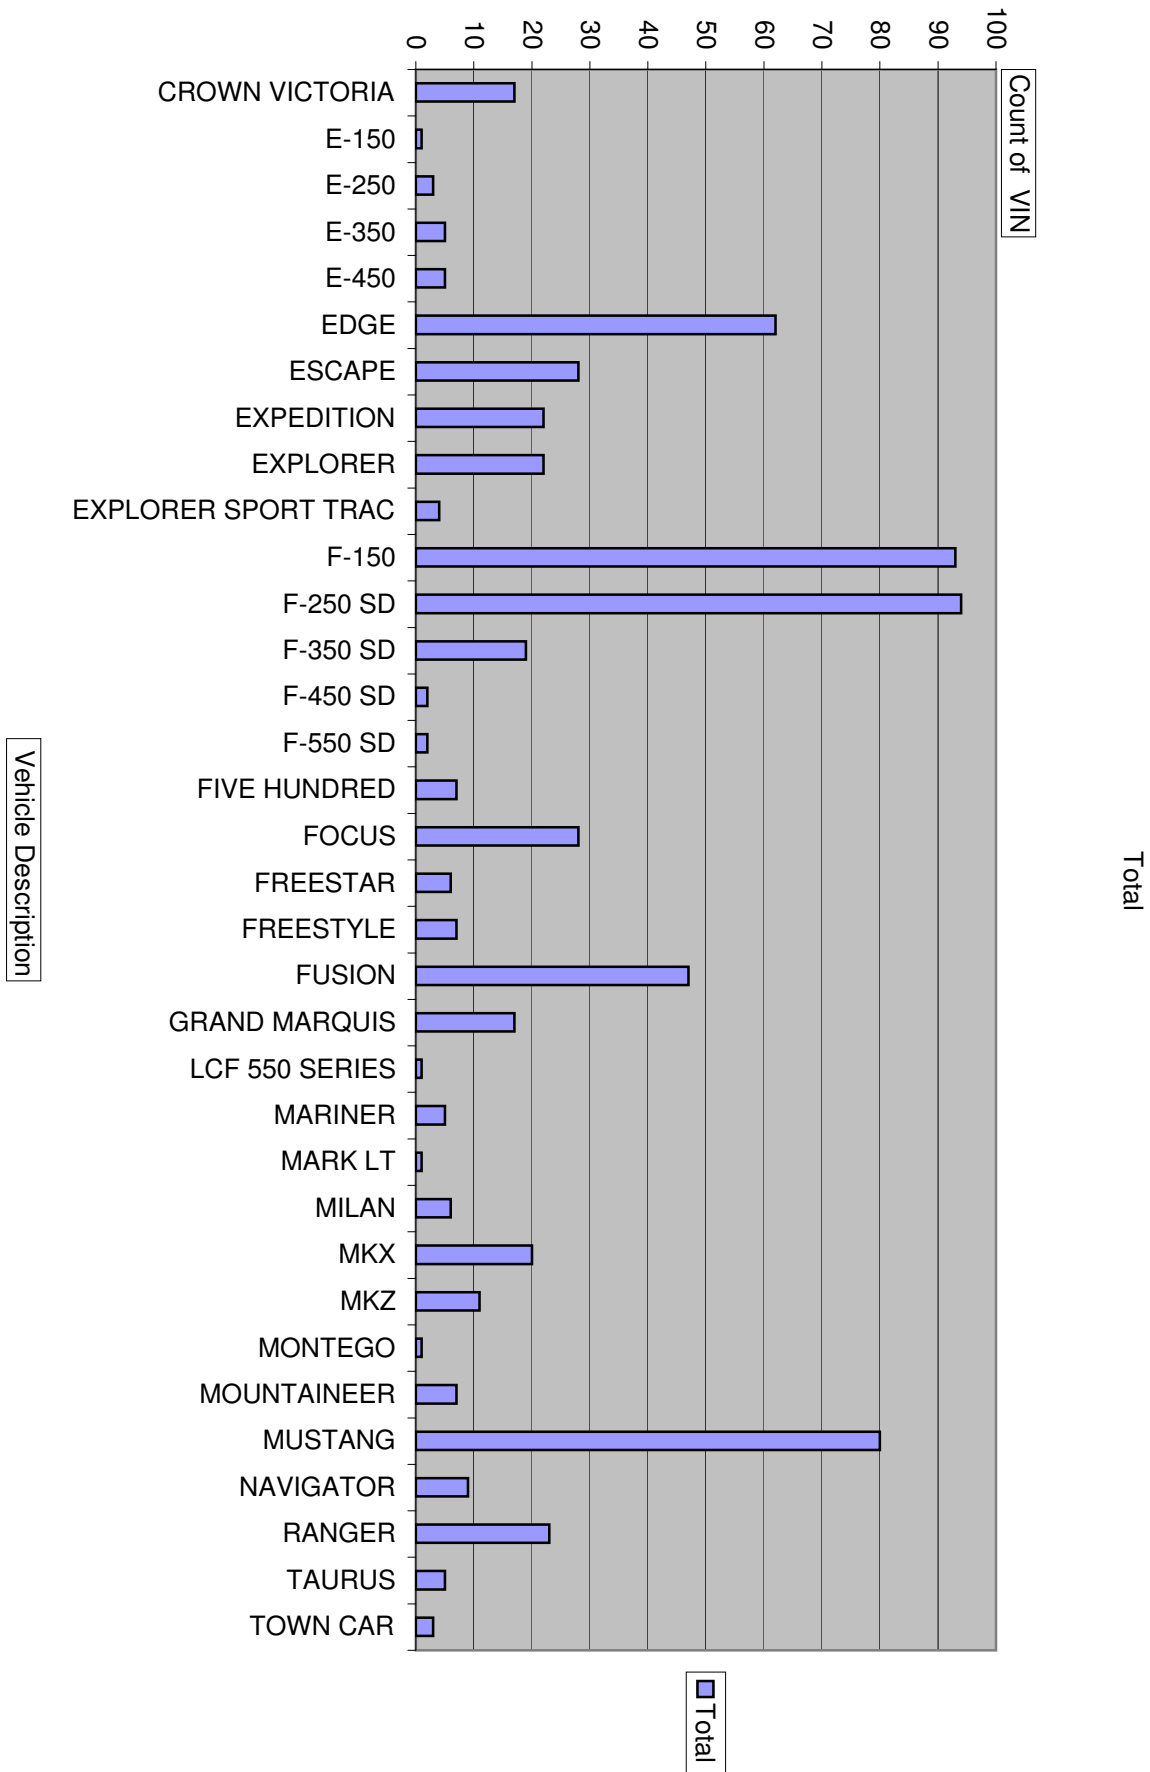

Count of VIN	
Vehicle Description	Total
CROWN VICTORIA	17
E-150	1
E-250	3
E-350	5
E-450	5
EDGE	62
ESCAPE	28
EXPEDITION	22
EXPLORER	22
EXPLORER SPORT TRAC	4
F-150	93
F-250 SD	94
F-350 SD	19
F-450 SD	2
F-550 SD	2
FIVE HUNDRED	7
FOCUS	28
FREESTAR	6
FREESTYLE	7
FUSION	47
GRAND MARQUIS	17
LCF 550 SERIES	1
MARINER	5
MARK LT	1
MILAN	6
MKX	20
MKZ	11
MONTEGO	1
MOUNTAINEER	7
MUSTANG	80
NAVIGATOR	9
RANGER	23
TAURUS	5
TOWN CAR	3
Grand Total	663

ECI Record ID	Source Code	Commodity(ies)	Symptoms	Significant Events	Verified	Source Claim Key	WCC	CPSC	TIS	Customer Condition Code	Function Group (VFG)	Repair/Report/Paid Date	L a Causal Part [Prefix	Causal Part Base	Causal Part Suffix	Causal Part Name	Dealer Code	Dealer Name
425101604	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		864	"5K02"	"28"	0	B65	V88	5/5/2006	3W1Z	1700	XA	VALVE & CAP AS	"08821 "	ENFIELD FORD
425444181	AWS	chassis;wheel assy;wheels/rims	damage-cracked/fractured/split;	N		3255	"5K02"		0	B65	V88	6/9/2006	5L3Z	1700	A	VALVE & CAP AS	"00272 "	BROOKER FORD LIN
426030687	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		5094	"5K02"	"05"	0	B65	V88	6/20/2006		1700		VALVE & CAP AS	"20218 "	JUNGE CENTER PO
426289618	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		5702	"5K02"		0	B65	V88	6/23/2006	6C3Z	1700	A	VALVE & CAP AS	"01026 "	CRESCENT FORD, I
426371089	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		6048	"5K02"		0	B65	V88	6/26/2006	6C3Z	1700	A	VALVE & CAP AS	"03319 "	PRITCHARD AUTO C
427251406	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		9399	"5K02"	"05"	0	B65	V88	7/7/2006		1700		VALVE & CAP AS	"02710 "	HUNTINGTON FORD
427832875	AWS	chassis;wheel assy;wheels/rims	burrs/sharp edges ;function-mal	N		12689	"5K02"		0	B65	V88	7/18/2006	6C3Z	1700	A	VALVE & CAP AS	"20339 "	STEVE COURY FOR
427995867	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		13311	"5K02"	"28"	0	B65	V88	7/20/2006	3W1Z	1700	XA	VALVE & CAP AS	"00977 "	FAIRWAY FORD, IN
428075559	AWS	chassis;wheel assy;wheels/rims	damage-cut/torn/frayed ;function	N		13787	"5K02"	"05"	0	B65	V88	7/21/2006		1700		VALVE & CAP AS	"01627 "	FORD OF HYANNIS,
428157261	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative	N		14121	"5K02"	"05"	0	A40	V83	7/24/2006		1700		VALVE & CAP AS	"B6264 "	S. L. FORD SALES L

428157609	AWS	chassis;wheel assy;wheels/rims	damage-cracked/fractured/split; N	14469	"5K02"		0	B65	V88	7/24/2006	6C3Z	1700	A	VALVE & CAP AS "09083 "	FRANKLIN FORD
428420174	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	15849	"5K02"	"28"	1	B65	V88	7/27/2006	3W1Z	1700	XA	VALVE & CAP AS "04798 "	WEIKERT FORD INC
428678309	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	16979	"5K02"		0	H62	V89	7/31/2006	6C3Z	1700	A	VALVE & CAP AS "03264 "	RIVERSIDE FORD M
429421724	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	23679	"5K02"		2	H45	V89	8/15/2006	6C3Z	1700	A	VALVE & CAP AS "09867 "	DOMINO FORD OF V
429646854	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	24295	"5K02"	"05"	0	B65	V88	8/16/2006		1700		VALVE & CAP AS "09304 "	LUNDGREN MOTOR
429729928	AWS	chassis;wheel assy;wheels/rims	damage-chafed/excessive wear N	24568	"5K02"		0	B65	V88	8/17/2006	6C3Z	1700	A	VALVE & CAP AS "01219 "	FALL RIVER FORD, I
429807318	AWS	chassis;wheel assy;wheels/rims	damage-cracked/fractured/split; N	25406	"5K02"	"05"	0	B65	V88	8/18/2006		1700		VALVE & CAP AS "04757 "	BURNWORTH-ZOLL
429881198	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	26466	"5K02"	"28"	0	B65	V88	8/21/2006	3W1Z	1700	XA	VALVE & CAP AS "11605 "	AUTOWAY LINCOLN
430885966	AWS	chassis;wheel assy;wheels/rims	damage-cracked/fractured/split; N	27663	"5K02"		0	C50	V89	8/23/2006	5L3Z	1700	A	VALVE & CAP AS "02414 "	BILLINGSLEY FORD
431504387	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	33267	"5K02"	"05"	0	B65	V88	8/31/2006		1700		VALVE & CAP AS "04225 "	COURTESY FORD S
431504663	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	33545	"5K02"	"07"	0	D50	V44	8/31/2006	2C3Z	1700	CA	VALVE & CAP AS "07282 "	CHASTANG'S BAYO
431906290	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	37286	"5K02"		1	B65	V88	9/7/2006	6C3Z	1700	A	"R0X62 "	AUTOPORT INC.
432334650	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	41978	"5K02"		0	B65	V88	9/14/2006	6C3Z	1700	A	VALVE & CAP AS "09223 "	STOUDT-ROSS FOR
432680080	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	45679	"5K02"	"05"	0	B65	V88	9/20/2006		1700		VALVE & CAP AS "00766 "	FORD OF BRATTLEI PE08-060 0865

432680090	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	45689	"5K02"	0	B65	V88	9/20/2006	6C3Z	1700	A	VALVE & CAP AS "00852 "	JOE COOPER FORD
432940597	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	49776	"5K02"	0	B65	V88	9/25/2006	6C3Z	1700	A	VALVE & CAP AS "06481 "	HUB CITY FORD, INC
433211573	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	53239	"5K02"	"05"	1	B65	9/28/2006		1700		VALVE & CAP AS "01560 "	RON HOPKINS FORD
433397503	AWS	chassis;wheel assy;wheels/rims	function-malfunction/inoperative N	57581	"5K02"	"30"	1	A40	10/3/2006	F42Z	1700	A	VALVE & CAP AS "B8802 "	DINGWALL FORD SA
433618558	AWS	chassis;wheel assy;wheels/rims;v	administrative cost;damage;func N	56344	"5K02"	"05"	1	H62	10/2/2006		1700		VALVE & CAP AS "01521 "	FRIENDLY FORD, IN
433793464	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	62083	"5K02"	"05"	1	C50	10/9/2006		1700		VALVE & CAP AS "B7007 "	STEVE MARSHALL F
433873287	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	63871	"5K02"	"05"	0	B65	10/10/2006		1700		VALVE & CAP AS "04638 "	PAUL HARVEY FORD
433874112	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	64696	"5K02"	"05"	1	A40	10/11/2006		1700		VALVE & CAP AS "B8422 "	LAMBTON MOTORS
433874797	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	65383	"5K02"		0	B65	10/11/2006	6C3Z	1700	A	VALVE & CAP AS "06061 "	BOLIVAR MOTOR CO
434495704	AWS	chassis;wheel assy;wheels/rims;v	damage;function-malfunction/in N	74923	"5K02"		0	B65	10/20/2006	6C3Z	1700	A	VALVE & CAP AS "09643 "	CANDY FORD-MERC



434660521	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	78039	"5K02"	0	B65	V88	10/24/2006	6C3Z	1700	A	VALVE & CAP AS "08040 "	OZARK FORD LINCC	
434980901	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	84059	"5K02"	0	B65	V88	10/30/2006	6C3Z	1700	A	VALVE & CAP AS "06638 "	MEDLIN MOTOR CO	
435075409	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	86357	"5K02"	1	B65	V88	10/31/2006	5L3Z	1700	A	VALVE & CAP AS "08246 "	ALL AMERICAN FOF	
435075671	AWS	chassis;wheel assy;wheels/rims;v damage;function-malfunction/in N	86619	"5K02"	0	B65	V88	10/31/2006	5L3Z	1700	A	VALVE & CAP AS "11152 "	PINNACLE LINCOLN	
435231082	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	90684	"5K02"	0	B65	V88	11/3/2006	6C3Z	1700	A	VALVE & CAP AS "09883 "	ROBERTS FORD	
435519701	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	95232	"5K02"	1	H62	V89	11/8/2006	6C3Z	1700	A	VALVE & CAP AS "08373 "	GULF COAST FORD	
435589240	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	95742	"5K02"	"05"	1	B65	V88	11/9/2006	1700		VALVE & CAP AS "B6081 "	DENHAM FORD SAL	
435661454	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	97768	"5K02"	"07"	2	B65	V88	11/10/2006	2C3Z	1700	CA	VALVE & CAP AS "04634 "	MIKE RAISOR FORD
435661497	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	97811	"5K02"		1	A40	V83	11/10/2006	5L3Z	1700	A	VALVE & CAP AS "04885 "	CHIPOLA FORD
435661652	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	97966	"5K02"	"05"	1	H62	V89	11/10/2006	1700		VALVE & CAP AS "06993 "	TOM SMITH FORD	
435661992	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	98310	"5K02"	"30"	1	B65	V88	11/10/2006	F42Z	1700	A	VALVE & CAP AS "20554 "	FREEHOLD FORD, II
435736342	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	99113	"5K02"	"05"	0	B65	V88	11/13/2006	1700		VALVE & CAP AS "02831 "	PAULI FORD-MERCI	
435901420	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	103152	"5K02"	"05"	0	B65	V88	11/15/2006	1700		VALVE & CAP AS "08986 "	BILL DUBE FORD	
435901423	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	103155	"5K02"		0	H62	V89	11/15/2006	5L3Z	1700	A	VALVE & CAP AS "08986 "	BILL DUBE FORD

435985284	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	104446	"5K02"	"05"	0	B65	V88	11/16/2006		1700	VALVE & CAP AS "06237 "	V & H AUTOMOTIVE
435985322	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	104484	"5K02"	"07"	0	B65	V88	11/16/2006	2C3Z	1700 CA	VALVE & CAP AS "06907 "	EXTREME FORD OF
436138359	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	107664	"5K02"	"05"	0	B65	V88	11/20/2006		1700	VALVE & CAP AS "07592 "	FORD, LINCOLN-ME
436417320	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	112590	"5K02"		2	B65	V88	11/24/2006	6C3Z	1700 A	VALVE & CAP AS "03781 "	JARRETT-GORDON
436417385	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	112655	"5K02"		2	B65	V88	11/24/2006	6C3Z	1700 A	VALVE & CAP AS "04617 "	CHAMPION FORD K.
436417734	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	113004	"5K02"	"05"	0	B65	V88	11/24/2006		1700	VALVE & CAP AS "11908 "	GREEN'S LINCOLN-I
436567274	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	115039	"5K02"	"05"	3	H04	V21	11/28/2006		1700	VALVE & CAP AS "B8425 "	BLACKSTOCK FORI
436567696	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	115461	"5K02"	"05"	1	B65	V88	11/28/2006		1700	VALVE & CAP AS "02736 "	VARSITY FORD
436654999	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	116965	"5K02"	"28"	0	H44	V89	11/29/2006	3W1Z	1700 XA	VALVE & CAP AS "B2447 "	VAL ESTRIE FORD L
436655739	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	117707	"5K02"		0	B65	V88	11/29/2006	6C3Z	1700 A	VALVE & CAP AS "03251 "	ZEISER FORD
436746332	AWS	chassis;wheel assy;wheels/rims;v leak-air/dust;loose;tire-fast/irreg N	121093	"5K02"	"05"	0	H62	V89	11/30/2006		1700	VALVE & CAP AS "13425 "	BRIGHT BAY LINCOI

436840074	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	122490	"5K02"	2	G29	V83	12/1/2006	5L3Z	1700	A	VALVE & CAP AS "05848 "	HOMER SKELTON F	
436908793	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	125394	"5K02"	"05"	0	B65	V88	12/5/2006	1700		VALVE & CAP AS "00274 "	CHEROKEE FORD	
436983771	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	127067	"5K02"	2	B65	V88	12/6/2006	6C3Z	1700	A	VALVE & CAP AS "B6152 "	KINGLAND FORD SA	
437126901	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	131322	"5K02"	4	B65	V88	12/8/2006	6C3Z	1700	A	VALVE & CAP AS "05591 "	EL CENTRO MOTOF	
437277394	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	134287	"5K02"	"30"	0	B65	V88	12/12/2006	F42Z	1700	A	VALVE & CAP AS "B4412 "	PARKSIDE FORD LII
437506994	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	140667	"5K02"	"30"	1	H62	V89	12/15/2006	F42Z	1700	A	VALVE & CAP AS "02202 "	DOWNTOWN FORD
437507365	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	141038	"5K02"	"05"	3	B65	V88	12/15/2006	1700		VALVE & CAP AS "04879 "	WAYNE AKERS FOF PE08-060 0869	

437586918	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	143150	"5K02"	"05"	2	A40	V83	12/18/2006		1700	VALVE & CAP AS "04945 "	BILL CURRIE FORD
437754465	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	147797	"5K02"		1	B65	V88	12/20/2006	6C3Z	1700 A	VALVE & CAP AS "04139 "	WESTLIE MOTOR C
438033784	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	159895	"5K02"	"05"	1	G29	V83	12/28/2006		1700	VALVE & CAP AS "10931 "	BOB MAXEY LINCOL
438037895	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	164011	"5K02"		4	B65	V88	1/1/2007	6C3Z	1700 A	VALVE & CAP AS "05201 "	UNITED FORD - NOF
438039347	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	165463	"5K02"		5	G29	V83	1/2/2007	6C3Z	1700 A	VALVE & CAP AS "04935 "	JARRETT FORD MEI
438039558	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	165674	"5K02"		5	B65	V88	1/2/2007	6C3Z	1700 A	VALVE & CAP AS "06122 "	THOMAS FORD MOT
438406224	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	169936	"5K02"	"30"	5	B65	V88	1/4/2007	F42Z	1700 A	VALVE & CAP AS "01108 "	GO FORD WEST
438407385	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	171097	"5K02"	"05"	0	B65	V88	1/4/2007		1700	VALVE & CAP AS "07329 "	DAVIES FORD
438474211	AWS	chassis;wheel assy;wheels/rims;v misaligned/out of position/adjus: N	172520	"5K02"	"05"	1	G29	V83	1/5/2007		1700	VALVE & CAP AS "01548 "	JOE COTTON FORD
438538995	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	175653	"5K02"		1	B95	V71	1/8/2007	6C3Z	1700 A	VALVE & CAP AS "04807 "	FREEDOM FORD, IN
438540168	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	176826	"5K02"		0	H62	V89	1/8/2007	6C3Z	1700 A	VALVE & CAP AS "20686 "	MAHWAH FORD SAI

438694432	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	184110	"5K02"	1	H45	V89	1/10/2007	6C3Z	1700 A	VALVE & CAP AS "06611 "	LEO VENTERS MOT	
438767723	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	185093	"5K02"	4	B66	V75	1/11/2007	5L3Z	1700 A	VALVE & CAP AS "B1393 "	FINES FORD LINCOLN	
438768860	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	186235	"5K02"	"05"	1	B65	V88	1/11/2007	1700	VALVE & CAP AS "04496 "	A C COLLINS FORD,	
438769813	AWS	chassis;wheel assy;wheels/rims;v loose;misaligned/out of position. N	187189	"5K02"	"05"	2	T55	V74	1/11/2007	1700	VALVE & CAP AS "11153 "	LINCOLN MERCURY	
438841974	AWS	chassis;wheel assy;wheels/rims;v loose;nvh-rough ride N	187667	"5K02"	"05"	3	C50	V89	1/12/2007	1700	VALVE & CAP AS "B2548 "	DESJARDINS FORD	
438841993	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	187686	"5K02"	"07"	0	B65	V88	1/12/2007	2C3Z	1700 BA	VALVE & CAP AS "B3303 "	AVALON FORD SALI
438842819	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	188512	"5K02"		1	B65	V88	1/12/2007	6C3Z	1700 A	VALVE & CAP AS "02922 "	HUBERT VESTER FC
438843536	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	189229	"5K02"	"30"	2	H26	V89	1/12/2007	F42Z	1700 A	VALVE & CAP AS "07332 "	SCOTT FORD-MERC
439088342	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	197298	"5K02"	"05"	0	B65	V88	1/17/2007	1700	VALVE & CAP AS "02732 "	DAVE KNAPP FORD	
439161641	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	201129	"5K02"	"07"	0	W05	V15	1/18/2007	WW	1700	VALVE & CAP AS "08471 "	WINSLOW FORD
439312107	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	204650	"5K02"		2	B65	V88	1/22/2007	5F9Z	1700 A	VALVE & CAP AS "B2490 "	CHARTRAND FORD

439312514	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	205057	"5K02"	"05"	0	B65	V88	1/22/2007	1700	VALVE & CAP AS "00061 "	PURVIS FORD, INC.	
439314396	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	206940	"5K02"		1	B65	V88	1/22/2007	6C3Z	1700 A	VALVE & CAP AS "09880 "	MIDDLEKAUFF FOR
440263806	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	208364	"5K02"		3	H62	V89	1/23/2007	6C3Z	1700 A	VALVE & CAP AS "01015 "	FORT MILL FORD
440264975	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	209533	"5K02"		1	B65	V88	1/23/2007	6C3Z	1700 A	VALVE & CAP AS "06400 "	TERRY MOORE FOF
440344104	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	211852	"5K02"		2	B65	V88	1/24/2007	6C3Z	1700 A	VALVE & CAP AS "03262 "	LAWRENCE MARSH
440422371	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	213963	"5K02"	"28"	4	C50	V89	1/25/2007	3W1Z	1700 XA	VALVE & CAP AS "B4412 "	PARKSIDE FORD LII
440424677	AWS	chassis;wheel assy;wheels/rims;v contaminated/foreign;function-rr N	216272	"5K02"	"28"	8	A40	V83	1/25/2007	3W1Z	1700 XA	VALVE & CAP AS "20672 "	CAUSEWAY FORD &
440674056	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	228373	"5K02"	"05"	0	B65	V88	1/31/2007		1700	VALVE & CAP AS "01231 "	TIDELANDS FORD L

440676418	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	230737	"5K02"	"28"	5	H62	V89	1/31/2007	3W1Z	1700 XA	VALVE & CAP AS "08999 "	ASHLEY FORD SALE
440991558	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	237961	"5K02"		0	E40	V17	2/5/2007	5L3Z	1700 A	VALVE & CAP AS "B1393 "	FINES FORD LINCOLN
441070989	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	242459	"5K02"		0	B65	V88	2/6/2007	6C3Z	1700 A	VALVE & CAP AS "04617 "	CHAMPION FORD K
441071816	AWS	chassis;wheel assy;wheels/rims;v appearance;damage-cut/torn/fræ N	243287	"5K02"	"28"	2	TB7	V88	2/6/2007	3W1Z	1700 XA	VALVE & CAP AS "10386 "	STU EVANS LINCOLN
441140947	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	244967	"5K02"	"05"	6	B65	V88	2/7/2007		1700	VALVE & CAP AS "01013 "	LUMBERTON FORD
441142692	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	246715	"5K02"	"28"	1	G29	V83	2/7/2007	3W1Z	1700 XA	VALVE & CAP AS "09695 "	FOUR SEASONS FO
441216076	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	249414	"5K02"	"05"	1	A40	V83	2/8/2007		1700	VALVE & CAP AS "07003 "	POLLARD FRIENDL
441218558	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	251896	"5K02"	"30"	2	H62	V89	2/9/2007	F42Z	1700 A	VALVE & CAP AS "04863 "	DUVAL FORD

441440844	AWS	chassis;wheel assy;wheels/rims;v leak-failed gasket/seal/weatherε N	257441	"5K02"	"28"	1	G29	V83	2/13/2007	3W1Z	1700 XA	VALVE & CAP AS "B2269 "	AUTOMOBILES DES
441442133	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	258730	"5K02"	"28"	1	B65	V88	2/13/2007	3W1Z	1700 XA	VALVE & CAP AS "03756 "	GORDIE BOUCHER
441442932	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	259529	"5K02"		0	B65	V88	2/13/2007	6C3Z	1700 A	VALVE & CAP AS "07587 "	SMITH FORD LLC
441577996	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	263862	"5K02"	"07"	1	B65	V88	2/15/2007	2C3Z	1700 CA	VALVE & CAP AS "B1711 "	CAMPBELL FORD S,
441792090	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	276624	"5K02"		0	B65	V88	2/20/2007	6C3Z	1700 A	VALVE & CAP AS "00469 "	BONDY'S FORD, INC
442174836	AWS	chassis;wheel assy;wheels/rims;v contaminated/foreign;loose;nvh· N	297762	"5K02"	"05"	3	N51	V39	2/27/2007		1700	VALVE & CAP AS "01345 "	BILL MARSH FORD,
442255265	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	301541	"5K02"	"28"	1	H62	V89	2/28/2007	3W1Z	1700 XA	VALVE & CAP AS "B2547 "	TRADITION FORD
442256244	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	302520	"5K02"		1	B65	V88	2/28/2007	6C3Z	1700 A	VALVE & CAP AS "01417 "	WAYNE COUNTY FC
442344973	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	307945	"5K02"	"30"	2	B65	V88	3/1/2007	F42Z	1700 A	VALVE & CAP AS "04113 "	ROUTE 23 AUTO MA



442349141	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	312115	"5K02"	"28"	1	B65	V88	3/2/2007	3W1Z	1700 XA	VALVE & CAP AS "08821 "	ENFIELD FORD
442478744	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	314069	"5K02"	"05"	6	B65	V88	3/5/2007		1700	VALVE & CAP AS "02284 "	JOHN LANCE FORD
442558412	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	317353	"5K02"		0	H62	V89	3/6/2007	6C3Z	1700 A	VALVE & CAP AS "00302 "	RONNIE THOMPSON
442836908	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	332351	"5K02"		2	H62	V89	3/12/2007	6C3Z	1700 A	VALVE & CAP AS "00602 "	CROWN FORD
442914034	AWS	chassis;wheel assy;wheels/rims;v damage-cut/torn/frayed ;function N	336800	"5K02"	"30"	0	L65	V44	3/13/2007	F42Z	1700 A	VALVE & CAP AS "01650 "	MCDONALD FORD II
442914448	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	337214	"5K02"		2	B65	V88	3/13/2007	5L3Z	1700 A	VALVE & CAP AS "02960 "	WEST-HERR FORD

442988600	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	340249	"5K02"	"30"	4	B65	V88	3/14/2007	F42Z	1700 A	VALVE & CAP AS "B2502 "	LES GALERIES FOR
442989870	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	341520	"5K02"	"28"	8	B65	V88	3/14/2007	3W1Z	1700 XA	VALVE & CAP AS "02864 "	DAVE GOULD FORD
443070743	AWS	chassis;wheel assy;wheels/rims;v damage-distorted/warped/wrinklN	344697	"5K02"	"30"	1	B65	V88	3/15/2007	F42Z	1700 A	VALVE & CAP AS "00852 "	JOE COOPER FORD
443151978	AWS	unknown	4E+07	"9AAA"		7	*	V00	3/17/2007	F4TA	1700 EA	"03191 "	DIVEM
443213397	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	352637	"5K02"	"05"	4	B65	V88	3/19/2007		1700	VALVE & CAP AS "02173 "	WILLIAMS MOTOR C
443375838	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	360811	"5K02"		1	B65	V88	3/21/2007	6C3Z	1700 A	VALVE & CAP AS "01409 "	BONANZA FORD
443376828	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	361802	"5K02"	"05"	1	A85	V17	3/21/2007		1700	VALVE & CAP AS "04963 "	BRANDON FORD
443377662	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	362636	"5K02"		5	B65	V88	3/21/2007	5L3Z	1700 A	VALVE & CAP AS "09054 "	STONEHAM MOTOR
443446760	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	364560	"5K02"	"30"	1	A99	V99	3/22/2007	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
443447174	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	364974	"5K02"	"05"	4	B65	V88	3/22/2007		1700	VALVE & CAP AS "02960 "	WEST-HERR FORD PE08-060 0876

443448991	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	366800	"5K02"	"28"	0	B65	V88	3/22/2007	3W1Z	1700 XA	VALVE & CAP AS "10939 "	PFEIFFER LINCOLN
443607148	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	374242	"5K02"		3	B65	V88	3/26/2007	6C3Z	1700 A	VALVE & CAP AS "06516 "	NATCHITOCHEES FO
443695514	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	376642	"5K02"	"07"	0	B65	V88	3/27/2007	2C3Z	1700 BA	VALVE & CAP AS "B8280 "	RIDGEHILL FORD S
443696328	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	377456	"5K02"	"05"	1	B65	V88	3/27/2007		1700	VALVE & CAP AS "02204 "	MARSHALL FORD
443698883	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	380011	"5K02"	"30"	1	B65	V88	3/27/2007	F42Z	1700 A	VALVE & CAP AS "11166 "	REYNOLDS LINCOLI
443857708	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	123413	"5K02"	"05"	3	A85	V17	12/4/2006		1700	VALVE & CAP AS "M2334 "	PLASENCIA MAZATI
444060266	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	390905	"5K02"	"30"	0	G29	V83	3/30/2007	F42Z	1700 A	VALVE & CAP AS "01248 "	WINNER FORD
444063011	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	393650	"5K02"		4	B65	V88	3/30/2007	5F9Z	1700 AB	VALVE & CAP AS "09054 "	STONEHAM MOTOR
444153880	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	395685	"5K02"		0	B65	V88	4/2/2007	5F9Z	1700 AB	VALVE & CAP AS "00012 "	KIP KILLMON'S TYS
444154086	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	395891	"5K02"	"05"	6	B65	V88	4/2/2007		1700	VALVE & CAP AS "00622 "	ZOOK MOTORS, INC
444242971	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	402464	"5K02"	"05"	1	H62	V89	4/3/2007		1700	VALVE & CAP AS "08178 "	PUNDMANN MOTOFO

444310014	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	403627	"5K02"	"07"	4	H62	V89	4/4/2007	2C3Z	1700 CA	VALVE & CAP AS "B1210 "	EDWARDS FORD SA
444525141	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	414247	"5K02"	"05"	1	B65	V88	4/9/2007		1700	VALVE & CAP AS "A3258 "	CABOT FORD LINCC
444525232	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	414338	"5K02"	"30"	4	B66	V75	4/9/2007	F42Z	1700 A	VALVE & CAP AS "A8053 "	AIRPORT FORD LINI
444963244	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	441336	"5K02"		4	B65	V88	4/17/2007	6C3Z	1700 A	VALVE & CAP AS "02014 "	EARL FLOYD FORD
444964512	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	442604	"5K02"	"05"	2	A99	V99	4/17/2007		1700	VALVE & CAP AS "06744 "	HASTINGS FORD, IN
445040779	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	446977	"5K02"	"05"	4	G29	V83	4/18/2007		1700	VALVE & CAP AS "06503 "	HIXSON AUTOPLEX
445042900	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	449104	"5K02"		2	B66	V75	4/19/2007	6C3Z	1700 A	VALVE & CAP AS "B4089 "	JUBILEE FORD SALI
445362376	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	467258	"5K02"		2	B65	V88	4/24/2007	6C3Z	1700 A	VALVE & CAP AS "20672 "	CAUSEWAY FORD &
445364712	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	469598	"5K02"	"30"	2	B65	V88	4/25/2007	F42Z	1700 A	VALVE & CAP AS "03604 "	OASIS FORD
445366712	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	471600	"5K02"	"30"	3	B65	V88	4/25/2007	F42Z	1700 A	VALVE & CAP AS "11122 "	OGDEN LINCOLN MI
445511702	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	473375	"5K02"		1	B65	V88	4/26/2007	5F9Z	1700 AB	VALVE & CAP AS "00571 "	MASTEL FORD-LINC

445513975	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	475649	"5K02"	"05"	1	G29	V83	4/26/2007		1700	VALVE & CAP AS "07997 "	MALL OF GEORGIA
445929092	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	498156	"5K02"	"07"	0	B65	V88	5/3/2007	2C3Z	1700 BA	VALVE & CAP AS "B8280 "	RIDGEHILL FORD S,
445931092	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	500158	"5K02"	"05"	7	G29	V83	5/3/2007		1700	VALVE & CAP AS "06366 "	ROSEMURGY MOTC
446002086	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	502602	"5K02"	"05"	2	B65	V88	5/4/2007		1700	VALVE & CAP AS "00572 "	EMERLING FORD MI
446082324	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	507580	"5K02"	"30"	7	H22	V87	5/7/2007	F42Z	1700 A	VALVE & CAP AS "02745 "	BLACKWELL FORD,
446082584	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	507840	"5K02"	"30"	1	B65	V88	5/7/2007	F42Z	1700 A	VALVE & CAP AS "03571 "	WEST BRANCH FOF
446165101	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	513124	"5K02"		1	B65	V88	5/8/2007	5F9Z	1700 AB	VALVE & CAP AS "04570 "	BLUEBONNET MOTC
446237770	AWS	chassis;wheel assy;wheels/rims;v leak-air/dust;misaligned/out of p N	517793	"5K02"		8	G29	V83	5/9/2007	5F9Z	1700 AB	VALVE & CAP AS "04843 "	MAROONE FORD OI
446311644	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	521374	"5K02"	"30"	3	A99	V99	5/10/2007	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
446534646	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	535256	"5K02"	"05"	3	B65	V88	5/15/2007		1700	VALVE & CAP AS "00766 "	FORD OF BRATTLEI
446534960	AWS	chassis;wheel assy;wheels/rims;v damage-road hazard;function-m N	535570	"5K02"	"05"	7	A99	V99	5/15/2007		1700	VALVE & CAP AS "01597 "	SANTA MARGARITA

446534962 AWS chassis;wheel assy;wheels/rims;v damage-road hazard;function-m N 535572 "5K02" "05" 2 A99 V99 5/15/2007 1700 VALVE & CAP AS "01597 " SANTA MARGARITA PE08-060 0879

446535167	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	535777	"5K02"	"30"	1	B65	V88	5/15/2007	F42Z	1700 A	VALVE & CAP AS "02414 "	BILLINGSLEY FORD
446695880	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	545505	"5K02"		7	H62	V89	5/17/2007	5F9Z	1700 AB	VALVE & CAP AS "00773 "	SEMINOLE FORD-MI
446696158	AWS	chassis;wheel assy;wheels/rims;v damage-distorted/warped/wrinkl N	545783	"5K02"	"30"	6	N24	V89	5/17/2007	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
446696431	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	546057	"5K02"		5	R10	V37	5/17/2007	5F9Z	1700 AB	VALVE & CAP AS "02588 "	GOLDING MOTORS,
447601082	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	559876	"5K02"	"05"	0	B65	V88	5/22/2007		1700	VALVE & CAP AS "00433 "	BAYSHORE FORD
447601186	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	559981	"5K02"	"05"	6	B65	V88	5/22/2007		1700	VALVE & CAP AS "00818 "	TOM PECK FORD OI
447601381	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	560176	"5K02"	"05"	3	B65	V88	5/22/2007		1700	VALVE & CAP AS "01300 "	GEO. M. YOCUM, INI
447679324	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	564539	"5K02"	"28"	2	B66	V75	5/23/2007	3W1Z	1700 XA	VALVE & CAP AS "A1059 "	OAK-LAND FORD LII
447825559	AWS	chassis;wheel assy;wheels/rims;v appearance;function-malfunction N	577839	"5K02"	"05"	2	B65	V88	5/25/2007		1700	VALVE & CAP AS "08101 "	QUALITY FORD-MEF
447937261	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	583319	"5K02"	"30"	3	B64	V75	5/29/2007	F42Z	1700 A	VALVE & CAP AS "01083 "	JAMES SHORT FOR

447937940	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	583998	"5K02"	"05"	1	G29	V83	5/29/2007		1700	VALVE & CAP AS "02865 "	FORD OF OCALA IN
448007753	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	588560	"5K02"	"30"	2	B65	V88	5/30/2007	F42Z	1700 A	VALVE & CAP AS "01262 "	SHARPNACK FORD
448009842	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	590649	"5K02"		2	B65	V88	5/30/2007	5F9Z	1700 AB	VALVE & CAP AS "05662 "	CROSSROADS FOR
448097272	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	596190	"5K02"	"05"	2	H26	V89	5/31/2007		1700	VALVE & CAP AS "03713 "	BREWSTER FORD S
448099288	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	598209	"5K02"		1	B66	V75	5/31/2007	6C3Z	1700 A	VALVE & CAP AS "08246 "	ALL AMERICAN FOF
448099567	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	598488	"5K02"	"05"	4	B65	V88	5/31/2007		1700	VALVE & CAP AS "08988 "	DRUM HILL FORD IN
448510288	AWS	chassis;wheel assy;wheels/rims;v appearance;function-malfunctio N	621811	"5K02"	"30"	7	B65	V88	6/7/2007	F42Z	1700 A	VALVE & CAP AS "00167 "	BESHORE AND KOL

448512214	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	623739	"5K02"	"30"	7	A85	V17	6/7/2007	F42Z	1700	A	VALVE & CAP AS "05471 "	JIM BURKE FORD
448577542	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	627749	"5K02"		3	G29	V83	6/8/2007	5L3Z	1700	A	VALVE & CAP AS "03689 "	MAN-O-WAR FORD
448579035	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	629242	"5K02"		12	G29	V83	6/8/2007	5L3Z	1700	A	VALVE & CAP AS "08766 "	ELLSWORTH FORD
448640601	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	632961	"5K02"		0	A85	V17	6/11/2007	6C3Z	1700	A	VALVE & CAP AS "04120 "	COCONUT POINT FC
449415207	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	648951	"5K02"	"05"	9	B65	V88	6/14/2007		1700		VALVE & CAP AS "03820 "	LANDERS FORD LIN
449416973	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	650717	"5K02"	"05"	1	B65	V88	6/14/2007		1700		VALVE & CAP AS "08913 "	REGAN FORD, INC.
449483176	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	656224	"5K02"	"30"	1	A85	V17	6/15/2007	F42Z	1700	A	VALVE & CAP AS "13354 "	PORT MOTORS LINK
449552615	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	658117	"5K02"		2	B65	V88	6/18/2007	5L3Z	1700	A	VALVE & CAP AS "00141 "	OURISMAN FORD LI
449554347	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	659849	"5K02"	"05"	8	C50	V89	6/18/2007		1700		VALVE & CAP AS "04329 "	COURTESY FORD C
449637594	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	666009	"5K02"	"05"	0	A40	V83	6/19/2007		1700		VALVE & CAP AS "04867 "	MIKE SHAD FORD L
449793859	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	675285	"5K02"	"05"	0	H44	V89	6/21/2007		1700		VALVE & CAP AS "B8013 "	GALLINGER MOTOF
449795138	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	676566	"5K02"		5	B62	V75	6/21/2007	5F9Z	1700	AB	VALVE & CAP AS "02694 "	DEAN SELLERS INC
449797168	AWS	chassis;wheel assy;wheels/rims;v damage;frozen/seized;function-i N	678596	"5K02"	"05"	1	C50	V89	6/21/2007		1700		VALVE & CAP AS "08452 "	NEW BRIGHTON FO



449939515	AWS	chassis;wheel assy;wheels/rims;v damage-chafed/excessive wear N	687818	"5K02"	"30"	0	B65	V88	6/25/2007	F42Z	1700 A	VALVE & CAP AS "03334 "	CHARLES GABUS FI
449939623	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	687926	"5K02"	"05"	0	B65	V88	6/25/2007		1700	VALVE & CAP AS "03701 "	JACK TREBOUR FOI
450027013	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	691870	"5K02"	"05"	2	H26	V89	6/26/2007		1700	VALVE & CAP AS "A3251 "	MAHONE AUTO SEF
450028352	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	693209	"5K02"	"05"	2	B65	V88	6/26/2007		1700	VALVE & CAP AS "01360 "	NEW HOLLAND FOF
450028841	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	693698	"5K02"	"28"	4	B65	V88	6/26/2007	3W1Z	1700 XA	VALVE & CAP AS "02617 "	BIRD/KULTGEN INC
450030519	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	695376	"5K02"		6	B65	V88	6/26/2007	5F9Z	1700 AB	VALVE & CAP AS "05809 "	DWAIN SEATON FO
450030789	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	695646	"5K02"	"30"	0	B65	V88	6/26/2007	F42Z	1700 A	VALVE & CAP AS "06721 "	JONES FORD
450108325	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	701771	"5K02"	"05"	1	H62	V89	6/27/2007		1700	VALVE & CAP AS "06716 "	KIMNACH FORD INC
450109291	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	702740	"5K02"	"30"	3	B65	V88	6/27/2007	F42Z	1700 A	VALVE & CAP AS "09695 "	FOUR SEASONS FO
450109958	AWS	chassis;wheel assy;wheels/rims;v administrative cost;damage-craç N	703413	"5K02"	"05"	3	B65	V88	6/27/2007		1700	VALVE & CAP AS "12825 "	PAUL CERAME LINC
450445185	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	728484	"5K02"	"05"	8	B65	V88	7/3/2007		1700	VALVE & CAP AS "09957 "	STOCKBRIDGE FOR

450550274	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	738224	"5K02"	6	B65	V88	7/6/2007	5F9Z	1700	AB	VALVE & CAP AS "05340 "	ROYAL OAK FORD	
450729370	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	757156	"5K02"	"30"	2	B65	V88	7/11/2007	F42Z	1700	A	VALVE & CAP AS "11117 "	GREECE RIDGE LIN
451003075	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	772702	"5K02"		7	B65	V88	7/16/2007	6C3Z	1700	A	VALVE & CAP AS "06443 "	BOLTON FORD, L.L
451082815	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	776553	"5K02"		0	B65	V88	7/17/2007	6C3Z	1700	A	VALVE & CAP AS "00635 "	BISON TRUCK CENT
451084136	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	777877	"5K02"	"30"	3	B65	V88	7/17/2007	F42Z	1700	A	VALVE & CAP AS "03893 "	VISTA FORD OF OXI
451154786	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	781755	"5K02"	"30"	1	B65	V88	7/18/2007	F42Z	1700	A	VALVE & CAP AS "A1323 "	EAST-COURT FORD
451155086	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	782058	"5K02"	"05"	5	B66	V75	7/18/2007		1700		VALVE & CAP AS "B2561 "	VILLENEUVE FORD
451298394	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	794851	"5K02"		8	H62	V89	7/20/2007	5F9Z	1700	AB	VALVE & CAP AS "00765 "	CHAMPION FORD S.
451374148	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	800425	"5K02"	"05"	0	B65	V88	7/23/2007		1700		VALVE & CAP AS "00010 "	KOONS COLLEGE P PE08-060 0884

451463727	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	814949	"5K02"	"05"	0	G29	V83	7/25/2007	1700	VALVE & CAP AS "01548 "	JOE COTTON FORD	
451633941	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	821799	"5K02"	"05"	6	B65	V88	7/26/2007	1700	VALVE & CAP AS "01330 "	JOHN KENNEDY FO	
451635037	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	822899	"5K02"	"05"	10	G29	V83	7/26/2007	1700	VALVE & CAP AS "03820 "	LANDERS FORD LIN	
451638165	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	826037	"5K02"		5	H62	V89	7/26/2007	5F9Z	1700 AB	VALVE & CAP AS "20589 "	LARSON FORD, INC
451710563	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	830688	"5K02"	"05"	0	B65	V88	7/27/2007		1700	VALVE & CAP AS "08986 "	BILL DUBE FORD
451710901	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	831026	"5K02"	"30"	1	B65	V88	7/27/2007	F42Z	1700 A	VALVE & CAP AS "10042 "	THOMPSON LINCOL
451877651	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	850678	"5K02"	"30"	10	N23	V89	7/31/2007	F42Z	1700 A	VALVE & CAP AS "04730 "	CRAIN FORD, INC.
451979397	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	857188	"5K02"	"05"	8	H62	V89	8/1/2007		1700	VALVE & CAP AS "02013 "	NEWBERRY FORD,

451982515	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	860309	"5K02"	"30"	4	H62	V89	8/1/2007	F42Z	1700 A	VALVE & CAP AS "09602 "	DEAN ARBOUR F-M
452051531	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	863747	"5K02"	"30"	8	B65	V88	8/2/2007	F42Z	1700 A	VALVE & CAP AS "02731 "	ATCHINSON FORD S
452052173	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	864391	"5K02"		2	B65	V88	8/2/2007	5F9Z	1700 AB	VALVE & CAP AS "04617 "	CHAMPION FORD K.
452121134	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	869115	"5K02"		5	B65	V88	8/3/2007	5F9Z	1700 AB	VALVE & CAP AS "01626 "	ARUNDEL FORD
452335282	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	886254	"5K02"	"05"	7	B65	V88	8/8/2007		1700	VALVE & CAP AS "00469 "	BONDY'S FORD, INC
452405021	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	891462	"5K02"	"05"	2	H62	V89	8/9/2007		1700	VALVE & CAP AS "A1327 "	AL PALLADINI'S PIN
452408839	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	895283	"5K02"		1	B65	V88	8/9/2007	6C3Z	1700 A	VALVE & CAP AS "06633 "	CAVALIER FORD
452628849	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	913279	"5K02"		0	B65	V88	8/14/2007	5F9Z	1700 AB	VALVE & CAP AS "03830 "	ROCHESTER FORD
452702398	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	917994	"5K02"	"05"	5	B65	V88	8/15/2007	FOVY	1700 A	VALVE & CAP AS "B8401 "	ROSE CITY FORD S.
452707377	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	922975	"5K02"	"30"	3	B65	V88	8/15/2007	F42Z	1700 A	VALVE & CAP AS "11619 "	SCANLON LINCOLN
452772243	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	925153	"5K02"	"30"	1	H62	V89	8/16/2007	F42Z	1700 A	VALVE & CAP AS "00407 "	THOMASTON FORD
452772604	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	925514	"5K02"	"07"	9	H62	V89	8/16/2007	2C3Z	1700 BA	VALVE & CAP AS "01401 "	HAGERSTOWN FOF
452776738	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	929652	"5K02"	"28"	5	B66	V75	8/16/2007	3W1Z	1700 XA	VALVE & CAP AS "20328 "	SUNSET FORD, INC

453118313	AWS	chassis;wheel assy;wheels/rims;v damage-road hazard;leak-poros N	954885	"5K02"	"28"	6	H62	V89	8/22/2007	3W1Z	1700 XA	VALVE & CAP AS "08190 "	PARAMUS FORD
453205314	AWS	chassis;wheel assy;wheels/rims;v frozen/seized;nvh-rough ride N	957400	"5K02"	"05"	12	C50	V89	8/23/2007		1700	VALVE & CAP AS "B2555 "	AUTO DESROSIERS
453205682	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	957768	"5K02"	"05"	12	B65	V88	8/23/2007	FOVY	1700 A	VALVE & CAP AS "B8242 "	MONTGOMERY FOF
453296637	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	966390	"5K02"		2	B65	V88	8/24/2007	6C2Z	1700 A	VALVE & CAP AS "04745 "	BREMEN FORD, INC
453391444	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	973535	"5K02"	"30"	6	B65	V88	8/27/2007	FOTZ	1700 AA	VALVE & CAP AS "05126 "	GARY CROSSLEY FI
453391747	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	973838	"5K02"	"05"	9	B65	V88	8/27/2007		1700	VALVE & CAP AS "05574 "	PALM SPRINGS FOF
453502337	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	979798	"5K02"	"30"	8	B65	V88	8/28/2007	F42Z	1700 A	VALVE & CAP AS "02746 "	ROMEO FORD INC

453503763	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	981224	"5K02"	"30"	1	N51	V39	8/28/2007	FOTZ	1700	AA	VALVE & CAP AS "05126 "	GARY CROSSLEY F
453505537	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	982998	"5K02"	"05"	11	B65	V88	8/28/2007		1700		VALVE & CAP AS "09168 "	BOB FRANCIS FOR
453607181	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	987029	"5K02"	"05"	4	B65	V88	8/29/2007		1700		VALVE & CAP AS "02200 "	CLASSIC FORD MEF
454082302	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	1	G29	V83	9/5/2007		1700		VALVE & CAP AS "09541 "	SUMMIT FORD
454082990	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		4	G29	V83	9/5/2007	5F9Z	1700	AB	VALVE & CAP AS "13924 "	SHEPHERD LINCOL
454083811	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		13	B65	V88	9/6/2007	6C3Z	1700	A	VALVE & CAP AS "B1210 "	EDWARDS FORD SA
454085859	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	6	B65	V88	9/6/2007	F42Z	1700	A	VALVE & CAP AS "02561 "	SEWELL FORD, INC
454088581	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	1	B65	V88	9/6/2007		1700		VALVE & CAP AS "09640 "	C. WIMBERLEY FOF

454088582	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	0	B65	V88	9/6/2007		1700	VALVE & CAP AS "09640 "	C. WIMBERLEY FOF
454088583	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	0	B65	V88	9/6/2007		1700	VALVE & CAP AS "09640 "	C. WIMBERLEY FOF
454089255	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	5	B65	V88	9/6/2007	F42Z	1700 A	VALVE & CAP AS "20051 "	DAHL FORD DAVEN
454095070	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		3	B65	V88	9/7/2007	5F9Z	1700 AB	VALVE & CAP AS "13641 "	NAPLETON LINCOLI
454096307	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	0	H26	V89	9/10/2007	F42Z	1700 A	VALVE & CAP AS "B4028 "	CYPRESS MOTORS
454097551	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	6	B65	V88	9/10/2007	F42Z	1700 A	VALVE & CAP AS "01014 "	DALE JARRETT FOF
454097876	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	8	A99	V99	9/10/2007	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
454101919	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	1	B65	V88	9/10/2007		1700	VALVE & CAP AS "10518 "	HIGHLAND PARK FC
454105028	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		8	H62	V89	9/11/2007	5L3Z	1700 A	VALVE & CAP AS "00487 "	JOHN BLEAKLEY FC
454107331	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	3	G29	V83	9/11/2007	F42Z	1700 A	VALVE & CAP AS "05065 "	LOUISBURG FORD S

454113251	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke	N	1E+06	"5K02"		7	B65	V88	9/12/2007	5L3Z	1700	A	VALVE & CAP AS "02960 "	WEST-HERR FORD
454129397	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"	"30"	5	B65	V88	9/14/2007	F42Z	1700	A	VALVE & CAP AS "09685 "	CROSSROADS FOR
454791847	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"		4	B65	V88	9/17/2007	5F9Z	1700	AB	VALVE & CAP AS "03702 "	SCARSDALE FORD,
454792017	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"		7	H62	V89	9/17/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK
454796074	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"	"30"	5	H26	V89	9/17/2007	F42Z	1700	A	VALVE & CAP AS "20590 "	LATHAM MOTORS, I
454884304	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"	"30"	10	B65	V88	9/18/2007	F42Z	1700	A	VALVE & CAP AS "B2447 "	VAL ESTRIE FORD L
454884790	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"		4	A40	V83	9/18/2007	5F9Z	1700	A	VALVE & CAP AS "B8216 "	ERIC CAMPBELL FC
454887149	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"		6	B65	V88	9/18/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK
454887150	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"	"30"	6	B65	V88	9/18/2007	F42Z	1700	A	VALVE & CAP AS "03997 "	PRINCE FREDERICK
454888180	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"	"05"	2	B65	V88	9/18/2007		1700		VALVE & CAP AS "05574 "	PALM SPRINGS FOF



454888999	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	14	G29	V83	9/18/2007	F42Z	1700	A	VALVE & CAP AS "07986 "	WEBSTER FORD LIN
455057808	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	3	H44	V89	9/20/2007		1700		VALVE & CAP AS "B1335 "	LANGE & FETTER M
455058191	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	3	C50	V89	9/20/2007		1700		VALVE & CAP AS "B6258 "	PEACE RIVER FORD
455060665	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		7	B65	V88	9/20/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK
455060666	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		7	B65	V88	9/20/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK
455060934	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	7	H62	V89	9/20/2007		1700		VALVE & CAP AS "04631 "	ANGOLA FORD MEF
455143739	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	4	H62	V89	9/21/2007	F42Z	1700	A	VALVE & CAP AS "11164 "	METROPOLITAN LIN
455213335	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		3	H45	V89	9/24/2007	5L3Z	1700	A	VALVE & CAP AS "B8178 "	STAUFFER MOTOR&
455215414	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		9	H62	V89	9/24/2007	5F9Z	1700	AB	VALVE & CAP AS "03214 "	EAGLE COUNTRY FI
455308949	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	2	H62	V89	9/25/2007		1700		VALVE & CAP AS "B4400 "	MID-TOWN FORD S/

455310460	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	7	B65	V88	9/25/2007		1700	VALVE & CAP AS "01548 "	JOE COTTON FORD
455312760	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	5	H62	V89	9/25/2007	F42Z	1700 A	VALVE & CAP AS "05503 "	KIEFFE & SONS FO
455397980	AWS	chassis;wheel assy;wheels/rims;v administrative cost;damage-cra	1E+06	"5K02"	"05"	7	B65	V88	9/26/2007		1700	VALVE & CAP AS "01337 "	DUNPHY MOTORS, I
455399558	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		17	B65	V88	9/26/2007	5F9Z	1700 AB	VALVE & CAP AS "04231 "	CHAMPION FORD
455402678	AWS	chassis;wheel assy;wheels/rims;v loose;mod-indicator light/warnin N	1E+06	"5K02"	"05"	5	G29	V83	9/26/2007		1700	VALVE & CAP AS "10931 "	BOB MAXEY LINCOL
455481184	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	2	B65	V88	9/27/2007		1700	VALVE & CAP AS "B3352 "	CHEBUCTO FORD S
455484764	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	1E+06	"5K02"	"30"	1	B65	V88	9/27/2007	F42Z	1700 A	VALVE & CAP AS "04945 "	BILL CURRIE FORD
455485081	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	2	B65	V88	9/27/2007	F42Z	1700 A	VALVE & CAP AS "05432 "	RANCHO FORD L-M
455485538	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	9	B65	V88	9/27/2007	F42Z	1700 A	VALVE & CAP AS "05896 "	GENE LANGLEY FOI
455485881	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	4	G29	V83	9/27/2007		1700	VALVE & CAP AS "06939 "	LATROBE FORD, INC
455570263	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	1E+06	"5K02"		7	B65	V88	9/28/2007	5F9Z	1700 AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK

455571553	AWS	chassis;wheel assy;wheels/rims;v damage;function-malfunction/in	N	1E+06	"5K02"	"30"	6	B65	V88	9/28/2007	F42Z	1700	A	VALVE & CAP AS "05618 "	BOB SWOPE FORD,
455573588	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"	"30"	9	B65	V88	9/28/2007	F42Z	1700	A	VALVE & CAP AS "09925 "	SALE FORD OF KIN
455663138	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"	"05"	5	A40	V83	10/1/2007		1700		VALVE & CAP AS "B6280 "	DENNY ANDREWS F
455664272	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"		5	B66	V75	10/1/2007	6C3Z	1700	A	VALVE & CAP AS "01151 "	MEDFORD FORD, IN
455666081	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"		8	B65	V88	10/1/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERIC
455755875	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun	N	1E+06	"5K02"		7	G29	V83	10/2/2007	5F9Z	1700	AB	VALVE & CAP AS "02284 "	JOHN LANCE FORD
455757356	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	1E+06	"5K02"	"30"	2	B65	V88	10/2/2007	F42Z	1700	A	VALVE & CAP AS "05201 "	UNITED FORD - NOF
455760233	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	1E+06	"5K02"	"05"	7	B65	V88	10/2/2007		1700		VALVE & CAP AS "47540 "	U-HAUL - SCHERER

455868582	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	1	G29	V83	10/3/2007	F42Z	1700	A	VALVE & CAP AS "08017 "	AUFFENBERG FORI
455936136	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	10	A40	V83	10/4/2007	F42Z	1700	A	VALVE & CAP AS "A6035 "	BIG M FORD LINCOL
455940825	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	7	B65	V88	10/4/2007		1700		VALVE & CAP AS "08578 "	TOM DENCHEL FOR
455944158	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	7	B65	V88	10/5/2007	F42Z	1700	A	VALVE & CAP AS "00601 "	WEST-HERR FORD,
455945480	AWS	chassis;wheel assy;wheels/rims;v leak-air/dust;loose;mod-indicato N	1E+06	"5K02"	"05"	12	G29	V83	10/5/2007		1700		VALVE & CAP AS "03701 "	JACK TREBOUR FOI
456068180	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	2	B65	V88	10/8/2007	F42Z	1700	A	VALVE & CAP AS "00210 "	SUNNY KING FORD
456070511	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		5	B65	V88	10/8/2007	6C3Z	1700	A	VALVE & CAP AS "04617 "	CHAMPION FORD K.

456229017	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	6	B65	V88	10/10/2007		1700	VALVE & CAP AS "00095 "	CROUSE FORD SAL
456229287	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	7	H62	V89	10/10/2007	F42Z	1700 A	VALVE & CAP AS "00815 "	RONNIE WATKINS F
456232624	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	2	B65	V88	10/10/2007	F42Z	1700 A	VALVE & CAP AS "07869 "	GAUDIN FORD
456233210	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	6	B65	V88	10/10/2007		1700	VALVE & CAP AS "09137 "	SARAT FORD SALES
456233757	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		9	H62	V89	10/10/2007	5F9Z	1700 AB	VALVE & CAP AS "10560 "	STRIETER MOTOR C
456302249	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	16	C50	V89	10/11/2007	F42Z	1700 A	VALVE & CAP AS "B4077 "	CARDEAGER FORD
456368675	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		12	A40	V83	10/12/2007	5F9Z	1700 AB	VALVE & CAP AS "A1075 "	JIM KEAY FORD LIN
456370946	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	20	G29	V83	10/12/2007	F42Z	1700 A	VALVE & CAP AS "02967 "	GORNIO BROS INC
456372483	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	9	B65	V88	10/12/2007		1700	VALVE & CAP AS "06249 "	LES STUMPF FORD
456379431	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	1E+06	"5K02"	"28"	8	B65	V88	10/15/2007	3W1Z	1700 XA	VALVE & CAP AS "04866 "	WHITE FORD COMP

456380844	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	6	B65	V88	10/15/2007	5F9Z	1700	AB	VALVE & CAP AS "07777 "	FUTURE FORD OF C	
456537389	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	12	G29	V83	10/16/2007	1700		VALVE & CAP AS "B7232 "	COASTAL FORD SAI	
456540925	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	6	A40	V83	10/16/2007	F42Z	1700	A	VALVE & CAP AS "05503 "	KIEFFE & SONS FOF
456542949	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	7	B65	V88	10/16/2007	F42Z	1700	A	VALVE & CAP AS "10464 "	NORTHEAST LINCO
456616841	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	1E+06	"5K02"	"30"	10	B65	V88	10/17/2007	F42Z	1700	A	VALVE & CAP AS "01109 "	BILL SMITH FORD IN
456617358	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	7	B65	V88	10/17/2007	F42Z	1700	A	VALVE & CAP AS "02337 "	FINDLAY FORD LINC
456620125	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	4	N24	V89	10/17/2007	FOTZ	1700	AA	VALVE & CAP AS "07618 "	CHESTATEE FORD
456620329	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		7	B65	V88	10/17/2007	5F9Z	1700	AB	VALVE & CAP AS "07923 "	VISTA FORD
456769935	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	8	B65	V88	10/19/2007		1700		VALVE & CAP AS "07986 "	WEBSTER FORD LIN
456843298	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	7	B65	V88	10/22/2007	F42Z	1700	A	VALVE & CAP AS "06314 "	THE MOTOR COMP/
456843299	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	7	B65	V88	10/22/2007	F42Z	1700	A	VALVE & CAP AS "06314 "	THE MOTOR COMP/

457212282	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"28"	8	B65	V88	10/25/2007	3W1Z	1700	XA	VALVE & CAP AS "05325 "	SHAWNEE MISSION
457282799	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		2	B66	V75	10/26/2007	5F9Z	1700	A	VALVE & CAP AS "A1075 "	JIM KEAY FORD LIN
457365609	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu N	1E+06	"5K02"	"30"	8	H62	V89	10/29/2007	F42Z	1700	A	VALVE & CAP AS "12805 "	ROB SIGHT FORD L
457461431	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	1E+06	"5K02"	"30"	7	B65	V88	10/30/2007	F42Z	1700	A	VALVE & CAP AS "06787 "	LAKE ELSINORE FO
457471348	AWS	chassis;wheel assy;wheels/rims;v leak-air/dust;leak-porosity ;tire-f N	1E+06	"5K02"	"30"	11	H62	V89	10/31/2007	F42Z	1700	A	VALVE & CAP AS "06851 "	HINCHEY FORD INC
457472503	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	2	B65	V88	10/31/2007		1700		VALVE & CAP AS "08828 "	HERB CHAMBERS F
457473544	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	1E+06	"5K02"	"30"	5	B65	V88	10/31/2007	F42Z	1700	A	VALVE & CAP AS "10712 "	JACK DEMMER LINC
457629927	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		7	B65	V88	11/1/2007	5F9Z	1700	AB	VALVE & CAP AS "04231 "	CHAMPION FORD
457693008	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	10	B65	V88	11/2/2007		1700		VALVE & CAP AS "00404 "	DON RICH FORD CC
457694515	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		9	B65	V88	11/2/2007	5F9Z	1700	AB	VALVE & CAP AS "03997 "	PRINCE FREDERICK
457773443	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	6	L29	V77	11/6/2007		1700		VALVE & CAP AS "02686 "	BRIARWOOD FORD

457773651	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	9	B65	V88	11/6/2007	F42Z	1700	A	VALVE & CAP AS "02934 "	ROY O'BRIEN, INC.
457778591	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	4	B66	V75	11/8/2007	FOVY	1700	A	VALVE & CAP AS "A8053 "	AIRPORT FORD LIN
457782963	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		9	B65	V88	11/8/2007	5L3Z	1700	A	VALVE & CAP AS "06543 "	SUPERIOR FORD, IN
457783922	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	6	B65	V88	11/8/2007	F42Z	1700	A	VALVE & CAP AS "08939 "	DAVID FORD LINCO
457784786	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	7	B65	V88	11/8/2007		1700		VALVE & CAP AS "11198 "	GANLEY LINCOLN M
458027173	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	8	B65	V88	11/12/2007	F42Z	1700	A	VALVE & CAP AS "00601 "	WEST-HERR FORD,
458110179	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	18	A40	V17	11/13/2007	F42Z	1700	A	VALVE & CAP AS "10456 "	HONESDALE LINCO
458178657	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	1E+06	"5K02"		12	B65	V88	11/14/2007	6C3Z	1700	A	VALVE & CAP AS "06933 "	ROGER SHIFLETT F
458316037	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	6	B65	V88	11/16/2007		1700		VALVE & CAP AS "07663 "	FAIRPORT FORD, LI
458316263	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	9	H62	V89	11/16/2007		1700		VALVE & CAP AS "07987 "	MOTOR INN OF ALG
458318167	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	13	B65	V88	11/16/2007	F42Z	1700	A	VALVE & CAP AS "13100 "	GERVAIS LINCOLN-I
458319287	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	12	B65	V88	11/19/2007		1700		VALVE & CAP AS "B4091 "	KEYSTONE FORD S
458320111	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		7	B65	V88	11/19/2007	5F9Z	1700	AB	VALVE & CAP AS "00572 "	EMERLING FORD M
458322142	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		9	B65	V88	11/19/2007	5F9Z	1700	AB	VALVE & CAP AS "04100 "	HAMMONTON FORD



458469159	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	11	B65	V88	11/20/2007	F42Z	1700	A	VALVE & CAP AS "06993 "	TOM SMITH FORD
458470426	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	7	A40	V17	11/20/2007	F42Z	1700	A	VALVE & CAP AS "09844 "	CAPITAL FORD LINC
458537772	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	10	H62	V89	11/21/2007		1700		VALVE & CAP AS "B8030 "	LESLIE MOTORS LT
458538411	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	1E+06	"5K02"	"05"	8	B65	V88	11/21/2007		1700		VALVE & CAP AS "00601 "	WEST-HERR FORD,
458538665	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		10	A40	V17	11/21/2007	5F9Z	1700	AB	VALVE & CAP AS "01219 "	FALL RIVER FORD, I
458538666	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	17	B65	V88	11/21/2007		1700		VALVE & CAP AS "01220 "	KELLER BROS. MOT
458542452	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	1	A40	V17	11/21/2007	F42Z	1700	A	VALVE & CAP AS "08654 "	HOOD RIVER FORD.
458543638	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	1	H39	V21	11/21/2007		1700		VALVE & CAP AS "12703 "	FRESNO LINCOLN-M
458641797	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	13	B65	V88	11/23/2007		1700		VALVE & CAP AS "04260 "	CROWLEY FORD LII PE08-060 0899

458695445	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	9	B65	V88	11/26/2007	F42Z	1700 A	VALVE & CAP AS "02818 "	HERTRICH'S F-L-M C
458698455	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"30"	10	B65	V88	11/26/2007	F42Z	1700 A	VALVE & CAP AS "08193 "	JACK SCHMITT FOR
458699501	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	9	H26	V89	11/26/2007	F42Z	1700 A	VALVE & CAP AS "10597 "	WRIGHT BROTHERS
458946104	AWS	chassis;wheel assy;wheels/rims;v damage-chafed/excessive wear N	1E+06	"5K02"	"30"	13	A99	V99	11/27/2007	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
458947098	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	8	B65	V88	11/27/2007		1700	VALVE & CAP AS "03334 "	CHARLES GABUS FI
458948694	AWS	chassis;wheel assy;wheels/rims;v damage-bent/buckled/kinked;fu N	1E+06	"5K02"	"28"	2	B65	V88	11/27/2007	3W1Z	1700 XA	VALVE & CAP AS "05613 "	LANCE CUNNINGHA
458948911	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu N	1E+06	"5K02"	"30"	10	A40	V17	11/27/2007	F42Z	1700 A	VALVE & CAP AS "05879 "	STEVE MARSH FOR
458949107	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"		7	B65	V88	11/27/2007	5L3Z	1700 A	VALVE & CAP AS "06314 "	THE MOTOR COMP/

458949452	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	6	B65	V88	11/27/2007		1700	VALVE & CAP AS "07318 "	BEDFORD FORD LIN
459019092	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	3	H39	V21	11/28/2007		1700	VALVE & CAP AS "A1091 "	POLITO FORD LINCO
459019963	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	15	A40	V17	11/28/2007	F42Z	1700 A	VALVE & CAP AS "B8216 "	ERIC CAMPBELL FC
459022657	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"05"	11	B65	V88	11/28/2007		1700	VALVE & CAP AS "04005 "	FLOOD FORD OF EA
459026601	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	3	B65	V88	11/28/2007	F42Z	1700 A	VALVE & CAP AS "11623 "	VENICE LINCOLN M
459095374	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	1E+06	"5K02"	"05"	9	B65	V88	11/29/2007		1700	VALVE & CAP AS "B7230 "	OCEAN PARK FORD
459099672	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"		7	B65	V88	11/29/2007	6C3Z	1700 A	VALVE & CAP AS "05718 "	COLE FORD-MERCL
459176298	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	1E+06	"5K02"	"30"	8	B65	V88	11/30/2007	F42Z	1700 A	VALVE & CAP AS "01856 "	PRIDE FORD OF NO
459263257	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	1E+06	"5K02"	"05"	3	H44	V89	12/3/2007		1700	VALVE & CAP AS "01077 "	GEORGE COLEMAN
459484377	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	10	TB8	V88	12/6/2007	F42Z	1700 A	VALVE & CAP AS "02890 "	RUSS MILNE FORD,
459487842	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		9	A40	V17	12/6/2007	5F9Z	1700 AB	VALVE & CAP AS "10736 "	GANLEY LINCOLN-M
460462144	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	9	B65	V88	12/7/2007	F42Z	1700 A	VALVE & CAP AS "B8043 "	MACMICKING MOTC
460521988	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	4	A40	V17	12/10/2007	F42Z	1700 A	VALVE & CAP AS "B8425 "	BLACKSTOCK FORD

460522522	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	N25	V89	12/10/2007	F42Z	1700	A	VALVE & CAP AS "00345 "	RICHARD HANEY FC
460522731	AWS	chassis;wheel assy;wheels/rims;v fire;function-malfunction/inoperat	2E+06	"5K02"	"30"	10	H44	V89	12/10/2007	F42Z	1700	A	VALVE & CAP AS "00671 "	NYE FORD, LINCOLN
460606373	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	13	E40	V17	12/11/2007	F42Z	1700	A	VALVE & CAP AS "B8047 "	HANNA MOTOR SAL
460610178	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	2E+06	"5K02"		6	B65	V88	12/11/2007	5F9Z	1700	AB	VALVE & CAP AS "05613 "	LANCE CUNNINGHAM
460610344	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	9	H62	V89	12/11/2007		1700		VALVE & CAP AS "05978 "	TROTTER FORD
460767914	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		11	B65	V88	12/12/2007	5L3Z	1700	A	VALVE & CAP AS "00976 "	D & D MOTORS, INC
460769029	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	11	B65	V88	12/12/2007		1700		VALVE & CAP AS "03043 "	RHINEBECK FORD,
460772396	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		9	B65	V88	12/12/2007	5F9Z	1700	AB	VALVE & CAP AS "09734 "	FLADEBOE FORD-M
460841518	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		3	B65	V88	12/13/2007	5F9Z	1700	AB	VALVE & CAP AS "06450 "	ROUNTREE FORD, I
460843283	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	11	B65	V88	12/13/2007	F42Z	1700	A	VALVE & CAP AS "10924 "	PLAINFIELD LINCOLN
462104894	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		9	B65	V88	12/17/2007	5F9Z	1700	AB	VALVE & CAP AS "03605 "	SUNSHINE FORD LIA
462107897	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	2E+06	"5K02"	"05"	9	B65	V88	12/17/2007		1700		VALVE & CAP AS "08862 "	PORTSMOUTH FOR
462183618	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	16	B65	V88	12/18/2007	F42Z	1700	A	VALVE & CAP AS "B8440 "	BROCK FORD SALE
462187439	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		2	B65	V88	12/18/2007	5F9Z	1700	AB	VALVE & CAP AS "06107 "	DICK BRANTMEIJER

462337168	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"07"	14	H45	V89	12/20/2007	2C3Z	1700	CA	VALVE & CAP AS "B8178 "	STAUFFER MOTOR&
462338223	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	2E+06	"5K02"		10	H39	V21	12/20/2007	5F9Z	1700	AB	VALVE & CAP AS "01249 "	BROWN-DAUB FORI
462416913	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	9	B65	V88	12/21/2007	F42Z	1700	A	VALVE & CAP AS "47540 "	U-HAUL - SCHERER
462541547	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	3	A40	V17	12/26/2007	F42Z	1700	A	VALVE & CAP AS "02539 "	VICTORY FORD
462591096	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		0	B65	V88	12/27/2007	5L3Z	1700	A	VALVE & CAP AS "04790 "	GARY YEOMANS FC
462591779	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		11	B65	V88	12/27/2007	5L3Z	1700	A	VALVE & CAP AS "05618 "	BOB SWOPE FORD,
462658715	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	15	C50	V89	12/28/2007		1700		VALVE & CAP AS "02728 "	BROWN'S FORD & M
462659102	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	B65	V88	12/28/2007	F42Z	1700	A	VALVE & CAP AS "03334 "	CHARLES GABUS FI
462740725	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	4	B65	V88	1/1/2008	F42Z	1700	A	VALVE & CAP AS "01856 "	PRIDE FORD OF NO
462872034	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	10	B65	V88	1/3/2008	F42Z	1700	A	VALVE & CAP AS "04947 "	WALKER FORD COM
462940274	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	2E+06	"5K02"	"30"	0	B65	V88	1/4/2008	F42Z	1700	A	VALVE & CAP AS "13100 "	GERVAIS LINCOLN-I
462998810	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	4	B65	V88	1/7/2008	F42Z	1700	A	VALVE & CAP AS "04466 "	BOGGUS FORD
462999888	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	2E+06	"5K02"		7	B65	V88	1/7/2008	6C3Z	1700	A	VALVE & CAP AS "05774 "	GRAHAM FORD-LIN
463001844	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	9	N25	V89	1/7/2008	F42Z	1700	A	VALVE & CAP AS "10000 "	HINDER MOTORS,IN

463119158	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	B65	V88	1/8/2008	F42Z	1700	A	VALVE & CAP AS "03253 "	PLANET FORD
463119295	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		10	B66	V75	1/8/2008	5L3Z	1700	A	VALVE & CAP AS "03689 "	MAN-O-WAR FORD
463187442	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	9	A40	V17	1/9/2008	F42Z	1700	A	VALVE & CAP AS "B1082 "	MOYNES FORD SAL
463419600	AWS	chassis;wheel assy;wheels/rims;v leak-failed gasket/seal/weatherc N	2E+06	"5K02"	"30"	9	C50	V89	1/10/2008	F42Z	1700	A	VALVE & CAP AS "B2421 "	JOLIETTE FORD INC
463423362	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	2E+06	"5K02"	"05"	9	B65	V88	1/10/2008		1700		VALVE & CAP AS "04950 "	VELDE FORD INC
463424988	AWS	chassis;wheel assy;wheels/rims;v administrative cost;damage;dan N	2E+06	"5K02"	"05"	9	B65	V88	1/10/2008		1700		VALVE & CAP AS "08578 "	TOM DENCHEL FOR
463425173	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	1	A40	V17	1/10/2008	F42Z	1700	A	VALVE & CAP AS "09015 "	PUTNAM FORD-MEF
463430590	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	9	H21	V87	1/11/2008		1700		VALVE & CAP AS "03820 "	LANDERS FORD LIN
463431925	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"07"	8	B65	V88	1/11/2008	2C3Z	1700	CA	VALVE & CAP AS "06231 "	COLERAIN FORD
463433424	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	9	B65	V88	1/11/2008		1700		VALVE & CAP AS "09971 "	JOEL CONFER FORI
463567662	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		13	B65	V88	1/14/2008	5L3Z	1700	A	VALVE & CAP AS "00976 "	D & D MOTORS, INC PE08-060 0904

463568898	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	13	B65	V88	1/14/2008	F42Z	1700	A	VALVE & CAP AS "02812 "	LAKE CITY FORD, LI
463573956	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	11	H62	V89	1/14/2008	F42Z	1700	A	VALVE & CAP AS "12805 "	ROB SIGHT FORD L
463652107	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	12	B65	V88	1/15/2008		1700		VALVE & CAP AS "00404 "	DON RICH FORD CC
463727405	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	7	B65	V88	1/16/2008	F42Z	1700	A	VALVE & CAP AS "01856 "	PRIDE FORD OF NO
463799461	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	6	A40	V17	1/17/2008		1700		VALVE & CAP AS "B2503 "	CARLE FORD INC.
463872678	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	A40	V17	12/5/2007	F42Z	1700	A	VALVE & CAP AS "04332 "	ARMSTRONG FORD
463873881	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	10	B65	V88	12/5/2007	F42Z	1700	A	VALVE & CAP AS "06414 "	CROSSROADS FOR
463874021	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		8	B66	V75	12/5/2007	5F9Z	1700	AB	VALVE & CAP AS "06779 "	DUNCAN FORD LINK
463874503	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	12	B65	V88	12/5/2007		1700		VALVE & CAP AS "08294 "	TRI FORD-MERCUR'
464020719	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		10	A40	V17	1/21/2008	5F9Z	1700	AB	VALVE & CAP AS "04892 "	DON REID FORD, IN
464112993	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		7	B65	V88	1/22/2008	5F9Z	1700	A	VALVE & CAP AS "07661 "	LAUREL FORD LINC

464114056	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	A40	V17	1/22/2008	F42Z	1700 A	VALVE & CAP AS "09555 "	GULF BREEZE FORI
464116135	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"28"	7	B66	V75	1/23/2008	3W1Z	1700 XA	VALVE & CAP AS "A1059 "	OAK-LAND FORD LII
464117588	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	A40	V17	1/23/2008	F42Z	1700 A	VALVE & CAP AS "00427 "	MARSHALL FORD LI
464119536	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	15	B65	V88	1/23/2008		1700	VALVE & CAP AS "04290 "	MATLOCK FORD-ME
464256813	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	14	H20	V21	1/24/2008		1700	VALVE & CAP AS "A1327 "	AL PALLADINI'S PIN
464257176	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	13	A40	V17	1/24/2008		1700	VALVE & CAP AS "B2503 "	CARLE FORD INC.
464263815	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	1	H62	V89	1/24/2008	F42Z	1700 A	VALVE & CAP AS "12805 "	ROB SIGHT FORD L
464331501	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"07"	16	B65	V88	1/25/2008	2C3Z	1700 CA	VALVE & CAP AS "01545 "	FOX VALLEY FORD,
464335895	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		7	H62	V89	1/25/2008	5F9Z	1700 AB	VALVE & CAP AS "10736 "	GANLEY LINCOLN-M
464399353	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	2	B65	V88	1/28/2008		1700	VALVE & CAP AS "A6040 "	UNIVERSAL FORD L
464401272	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	1	B65	V88	1/28/2008		1700	VALVE & CAP AS "00488 "	TALLAPOOSA FORC
464404533	AWS	chassis;wheel assy;wheels/rims;v damage;function-malfunction/inoper N	2E+06	"5K02"	"30"	8	B65	V88	1/28/2008	F42Z	1700 A	VALVE & CAP AS "05432 "	RANCHO FORD L-M
464405927	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	B65	V88	1/28/2008	F42Z	1700 A	VALVE & CAP AS "08016 "	MARSHALL FORD S.



464406406	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	14	H39	V21	1/28/2008		1700	VALVE & CAP AS "08862 "	PORTSMOUTH FOR
464498467	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-chafec N	2E+06	"5K02"	"30"	9	B65	V88	1/29/2008	F42Z	1700 A	VALVE & CAP AS "06658 "	SANDERS FORD INC
464741033	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	A99	V99	2/1/2008	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
464741235	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		8	B65	V88	2/1/2008	5F9Z	1700 AB	VALVE & CAP AS "02100 "	INTERSTATE FORD,
464745358	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"28"	20	B65	V88	2/1/2008	3W1Z	1700 XA	VALVE & CAP AS "11265 "	CORTESE LINCOLN
464807098	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	8	A40	V17	2/4/2008		1700	VALVE & CAP AS "B3223 "	JIM PENNEY LTD
464879819	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	A40	V17	2/5/2008	F42Z	1700 A	VALVE & CAP AS "04822 "	GREENWAY FORD,

464956194	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	11	A40	V17	2/7/2008	5F9Z	1700 AB	VALVE & CAP AS "01360 "	NEW HOLLAND FOF
464961261	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-chafec N	2E+06 "5K02"	12	B65	V88	2/7/2008	5L3Z	1700 A	VALVE & CAP AS "20626 "	SEABREEZE FORD,
465024946	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06 "5K02"	13	A40	V17	2/8/2008	5F9Z	1700 AB	VALVE & CAP AS "04822 "	GREENWAY FORD,
465026932	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "05"	16	B65	V88	2/8/2008		1700	VALVE & CAP AS "09304 "	LUNDGREN MOTOR
465027045	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	7	H62	V89	2/8/2008	F42Z	1700 A	VALVE & CAP AS "09609 "	CLINTON-TECUMSE
465095696	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	10	A40	V17	2/11/2008	F42Z	1700 A	VALVE & CAP AS "00192 "	FAMILY FORD, INC.
465171031	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	12	A99	V99	2/12/2008	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA
465242061	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "05"	13	B65	V88	2/13/2008		1700	VALVE & CAP AS "A2299 "	AVANTAGE FORD IN
465247087	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "05"	12	B65	V88	2/13/2008		1700	VALVE & CAP AS "07592 "	FORD, LINCOLN-ME
465317659	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	9	B65	V88	2/14/2008	F42Z	1700 A	VALVE & CAP AS "04352 "	HEALEY FORD LINC
465317981	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06 "5K02"	11	H62	V89	2/14/2008	5F9Z	1700 A	VALVE & CAP AS "04845 "	SAM GALLOWAY FC
465320740	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	1	H62	V89	2/14/2008	5F9Z	1700 AB	VALVE & CAP AS "10736 "	GANLEY LINCOLN-M

465410566	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	12	B95	V71	2/15/2008		1700	VALVE & CAP AS "10518 "	HIGHLAND PARK FC
465482986	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"07"	0	B65	V88	2/18/2008	2C3Z	1700 BA	VALVE & CAP AS "A7053 "	DAMS FORD LINCOLN
465486486	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	2/18/2008	F42Z	1700 A	VALVE & CAP AS "04216 "	DITSCHMAN/FLEMING
465486824	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	10	B65	V88	2/18/2008		1700	VALVE & CAP AS "04651 "	DIMENSION FORD V
465486968	AWS	chassis;wheel assy;wheels/rims;v damage;function-malfunction/inoperative N	2E+06	"5K02"		11	H62	V89	2/18/2008	5F9Z	1700 A	VALVE & CAP AS "04845 "	SAM GALLOWAY FC
465570173	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	5	B65	V88	2/19/2008	F42Z	1700 A	VALVE & CAP AS "06107 "	DICK BRANTMEIER
465650379	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	A40	V17	2/20/2008	F42Z	1700 A	VALVE & CAP AS "04935 "	JARRETT FORD MEI
465650411	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	1	A40	V17	2/20/2008		1700	VALVE & CAP AS "04963 "	BRANDON FORD
465654316	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		20	A40	V17	2/20/2008	5F9Z	1700 AB	VALVE & CAP AS "13354 "	PORT MOTORS LINCOLN
465730771	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfunction/inoperative N	2E+06	"5K02"		11	B65	V88	2/21/2008	5F9Z	1700 AB	VALVE & CAP AS "00389 "	MTN. VIEW FORD LINCOLN
465812184	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	11	H62	V89	2/22/2008		1700	VALVE & CAP AS "01548 "	JOE COTTON FORD
465812893	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	2/22/2008	F42Z	1700 A	VALVE & CAP AS "02732 "	DAVE KNAPP FORD

465859212	AWS	chassis;wheel assy	damage-chafed/excessive wear N	4E+07	"5K04"	9	TA4	V88	2/23/2008	F42Z	1700	A	"02150 "	AUTO MASTER	
465895616	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"28"	12	B65	V88	2/25/2008	3W1Z	1700	XA	VALVE & CAP AS "A1059 "	OAK-LAND FORD LII
465902297	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"		8	H62	V89	2/25/2008	6C3Z	1700	A	VALVE & CAP AS "06414 "	CROSSROADS FOR
465904922	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"05"	7	B65	V88	2/25/2008		1700		VALVE & CAP AS "11198 "	GANLEY LINCOLN M
465986630	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"05"	14	A40	V17	2/26/2008		1700		VALVE & CAP AS "02337 "	FINDLAY FORD LINC
466180775	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"05"	14	B65	V88	2/28/2008		1700		VALVE & CAP AS "02700 "	SKALNEK FORD INC
466391222	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"30"	18	B65	V88	3/3/2008	FOTZ	1700	AA	VALVE & CAP AS "02173 "	WILLIAMS MOTOR C
466393560	AWS	chassis;wheel assy;wheels/rims;v	corroded/rusted;damage-chafec N	2E+06	"5K02"		11	B65	V88	3/3/2008	5L3Z	1700	A	VALVE & CAP AS "04963 "	BRANDON FORD
466403856	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"	"05"	11	B65	V88	3/4/2008		1700		VALVE & CAP AS "04521 "	TIPTON FORD, INC.
466642843	AWS	chassis;wheel assy;wheels/rims;v	function-malfunction/inoperative N	2E+06	"5K02"		18	N23	V89	3/6/2008	6C3Z	1700	A	VALVE & CAP AS "01249 "	BROWN-DAUB FORI
466646201	AWS	chassis;wheel assy;wheels/rims;v	damage-road hazard;function-m N	2E+06	"5K02"	"05"	5	B65	V88	3/6/2008		1700		VALVE & CAP AS "05735 "	SAGINAW VALLEY F

466646966	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	7	H45	V89	3/6/2008	5F9Z	1700 AB	VALVE & CAP AS "07298 "	PACIFICO MARPLE I
466649953	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	12	B65	V88	3/6/2008	5L3Z	1700 A	VALVE & CAP AS "20651 "	FULLERTON FORD
466719467	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06 "5K02" "05"	8	B65	V88	3/7/2008		1700	VALVE & CAP AS "04903 "	MAROONE FORD OI
466723200	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	9	H62	V89	3/7/2008	5F9Z	1700 AB	VALVE & CAP AS "11612 "	DELRAY LINCOLN-M
466812605	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	1	A40	V17	3/10/2008	F42Z	1700 A	VALVE & CAP AS "13354 "	PORT MOTORS LINK
466981756	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02"	2	H45	V89	3/12/2008	5F9Z	1700 AB	VALVE & CAP AS "B1706 "	SANFORD G WELLS
467070475	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	9	B65	V88	2/6/2008	F42Z	1700 A	VALVE & CAP AS "09304 "	LUNDGREN MOTOR
467070670	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06 "5K02" "30"	6	H26	V89	2/6/2008	F42Z	1700 A	VALVE & CAP AS "09779 "	BABB FORD SALES,
467230795	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage;damag N	2E+06 "5K02" "30"	10	B65	V88	3/14/2008	F42Z	1700 A	VALVE & CAP AS "04584 "	CHAMPION FORD
467337730	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06 "5K02"	14	B65	V88	3/17/2008	5L3Z	1700 A	VALVE & CAP AS "00060 "	HUNT FORD, INC.

467437503	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	14	B65	V88	3/18/2008	F42Z	1700	A	VALVE & CAP AS "00334 "	WARRENSBURG FC
467444048	AWS	chassis;wheel assy;wheels/rims;v damage;function-malfunction/in	2E+06	"5K02"	"05"	13	H62	V89	3/18/2008		1700		VALVE & CAP AS "08951 "	FORD OF CLERMON
467530202	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	8	B65	V88	3/19/2008	F42Z	1700	A	VALVE & CAP AS "03418 "	NOBLE FORD-MERC
467530490	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	16	B65	V88	3/19/2008		1700		VALVE & CAP AS "03891 "	MORRIE'S MINNETC
467531240	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	B65	V88	3/19/2008	F42Z	1700	A	VALVE & CAP AS "04728 "	RAY SKILLMAN PER
467535875	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	13	B65	V88	3/19/2008	F42Z	1700	A	VALVE & CAP AS "13316 "	NORTH SHORE LINC
467615938	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		13	B65	V88	3/20/2008	5F9Z	1700	AB	VALVE & CAP AS "02265 "	MATHEWS FORD LII
467776339	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		10	B65	V88	3/24/2008	5F9Z	1700	AB	VALVE & CAP AS "04808 "	KELLY FORD
467779865	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	15	B65	V88	3/24/2008	F42Z	1700	A	VALVE & CAP AS "09116 "	STARKEY FORD, INC
467958218	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	B65	V88	3/26/2008	F42Z	1700	A	VALVE & CAP AS "00377 "	COURTESY FORD L

467961085	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	11	B65	V88	3/26/2008	F42Z	1700	A	VALVE & CAP AS "03997 "	PRINCE FREDERICK
467962455	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		12	B65	V88	3/26/2008	5L3Z	1700	A	VALVE & CAP AS "05432 "	RANCHO FORD L-M
468049923	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	2E+06	"5K02"	"05"	7	B65	V88	3/27/2008		1700		VALVE & CAP AS "B8158 "	HIGHBURY FORD S/
468051210	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		11	B65	V88	3/27/2008	6C3Z	1700	A	VALVE & CAP AS "01151 "	MEDFORD FORD, IN
468056976	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	11	C50	V89	3/27/2008		1700		VALVE & CAP AS "07869 "	GAUDIN FORD
468057808	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		9	H62	V89	3/27/2008	5L3Z	1700	A	VALVE & CAP AS "08828 "	HERB CHAMBERS F
468142384	AWS	chassis;wheel assy;wheels/rims;v damage-cut/torn/frayed ;functio N	2E+06	"5K02"	"30"	7	H62	V89	3/28/2008	F42Z	1700	A	VALVE & CAP AS "00827 "	MCAULEY FORD-ME
468147090	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	A40	V17	3/28/2008	F42Z	1700	A	VALVE & CAP AS "05895 "	GENESEE VALLEY F
468149552	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	11	B65	V88	3/28/2008	F42Z	1700	A	VALVE & CAP AS "09555 "	GULF BREEZE FORI
468251052	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	11	L88	V51	3/31/2008	F42Z	1700	A	VALVE & CAP AS "05400 "	JIM CHARLON FORI
468252035	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	14	B65	V88	3/31/2008		1700		VALVE & CAP AS "05765 "	BURCHETT FORD LI
468252428	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	9	B65	V88	3/31/2008		1700		VALVE & CAP AS "06231 "	COLERAIN FORD

468373305	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"28"	12	B66	V75	4/1/2008	3W1Z	1700 XA	VALVE & CAP AS "04839 "	ADVANTAGE FORD
468373485	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	4/1/2008	F42Z	1700 A	VALVE & CAP AS "04947 "	WALKER FORD COM
468376449	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	14	B65	V88	4/1/2008	F42Z	1700 A	VALVE & CAP AS "09169 "	REDLANDS FORD
468378173	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	B65	V88	4/1/2008	F42Z	1700 A	VALVE & CAP AS "20337 "	HOLMES TUTTLE FC
468540004	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	11	B65	V88	4/3/2008		1700	VALVE & CAP AS "B8158 "	HIGHBURY FORD S/
468625896	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		8	H62	V89	4/4/2008	5L3Z	1700 A	VALVE & CAP AS "06907 "	EXTREME FORD OF

468709478	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"05"	16	H62	V89	4/7/2008		1700	VALVE & CAP AS "04835 "	MAROONE FORD OI
468710374	AWS	chassis;wheel assy;wheels/rims;v damage-road hazard;function-m N	2E+06	"5K02"		13	B65	V88	4/7/2008	5L3Z	1700 A	VALVE & CAP AS "05543 "	RAMSEY STREET FC
468888138	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	17	A99	V99	4/9/2008	F42Z	1700 A	VALVE & CAP AS "01597 "	SANTA MARGARITA



468893615	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	B65	V88	4/9/2008	F42Z	1700	A	VALVE & CAP AS "09925 "	SALE FORD OF KIN
468977092	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	13	B65	V88	4/10/2008		1700		VALVE & CAP AS "20651 "	FULLERTON FORD
468977096	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		14	B65	V88	4/10/2008	5L3Z	1700	A	VALVE & CAP AS "20651 "	FULLERTON FORD
469050757	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	16	B65	V88	4/11/2008		1700		VALVE & CAP AS "04963 "	BRANDON FORD
469142588	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	15	B65	V88	4/14/2008	F42Z	1700	A	VALVE & CAP AS "05439 "	FIESTA FORD, INC.
469144111	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	10	B65	V88	4/14/2008	F42Z	1700	A	VALVE & CAP AS "07892 "	CAPITAL FORD
469144128	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	17	H62	V89	4/14/2008	F42Z	1700	A	VALVE & CAP AS "07908 "	CUTTER FORD, INC
469235725	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu N	2E+06	"5K02"	"30"	11	B65	V88	4/15/2008	F42Z	1700	A	VALVE & CAP AS "01090 "	QUALITY MOTOR CO
469237783	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	H62	V89	4/15/2008	F42Z	1700	A	VALVE & CAP AS "03898 "	COGGIN DELAND FO
469321772	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	8	G32	V83	4/16/2008	F42Z	1700	A	VALVE & CAP AS "00192 "	FAMILY FORD, INC.
469321909	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	16	B65	V88	4/16/2008	F42Z	1700	A	VALVE & CAP AS "00404 "	DON RICH FORD CC

469322272	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	13	B65	V88	4/16/2008	F42Z	1700	A	VALVE & CAP AS "01082 "	NORRIS FORD
469323327	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	4/16/2008	F42Z	1700	A	VALVE & CAP AS "02561 "	SEWELL FORD, INC
469324362	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	13	B65	V88	4/16/2008	F42Z	1700	A	VALVE & CAP AS "04120 "	COCONUT POINT FC
469324882	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"05"	13	B65	V88	4/16/2008		1700		VALVE & CAP AS "04822 "	GREENWAY FORD,
469327277	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	12	C50	V89	4/16/2008	F42Z	1700	A	VALVE & CAP AS "08473 "	RAMEY FORD LINCC
469406239	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;flaw in material N	2E+06	"5K02"	"30"	13	H62	V89	4/17/2008	F42Z	1700	A	VALVE & CAP AS "00147 "	PAUL OBAUGH FOR
469413678	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	13	B65	V88	4/17/2008	F42Z	1700	A	VALVE & CAP AS "20354 "	GALPIN FORD, INC.
469488508	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	16	B65	V88	4/18/2008		1700		VALVE & CAP AS "01220 "	KELLER BROS. MOT

469489406	AWS	chassis;wheel assy;wheels/rims;v contaminated/foreign;damage-cr	N	2E+06	"5K02"		7	A40	V17	4/18/2008	5L3Z	1700	A	VALVE & CAP AS "02686 "	BRIARWOOD FORD
469491024	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	2E+06	"5K02"	"05"	13	H62	V89	4/18/2008		1700		VALVE & CAP AS "04963 "	BRANDON FORD
469491402	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"		12	H62	V89	4/18/2008	5F9Z	1700	AB	VALVE & CAP AS "05503 "	KIEFFE & SONS FOF
469492617	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"		13	B65	V88	4/18/2008	5F9Z	1700	AB	VALVE & CAP AS "07839 "	VALLEY ISLE MOTO
469573183	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"	"30"	16	B65	V88	4/21/2008	F42Z	1700	A	VALVE & CAP AS "01306 "	HOPKINS FORD LIN
469579011	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	2E+06	"5K02"	"05"	9	B65	V88	4/21/2008		1700		VALVE & CAP AS "09578 "	MIDWAY FORD COM
469580627	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun	N	2E+06	"5K02"		14	A40	V17	4/21/2008	5F9Z	1700	AB	VALVE & CAP AS "20681 "	DOWNS FORD, INC.
469676457	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"	"05"	17	A40	V17	4/22/2008		1700		VALVE & CAP AS "B8144 "	CAVALCADE FORD
469677195	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"	"30"	16	B65	V88	4/22/2008	F42Z	1700	A	VALVE & CAP AS "00404 "	DON RICH FORD CC
469680458	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu	N	2E+06	"5K02"	"30"	14	B65	V88	4/22/2008	F42Z	1700	A	VALVE & CAP AS "04587 "	HELFMAN FORD INC
469683480	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"		17	B65	V88	4/22/2008	5F9Z	1700	AB	VALVE & CAP AS "08939 "	DAVID FORD LINCO
469683613	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split;	N	2E+06	"5K02"	"30"	15	B65	V88	4/22/2008	F42Z	1700	A	VALVE & CAP AS "09169 "	REDLANDS FORD
469683959	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	2E+06	"5K02"	"05"	15	B65	V88	4/22/2008		1700		VALVE & CAP AS "09801 "	MIDLAND FORD LIN

469691322	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"05"	17	B65	V88	4/23/2008		1700	VALVE & CAP AS "04963 "	BRANDON FORD
469694338	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	12	H62	V89	4/23/2008	F42Z	1700 A	VALVE & CAP AS "10597 "	WRIGHT BROTHERS
469850629	AWS	chassis;wheel assy;wheels/rims;v adhesive/sealer failure/missing; N	2E+06	"5K02"	"30"	13	B65	V88	4/24/2008	F42Z	1700 A	VALVE & CAP AS "08233 "	ACCESS FORD, LTD
469945631	AWS	chassis;wheel assy;wheels/rims;v appearance;corroded/rusted;fur N	2E+06	"5K02"	"30"	10	B65	V88	4/25/2008	F42Z	1700 A	VALVE & CAP AS "01625 "	COURTESY FORD
469947731	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"28"	15	B65	V88	4/25/2008	3W1Z	1700 XA	VALVE & CAP AS "04866 "	WHITE FORD COMP
469948357	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"		10	B65	V88	4/25/2008	5F9Z	1700 AB	VALVE & CAP AS "05543 "	RAMSEY STREET F
469950339	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	14	B65	V88	4/25/2008	F42Z	1700 A	VALVE & CAP AS "09555 "	GULF BREEZE FORI
469954471	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	14	B65	V88	4/28/2008	F42Z	1700 A	VALVE & CAP AS "00362 "	WALTER HAND MOT
469955991	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"28"	10	B65	V88	4/28/2008	3W1Z	1700 XA	VALVE & CAP AS "02370 "	MULLINAX FORD NC
469958400	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"05"	13	H39	V21	4/28/2008		1700	VALVE & CAP AS "04860 "	AUTOWAY FORD - S PE08-060 0918

469960293	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	4/28/2008	F42Z	1700	A	VALVE & CAP AS "07398 "	AL PACKER'S WHITI
469962562	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	7	B65	V88	4/28/2008	F42Z	1700	A	VALVE & CAP AS "10705 "	NICK MAYER LINCO
469965933	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		17	B65	V88	4/29/2008	5F9Z	1700	A	VALVE & CAP AS "B7230 "	OCEAN PARK FORD
470218653	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	14	B65	V88	4/30/2008	F42Z	1700	A	VALVE & CAP AS "01423 "	BETHLEHEM-SUB M
470219915	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"	"30"	15	B65	V88	4/30/2008	F42Z	1700	A	VALVE & CAP AS "02811 "	LITHIA FORD OF FR
470220584	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-bent/b N	2E+06	"5K02"	"30"	15	B65	V88	4/30/2008	F42Z	1700	A	VALVE & CAP AS "03658 "	DOWLING FORD INC
470222480	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		11	B65	V88	4/30/2008	5F9Z	1700	AB	VALVE & CAP AS "05503 "	KIEFFE & SONS FOF
470223315	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	2E+06	"5K02"	"30"	13	B65	V88	4/30/2008	F42Z	1700	A	VALVE & CAP AS "06554 "	WRAY FORD, INC.
470225122	AWS	chassis;wheel assy;wheels/rims;v frozen/seized;function-malfuncti N	2E+06	"5K02"		4	B66	V75	4/30/2008	5F9Z	1700	AB	VALVE & CAP AS "09054 "	STONEHAM MOTOR

470381594	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		11	A40	V17	5/2/2008	5F9Z	1700	A	VALVE & CAP AS "B8216 "	ERIC CAMPBELL FC
470384337	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu N	2E+06	"5K02"	"05"	16	B65	V88	5/2/2008		1700		VALVE & CAP AS "04814 "	AUTOWAY FORD
470384522	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	2E+06	"5K02"		10	A40	V17	5/2/2008	5L3Z	1700	A	VALVE & CAP AS "04963 "	BRANDON FORD
470384539	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	2E+06	"5K02"		14	A40	V17	5/2/2008	5L3Z	1700	A	VALVE & CAP AS "04963 "	BRANDON FORD
470456191	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		13	B65	V88	5/5/2008	5F9Z	1700	AB	VALVE & CAP AS "11612 "	DELRAY LINCOLN-M
470535894	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	12	B65	V88	5/6/2008	F42Z	1700	A	VALVE & CAP AS "A8100 "	TERRACE FORD LIN
470538204	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"		12	B65	V88	5/6/2008	5L3Z	1700	A	VALVE & CAP AS "01948 "	LES STANFORD FOI
470541169	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	10	B65	V88	5/6/2008	F42Z	1700	A	VALVE & CAP AS "06111 "	JACK SAFRO FORD
470619518	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	8	B65	V88	5/7/2008	F42Z	1700	A	VALVE & CAP AS "03171 "	TROPICAL FORD LIN
470623992	AWS	chassis;wheel assy;wheels/rims;v flaw in material ;function-malfun N	3E+06	"5K02"		16	H62	V89	5/7/2008	5F9Z	1700	AB	VALVE & CAP AS "11636 "	HOLLYWOOD LINCC PE08-060 0920

470707576	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fractu	N	3E+06	"5K02"	"30"	13	B65	V88	5/8/2008	F42Z	1700	A	VALVE & CAP AS "04814 "	AUTOWAY FORD
470711170	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;flaw in material	N	3E+06	"5K02"	"30"	12	B65	V88	5/8/2008	F42Z	1700	A	VALVE & CAP AS "20323 "	POWER FORD NOR
470715740	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N		3E+06	"5K02"	"28"	12	B65	V88	5/9/2008	3W1Z	1700	XA	VALVE & CAP AS "04798 "	WEIKERT FORD INC
470718572	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"		14	B65	V88	5/9/2008	5F9Z	1700	AB	VALVE & CAP AS "10972 "	PRESTA LINCOLN M
470718806	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	16	H62	V89	5/9/2008	F42Z	1700	A	VALVE & CAP AS "11634 "	SCARRITT LINCOLN
470719256	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	10	B65	V88	5/9/2008	F42Z	1700	A	VALVE & CAP AS "20523 "	FAMILY FORD INC
470861839	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	15	B65	V88	5/12/2008	F42Z	1700	A	VALVE & CAP AS "00904 "	FINISH LINE FORD L
470862503	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	17	B65	V88	5/12/2008	F42Z	1700	A	VALVE & CAP AS "01686 "	WYNNE FORD
470865813	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	13	B65	V88	5/12/2008	F42Z	1700	A	VALVE & CAP AS "06534 "	ESTABROOK MOTO
470868754	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"05"	12	B65	V88	5/12/2008		1700		VALVE & CAP AS "20551 "	NEW COUNTRY FOI
470948216	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N		3E+06	"5K02"	"30"	9	B66	V75	5/13/2008	F42Z	1700	A	VALVE & CAP AS "B2425 "	DESJARDINS AUTO
470948350	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"07"	18	C50	V89	5/13/2008	2C3Z	1700	CA	VALVE & CAP AS "B3220 "	BELLIVEAU MOTOR
470950722	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative	N	3E+06	"5K02"	"30"	15	B65	V88	5/13/2008	F42Z	1700	A	VALVE & CAP AS "02444 "	JIM BASS FORD INC

470952368	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	12	B65	V88	5/13/2008	F42Z	1700	A	VALVE & CAP AS "04935 "	JARRETT FORD MEI
470952386	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	17	B65	V88	5/13/2008	F42Z	1700	A	VALVE & CAP AS "04947 "	WALKER FORD COM
470956111	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"28"	13	B65	V88	5/13/2008	3W1Z	1700	XA	VALVE & CAP AS "20328 "	SUNSET FORD, INC
470956156	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	15	B65	V88	5/13/2008	F42Z	1700	A	VALVE & CAP AS "20389 "	MCSPADDEN FORD
471031969	AWS	chassis;wheel assy;wheels/rims;v appearance-dull/faded;corroded N	3E+06	"5K02"		16	B66	V75	5/14/2008	5F9Z	1700	AB	VALVE & CAP AS "B3366 "	FUNDY FORD SALE:
471033755	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	13	B65	V88	5/14/2008	F42Z	1700	A	VALVE & CAP AS "01686 "	WYNNE FORD
471034047	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	2	B65	V88	5/14/2008	F42Z	1700	A	VALVE & CAP AS "02220 "	L F DONNELL INC
471034525	AWS	chassis;wheel assy;wheels/rims;v damage-chafed/excessive wear N	3E+06	"5K02"	"30"	10	B65	V88	5/14/2008	F42Z	1700	A	VALVE & CAP AS "02938 "	PALM BAY FORD, IN
471035791	AWS	chassis;wheel assy;wheels/rims;v damage-chafed/excessive wear N	3E+06	"5K02"	"05"	13	C50	V89	5/14/2008		1700		VALVE & CAP AS "04870 "	AL PACKER FORD
471035852	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	13	B65	V88	5/14/2008	F42Z	1700	A	VALVE & CAP AS "04910 "	COOK-WHITEHEAD
471038902	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	11	B65	V88	5/14/2008		1700		VALVE & CAP AS "10597 "	WRIGHT BROTHERS



471039238	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	11	B65	V88	5/14/2008	F42Z	1700 A	VALVE & CAP AS "11638 "	MARGATE LINCOLN
471116028	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	11	B65	V88	5/15/2008	F42Z	1700 A	VALVE & CAP AS "01864 "	POWER FORD VALE
471116094	AWS	chassis;wheel assy;wheels/rims;v damage-distorted/warped/wrinkl N	3E+06	"5K02"	"30"	16	B65	V88	5/15/2008	F42Z	1700 A	VALVE & CAP AS "02015 "	TURNPIKE FORD OF
471116515	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	15	B65	V88	5/15/2008	F42Z	1700 A	VALVE & CAP AS "02731 "	ATCHINSON FORD S
471120003	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	12	B65	V88	5/15/2008	F42Z	1700 A	VALVE & CAP AS "08466 "	PORT LAVACA FORI
471121470	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	3E+06	"5K02"	"30"	16	B65	V88	5/15/2008	F42Z	1700 A	VALVE & CAP AS "11634 "	SCARRITT LINCOLN
471196795	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		14	B65	V88	5/16/2008	5F9Z	1700 AB	VALVE & CAP AS "05543 "	RAMSEY STREET FO
471196797	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		14	B65	V88	5/16/2008	5F9Z	1700 AB	VALVE & CAP AS "05543 "	RAMSEY STREET FO
471197085	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"		15	B65	V88	5/16/2008	5F9Z	1700 AB	VALVE & CAP AS "06190 "	PORCARO FORD
471270093	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	18	H62	V89	5/19/2008	F42Z	1700 A	VALVE & CAP AS "02414 "	BILLINGSLEY FORD
471273354	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	14	N27	V21	5/19/2008		1700	VALVE & CAP AS "06988 "	AKINS FORD LINCO
471275855	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	11	H62	V89	5/19/2008	F42Z	1700 A	VALVE & CAP AS "11822 "	STAR LINCOLN-MEF
471369860	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	11	B65	V88	5/20/2008		1700	VALVE & CAP AS "03915 "	TEAM FORD

471369861	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	12	B65	V88	5/20/2008		1700	VALVE & CAP AS "03915 "	TEAM FORD
471369867	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	13	B65	V88	5/20/2008		1700	VALVE & CAP AS "03915 "	TEAM FORD
471370620	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;flaw in material N	3E+06	"5K02"		13	B65	V88	5/20/2008	5L3Z	1700 A	VALVE & CAP AS "04963 "	BRANDON FORD
471452978	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	14	B65	V88	5/21/2008	F42Z	1700 A	VALVE & CAP AS "01082 "	NORRIS FORD
471454827	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	6	H62	V89	5/21/2008	F42Z	1700 A	VALVE & CAP AS "03952 "	JOHN KENNEDY FO
471455337	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	17	B65	V88	5/21/2008	F42Z	1700 A	VALVE & CAP AS "04843 "	MAROONE FORD OI
471455459	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	15	H62	V89	5/21/2008	F42Z	1700 A	VALVE & CAP AS "04921 "	BOZARD FORD LINC
471455813	AWS	chassis;wheel assy;wheels/rims;v damage;field service action;func N	3E+06	"5K02"	"05"	16	B65	V88	5/21/2008		1700	VALVE & CAP AS "05439 "	FIESTA FORD, INC.
471458768	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfun N	3E+06	"5K02"	"30"	14	B65	V88	5/21/2008	F42Z	1700 A	VALVE & CAP AS "11634 "	SCARRITT LINCOLN
471540413	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		16	B65	V88	5/22/2008	5F9Z	1700 AB	VALVE & CAP AS "04962 "	WORLD FORD-PENK
471621193	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;damage-cracke N	3E+06	"5K02"	"30"	14	H62	V89	5/23/2008	F42Z	1700 A	VALVE & CAP AS "01018 "	O. C. WELCH FORD
471622724	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	15	B65	V88	5/23/2008	F42Z	1700 A	VALVE & CAP AS "03781 "	JARRETT-GORDON
471623379	AWS	chassis;wheel assy;wheels/rims;v administrative cost;corroded/rus N	3E+06	"5K02"	"05"	15	C50	V89	5/23/2008		1700	VALVE & CAP AS "04790 "	GARY YEOMANS FC
471623605	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		13	B65	V88	5/23/2008	5L3Z	1700 A	VALVE & CAP AS "04963 "	BRANDON FORD
471624878	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	13	B65	V88	5/23/2008	F42Z	1700 A	VALVE & CAP AS "07809 "	JONES-WEST FORD

471625409	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	13	A99	V99	5/23/2008		1700	VALVE & CAP AS "08776 "	LAIRD NOLLER FOR
471626277	AWS	chassis;wheel assy;wheels/rims;v damage;flaw in material ;functio N	3E+06	"5K02"	"30"	16	B65	V88	5/23/2008	F42Z	1700 A	VALVE & CAP AS "10916 "	BOWLING GREEN L
471700533	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	13	C50	V89	5/26/2008		1700	VALVE & CAP AS "07269 "	JACKY JONES FORI
471700999	AWS	chassis;wheel assy;wheels/rims;v damage-chafed/excessive wear N	3E+06	"5K02"	"05"	16	B65	V88	5/26/2008	FOVY	1700 A	VALVE & CAP AS "10123 "	VULCAN LINCOLN-M
471760540	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	17	B65	V88	5/27/2008	F42Z	1700 A	VALVE & CAP AS "03250 "	FORD OF MONTEBE
471762806	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	17	H62	V89	5/27/2008	F42Z	1700 A	VALVE & CAP AS "06727 "	BEACH FORD, INC.
471763230	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	13	B65	V88	5/27/2008	F42Z	1700 A	VALVE & CAP AS "07869 "	GAUDIN FORD
471765051	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	10	A40	V17	5/27/2008	F42Z	1700 A	VALVE & CAP AS "13952 "	HINES PARK LINCOI
471846067	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	14	B65	V88	5/28/2008	F42Z	1700 A	VALVE & CAP AS "01768 "	KUNES' COUNTRY F
471846210	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	18	B65	V88	5/28/2008	FOTZ	1700 AA	VALVE & CAP AS "02173 "	WILLIAMS MOTOR C

471849276	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"05"	14	H62	V89	5/28/2008		1700	VALVE & CAP AS "06658 "	SANDERS FORD INC
471849282	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	11	B65	V88	5/28/2008	F42Z	1700 A	VALVE & CAP AS "06684 "	RIGGINS MOTOR CO
471932757	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"		14	B65	V88	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "A1333 "	EVANS FORD LINCOLN
471934437	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	13	B65	V88	5/29/2008	F42Z	1700 A	VALVE & CAP AS "00475 "	BURNS FORD-MERCURY
471934856	AWS	chassis;wheel assy;wheels/rims;v damage;damage-cracked/fracture	3E+06	"5K02"	"30"	14	B65	V88	5/29/2008	F42Z	1700 A	VALVE & CAP AS "01231 "	TIDELANDS FORD LINCOLN
471935791	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"		12	B65	V88	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "02531 "	BOB TOMES FORD, INC
471938222	AWS	chassis;wheel assy;wheels/rims;v damage-cracked/fractured/split; N	3E+06	"5K02"	"30"	14	H62	V89	5/29/2008	F42Z	1700 A	VALVE & CAP AS "05539 "	SUNRISE FORD LINCOLN
471939671	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfunction	3E+06	"5K02"		16	H62	V89	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "07997 "	MALL OF GEORGIA
471939672	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfunction	3E+06	"5K02"		16	H62	V89	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "07997 "	MALL OF GEORGIA
471939673	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfunction	3E+06	"5K02"		16	H62	V89	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "07997 "	MALL OF GEORGIA
471939674	AWS	chassis;wheel assy;wheels/rims;v corroded/rusted;function-malfunction	3E+06	"5K02"		16	H62	V89	5/29/2008	5F9Z	1700 AB	VALVE & CAP AS "07997 "	MALL OF GEORGIA
471940539	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	16	B65	V88	5/29/2008	F42Z	1700 A	VALVE & CAP AS "09643 "	CANDY FORD-MERCURY
471940951	AWS	chassis;wheel assy;wheels/rims;v function-malfunction/inoperative N	3E+06	"5K02"	"30"	9	B65	V88	5/29/2008	F42Z	1700 A	VALVE & CAP AS "10459 "	LANCASTER LINCOLN

Dealer City	Dealer State/Province	Dealer Country	Dealer Phone Number	Tread Category Description	Tire Manufacturer	Tire Size	Tire Brand Series	Wheel	VIN	Production Date	Model Year	Vehicle Description	Retail Sale Indicator Code	Warranty Start Date	Mileage
ENFIELD	CT	USA	8607451111	wheels	Unknown	P215/60R-16	BSW ALL SEASON		1FAFP53U07A[REDACTED]	4/25/2006	2007	TAURUS	F	5/10/2006	2
DALTON	GA	USA	7062781151	wheels	Unknown	P225/75R15	BSW		1FMYU02Z77K[REDACTED]	6/1/2006	2007	ESCAPE	R	3/9/2007	3
CENTER POINT	IA	USA	3198492022	wheels	Unknown	31X10.5R X 15C	STL OWL A-T		1FTZR45E17P[REDACTED]	6/6/2006	2007	RANGER	R	6/23/2007	4
HIGH POINT	NC	USA	3368692181	wheels	Unknown	LT245/75/R17E	A/T OWL		1FTWW33P07E[REDACTED]	5/25/2006	2007	F-350 SD	R	11/28/2006	5
BRITT	IA	USA	6418433871	wheels	Unknown	LT 275/65R 18E	BSW A/S		1FDSF34P27E[REDACTED]	5/31/2006	2007	F-350 SD	F	7/30/2007	3
ROCHESTER	MI	USA	2488520400	wheels	Unknown	235/50 ZR 18	TYRE		1ZVFT85H575[REDACTED]	6/23/2006	2007	MUSTANG	R	8/10/2006	7
COTTONWOOD	AZ	USA	9286342291	wheels	Unknown	LT265/70/R17E	A/T OWL		1FTSX21P57E[REDACTED]	6/22/2006	2007	F-250 SD	R	3/27/2007	7
GREENVILLE	SC	USA	8642425060	wheels	Unknown	P235/55HR 17			2FAFP74V97X[REDACTED]	6/29/2006	2007	CROWN VIC' R		12/8/2006	3
HYANNIS	MA	USA	5087755912	wheels	Unknown	LT265/70/R17E	A/T OWL		1FTSX21P67E[REDACTED]	6/8/2006	2007	F-250 SD	R	7/22/2007	10
SLAVE LAKE	AB	CAN	7808494419		Unknown	LT265/70/R17E	A/T OWL		1FTSW21567E[REDACTED]	6/30/2006	2007	F-250 SD	F	4/1/2007	3

WALLISVILLE	TX	USA	4093892291 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20527E [REDACTED]	6/16/2006	2007 F-250 SD	R	2/20/2007	4
LAKE WALES	FL	USA	8636767944 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21PX7E [REDACTED]	6/16/2006	2007 F-250 SD	R	7/7/2006	2200
CEDARTOWN	GA	USA	7707483673 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P07E [REDACTED]	6/23/2006	2007 F-250 SD	R	6/16/2007	3
WADENA	MN	USA	2186311470 wheels	Unknown	LT265/70/R17E A/T BSW	1FTWW31Y37E [REDACTED]	6/12/2006	2007 F-350 SD	R	7/7/2006	1000
EVELETH	MN	USA	2187444821 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21527E [REDACTED]	7/21/2006	2007 F-250 SD	R	11/3/2006	5
FALL RIVER	MA	USA	5087301000 wheels	Unknown	LT275/65R 20E A/T OWL	1FTWW31P47E [REDACTED]	8/2/2006	2007 F-350 SD	R	10/25/2006	7
LIGONIER	IN	USA	2608947176 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P87E [REDACTED]	7/25/2006	2007 F-250 SD	R	12/30/2006	4
CLEARWATER	FL	USA	7274662000 wheels	Unknown	P225/60TR-16 WSW	2MEFM74W97X [REDACTED]	7/17/2006	2007 GRAND MARR		1/3/2007	28
ARDMORE	OK	USA	5802263300 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF122X7N [REDACTED]	7/27/2006	2007 F-150	R	9/5/2006	2
CONRAD	MT	USA	4062785533 wheels	Unknown	LT 275/65R 18E BSW A/S	1FDSF34P37E [REDACTED]	7/24/2006	2007 F-350 SD	F	9/26/2006	17
HOUSTON	TX	USA	7136785000 wheels	Unknown	225/70R-19.5" BSW TRACTION	1FDXF47P47E [REDACTED]	8/11/2006	2007 F-450 SD	F	9/25/2006	3
NEW CASTLE	DE	USA	wheels	Unknown	LT 275/70R18E A/T BSW	1FTWW31P77E [REDACTED]	7/23/2006	2007 F-350 SD	R	8/11/2006	6
VALLEY CITY	ND	USA	7018451671 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW21P57E [REDACTED]	6/22/2006	2007 F-250 SD	R	3/9/2007	16
BRATTLEBORO	VT	USA	8022582400 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21577E [REDACTED]	6/30/2006	2007 F-250 SD	R	9/16/2006	6

MIDWEST CITY OK		USA	4057331611 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P17E [REDACTED]	7/23/2006	2007 F-250 SD	R	1/22/2007	6
LAFAYETTE LA		USA	3372334500 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P27E [REDACTED]	8/3/2006	2007 F-250 SD	R	2/3/2007	6
ELGIN IL		USA	8477417500 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P87E [REDACTED]	6/27/2006	2007 F-250 SD	R	9/20/2006	231
KENORA ON		CAN	8074686443	Unknown	P235/70R 17 A/S BSW TIRES	1FTRX12WX7M [REDACTED]	8/28/2006	2007 F-150	R	9/25/2006	597
ROSELLE IL		USA	6309248686 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN	1FMEU75E47U [REDACTED]	8/15/2006	2007 EXPLORER	R	8/25/2006	858
CAMPBELL RIV BC		CAN	2502879171	Unknown	LT275/65R 20E A/T OWL	1FTWW31P27E [REDACTED]	8/2/2006	2007 F-350 SD	R	8/31/2006	369
INDIANAPOLIS IN		USA	3172988814 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P07E [REDACTED]	8/3/2006	2007 F-250 SD	R	2/16/2007	20
SARNIA ON		CAN	5194644000	Unknown	P235/75R15SL S/BLT OWL A-T	1FTYR44UX7P [REDACTED]	6/20/2006	2007 RANGER	R	9/28/2006	292
BOLIVAR TN		USA	7316585293 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21PX7E [REDACTED]	8/2/2006	2007 F-250 SD	R	12/30/2006	169
CHARLOTTE MI		USA	5175438292 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21PX7E [REDACTED]	8/3/2006	2007 F-250 SD	R	12/5/2006	6

CAMDENTON	MO	USA	5733465551 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21PX7E [REDACTED]	8/2/2006	2007 F-250 SD	R	4/21/2007	18
WEST POINT	VA	USA	8048432500 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSX20547E [REDACTED]	8/8/2006	2007 F-250 SD	R	1/18/2007	5
TALLAHASSEE	FL	USA	wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTYR10D67P [REDACTED]	10/16/2006	2007 RANGER	R	7/7/2007	1
MATTHEWS	NC	USA	7042461400 wheels	Unknown	P235/70R-16T BSW A-S LRR	4M2CU39H67K [REDACTED]	10/5/2006	2007 MARINER	R	11/25/2006	4
WOOD RIVER	IL	USA	6182592424 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21547E [REDACTED]	6/30/2006	2007 F-250 SD	R	2/15/2007	9
ANGLETON	TX	USA	7134227200 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P57E [REDACTED]	8/4/2006	2007 F-250 SD	R	10/6/2006	1603
WETASKIWIN	AB	CAN	7803526043	Unknown	LT245/75/R17E A/T OWL	1FTWW33P87E [REDACTED]	9/12/2006	2007 F-350 SD	F		9
LAFAYETTE	IN	USA	7654479444 wheels	Unknown	LT275/65R 20E A/T OWL	1FTWW31P97E [REDACTED]	8/1/2006	2007 F-350 SD	R	9/7/2006	5908
MARIANNA	FL	USA	8504824043 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTYR10D07P [REDACTED]	5/8/2006	2007 RANGER	R	10/10/2006	3867
LILLINGTON	NC	USA	9108142243 wheels	Unknown	275/65R 20E A/T BSW TIRE	1FTSW21PX7E [REDACTED]	8/3/2006	2007 F-250 SD	R	10/31/2006	77
FREEHOLD	NJ	USA	7324623131 wheels	Unknown	P225/50VR 17	3FAHP081X7R [REDACTED]	8/30/2006	2007 FUSION	R	11/4/2006	100
SAINT JOHNS	MI	USA	9892246711 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P27E [REDACTED]	6/22/2006	2007 F-250 SD	R	5/18/2007	11
DOVER	NH	USA	6037495500 wheels	Unknown	P215/60R 17 A/S BSW	1FAHP24137G [REDACTED]	5/31/2006	2007 FIVE HUNDR		5/12/2007	33
DOVER	NH	USA	6037495500 wheels	Unknown	P225/50VR 17	3FAHP08127R [REDACTED]	8/5/2006	2007 FUSION	R	6/1/2007	11



MARSHFIELD	WI	USA	7153872545 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21PX7E [REDACTED]	6/8/2006	2007 F-250 SD	R	12/11/2006	59
CRYSTAL LAKE	IL	USA	8154598200 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSX21587E [REDACTED]	6/26/2006	2007 F-250 SD	R	12/29/2006	7
SLIDELL	LA	USA	9856438900 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P77E [REDACTED]	6/26/2006	2007 F-250 SD	R	12/1/2006	17
WINTER HAVEN	FL	USA	8632943571 wheels	Unknown	LT245/75/R17E A/T BSW	1FTSX21557E [REDACTED]	7/27/2006	2007 F-250 SD	R	9/29/2006	4060
KATY	TX	USA	2816754700 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20PX7E [REDACTED]	8/3/2006	2007 F-250 SD	R	9/30/2006	2306
LEXINGTON	KY	USA	8592542391 wheels	Unknown	P225/60R 17 A/S WSW	1LNHM83V97Y [REDACTED]	11/10/2006	2007 TOWN CAR	R	12/21/2006	5
ORANGEVILLE	ON	CAN	5199415431	Unknown	195/60R 15T BSW	1FAFP34N17W [REDACTED]	6/7/2006	2007 FOCUS	R	8/31/2006	3075
ANN ARBOR	MI	USA	7349962300 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21P07E [REDACTED]	7/1/2006	2007 F-250 SD	R	10/31/2006	1102
SHERBROOKE	QC	CAN	8195634466	Unknown	P205/60R16 ALL SEASON	3FAHP07Z37R [REDACTED]	8/12/2006	2007 FUSION	R	12/28/2006	1
WARRENTON	MO	USA	6364564305 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21P97E [REDACTED]	6/23/2006	2007 F-250 SD	R	3/14/2007	31
BAY SHORE	NY	USA	5166666720 wheels	Unknown	P225/50VR 17	3LNHM28T37R [REDACTED]	11/16/2006	2007 MKZ	R	11/30/2006	2

OLIVE BRANCH MS		USA	6628956700 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR10U87P [REDACTED]	10/16/2006	2007 RANGER	R	10/26/2006	751	
WOODSTOCK GA		USA	7705920090 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20PX7E [REDACTED]	7/28/2006	2007 F-250 SD	R	1/24/2007	3
HAY RIVER NT		CAN	8678747700	Unknown	LT245/75/R17E A/T OWL	1FTWW33PX7E [REDACTED]	9/12/2006	2007 F-350 SD	R	10/5/2006	5795
EL CENTRO CA		USA	7603528030 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSX20567E [REDACTED]	6/16/2006	2007 F-250 SD	R	8/21/2006	6073
WINNIPEG MB		CAN	2043392000	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W47K [REDACTED]	11/20/2006	2007 F-150	F	12/8/2006	3
CANTON OH		USA	3304562781 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSX21Y97E [REDACTED]	6/15/2006	2007 F-250 SD	R		101
LAKE WORTH FL		USA	5615824444 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P07E [REDACTED]	8/2/2006	2007 F-250 SD	R	9/26/2006	7337

TAMPA	FL	USA	8138725555 wheels	Unknown	P255/70R18 A/S OWL	1FMFU17517L [REDACTED]	8/31/2006	2007 EXPEDITION R	11/3/2006	3397
MINOT	ND	USA	7018521354 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSW21P17E [REDACTED]	8/2/2006	2007 F-250 SD R	12/8/2006	570
DETROIT	MI	USA	3138854000 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN 4M2EU48E07U [REDACTED]		9/28/2006	2007 MOUNTAINE R	12/18/2006	159
TULSA	OK	USA	9182806086 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P07E [REDACTED]	6/27/2006	2007 F-250 SD R	9/13/2006	5603
DADE CITY	FL	USA	3525676711 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSX205X7E [REDACTED]	7/24/2006	2007 F-250 SD R		5567
L'ANSE	MI	USA	9065246112 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSX20507E [REDACTED]	7/1/2006	2007 F-250 SD R	8/2/2006	2703
WHEAT RIDGE CO		USA	3034215350 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H57E [REDACTED]	6/13/2006	2007 MUSTANG R	7/31/2006	4164
CONNELLSVILL PA		USA	7246282720 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P47E [REDACTED]	7/27/2006	2007 F-250 SD R	1/2/2007	14
CAROL STREAM IL		USA	6306829200 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W17N [REDACTED]	7/27/2006	2007 F-150 R	12/16/2006	187
CLEARWATER FL		USA	7277972277 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P37E [REDACTED]	8/3/2006	2007 F-250 SD R	12/9/2006	2235
MAHWAH NJ		USA	2015293200 wheels	Unknown	275/65R 20E A/T BSW TIRE	1FTSW21P57E [REDACTED]	6/27/2006	2007 F-250 SD R	1/15/2007	20

AYDEN	NC	USA	2527466171 wheels	Unknown	LT275/65R 20E A/T OWL	1FTWW31PX7E [REDACTED]	8/4/2006	2007 F-350 SD	R	12/30/2006	185
BOLTON	ON	CAN	9058571252	Unknown	205/50VR-16 BSW	1FAFP37N67W [REDACTED]	9/19/2006	2007 FOCUS	R	9/30/2006	6446
PASADENA	TX	USA	2816043673 wheels	Unknown	P235/75R15SL S/BLT OWL A-T	1FTYR10U27P [REDACTED]	5/11/2006	2007 RANGER	R	12/29/2006	1179
CINCINNATI	OH	USA	5134744313 wheels	Unknown	P225/60R 17 A/S WSW	1LNHM81V67Y [REDACTED]	10/5/2006	2007 TOWN CAR	R	11/27/2006	1684
ROXBORO	QC	CAN	5146851330	Unknown	P215/65R17 BSW	1FMZK05157G [REDACTED]	8/16/2006	2007 FREESTYLE	R	10/26/2006	2307
MOUNT PEARL	NL	CAN	7097547500	Unknown	275/65R 20E A/T BSW TIRE	1FTSW21P47E [REDACTED]	11/26/2006	2007 F-250 SD	R	1/8/2007	6
CLINTON	NC	USA	9105926056 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P07E [REDACTED]	8/2/2006	2007 F-250 SD	R	12/14/2006	3257
KINGWOOD	WV	USA	3043293673 wheels	Unknown	P225/50VR 17	3MEHM02127R [REDACTED]	10/13/2006	2007 MILAN	R	12/2/2006	1369
ADRIAN	MI	USA	5172658187 wheels	Unknown	LT265/70/R17E A/S OWL	1FTNF215X7E [REDACTED]	8/4/2006	2007 F-250 SD	R	3/27/2007	1
WINSLOW	AZ	USA	9282893354 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTZR44U37P [REDACTED]	6/27/2006	2007 RANGER	R	4/7/2007	200
LAVAL	QC	CAN	4506696110	Unknown	195/60R 15T BSW	1FAFP34N27W [REDACTED]	11/17/2006	2007 FOCUS	R	12/15/2006	9631

FREDERICKSBL VA		USA	5408983000 wheels	Unknown	LT275/65R 20E A/T OWL	1FTWW31P87E [REDACTED]	6/6/2006	2007 F-350 SD	R	1/17/2007	215
TWIN FALLS ID		USA	2087362480 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSF21PX7E [REDACTED]	8/4/2006	2007 F-250 SD	R	1/2/2007	602
FORT MILL SC		USA	8035475454 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P57E [REDACTED]	7/16/2006	2007 F-250 SD	R	10/31/2006	5870
CONOVER NC		USA	8284643431 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSW21P87E [REDACTED]	8/2/2006	2007 F-250 SD	R	1/12/2007	1080
HEMPSTEAD TX		USA	9798268026 wheels	Unknown	LT245/75/R17E A/T OWL	1FTWW32P67E [REDACTED]	7/30/2006	2007 F-350 SD	R	12/23/2006	571
WINNIPEG MB		CAN	2043392000	Unknown	P215/60R-16 BSW ALL SEASON	1FAFP53U37 [REDACTED]	9/29/2006	2007 TAURUS	F	10/19/2006	2899
MANAHAWKIN NJ		USA	6095978083 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT82H375 [REDACTED]	6/14/2006	2007 MUSTANG	R	6/28/2006	5010
PAWLEYS ISLA SC		USA	8432373673 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P27E [REDACTED]	8/3/2006	2007 F-250 SD	R	1/29/2007	PE08-060-0935 335

NEW BEDFORD MA		USA	5089965611 wheels	Unknown	195/60R 15T BSW	1FAFP31N97W [REDACTED]	8/10/2006	2007 FOCUS	R	9/28/2006	3027
BOLTON	ON	CAN	9058571252	Unknown	P235/55R 17 BSW	2FMZA57297E [REDACTED]	5/3/2006	2007 FREESTAR	R	2/7/2007	19
KATY	TX	USA	2816754700 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P87E [REDACTED]	7/19/2006	2007 F-250 SD	R	2/20/2007	263
CLINTON TOWN MI		USA	5868402000 wheels	Unknown	P225/50VR 17	3LNHM28T17R [REDACTED]	10/4/2006	2007 MKZ	R	12/23/2006	1556
LUMBERTON	NC	USA	9107386281 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P07E [REDACTED]	7/17/2006	2007 F-250 SD	R	9/1/2006	7492
CADILLAC	MI	USA	2317753448 wheels	Unknown	P245/65R 17 A/S OWL	1FMEU51K47U [REDACTED]	4/28/2006	2007 EXPLORER	R	1/29/2007	332
LUBBOCK	TX	USA	8067973441 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12257N [REDACTED]	7/24/2006	2007 F-150	R	2/1/2007	45
JACKSONVILLE FL		USA	9043876541 wheels	Unknown	P255/65R 17 A/S OWL	1FTPF12V37N [REDACTED]	12/4/2006	2007 F-150	R	12/13/2006	482

TERREBONNE	QC	CAN	4504716601	Unknown	P235/70R-16 OWL A-S	1FMYU93197K [REDACTED]	5/4/2006	2007 ESCAPE	R	1/31/2007	5
WEST BEND	WI	USA	2623383379 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P77E [REDACTED]	6/29/2006	2007 F-250 SD	R		1585
NORWICH	NY	USA	6073343273 wheels	Unknown	LT265/70/R17E A/T OWL	1FTNF21577E [REDACTED]	6/11/2006	2007 F-250 SD	R	7/28/2007	184
OTTAWA	ON	CAN	6137253611	Unknown	LT245/75/R17E A/T OWL	1FTWW33P77E [REDACTED]	5/19/2006	2007 F-350 SD	R	1/23/2007	136
DOTHAN	AL	USA	3347925171 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P57E [REDACTED]	8/4/2006	2007 F-250 SD	R	2/28/2007	30
NEWTOWN	PA	USA	2159683806 wheels	Unknown	P255/70R18 A/S OWL	1FMFK20577L [REDACTED]	8/30/2006	2007 EXPEDITION	R	12/7/2006	7120
DRUMMONDVIL	QC	CAN	8194773050	Unknown	P225/50VR 17	3FAHP08127R [REDACTED]	8/12/2006	2007 FUSION	R	1/22/2007	12
HONESDALE	PA	USA	5702531557 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21517E [REDACTED]	8/4/2006	2007 F-250 SD	R	2/9/2007	344
BUTLER	NJ	USA	9738380800 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21557E [REDACTED]	6/9/2006	2007 F-250 SD	R	1/23/2007	1306

ENFIELD	CT	USA	8607451111 wheels	Unknown	P225/60R18 BSW TIRE	1FMDK06167G [REDACTED]	5/3/2006	2007 FREESTYLE R	2/28/2007	2347
WESTLAKE	OH	USA	4408718600 wheels	Unknown	225/70/R-19.5 BW F:A/S R:TRAC	1FDAF57P57E [REDACTED]	8/2/2006	2007 F-550 SD F	9/19/2006	9911
EAST ELLIJAY	GA	USA	7062762777 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P57E [REDACTED]	6/20/2006	2007 F-250 SD R		21
REDDING	CA	USA	5302414321 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P17E [REDACTED]	8/4/2006	2007 F-250 SD R	2/6/2007	1632
FREELAND	MI	USA	9896955566 wheels	Unknown	P225/50VR 17	3FAHP08Z47R [REDACTED]	2/23/2007	2007 FUSION R		5
GETZVILLE	NY	USA	7166885464 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z87R [REDACTED]	11/4/2006	2007 FUSION R	1/31/2007	2426



JONQUIERE ELLSWORTH	QC ME	CAN USA	4185429551 2076675541 wheels	Unknown Unknown	195/60R 15T BSW 235/50 ZR 18 TYRE	1FAFP36N97W 1ZVFT85H075	11/16/2006 6/6/2006	2007 FOCUS 2007 MUSTANG	R R	12/11/2006 7/25/2006	1636 6469
MIDWEST CITY	OK	USA	4057331611 wheels	Unknown	LT245/70R17D BSW A/T	1FTRX14W97F	2/19/2007	2007 F-150	F	3/6/2007	2
MOJI MIRIM	SP	BRA	55-19-8145	Unknown	LT265/75R-16 PIRELLI TIRE VEND	9BFHF21C37B	4/27/2006	2007 F-250 SD	R	5/31/2006	9330
BEREA	OH	USA	4402342770 wheels	Unknown	LT225/75R-16E BSW A-S	1FDWE35L27D	10/31/2006	2007 E-350	R	11/30/2006	6455
FOUR LAKES	WA	USA	5097478811 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSX21517E	8/4/2006	2007 F-250 SD	R	12/31/2006	215
TAMPA	FL	USA	8132463673 wheels	Unknown	P255/70R18 A/S OWL	1FMFU19517L	2/27/2007	2007 EXPEDITION	R	3/19/2007	15
STONEHAM	MA	USA	7814380490 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z97R	10/26/2006	2007 FUSION	F	10/27/2006	3941
RANCHO SANTO	CA	USA	9494596800 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z27R	2/20/2007	2007 FUSION	F	3/8/2007	706
GETZVILLE	NY	USA	7166885464 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTPX14527F	9/7/2006	2007 F-150	R	12/9/2006	3052

GRAND RAPIDS MI	USA	6169497800 wheels	Unknown	P225/50VR 17	3MEHM08117R [REDACTED]	1/25/2007	2007 MILAN	R	8/9/2007	152
NATCHITOCHE LA	USA	3183523677 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW20P17E [REDACTED]	7/30/2006	2007 F-250 SD	R	1/9/2007	637
CAMBRIDGE ON	CAN	5196210720	Unknown	Unknown	1FDSE35L47D [REDACTED]	12/7/2006	2007 E-350	F	4/4/2007	73
MAYFIELD HEIGHTS OH	USA	4404491000 wheels	Unknown	P235/70R-16T BSW A-S	1FMCU04107K [REDACTED]	12/1/2006	2007 ESCAPE	R	3/10/2007	2517
OKLAHOMA CITY OK	USA	4057755500 wheels	Unknown	P275/55R20" BSW A/S	5LMFU28547L [REDACTED]	3/7/2007	2007 NAVIGATOR	R	6/22/2007	3
MAZATLAN SI	MEX	9169831477	Unknown	235/50 ZR 18 TYRE	1ZVFT85H775 [REDACTED]	8/5/2006	2007 MUSTANG	R	9/8/2006	375
CHERRY HILL NJ	USA	8564284000 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12207N [REDACTED]	3/14/2007	2007 F-150	F	4/3/2007	4
STONEHAM MA	USA	7814380490 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z87R [REDACTED] 1	11/25/2006	2007 FUSION	F	11/27/2006	3519
VIENNA VA	USA	7034480100 wheels	Unknown	LT245/75/R17E A/S BSW	1FTSW21P87E [REDACTED]	7/25/2006	2007 F-250 SD	R		170
KANE PA	USA	8148377225 wheels	Unknown	P205/60R16 ALL SEASON	3MEHM07177 [REDACTED]	10/3/2006	2007 MILAN	R	10/25/2006	7607
SAINT CHARLES MO	USA	6369466611 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTPX14V47F [REDACTED]	8/16/2006	2007 F-150	R	3/13/2007	939

KINGSTON	ON	CAN	6135462211	Unknown	LT245/75/R17E A/S BSW	1FTWW33P47E [REDACTED]	8/29/2006	2007 F-350 SD	R	11/20/2006	9912
ST JOHNS	NL	CAN	7097226600	Unknown	195/60R 15T BSW	1FAFP34N67W [REDACTED]	8/18/2006	2007 FOCUS	R	3/31/2007	235
HAMILTON	ON	CAN	9053886396	Unknown	P245/60R18 A/S BSW	2FMDK49C17B [REDACTED]	12/20/2006	2007 EDGE	R	12/27/2006	5827
CARROLLTON	KY	USA	5027326674 wheels	Unknown	LT245/75/R17E A/T BSW	1FTNF215X7E [REDACTED]	7/17/2006	2007 F-250 SD	R	12/21/2006	9856
GREENVILLE	NC	USA	2527580114 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN	1FMEU64877U [REDACTED]	2/9/2007	2007 EXPLORER	L	2/9/2007	5031
ALEXANDRIA	LA	USA	3184480871 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT82H175 [REDACTED]	10/25/2006	2007 MUSTANG	R	1/2/2007	2296
SASKATOON	SK	CAN	3063734444	Unknown	LT245/75R-16E BSW A-S	1FDSE34L67D [REDACTED]	11/30/2006	2007 E-350	F	3/8/2007	23
MANAHAWKIN	NJ	USA	6095978083 wheels	Unknown	LT265/70/R17E A/T OWL	1FTNF20567E [REDACTED]	6/13/2006	2007 F-250 SD	R	2/17/2007	1587
OLD BRIDGE	NJ	USA	7325911111 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE	1FMEU74E57U [REDACTED]	9/29/2006	2007 EXPLORER	R	3/10/2007	1906
NORTH AUROR.	IL	USA	6309070707 wheels	Unknown	P225/50VR 17	3LNHM28T57P [REDACTED]	9/5/2006	2007 MKZ	R	1/26/2007	3879
OLEAN	NY	USA	5853727272 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU931X7K [REDACTED]	12/20/2006	2007 ESCAPE	R	3/23/2007	275

BUFORD	GA	USA	7709324060 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C37E [REDACTED]	3/22/2007	2007 EDGE	R	4/12/2007	251
CAMBRIDGE	ON	CAN	5196210720	Unknown	Unknown	1FDSE35L67D [REDACTED]	12/7/2006	2007 E-350	F	6/18/2007	72
WAUSAU	WI	USA	7156759500 wheels	Unknown	P235/70R-16 GOODYEAR TIRE VE1	FMEU73E17U [REDACTED]	8/23/2006	2007 EXPLORER	F	9/7/2006	12931
SPRINGVILLE	NY	USA	7165924949 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21537E [REDACTED]	8/4/2006	2007 F-250 SD	R	3/20/2007	814
PLYMOUTH	MI	USA	7344531100 wheels	Unknown	P225/50VR 17	3FAHP08107R [REDACTED]	8/28/2006	2007 FUSION	R	11/1/2006	4788
WEST BRANCH IA		USA	3196432123 wheels	Unknown	205/50VR-16 BSW	1FAHP34N77W [REDACTED]	10/24/2006	2007 FOCUS	R	4/23/2007	221
NEW BRAUNFE TX		USA	8306068011 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRX12W17K [REDACTED]	4/19/2007	2007 F-150	R	5/5/2007	138
FORT LAUDERC FL		USA	9545643221 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H975 [REDACTED]	9/8/2006	2007 MUSTANG	R	9/30/2006	13314
RANCHO SANT/ CA		USA	9494596800 wheels	Unknown	P235/65R18 A/S OWL	1FMEU658X7U [REDACTED]	2/9/2007	2007 EXPLORER	L	2/20/2007	5100
BRATTLEBORO VT		USA	8022582400 wheels	Unknown	P225/50VR 17	3FAHP02177R [REDACTED]	12/11/2006	2007 FUSION	R	2/26/2007	6647
RANCHO SANT/ CA		USA	9494596800 wheels	Unknown	P235/70R-16T BSW A-S	1FMYU03117K [REDACTED]	10/26/2006	2007 ESCAPE	F	11/10/2006	15659
RANCHO SANT/ CA		USA	9494596800 wheels	Unknown	P235/65R17 BSW A/S	2FMDK49C07B [REDACTED]	2/19/2007	2007 EDGE	L	3/14/2007	2302

ARDMORE	OK	USA	5802263300 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP31N17W [REDACTED]	4/16/2007	2007 FOCUS	R	10/19/2007	6
SEMINOLE	OK	USA	4053822222 wheels	Unknown	P225/60TR-16 WSW	2MEHM75V77X [REDACTED]	7/19/2006	2007 GRAND MARR		11/8/2006	8674
RANCHO SANT/CA		USA	9494596800 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTPX12507F [REDACTED]	11/8/2006	2007 F-150	F	11/9/2006	7809
SAN SABA	TX	USA	3253725707 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSX20P07E [REDACTED]	8/8/2006	2007 F-250 SD	R	12/29/2006	2564
PENNSVILLE	NJ	USA	8566783111 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT85H075 [REDACTED]	4/27/2007	2007 MUSTANG	R	12/22/2007	12
HUNTLEY	IL	USA	8476696060 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21567E [REDACTED]	6/29/2006	2007 F-250 SD	R	11/30/2006	17431
LANSDALE	PA	USA	2158551153 wheels	Unknown	195/60R 15T BSW	1FAHP34N27W [REDACTED]	10/17/2006	2007 FOCUS	R	2/21/2007	4367
OAKVILLE	ON	CAN	9058443273	Unknown	P225/50VR 17	3FAHP08167R [REDACTED]	3/6/2007	2007 FUSION	R	4/2/2007	977
PRINCETON	KY	USA	2703653673 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSX21P77E [REDACTED]	7/18/2006	2007 F-250 SD	R	4/11/2007	1130
ROYSTON	GA	USA	7062459241 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C67B [REDACTED]	1/25/2007	2007 EDGE	R		1708

OCALA	FL	USA	3527324800 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H075 [REDACTED]	12/13/2006	2007 MUSTANG	R	4/26/2007	796
WILLARD	OH	USA	4199354571 wheels	Unknown	P215/65R17 BSW	1FMDK05177G [REDACTED]	8/14/2006	2007 FREESTYLE	R	4/20/2007	1200
FRANKFORT	KY	USA	5026951990 wheels	Unknown	LT245/75/R17E A/S BSW	1FTSW20P47E [REDACTED]	7/21/2006	2007 F-250 SD	R		6377
BREWSTER	NY	USA	8452792992 wheels	Unknown	P225/50VR 17	3FAHP02147R [REDACTED]	11/15/2006	2007 FUSION	R	4/4/2007	3492
TALLAHASSEE	FL	USA	wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P67E [REDACTED]	6/21/2006	2007 F-250 SD	R	5/26/2007	1321
LOWELL	MA	USA	9784523900 wheels	Unknown	P225/75R15 BSW	1FMYU02Z07 [REDACTED]	12/19/2006	2007 ESCAPE	R	2/21/2007	3201
MANCHESTER	PA	USA	7172663651 wheels	Unknown	P235/70R-16 OWL A-S	1FMEU51K77U [REDACTED]	5/23/2006	2007 EXPLORER	R	11/10/2006	2867

BAKERSFIELD	CA	USA	6613283600 wheels	Unknown	P215/65R16 96T A/S	1ZVFT84N675 [REDACTED]	10/20/2006	2007 MUSTANG	R		11242
LEXINGTON	KY	USA	8592711800 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1	FMEU73E27U [REDACTED]	1/2/2007	2007 EXPLORER	R	2/14/2007	3406
ELLSWORTH	WI	USA	7152734319 wheels	Unknown	P235/65R18 A/S OWL	1FMEU53807U [REDACTED]	5/18/2006	2007 EXPLORER	R	6/12/2006	27958
ESTERO	FL	USA	2394983673 wheels	Unknown	LT245/75R-16E BSW A-S	1FTNS24W07D [REDACTED]	1/22/2007	2007 E-250	R	8/1/2007	3
COLLIERVILLE	TN	USA	9018543673 wheels	Unknown	P275/65R18 A/T OWL	1FTPW14V57K [REDACTED]	8/11/2006	2007 F-150	R	9/27/2006	4164
HAVERHILL	MA	USA	9783733878 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07157R [REDACTED]	2/15/2007	2007 FUSION	R	5/31/2007	360
ROSLYN	NY	USA	5164846633 wheels	Unknown	P275/55R20" BSW A/S	5LMFU28587L [REDACTED]	4/4/2007	2007 NAVIGATOR	R	6/8/2007	260
ALEXANDRIA	VA	USA	7036609000 wheels	Unknown	205/50VR-16 BSW	1FAHP31N67W [REDACTED]	3/8/2007	2007 FOCUS	R	4/28/2007	5198
DECATUR	IN	USA	2607248526 wheels	Unknown	P225/50VR 17	3FAHP08147R [REDACTED]	8/15/2006	2007 FUSION	R	11/11/2006	2845
JACKSONVILLE	FL	USA	9047773673 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1	FMEU64E67U [REDACTED]	6/6/2007	2007 EXPLORER	R	8/22/2007	5
MILTON	ON	CAN	9058753673	Unknown	LT225/75R-16E BSW A-S	1FTNE14W17D [REDACTED]	6/12/2007	2007 E-150	F	7/31/2007	3
TROY	MI	USA	2486437500 wheels	Unknown	205/50VR-16 BSW	1FAHP31N67W [REDACTED]	12/22/2006	2007 FOCUS	R	1/22/2007	11388
NEW BRIGHTON	MN	USA	6516339010 wheels	Unknown	LT 275/70R18E A/T OWL	1FTWW31P07E [REDACTED]	6/21/2006	2007 F-350 SD	R	5/12/2007	1667

DES MOINES	IA	USA	5152700707 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C27E [REDACTED]	3/8/2007	2007 EDGE	R	6/25/2007	285
RANDOLPH	NJ	USA	2019276700 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H875 [REDACTED]	3/6/2007	2007 MUSTANG	R	6/6/2007	805
BLOCK HOUSE	NS	CAN	9026248315	Unknown	P205/60R16 ALL SEASON	3FAHP07ZX7P [REDACTED]	2/26/2007	2007 FUSION	R	5/10/2007	1719
NEW HOLLAND	PA	USA	7173544901 wheels	Unknown	LT245/75/R17E A/T BSW	1FTSX21P37E [REDACTED]	7/26/2006	2007 F-250 SD	R	4/20/2007	2245
WACO	TX	USA	2546662473 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE	1FMEU64E97U [REDACTED]	11/29/2006	2007 EXPLORER	R	2/8/2007	4906
HENDERSON	TN	USA	7319892121 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W07X [REDACTED]	12/5/2006	2007 CROWN VIC	F	1/26/2007	8738
SHALLOTTE	NC	USA	9107544341 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP06ZX7P [REDACTED]	6/2/2007	2007 FUSION	R	7/9/2007	3
NORFOLK	VA	USA	7574616401 wheels	Unknown	Unknown	3FRML55Z87V [REDACTED]	11/16/2006	2007 LCF 550 SEF	F	3/29/2008	820
CADILLAC	MI	USA	2317753448 wheels	Unknown	P235/65R17 BSW A/S	2FMDK49C57B [REDACTED]	3/21/2007	2007 EDGE	R	4/4/2007	6031
ST LOUIS	MO	USA	3148310200 wheels	Unknown	P225/60TR-16 WSW	2MEFM74V97X [REDACTED]	12/13/2006	2007 GRAND MARR		3/14/2007	4522
STOCKBRIDGE	MI	USA	5178517035 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P77E [REDACTED]	6/13/2006	2007 F-250 SD	R	11/22/2006	11988



ROYAL OAK	MI	USA	2485484100 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C77B [REDACTED]	1/16/2007	2007 EDGE	R	1/27/2007	6300
ROCHESTER	NY	USA	5852273800 wheels	Unknown	P225/60TR-16 WSW	2MEFM74VX7X [REDACTED]	3/6/2007	2007 GRAND MARR		5/29/2007	4116
LAKE CHARLES	LA	USA	3374740070 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P37E [REDACTED]	8/2/2006	2007 F-250 SD	R	12/26/2006	8109
CHEEKTOWAG	NY	USA	7166840010 wheels	Unknown	LT245/75R-16E BSW A-S	1FTNE24WX7D [REDACTED]	6/25/2007	2007 E-250	F	7/26/2007	3
OXNARD	CA	USA	8059836511 wheels	Unknown	P235/70R-16T BSW A-S LRR	1FMYU49H47K [REDACTED]	10/5/2006	2007 ESCAPE	R	4/23/2007	1566
TORONTO	ON	CAN	4162921171	Unknown	P205/60R16 ALL SEASON	3FAHP07177R [REDACTED]	2/2/2007	2007 FUSION	R	5/16/2007	652
MATANE	QC	CAN	4185621256	Unknown	P235/70R-16 OWL A-S	1FMYU93167K [REDACTED]	8/18/2006	2007 ESCAPE	R	11/2/2006	7381
ERIE	PA	USA	8148782500 wheels	Unknown	LT245/75/R17E A/S BSW	1FTNF21557E [REDACTED]	6/25/2006	2007 F-250 SD	R	11/24/2006	7105
COLLEGE PARK	MD	USA	3014745100 wheels	Unknown	P195/60R 15T BSW (87T)	1FAHP31N07W [REDACTED]	12/21/2006	2007 FOCUS	R	8/9/2007	5

CAROL STREAM IL	USA	6306829200 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR14E97P [REDACTED]		1/4/2007	2007 RANGER	R	7/24/2007	151
POTTSTOWN PA	USA	6104957172 wheels	Unknown	P215/60R 17 A/S BSW	1FAFP27187G [REDACTED]	6/8/2006	2007 FIVE HUNDRR		2/20/2007	7018
COLLIERVILLE TN	USA	9018543673 wheels	Unknown	P275/65R18 A/T OWL	1FTPW14V57K [REDACTED]	8/11/2006	2007 F-150	R	9/27/2006	4423
LAKEWOOD NJ	USA	7323638100 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z27R [REDACTED]	2/8/2007	2007 FUSION	F	3/6/2007	7341
DOVER NH	USA	6037495500 wheels	Unknown	P245/65R 17 A/S OWL	1FMEU73E47U [REDACTED]	12/22/2006	2007 EXPLORER	R	12/12/2007	13
BALTIMORE MD	USA	4102826300 wheels	Unknown	P225/50VR 17	3LNHM26T57R [REDACTED]	10/18/2006	2007 MKZ	R	6/8/2007	1039
WARREN IN	USA	2603753525 wheels	Unknown	P225/60R18 BSW TIRE	1FMDK03177G [REDACTED]	9/18/2006	2007 FREESTYLE	F	10/3/2006	14269
PEARISBURG VA	USA	5409211531 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSX21Y67E [REDACTED]	7/20/2006	2007 F-250 SD	R	12/13/2006	6661

TAWAS CITY	MI	USA	9893623489 wheels	Unknown	P235/65R18 A/S OWL	1FMEU75807U [REDACTED]	3/30/2007	2007 EXPLORER	L	4/3/2007	6952
BELLEVILLE	MI	USA	7346979161 wheels	Unknown	P215/60R 17 A/S BSW	1FAFP24147G [REDACTED]	6/8/2006	2007 FIVE HUNDRR		12/29/2006	6819
KATY	TX	USA	2816754700 wheels	Unknown	P265/60R18 A/S OWL	1FTPW12V77K [REDACTED]	2/27/2007	2007 F-150	R	6/8/2007	4247
ARUNDEL	ME	USA	2079857171 wheels	Unknown	P225/50VR 17	3LNHM26T87F [REDACTED]	2/28/2007	2007 MKZ	R	3/28/2007	2164
DOTHAN	AL	USA	3347925171 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z47R [REDACTED]	1/4/2007	2007 FUSION	F	1/19/2007	6785
WOODBIDGE	ON	CAN	4167984777	Unknown	195/60R 15T BSW	1FAFP31N17W [REDACTED]	1/24/2007	2007 FOCUS	R	6/30/2007	1087
CHESAPEAKE	VA	USA	7574241111 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21557E [REDACTED]	6/14/2006	2007 F-250 SD	R	9/20/2006	237
ROCHESTER	MN	USA	5072887564 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H075 [REDACTED]	2/9/2007	2007 MUSTANG	R	11/16/2007	65
WINDSOR	ON	CAN	5199487800	Unknown	P225/50VR 17	3FAHP08137R [REDACTED]	2/14/2007	2007 FUSION	L	3/15/2007	8434
FT MYERS	FL	USA	2394332277 wheels	Unknown	P275/55R20" BSW A/S	5LMFU27527L [REDACTED]	4/10/2007	2007 NAVIGATOR	R	4/24/2007	4718
THOMASTON	GA	USA	7066482191 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07177R [REDACTED]	9/14/2006	2007 FUSION	R	7/24/2007	1075
HAGERSTOWN	MD	USA	3017333673 wheels	Unknown	LT245/75/R17E A/S BSW	1FTWW33P67E [REDACTED]	9/21/2006	2007 F-350 SD	R	11/25/2006	4360
PEORIA	AZ	USA	6239778888 wheels	Unknown	P255/65R 17 A/S OWL	1FTPW12537K [REDACTED]	2/13/2007	2007 F-150	R	4/2/2007	6987

PARAMUS	NJ	USA	2012624900 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07ZX7E [REDACTED]	3/1/2007	2007 FUSION	F	3/16/2007	7694
STE-AGATHE-N	QC	CAN	8193268944	Unknown	P225/60R-16 BSW-PERFORMANC	I2FMZA55267E [REDACTED]	5/9/2006	2007 FREESTAR	R	8/22/2006	6207
LUCKNOW	ON	CAN	5195282813	Unknown	LT265/70/R17E A/S BSW	1FTSW21YX7E [REDACTED]	7/19/2006	2007 F-250 SD	R	8/16/2006	13787
BREMEN	IN	USA	5745462727 wheels	Unknown	LT225/75R-16E BSW A-S	1FDXE45P67D [REDACTED]	4/3/2007	2007 E-450	F	6/28/2007	5
KANSAS CITY	MO	USA	8167814844 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C07E [REDACTED]	2/8/2007	2007 EDGE	R	2/28/2007	7588
CATHEDRAL CI	CA	USA	7603282102 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTPX14557F [REDACTED]	8/28/2006	2007 F-150	R	12/21/2006	11979
ROMEO	MI	USA	5867525500 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE	1FMEU74E77U [REDACTED]	11/20/2006	2007 EXPLORER	R	12/27/2006	10189

KANSAS CITY	MO	USA	8167814844 wheels	Unknown	P255/70R18 A/S OWL	1FMFK20527L [REDACTED]	5/1/2007	2007 EXPEDITION R	7/9/2007	690
RUSK	TX	USA	9036832204 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17567L [REDACTED]	9/27/2006	2007 EXPEDITION F	10/15/2006	21088
CHARDON	OH	USA	4402867131 wheels	Unknown	P225/60TR-16 WSW	2MEFM74V87X [REDACTED]	9/12/2006	2007 GRAND MARR	4/30/2007	4931
ELBRIDGE	NY	USA	3156893971 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT82H275 [REDACTED]	6/6/2007	2007 MUSTANG R	7/31/2007	553
RICHMOND	MI	USA	5867273885 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTYR44U57P [REDACTED]	12/14/2006	2007 RANGER R	4/30/2007	5594
KINGSTON	ON	CAN	6135462211	Unknown	275/65R 20E A/T BSW TIRE	1FTSW21P47E [REDACTED]	5/21/2006	2007 F-250 SD R	8/29/2006	21682
ODESSA	TX	USA	4323320421 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C27B [REDACTED]	1/22/2007	2007 EDGE R	3/20/2007	8394
DOWAGIAC	MI	USA	2697822151 wheels	Unknown	LT225/75R-16E BSW A-S	1FDXE45SX7D [REDACTED]	7/31/2007	2007 E-450 R	3/31/2008	5

DOWAGIAC	MI	USA	2697822151 wheels	Unknown	LT225/75R-16E BSW A-S	1FDXE45S27D [REDACTED]	7/31/2007	2007 E-450	F	1/17/2008	5
DOWAGIAC	MI	USA	2697822151 wheels	Unknown	LT225/75R-16E BSW A-S	1FDXE45S77D [REDACTED]	7/31/2007	2007 E-450	R	12/28/2007	5
DAVENPORT	IA	USA	5633912600 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H575 [REDACTED]	3/22/2007	2007 MUSTANG	R	4/17/2007	2622
BLUE ISLAND	IL	USA	7083854500 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSX21577E [REDACTED]	6/23/2006	2007 F-250 SD	R	6/22/2007	2657
MAPLE CREEK	SK	CAN	3066622617	Unknown	P275/65R18 A/T OWL	1FTPW145X7F [REDACTED]	8/31/2006	2007 F-150	R	8/23/2007	350
INDIAN TRAIL	NC	USA	7042838521 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W57N [REDACTED]	1/4/2007	2007 F-150	R	3/31/2007	7313
RANCHO SANTO	CA	USA	9494596800 wheels	Unknown	P225/55R18 A/S BSW	1FAHP24167G [REDACTED]	1/25/2007	2007 FIVE HUNDRED		2/10/2007	6161
HIGHLAND PARK	IL	USA	8478315880 wheels	Unknown	LT225/75R-16E BSW A-S	1FDWE35L07D [REDACTED]	5/11/2007	2007 E-350	F	8/20/2007	203
LITHIA SPRING	GA	USA	7709419000 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H475 [REDACTED]	1/5/2007	2007 MUSTANG	R	1/31/2007	11500
LOUISBURG	KS	USA	9138374311 wheels	Unknown	P245/60R18 A/S BSW	2FMDK38C67B [REDACTED]	5/9/2007	2007 EDGE	R	6/12/2007	3650

GETZVILLE	NY	USA	7166885464 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU93187K [REDACTED]	12/7/2006	2007 ESCAPE	R	2/23/2007	6749
PRINCE GEORGE	VA	USA	8048621000 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT82H875 [REDACTED]	4/11/2007	2007 MUSTANG	R	5/5/2007	4292
SCARSDALE	NY	USA	9144729500 wheels	Unknown	P255/70R18 A/S OWL	1FMFK16507L [REDACTED]	4/25/2007	2007 EXPEDITION	R	5/16/2007	4928
PRINCE FREDERICK	MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W17X [REDACTED]	1/29/2007	2007 CROWN VIC	F	3/1/2007	7087
LATHAM	NY	USA	5187854161 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT85H275 [REDACTED]	4/5/2007	2007 MUSTANG	R	5/7/2007	14986
SHERBROOKE	QC	CAN	8195634466	Unknown	P235/75R 17 A/T BSW TIRES	1FTPX14587F [REDACTED]	11/30/2006	2007 F-150	R	12/19/2006	12432
EXETER	ON	CAN	5192351380	Unknown	P225/50VR 17	3LNHM28T07R [REDACTED]	10/3/2006	2007 MKZ	R	5/19/2007	7564
PRINCE FREDERICK	MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W07X [REDACTED]	3/21/2007	2007 CROWN VIC	F		6591
PRINCE FREDERICK	MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W77X [REDACTED]	2/12/2007	2007 CROWN VIC	F	3/22/2007	10382
CATHEDRAL CITY	CA	USA	7603282102 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT85H375 [REDACTED]	6/21/2007	2007 MUSTANG	R	7/16/2007	901

WEBSTER	NY	USA	5857871700 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU93117K [REDACTED]	6/3/2006	2007 ESCAPE	R	8/14/2006	7359
TRENTON	ON	CAN	6133926561	Unknown	P245/60R18 A/S BSW	2FMDK39C17B [REDACTED]	12/4/2006	2007 EDGE	R		3091
PEACE RIVER	AB	CAN	7806243450	Unknown	P275/65R18 A/T OWL	1FTPW14V07F [REDACTED]	4/14/2007	2007 F-150	R	7/13/2007	2485
PRINCE FREDE MD		USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W27X [REDACTED]	2/12/2007	2007 CROWN VIC	F	3/22/2007	11700
PRINCE FREDE MD		USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W57X [REDACTED]	2/1/2007	2007 CROWN VIC	F	3/1/2007	4571
ANGOLA	IN	USA	2606659526 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12277K [REDACTED]	12/14/2006	2007 F-150	R	2/27/2007	24956
GARDEN CITY	MI	USA	7344254300 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN 4M2EU48E37U [REDACTED]		4/19/2007	2007 MOUNTAINE	R	5/23/2007	3418
TILLSONBURG	ON	CAN	5198423646	Unknown	P275/55R20 A/T OWL	1FTPW12V67K [REDACTED]	6/23/2007	2007 F-150	R	7/6/2007	6402
SIDNEY	MT	USA	4064331810 wheels	Unknown	P215/65R17 BSW	1FMDK05147G [REDACTED]	1/4/2007	2007 FREESTYLE	F	1/19/2007	15231
WINNIPEG	MB	CAN	2042847650	Unknown	P245/60R18 A/S BSW H-RATED	2FMDK49C17B [REDACTED]	7/27/2007	2007 EDGE	R	8/18/2007	1304



CAROL STREAM IL	USA	6306829200 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C57B [REDACTED]	1/26/2007	2007 EDGE	R	3/14/2007	8426
MOJAVE CA	USA	6618242477 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C77B [REDACTED]	12/21/2006	2007 EDGE	R	4/24/2007	7178
PHILADELPHIA PA	USA	2156246700 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT84N475 [REDACTED]	2/8/2007	2007 MUSTANG	R	3/14/2007	10076
NASHVILLE TN	USA	6152974111 wheels	Unknown	P215/60R-16 BSW ALL SEASON	1FAFP56U17 [REDACTED]	5/1/2006	2007 TAURUS	F	5/16/2006	17241
DETROIT MI	USA	3138854000 wheels	Unknown	P245/65R 17 GOODRICH TIRE VE4M2EU47E27U [REDACTED]		5/9/2007	2007 MOUNTAINE R		5/23/2007	2928
DARTMOUTH NS	CAN	9024347700	Unknown	P275/65R18 A/T OWL	1FTPX14V77F [REDACTED]	7/28/2007	2007 F-150	R	8/9/2007	2840
TAMPA FL	USA	8138725555 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H675 [REDACTED]	9/5/2006	2007 MUSTANG	R	9/1/2007	595
TEMECULA CA	USA	9516991302 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRX12W97K [REDACTED]	6/22/2007	2007 F-150	R	8/22/2007	1376
HUMBOLDT TN	USA	7317849311 wheels	Unknown	P225/50VR 17	3FAHP07Z97R [REDACTED]	12/18/2006	2007 FUSION	R	1/19/2007	12712
LATROBE PA	USA	7245377723 wheels	Unknown	P215/65R16 96T A/S	1ZVFT80NX75 [REDACTED]	10/6/2006	2007 MUSTANG	R	5/24/2007	8360
PRINCE FREDE MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W47X [REDACTED]	2/1/2007	2007 CROWN VIC' F		3/1/2007	2044

ELIZABETH	TOW KY	USA	2707371000 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80NX7 [REDACTED]	1/12/2007	2007 MUSTANG	R	4/7/2007	13364
KINSTON	NC	USA	2525223673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N675 [REDACTED]	12/20/2006	2007 MUSTANG	R		12331
EDMONTON	AB	CAN	7804899999	Unknown	P235/75R15SL S/BLT OWL A-T	1FTYR44U17P [REDACTED]	2/14/2007	2007 RANGER	R	5/15/2007	4591
MEDFORD	NJ	USA	6096545166 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P37E [REDACTED]	8/3/2006	2007 F-250 SD	R	5/7/2007	2909
PRINCE FREDE	MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W87X [REDACTED]	1/31/2007	2007 CROWN VIC	F	3/1/2007	15966
WESTLAKE	OH	USA	4408718600 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C57B [REDACTED]	3/20/2007	2007 EDGE	F	4/4/2007	15525
TULSA	OK	USA	9182806086 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT82H875 [REDACTED]	9/18/2006	2007 MUSTANG	R	7/31/2007	2143
SCHERERVILLE	IN	USA	wheels	Unknown	LT245/75R-16E BSW A-S	1FTNE24W97D [REDACTED]	1/9/2007	2007 E-250	F	3/5/2007	3816

BELLEVILLE	IL	USA	6182340330 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT80N375 [REDACTED]	8/26/2006	2007 MUSTANG	R	9/28/2007	539
MEDICINE HAT	AB	CAN	4035274406	Unknown	P275/55R20" BSW A/S	5LMFU28557L [REDACTED]	11/30/2006	2007 NAVIGATOR	F		7977
HERMISTON	OR	USA	5035673291 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N575 [REDACTED]	1/10/2007	2007 MUSTANG	R	3/9/2007	7773
HAMBURG	NY	USA	7166495640 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU73E77U [REDACTED]		3/23/2007	2007 EXPLORER	R	4/2/2007	9330
RANDOLPH	NJ	USA	2019276700 wheels	Unknown	P225/75R15 BSW	1FMYU92Z77K [REDACTED]	7/19/2006	2007 ESCAPE	R	10/18/2006	9456
ANNISTON	AL	USA	2568315300 wheels	Unknown	P255/65R 17 A/S OWL	1FTPW12547K [REDACTED]	1/30/2007	2007 F-150	R	9/3/2007	4196
KATY	TX	USA	2816754700 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21PX7E [REDACTED]	6/23/2006	2007 F-250 SD	R	5/18/2007	9950

TANEYTOWN	MD	USA	4107566655 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU74E77U [REDACTED]	3/23/2007	2007 EXPLORER	R	4/21/2007	17341
GADSDEN	AL	USA	2565439400 wheels	Unknown	P235/70R 17 A/S BSW TIRES 1FTRX12W37N [REDACTED]	2/26/2007	2007 F-150	F	3/13/2007	30181
LAS VEGAS	NV	USA	7027312121 wheels	Unknown	P275/65R18 A/T OWL 1FTPX14527K [REDACTED]	1/12/2007	2007 F-150	R	8/20/2007	406
AGAWAM	MA	USA	4137860430 wheels	Unknown	P205/60R16 ALL SEASON 3FAHP07Z87R [REDACTED]	11/8/2006	2007 FUSION	R	5/8/2007	6736
DAVENPORT	IA	USA	5633911500 wheels	Unknown	P235/55R 17 A/S BSW 2FAFP71W47X [REDACTED]	7/27/2006	2007 CROWN VIC	F	1/31/2007	27570
ROBLIN	MB	CAN	2049378383	Unknown	P235/60R-16 BSW 2FMZA56277B [REDACTED]	5/23/2006	2007 FREESTAR	F	6/22/2006	7456
OTTAWA	ON	CAN	6138411010	Unknown	P235/70R-16T BSW A-S 1FMYU94157K [REDACTED]	9/26/2006	2007 ESCAPE	R	10/24/2006	12738
WOODHAVEN	MI	USA	7346762200 wheels	Unknown	P245/65R 17 A/S OWL 1FMEU31KX7U [REDACTED]	2/23/2006	2007 EXPLORER	R	2/28/2006	29015
APPLETON	WI	USA	9207315211 wheels	Unknown	P235/70R 17 A/S BSW TIRES 1FTRF12257N [REDACTED]	1/4/2007	2007 F-150	F	1/19/2007	8766
CHIEFLAND	FL	USA	3524934297 wheels	Unknown	P235/55ZR17 99W A/S 1ZVFT82H775 [REDACTED]	1/4/2007	2007 MUSTANG	R	2/23/2007	10968

CLOVIS	CA	USA	5592912581 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82HX75 [REDACTED]	12/7/2006	2007 MUSTANG	R	4/18/2007	9883
BURNABY	BC	CAN	6042946525	Unknown	P225/60R-16 BSW-PERFORMANC	12FMZA50217B [REDACTED]	10/17/2006	2007 FREESTAR	F	11/10/2006	22739
MOJAVE	CA	USA	6618242477 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C77B [REDACTED]	12/21/2006	2007 EDGE	R	4/24/2007	8149
PHILADELPHIA	PA	USA	2153316600 wheels	Unknown	P205/60R16 ALL SEASON	3MEHM07Z07R [REDACTED]	2/26/2007	2007 MILAN	R	4/2/2007	6067
SOUTHERN PIN	NC	USA	9106928765 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W37N [REDACTED]	12/8/2006	2007 F-150	R	12/27/2006	11658
FINDLAY	OH	USA	4194221661 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H875 [REDACTED]	3/8/2007	2007 MUSTANG	R	3/20/2007	8351
DAHLONEGA	GA	USA	7068646504 wheels	Unknown	P235/75R15SL S/BLT OWL A-T	1FTYR44U17P [REDACTED]	5/16/2006	2007 RANGER	R	6/27/2007	10380
WOODLAND HIL	CA	USA	8188847600 wheels	Unknown	P235/70R-16T BSW A-S LRR	1FMYU49H87K [REDACTED]	12/15/2006	2007 ESCAPE	R	3/28/2007	18326
WEBSTER	NY	USA	5857871700 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07147R [REDACTED]	3/5/2007	2007 FUSION	F	3/12/2007	14654
MARINETTE	WI	USA	7157357474 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71WX7X [REDACTED]	2/14/2007	2007 CROWN VIC	F	3/30/2007	16570
MARINETTE	WI	USA	7157357474 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W67X [REDACTED]	2/14/2007	2007 CROWN VIC	F	4/5/2007	15959

SHAWNEE	KS	USA	9136310000 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C37E [REDACTED]	11/14/2006	2007 EDGE	R	2/13/2007	13432
OTTAWA	ON	CAN	6138411010	Unknown	P275/65R18 A/T OWL	1FTPW14V67K [REDACTED]	3/21/2007	2007 F-150	R	8/31/2007	4435
KANSAS CITY	MO	USA	8169411200 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C77E [REDACTED]	1/23/2007	2007 MKX	R	3/10/2007	8104
LAKE ELSINORE	CA	USA	9514714100 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H37E [REDACTED]	1/11/2007	2007 MUSTANG	R	4/14/2007	6365
GUYMON	OK	USA	5803388423 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTPX14VX7E [REDACTED]	10/19/2006	2007 F-150	F	11/2/2006	19419
BRAINTREE	MA	USA	7818481350 wheels	Unknown	P195/60R 15T BSW (87T)	1FAHP34N67W [REDACTED]	6/29/2007	2007 FOCUS	R	9/15/2007	3441
DEARBORN	MI	USA	3132748800 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN	4M2EU48E07 [REDACTED]	2/8/2007	2007 MOUNTAINEER	R	6/5/2007	7512
NASHVILLE	TN	USA	6152974111 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P47E [REDACTED]	8/2/2006	2007 F-250 SD	R	4/28/2007	9030
VILLA RICA	GA	USA	7704595132 wheels	Unknown	P235/70R-16T BSW A-S LRR	1FMCU49H37K [REDACTED]	8/10/2006	2007 ESCAPE	R	1/12/2007	9560
PRINCE FREDERICK	MD	USA	3018551739 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W07X [REDACTED]	1/31/2007	2007 CROWN VICTORIA	R	3/1/2007	12009
SALINE	MI	USA	7344295478 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C17E [REDACTED]	5/23/2007	2007 EDGE	R	6/2/2007	12009

ST CLAIR SHOR MI		USA	5867767600 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU03Z17K [REDACTED]	12/18/2006	2007 ESCAPE	R	3/1/2007	16809
HAMILTON	ON	CAN	9053886396	Unknown	P225/50VR 17	3LNHM28TX7R [REDACTED]	9/7/2006	2007 MKZ	R	7/13/2007	14284
ZACHARY	LA	USA	2256542611 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N275 [REDACTED]	1/12/2007	2007 MUSTANG	R	1/31/2007	14874
KEENE	NH	USA	6033524330 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C17B [REDACTED]	5/1/2007	2007 EDGE	F	5/16/2007	9144
BRUNSWICK	OH	USA	3302253700 wheels	Unknown	P205/60R16 ALL SEASON	3MEHM07167R [REDACTED]	4/9/2007	2007 MILAN	F	4/12/2007	6347
HAMBURG	NY	USA	7166495640 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07117R [REDACTED]	2/16/2007	2007 FUSION	R	4/2/2007	4014
HONESDALE	PA	USA	5702531888 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU93147K [REDACTED]	5/2/2006	2007 ESCAPE	F	5/18/2006	16853
GAFFNEY	SC	USA	8644894764 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21P47E [REDACTED]	6/20/2006	2007 F-250 SD	R	11/30/2006	3963
EAST ROCHEST NY		USA	5855864415 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C67B [REDACTED]	2/12/2007	2007 EDGE	R	5/23/2007	7465
ALGONA	IA	USA	5152952497 wheels	Unknown	P275/65R18 A/T OWL	1FTPW14VX7 [REDACTED]	1/30/2007	2007 F-150	R	2/27/2007	10331
LOWELL	MA	USA	9784545696 wheels	Unknown	P235/70R-16T BSW A-S	4M2YU80Z97K [REDACTED]	9/8/2006	2007 MARINER	R	11/20/2006	8799
WINNIPEG	MB	CAN	2046619555	Unknown	P235/70R-16 OWL A-T	1FMYU94167K [REDACTED]	11/8/2006	2007 ESCAPE	F	11/29/2006	7056
SPRINGVILLE	NY	USA	7165924949 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07177R [REDACTED]	10/16/2006	2007 FUSION	R	4/19/2007	15669
HAMMONTON	NJ	USA	6095618899 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT85H075 [REDACTED]	2/16/2007	2007 MUSTANG	R	3/19/2007	17666

LILLINGTON	NC	USA	9108142243 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF122X7N [REDACTED]	12/7/2006	2007 F-150	R	12/23/2006	13998
WILMINGTON	NC	USA	9107994060 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT85H975 [REDACTED]	4/12/2007	2007 MUSTANG	R	4/26/2007	15076
HARRISTON	ON	CAN	5193382310	Unknown	P255/70R17 A/T OWL	1FTPW14577K [REDACTED]	8/30/2006	2007 F-150	R	2/10/2007	10374
HAMBURG	NY	USA	7166495640 wheels	Unknown	205/50VR-16 BSW	1FAHP34N17W [REDACTED]	2/15/2007	2007 FOCUS	R	3/31/2007	7097
FALL RIVER	MA	USA	5087301000 wheels	Unknown	P225/50VR 17	3FAHP07Z37R [REDACTED]	1/6/2007	2007 FUSION	R	2/19/2007	15590
LEBANON	PA	USA	7179492000 wheels	Unknown	P235/70R-16T BSW A-S LRR	1FMCU59H67K [REDACTED]	6/5/2006	2007 ESCAPE	R	7/26/2006	26338
HOOD RIVER	OR	USA	5413865277 wheels	Unknown	LT275/65R 18C A-T OWL	1FTPW14517F [REDACTED]	6/4/2007	2007 F-150	R	10/30/2007	2151
FRESNO	CA	USA	5592265175 wheels	Unknown	P275/55R20" BSW A/S	5LMFU28537LJ [REDACTED]	10/30/2006	2007 NAVIGATOR	R	10/26/2007	4015
PLAINVILLE	CT	USA	8607938885 wheels	Unknown	225/70R-19.5" BSW TRACTION	1FDAF57P07E [REDACTED]	8/15/2006	2007 F-550 SD	R	10/31/2006	9902



MILFORD	DE	USA	3024228071 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N9752 [REDACTED]	12/20/2006	2007 MUSTANG	R	3/10/2007	4022
COLLINSVILLE	IL	USA	6183445105 wheels	Unknown	P245/60R18 A/S BSW	2LMDU88C17B [REDACTED]	12/20/2006	2007 MKX	R	1/19/2007	9876
YORK	PA	USA	7177413876 wheels	Unknown	P245/60R18 A/S BSW	2LMDU88C57B [REDACTED]	2/26/2007	2007 MKX	R	3/23/2007	3204
RANCHO SANTO	CA	USA	9494596800 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07187R [REDACTED]	10/25/2006	2007 FUSION	L	11/2/2006	9603
DES MOINES	IA	USA	5152700707 wheels	Unknown	205/50VR-16 BSW	1FAHP34N07W [REDACTED]	3/30/2007	2007 FOCUS	F	4/2/2007	7645
KNOXVILLE	TN	USA	8656872100 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N275 [REDACTED]	3/29/2007	2007 MUSTANG	R	9/22/2007	3015
MILAN	TN	USA	7316867461 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N37 [REDACTED]	12/21/2006	2007 MUSTANG	R	1/27/2007	11328
MARINETTE	WI	USA	7157357474 wheels	Unknown	P235/55R 17 A/S BSW	2FAHP71WX7X [REDACTED]	3/19/2007	2007 CROWN VIC	F	5/2/2007	20171

BEDFORD	PA	USA	8146238154 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P07E [REDACTED]	6/18/2006	2007 F-250 SD	R	5/29/2007	6013
LINDSAY	ON	CAN	7053283673	Unknown	P245/60R18 A/S BSW	2LMDU88C97B [REDACTED]	12/12/2006	2007 MKX	R	9/20/2007	12145
EXETER	ON	CAN	5192351380	Unknown	P225/55R18 A/S BSW	1FAHP25137G [REDACTED]	9/13/2006	2007 FIVE HUNDRR		10/2/2006	18664
EAST GREENW	RI	USA	4018844000 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU93177K [REDACTED]	12/20/2006	2007 ESCAPE	R	1/20/2007	26121
VENICE	FL	USA	9414971986 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C97B [REDACTED]	4/2/2007	2007 MKX	R	9/5/2007	5500
SURREY	BC	CAN	6045316100	Unknown	31X10.5R X 15C STL OWL A-T	1FTZR45E27P [REDACTED]	2/13/2007	2007 RANGER	R	3/26/2007	14679
WINCHESTER	KY	USA	8597448878 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSF21P87E [REDACTED]	6/4/2006	2007 F-250 SD	R	4/30/2007	3862
NORTH ATTLEB	MA	USA	5086991111 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP34N27W [REDACTED]	4/5/2007	2007 FOCUS	F	4/20/2007	11891
TRAVELERS RE	SC	USA	8648346060 wheels	Unknown	LT265/70/R17E A/S OWL	1FTSW20P07 [REDACTED]	6/23/2006	2007 F-250 SD	R	9/21/2007	3132
MACOMB	MI	USA	5869487700 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36CX7B [REDACTED]	12/15/2006	2007 EDGE	R	2/21/2007	14136
MIDDLEBURG	HOH	USA	4408456000 wheels	Unknown	P235/70R-16T BSW A-S	4M2YU81197K [REDACTED]	5/15/2006	2007 MARINER	R	3/12/2007	5757
HANOVER	ON	CAN	5193641840	Unknown	P205/60R16 ALL SEASON	3FAHP07Z07P [REDACTED]	9/22/2006	2007 FUSION	R	3/31/2007	10326
ORANGEVILLE	ON	CAN	5199415431	Unknown	195/60R 15T BSW	1FAHP36NX7W [REDACTED]	11/15/2006	2007 FOCUS	R	8/18/2007	12327

CARROLLTON	GA	USA	7708322457 wheels	Unknown	P235/70R-16T BSW A-S	1FMYU04137K [REDACTED]	12/12/2006	2007 ESCAPE	F	12/28/2006	15649
ONEIDA	NY	USA	3153630600 wheels	Unknown	P235/70R-16T BSW A-S	4M2CU97107K [REDACTED]	5/25/2006	2007 MARINER	R	2/26/2007	10779
COLLINGWOOD	ON	CAN	7054454300	Unknown	P265/70R 17 A/T OWL	1FMFU16527L [REDACTED]	10/30/2006	2007 EXPEDITION	F	11/14/2006	14324
KNOXVILLE	TN	USA	8656872100 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H0753 [REDACTED]	2/8/2007	2007 MUSTANG	R	6/27/2007	11161
PINE BLUFF	AR	USA	8705354321 wheels	Unknown	LT275/65R 20E A/T OWL	1FTSW21P27E [REDACTED]	8/4/2006	2007 F-250 SD	R	2/19/2007	11049
GREER	SC	USA	8648770711 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z77R [REDACTED]	12/16/2006	2007 FUSION	R	1/18/2007	26883
RHINEBECK	NY	USA	8458762046 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21557E [REDACTED]	8/3/2006	2007 F-250 SD	R	2/9/2007	4413
GLADWIN	MI	USA	9894269218 wheels	Unknown	P255/70R17 A/T OWL	1FTPX14V27F [REDACTED]	12/8/2006	2007 F-150	R	3/19/2007	7406
SHREVEPORT	LA	USA	3187983673 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07177R [REDACTED]	1/22/2007	2007 FUSION	R	9/28/2007	8717
GRAND RAPIDS	MI	USA	6163635551 wheels	Unknown	P225/60TR-16 WSW	2MEFM74V67X [REDACTED]	12/4/2006	2007 GRAND MARR			5768
NEWBURGH	NY	USA	8455613900 wheels	Unknown	P225/50VR 17	3LNHM26T77R [REDACTED]	10/13/2006	2007 MKZ	R	3/30/2007	8161
PORTSMOUTH	NH	USA	6034331221 wheels	Unknown	P235/70R-16 OWL A-S	1FMCU93147K [REDACTED]	12/18/2006	2007 ESCAPE	R	4/14/2007	12789
NIAGARA FALLS	ON	CAN	9053575410	Unknown	P235/55R 17 BSW	2FMZA57267E [REDACTED]	8/15/2006	2007 FREESTAR	F	8/31/2006	31394
SHEBOYGAN	WI	USA	9204586111 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z57R [REDACTED]	6/14/2007	2007 FUSION	R	11/7/2007	1791

TILLSONBURG	ON	CAN	5198423646	Unknown	LT245/75/R17E A/T OWL	1FTWW33P87E [REDACTED]	7/1/2006	2007 F-350 SD	R	10/25/2006	12094
NAZARETH	PA	USA	6107599300 wheels	Unknown	P275/55R20" BSW A/S	5LMFU28507L [REDACTED]	10/25/2006	2007 NAVIGATOR	R	3/13/2007	11242
SCHERERVILLE	IN	USA	wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W07K [REDACTED]	1/10/2007	2007 F-150	F	2/27/2007	7486
EPHRATA	PA	USA	7177336644 wheels	Unknown	P225/55R18 A/S BSW	1FAHP25147G [REDACTED]	1/30/2007	2007 FIVE HUNDRR		7/7/2007	4781
DAYTONA BEAC	FL	USA	3862536771 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39C67B [REDACTED]	8/29/2007	2007 EDGE	R	2/6/2008	234
ELIZABETH	TOW KY	USA	2707371000 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12207N [REDACTED]	1/4/2007	2007 F-150	R	1/31/2007	12783
AMSTERDAM	NY	USA	5188425416 wheels	Unknown	P255/70R-16 OWL A-T	1FTZR15E07 [REDACTED]	9/20/2006	2007 RANGER	R	10/19/2006	9943
DES MOINES	IA	USA	5152700707 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP31N67W [REDACTED]	10/27/2006	2007 FOCUS	R	1/29/2007	18114
NORTH ATTLEB	MA	USA	5086991111 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP34N27W [REDACTED]	7/25/2007	2007 FOCUS	R	8/21/2007	6025
CLEARWATER	FL	USA	7275353673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C97B [REDACTED]	1/11/2007	2007 EDGE	R	3/31/2007	9261
LOWELL	MA	USA	9784545696 wheels	Unknown	P275/55R20" BSW A/T	5LTPW18587F [REDACTED]	3/22/2007	2007 MARK LT	R	1/2/2008	10
HARLINGEN	TX	USA	9564232580 wheels	Unknown	P265/60R18 A/S OWL	1FTRW12W57 [REDACTED]	6/11/2007	2007 F-150	R	9/10/2007	3818
DICKSON	TN	USA	6154462308 wheels	Unknown	LT265/70/R17E A/T BSW	1FTSW21P97E [REDACTED]	6/22/2006	2007 F-250 SD	R	6/29/2007	8867
ABERDEEN	MD	USA	4102724300 wheels	Unknown	P225/60TR-16 WSW	2MEFM74V97X [REDACTED]	1/22/2007	2007 GRAND MARR		3/29/2007	11062

BELTON	SC	USA	8643388080 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C07B [REDACTED]	1/17/2007	2007 EDGE	R	2/3/2007	25314
LEXINGTON	KY	USA	8592711800 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU18527L [REDACTED]	1/26/2007	2007 EXPEDITION	R	3/21/2007	14963
LINDSAY	ON	CAN	7053249484	Unknown	P235/55R 17 BSW	2FMZA57217 [REDACTED]	10/4/2006	2007 FREESTAR	R	4/12/2007	14024
JOLIETTE	QC	CAN	4507597750	Unknown	P245/60R18 A/S BSW	2FMDK48C27B [REDACTED]	4/17/2007	2007 EDGE	R	4/27/2007	7900
VERO BEACH	FL	USA	7725693400 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H475 [REDACTED]	10/6/2006	2007 MUSTANG	R	5/7/2007	3141
HERMISTON	OR	USA	5035673291 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N575 [REDACTED]	12/20/2006	2007 MUSTANG	R	4/5/2007	18197
PUTNAM	CT	USA	8609282731 wheels	Unknown	P235/65R17 BSW A/S	2FMDK46C77B [REDACTED]	12/14/2006	2007 EDGE	R	12/14/2007	1003
COLLIERVILLE	TN	USA	9018543673 wheels	Unknown	P225/50VR 17	3FAHP08197R [REDACTED]	4/25/2007	2007 FUSION	L	4/26/2007	3443
CINCINNATI	OH	USA	5133851414 wheels	Unknown	LT265/70/R17E A/T BSW	1FTNF21587E [REDACTED]	11/21/2006	2007 F-250 SD	R	4/25/2007	2673
BELLEFONTE	PA	USA	8143555445 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21P87E [REDACTED]	7/25/2006	2007 F-250 SD	R	5/11/2007	7500
GREER	SC	USA	8648770711 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C47B [REDACTED]	11/27/2006	2007 EDGE	F	1/2/2007	22565

LAKE CITY	SC	USA	8433743943 wheels	Unknown	P215/65R17 BSW	1FMDK02157G [REDACTED]	12/12/2006	2007 FREESTYLE R	12/30/2006	6509
KANSAS CITY	MO	USA	8169411200 wheels	Unknown	P225/60TR-16 WSW	2MEFM74VX7X [REDACTED]	10/23/2006	2007 GRAND MARR	3/19/2007	16654
VILLA RICA	GA	USA	7704595132 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1	FMEU63E17U [REDACTED]	1/3/2007	2007 EXPLORER F	1/17/2007	20310
NORTH ATTLEB MA		USA	5086991111 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N8753 [REDACTED]	6/8/2007	2007 MUSTANG R		4432
GATINEAU	QC	CAN	8199863000	Unknown	P275/65R18 A/T OWL	1FTPW14V27F [REDACTED]	6/1/2007	2007 F-150 R	6/28/2007	9980
HOMESTEAD	FL	USA	3052475112 wheels	Unknown	P215/65R16 96T A/S	1ZVHT80N675 [REDACTED]	7/27/2006	2007 MUSTANG R	12/22/2006	9276
MEMPHIS	TN	USA	9017626500 wheels	Unknown	P255/70R17 A/T OWL	1FTPW14V37K [REDACTED]	9/29/2006	2007 F-150 R	2/1/2007	4458
BLACKSBURG	VA	USA	5405524331 wheels	Unknown	P255/70R17 A/T OWL	1FTPX14V17N [REDACTED]	2/23/2007	2007 F-150 R	4/26/2007	12597
HIGHLAND	IL	USA	6186542122 wheels	Unknown	P225/70R15SL S/BLT RBL A-S	1FTYR10D77P [REDACTED]	5/3/2006	2007 RANGER R	12/22/2006	24839
MAITLAND	FL	USA	4076447111 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU03197K [REDACTED]	10/13/2006	2007 ESCAPE R	4/10/2007	13934
WINDBER	PA	USA	8144675565 wheels	Unknown	205/50VR-16 BSW	1FAHP34N47W [REDACTED]	3/23/2007	2007 FOCUS R	7/6/2007	4355

GULF BREEZE	FL	USA	8509348366 wheels	Unknown	P265/60R18 A/S OWL	1FTPW12V97F [REDACTED]	1/25/2007	2007 F-150	R	2/20/2007	6044
OAKVILLE	ON	CAN	9058443273	Unknown	P245/60R18 A/S BSW	2FMDK49C27B [REDACTED]	5/1/2007	2007 EDGE	R	7/3/2007	7027
MARSHALL	TX	USA	9039350665 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80NX75 [REDACTED]	1/19/2007	2007 MUSTANG	R	2/15/2007	9845
FRANKLIN	IN	USA	3177365185 wheels	Unknown	P215/60R-16 BSW ALL SEASON	1FAFP56U27 [REDACTED]	10/10/2006	2007 TAURUS	F	10/25/2006	28865
WOODBIDGE	ON	CAN	4167984777	Unknown	P245/60R18 A/S BSW	2LMDU88CX7 [REDACTED]	12/15/2006	2007 MKX	R	12/21/2006	16891
GATINEAU	QC	CAN	8199863000	Unknown	P235/70R-16 OWL A-S	1FMYU03197K [REDACTED]	9/18/2006	2007 ESCAPE	R	11/7/2006	10619
KANSAS CITY	MO	USA	8169411200 wheels	Unknown	P205/60 R16 V AS TIRE	3FAHP011X7R [REDACTED]	12/18/2006	2007 FUSION	R	12/27/2007	1287
NORTH AUROR.	IL	USA	6309073100 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT82H375 [REDACTED]	9/19/2006	2007 MUSTANG	R	9/30/2006	32189
MIDDLEBURG	HOH	USA	4408456000 wheels	Unknown	P245/60R18 A/S BSW H-RATED	2LMDU88C57 [REDACTED] 4	6/18/2007	2007 MKX	R	7/26/2007	5331
CALGARY	AB	CAN	4032912800	Unknown	P195/60R 15T BSW (87T)	1FAFP34N37W [REDACTED]	6/13/2007	2007 FOCUS	R	12/5/2007	4268
ALEXANDER CI	AL	USA	2562343432 wheels	Unknown	P235/70R-16 OWL A-S	1FTYR44U27P [REDACTED]	8/9/2006	2007 RANGER	R	12/3/2007	301
TEMECULA	CA	USA	9516991302 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N175 [REDACTED]	3/26/2007	2007 MUSTANG	R	4/23/2007	5463
O'FALLON	MO	USA	6369783673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H775 [REDACTED]	1/10/2007	2007 MUSTANG	R	2/17/2007	12437

PORTSMOUTH NH		USA	6034331221 wheels	Unknown	P225/55R18 A/S BSW	1FAHP28197G [REDACTED]	9/22/2006	2007 FIVE HUNDRR		12/13/2006	20573
JACKSONVILLE NC		USA	9104551911 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12247 [REDACTED]	12/15/2006	2007 F-150	R	5/4/2007	9675
RANCHO SANT/CA		USA	9494596800 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z77 [REDACTED]	2/8/2007	2007 FUSION	F	2/23/2007	19628
MIAMISBURG OH		USA	9378660781 wheels	Unknown	P275/65R18 A/T OWL	1FTPX14V67F [REDACTED]	12/15/2006	2007 F-150	R	6/5/2007	12644
ROCHESTER NY		USA	5852720220 wheels	Unknown	P215/60R-16 BSW ALL SEASON	1FAFP56U57 [REDACTED]	6/21/2006	2007 TAURUS	F	7/6/2006	28714
GANDER NL		CAN	7092564821	Unknown	P255/70R17 A/T OWL	1FTPW14597F [REDACTED]	11/3/2006	2007 F-150	R	6/7/2007	8929
ORLANDO FL		USA	4072753200 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82HX75 [REDACTED]	12/22/2006	2007 MUSTANG	R	2/27/2007	9278



NEW HOLLAND PA		USA	7173544901 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU73E37U		12/8/2006	2007 EXPLORER	R	3/19/2007	9311
BELMAR NJ		USA	7326811600 wheels	Unknown	P275/65R18 A/T OWL	1FTPW14V67F	2/13/2007	2007 F-150	R	3/1/2007	18864
ORLANDO FL		USA	4072753200 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU63E07U		12/5/2006	2007 EXPLORER	R	1/5/2007	9337
EVELETH MN		USA	2187444821 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21527E	7/21/2006	2007 F-250 SD	R	11/3/2006	11134
CLINTON MI		USA	5174567414 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU93177K	12/7/2006	2007 ESCAPE	R	7/28/2007	12398
DALLAS GA		USA	7704458891 wheels	Unknown	P255/70R18 A/S OWL	1FMFU19577L	3/2/2007	2007 EXPEDITION	R	4/20/2007	16660
RANCHO SANTA CA		USA	9494596800 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z27R	2/20/2007	2007 FUSION	F	3/8/2007	20403
ILE-PERROT QC		CAN	5144535850	Unknown	P275/55R20 A/T OWL	1FTPW14V07K	1/9/2007	2007 F-150	R	1/31/2007	19543
SLIDELL LA		USA	9856438900 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12277	2/22/2007	2007 F-150	R	2/28/2007	17741
GOSHEN NY		USA	8453433135 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H975	7/26/2006	2007 MUSTANG	R	5/22/2007	2524
FORT MYERS FL		USA	2399363673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N2752	12/22/2006	2007 MUSTANG	R	3/24/2007	6458
MIDDLEBURG HOH		USA	4408456000 wheels	Unknown	P235/65R18 MICHELIN TIRE VEN 4M2EU48897U		2/15/2007	2007 MOUNTAINEER	R	6/21/2007	12558

HIGHLAND PAR IL	USA	8478315880 wheels	Unknown	P225/60TR-16 BSW A-S	2MEFM75V27X6 [REDACTED]	1/31/2007	2007 GRAND MARF		2/26/2007	17638
SURREY BC	CAN	6045889921	Unknown	LT225/75R-16E BSW A-S	1FDXE45P77D [REDACTED]	4/5/2007	2007 E-450	F	2/9/2008	19
FLEMINGTON NJ	USA	9087823673 wheels	Unknown	195/60R 15T BSW	1FAHP36N37W [REDACTED]	10/4/2006	2007 FOCUS	R	11/30/2006	5346
FORT WAYNE IN	USA	2604363673 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12297 [REDACTED]	4/18/2007	2007 F-150	R	5/11/2007	6756
FORT MYERS FL	USA	2399363673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N275 [REDACTED]	12/22/2006	2007 MUSTANG	R	3/24/2007	6458
SHEBOYGAN WI	USA	9204586111 wheels	Unknown	P255/70R17 A/T OWL	1FTPW14V17F [REDACTED]	8/3/2007	2007 F-150	R	10/3/2007	7400
DADE CITY FL	USA	3525676711 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRX12W67N [REDACTED]	12/12/2006	2007 F-150	R	3/17/2007	12904
TAMPA FL	USA	8132463673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H875 [REDACTED]	3/22/2007	2007 MUSTANG	R	12/26/2007	6178
ROSLYN NY	USA	5164846633 wheels	Unknown	P235/70R-16T BSW A-S	4M2CU97107K [REDACTED]	6/27/2006	2007 MARINER	R	7/24/2006	20897
CHATTANOOGA TN	USA	4237561331 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12227N [REDACTED]	12/7/2006	2007 F-150	R	3/26/2007	17044
CAROL STREAM IL	USA	6306829200 wheels	Unknown	P215/65R17 BSW	1FMDK02157G [REDACTED]	8/21/2006	2007 FREESTYLE	R	4/4/2007	20436
ADRIAN MI	USA	5172658187 wheels	Unknown	P225/50VR 17	3LNHM26T67P [REDACTED]	11/14/2006	2007 MKZ	R	12/20/2006	13256

CAMPO GRAND MS		BRA	55-7-322-1	Unknown	P225/50VR 17	3FAHP08Z57F [REDACTED]	3/29/2007	2007 FUSION	R	6/5/2007	6584
OAKVILLE	ON	CAN	9058443273	Unknown	P275/65R18 A/T OWL	1FTPX14V07F [REDACTED]	3/5/2007	2007 F-150	R	3/20/2007	5828
MEMPHIS	TN	USA	9017626500 wheels	Unknown	LT265/70/R17E A/S BSW	1FTSW20P77 [REDACTED]	6/26/2006	2007 F-250 SD	R	7/23/2007	7838
BRUNSWICK	OH	USA	3302253700 wheels	Unknown	P245/60R18 A/S BSW H-RATED	2LMDU68C37B [REDACTED]	6/28/2007	2007 MKX	R	8/2/2007	5531
FINDLAY	OH	USA	4194221661 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H7752 [REDACTED]	10/26/2006	2007 MUSTANG	R	1/13/2007	12443
LAKE ORION	MI	USA	2486936241 wheels	Unknown	P235/65R17 BSW A/S	2FMDK39C87B [REDACTED]	1/16/2007	2007 EDGE	L	1/19/2007	19006
BEREA	OH	USA	4402342770 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C37 [REDACTED]	8/16/2006	2007 EDGE	L	9/26/2006	7717
TAMPA	FL	USA	8132463673 wheels	Unknown	P275/55R20 A/T OWL	1FTPW14V97K [REDACTED]	3/29/2007	2007 F-150	R	4/7/2007	16452
NACOGDOCHE	TX	USA	9365647337 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT82H57 [REDACTED]	6/5/2006	2007 MUSTANG	R	4/20/2007	8950
NAZARETH	PA	USA	6107599300 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSW21PX7E [REDACTED]	6/8/2006	2007 F-250 SD	R	9/29/2006	12538
SAGINAW	MI	USA	9897921700 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C67B [REDACTED]	12/18/2006	2007 MKX	R	10/31/2007	7151

BROOMALL	PA	USA	6103535500 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P67E [REDACTED]	6/22/2006	2007 F-250 SD	R	8/13/2007	8977
SOMERVILLE	NJ	USA	9087222500 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU74E37U [REDACTED]		3/20/2007	2007 EXPLORER	F	4/4/2007	27650
MIAMI	FL	USA	3055576500 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT85H775 [REDACTED]	4/18/2007	2007 MUSTANG	R	7/18/2007	10550
DELRAY BEACH	FL	USA	5614541800 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C97 [REDACTED]	5/8/2007	2007 MKX	R	6/11/2007	10624
ROSLYN	NY	USA	5164846633 wheels	Unknown	Unknown	5LMFU28557LJ [REDACTED]	8/24/2006	2007 NAVIGATOR	R	2/25/2008	458
INGLESIDE	ON	CAN	6135372287	Unknown	195/60R 15T BSW	1FAHP34N17W [REDACTED]	2/22/2007	2007 FOCUS	R	12/31/2007	1337
EVELETH	MN	USA	2187444821 wheels	Unknown	P235/65R17 BSW A/S	2FMDK46C37B [REDACTED]	5/10/2007	2007 EDGE	F	5/25/2007	8550
REED CITY	MI	USA	2318322206 wheels	Unknown	P255/70R-16 OWL A-T	1FTZR15E77P [REDACTED]	10/9/2006	2007 RANGER	R	8/31/2007	1859
CORPUS CHRISTI		USA	3619946200 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H275 [REDACTED]	12/22/2006	2007 MUSTANG	R	5/30/2007	10761
LA PLATA	MD	USA	3018703025 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTRF14W07N [REDACTED]	1/3/2007	2007 F-150	F	2/21/2007	16494

WARRENSBURG	MO	USA	6607477111 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C77B [REDACTED]	12/21/2006	2007 EDGE	R	2/21/2007	13101
CLERMONT	FL	USA	3523946161 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39C47B [REDACTED]	1/2/2007	2007 EDGE	R	3/5/2007	23152
INDIANOLA	IA	USA	5159618151 wheels	Unknown	P225/60TR-16 WSW	2MEFM74V87X [REDACTED]	3/19/2007	2007 GRAND MARR		7/2/2007	9597
MINNETONKA	MN	USA	9525465441 wheels	Unknown	P275/55R20" BSW A/S	5LMFU285X7L [REDACTED]	11/29/2006	2007 NAVIGATOR F		12/24/2006	15216
GREENWOOD	IN	USA	3178812541 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTRX14W67F [REDACTED]	2/27/2007	2007 F-150	R	3/15/2007	9220
PORT JEFFERS	NY	USA	6314736900 wheels	Unknown	P245/65R 17 GOODRICH TIRE VE4M2EU47EX7U [REDACTED]		2/13/2007	2007 MOUNTAINE R		3/10/2007	15028
SANDUSKY	OH	USA	4196264721 wheels	Unknown	P235/70R-16 OWL A-S	1FMYU031X7K [REDACTED]	12/14/2006	2007 ESCAPE	R	2/26/2007	11513
MELBOURNE	FL	USA	3212544283 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12287N [REDACTED]	12/12/2006	2007 F-150	R	5/29/2007	13812
YORK	ME	USA	2073632483 wheels	Unknown	P235/65R17 BSW A/S	2FMDK49C87B [REDACTED]	1/16/2007	2007 EDGE	L	1/24/2007	14459
ROME	GA	USA	7062354453 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT85H5753 [REDACTED]	3/12/2007	2007 MUSTANG	R	3/31/2007	18353

PRINCE FREDERICK		USA	3018551739 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT85H57 [REDACTED]	4/23/2007	2007 MUSTANG	R	5/4/2007	6632
TEMECULA	CA	USA	9516991302 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT80N075 [REDACTED]	2/16/2007	2007 MUSTANG	R	4/2/2007	6158
LONDON	ON	CAN	5194551800	Unknown	P225/50VR 17	3FAHP07Z37P [REDACTED]	3/22/2007	2007 FUSION	R	9/19/2007	2675
MEDFORD	NJ	USA	6096545166 wheels	Unknown	LT265/70/R17E A/T OWL	1FTSX21P37E [REDACTED]	8/3/2006	2007 F-250 SD	R	5/7/2007	8194
LAS VEGAS	NV	USA	7027312121 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP34N47W [REDACTED]	3/22/2007	2007 FOCUS	R	5/7/2007	8871
BRAINTREE	MA	USA	7818481350 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z27P [REDACTED]	6/16/2007	2007 FUSION	R	7/18/2007	3426
PATTERSON	CA	USA	2098923341 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C97B [REDACTED]	2/7/2007	2007 EDGE	R		8573
AVON	NY	USA	5852262600 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT84N675 [REDACTED]	7/24/2006	2007 MUSTANG	R		2139
GULF BREEZE	FL	USA	8509348366 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12237N [REDACTED]	2/26/2007	2007 F-150	R	5/31/2007	8702
RIDGECREST	CA	USA	7603711331 wheels	Unknown	P255/65R 17 A/S OWL	1FTRW12W57K [REDACTED]	3/22/2007	2007 F-150	R	5/4/2007	7871
LEBANON	TN	USA	6154448221 wheels	Unknown	P225/60TR-16 BSW A-S	2MEFM75V97X [REDACTED]	1/31/2007	2007 GRAND MARF		2/15/2007	21656
CINCINNATI	OH	USA	5133851414 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12297N [REDACTED]	6/12/2007	2007 F-150	R	7/23/2007	9184

STUART	FL	USA	7722870955 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12257N [REDACTED]	12/4/2006	2007 F-150	R	4/5/2007	10513
CLEARWATER	FL	USA	7275353673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C37B [REDACTED]	12/21/2006	2007 EDGE	R	1/10/2007	13778
REDLANDS	CA	USA	9097933211 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H375 [REDACTED]	12/20/2006	2007 MUSTANG	R	2/15/2007	22086
TUCSON	AZ	USA	5202923600 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12297K [REDACTED] 7	12/21/2006	2007 F-150	R	4/2/2007	12490
LONDON	ON	CAN	5194551800	Unknown	P275/55R20 A/T OWL	1FTPX14V27F [REDACTED]	2/23/2007	2007 F-150	R	5/15/2007	16327
CRYSTAL LAKE	IL	USA	8154598200 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39CX7E [REDACTED]	5/30/2007	2007 EDGE	R	8/11/2007	22172

DELRAY BEACH	FL	USA	5612780303 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17577L [REDACTED]	11/28/2006	2007 EXPEDITION	R	12/9/2006	7598
BANNING	CA	USA	9098496221 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17547L [REDACTED]	12/15/2006	2007 EXPEDITION	R	3/9/2007	19504
RANCHO SANTA	CA	USA	9494596800 wheels	Unknown	P225/75R15 BSW	1FMYU02Z17K [REDACTED]	11/14/2006	2007 ESCAPE	L	12/5/2006	28062

KINSTON	NC	USA	2525223673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C17B [REDACTED]	2/5/2007	2007 EDGE	R	4/14/2007	18109
SOMERVILLE	NJ	USA	9087222500 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU74E37U [REDACTED]		3/20/2007	2007 EXPLORER	F	4/4/2007	30400
SOMERVILLE	NJ	USA	9087222500 wheels	Unknown	P275/65R18 A/T OWL	1FTPX14507 [REDACTED]	1/26/2007	2007 F-150	R	2/28/2007	21593
TAMPA	FL	USA	8132463673 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17507L [REDACTED]	12/12/2006	2007 EXPEDITION	L	12/13/2006	17706
INDIO	CA	USA	7607728000 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C87B [REDACTED]	1/23/2007	2007 MKX	R	2/13/2007	25704
CARSON CITY	NV	USA	7758825353 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTRF14W77K [REDACTED]	2/1/2007	2007 F-150	R	7/3/2007	19972
AIEA	HI	USA	8085649210 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU16517L [REDACTED]	12/1/2006	2007 EXPEDITION	F	12/17/2006	19422
WHITEVILLE	NC	USA	9106427121 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12W87N [REDACTED]	3/28/2007	2007 F-150	R	5/24/2007	10491
ORANGE CITY	FL	USA	3867751000 wheels	Unknown	P235/75R 17 A/T BSW TIRES	1FTRF14W67N [REDACTED]	1/4/2007	2007 F-150	F		9795
DALLAS	GA	USA	7704458891 wheels	Unknown	P245/65R 17 GOODYEAR TIRE VE1FMEU63E17U [REDACTED]		6/5/2007	2007 EXPLORER	R		10159
VILLA RICA	GA	USA	7704595132 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT85H375 [REDACTED]	12/18/2006	2007 MUSTANG	R	1/2/2007	17607



PICKENS	SC	USA	8648786364 wheels	Unknown	P235/65R17 BSW A/S	2FMDK39C27B [REDACTED]	1/24/2007	2007 EDGE	R	3/26/2007	24758
ODESSA	TX	USA	4323320421 wheels	Unknown	235/50 ZR 18 TYRE	1ZVHT82H875 [REDACTED]	1/2/2007	2007 MUSTANG	R	2/9/2007	12758
ESTERO	FL	USA	2394983673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C17B [REDACTED]	3/30/2007	2007 EDGE	R	4/16/2007	8628
ORLANDO	FL	USA	4072753200 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C57B [REDACTED]	2/8/2007	2007 EDGE	R	4/1/2007	14288
JOHNSON CITY TN		USA	4232823000 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT82H3753 [REDACTED]	4/10/2007	2007 MUSTANG	R	4/24/2007	6832
STAUNTON	VA	USA	5408514800 wheels	Unknown	P235/65R17 BSW A/S	2FMDK46C17B [REDACTED]	1/11/2007	2007 EDGE	R	4/7/2007	22130
PRESCOTT	AZ	USA	9284453673 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12277K [REDACTED]	2/1/2007	2007 F-150	R	3/31/2007	14346
LEBANON	PA	USA	7179492000 wheels	Unknown	225/70R-19.5" F BSW ALL SEASON	1FDXF46P57E [REDACTED]	9/26/2006	2007 F-450 SD	R	1/2/2007	28115

SALINE	MI	USA	7344295478 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82HX75 [REDACTED]	3/6/2007	2007 MUSTANG	R	10/1/2007	7456
TAMPA	FL	USA	8132463673 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N175 [REDACTED]	2/8/2007	2007 MUSTANG	R	3/26/2007	16465
MOJAVE	CA	USA	6618242477 wheels	Unknown	P235/65R17 BSW A/S	2FMDK48C77B [REDACTED]	12/21/2006	2007 EDGE	R	4/24/2007	15097
KAHULUI	HI	USA	8088773673 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR10D17P [REDACTED]		1/9/2007	2007 RANGER	R	4/7/2007	4718
JENKINTOWN	PA	USA	2152244550 wheels	Unknown	P245/60R18 A/S BSW	2LMDU88C07B [REDACTED]	1/2/2007	2007 MKX	R	1/12/2007	22321
ROSEVILLE	MN	USA	6516368200 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H875 [REDACTED]	4/13/2007	2007 MUSTANG	R	8/22/2007	6678
TOMS RIVER	NJ	USA	7323492240 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C17B [REDACTED]	1/15/2007	2007 EDGE	R	3/12/2007	17391
BRACEBRIDGE	ON	CAN	7056458731	Unknown	195/60R 15T BSW	1FAFP36N57W [REDACTED]	11/9/2006	2007 FOCUS	F	11/26/2006	13786
VILLA RICA	GA	USA	7704595132 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT85H375 [REDACTED]	12/18/2006	2007 MUSTANG	R	1/2/2007	17846
STAFFORD	TX	USA	2812403673 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W07X [REDACTED]	1/31/2007	2007 CROWN VIC	F	3/12/2007	17358
KEENE	NH	USA	6033524330 wheels	Unknown	31X10.5R X 15C STL OWL A-T	1FTZR45EX7P [REDACTED]	5/15/2006	2007 RANGER	R	12/14/2006	19641
REDLANDS	CA	USA	9097933211 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H375 [REDACTED]	12/20/2006	2007 MUSTANG	R	2/15/2007	23334
MIDLAND	MI	USA	9896310040 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C77B [REDACTED]	12/20/2006	2007 EDGE	R		

TAMPA	FL	USA	8132463673 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17507L [REDACTED]	12/12/2006	2007 EXPEDITIONL	12/13/2006	19154
YORK	PA	USA	7177413876 wheels	Unknown	P225/55R18 A/S BSW	1MEHM42197G [REDACTED]	1/26/2007	2007 MONTEGO R	5/23/2007	12965
CORPUS CHRISTX		USA	3612653673 wheels	Unknown	P265/60R18 A/S OWL	1FTRW12W77K [REDACTED]	3/16/2007	2007 F-150 R	4/27/2007	26736
SANFORD	FL	USA	4073286000 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H575 [REDACTED]	2/13/2007	2007 MUSTANG R	7/23/2007	5696
CHIEFLAND	FL	USA	3524934297 wheels	Unknown	P235/55R 17 A/S BSW	2FAHP71W87X [REDACTED]	1/16/2007	2007 CROWN VIC F	2/9/2007	21401
BANNING	CA	USA	9098496221 wheels	Unknown	P225/60TR-16 BSW A-S	2MEFM75V47X [REDACTED]	3/7/2007	2007 GRAND MARR	7/20/2007	4388
GULF BREEZE	FL	USA	8509348366 wheels	Unknown	P255/70R18 A/S OWL	1FMFK17537L [REDACTED]	2/1/2007	2007 EXPEDITIONR	3/14/2007	19016
OZARK	AL	USA	3347742551 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39C07B [REDACTED]	1/26/2007	2007 EDGE R	3/7/2007	15651
NORTH CANTOIOH		USA	3304979100 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H875 [REDACTED]	4/5/2007	2007 MUSTANG R		15787
ST PETERSBUR FL		USA	7273233400 wheels	Unknown	P245/60R18 A/S BSW	2FMDK38CX7B [REDACTED]	2/8/2007	2007 EDGE R	4/19/2007	13374

MIDDLE RIVER	MD	USA	4437775000 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12267N [REDACTED]	12/7/2006	2007 F-150	R	2/7/2007	10858
WESTLAKE	OH	USA	4408353700 wheels	Unknown	P245/65R 17 GOODRICH TIRE VE4M2EU47E27U [REDACTED]		2/22/2007	2007 MOUNTAINE R		9/30/2007	21918
SURREY	BC	CAN	6045316100	Unknown	P225/60R 17 A/S BSW	1LNHM82W77Y [REDACTED]	11/15/2006	2007 TOWN CAR	F	12/12/2006	16719
BETHLEHEM	PA	USA	6108678641 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H175 [REDACTED]	3/7/2007	2007 MUSTANG	R	4/2/2007	14787
FRESNO	CA	USA	5594358400 wheels	Unknown	P235/65R18 / MICHELIN TIRE VEN 1FMEU65E97 [REDACTED]		1/2/2007	2007 EXPLORER	R	2/18/2007	10165
CHESHIRE	CT	USA	2032722772 wheels	Unknown	P225/50VR 17	3FAHP02177R [REDACTED]	1/4/2007	2007 FUSION	R	2/16/2007	18202
MOJAVE	CA	USA	6618242477 wheels	Unknown	P245/65R 17 A/S OWL	1FMEU63E07U [REDACTED]	2/9/2007	2007 EXPLORER	F	6/15/2007	12101
BOSSIER CITY	LA	USA	3186867300 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT80N77 [REDACTED]	3/8/2007	2007 MUSTANG	R	4/17/2007	16744
STONEHAM	MA	USA	7814380490 wheels	Unknown	P255/65R 17 A/S OWL	1FTRF12587N [REDACTED]	5/25/2007	2007 F-150	R	1/4/2008	3574

EXETER	ON	CAN	5192351380	Unknown	P215/65R16 96T A/S	1ZVFT84N175 [REDACTED]	5/14/2007	2007 MUSTANG	F	5/29/2007	4331
BRADENTON	FL	USA	9417473711 wheels	Unknown	P255/70R18 A/S OWL	1FMFU175X7L [REDACTED]	12/19/2006	2007 EXPEDITION	R	1/22/2007	13932
TAMPA	FL	USA	8132463673 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17587L [REDACTED]	3/29/2007	2007 EXPEDITION	R	6/20/2007	18472
TAMPA	FL	USA	8132463673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C77B [REDACTED]	2/13/2007	2007 EDGE	F	2/28/2007	18282
DELRAY BEACH	FL	USA	5614541800 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C47B [REDACTED]	3/19/2007	2007 MKX	R	4/13/2007	13108
BURLINGTON	ON	CAN	9056326252	Unknown	P225/50VR 17	3LNHM26T87R6 [REDACTED]	10/28/2006	2007 MKZ	R	5/30/2007	25609
BATTLE CREEK	MI	USA	2699657771 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT85H175 [REDACTED]	4/19/2007	2007 MUSTANG	R	5/4/2007	11367
OCONOMOWOC	WI	USA	2625675574 wheels	Unknown	P225/50VR 17	3FAHP08Z97R [REDACTED]	6/1/2007	2007 FUSION	R	7/27/2007	10457
ORLANDO	FL	USA	4072404020 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C27B [REDACTED]	4/10/2007	2007 MKX	R	9/28/2007	12790
HOLLYWOOD	FL	USA	3059206010 wheels	Unknown	P225/60TR-16 BSW A-S	2MEFM75V97X [REDACTED]	1/3/2007	2007 GRAND MARF		1/19/2007	14157

BRADENTON	FL	USA	9417473711 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12267K [REDACTED]	3/22/2007	2007 F-150	R	4/17/2007	13640
SCOTTSDALE	AZ	USA	4809913333 wheels	Unknown	235/50 ZR 18 TYRE	1ZVFT85H975 [REDACTED]	4/17/2007	2007 MUSTANG	R	6/3/2007	7128
LAKE WALES	FL	USA	8636767944 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12237N [REDACTED]	1/3/2007	2007 F-150	R	6/5/2007	25025
ELGIN	IL	USA	8472898900 wheels	Unknown	P275/55R20" BSW A/S	5LMFU28507L [REDACTED]	3/2/2007	2007 NAVIGATOR	R	3/19/2007	19432
SEMINOLE	FL	USA	7273273700 wheels	Unknown	P225/60TR-16 WSW	2MEFM74VX7X [REDACTED]	12/19/2006	2007 GRAND MARR			7359
NETCONG	NJ	USA	9733473000 wheels	Unknown	P245/60R18 A/S BSW	2FMDK48C17B [REDACTED]	4/24/2007	2007 EDGE	R	7/30/2007	5820
STATESVILLE	NC	USA	7048733673 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR10D67P [REDACTED]		12/5/2006	2007 RANGER	R	2/19/2007	9723
HAMPTON	VA	USA	7578380222 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR14U77P [REDACTED]		12/6/2006	2007 RANGER	R	1/6/2007	15425
PASCAGOULA	MS	USA	2287622641 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU17537L [REDACTED]	2/26/2007	2007 EXPEDITION	R	4/19/2007	9929
SARATOGA SP	NY	USA	5185847272 wheels	Unknown	P275/55R20 A/T OWL	1FTPW14537F [REDACTED]	9/20/2006	2007 F-150	R	5/18/2007	9961
VANIER	QC	CAN	4186834451	Unknown	205/50VR-16 BSW	1FAFP37N87W [REDACTED]	6/4/2007	2007 FOCUS	R	8/31/2007	4324
CHURCH POINT	NS	CAN	9027690706	Unknown	LT245/75/R17E A/T BSW	1FTWX33P47E [REDACTED]	8/14/2006	2007 F-350 SD	R	9/5/2006	29076
SAN ANGELO	TX	USA	3259494621 wheels	Unknown	P255/65R 17 A/S OWL	1FTRX12W77F [REDACTED]	1/4/2007	2007 F-150	R	3/2/2007	14959

DADE CITY	FL	USA	3525676711 wheels	Unknown	P225/60TR-16 WSW	2MEFM75V17X [REDACTED]	12/7/2006	2007 GRAND MARR		6/2/2007	8584
CLEARWATER	FL	USA	7275353673 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C37B [REDACTED]	12/21/2006	2007 EDGE	R	1/10/2007	15230
PEORIA	AZ	USA	6239778888 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H875 [REDACTED]	3/6/2007	2007 MUSTANG	R	4/23/2007	13502
GLOBE	AZ	USA	9284254491 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39C07B [REDACTED]	1/31/2007	2007 EDGE	R	3/16/2007	11772
MIDDLETON	NS	CAN	9028255555	Unknown	P245/60R18 A/S BSW	2FMDK49C37B [REDACTED]	12/19/2006	2007 EDGE	R	1/25/2007	25186
HAMPTON	VA	USA	7578380222 wheels	Unknown	P255/65R 17 A/S OWL	1FTRF12237K [REDACTED]	2/1/2007	2007 F-150	R	5/16/2007	22280
YOUNGSTOWN	OH	USA	3307268181 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C87B [REDACTED]	5/29/2007	2007 EDGE	R	3/21/2008	6332
PALM BAY	FL	USA	3217229000 wheels	Unknown	P235/55ZR17 99W A/S	1ZVFT82H375 [REDACTED]	1/4/2007	2007 MUSTANG	R	7/21/2007	11266
WEST PALM BE	FL	USA	5616896550 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTYR10D37P [REDACTED]	2/1/2007	2007 RANGER	R	4/17/2007	17372
PANAMA CITY	FL	USA	8507840400 wheels	Unknown	P255/70R17 A/T OWL	1FTPX14V97 [REDACTED]	2/20/2007	2007 F-150	R	4/20/2007	2
YORK	PA	USA	7177413876 wheels	Unknown	P245/60R18 A/S BSW	2LMDU88C77B [REDACTED]	5/15/2007	2007 MKX	R	6/29/2007	22281

MARGATE	FL	USA	3059782277 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C07B[REDACTED]	1/23/2007	2007 MKX	R	7/12/2007	11345
VALENCIA	CA	USA	6612556600 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S	1FTYR14U67P[REDACTED]	12/4/2006	2007 RANGER	R	7/9/2007	4880
HUNTINGTON	WV	USA	3045292200 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT84N675[REDACTED]	2/2/2007	2007 MUSTANG	R	2/17/2007	12127
BELLEVILLE	MI	USA	7346979161 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H475[REDACTED]	3/7/2007	2007 MUSTANG	R	3/15/2007	11616
PORT LAVACA	TX	USA	3615521155 wheels	Unknown	P255/70R18 A/S OWL	1FMFU17587L[REDACTED]	1/25/2007	2007 EXPEDITION	R	5/19/2007	27271
SEMINOLE	FL	USA	7273273700 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68C27B[REDACTED]	1/18/2007	2007 MKX	R	2/14/2007	15795
BANNING	CA	USA	9098496221 wheels	Unknown	P235/70R-16 GOODYEAR TIRE VE	1FMFU03Z37K[REDACTED]	2/7/2007	2007 EXPLORER	R	4/3/2007	18508
BANNING	CA	USA	9098496221 wheels	Unknown	P225/50VR 17	3FAHP07Z57P[REDACTED]	2/13/2007	2007 FUSION	R	4/19/2007	13827
RACINE	WI	USA	2628865200 wheels	Unknown	P265/70R 17 A/T OWL	1FMFU18587L[REDACTED]	2/13/2007	2007 EXPEDITION	F	2/28/2007	13913
ARDMORE	OK	USA	5802263300 wheels	Unknown	P235/70R-16T BSW A-S	1FMFU03Z37K[REDACTED]	12/5/2006	2007 ESCAPE	F	12/20/2006	22901
BOGART	GA	USA	7063541130 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12277N[REDACTED]	1/4/2007	2007 F-150	R	3/23/2007	12835
GLENDALE	CA	USA	8182471903 wheels	Unknown	P245/60R18 A/S BSW	2LMDU68CX7B[REDACTED]	2/13/2007	2007 MKX	R	6/9/2007	14644
LAS VEGAS	NV	USA	7023955100 wheels	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12297K[REDACTED]	1/4/2007	2007 F-150	R	7/14/2007	7241



LAS VEGAS	NV	USA	7023955100 wheels	Unknown	P265/60R18 A/S OWL	1FTRX12547K [REDACTED]	1/24/2007	2007 F-150	R	5/30/2007	11989
LAS VEGAS	NV	USA	7023955100 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT82H375 [REDACTED]	2/1/2007	2007 MUSTANG	R	5/3/2007	16015
TAMPA	FL	USA	8132463673 wheels	Unknown	LT275/65R 18C A-T OWL	1FTPW14V77K [REDACTED]	3/27/2007	2007 F-150	R	4/23/2007	27059
PICKENS	SC	USA	8648786364 wheels	Unknown	P235/65R17 BSW A/S	2FMDK36C67B [REDACTED]	1/16/2007	2007 EDGE	R	3/31/2007	24002
PHOENIXVILLE PA		USA	6109335811 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z47R [REDACTED]	5/21/2007	2007 FUSION	R	11/26/2007	5192
FORT LAUDERDALE FL		USA	9545643221 wheels	Unknown	P235/65R17 BSW A/S	2FMDK38C97B [REDACTED]	12/21/2006	2007 EDGE	R	1/11/2007	24605
SAINT AUGUSTINE FL		USA	9048241641 wheels	Unknown	P235/55R 17 A/S BSW	2FAFP71W77X [REDACTED]	1/31/2007	2007 CROWN VIC	F	2/27/2007	8458
INDIO	CA	USA	7607728000 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07Z57R [REDACTED]	1/18/2007	2007 FUSION	R	2/16/2007	3110
SEMINOLE	FL	USA	7273273700 wheels	Unknown	P225/50VR 17	3LNHM26T07R [REDACTED]	2/8/2007	2007 MKZ	R	4/12/2007	4851
PENSACOLA	FL	USA	8504769050 wheels	Unknown	P255/65R 17 A/S OWL	1FTRF12287K [REDACTED]	12/4/2006	2007 F-150	R	1/30/2007	16521
HARDEEVILLE	SC	USA	8432880100 wheels	Unknown	P235/65R17 BSW A/S	2FMDK46CX7B [REDACTED]	2/6/2007	2007 EDGE	R	4/12/2007	15786
WINTER HAVEN	FL	USA	8632943571 wheels	Unknown	P245/60R18 A/S BSW	2FMDK39C17B [REDACTED]	1/24/2007	2007 EDGE	R	3/2/2007	15474
DAYTONA BEACH FL		USA	3862536771 wheels	Unknown	P255/65R 17 A/S OWL	1FTRF12297N [REDACTED]	1/5/2007	2007 F-150	R	3/25/2007	10525
TAMPA	FL	USA	8132463673 wheels	Unknown	LT245/70R17D BSW A/T	1FTVX12527N [REDACTED]	1/4/2007	2007 F-150	R	3/29/2007	15378
RENO	NV	USA	7753298800 wheels	Unknown	P235/55ZR17 99W A/S	1ZVHT80N27 [REDACTED]	3/9/2007	2007 MUSTANG	R	4/28/2007	10796

TOPEKA	KS	USA	7852359211 wheels	Unknown	P205/60R16 ALL SEASON	3FAHP07167R [REDACTED]	4/12/2007	2007 FUSION	F	4/24/2007	41869
BOWLING GREEN	OH	USA	4193522553 wheels	Unknown	P225/60TR-16 BSW A-S	2MEFM75V37X [REDACTED]	1/23/2007	2007 GRAND MARF		2/7/2007	18213
HAYESVILLE	NC	USA	8283896325 wheels	Unknown	LT245/75/R17E A/T BSW	1FTVF125X7N [REDACTED]	3/27/2007	2007 F-150	R	4/27/2007	12305
BIRMINGHAM	AL	USA	2059785300 wheels	Unknown	P225/60TR-16 WSW	2MEHM75V47X [REDACTED]	1/22/2007	2007 GRAND MARR		2/24/2007	7825
MONTEBELLO	CA	USA	3238386920 wheels	Unknown	P225/70R15 SL ST BELT OWL A-S 1FTYR10U37P [REDACTED]		12/6/2006	2007 RANGER	F	12/21/2006	16649
VIRGINIA BEACH	VA	USA	7574862717 wheels	Unknown	P245/60R18 A/S BSW	2FMDK49C47B [REDACTED]	12/19/2006	2007 EDGE	R	1/5/2007	15714
LAS VEGAS	NV	USA	7027312121 wheels	Unknown	P195/60R 15T BSW (87T)	1FAFP34N47W [REDACTED]	3/22/2007	2007 FOCUS	R	5/7/2007	10604
PLYMOUTH	MI	USA	7344532424 wheels	Unknown	P245/60R18 A/S BSW H-RATED	2LMDU68C27B [REDACTED]	7/20/2007	2007 MKX	R	7/26/2007	6673
DELANE	WI	USA	2627285544	Unknown	P235/70R-16 OWL A-S	1FMYU93177K [REDACTED]	12/18/2006	2007 ESCAPE	R	4/17/2007	14422
BEREA	OH	USA	4402342770	Unknown	P245/60R18 A/S BSW	2FMDK49C67B [REDACTED]	12/19/2006	2007 EDGE	R	12/22/2006	14139

JACKSONVILLE	NC	USA	9104551911	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12287N [REDACTED]	2/1/2007	2007 F-150	R	4/9/2007	17069
POQUOSON	VA	USA	7578686777	Unknown	P245/60R18 A/S BSW	2FMDK49C87B [REDACTED]	2/9/2007	2007 EDGE	R	7/20/2007	7557
TORONTO	ON	CAN	4162313361	Unknown	P275/55R20" BSW A/S	1FMFU18557L [REDACTED]	4/2/2007	2007 EXPEDITION	R	4/12/2007	14190
LANCASTER	SC	USA	8032864414	Unknown	P235/65R17 BSW A/S	2FMDK36C57B [REDACTED]	2/19/2007	2007 EDGE	R	5/25/2007	14466
PAWLEYS ISLAND	SC	USA	8432373673	Unknown	P255/70R18 A/S OWL	1FMFU17597L [REDACTED]	3/27/2007	2007 EXPEDITION	R	4/23/2007	16351
MCKINNEY	TX	USA	2145445000	Unknown	P235/70R 17 A/S BSW TIRES	1FTRF12267K [REDACTED]	1/17/2007	2007 F-150	R	6/2/2007	16608
FONTANA	CA	USA	9098224401	Unknown	P235/65R17 BSW A/S	2FMDK36C77B [REDACTED]	12/22/2006	2007 EDGE	R	3/29/2007	31416
BUFORD	GA	USA	7709324060	Unknown	P235/70R 17 A/S BSW TIRES	1FTPF12V17K [REDACTED]	2/13/2007	2007 F-150	L	2/13/2007	4604
BUFORD	GA	USA	7709324060	Unknown	P235/70R 17 A/S BSW TIRES	1FTPF12V37K [REDACTED]	2/13/2007	2007 F-150	L	2/13/2007	5900
BUFORD	GA	USA	7709324060	Unknown	P235/70R 17 A/S BSW TIRES	1FTPF12V57K [REDACTED]	2/12/2007	2007 F-150	L	2/12/2007	8346
BUFORD	GA	USA	7709324060	Unknown	P235/70R 17 A/S BSW TIRES	1FTPF12V77K [REDACTED]	2/14/2007	2007 F-150	L	2/14/2007	19555
CHARLOTTE	MI	USA	5175438292	Unknown	P245/60R18 A/S BSW	2LMDU88CX7B [REDACTED]	2/8/2007	2007 MKX	L	2/9/2007	46937
LANCASTER	PA	USA	7172955000	Unknown	P225/50VR 17	3MEHM02157R [REDACTED]	10/13/2006	2007 MILAN	R	9/20/2007	5505

Issue Description	Additional Repairs	Customer Comments	Technician Comments	CQIS Recommendations
Leaks		CUSTOMER STATES THE LEFT FRONT TIRE LEAKING, CHECK AND ADVISE	1 FOUND TIRE VALVE LEAKING, DISMOUNT TIRE AND REPLACE TIRE VALVE ASSY BALANCETIRE	
Leaks		LEFT FRONT VALVE STEEM LEAKS	DISMOUNT AND REPLACED LEFT FRONT VALVE STEM LEAKING AT CORE RETORQUE CORE RECHECKAND REINSTALL	
Leaks		LFT FRONT TIRE LOW		
Leaks		LEFT FRONT TIRE LEAKING AT VALVE STEM	1 REPLACE VALUE STEM	
Ripped		CUSTOMER STATES RIGHT FRONT TIRE FLAT	RIGHT FRONT TIRE FLAT, VALVE STEM RIPPED, REPLACED TIRE VALVE	
Leaks		B95 RT REAR TIRES KEEPS GOING LOW	COMPLETED FOUND THE VALVE STEM LEAKING, REPLACED VALVE STEM TIRE HOLDING PRESURE	
Leaks		CLIENT STATES LEFT REAR TIRE HAS A SLOW LEAK	7 REPLACED VALVE STEM ASY NOT SEALING TO RIM. REBALANCED. 6C3Z1700A CODE 91. NO LABOR OPER. .7 M T	
Leaks		L F TIRE LOW ON PRESSURE	3 WF 40 REMOVE LEFT FRONT WHEEL TO REPLACE VALVE STEM. NESS TO BALANCE AFTER REPAIR.	
Leaks		CUSTOMER STATES RIGHT REAR TIRE IS GOING FLAT PLEASE CHECK AND ADVISE	20 TORN VALVE STEM VERIFIED CONCERN, SPRAYED SOAPY WATER ON TIRE, FOUND VALVESTEM LEAKING, DISMOUNTED TIRE, REPLACED VALVE STEM, REMOUNTED AND REBALANCED TIRE, RETESTED OK.	
Leaks		VALVE STEM IS LEAKING	VERIFIED CONCERN.LH FRONT VALVE STEM IS LEAKING.REPLACED VALVE STEM. INSPECTED.OK.	

Torn	REPAIR FLAT TIRE	CHECK LEFT REAR TIRE GOING FLAT ,CHECK AND REPLACE VALVE STEM STEM TORN WHEN INSTALLED
Leaks		LEAKING VALVE STEM
Leaks	CUSTOMER STATES LEFT REAR TIRE LEAKING FROM VALVE STEM	REPALCE VALVE STEM REPLACED VALVE STEM TO CORRECT
Leaks	CUSTOMER STATES THAT RT RREAR TIRE KEEPS GOING LOW PLEASE CHECK AND ADVISE	SOAPED DOWN TIRE AND VERIFIED CONCERN VALVE STE M LEAKING R AND R TIRE AND REPLACED VALVE STEM CHECKED OUT OK
Leaks	DRIVERS SIDE FRONT TIRE LOW, ADVISE	RIGHT FRONT TIRE LOW, CHECK FOR LEAKS, REPLACED LEAKING VALVE STEM
Leaks	DURING PDI ALL VALVE STEMS LEAKING	7 30 1700 REMOVED 4 WHEELS FROM VEHICLE DISMOUNTED TIRES REMOVED AND REPLACED 4 VALVE STEMS FROM WHEELS MOUNTED AND BALANCED 4 TIRES INSTALLED WHEELS ON VEHICLE
Leaks	PASSENGER REAR TIRE FLAT.	CHECK AND REPLACE LEAKING VALVE STEM.
Leaks	B65 RF TIRE GOES FLAT	28 CHECK RGT FRT TIRE AND FOUND VALAVE LEAKING REPLACE VALVE STEM
Leaks	LEFT FRONT TIRE WILL NOT HOLD AIR	R&I LEFT FRONT TIRE AND CHECK FOR LEAKS.FOUND VALVE STEM WAS NOT INSTALLED
Leaks	BOTH REAR TIRES GO FLAT	PROPERLY.BREAKDOWN TIRE TO REPLACE VALVE STEM. VALVE STEMS LEAKING REPLACE STEMS RECHECK FOR LEAKS OK
Missing Extension	MISSING VALVE STEM EXTENDER DRIVERS FRONT TIRE	3 7153 FROUNT MISSING FROUNT LEFT VALVE STEM EXTENDER GOT A NEW ONE FROM PARTS
Leaks		REPLACED RIGHT FRONT TIRE VALVE STEM (LEAKING)
Leaks	RIGHT FRONT TIRE KEEPS LOOSING AIR	REMOVE TIRE TEST FOR LEAK STEM LEAKING AT RIM REPLACE STEM
Replace	REPAIR VALVE STEM PASS FRONT	REPLACED RIGHT FRONT VALVE STEM ALL OK

Leaks		LEFT AND RIGHT FRONT TIRES LOOSING AIR	6 0.5 REPLACED VALVE STEM IN LEFT FRONT, REPLACED VALVE STEM CORE IN RIGHT FRONT CC: 42 VERIFIED CONCERN. FOUND THE VALVE STEMS LEAKING ON BOTH REAR TIRES.
Leaks		CK TRUCK BOTH REAR TIRES FLAT ON LOT CODE TC8	REMOVED AND REPLACED VALVE STEMS
Leaks		CHECK FOR SLOW LEAK FROM L R VALVE STEM	R&R LEFT REAR TIRE AND REPLACE VALVE STEM ASSY. CHECK OVER, FOUND VALVE STEM LEAKING AIR AROUND RIM. REPLACE VALVE STEM, INSTALLED AND BALANCE TIRE. MT DUE TO NO LABOR.
Leaks		CHECK FOR LOW TIRE LIGHT ON SUSPECT LR TIRE HAS LEAK	
			CUSTOMER WAS JUST LEAVING TOWN TO GO ON VACATION WHEN HE HAD A FLAT TIRE CAUSED BY A LEAKING VALVE STEM. CUSTOMER HAD TIRE REPLACED LOCALLY IN ORDER TO LEAVE ON VACATION.
Leaks	Replace tire	CUSTOMER REQ REFUND FOR TIRE FAILURE BLOWOUT DUE TO VALVE STEM LEAK WHILE DRIVING CAUSED TIRE TO RUN FLAT AND DAMAGED WHILE ON VACATION	REIMBURSE CUSTOMER FULL AMOUNT DUE TO 2007 VEHICLE JUST PURCHASED HERE ON 8 28 06 (1 DAY BEFORE FLAT). CHECKED FOR LEAKS AND
Leaks		CUSTOMER COMPLAINING ABOUT TIRE(S) GOINT FLAT OR LOOSING AIR CHECK	FOUND VALVE STEM LEAKING ON LEFT REAR WHEEL . REPLACED VALVE STEM .3 AT
Leaks		LEFT REAR TIRE LOOSES AIR	INSPECTED AND VERFIED LEFT REAR TIRE IS L OOSING AIR INSPECTED AND FOUND VALVE STEM LEAKING REPLACED VALVE STEM . RECHECK OK DIAGNOSIS FOR LOW TIRE LIGHT ON. CHECK OASIS 310 235 786. PIDS TEST. PINPOINT TEST. CLEAR CODES AND RELEARN ALL TIRE PRESSURE SENSORS. R AND R TIRE LEAK TEST,AND VALVE STEM REPLACEMENT. CHECK AND FOUND VALVE STEM LEAKING, R&I TIRE REPLACE VALVE STEM ORIGINAL LOOKS DAMAGED ON INSTALL, RECK OK.
TPMS light		TIRE MONITOR LIGHT WILL NOT SHUT OFF	
Leaks		CK RIGHT REAR TIRE LOW	
Leaks		REPAIR PASS. SIDE FRONT TIRE	

Leaks	CUSTOMER STATES PASS FRONT TIRE IS LEAKING AIR	FOUND LEAKING VALVE STEM RENEW VALVE STEM. TEST AND REPLACED R F TIRE
Leaks	L F TIRE GOING FLAT CUS STATES THE SPARE TIRE WILL NOT HOLD AIR	VALVE STEM, LEAKING AIR
Leaks		1 REPLACE VALVE STEM DAMAGED VALVE STEM
Damaged	VALVE STEM DAMAGED	M TIME, R&I TIRE, REPLACE VALVE STEM
Leaks	FRONT RIGHT TIRE FLAT	9 CK & REMOVE WHEEL DUNK TANK & FOUND VALVE STEM LEAKING AROUND STEM SEAL ORDER STEM REPLACE VALVE STEM RETEST FOR LEAK OK VERIFIED CONCERN. REPLACED
Leaks	RIGHT FRONT VALVE STEM LEAKING	VALVE STEM
Not Aligned	VALVE STEM NOT ALIGNED ON REAR DUAL	R & I LT REAR DUAL WHEEL, ALIGN VALVE STEM WITH INNER WHEEL.
Leaks	STATES RIGHT REAR WHEEL HAS A SLOW LEAK	DIAG SLOW LEAK SOAKED TIRE W SOAPY WATER FOUND LEAK VALVE STEM. RR
TPMS Sensor	CUSTOMER STATES LEFT FRONT TIRE LOSES AIR	SENSOR PERFORM DIAG REPLACE LOW AIR SENSOR REMOVED TIRE AND WHEEL ASSY DISMOUNT TIRE REPLACE
Leaks	RIGHT REAR VALVE STEM LEAKING AIR	VALVE STEM REMOUNT TIRE BALANCE TIRE
Leaks	CUSTOMER STATES LEFT FRONT TIRE LOOSES AIR	VALVE STEM LEAKING FOUND TIRE VALVE LEAKING DISMOUNT TIRE TO REPLACE VALVE REBALANCE
Leaks	LEFT REAR TIRE FLAT	INSPECTED NAD HAS BAD VALVE STEM, NOT SEALING. REMOVED TIRE FROM RIM AND REPLACE STEM, BALANCE AND REINSTALL ON TRUCK
Leaks	RIGHT FRONT TIRE WILL NOT HOLD AIR	CHECK TIRE PRESSURE LOW REMOVE FROM VEHICLE TANK CHECK FOUND LEAK AT VALVE CORE TIGHTEN VALVE CORE LEAK STOPPED AT THIS TIME CHECKED RIGHT REAR TIRE
Leaks	RIGHT REAR TIRE WILL NOT HOLD AIR	LOW FOUND VALVE STEM LEAKING AT WHEEL REMOVED TIRE AND REPLACED VALVE STEM

		59 VALVE STEM REMOVED WHEEL FROM TIRE INSTALLED IN TANK CHECKED FOR LEAKS FOUND VALVE STEM LEAKING REPLACED VALVE STEM CHECKED FOR LEAK OK INSTALLED WHEEL ON VEHICLE
Leaks	FRONT RIGHT TIRE GOES FLAT	WPI INSPECT, FOUND FAULTY VALVE STEM. R&R TIRE AND REPLACED VALVE STEM.
Leaks	INSTOCK P/S FRONT TIRE HAS SLOW LEAK.	BALANCED TIRE AND RECHCEK OK. REPLACED LEAKING VALVE STEM
Leaks	RF FLAT REPAIR	VERIFIED CONCERN FOUND TO HAVE A BAD VALVE STEM REPLACED VALVE STEM OK AT THIS TIME
Leaks	CUSTOMER STATES:THAT THE LEFT REAR TIRE HAS A SLOW LEAK	2306 VALVE STEMS WERE LEAKING REPLACED BOTH VALVE STEMS
Leaks	C S THE FRONT 2 TIRES KEEP LOSSING AIR FROM 60 TO 35 3 TIMES SO FAR	CONFIRM CONCERN, PERFORM LEAK TEST AND CONFIRM LEAK AT VALVE STEM. NESS TO BREAK DOWN TIRE AND REPLACE VALVE STEM. MOUNT AND BALANCE TIRE. OK AT THIS TIME
Leaks	CUSTOMER STATES RIGHT FRONT TIRE LEAKING AIR FROM VALVE STEM	CHECK & REPLACED VALVE STEM.
Leaks	LEFT REAR TIRE HAS A SLOW LEAK	CODE D8 MILEAGE 1102 CHECKED LEFT REAR TIRE FOR LEAKS FOUND VALVE STEM LEAKING REPLACED VAVLE STEM BECAUSE OF SEA;L FAILURE
Leaks	THE DRIVER SIDE REAR TIRE HAS SLOW LEAK CK FOR NAIL FOUND NONE	REMPLOCER VALVE DE PNEU ARR DRT
Replace	PNEU A PLAT REMPLACER	INFLATED TIRE TO 60 PSI. SPRAYED SOAP SOLUTION ON TREAD, BEAD, AND VALVE STEM. FOUND AIR ESCAPING FROM AROUND VALVE STEM.
Leaks	CUSTOMER STATES RIGHT FRONT TIRE HAS A SLOW AIR LEAK. PLEASE CHECK AND ADVISE.	BROKE TIRE LOOSE. REPLACED THE VALVE STEM. RETEST OKAY.
Leaks	FRONT RIGHT TIRE LOW ON AIR	FOUND VALVE STEM LEAKING TIGHTENED VALVE STEM



		VERIFIED CONCERN INSPECTED AND FOUND THE VALVE STEM LEAKING REMOVED AND REPLACED THE RIGHT FORNT TIRE VALVE STEM AND CHECKED AND ADJUSTED AIR PRESSURE IN ALL FOUR TIRES AND RESET THE LOW TIRE LIGHT AND RECHECKED FOR REPAIR
Leaks	CHECK LOW TIRE LIGHT ON CUSTOMER HAS TO ADD AIR TO RF TIRE	FAILED VALVE STEM AIRED UP TIRE,DIPPED IN WATER TANK TO LOCATE LEAK FOUND FAULTY VALVE STEM,REPLACED AND RECHECKED OK
Leaks	LEFT FRONT TIRE FLAT	9327 VARIFY PASS SIDE INNER DUAL VALVE CORE CAME APART.NEEDS NEW CORE AND STEM.REMOVE REAR WHEEL S ON RT SIDE,INSTALL NEW VALVE STEM AND REIN STALL WHEELS.
Came apart	CHK P S INNER DUAL WHEEL VALVE STEM CAME OUT WHEN CHKING TIRE PRESSURE	TECH VERIFY CUSTOMER CONCERN, FOUND ONLY LEFT REAR TIRE LEAKING AIR THRU VALVE STEM. REMOVED TIRE AND REPLACED VALVE STEM, ADJUSTED ALL TIRES PSI TO 60PSI FRONT AND 75PSI REAR,,,CUSTOMER REQUEST CHECKED TIRE FOR POSSIBLE LEAKAS FOUND VALVE STEM TO BE CAUSE OF LEAKS SUPPLIED AND INSTALLED NEW VALVE STEM
Leaks	CUST STATES AIR IS LEAKING FROM ALL TIRES, LEFT REAR TIRE LEAKS MOST	101 CHECK TIRE FOR LEAKS CHECK AND BREAKDOWN TIRE REPLACED LEAKING VALVE STEM AND REBALANCED TIRE OK
Leaks	** WHEELS/TIRES ** ..... CHECK L/F TIRE GOING FLAT	7337 LT FRONT TIRE LEAKS WARR....3069 WATER TESTED LT FRONT TIRE FOUND VALVE STEM LEAKING DISMOUNTED TIRE AND REPLACED VALVE STEM BALANCED WHEEL AND RETESTED TIRE FOR LEAKS NO LEAKS FOUND AT THIS TIME
Leaks	LEFT FRONT TIRE	
Leaks	LT FT TIRE LOOSE AIR	

Leaks	OWNER REPORTS TIRE WARNING LAMP WONT SHUT OFF CCA40	NGS TESTS,DCL TEST,REPLACE LEAKING LEFT FRONT TIRE VALVE STEM,B2872
Leaks	RIGHT FRONT TIRE GOES FLAT	570 REMOVED RIGHT FRONT WHEEL AND FOUND THAT VALVE STEM WAS LEAKING REPLACED VALVE STEM AND CHECKE D FOR LEAKS NONE FOUND.
Leaks	CHK AND ADV CUST STATES LOW TIRE PRESSUR LIGHT IS ON. PASS REAR TIRE IS AT 20PSI.	1700 LOOSE INSPECT TIRE FOR LEAKS. VALVE STEM CORE LEAKING. REPAIRED VALVE STEM. RETEST OK.
Dry rotted	ALL 4 TIRES LEAKING AT VALVE STEMS AND STEMS ARE TO SHORT	VERIFIED CONCERN FOUND ALL 4 VALVE STEMS DRY ROTTED AT BASE OF STEM REPLACE WITH HIGH PRESSURE VALVE STEMS AND VERIFIED REPAIR AT THIS TIME Q.C. BY GARRETT
Leaks	CUSTOMER STATES:ALL TIRES PRESSURE STAYING AT 54,55,57, RIGHT FRT. AT 44 PSI	VERIFIED CONCERN RF TIRE LEAKING DOWN SLOWLY. ALSO FOUND RR TIRE LEAKING. BOTH VALVE STEMS LEAKING AT STEM R&R TIRES REPLACED VALVE STEMS BALANCED TIRES
Leaks	RT FRONT TIRE GOES DOWN IN TWO WEEKS	INSPECT AND FOUND VALVE STEM LEAKING AT WHEEL REPLACE VALVE STEM
Leaks	REPAIR TIRE RIGHT REAR	4164 VERIFIED CONCERN PINPOINT TEST FOUND LEAKING VALVE STEM ON RIGHT REAR, REPLACED VALVE STEM CORE AND RETEST OK
Leaks	LEFT REAR TIRE FLAT	AT THIS TIME DONE. 0.5 REPLACED VALVE STEM
TPMS light	LOW TIRE PRESURE LIGHT IS ON CUS SAYS THAT BOTH LEFT FT WHEEL AND RT REAR WHEEL ARE ;OOSING TIRE PSI....VALVE STEM????	187 RESET ALL TIRE PRESSURES AND DROVE TRUCK. LOW TIRE PRESSURE LIGHT WENT OFF.
Leaks		CONFIRMED, REPLACED LEFT REAR AND RT REAR VALVE STEM
Leaks	SALES STATES RT FRT TIRE GOES FLAT CK FOR LEAK	RNR RT FRT WHEEL VALVE STEM WAS LEAKING REPLACED

		VALVE STEM LEAKING REPLACE VALVE STEM AND REBALANCE
Leaks	AIR LEAK AT LEFT REAR TIRE	TIRE USE MT NO OP
Leaks	CHECK SLOW LEAK IN PASSENGER REAR TIRE	RE AND RE TIRE AND REPLACED VALVE CORE LOOSE
TPMS light	CHECK TIRE PRESSURE LIGHT IS ON CUSTOMER STATES ABOVE THE REAR VIEW MIRROR THE WIRES ARE LOOSE AND	ADDITIONAL MISC. REPAIRS TAPED UP.TECH FOUND TRIM ABOVE MIRROE LOOSE TECH RE ATTCHED 143 VERIFIER ET REPARER SPRING VALVE ET ADJUSTER TIRE PRES SURE
	VER. PRESSION DES PNEUS	
		10 15 CORRECT MILAGE IN AND OUT PERFORMED PDI WRONG WHEEL COVERS WITH VEHICLE;ADVISED AND ORDERED CORRECT COVERS NO VALVE COVERS WITH VELICLE;ADVISED GARY.C ORDERED COVERS NO EMBLEM ON REAR TAILGATE;ADVISED GARY AND ORDERED PART TECH 1293 INSTALLED 4 NEW VALVE COVERS ON WHEEL INSTALLED NEW EMBLEM ON NRE4AR TAIL GATE DID NOT NEED WHEEL COVER RIGHT ONES IN VEHICLE CHECKED FOR LEAKS, FOUND ALL 4 VALVE STEMS LEAKING DISMOUNTED ALL 4 TIRES AND REPLACED VALVE STEMS. REMOUNTED TIRES, RECHECKED, NO LEAKS DETECTED
	PRE DELIVERY INSPECTION	VALVE STEM FAULTY
Leaks	CUSTOMER STATES VALVE STEM LEAKING	REPLACED PASSENGER FRONT TIRE VALVE STEM
Leaks	CUSTOMER STATES RT FRT TIRES LOSES AIR	BREAK DOWN TIRE AND REPLACE VALVE STEM
Leaks	BRAKE TIRE DOWN AND REPLACE THE VALVE STEM	FOUND WIPER ELEMENT TORN. REPLACED WIPER BLADE. VERIFIER ET REMPLACER
	PASSENGER WIPER BLADE INOP.	VALVE NE GARDE PAS AIR PNEU AVANT GAUCHE
Replace	VERIFIER PNEU AVANT GAUCHE ETAIT A PLAT (B650	

Leaks	LEFT FRT TIRE LOSING AIR	LEFT FRONT TIRE LOOSING AIR VERIFY DIAG AND R & R LEFT FRONT TIRE AND FIX VALVE STEM LEAKING LT REAR VALVE STEM REPLACED VALVE STEM, BALANCED TIRE & SET AIR PRESSURE
Leaks	REPAIR FOR LEFT REAR VALVE STEM LEAKING.	DISMOUNTED LEFT FRONT TIRE REPLACED VALVE STEM REMOVED R.F. WHEEL. REMOVED TIRE REPLACED VALVE STEM. REBALANCED INSTALLED
Leaks	CUSTOMER HAS TO ADD AIR TO RIGHT FROTN TIRE NOTICE STEM SOUNDS LIKE LEAKING	
Leaks	RIGHT FRONT TIRE KEEPS LOSING AIR	
Missing Gasket	C S LR OUTSIDE TIRE GOES LOW,HAS TO ADD AIR SINCE DAY OF DELIVERY,SALES HAD HIM BRING TRUCK IN ADVISE.	1 RUBBER GASKET IN VALVE STEM MISSING, CAUSING AIR TO ESCAPE. REMOVED TIRE FROM RIM, REPL VALVE STEM ASSEM. MOUNT TIRE AND REBALANCE
	GENERAL MECHANICAL ..... CHECK RIGHT REAR TIRE LOSING AIR	UPON INSPECTION FOUND TIRE BEAQD TO BE LEAKING AROUND RIM. REMOVED TIRE FROM RIM INSPECTED BEAD OK. APPLIED BEAD SEALER TO BOTH BEADS AND REINSTALLED TIRE. CHECKED FOR LEAKS OK INSTALLED RIM ON CAR TORQUED LUG NUTS TO 100 FT/LBS. 6364 DONE
Leaks	TIRE LITE GOES ON AND OFF EVEN WHEN SHE ADJUST PRESSURES	PERFORM EEC TEST NO CODES STORED CHECK OASISI NO SSM OR TSB CHECK THE TIRE PRESSURES ALL WERE GOOD CHECK ON DATALOGGER ALSO GOOD CHECK THE TIRES FOR LEAKS OR DEBRI OK REMOVED EACH TIRE AND PUT IN DUNK REMOVED AND REPLACE LEAKING VAVLE STEM CORE AND HAD PERFORM AWAKE AND RELEARN PROCEDURE FOR SENSORS AND REROAD TEST OK CHECKED AND TESTED AND FOUN RF TIRE LEAKING VALVE STEM REPLACED AND RECHECKED GOOD
Leaks	CUST STATES RF TIRE HAS A SLOW LEAK	

Leaks	Replace tire	C/S RIGHT FRONT TIRE WENT FLAT	VERIFIED CONCERN VALVE WAS LEAKING REPLACED TIRE DUE TO FAULTY VALVE STEM TIRE WENT FLAT WHILE DRIVING NO DAMAGE TO RIM FOUND.
TPMS light		CHECK LOW TIRE PRESSURE LIGHT IS ON DARRELL CHECKED PRESSURES & THEY ARE OK	BCE DIAG, PINPIUNT TEST, RE AND RE LEFT FRONT TIRE REPLACED VALVE STEM RESET A LL TIRES TO 37PSI COLD
Leaks		RIGHT FRONT TIRE NOT HOLDING PRESSURE. CHECK AND ADVISE.	263 PRESSURED TIRE, CHECKED FOR LEAKS, NONE FOUND, WATER TESTED WHEEL TIRE, FOUND VALVE STEM LEAKING. DISMOUNTED TIRE FROM WHEEL, REMOVED AND REPLACED VALVE STEM. REMOUNTED TIRE TO WHEEL, BALANCED ASSEMBLY AND REINSTALLED ON VEHICLE.
Leaks	Replace tire	CUST STATE THERE IS A LEAK ON THE TIRE THAT IS IN THE TRUNK	B90ANNHX3906 B90ANNHX4006 AIRRED UP TIRE,WATER TESTED IN TANK,VERIFIED LEAK IN THE SIDEWALL.BROKEDOWN TIRE FROM RIM.FOUND WEAK SPOT IN THE MATERIAL OF THE SIDEWALL WHICH CAUSED PINHOLE WITHOUT BEING PUNCTURED.MANUFACTURE DEFECT. CC 30 BASIC 1007 NOT OPERATING PROPERLY CP: 1700 REMOVE RIGHT FRONT TIRE, REPLACE VALVE
Leaks		RIGHT FRONT VALVE STEM LEAKING	STEM
TPMS light		TIRE LITE ON DID CHECK TIRE PRESSURES & TEST DROVE LITE WONT GO OUT	1700 REPLACE LR VALVE STEM & ROAD EST OVER 20MPH TO REST WARNING LITE
Cut		REPLACE VALVE STEM ON DRIVERS SIDE REAR TIRE	REPLACE VALVE STEM. CUT VERIFIED DRIVERS REAR VALVE STEM LEAKING. DISMOUNTED TIRE. REPLACED VALVE STEM
Leaks		CUSTOMER STATES LEFT REAR TIRE LEAKING VALVE STEM CONCERN	REMOVED TIRE AND VERIFIED REPAIR. MILES OUT 482

Replace	T MOIN PENU FROID	PLAINTE CONFIRM ,PERTE PAR LA VALVE PNEU ARRIERE GAUCHE, REMPLACER VALVE,TEST OK, AJUSTER PRESSION
Leaks	PATCH TIRE, CS THAT LF TIRE IS LEAKING, OK PER RANDY T	REMOVED TIRE, CHECKED FOR LEAK, LEAKING FROM VALVESTEM. REPLACED VALVE STEM
Leaks	CUSTOMER STATES:FT TIRES LOSE AIR REPAIR	VERIFIED CONCERN, FOUND VALVE STEMS LEAKING ON BOTH FRONT TIRES, DISMOUNTED, REPLACED VALVE STEMS, REMOUNTED, REBALANCED, OK AT THIS TIME (D8) 1700. TRACE AIR LEAK TO TIRE VALVE. REMOVE TIRE, UNMOUNT, REMOVETIRE VALVE, CLEAN AND INSTALL NEW TIREVALVE, REMOUNT TIRE & BALANCE.NO SLTS VALVE STEM
Leaks	R/R OUTER TIRE IS FLAT (B65)	REMOVED AND REPLACED VALVE STEM
Replace	FLAT REPAIR	CP:1700
		NOISE FROM R/R TIRE WHEN ROTATING TIRES
	TECH STATES NOISE HEARD FROM TIRE WHEN ROTATING B65	DISMOUNTED TIRE FOUND LOOSE VALVE STEM IN TIRE, REMOVED VALVE STEM REMOUNTED AND BALANCED R/R TIRE
Replace	VERIFIER PNEUS AVANT DROITE SE DEGONFLE	VERIFIER ET REMPLACER VALVE REMONTER FAIRE ESSAI O.K.
Leaks	CUSTOMER STATES LEFT REAR TIRE LOOSES AIR	VERIFY LEFT REAR TIRE HAS SLOW LEAK FOUND VALVE STEM LEAKING REMOVE TIRE DISMOUNT REPLACE VALVE STEMREMOUNT TIRE VERIFY REPAIR
Leaks	C S AIR LEAKING FROM VALVE STEM DRIVERS FRONT SIDE IS LEAKING	VERIFIED VALVE STEM LEAKING REPLACED VALVE STEM AND RETEST FINE AT THIS TIME

		CK RF TIRE PRESSURE, VERIFIED LOW, REMOVED RF TIRE AND PLACE IN WATER TANK, FOUND LEAKAGE FROM RF VALVE STEM DISMOUNT TIRE, REPLACE VALVE STEM, REMOUNT TIRE AND COMPUTER SPIN BALANCE RECHECK ALL OK AT THIS TIME
Leaks	CUST STATES RF TIRE KEEPS LOOSING AIR CK AND ADV SEEMS TO BE LOWER AFTER HIGHWAY DRIVING	TIME TO REPAIR VALVE ON BOTH REAR WHEELS VERIFIED CONCERN.FOUND BOTH FRONT TIRES HAVE VERY LOW AIR PRESSURE. CHECKED WHEEL TIRE ASSEMBLIES FOR AIR LEAKS.FOUND BOTH FRONT WHEEL VALVE STEMS CRACKED AND LEAKING AIR.REPLACED VALVE STEMS IN BOTH FRONT WHEELS,RECHECKED.NO LEAKS. CONCERN
	DRIVER REAR TIRE REPAIR ?	CORRECTED.MT REQUIRED SINCE NO LABOR OP FOR THIS 1 CHECKED VEHICLE FOUND BOTH REAR TIRE VALVE STEMS LEAKING REPLACED V STEMS AND CHECKED OK.
Cracked	CUSTOMER STATES BOTH FRONT TIRES LOOSING AIR.	13 PSI. LEFT EAR TIRE LOW ON PRESSURE, INSPECTED AND FOUND LEAK. LEAKING AT VALVE STEM, TORN AT RIM.REPLACE VALV STEM AND RECHECKED. OK AT THIS TIME.
Leaks	CUSTOMER STATES DR REAR WHEEL VALVE STEM LEAKING SOP HERE	2426 CK OUT TIRE AND FOUND VALVE STEM LEAKING. DISMOUNT TIRE AND REPLACE STEM, SPIN BALANCE AND RECK, ALL OK NOW
Leaks	REPORTED AS DRIVERS REAR TIRE PRESSURE AT	
Leaks	CUSTOMER STATES THE RIGHT REAR TIRE IS LOW ON AIR	

		VERIFIER PNEU ARRIERE DROIT QUI DEGONFLE VERIFIER CONSULTER OASIS ET RIEN VERIFIER ET DEGONFLE PAR LA VALVE ENLEVER PNEUDECOLLER PNEU REPLACER VALVE RETEST OK (01) MT AUCUN TEMPS D'OPERATION DECERNER DANS LE SLTS POUR ENLEVER ROUE DECOLLER PNEU REPLACER VALVE NETTOYER
Replace Replace	PNEU ARRIERE DROIT DEGONFLE PAR LA VALVE CHECK L R TIRE HAS A LEAK UPON INSPECTION OFF TRANSPORT TRUCK FOUND LH FRONT TIRE STEM LEAKING	ROUEREPOSER PNEU ET REPLACER VALVE REPLACED TIRE VALVE STEM
Leaks	defeito pneus com desgaste prematuro.01 causa desgaste precocoe dos pneus, devido ao material de m qualidade dos pneus, ocas	2 REPLACED VALVE STEAM defeito pneus com desgaste prematuro.01 causa desgaste precocoe dos pneus, devido ao material de m qualidade dos pneus, ocas
Leaks	CUSTOMER STATES RIGHT REAR OUTER TIRE LOSING AIR. IF YOU PLAY WITH VALVE STEM IT WILL LEAK.	CHECK OUT FOR RIGHT REAR OUTER TIRE LOSING AIR,REMOVED WHEEL ASSEMBLY,BREAKDOWN TIRE AND RESEAL TIRE ONTO RIM,ADJUST TIRE PRESSURE AT ALL TIRES,SET TO SPECS. VERIFIED, FOUND AIR LEAKING FROM VALVE STEM REPLACED VALVE STEM.
Leaks	LF TIRE LOOSEING AIR CHECK AND ADVISE	INOP REPLACED RIGHT FRONT TIRE PRESS. SENSOR
TPMS light	CUSTOMER STATES PSI LIGHT IS ON	
Leaks	LEFT REAR TIRE LOSSES AIR  RT FRONT TIRE FLAT	REPLACE TIRE VALVE LEAKING 706 060 FLAG 125 .6 REPLACED RIGHT FRONT TIRE MOUNT AND BALANCE REINSTALLED SPARE TIRE IN TRUNK 3052 CK OUT AND FOUND RT REAR TIRE LOW. CK OUT AND FOUND VALVE STEM LEAKING. DISMOUNT TIRE, REPLACE STEM AND BALANCE, CK FOR LEAKS, ALL OK NOW
TPMS light	C S: CUST STATES LOW TIRE PRESSURE LIGHT IS ON	



Leaks	R R TIRE SOFT	VALVE STEM FAILURE MT TIME TO REPLACE R R TIRE VALVE STEM CHECKED AND VALUE STEM LOOSING AIR R AND R TIRE, REPLACE VALVE STEM AND BALANCE. CHECK AND REPLACE VALVE STEM FAULTY
Leaks	CS THAT STEM ON PASS FRONT IS LOOSING AIR	2517 REPLACE THE VALVE STEM AND RESEAL THE BEED 3 R&R TIRE AND REPLACED VELVE TIRE AND BALANCED SQ 5011
Leaks	LT OUTER TIRE LOW #90	SE REVISU INDICADOR DE LLANTA BAJA ENCENDIDO ENCONTRANDO FALTA DE EN TRENIMIENTO DE LOS SENSORES DE PRESION DE LAS 4 RUEDAS (FALLO DE SENSORES POR RADIACION/SE CORRIGIO ENTRENANDO SENSORES DE PRESION A LAS CUATRO RUEDAS/SE UTILIZO MT POR NO EXISTIR OPERACION EN MANUAL DE TARIFA DE TIEMPO.
Leaks	RIGHT REAR TIRE HAS SLOW LEAK PLEASE CHECK	4 VERIFIED CUST CONCERN RI TIRE DISMOUNT TIRE RR STEM REMOUNT AND BLANCE FILL TO SPECS VALVE OK TAKING AIR REROAD TEST OK AT THIS TIME XX
Cracked	REPLACE SPLIT VALCE STEM ON RIGHT REAR WHEEL	REPLACE RIGHT FRONT TIRE VALVE 170 INSPECTED & FOUND LEAKING OUT OF VALVE STEM , REMOVED & REPL L FRONT VALVE STEM
	INDICADOR DE LLANTA BAJA ENCENDIDO	REAR PASSENGER TIRE WAS FLAT THIS AM REPLACED VALVE STEM
TPMS light	C STATES TIRE PRESSURE LIGHT ON	1 LEAK TEST TIRE, DISMOUNT TIRE AND PATCH FROM INSIDE, IF REBALANCE IS REQUIRED, ADDITIONAL CHARGE IS \$8.00. REPLACED SHCREADER VALVE
Leaks	ADDED AIR TO RIGHT FRONT AND CAN HEAR VALVE LEAKING NOW	
Leaks	SLOW LEAK LEFT FT TIRE	
Leaks	UNIT HAS A FLAT TIRE REPAIR TIRE	
Replace	LEAK TEST, DISMOUNT TIRE AND INSTALL SELF VULCANIZING PLUG PATCH PASS FT TIRE SLOW LEAK	

		CHECKED RIGHT FRONT WHEEL FOR SLOW LEAK. SPRAYED WITH SOAP NO LEAK FOUND. PUT WHEEL & TIRE IN WET TANK. FOUND BUBBLES COMING FROM VALVE STEM AREA. REMOVE TIRE/REMOVE VALVE STEM/ INSTALL NEW VALVE STEM. REINSTALL TIRE REBALANCE/ RECHECK OK.LEAK WAS FROM RUBBER BASE ON STEEL VALVE STEM IT WASTORN CUSTOMER CONCERN CODE TC8 VALVE STEM LEAKING NOT SELF SEALING TIRE.
Torn	RIGHT FRONT TIRE KEEPS GOING FLAT	CHECK RIGHT FRONT TIRE, FOUND TIRE VALVE LEAKING. REPLACE RIGHT FRONT TIRE VALVE. OTHER TIRE VALVE REPLACE LEFT REAR VALVE STEM
Leaks	RIGHT FRONT TIRE GOES LOW	
Leaks	CK FOR LEFT REAR TIRE LEAK	
Leaks	VALVE STEMS AT WHEELS LEAK AIR,ONE ALREADY REQUIRED REPLACEMENT CC TC8 REPLACE TIRE AIR WITH NITROGEN	VERIFY CONCERN.SOAP TEST VALVE STEMS.THREE STEMS LEAKING AIR. REPLACE THREE VALVE STEMS AND SET AIR PRESSURE AT 80PSI. CONCERN CORRECTED AT THIS TIME. RRPLACED NITROGEN IN VEH 1 VERIFIED CONCERN,TIGHTENED VALVE STEM,ADJUSTED TIRE PSI LIGHT,ROAD TESTED,OK. INSPECTED TIRE TO FIND VALVE STEM LEAKING. REPLACED VALVE STEM. ORDERED NEW VALVE STEM FOR R F TIRE (NON TRADITIONAL STEM) REPLACE VALVE STEM IN TIRE OF VEHREPLACE VALVE STEM
Tightsen valve stem	CUST STATES THAT THE TIRE PSI LAMP COMES ON	
Leaks	AIR LEAK FROM DRIVERS REAR TIRE.	
Broken	CUSTOMER STATES STEM BROKE BETWEEN WHEEL AND STEMS	
Replace	CUST ST D S R TIRE HAS 2 B FILLED EVERY OTHER DAY	
Leaks	LEFT REAR TIRE LOOSES AIR	REPL LR TIRE VALVE LOOSE AIR LOW ON REAR R&I TIRE, REPLACED LEAKING VALVE STEM.RECK. OK
Leaks	CUSTOMER STATES THAT THE REAR TIRE WAS 10	

		251 RT REAR VALVE STEM LEAKING TECH3645 CK FOR
Leaks	CUST REPORTS TIRE LT IS STAYING ON	LEAK,REPLACE VALVE STEM, RECALIBRATE TIRE SENSORS CHECK AND REPLACE VALVE
Replace	CHECK RT REAR INNER TIRE FLAT	STEM RIGHT INNER TIRE REPLACED VALVE STEM AND RESEALED BEAD. RECHECKED FOR LEAKS NO OTHER LEAKS NOTED. WPI
Replace		AIR LEAK AT RIGHT FRONT VALVE STEREMOVE RIGHT FRONT TIRE DISMOUNT AND REPLACE VALVE STEM
Leaks	CUST STATES THAT LEFT FRONT TIRE LOOSES 20LBS OF AIR EVERY TWO DAYS	REPLACE LEFT FRONT VALVE STEM, LEAKING.
Leaks	DRIVERS SIDE FRONT TIRE HAS A SLOW LEAK CHECK AND ADVISE.	MISSING PART VERIFY CONCERN, BREAK DOWN SPARE TIRE AND INSTALL VALVE STEM, VALVE STEM WAS MISSING FROM WHEEL
Missing	SPARE TIRE IS FLAT	
Leaks	CUST STATES THAT RIGHT REAR TIRE VALVE STEM LEAKS	. COMPLETED REPAIR OF TIRE REP VALVE CAUSING TIRE TO LOSE AIR
TPMS light	LOW TIRE PRESSURE LIGHT ON	
		5100 W 1007AF .3 1007D2A .5 80 REPLACED TIRE DISMOUNTED & REMOUNTED TIRE SET TIRE PRESSURE REPLACED VALVE STEM SEAL BALANCED TIRES OLD DOT CODE # AP6J L7XX
Replace	TIRE 1 SEE BRIAN CIRA SEE ADRIAN FIRST	4306 X 1 NEW DOT CODE # AP6U L7XX 0607 X 1 FLAG 428
Broken	C S LEFT FRONT TIRE IS FLAT INSTALLED SPARE,PLEASE CHECK AND ADVISE	INSPECTED FOUND VALVE STEM BROKE REPLACED VALVE STEM OK
		15659 060 FLAG 125 .6 REPAIRED LEFT REAR TIRE STEM SEAL LEAKS REMOVED AND REPLACED RIGHT FRONT HAD NAIL REPAIRED TIRE
Leaks	CK TIRES FOR LEAKS LEFT REAR	2302 030 REPAIRED RIGHT REAR TIRE REMOVED TIRE DISMOUNTED TIRE REMOVED NAIL PATCHED HOLE REMOUNTED TIRE REBALANCED TIRE ADJUSTED ALL TIRES TO CORRECT PRESSURE 35 PSI RESET TIRE PRESSURE SENSORS.
	REPAIR FLAT TIRE	

Leaks	CUSTOMER STATES LF TIRE LOOSEING AIR	LEAK TEST TIRE WAS LEAKING AT THE BASE OF VALVE STEM REPLACED THE VALVE STEM RETEST OK
Leaks	CK R R TIRE LOOSES AIR PRESSURE	REPLACE VALVE STEM 7809 MT1007 MT1007 .9 HRS 1007D .4 TECH 449 130 TEST DROVE VEHICLE VERIFY VIBRATION CONCERN. INSPECTED TIRES FOR RADIAL AND LATERAL TIRE RUNOUT, FOUN EXCESSIVE RADIAL RUNOUT. REMOVED AND REPLACED THREE FAULTY TIRES, BALANCED TIRES, SET TIRE PRESSURE. REROAD TEST VEHICLE OPERATING AS DESIGNED AT THIS TIME FLAG TECH 449. OLD CODS DOT 5M7C
	C50 CHECK VIBRATION IN FRONT END	PJNH 0207 X THREE. NEX COD T79CP JNH 1206 X FRT DRIVERS TIRE IS LOW REOVED AND REPALCED VALVE STEM
Replace	C S FRONT DRIVERS TIRE IS LOW CHECK LEFT REAR TIRE LOOSING AIR	REPLACE LEAKING VALVE STEM
Leaks	CUST STATES LEFT REAR TIRE HAS AIR LEAK	VERIFY LOCATE LEAK REPLACE WHEEL VALVE STEM
Leaks	CUSTOMER STATES RIGHT FRONT TIRE LOSES AIR CHECK AND ADVISE	REPLACE LEAKING VALVE STEM
Leaks	REPORT ON PASSENGER FRT TIRE LOOSING AIR. (B66)	DIAG. INSPECTED. FOUND LEAKING TIRE VALVE. REMOVED TIRE AND REPLACED VALVE. REMOUNTED TIRE AND BALANCED. (D8) VALVE STEM IS LEAKING ON R FBROKE TIRE DOWN AND
Leaks	CUSTOMER STATES CHECK DRIVERS SIDE TIRE FOR AIR LEAK	REPLACED STEM AND REBALANCED
Leaks	RIGHT REAR TIRE LEAKS DOWN	DIAG AND RR RIGHT REAR TO REPLACE VALVE STEM

Leaks	CUSTOMER STATES TIRE LIGHT COMING ON	TIRE PRESSURE LIGHT ON. BCE DIAG. RECORD AND MONITOR PIDS. RIGHT EAR TIRE PRESSURE LOW. LEAK TESTED TIRE, LEAK FOUND AT VALVE STEM. REPLACED VALVE STEM CORE. RETESTED, NO LEAK. OK.
Leaks	CUSTOMER STATES PASS.REAR TIRE KEEPS GOING LOW. CHECK TIRE FOR LEAKS AND ADVISE.	VERIFIED CONCERN WITH RIGHT REAR TIRE LOW.REMOVED WHEEL AND INSPECTED AND FOUND VALVE STEM LEAKING AROUND RIM. REMOVED AND REPLACED BAD VALVE STEM AND OK AFTER REPAIRS.
Leaks	LEFT FRONT TIRE LEAKING AIR	FOUND METAL VALVE STEM LEAKING. BREAK DOWN TIRE AND REPLACED VALVE STEM. RECHECK
Leaks	C/S PASSENGER FRONT TIRE IS LOSING AIR WENT DOWN TO 18PSI IN 2 DAYS	PASSENGER SIDE FRONT TIRE LOOSING AIR. PUT INTO DUNK TANK,FOUND VALVE STEM TO BE PASSING AIR. R&R VALVE STEM.
Leaks	CUSTOMER STATES THAT THE R F TIRE IS LEAKING	BAD VALVE STEM INSPECTED TIRE NO FOREIGN OBJECTS OR DAMAGE FOUND LEAK TESTED TIRE IN DIP TANK FOUND LEAK AT VALVE STEM DISMOUNTED TIRE REPLACED VALVE STEM REMOUNTED AND BALANCED TIRE LEAK TESTED AGAIN OKAY
Tighten valve core	CHECK SLOW LEAK LF TIRE AREA	INSPECT FOR LEAK AND TIGHTEN VALVE STEM CORE
Leaks	OWNER STATES,R F TIRE IS LEAKING	REPLACE VALVE STEM CHECKED FOR LEAKS NONE FOUND CHEKED TIRE AND WHEEEL COMPLETE FOR LEAKS NO LEAKS FOUND INSTALLED NEW VALVE STEM AND RECHEDKED COMPLETE ALL FOUND NORMAL NPF CND ALL OK PERFORMED LOF QC

		11242 LEAKING TIRE STEM VALVE, LOSING AIR IN L R TIRE 0 DIAG, CHECKED AIR PRESSURE, L R TIRE PRESSURE 23LBS, INSPECTED FOR ANY NAILS (NONE), CKD VALVE STEM, R&I TIRE FROM RIM, REPLACED VALVE STEM ASY, RE TESTED OK, RE SET
Missing	CUST STATES CHECK FOR THE TIRE PRESURE LIGHT IS ON AND MISSING VALVE STEM	LOW TIRE PRESS WARNING INDIATOR, RE TESTED OK CODE B2872
TPMS light	TIRE SENSOR LIGHT STAYING ON	CK OUT, REPLACE VALVE STEM FOUND LEFT REAR VALVE STEM
Leaks	LOW TIRE PRESSURE INDICATOR ON	LEAKING, REPLACED VALVESTEM. TESTED OK
Leaks	CUST STATES LEFT TIRE LEAKING AT VALVE STEAM	VERIFIED CONCERN, REPLACED VAVLE STEAM
Leaks	CUST.STATES THAT THE DRIVER FRONT TIRE KEEPS LOOSING AIR CK VALVE STEM AND ADVISE	VALVE STEM LEAKING. CHECK AND RPL VALVE STEM ON LF TIRE.
Leaks	CHECK AND ADVISE TIRE LOOSING AIR LR GOES DOWN OVERNIGHT	REPLACE VALVE STEM ADDITIONAL MISC. REPAIRS
Leaks	CUSTOMER STATES THAT TIRE WARNING PRESSURE SENSOR INOP KEEPS ON BEEPING, CHECK TIRE PRESSURE ALREADY OK.	VERIFIED CONCERN FOUND LEFT SIDE VALVE STEM LEAKING. REPLACE VALVE STEM CORE AND RECALIBRATE VERIFIED REPAIRS.
Leaks	DRIVERS SIDE FRONT TIRE LOOSES AIR VALVE STEM BAD	REPLACED LEFT FRONT VALVE STEM AND REBLANCE TIRE
Leaks	RIGHT REAR TIRE LOOSES AIR	REMOVED AND CHECKED TIRE. FOUND VALVE STEM LEAKING. REMOVED VALVE STEM AND REPLACED. CHECKED OK.
Leaks	C S LF TIRE GOES FLAT...TIRE PRESSURE LIGHT ON	REPLACE LEFT FRONT WHEEL VALVE STEM LEAKING
Replace	CHECK FLAT R.R. TIRE...JUST DROPPED FROM ALLIED.	REPLACE R.R. TIRE SCHRADER VALVE.
Replace	CHECK RT FRONT TIRE LOOSING AIR JUST REPLACED YESTERDAY	NOTHING FOUND IN TIRE APPLIED BEAD SEAL AND REPLACED VALVE STEM COULD NOT CHECK TIRE PRESSURE OR ADD AIR FOUND VALVE CORE DAMAGED
core	CAN NOT CK TIRE PRESSURE	REPLACE VALVE STEM AND RECHECK OK

Missing	VALVE STEM PULLED FROM SPARE	295 VALVE STEM PULLED FROM SPARE W REMOVED SPARE FROM VEH. REMOVED TIRE FROM RIM AND INSTALLED VALVE STEM.
Leaks	LEFT FRONT TIRE WILL NOT HOLD AIR	TESTED FOR LEAKS. FOUND VALVE STEM ON LEFT FRONT TIRE LEAKING. REPLACED VALVE STEM WITH NEW. CC H26;LO 999A 0.2;C 1700
Leaks	CHECK RIGHT REAR TIRE FOR LEAKS	REPLACED LEAKING VALVE STEM IN RIGHT REAR TIRE.
Leaks	CUSTOMER STATES RIGHT TIRE LOOSES AIR SEEMS TO END UP AT 60 65 LBS CUSTOMER STATES DRIVER SIDE APPEARS TO BE DOING THE SAME	FAILED VALVE STEMS NECESSARY TIME TO INSPECT AND FOUND BOTH REAR TIRE VALVE STEMS LEAKING RIM REPLACE BOTH AND REINSTALL
Cracked	CHECK VALVE STEMS,STEMS CRACKED DRY ROTTED.	1700 CC 42 CCC B65 CHECKED VALVE STEMS,CRACKED,REPLACED ALL FOUR VALVE STEMS. VERIFY CONCERN REMOVED WHEEL REMOVED TIRE R&R
Leaks	CUSTOMER STATES RIGHT REAR TIRE LEAKING AT VALVE STEM	VALVE STEM BALANCE TIRE AND REINSTALL RE CHECK OK
?	CUST STATES RIGHT REAR TIRE WILL NOT HOLD AIR PRESSURE	R R R REAR TIRE TO SECURE VALVE STEM.
Leaks	TIRE HAS SLOW LEAK	1700 REPLACE LEAKING VALVE STEM & RESEAL BEAD
Leaks	EMERGENCY REPAIR HAD FLAT TIRE VALVE STEM WAS LEAKING 23.55	CUSTOMER HAD FLAT TIRE LATE ONE EVENING. TOOK TO TIRE SHOP TO HAVE REPAIRED FOUND VALVE STEM LEAKING. THEY REPLACED VALVE STEM FOR CUSTOMER.. REQUESTING REFUND FOR EMERGENCY AFTER HOUR REPAIR \$23.55 WATER TEST VALVE STEM LEAKING REPLACED STEM AND REWATER TEST LUG NUT
Leaks	CHECK LEFT REAR TIRE FOR SLOW.	TORQUE 150 FT LBS

		1007 42 VERIFY CONCERN INSPECTED TO FIND RR VALVE STEM LEAKING AT SEALING SURFACE TO WHEEL. DISMOUNT TIRE FROM WHEEL AND REPLACED FAULTY VALVE STEM WITH NEW. REMOUNT AND BALANCE TIRE AND RECALIBRATE TPMS SYSTEM. RECHK GOOD.
Leaks	CUST STATES THAT VALVE STEM LEAKING PASS SIDE REAR	
Leaks	WHEEL AND TIRE REPAIRS	4116 THERE WAS A VALVE STEME LEEK LEAKING THRU VALVE STEM SEAL REPLACED 1
Leaks	TIRE GOES FLAT LEFT REAR VALVE STEM LEAKING	VALVE STEM MT TO CHECK FOR LOSS OF AIR PRESSURE AT LEFT FRONT TIRE. LEAKING AT VALVE STEM, REMOVE CORE & FOUND O RING STUCK IN STEM. INSTALL NEW CORE, AIR TIRE & RECHECK
Leaks	L STEER TIRE GOING FLAT CUSTOMER STATES RIGHT REAR AND LEFT FRONT WHEEL VALVE STEMS ARE NOT STRAIGHT OUT OF WHEELS, ADVISE	RIGHT REAR AND LEFT FRONT WHEEL VALVES FIT POOR, INSPECT, REPLACE BOTH VALVE STEMS
Poor fit	CHECK AND REPORT ON FLAT TIRE IN TRUNK OF VEHICLE	REPLACED VALVE STEM RT REAR TIRE
Replace		V RIFI ET DEMONTE ROUE AVANT GAUCHE, DESSOUFFLE AUTOUR DE LA VALVE, FISSUREAUTOUR ET SUR TROU DE VALVE, R PAR FISSURE AUTOUR, FAIT SOUDER TROU POUR PERC NOUVEAU, PERC NOUVEAU TROU SUR ROUE ALUMINIUM, ESSAI OK ***SOUDURE EN SOUS TRAITANCE PAR SOUDURE MARTIN ST PIERRE***
	VERIFIER ROUE AVANT GAUCHE DESSOUFFLE AUTOUR DU RIM R ROUE AVANT GAUCHE DESSOUFFLE AUTOUR DU RIM(B66)	CK ALL TIRES FOR LEAKING AIR FOUND LF RF AND RR ALL 3 TIRES LEAKING AT THE VALVE STEM R R 3 TIRES R R TIRES
Leaks	ALL TIRES EXCEPT D S REAR LOSE AIR LOSE ABOUT 40 PSI IN A COUPLE WEEKS	OFF THE WHEELS REPLACE VALVE STEMS MOUNT AND BALANCE 3 TIRES
Leaks	FLAT TIRE	VALVE STEM IS LEAKING TIRE REINDEX



TPMS light	LOW TIRE PRESURE LITE KEEPS FLASHING	151 VERIFIED COMPLAINT HOOKED UP WDS CHECKED FOR CODES FOUND DTCS B287A AND B2872A FOR TIRE SYSTEM FAULTS CHECKED TIRE PRESSURE FOUND PRESSURES LOW INFLATED TO PROPER SPEC LIGHT WENT FROM FLASHING TO SOLID RECALIBRATED ALL SENSORS WITH TOOL204 363 CLEARED CODES VERIFIED REPAIR
Tighten valve core	CUST STS RIGHT REAR TIRE LEAKING	CHECKED TIRE FOR LEAK VERIFIED VALVE CORE LEAKING TIGHTENED VALVE CORE RETESTED OK AT THIS TIME
Leaks	CUST.STATES THAT THE LOW TIRE WARNING LIGHT IS ON ALSO THERE IS AIR LEAKING FROM ALL BUT 1 VALVE STEMS	RF, BOTH REAR VALVE STEMS LEAKING. BREAK DOWN RF, RR, LR TIRES FOR ACCESS TO RPL VALVE STEMS. NOTE ON RO# 176177, 9 27 07, 4164 MILES, THE LF VALVE STEM WAS RPL. DIFF VALVE STEMS THIS VISIT. VERIFY CUSTOMER CONCERN TIRE IS FLAT INSPECT TIRE FOUND VALVE STEM TORN BROKEN HAD TO REPLACE THE VALVE STEM AND FOUND TIRE STILL LEAKING ALSO FOUND NAIL IN TIRE AND PLUGGED TIRE OK
Torn	CUSTOMER STATES LEFT FRONT TIRE IS FLAT CHECK AND ADVISE	REMOVED LEFT REAR TIRE LEAK CHECKED IN TANK FOUND LEAK AT VALVE CORE TIGHTENED VALVE CORE IN VALVE STEM LEAK GONE NOW
Tighten valve core Leaks	LEFT REAR TIRE LOSING AIR LEFT FRONT TIRE WENT FLAT	QUALITY CHECK OK REPL LEAKING VALVE STEM VALVE STEM MISSING..TIRE RUN FLAT...CUSTOMER NOT CONCERNED WITH TIRE DINGS
Missing Leaks	LOUD NOISE AND TIRE RAN FLAT.. LEFT REAR TIRE LEAKS DOWN	

		1 PERFORMED LEAK DIAGNOSIS; FOUND VALVE STEM LEAKING; REPLACED VALVE STEM; REMOUNTED & BALANCED ON TRUCK; PUT SPARE BACK ON SPARE TIRE ASSY
Leaks	CHECK PASSENGER FRONT TIRE HAD FLAT AND HAD SPARE PUT ON TRUCK; FLAT TIRE IN CARGO AREA; LOW TIRE LIGHT ON	
Leaks	THE PASSENGER REAR TIRE STEM IS LEAKING AIR	REPLACE VALVE STEM 4247 INSPECTED TIRES FOR LEAK FOUND VALVE STEM CORE TO BE LEAKING BROKE DOWN TIRE REPLACED VALVE STEM CORE REMOUNTED & BALANCED TIRE RETESTED, NO LEAKS FOUND
core Leaks	C S THAT FRONT DRIVERSIDE TIRE HAS SLOW LEAK. RIGHT FRONT TIRE LOSES AIR.	REPLACED VALVE STEM VALVE STEM
Replace	CUSTOMER STATES RIGHT REAR TIRE CONTINUES TO GO DOWN REPROT ON CAUSE OF RT FRT TIRE KEEPS LOOSING ARE AT VALVE STEM MOVE STEM AND YOU WILL HEAR IT	REMOVED AND REPLACED VALVE STEM
Broken	CUST STS LF TIRE GOING FLAT, STATES IF YOU MOVE VALVE STEM, CAN HEA	1750 .5 HR REPLACED VALVE STEM BROKEN
Leaks		REPLACED VALVE STEM AND PUT BACK ON RIGHT FRONT REMOVE TIRE, DISMOUNT TIRE FROM RIM, PATCH HOLE, REMOUNT TIRE ON RIM, BALANCE TIRE AND INSTALL ON VEHICLE. INSPECTED FOR LEAK COULD NOT FIND ANY LEAK SET PRESSURE TO 35 PSI WILL RECHECK INA COUPLE OF DAYS RECHECKED FOUND THAT THE VALVE STEM IS LEAKING REPLACED VALVE STEM TECH 2299 DB
Leaks	CUSTOMER STATES THE LEFT REAR TIRE IS FLAT. REPORT DRIVER SIDE FRONT TIRE IS LOSING AIR. AIR COMING FROM VALVE STEM	
Leaks		REPLACE VALVE STEM DIAG AND REPLACE RR TIRE DUE TO DEFECTIVVE VALVE STEM
Leaks	RIGHT REAR TIRE GOES FLAT CUSTOMER SAYS THERE IS A LEAK IN TIRE DRIVER FRONT	
Leaks		REPLACE VALVE STEM LEAK TEST & REPLACE VALVE STEM
Leaks	SLOW LEAK DRIVERS FRONT TIRE RIGHT FRONT TIRE IS LOSING AIR	REPLACED LEAKING ATEM

	C S P S REAR TIRE FLAT ADVISE TIRE IN TRUNK	7694 . P S REAR TIRE SEVERELY PUNCTURED INCAPABLE OF REPAIR MOUNT,BALANCE AND INSTALL REPLACEMENT TIRE VERIFIER FUITE PNEU AVANT DROIT.VERIFIER ET REMPLACER VALV E CAR RESTAIT COLLER.REGLER PRESSION,RESETTER SYSTEME.OTHER VALVE. VERIFIER FUITE PNEU AVANT DROIT REMPLACER SPRING VALVE QUI RESTAIT COLLE , RESET SYSTEME
Replace	CREVAISON AVANT DROITE	
Leaks	CHECK FOR LF TIRE LOOSING AIR PRESSURE LOW	VERIFY CONCERN AIR LEAKING AROUND BASE OF VALVE STEM REPLACE VALVE STEM AND RECHECK OK
Broken	VALVE STEM BROKEN FROM FACTORY	CONFIRM COMPLAINT. NEED TO ORDER NEW VALVE STEM. RECIEVED PART REMOVED OUTER AND INNER TIRE BROKE DOWN TIRE REMOVED AND REPLACED VALVE AIRED UP TIRE REINSTALLED BOTH TIRES AND WHEELS RECHECKED
Leaks	CUST STATES THAT THE RIGHT FRONT TIRE IS LOOSING AIR.	VALVE STEM LEAKING AIR. REPLACE VAVLE STEM R & I LEFT REAR TIRE FOR ACCESS TO REPLACE LEAKINGVALVE STEM,RETEST OK
Leaks	CUSTOMER STATES THE LEFT FRONT TIRE LEAKS FROM THE STEM, TIRE IS IN THE BED NOW	1 FOUND LEAK AT VALVE CORE. REPLACED VALVE STEM. RETEST OK.
Leaks	RIGHT REAR TIRE HAS SLOW LEAK	

		ROAD TEST BY FOREMAN AND DID NOT VERIFY A HISS FROM L.R. WHEEL AREA. EVEN PERFORMED A NUETRAL ENGINE OFF COAST AND HEARD NO ABNORAL NOISES. CAN ROAD TEST WITH CUSTOMER IF NEED TO FOR Q.C., NO SSMS OR TSBS EITHER. ADVISOR SPOKE WITH CUSTOMER AND CAN HEAR NOISE FRON VALVE STEM WHEN MOVEING REPLACED VALVE STEM
Leaks	CUST STATES THEY HEAR HISSING NOISE AROUND LEFT REAR WHEEL	VERIFIED CONCERN LEFT REAR TIRE PRESSURE LOW FOUND LOOSE VALVE CORE TIGHTEN VALVE CORE AIRED TIRE
Tighten valve core	CUSTOMER STATES TIRE PRESSURE LIGHT IS ON	RESET TPMS RETESTED OK .2 M TIME
Leaks	LEFT FRONT TIRE KEEPS LOSING AIR.	VALVE STEM NOT SEATED INTO RIM OPENING LEAKING REPLACED VALVE STEM BALANCE TIRE
TPMS light	CUSTOMER STATES TIRE SENSOR LIGHT ON DASH	VERIFIED CUSTOMER CONCERN FOUND SENSOR NEEDED TO BE RETAUGHT RETAUGHT TIRE SENSOR ROAD TESTED OK
Leaks	LOW TIRE LIGHT IS ON	MT1552 #1552 .5 G29 42 INSPECTED AND FOUND THE LEFT REAR TIRE LOW ONLY 20 PSI FOUND THE VALVE STEM LEAKING REMOVED AND REPLACED THE VALVE STEM
Leaks	RIGHT REAR TIRE REPAIR.	RESET LIGHT OKAY REPLACED VALVE STEM LEAKING.
Cracked	VALVE STEAMS CRAKING LEAKING REPORT	BROKE DOWN 4 WHEELS AND TIRES AND REPLACED ALL, VALVE STEMS.(CRACKED DISTORTED)
	REMOVE L REAR WHEEL LINE UP VALVE STEM	ALIGN L REAR INSIDE VALVE STEM NOT ALIGNED U CORRECTLYCANNOT PUT AIR IN INSIDE TIRE REMOVE OUTSIDE TIRE INSTALLED TO PRPER POSOITION

		R AND R INSIDE STEM NOT ALIGNED UP CORRECTLY CANNOT PUT ARI IN INSIDE TIRE REMOVE OUTSIDE TIRE INSTALLED TO PROPER POSITION
	REMOVE R REAR TIRE LINE UP VALVE STEM	L REAR INSIDE VALVE STEM NOT ALIGNED UP CORRECTLY CANNOT PUT AIR INSIDE TIRE REMOVED OUTSIDE TIRE INSTALLED TO PROPER POSITION
Leaks	REMOVE LEFT REAR WHEEL AND ALIGN VALVE STEM CHECK DRIVERS SIDE REAR TIRE LEAKING	CK AND REPLACE BAD VALVE STEM
Leaks	CHECK FOR TIRE LEAK REAR DRIVERS SIDE TIRE AND FRONT PASS SIDE	REPLACED VALVE STEMS DRIVERS SIDE REAR TIRE AND PASS SIDE FRONT TIRE
Cracked	CHECK RIGHT HAND SIDE REAR TIRE	RIGHT REAR TIRE WAS FLAT, TECH CHECKED TIRE AND FOUND CRACKED VALVE STEM, REPLACE VALVE STEM, REMOVED TIRE AND RE INSTALLED
Leaks	CUSTOMER STATES TIRES HAVE SLOW LEAK ADVISE	VALVE STEMS LEAKING REMOVED FOUR TIRES BROKE TIRES DOWN REMOVED OLD STEMS AND REPLACED STEMS AND AIRD TIRES UP TO 35 LBS 6161 W 1007AF .3 1007D1 .4 070 INSPECT TIRE REPLACED 1 FRONT TIRE MOUNTED & BALANCED TIRE SET TIRE PRESSURE REPLACED VALVE STEM SEALS OLD DOT CODE # N9WN F719 3906 X 1 NEW DOT CODE # N9WN F719 4606 X 1 FLAG 428
Replace	TIRE1 REPLACE ONE TIRE TO INCLUDE NEW STEM SEAL AND MOUNT AND BALANCE	VALVE STEM LEAKING REPLACED RIGHT FRONT VALVE STEM AND REBALANCED WHEEL
Leaks	CUSTOMER STATES THE R F TIRE HAD 10# OF AIR VERY LOW. ALL VALVE STEMS ARE CRACKED AND DR FRONT TIRE IS LEAKING FROM VALVE STEM	REPL ALL VALVE STEMS DUE TO BEING CRACKED CHECK FOR LEAKS AND FOUND VALVE STEM AROUND SEAT LEAKING, BREAK DOWN TIRE AND REPLACE VALVE STEM AND REBALANCE
Cracked		
Leaks	CUSTOMER STATES THE LEFT REAR TIRE IS LEAKING AIR AND LOW TIRE LIGHT IS ON	

		6749 LEAK CHECKED ALL TIRES FOUND VALVE STEMS HAVE A SLOW LEAK AND ARE CRACKED. REPLACED ALL FOUR VALVE STEMS AND RESET TIRE PRESSURES. LEAK CHECKED TIRES AGAIN. NO PROBLEM FOUND.
Cracked	CUSTOMER STATES TIRES LOSING PRESSURE AND FIND THAT VALVE STEMS ARE CRACKED DRY ROTTED	
Cracked	CUSTOMER STATES CHECK VALVE STEMS CRACKED	VALVE STEMS CRACKES REPLACED ALL 4 CHECK FOR LEAK HAD TO REPLACE VALVE PERFORM INSPECTION INSTALL 4 NEW VALVE STEMS BALANCE 4 TIRES
Leaks	L/F TIRE LOOSES AIR	TESTED ALL 4 WHEELS, VALVE STEMS LEAKING A CHROME AL WHEEL. BROKE DOWN ALL 4 TIRES, REPLACED VALVE STEMS, REBALANCED AND RETESTED.
Leaks	CUSTOMER STATES ALL TIRES LEAKING AT VALVE STEMS	REPLACER SPRING VALVE, COULLE CHECK PRESSURE LOW LOCATED VALVE STEM LEAKING WHEN INSPECTING REQUIRED TO REPAIR WITH REPLACEMENT VALVE STEM ASSY . DISMOUNT AND REMOUNT REBALANCE . PERFORM INSPECTION FOUND FAILED VALVE STEM IN LEFT FRONTWHEEL INSTALL NEW STEM AND BALANCE TIRE TIRE(S) DISMONT ALL FOUR TIRE TO REPLACE DRYROTTED VALVE STEMS COMPLETE LEAK TESTED FOUND VALVE STEM LEAKING AT LEFT WHEEL.REPLACED TIRE AND WHEEL.
TPMS light	CHECK LF TIRE LIGHT COES ON ONCE A WEEK HAS TO ADD AIR TO LF	
core	PNEU ARRIERE DROITE ***ETAIT A PLAT CE MATIN????	
Leaks	LOW PRESSURE ON RT FRONT TIRE WHEN CHECKED LOCATED VALVE STEM LEAK WILL REQUIRE TO REPAIR . NOTED WHEN PERFORMING SERVICE ON SATURDAY A:M	
Leaks	CUSTOMER STATES LEFT FRONT VALVE STEM LEAKING AIR	
Cracked	CUSTOMER STATES ALL VALVE STEMS ON TIRES ARE CRACKED	
Leaks	Replace tire CUSTOMER STATES THE LEFT FRONT TIRE WENT FLAT WHILE DRIVING	

		7359 RF VALVE STEM IS LEAKING. CHECKED TIRE PRESSURES AND RF ONLY HAS 20 PSI. CHECKED TIRE FOR LEAKS AND FOUND VALVE STEM LEAKING AT THE RIM. DISMOUNTED TIRE, REPLACED VALVE STEM AND REBALANCED TIRE. RECHECKED FOR LEAKS AND ALL OK. LOW TIRE PRESSURE WARNING LIGHT RESET ITSELF. MT TIME CHECKED AROUND RIM FOR LEAKS,CHK VALVE STEM FOR LEAKS,VALVE STEM FOUND TO BE
TPMS light	TIRE PSI WARNING LIGHT IS ON	
Leaks	CHK CONCERN WITH LEFT REAR TIRE FLAT	LEAKING.REPLACED VALVE STEM.RECHK ALL OK.
Leaks	SLOW LEAK IN TIRE	DIAG SLOW LEAK. SUBLET TO TAZ TIRE FOR REPAIR. FOUND FAULTY VALVE STEM CUASING THE PROBLEM.
Leaks	CUSTOMER STATES ALL FOUR VALVE STEMS LEAKING	TIRE AND WHEEL BALANCE VERIFY CONCERN FOUND ALL FOUR VALVE STEMS LEAKINGINSTALL NEW VALVE STEMS BALANCE WHEELS TIRE(S) OR WHEEL(S)
Cracked	CUSTOMER STATES RIGHT FRONT AND LEFT REAR VALVE STEMS CRACKED	REPLACE INSTALL NEW VALVE STEM IN RIGHT FRONT AND LEFT REARPER INSPECTION CHECKED BOTH FRONT WHEEL VALVE STEMS,BREAK DOWN BOTH FRONT TIRES AND INSTALLED NEW VALVE STEMS
Replace	INSTALL NEW VALVE STEMS IN BOTH FRONT TIRES	IN BOTH FRONT TIRES AS NEEDED.
Leaks	CUSTOMER STATES THAT THE DRIVER REAR TIRE IS LOOSING AIR EVERY OTHER DAY	VERIFIED REAR TIRE LOOSING AIR FOUND LEAK AT VALVE STEM NEC TO REPLACE LEAKING VALVE STEM RETEST NO LEAKS 1700 CC D8
TPMS light Replace	TIRE PRESSURE LIGHT IS ON FOUND TIRE FLAT, PLEASE ADVISE	CHECK OVER RE+RE R.F. TIRE AND REPLACE VALVE REPLACED VALVE STEM INSPECTED AND INSTALLED NEW VALVE STEM
Leaks	CHECK FOR TIRE LEAKING AIR	MISC OTHER VALVE STEM

Cracked		8426 REPLACED ALL 4 VALVE STEMS AND MOUNTED AND BALLANCED WHEELS. PUT SPARE TIRE BACK IN REAR HOLDER
Cracked	CUSTOMETR HAD FLAT TIRE ALL 4 VALVE STEMS CRACKING	REMOVE LEFT FRONT TIRE AND REPLACE LEAKING VALVE STEM, RESET TIRE PRESSURE SYSTEM.
Leaks	CUSTOMER STATES RIGHT FRONT TIRE VALVE STEM LEAKING.	
Broken	Replace tire	CUSTOMER ASKING FOR A REIMBURSMET FOR VALVE STEMS SNAPPED AND CAUSED BLOW OUT ON TIRE ALSO LOST WORK AS A POLICEMAN FOR A DAY DUE TO LOSS OF VEHICLE MILAGE SHOULD READ 10076
Leaks	CHECK VALVE STEM SNAPPED CAUSING TIRE TO RUPTURE CHECK RIGHT FRONT TIRE HAS LEAK	REPLACE RIGHT FRONT TIRE VALVE STEM 1700 LOOSE INSPECT TIGHTEN LOOSE LFT FRT TIRE VALVE STEM RESET TIRE MONITOR SYSTEM
TPMS light	CHK AND ADV CUST STATES THE LOW TIRE PRESSURE LIGHT IS ON.	CHECKED AND FOUND VALVE STEM LEAKING,REPLACED DEFECTIVE VALVE STEM.INSTALLED TIRE ON LEFT REAR,RE INSTALLED SPARE
Leaks	CUSTOMER REPORTS LEAK IN ONE OF THE TIRES, CHECK AND ADVISE TIRE IS	REPL RUSTED ALL 4 VALVE STEM NUTS
Leaks	CUSTOMER STATES METAL NUTS AT VALVE STEM BASE ARE RUSTY CCC B65 REPORTS ADDING AIR TO R F TIRE EVERY 2 3 DAYS	1 REMOVED VALVE STEM AND REPLACED.
Cracked	VALVE STEMS ARE CRACKED	ALL FOUR VALVE STEMS WERE CRACKED. REPLACE ALL FOUR VALVE STEMS.
TPMS light	LOW PRESSURE TIRE LIGHT STAYING ON	TIRE NOT SET AT FORD SPECS. RESET ALL 4 TIRES TO 35 PSI TEST DROVE LIGHT OUT PERFORM INSPECTION VERIFY CONCERN FOUND ALL FOUR VALVE STEMSCRACKED AT BASE INSTALL NEW VALVE STEMS ALL FOUR WHEELS COMPLETE
Cracked	CUSTOMER STATES ALL FOUR VALVE STEMS DRY ROTTED AND CRACKED AT BASE OF STEM	



		LEAK CHECK ALL 4 TIRES VERIFIED VALVE STEMS LEAKING LEFT FRONT TIRE DAMAGED DUE TO INSUFF TIRE PRESSURE REPLACED 3 VALVE STEMS MOUNT AND BALANCE 1 TIRE
Leaks	LEFT FRONT TIRE FLAT TIRES KEEP LOOSING AIR	
Leaks		CLOSEST LABOR OP TO REPLACING 2 VALVE STEM SEALS DUE TO LEAKING 7389 TIRE PRESSURES WERE ALL AT OPTIMUM LEVELS. CHECKED FOR LEAKS ON ALL TIRES AND FOUND NO PUNCTURES 8017 RESET TIRE PRESSURES AND TEST DROVE VEHICLE 8017
TPMS light	CUSTOMER REPORTS THAT TIRE PRESSURE LIGHT IS ON.PLEASE CHECK AND ADVISE.	
Replace	CHECK PASSENGER REAR TIRE HAS DIFFERENT VALVE STEM	REPLACED TIRE VALVE STEM PERFORM INSPECTION FOUND 3 VALVE STEMS CRACKED MOUNT AND BALANCE3
Cracked	CUSTOMER STATES 3 VALVE STEMS CRACKING AT WHEEL BASE	WHEELS INSTALL NEW VALVE STEMS
		15525 DIAG. FOR TIRE MONITOR LIGHT ON. QUICK TEST, B2872, PID MONITOR TIRE MONITOR DATA, PERFORM PINPOINT TESTS. ATTEPT TO TRAIN TIRE SENSORS. LEFT REAR WHEEL SENSOR NOT RESPONDING. REPLACE LEFT REAR WHEEL SENSOR, REPLACE VALVE STEM, REASSEMBLE, RETEST. WHEEL SENSOR IS NOW RESPONDING TO SCAN TOOL. WHILE CHECKING TIRE PRESSURES FOUND ALL VALVE STEMS DRY ROTTED. FOUND ALL FOUR VALVE STEMS LEAKING BECAUSE OF WEATHER CRACKS BROKE DOWN ALL FOUR WHEELS AND INSTALLED NEW VALVE STEMS INSTALLED 1 NEW TIRE PRESSURE SENSOR BAND. QC BY TRENT
Dry rotted	CUSTOMER STATES TIRE LIGHT COMES ON	FAILURE OF VALVE STEM.
Cracked	CUSTOMER STATES ALL FOUR TIRES LOSING AIR SLOW LEAK	REPLACE VALVE STEM.
Leaks	LEFT FRONT TIRE FLAT.	

TPMS light	TIRE PRESSURE LIGHT IS ON	539 DIAG LOW TIRE PRESSURE LAMP ON,SELF TEST SYSTEM,NO CODES.PINPOINT TESTS E FOUND L R TIRE AT 28 PSI.LEAK CHECK TIRE,VALVE STEM LEAKING AT RIM REMOVE TIRE FROM RIM AND REPLACE VALVE STEM,REINSTALL AND TEST DRIVE LAMP IS OFF
Leaks	DIAG & ADVISE TIRE PSI LIGHT IS ON.	DIAGNOSE, FOUND RIGHT REAR TIRE TO BE LOW VALVE STEM LEAKING. REPLACED VALVE STEM & TORQUED WHEEL TO 150 FT LBS.
Cracked	CUSTOMER STATES TIRE VALVE STEMS ARE CRACKING	NEEDS NEW VALVE STEMS REPLACED SUBLET TO HERMISTON TIRE INV#1 24121 P.O.30147
Leaks	PASSENGER FRONT TIRE HAS SLOW LEAK PLEASE CHECK	9330 CUST STATES RF TIRE LOSING AIR VERIFIED CONCERN FOUND VALVE STEM TO HAVE A SLOW LEAK REMOVED TIRE FROM RIM REPLACED VALVE REMOUNTED AND RE BALANCED TIRE VALVE STEM WAS LOOSE IN THE WHEEL.LEAKING AIR BODY CHASSIS ELECTRICAL PIN POINT TEST DIAGNOSIS.. VERIFIED THE COMPLAINT. TESTED THE TIRE PRESSURE MONITORING SYSTEM.FOUND THE LEFT REAR TIRE TO BE LOW.. FOUND THE VALVE TO BE LOOSE IN THE WHEEL.
TPMS light	CUSTOMER STATES THAT THE ORANGE EXPLANATION POINT LIGHT IS ON	TIGHTENED UP STEM AND Aired up tire and RESET MONIT
Cracked	REFUND FOR TIRE VALVE STEM	SPARE TIRE VALVE STEM CRACKED REPLACED VALVE STEM
Leaks	C S DRIVER SIDE FRONT TIRE,LOOSE AIR EVERY 24 HRS,CHECK HIST REPAIR	9950 INSPECTED TIRE FOR LEAK FOUND VALVE STEM TO BE LEAKING BROKE DOWN TIRES & INSTALLED NEW VALVE CORE REMOUNTED TIRES & BALANCED CHECKED VALVE STEM FOR LEAKS PASSED OK T005T

Cracked	LEFT REAR AND BOTH RIGHT SIDE VALVE STEMS ARE CRACKED.	REPLACED ALL 4 VALVE STEMS ON VEHICLE TO COREECT CONCERN 30184 R R TIRES R R VALVE STEMS INSTALLED NEW RETRAINED SENSORE
Cracked	C S ALL FOUR VALVE STEMS ARE CRACKING AT BASE H62	RETESTED CHECK OK AT THIS TIME LT FRT TIRE BEED & V STEAM LKING
Leaks	CUSTOMER STATES THE LEFT FRONT TIRE,NEEDS TO KEEP ADDING AIR ,,ADVISE	INST.NEW VALVE STEAM & REINDEX TIRE SERVICE TO SPEC.35 PSI & BALAN
Leaks	CHECK RR TIRE VALVE STEM LEAKS CHECK AND ADVISE RT REAR TIRE GOING DOWN	REPLACED LR VALVE STEM. SET TIRE PSI. REMOUNTED WHEEL
Replace	TIRE IN SPARE RACK FLAT TIRE IN BACK SEA T TO MOUNT AND BALANCE	REPLACE VALVE STEM IN 1 TIRE REPLACE TIRE IN TRUNK AND BALANCE
TPMS light	CK REPAIR LOW TIRE LITE ON	I D S TEST L H REAR WHEL SENSOR DO PINPTS REPLACE TIRE VALVE STEM LEAKING R ESET ALL ROAD TESED OK VERIFIED CONCERN. INSPECTED AND REPLACED 4 LEA KING TIRE VALVES. REPLACED AND RECHECKED O.K.
TPMS light	TIRE LIGHT ON CHECK	29015 CHECK LIGHT TEST SYSTEM FOR CODES CHECK RIGHT FRONT LOW TRACE LEAK R&R TIRE DISMOUNT REPLACE VALVE STEM LEAKING REASSEMBLE TRAIN SENSORS RECHECK O.K.
TPMS light	LOW TIRE WARNING LIGHT ON	
Replace		REPLCE RIGHT FRONT VALVE STEM REPLACE RIGHT FRONT VALVE STEM R AND R RF DEFECTIVE VALVE STEM WPI
Cracked	CUST STS L F TIRE LEAK AIR FROM VALVE STEM CHK ALL VALVE VALVE STEMS SEEM TO BE CRACKING	VERIFIED CUST CONCERN L F VALVE STEM LEAKING AND ON INSP FOUND ALL VALVE STEMS CRACKING AND DRY ROTTED REPLACED ALL 4 TIRE VALVE STEMS VERIFIED REPAIR

Broken	RIGHT REAR TIRE LOST AIR PRESSURE	9884 CK RF TIRE VALVE STEM BROKEN REMOVE TIRE FOUND SENSOR STRIAP BROKEN CAUSE OF FLAT TITRE INSTALLED STEM AND STRIP BALANCE TIRE RESET TIRE LITE
TPMS light	REPAIR TIRE PRESSURE LIGHT WILL NOT GO OFF STAYS ON ALL THE TIME	TIR PRESSURE TEST LIGHT ON AND GO ON AND OFF TEST PIN POINT TEST REPROGRAM TIRE MONITOR ROAD TEST O K
TPMS light	CUST STATES THAT THE LOW TIRE INDICATOR IS ON	VALVE STEM ON LEFT FRONT TIRE IS COMING OFF R AND R VALVE STEM ON LEFT FRONT TIRE
Replace	ALL FOUR VALVE STEMS COMING APART	DEFECTIVE R R ALL FOUR TIRES,DISMOUNT AND REPLACE VALVE STEMS
Cracked	CHECK REASON WHY TIRES LEAKING DOWN	3 VALVE STEMS LEAKING FROM CRACKED SIDES. DIAG FOUND LT & RT FT AS WELL AS LT REAR VALVE STEMS
Cracked	CUST STATES DS FRONT TIRE HAS SLOW LEAK AND OTHER TIRES HAVE CRACKED VALVE STEMS	CRACKED(DRY ROTTED) AND LEAKING AIR CAUSING TIRES TO GO FLAT,REPLACED R VALVE STEMS & REBALANCED WHEEL/TIRES.
Cracked	N24 CUST STATES VIBRATION WHILE DRIVING FROM TIRES	VALVE STEMS CRACKED 10380 ORDERED PARTS ORDERED 2 WHEELS 10 2 07 REPLACED SPECIAL ORDERED PARTS INSTALLED TIRE MONITORS TECH 330
Cracked	VALVE STEM LEAKING AIR 2 FRONT WHEELS	18326 DISMOUNT FRONT TIRES AND REPLACE BOTH CRACKED VALVE STEMS REBALANCE TIRES
Leaks	CUSTOMER STATES THEY HAVE A FLAT TIRE	14654 CHECKED CUSTOMERS CONCERN AND REPLACED VALVE STEM (BROKE TIRE DOWN AND REPLACED) COMPLETE,REPLACED ALL
Cracked	VALVE STEMS ARE CRACKING	FOUR VALVE STEMS.120 COMPLETE,FOUND ALL FOUR
Dry rotted	TIRE REPAIR VALVE CONCERN PUT BACK ON CAR HAS SPARE ON	VALVE STEMS ROTTEN,REPLACED ALL.120

Cracked	VALVE STEMS ARE ALL CRACKED	BROKEN TIME TO REMOVE TIRES AND REMOVE AND REPLACE ALL 4 VALVE STEMS. RES VERIFIED CONCERN. INSPECTED AND REPLACED LEAKI NG LEFT FRONT WHEEL TIRE VALVE. REPLACED AND RECHECKED O.K.
Leaks	CHECK LT FRT TIRE SLOW LEAK CUST WAS DRIVING AND RIGHT FRONT TIRE LOST AIR, BY THE TIME CUSTOMER WAS ABLE TO PULL OVER AND HAVE TIRE CHECKED FOUND AIR LEAKING FROM BASE OF VAVLE STEM AMD TIRE WAS DAMAGED	8104 1007AF 0.3 MOUNT AND BALANCE 1 NEW TIRE.INSPECT ALL TIRES AND FOUND ALL VALVE STEMS CRACKED.REPLACE ALL VALVE STEMS.
Cracked	Replace tire	
Dry rotted	CUSTOMER STATES ALL TIRES ARE LOSING AIR FROM DRY ROTTED VALVE STEMS. ALL APPEAR TO BE MUCH TOO LONG. COMPARE TO OTHERS ON LOT. PLEASE REPLACE ALL AS NEEDED. CHECK AIR LEAK @ LEFT FRONT TIRE	6365 AIR LEAKS. 110 INSPECT ALL VALVE STEMS. ALL DRY ROTTED. REMOVE ALL 4 TIRES TO REPLACE ALL VALVE STEMS. RETRAIN ALL 4 TIRES. TO SHUT LITE OFF. ROAD TEST.
Leaks		BAD BEAD INSPECTED REMOVED TIRE AND WATER TESTED FOUND BEAD LEAKING..BROKE DOWN TIRE..BEAD SEALED RETESTED OK
Leaks	PASS REAR TIRE FLAT	REPL LEAKING LEFT TIRE VALVE STEM
Valve loose	LEFT FRT TIRE LEAKING AIR CHECK PASS FRT TIRE LOOSE	REPLACE LOOSE VALVE STEM RELEARN ADJUST AIR PRESSURE AND RETRAIN ALL WHELL SENSORS
TPMS light	LOW TIRE LIGHT ON	PERFORM INSPECTION FOUND RIGHT FRONT AND RIGHT REAR TIREVALVE STEMS CRACKED AT BASE INSTALL NEW STEMS
Cracked	CUSTOMER STATES VALVE STEMS CRACKING AT BASE OF WHEEL	BOTH WHEELS AND RE BALANCE COMPLETE
core	LOW TIRE PSI LIGHT STAYS ON AT ALL TIMES .	VERIFIED TPS SENSOR FOUND RIGHT REAR TIRE A LITTLE LOW TOPPED OFF AND OK,RECOMMEND CHECKING FOR SLOW LEAK,CHECKED TIRE FOUND VAVLE STEM CORE LOOSE TIGHTEND AND OK,

Cracked	ALL VALVE STEMS CRACKING	REPLACED VALVE STEMS ON LEFT FRONT,RIGHT FRONT AND RIGHT REAR TIRES.
Leaks	RIGHT FRONT TIRE HAS A SLOW LEAK CHECK & REPORT	REPLACED LEAKING VALVE STEM & ADJUSTED TIRE PRESSURE TO 35 PSI & CONFIRMED REPAIR
Cracked	ALL 4 VALVE STEMS ARE CRACKED AND LEAKING AIR ARE CRACKED AND LEAKING AIR CUSTOMER STATES THAT LEFT FRONT TIRE LOSING AIR AGAIN, JUST PUT TIRE ON	FOUND 4 VALVE STEMS LEAKING,DISMOUNTED TIRES,REPALCED STEMS,REMOUNT AND BALANCED
Leaks	CUSTOMER STATES THE LEFT REAR TIRE KEEPS LOOSING AIR	REPLACED VALVE STEM IN LEFT FRONT TIRE
Leaks		REPLACED VALVE STEM AND BALANCED TIRE
Leaks	CUST STATES TIRE LEAK	4014 INSPECTED FOUND RR TIRE LEAKING FOUND VALVE STEM LEAKING STEM POURICE. REMOVED TIRE AND REPLACED VALVE STEM REBALANCED TIRE CHECK AND REPLACE LEAKING VALVE STEM ON RIGHT REAR TIRE
Leaks	CUSTOMER STATES LOW TIRE PRESSURE LIGHT ON	CHECK AND FOUND VALVE STEM LEAKING.REMOVE WHEEL DISMONT TIRE REPLACE VALE STEM.MOUNT AND BALANCE TIRE RECHECK OK AT THIS TIME.
Leaks	CUSTOMER COMPLAINS OF PASSENGER SIDE FRONT TIRE HAS BEEN GOING DOWN EVER SINCE CUSTOMER BOUGHT VEHICLE HAS TO KEEP ADDING AIR	7465 FOUND LEFT FRONT VALVE STEM LEAKING R+R LEFT FRONT VALVE STEM,CHECK OPER. OK
Leaks	CUSTOMER STATES L F TIRE IS LOOSING AIR	REMOVED TIRE, REPLACED VALVE STEM, RE SEALED TIRE.WPI
Replace	L F TIRE GOES FLAT	INSPECT,REPLACE LEAKING VALVE STEM
Leaks	CHECK RIGHT REAR TIRE FOR LEAK	11357 REPAIRED L R TIRE(VALVE STEM LEAKING)
Leaks	INSPECT FOR LOW TIRE LIGHT KEEPS COMEING ON REPORT	SET ALL TIRES PRESS 30 PSI
Replace	CHECK TIRE WENT FLAT ALSO CHECK RIGHT FRONT SLOW LEAK CK C.S VALVE STEMS CRACKED & LEAKING	VERIFIED CONCERN AND REPLACED RIGREPLACE VALVE STEM AND RECHECK OK
Cracked		REPLACED ALL 4 VALVE STEMS

Leaks	CHECK TIRES HAVE SLOW LEAKS	REPLACE THREE VALVE STEMS FOUND ALL 4 VALVE 1700 STEMS CRACKED AND LEAKING, DISMOUNTED ALL 4 TIRES,
Cracked	CUST STATES LOW TIRE PRESSURE LIGHT COMES ON VALVE STEMS LOOK TO BE DRY AND CRACKING	REPLACED ALL 4 VALVE STEMS, REBALANCED ALL 4 TIRES, ROAD TEST
TPMS light	CHECK TIRE LIGHT ON	VERIFIED TIRE LIGHT ON,CHECKED ALL TIRE PRESSURES.FOUND R.R.TIRE PRESSURE LOW.FOUND VALVE STEM LEAKING.REPLACED VALVE STEM,RESEALED TIRE & BALANCED.PROGRAMMED TIRES,TESTED,O.K. OSP REPRESENTS VALVE STEM REQUIRED TO REPAIR TIRE 7097 FOUND LEAKING
Leaks	DRIVERS SIDE FRONT TIRE SEEMS LOW	REPLACED STEM TESTED OK AT TIS TIME
Leaks	CUSTOMER STATES TIRES LOOSING AIR THROUGH VALVE STEMS CHECK AND ADVISE	15590 VERIFY CONCERN YES REPLACED FOUR VALVE STEM CC 42 CP 1700 CHECK TIRE PRESSURES R.R. TIRE IS LOW. CHECK R.R. TIRE FOR LEAKS FOUND LEAK AROUND VALVE STEM. RESEAT VALVE STEM. RECHECK FOR LEAKS OK.
TPMS light	LOW TIRE PRESSURE LIGHT COMES ON.	VERIFIED LOW TIRE PRESSURE LIGHT IS ON HOOKED UP TO TDS TO MONITOR PID FUNCTION PERFORMED LEAK TEST FOUND FAULTY VALVE STEM ON RIGHT REAR WHEEL REPLACED VALVE STEAM RETESTED ALL OK CHECK AND VERIFIED CONCERN, MTIME TO RESECURE VALVE STEM, FOUND TO HAVE POOR FIT. RETESTED ALL OK.
TPMS light	CUSTOMER STATES LOW TIRE LIGHT KEEPS COMMING ON	REPLACED VALVE STEAM RETESTED ALL OK CHECK AND VERIFIED CONCERN, MTIME TO RESECURE VALVE STEM, FOUND TO HAVE POOR FIT. RETESTED ALL OK.
Leaks	CUST STS RR VALVE STEM IS LOOSING AIR.	REMOVED THE TIRES AND RESECURED THE VALVE STEMS SECURE VALVE STEMS
Leaks	CUSTOMER STATES BOTH FRONT AND PASSENGER OUTER REAR TIRE KEEPS GOING LOW ON PRESSURE.	REMOVED THE TIRES AND RESECURED THE VALVE STEMS SECURE VALVE STEMS

Cracked		CUSTOMER STATES LEFT FRONT TIRE IS FLAT. INSTALLED SPARE. CHECK ALL TIRES FOR ISSUES.	CHECKED VALVE STEMS. FOUND VALVE STEMS SPLITTING NEAR RIM. REMOVED AND REPLACED 4 VALVE STEMS. BALANCED TIRES, REAR VALVE STEMS CRACKING. LEAKING AIR. REPLACED REAR VALVE STEMS.
Cracked		REAR VALVE STEMS CRACKING, LEAKING AIR	
Leaks		AIR LEAKING FROM VALVE STEM	1700 H26 42 VERIFIED CUSTOMER CONCERN FOUND PASSENGER SIDE FRONT TIRE LEAKING AT VALVE STEM DISMOUNTED AND REOMED OLD VALVE STEM INSTALLED NEW VALVE STEM REMOUNTED TIRE AND REBALANCED TIRE CHECKED NO LEAKS FOUND OK COMPLETED 9603 CC42 CP1007 1007ABT .5 50 FLAG 125 .5 REPLACED 2 REAR TIRE MOUNT AND BALANCE
Replace		TIRE2 REPLACE REAR TIRES HAVE BUBBLE WEAR  CUST STATES THAT RT FRT TIRE IS LOOSING AIR	WARANTY DOT CODES PSXV46MB2707 7645 NO LEAKS FOUND. .4 DISMOUNTED TIRE AND CHECK INSIDE. REPLACED VALVE STEM. SET TIRES AT 35 PSI. 1 VERIFIED CONCERN, ADJUSTED PSI, FOUND BAD VALVE STEM, REPLAC VALCE STEM, RETRAIN SENSORS, RETEST
TPMS light		CUSTOMER STATES TIRE PRESSURE LIGHT IS ON	PASS REAR TIRE VALVE STEM SPLIT CAUSING TIRE TO GODOWN ALL AT ONCE SIDEWALL OF TIRE BROKEN DOWN NEC ESSARY TO REPLACE DAMAGED TIRE DUE TO VALVE STEM SPLITTING NEW TIRE DOT N9EKF6614906 OLD DOT N9EKF6614406
Cracked	Replace tire	CK LOW TIRE LIGHT ON	
Cracked		TIRES ARE LOOSING AIR	VALVE STEMS CRACKED AND LEAKING REPLACED THREE VALVE STEMS.120



		6013 FOUND LEAK IN RIGHT FRONT TIRE FOUND VALVE STEM LEAKING AIR REMOVE TIRE REPLACE VALVE STEM
Leaks	RIGHT FRONT TIRE LOSING AIR	REMOUNT TIRE AND BALANCE
Leaks	FRONT DRIVER SIDE TIRE LOSING AIR SENSOR GOES OFF EVERY 2 WEEKS!	CHECK TIRE/RE AND RE AND REPLACED CORE(HAD SLOW LEAK) CHECK BALANCE. CHECKED LEFT FRONT TIRE, DIAGNOSED LEAKING VALVE STEM REPLACED LEFT FRONT VALVE STEM AS REQUIRED TO CORRECT SLOW LEAK CONCERN DESCRIBED
Leaks	CHECK LEFT FRONT TIRE FOR POSSIBLE SLOW LEAK?	26316 REPLACE VALVE STEM ON LEFT FRONT TIRE
Leaks	CK FOR VALVE STEM LEAKING	LEAK CHECK TIRE REPLACE VALVE STEM REMOUNT AND BALANCE TIRE
Leaks	CUSTOMER STATES RIGHT FRONT TIRE LOW	REMOVE TIRE FROM RIM AND REPLACE BROKEN VALVE STEM.
Cracked	REPAIR FOR LEFT REAR VALVE STEM CRACKED	
Leaks	CUSTOMER STATES CHECK VALVE STEM RIGHT SIDE FRONT LEAKS AIR	CHECK REPLACE RIGHTFRONT WHEEL VALVE STEM
Leaks	CUSTOMER STATES LEFT FRONT TIRE GOES LOW.	FOUND LF TIRE VALE STEM CORE LEAKING AIR. REPLACED LF VALVE STEM CORE ROAD TEST TO VERIFY CONCER, R&R REAR TIRES, FOUND LOW AIR, STEMS LEAKING. BREAK DOWN REAR TIRES, REPLACE BOTH STEMS, RE ROAD TEST, PASS CRACKED VALVE STEM
Leaks	C S BOTH REAR TIRES ARE CONTINUOSLY LOOSING AIR	
Cracked	CHECK DRIVERS SIDE FRONT VALVE STEM IS CRACKED AND IS LOOSING AIR	TIRE(S) OR WHEEL(S) (TWC01 1007 1015) REMOVE AND REINSTALL
	TIRE LOW PRESSURE LIGHT IS ON	5757 FOUND LEFT REAR TIRE LOW RESEALED RIM AND RESET LIGHT
Leaks	CHECK CAUSE LEFT REAR TIRE WAS FLAT ROADSIDE ASSISTANCE INSTALLED SPARE	TWC01 / TB6 / D1 1007AB .3 TRACED CAUSE OF AIR PRESSURE LEAK TIRE LEAK AT VALVE STEM REPLACED VALVE STEM REINSTALLED ON VEHICLE
Leaks	FRONT PASSENGER TIRE HAS A LEAK.	VERIFY CONCERN, REPLACED WHEEL VALVE STEM

		CUSTOMER STATES VIBRATION AT HWY SPEEDS. INSPECTED. CK TIRE PRESSURE. RIGHT FRONT TIRE LOW. LEAK AT VALVE STEM. REPLACED VALVE STEM AND RESET TIRE PRESSURE AND TIRE LIGHT. RETESTED OK.
Leaks	N25 VIBRATION AT HWY SPEEDS	CK TIRES PRESS GOOD
	CUSTOMER STATES LOW TIRE LT ON SMELL LIKE SOMETHING WAS BURNING	PERFORMED PINPOINT TEST RESET ALL 4 SENSORS FINAL TEST PASSED
		CHECKING TIRES ALL LOW ? CHECKED FOR LEAKS, FOUND VALVE STEMS LEAKING.
TPMS light Dry rotted	LOW TIRE WARNING LIGHT ILLUMINATED ON DASH VALVE STEMS DRY ROTTED RIGHT FRONT AND LEFT REAR	REPLACING 4 VALVE STEMS, RELEARN TIRE MONITORS. 1 REPLACED VALVE STEMS
Leaks	TIRES HAVE SLOW LEAKS DRIVERS FRONT VALVE STEM	REPLACED 3 VALVE STEMS
Cracked	CRACKED	REPLACED VALVE STEM CHECKED/CONFIRMED/HAD A BAD VALVE STEM REPLACED VALVE STEM/RECHECKED/OK AT THIS TIME
Leaks	C/S L/R TIRE HAS A SLOW LEAK CHECK & ADVISE	REPLACED ALL VALVE STEMS AND RESEAL TIRE BEARDS TO FIX
Leaks	C S ALL TIRES LEAKING AIR	1 INSP, REPLACE 4 VALVE
Cracked	CUST STATES RUBBER ON VALVE STEMS CRACKING	STEM
Leaks	CUSTOMER STATES THE LEFT FRONT TIRE IS FLAT	FLAT TIRE TIRE AND WHEEL BALANCE CHECKED FOR CS CONCERN AND FOUND LEFT FRONT VALVE STEM FAULT REPLACED VALVE STEM AND CHECKED ALL TIRES ALL OK
Broken	CS STATES THAT VALVE STEM BROKE ON TIRE WHEN PUTTING AIR IN	12789 INSPECTED VALVE STEM FOUND ALL FOUR CRACKED AND DRY ROTTED BROKE DOWN ALL FOUR TIRES
Cracked	OWNER STATES THAT OSR STATES ALL VALVE STEMS ARE CRACKED CHECK AND ADVISE	REPLACED VALVE STEMS REINSTALLED TIRES SET TIRE PRESSURES AND BALANCED LEFT FRONT TIRE LOSING AIR
Leaks	TIRE IS LOSING AIR	REPLACE VALVE STEM LEAK AT VALVE STEM
Leaks	RT FRT TIRE LOOSE AIR WENT FLAT	REPLACE VALVE STEM RT FRT TIRE

Leaks	L.R. OUTSIDE TIRE HAS LEAK	REPAIRED LEFT REAR TIRE REPLACED VALVE STEM , RESEALED TIRE LOSING AIR
TPMS light	C.S.: LOW TIRE PRESSURE LIGHT ON	REPLACE VALVE STEM DEFECTIVE FROM FACTORY
Leaks	TIRE LOSES AIR. CUST STATES FRONT RT TIRE	VALVE STEM CORE DEFECTIVE. REPLACE VALVE STEM. FOUND VALVE STEM SEEPING AIR. REPLACED VALVE STEM
Leaks	LOSES AIR	17000 42 CHECKED TIRE FOR LEAK. BROKE DOWN TIRE & REPLACED LEAKING VALVE STEM. RECHECKED.
Leaks	CUST STS THE RIGHT REAR TIRE HAS SLOW LEAK CONTI P245 60 R18	REMOVED GOOD TIRE FROM SPARE REMOUNT SPARE R&R 3 VALVE STEMS REMOUNT 3 TIRE RECHECK OK
Cracked	BOTH REAR TIRE VALVE STEMS CRACKED RIGHT FRONT CRACKED AND LEAKING	
Leaks	C S DRIVERS SIDE FRONT TIRE LEAKING AIR OUT OF THE STEM CUST STATES THAT DRIVERS SIDE FRONT TIRE HAS A SLOW LEAK	CHECK TIRE FOR LEAK FOUND VALVE STEM FAULTY REPLACED RECALIBRATE SENSORS ROAD TEST ALL OK F
Leaks		REPLACED VALVE STEM FOUND LF VALVE STEM LOW. REPLACED LF VALVE STEM, NO LA OP FOR VALVE STEM FOUND.
Leaks	CUSTOMER STATES CHECK TIRE FOR LEAK LF LOW.	
Leaks	RIGHT FRONT TIRE KEEPS GOINF FLAT.VALVE STEM LOOKS BAD.VALVE STEM ON THELEFT FRONT WAS BAD AND HAD TO BE REPLACED. LOOK AT THE REAR STEMS ,THEY LOOK BAD ALSO LIKE THE CUSTOMER GOT A DEFECT	CHECK FRONT RIGHT WHEEL FOR LEAKS REPLACED VALVE STEM CHECKED AND REPLACED LEFT REAR VALVE STEM REMOVE TIRE REPLACE VALVE STEM LETIME TO REPAIR LEAKING VALVE STEM REPLACED TWO VALVE STEMS WITH NEW ONES,TIRES CORRECTLY HOLD AIR
TPMS light	TIRE PRESSURE LIGHT IS ON	
Leaks	CHECK TIRE LEAKS	
Leaks	CS HE HAS TO ADD AIR TO TIRES EVERY FEW DAYS	
Leaks	CUSTOMER STATES LEFT REAR TIRE WENT FLAT	LEFT REAR VALVE STEM LEAKING AIR REPLACED VALVE STEM UNDER 12 12 WARRANTY

Cracked	ALL TIRES GOING FLAT. VALVE STEMS CRACKED AND LEAKING. ADVISE	BROKE DOWN ALL FOUR TIRES REPLACE VALVE STEMS BALANCE TIRES MC
Cracked	VALVE STEMS HAVE SPLITS IN THEM	REPLACE ALL VALAVE STEMS
TPMS light	LOW TIRE LIGHT ON / RIGHT REAR GOES LOW	RE AND RE TIRE FROM RIM AND CLEAN BEADS REBALANCE TIRE. REPL LEAKING VALVE STEM. NO OPERATION NUMBER, USED ACTUAL TIME FAIRE TEST APPROPRIES, REMPL.LA VALVE DU PNEU AV. GAUCHE ET BALANCER
TPMS light	VERIFIER LUMIERE DE PNEUS ALLUME , WAIT CS WASHERS ON VALVE STEMS RUSTED	AJUSTER PRESSION, CLEAR CODE & RETEST OK RUSTED FROM FACTORY REPL WASHERS
Cracked	Replace tire	CUSTOMER STATES WHILE DRIVING LOW TIRE PRESSURE LIGHT CAME ON PULLED OVER AT SAFE PLACE TIRE WAS FLAT AND SIDE DAMAGED HAD TIRE REPLACED SERVICE CENTER NOTED FAILED VALVE STEM CAUSED TIRE
TPMS light	CUSTOMER STATES: THE LOW TIRE PRESSURE LIGHT IS ON	INSPECTED TIRES ALL 4 VALVE STEMS CRACKED REPLACE ONE TIRE AND 4 VALVE STEMS. CUST REQUEST REFUND EMERGENCY REPAIR
Leaks	VEHICLE HAS FLAT TIRE.	LOW TIRE PRESSURE LIGHT ON FOUND LEAKING VALVE STEM FOUND LOW TIRE CAUSED BY LEAKING VALVE
Leaks	AIR LEAK AT LEFT REAR VALVE STEM	STEM...REPLACE STEM...SET TIRE PRESSURE...LIGHT OFF. 3443 LEAKING VALVE STEM REPLACED THE VALVE STEM, REINSTALLED TIRE AND REINSTALLED SPARE TIRE AND JACK.
Leaks	CUSTOMER STATES R F VALVE STEM LOSING AIR HE CHECKED IT AND IT IS LEAKING	VALVE STEM LEAKING DISMOUNT TIRE TO REPLACE LEAKING VALVE STEM REBALANCE AND REINSTALL CONFIMED LEAKING VALVE STEM ON P S FRONT WHEEL R
Leaks	PASS FRONT TIRE HAS LEAKING VALVE STEM	R VALVE STEM ON P S FRONT WHEEL RETEST OK AT THIS TIME
Leaks		REPLACED VALVE STEM

Cracked	TIRE VALVE STEMS SPLITTING ON SIDES	WHEEL VALVE STEMS TIRE(S) OR WHEEL(S) REPLACE
Leaks	L R TIRE WENT FLAT SINCE MAINT DONE ON RO 231418 1.10.08 16794 MILES #73 ADVISE	16654 1007D3B 0.5 FOUND LEFT REAR TIRE LEAKING AIR AT VALVESTEM DISMOUNTED TIRE INSTALLED NEW VALVESTEM AND CORE REMOUNTED TIRE BALANCED AND INSTALLED ON VEHICLE ROAD TEST OK NO LEAK FOUND QC 58
TPMS light	LOW TIRE LIGHT ON WILL NOT RESET PER CUSTOMER	LOW AIR PRESSURE ACCESS AND ADJUST AIR PRESSURE IN ALL TIRES
TPMS light	CUSTOMER STATES CHECK TIRE FOR LEAK TIRE PRESSURE LIGHT IS ON.	CHECK ALL TIRE PRESSURES AND INSPECT RIGHT FRONT TIRE FOR LEAKS.FOUND VALVE STEM LEAKING. REPLACE RIGHT FRONT TIRE VALVE STEM AND CHECK BALANCE. RE SET TPS SYSTEM.
TPMS light	INDICATEUR DE PRESSION PNEU ALLUME	INDICATEUR DE PNEUS RESET OK VERIFIER PNEUS ARR G 20PSI REMPLACER VALVE INTERIEUR VOIR POUR CLOUE ALL OK A REVERIFIE
TPMS light	LOW TIRE LIGHT IS ON , ADVISE	REPLACED DEFECTIVE VALVE STEM LEAKING, TESTED ALL FOUR TIRE SENSORS OK LR VAVLE STEM LEAKING AIR
Leaks	LEFT REAR VALVE STEM LEAKING AIR	REPLACED VALVE STEM RECHECKED OK....116 MT FOR CKING AIR PRESSURE, ALL FOUR TIRES 32 34PSI, ADJUST TO 35PSI ON COLD RIMS AND TIRES, CK VALVESTEMS, SEVERAL CRACKS FOUND, REPLACED ALL 4 VAVLE STEMS TO CORRECT CONCERN
Cracked	CUST STATE RECENTLY HE HAS HAD TO ADD AIR TO ALL 4 TIRES, DS 4LBS LOW PS 2.5LBS LOW LAST TIME, CUST ALSO ADDS THE VAVLE STEMS ARE REALLY CRACKED UP	VALVE STEM NOT SEALING,CK STEM,CK RIM,REPLACE STEM,OK
Leaks	RT REAR TIRE LOSES AIR CUST STATES LOW TIRE LIGHT IS ON	REPLAVE LEAKING VLAVE STEM VERIFIED.VALVE STEM
Leaks	CUSTOMER STATES LEFT FRONT TIRE LOSING AIR	LEAKING.R&R VALVE STEM,CLEAN BEAD

		6044 INSPECTED AND FOUND RR STEM LEAKING AND THE OTHER THREE CRACKED CONTACTED THE HOTLINE SPOKE WITH ROB THERE ARE NO KNOWN CONCERNS FOR THIS
Cracked	C S TIRE SENSOR LIGHT IS ON.....RIGHT REAR VALVE STEM IS CRACKED....PLZ CHECK AND ADVISE	REPLACED ALL FOUR VALVE STEMS DIAG. INSPECTED. REPAIRED
TPMS light	TIRE LIGHT ON, RIGHT FRONT TIRE LOOSING AIR (B66)	LEAK AT RIGHT FRT TIRE VALVE. (D8) LOW TIRE LIGHT COME ON INSPECTED VALVE STEMS CRACKED FOUND LEAKING VALVE STEMS REPLACED
Cracked	CC:G29 LOW TIRE LIGHT COMES ON,VALVE STEMS FOUND CRACKED	VALVE STEMS INSTALL TIRES RETEST VERIFY CONCERN LEAK TEST FOUND VALVE STEM LEAKING R AND R VALVE STEM WPI
Leaks	TIRE GOES FLAT REPORT ON CAUSE OF LFT REAR TIRE VALVE IS LKG	INSPECT FOR LEAK AND REPL REAR VALVE STEM
Replace	TEMOIN POUR PRESSION D AIR DE PNEU ALLUME	AJUSTER AIR TIRE REMPLACER VALVE AV D OK
Replace	LEFT FRONT TIRE KEEPS LOSING AIR, WE HAVE CHECKED BEFORE AND CANT FIND ANYTHING IN TIRE, PLEASE BREAK DOWN TIRE AND CHECK	1287 1007AF .3 .3 DISMOUNT LEFT FRT WHEEL REPLACE VALVE STEM CLEAN TIRE AND WHEEL BEAD REMOUNT AND BAL
		VERIFIED ALL FOUR LEAKING AROUND TIRE(S) OR WHEEL(S) REMOVE CLEAN BEAD AND REMOUNT
TPMS light	CHECK ALL 4 TIRES LEAKING LOOSING AIR CHECK PASS SIDE REAR TIRE LOST AIR AND PRESSURE SENSOR LIGHT CAME ON	5331 REPLACE LEAKING VALVE STEM INSPECT.REPLACED LEAKING VALVE STEM.
Leaks	REPAIR FOR PASSENGER FRONT TIRE HAS A SLOW LEAK.	RETRAINED ALL TPMS SENSEOR AND TEST DROVE
TPMS light	TIRE PRESSURE LAMP ON R F TIRE DAMAGED P235 55 ZR17 98WM M+S PIRELLI PZERONERO LOW TIRE WARNING LIGHT WAS ON LAST WEEK, AIR WAS ADD L F	1 MOUNT AND BALANCED 1 NEW PIRELLI TIRE TO L F
TPMS light	REQUEST CHECK VALVE STEMS ALL TIRES REQUEST OLD TIRE BE RETURNED	REPLACED ALL VALVE STEMS WITH SHORTER STEMS
Cracked	WHEELS AND TIRES CHECK VALVE STEMS CRACKING	VALVE STEMS CRACKED REPLACE ALL VALVE STEMS

		20576 CHECK FOR TRACTION LIGHT ON, NOT ON AT THIS TIME, ROAD TESTED, TESTED SYSTEM, NO CODES. CHECKED OASIS NO SSM TSB. MONITOR WHEELSPEEDS, ALL APPEAR OK, CHECKED TIRE CIRCUMFERENCE, ALL OK, FOUND RT FRONT TIRE VERY LOW. HAS BAD VALVESTEM. DISMOUNT TIRE, REPLACED LEAKING VALVESTEM, CHECKED ALL TIRE PRESSURES, OK, ROAD TEST OK AT THIS TIME.
TPMS light	OWNER STATES THAT THE TRAC LIGHT IS COMING ON AND STAYING ON SOLID AT TIMES	INSPECT ALL TIRE VALVES. 3 DRY ROT AND CRACKED DISMOUNT 3 TIRES. REPLACE TIRE VALVES AND BALANCE WHEELS TIRE PRESSURE LIGHT ON AT THIS TIME. IF LIGHT CONTINUES TO STAY ON, VEHICLE MAY HAVE TO GO TO JAX TO BE RESET
Dry rotted	CUSTOMER STATES VALVE STEMS DRY ROTTING ON 3 WHEELS	19628 060 FLAG 125 .6 REPLACED RIGHT FRONT TIRE MOUNT AND BALANCE REINSTALLED SPARE TIRE IN TRUNK GREEN
	TIRE1 REPLACE ONE TIRE TO INCLUDE NEW STEM SEAL AND MOUNT AND BALANCE	1 FOUND ALL VALVE STEMS CRACKING BROKE DOWN ALL 4 WHEELS AND REMOVED TIRES TO INSTALL ALL NEW VALVE STEMS
Cracked	CUST STATES TIRES LOOSING AIR	TECH VERIFIED CUSTOMER CONCERN, DIAG AS THE VALVE STEM IS LEAKING, TECH REPLACED THE VALVE STEM AND RETEST
Leaks	CUSTOMER CONCERN THE LEFT REAR TIRE IS FLAT	VERIFIED CONCERN AND FOUND R/R TIRE VALVE LEAKING IN CORE. REPLACED VALVE WITH NEW ONE.
TPMS light	CHECK OFR TIRE SENSOR LIGHT ON IN DASH SINCE LAST SERVICE.	VALVE STEMS LEAKING
TPMS light	C S LOW TIRE PRESSURE LIGHT ON	REPLACE VALVE STEMS

		CUSTOMER STATES THAT THE TIRE LIGHT IS ON AND HE KEEPS CHECKING THE PRESSURES AND HE FINDS THAT THEY ALL LOOSE SOME AIR AND THEY AMOUNT OF AIR LOSE IS DIFFERENT FROM TIRE TO TIRE. EVERYTIM	FOUND LEAKING VALVE STEMS. REPLACED ALL 4 VALVE STEMS. MT LABOR OP USED NO PUBLISHED LABOR OP AT TIME OF REPAIR
TPMS light			INSPECTED ALL FOUR WHEELS AND FOUND VALVE STEMS ABNORMALLY DRY ROTTED AT THEIR BASES. REPLACED ALL 4STEMS.
Cracked		CHECK FOR TIRES LOSING AIR. CUSTOMER THINKS VALVE STEMS ARE CRACKED	
Cracked		LOW TIRE PRESSURE MESSAGE ON C S VALVE STEMS LOOK CRACKED	VALVE STEM LEAKING REPLACE VALVE STEM
Leaks		LEFT TIRE HAS A LEAK	CHECKED FOR LEAK IN LEFT REAR TIRE. VALVE STEM LEAKING. REPLACED VALVE STEM.
Leaks		THERE IS A LEAK COMING FROM RF VALVE STEM	REMOVED AND REPLACED VALVE STEM BALANCED TIRE
TPMS light		LOW TIRE LIGHT IS ON TIRE1 REPLACE ONE TIRE TO INCLUDE NEW STEM SEAL AND MOUNT AND BALANCE	16660 REPLACE L R VALVE CORE RETEST
Replace	Replace tire		20403 030 REPLACE 1 TIRE NEW DOT P5XV 46MB 2207 1 FLAG 102
Leaks		VERIFIER CREVAISON SLOW LEAK AVAN GAUCHE	SEALER RIM: CHANGER VALVE ET BALANCER VALVE DEFECT OTHER VALVE
Leaks		VALVE STEMS LEAKING	3 VALVE STEMS LEAKING REPLACED VALVE STEMS
			VERIFIED CONCERN, CHECK AIR PRESSURE FOUND L F VALVE STEM LEAKING REMOVED WHEEL, DISMOUNTED TIRE REPLACE VALVE STEM REMOUNT REBALANCE
TPMS light		CUSTOMER STATES TIRE PRESSURE LIGHT ON	WHEEL, TRAIN SYSTEM OK 1015DF .2 1007AF .3
Cracked		CUSTOMER STATES ALL VALVE STEMS ARE LOOSE	CC 42 VALVE STEMS VERRIFIED C C. FOUND VALVE STEMS CRACKED AND LEAKING. REPLAC ED REMAINING 3 VALVE STEMS. TESTS OK..
Leaks		CUST STATES RT FRT TIRE LOSING AIR	12558 REPLACE RT FRONT VALVE STEM



		REPAIR LOOSE VALVE STEM REPAIR LUG NUTS ARE OK THE AIR VALVE HAD TO BE REPAIRED
Leaks	CHECK LEFT REAR TIRE WENT FLAT	REMOVE AND REPLACE LEAKING VALVE STEM CONFIRMED LEAK AT VALVE CKD DIAG TIRE LEAK REPLACED VALVE STEM
Leaks	REPAIR L/REAR OUTSIDE TIRE.	REMOVED TIRE AND MOUNT AND BALANCE RIGHT REAR VALVE STEM LEAKING REPLACED
Leaks	CUSTOMER STATES LEFT FRONT TIRE IS LEAKING	
Leaks	RIGHT REAR VALVE STEM LEAKING	
		CC 42 VERRIFIED C C. FOUND VALVE STEM LEAKING. FOUND VALVE STEM AS CAUSE OF TIRE SIDEWALL FAILURE. DOT N9 EK F661 4306. REPLACED TIRE VALVE STEM AND REPLACED TIRE. BALANCED... ALL CONCERNS CORRECTED... VALVE CORE LEAKING REPLACE VALVE CORE
Leaks	Replace tire CUSTOMER STATES VALVE STEM ON PASS REAR IS LEAKING TIRE RAN LOW AND DAMAGE TO SIDEWALL	
TPMS light	CK LOW TIRE LIGHT ON	
		12904 T REINSTALLED NEW ONE REINFLATED TIRE TO VERIFY REPAIR DISMOUNTED TIRE AND RIM TO TRACK CYCLE KEY AND RESET TIRE PRESS LIGHT REPROGRAM TIRE PRESSURE SENSOR EEC (QUICK TEST) DIAGNOSIS CHECKED VERIFIE DCOMPLAINT FOUND RIGHT REAR TIRE LOW CHECKED FOR LEAK FOUND VALVE CORE LEAKING.REPLACED VALVE SET TIRE PRESSURE ALL THE WAY AROUND
TPMS light	CUST STATES TIRE PRESSURE LIGHT CAME ON THEN TIRE WENT FLAT AIR LEAKING FROM VALVE STEM TIRE IN THE BACK	
	CUSTOMER STATES THE CK ENG LIGHT IS ON.	
TPMS light	CUSTOMER STATES TIRE PSI LIGHT IS ON	
Dry rotted	C S ALL VALVE STEMS ARE DRY ROTTED	17044 REPLACED ALL FOUR VALVE STEMS 20436 FOUND LEAK IN VALVE STEM. REPLACED VALVE STEM AND RE MOUNTED AND BALANCED TIRE
Leaks	LT REAR TIRE GOES FLAT	
Leaks	C C OF PASS FRONT TIRE GOES LOW	REPLACE LEAKING VALVE STEM

	PNEU DIANTEIRO DO L.E. SOLTANDO A BORRACHA	PNEUS DIANTEIROS L/E COM DESGASTE PREMATURO, VINDO A DETERRIORAR A BANDA DE RODAGEM DO MESMO.SUBSTITUIR PNEU E EM CONSEQUENCIA VAL LA E BALANCEAMENTO EM TERCEIRO. EMPRESA MW PNEUS, PARA BALANCEAMENTO CONFORME NF. 6402 DE 08/02/08. DIAG. INSPECTED. REPLACED LEAKING VALVE STEM AS REQUIRED. NOTE: NECESSARY TO R/R TIRE TO REPLACE VALVE STEM. (D8)
Leaks	SLOW TIRE LEAK IN LEFT REAR TIRE. (B65)	REPLACED RF VALVE STEM. CC 42
Leaks	CORRECT RT FRONT TIRE LEAKING AT VALVE STEM	
	CUSTOMER STATES THE PASSENGER FRONT TIRE IS LOW ON AIR	RESEALED TIRE
Leaks	A40 TIRE LIGHT KEEPS COMING ON CHECK REAR TIRES	RIGHT REAT TIRE VALVE STEM LEAKING
Tighten valve core	LEFT FRONT TIRE LOOSING AIR TRACED TO VALVE CORE LEAKING TIGHTENED VALVE CORE	TIGHTEN LOOSE VALVE CORE REPLACED LEAKING VALVE STEM
Leaks	THE LEFT REAR TIRE LOOSES AIR CUSTOMER STATES VALVE STEMS ON TIRES ARE CRACKED AND LOSING AIR	DRY ROTTED TIME TO DISMOUNT 4 TIRES AND REPLACE 4 VALVESTEMS 8950 LEFT FRONT VALVE STEM 42 WARRANTY BROKE DOWN TIRE AND REPLACED VALVE STEM
Cracked		
Leaks	C S LEFT FRONT TIRE LEAKS AT VALVE STEM	
Leaks	CUST STATES LEFT FRONT VALVE STEM LEAKS AIR	INOP R AND R VALVE STEM 1 PERFORMED WATER LEAK
	PERFORM MULTI POINT INSPECTION	TEST FOUND VALVE STEM LEAKING. INSTALLED NEW VALVE STEM AND RETEST OK.
Leaks	REPORT CARD RIGHT REAR TIRE LOW CHECK FOR NAIL	

		RFRNT VAE STEM LEAKING TIRE(S) OR WHEEL(S) REPLACE TECH 20 STATES INSPECTED VECH AND VERFIED CUSTOMER CONCERN. APPLIED SOAPY WATER TO RF VAE STEM . FOUND VALVE STEM LEAKING AT BASE.REMOVE TIRE FROM RIM ,BREAK DOWN TIRE FROM RIM AND REPLACE VALE STEM.RE MOUNT AND BALANC
Leaks	CUSTOMER STATES CHECK BOTH FRONT TIRES LOOSING AIR, SAYS VALVE STEMS ARE LEAKING	
Leaks	CUSTOMER STATES INSPECT AND PLUG R F TIRE WENT FLAT LAST NIGHT IN REAR HATCH AREA OF VEHICLE, SPARE IS ON FRONT NOW.	INSPECTED TIRE FOR OBJECTS, FOUND THAT TIRE HAD FAULTY VALVE INSERT AT STEM REPLACED VALVE STEM VERIFY CONCERN R F WHEEL AIR VALVE DETERIOTAING
Cracked	B65 CUST STATES FRONT PASSENGER VALVE STEM LOOKS CRACED	UNMOUNT TIRE AND REPLACE AIR VALVE MOUNT AND BALANCE TIRE
Cracked	CUST STATES REAR RIGHT LEFT TIRE VALVE STEMS CRACKED AND LEAKING AIR..REPLACE PER DAVE ADAMS	DISMOUNT TWO TIRES REPLACED VALVE STEMS REMOUNTED AND BALANCED TWO TIRES
TPMS light	CUSTOMER STATES TIRE PSI LIGHT IS ON	CHECKED VERIFIED COMPLAINT FOUND RIGHT FRONT TIRE LOW. REPLACED VALVE STEM AND RECALIBRATED SLOW LEAK REMOVED TIRE REPLACE VALVE STEM AND RESEAL TIRE PROBLME SOLVED
Leaks		CHECK FOR LEAK IN RIGHT FRONT. FOUND VALVE STEM LEAKING. REPLACED VALVE STEM. RESET LOW TIRE LIGHT RT FT TIRE IS LOW.VALVE STEM IS LEAKING AT CORE.REPLACE STEM.OK.
Leaks	CHECK FOR FLAT TIRE ONRIGHT FRONT.	
Leaks	VEHICLE IS PULLING TO THE RIGHT.	
Cracked	CUST.STATES ALL 4 VALVE STEEMS ARE DRY ROTTED AND CRACKING. ONE STEEM LET GO AND CAUSED A FLAT WHILE GOING DOWN INTERSTATE, DAMAGING TIRE	10761 100 COMPLETE WITH THREE NEW STEMS REPLACE ALL 4 VALVE STEMS AND BALANCE ALL TIRES
Cracked	Replace tire CHECK TIRE VALVE STEMS FOR CRACKS	

Cracked		CUSTOMER STATES VALVE SPEMS HAVE SPLITS IN THEM AND MAY START LEAKING	VERIFY AND REPLACE THREE SPLIT VALVE STEMS BREAK DOWN THREE TIRES AND REPLACE VALVE STEMS
Leaks	Replace tire	P05 VALVE STEM LEAKING RUINED TIRE	VALVE STEM LEAKING REPLACE TIRE AND VALVE STEM 9597 STEM (CC42) WARRANTY LEFT FRONT TIRE LOSES AIR. FOUND LEAKING FROM VALVE STEM. DISMOUNT TIRE AND REPLACE STEM. MOUNT TIRE AND BALANCE. RECHECK FOR LEAKS, OK.
Leaks		CUST STATES LEFT FRONT TIRE LOSING AIR	COMPLETED TPS QUICK TESTS COMPLETED PID MONITOR AND RECORD. FOUND THAT THE RF TIRES WAS LOW CHECKED FOR LEAKS. REPLACED THE LEAKING RF VALVE STEM CORE. RETESTED OK. RECALIBRATED TH E TIRE PRESSURE
TPMS light		CUSTOMER STATED LOW TIRE LIGHT STAYS ON ALL THE TIME	SENSORS. TIME TO REPLACE VALVE STEM ON RIGHT FRONT TIRE
Leaks			LEAKING.
Leaks		CUSTOMER STATES THE RIGHT REAR TIRE KEEPS GOING LOW	VERIFIED THE RIGHT REAR TIRE LOW. INSPECTED TIRE FOUND VALVE STEM LEAKING. REPLACED THE VALVE STEM.
Cracked		ALL FOUR VALVE STEMS HAVE CRACKS IN THEM	11513 REPLACED ALL 4 VALVE STEMS & ADJUSTED TIRE PRES
Leaks		CUST STATES RIGHT REAR VALVE STEM LEAKING	LEAKING CHECKED RR VALVE STEM FOR LEAK, VERIFIED CONCERN, REMOVED AND REPLACED RR VALVE STEM, NO FURTHER CONCERNS, 419 0186
Cracked		ALL 4 VALVES STEMS CRACKED R&R ALL FOUR WHEELS TO REPLACE VALVE STEMS	BASIC #1700 CC 01 CCC B65
Leaks		CK VEHICLE CUSTOMER STATES VALVES STEMS LEAKING ON MORE THAN ONE WHEEL	VALVE STEMS TORE BROKE DOWN ALL TIRES AND REPLACED ALL 4 VALVE STEMS AND RETRAINED TPMS SYSTEM

Leaks	CUSTOMER STATES AIR LEAKING FROM VALVE STEMS ON TIRES	VERIFIED CUSTOMER CONCERN LEAKING VALVESTEM REPLACED NO FURTHER PROBLEM FOUND AT THIS TIME
Leaks	LEAKING VALVE STEM SEALS L F,L R AND R F	REMOVE WHEELS AND TEST STEMS, STEMS LEAK. REMOVE 4 TIRES AND REPLACE 4 VALVE STEMS. ROAD TEST, TIRE LITE ON. RETRAIN 4 SENSORS AND ROAD TEST AGAIN, OK..... VALVE STEM WILL NOT SEAL
Leaks	RIGHT REAR TIRE IS FLAT INSPECT AND REPORT	INSPECT PROPERLY. REPLACE VALVE STEM
Leaks	CHECK FRT TIRE FOR SLOW LEAK REPAIR FLAT TIRE LEAKING AT VALVE STEM REINSTALL BACK ON CAR	CHECKED AND REPLACED TIRE VALVE LEAKING
Leaks	CUST STATES PASS REAR TIRE KEEPS GOING FLAT CK AND REPORT	REPLACE R F TIRE VALVE STIM FOUND LEAKING
Leaks		INSPECTED AND FOUND VALVE STEM LEAKING REPLACED RETESTED OK
Leaks	C/S LEFT REAR TIRE KEEPS GOING FLAT	VERIFIED TIRE WILL NOT HOLD PRESSURE, FOUND VALVE STEM LEAKING, FOUND STEM WITH TEAR AT BASE, REPLACED VALVE STEM AND VERIFIED REPAIR
Leaks	CUSTOMER STATES PASSANGER FRONT TIRE IS LOOSING AIR	2139 VALVE STEM LEAKING TANK TEST WHEEL AND TIRE BREAK DOWN TIRE REPLACE VALVE STEM REINSTALL TIRE ROAD FORCE BALANCE ROAD TEST TO VERIFY REPAIR
Cracked	C S RIGHT REAR TIRE STEAM CRACKED.....TIRE LEAKING AIR...PLZ CHECK AND ADVISE	REMOVED ALL FOUR TIRES AND REPLACED VALVE STEMS. INSTALLED TIRES AND BALANCED.
Leaks	CHECK DRIVER REAR VALVE STEM LEAKING	REPLACE VALVE STEM
Replace	CHECK DR FRT TIRE FLAT CUST REPORTS TIRE WARNING LIGHT KEEPS COMING ON. CUST FEELS PROBLEM IS WITH DRIVER SIDE REAR TIRE	REPLCAE LEFT FRT VALVE STEM AND PUT SPARE UP VERIFIED CONCERN. FOUND VALVE STEM IN RIGHT REAR TIRE LEAKING. REPLACED VALVE STEM. RETEST. OK.

Leaks	CUSTOMER STATES TIRE LEAKING AIR AROUND STEIM	INSPECTED TIRE AND PERFORMED DUNK TEST LEAK DETECTED AT VALVE STEM REPLACED VALVE STEM AND BALANCED 1 TIRE REINSTALL SPARE UNDER VEHICLE AT CUSTOMER REQUEST COD 01 13778 INSPECTED AND FOUND TIRE VALVE STEM LEAKING AT BASE FOUND NO VISUAL DAMAGE REMOVED R AND R TIRE AND INSTALLED NEW VALVE STEM HAD TO REPROGRAM WHEEL SENSORS DUE TO TIRE LIGHT WF TECH 388
Leaks	PERFORM TIRE PATCH REPAIR \$22.85 DISMOUNT, INSTALL TIRE PATCH, REMOUNT AND BALANCE TIRE	FOUND VALVE STEM LEAKING DISMOUNT AND MOUNT TIRE INSTALLED VALVE STEM
Leaks	CHECK FOR LEAK FROM RIGHT REAR VALVE STEM CHECK VALVE STEMS, CUST STATES THEY ARE CRACKING AND NEED REPLACEMENT. CUSTOMER SUPPLIED NEW PARTS IN TRUCK	VERIFIED CONCERN AND INSTALLED NEW VAVLE STEMS
Cracked	RIGHT FRONT HAS FLAT IN BACK OF TRUCK REPAIR AND RE STOW SPARE UNDER VEHICLE	VALVE STEM IS LEAKING REPLACED VALVE STEM PERFORM INSPECTION, VALVE STEM BAD. R&R STEM. RECHECK OK.
Leaks	CK LOW TIRE PSI LIGHT LIT ON DASH.	7598 VAVLE STEMS VERIFY CONCERN PERFORM IDS TEST LEFT REAR TIRE LOW INSPECT FOUND VALVE STEM CRACK AND LEAKING INSPECT ALL 4 TIRES FOUND THAT 3 OUT OF 4 VALVE STEM BAD REPLACE LEFT REAR RT FRONT AND RT REAR DISMOUNT THREE TIRES INSTALL VALVE STEM BALANNCE THREE TIRE AND REFILL WITH NITROGEN RESET
Cracked	A40 CUSTOMER REPORTS LOW TIRE PRESSURE LIGHT IS ON CUSTOMER STATES TIRE PRESSURE LIGHT KEEPS COMING ,RIGHT REAR TIRE GOES DOWN NO NAILS	TIRE MONITOR TECH 8200 WARR CHECKED TIRE FOR LEAKS,FOUND VALVE STEM LEAKING REPLACED VALVE STEM
TPMS light	TIRE SPECIAL: WE HAVE THE LOWEST PRICED TIRES GUARANTEED. WE WILL BEAT ANY COMPETITORS ADVERTISED	28066 120 REPLACED 4 TIRES NEW DOT MDHL TBHR 0208 2 4407 2 FLAG 102

Cracked		TIRES KEEP LOSING PRESSURE FOUND VALVE STEMS CRACKED AND LEAKING AIR REPLACED ALL VALVE STEMS
Leaks	CUSTOMER STATES CHECK TIRE PRESSURE LIGHT IS ON AND THE R R TIRE HAS 19 LBS OF PRESSURE	FOUND VALVE STEM LEAKING REPLACED VALVE STEM ON RIGHT REAR. RETESTED: OK VALVE STEMS ARE CRACKING TECH REMOVED AND
Cracked	CUSTOMER STATES VALVE STEMS ARE CRACKING ON ALL FOUR TIRES. CUSTOMER STATES RIGHT REAR	REPLACED CRACKED VALVE STEMS ON ALL FOUR TIRES LEAKING REPLACE R R VALVE STEM
Leaks	TIRE IS LOSING AIR	CRACK LEAKING DESMOUNT ALL 4 TIRES AND REPLACE ALL VALVE STEAM RETEST OK. TIRE PRESSURE LIGHT ON RIGHT FRONT TIRE LOW ON AIR FOUND VALVE STEAM IS LEAKING REMOVED TIRE REPLACED VALVE STEM RETRAIN TIRE MIONITOR SYSTEM RETEST LIGHT IS OFF 19422 CHANGE TO WF94 .PERFORMED CHECK TIRE GOES FLAT FOUND THE TIRE LEAKING FROM THE RIM VALVE STEM.PERFORMED REMOVE AND REPLACE RIM VALVE STEM.PERFORMED QUALITY CHECK.
Leaks	LEAKING AIR FROM VALVE STEAMS ON TIRES	CHECKED ALL TIRES FOUND RIGHT FRONT TIRES LEAKING AIR REMOVED TIRE CHECKED FOR HOLE IN TIRE NONE FOUND CHECKED VALVE STEM FOUND CRACKED REMOVED ADN REREPACED INSTALLED TIRE TEST DROVE OK
Leaks	CUST STATES RIGHT FRONT TIRE LOOSING TIRE PRESSURE CHECK AND ANDVISE	BREAKDOWN TIRE & INSTALL NEW VALVE STEM LEAKING 10159 CHECK ALL TIRES REPLACE LEAKING R F VALVE CORE LABOR 0.5 VALVE STEM LEAKING ACCESS AND REPLACED VALVE STEMS
Leaks	CUST STATES THAT THE RIGHT FRONT TIRE GOES FLAT. THERE IS A SPARE NOW AND TIRE IS ON REAR	
Cracked	TIRES LEAKING AIR	
Cracked	C S VALVE STEM ON RIGHT FRT TIRE SPLIT AT RIM	
TPMS light	LOW TIRE PRESSURE LIGHT IS ON	
TPMS light	LOW TIRE LIGHT ON	

Broken	CUSTOMER STATES THAT TIRE WENT FLAT LOOKS LIKE VALVE STEM IS BROKEN	VERIFIED CONCERN AND PERFORMED DIAG FOUND TIRE PRESSURE LIGHT ON AND VALVE STEMS CRACKING REPLACED ALL 4 STEMS AND RECALIBRATED SENSORS RIGHT REAR VALVE STEM LEAKING R&I RIGHT REAR TIRE ASSEMBLY AND REPLACE VALVE STEM
Leaks	RIGHT REAR VALVE STEM LEAKS AIR	
		1700 CC 01 TECH 03483 MO 8635 VERIFIED CONCERN, FOUND L F, R R, L R VALVE STEMS TO BE CRACKED AND LEAKING REMOVED THREE TIRES FROM VEHICLE DISMOUNTED THREE TIRES REPLACED VALVE STEMS IN THREE TIRES REMOUNTED THREE TIRES AND REBALANCED THREE TIRES REINSTALLED WHEEL ON TO VEHICLE POST OPPTS CHECK OK
Cracked	CUST STATES LEFT FT RIGHT REAR LEFT REAR VALVE STEMS CRACKED	POST ROAD TEST OK CC CRACKING VALVE STEM CAUSING LEAK REPLACED VALVE STEM, MOUNT AND BALANCE TIRE
Cracked	C S VALVE STEM CRACKING ON LEFT FRONT	1 CHECKED AND FOUND VAVLE STEM CRACKED AND LEAKING DISMOUNTED TIRE AND REPLACED VALVE STEM REMOUNTED AND BALANCED
Cracked	CUSTOMER STATE THE LEFT FRT. TIRE HAS A SLOW LEAK NOTICED THE VALVE STEM IS CRACKED.	
Dry rotted	CUSTOMER STATES THAT IT APPEARS TO HAVE DRY ROTTED VALVE STEMS. CHECK AND ADVISE.	R & R VALVE STEMS FOR DEFECT. TWO REAR VALVE STEMS REPLACED BECAUSE OF LEAKS.NOWD/S FRONT LOOKS CRACKED.CUSTOMER WANTS ALL STEMS RECHECKED AND REPLACED AS NEEDED. MOUNT AND BALANCE 1 TIRE
Cracked	TIRES.CUSTOMER STATES VEHICLE HAS HAD TO HAVE LEFT FRONT TIRE VALVE STEM LEAKS.	REPLACED BOTH FRT VA LVE STEMS REPLACE VALVE STEM ON L.F. WHEEL.



		CHECKED AND FOUND LEFT REAR VALVE STEM CAP IS SEIZED AND LEAKING
Leaks	CK TIRE PRESSURE MONITOR LIGHT IS CHECK FOR NAIL DEBRIS IN TIRES	DISMOUNTED TIRE REPLACED STEM AND REMOUNTED AND BALANCED
Leaks	CUSTOMER STATES THE VALVE STEM ON RIGHT REAR WHEEL LEAKING	INOP REPLACE R R VALVESTEM R AND R THE PASSENGER SIDE TIRE VALVE
Leaks	CUSTOMER STATES THAT THE VALVE STEM IS LEAKING	
Leaks	C S L R TIRE HAS LEAK FROM VALVE STEM. CHECK AND ADVISE	VERIFIED STEM LEAK. REMOVED AND REPLACE VALVE S TEM. RECHECKED OK
Leaks	LEFT REAR TIRE FLAT	LEFT REAR WHEEL VALVE STEM LEAKING REPLACE VALVE STEM ASSY
Cracked	CUST STATES ALL VALVE STEMS ARE CRACKED AND ONE LEAKS AIR ON RIGHT REAR	6678 ALL STEMS ARE CRACKED REPLACED ALL VALVE STEMS AND OK NOW.
Dry rotted	C S THE TIRE PSI LIGHT STAYS ON CUSTOMER TOLD THE LEFT FRONT VALVE STEM DRY ROTTED AND ALLOWING TIRE TO LOOSE AIR	CK FOUND TIRE VALVE STEM EXESSION DRY ROT AND LEAKING, INST NEW STEM AND SET TIRE PRESSURES AND RESET WARNING SYSTEM
Leaks	LEFT FRONT TIRE IS LEAKING	REPLACED LEAKING VALVE STEM IN LEFT FRONT TIRE
Leaks	CHECK SLOW LEAK CUSTOMER STATES BOTH RIGHT SIDE AND LEFT REAR TIRES VALVE STEMS HAVE SPLIT APART AT WHEEL RIM CAUSING FLAT TIRES. LEFT REAR TIRE WAS DAMAGE NEEDS REPLACEMENT.	3 VALVE STEMS LEAKING ACCESS AND REPLACED 3 VALVE STEMS
Cracked	Replace tire	CRACKING REPLACED ALL 4 VALVE STEMS
TPMS light	TPMS LIGHT IS ON, PLEASE CHECK AND ADVISE THE PASS SIDE FRONT TIRE WAS DOWN TO 20PSI	VERIFIED CONCERN, REMOVED AND REPLACED THE LEAKING VALVE STEM, TESTED OK AT THIS TIME
Cracked	CHECK TIRES FOR LEAK	REPLACED LEFT REAR AND RIGHT FRONT VALVE STEMS DUE TO RUBBER CRACKED CAUSING AIR LEAKS THE FIRST ONE WAS THE RIGHT REAR
Leaks	1 PASSENGER FRONT TIRE LOOSING AIR	DIFFERENT TIRE 1700 CC42 INSPECTED AND FOUND THAT THE VALVE STEM WAS LEAKING R R PROBLEM SOLVED

Leaks		CUSTOMER STATES RF AND LR TIRES LEAKING AIR FROM VALVE STEMS	LEAKING TIME TO INSPECT AND REPLACE R F AND L R VALVE STEMS H62 42 VERIFIED CUSTOMER CONCERN FOUND BOTH TIRES VALVE STEMS LEAKING AIR REMOVED OLD VALVE STEMS INSTALLED NEW VALVE STEMS RECHECKED NO LEAKS FOUND ON BOTH TIRE OK COMPLETED
Leaks		LF AND RR TIRE LEAKING	26736 ALL 4 VALVE STEMS BASE LEAKING AIR REPLACE ALL 4 VALVE STEMS ON ALL 4
Cracked		C S VALVE STEMS ARE SPITTING AT WHEEL AREA; TIRES ARE LEAKING	WAVLE STYEM ON ALL 4 WHEELS 5696 DISMOUNT 4 TIRES AND INSATLL 4 NEW VALVE STEMS AND REMOUNT AND BALANCE 4 TIRES RUSTING
Cracked		CUST STATES THE VALVE STEMS ON ALL FOUR TIRES ARE RUSTING SOP PARTS ARE HERE	1 VERIFIED CUST CONCERN ALL VALVE STEMS CRACKING, REPLACED 4 VALVE STEMS AND VERIFIED REPAIR
Cracked		CUST STS ALL VALVE STEMS CRACKING AT THE BASE	
Leaks		CUSTOMER STATES LEFT FRONT TIRE KEEPS GOING LOW RIGHT REAR AND LEFT FRONT TIRE STEMS LEAKING....CUSTOMER HAS TO REPLACE RIGHT FRONT TIRE DUE TO FLAT CAUSED BY VALVE STEM LEAK....DI FOR APPROVAL	VERIFIED FOUND VALVE STEM LEAKING,REPLACED RETEST OK
Leaks	Replace tire	LEFT REAR TIRE VALVE STEM LEAKING	REPLACED RIGHT REAR AND LEFT FRONT VALVE STEMS
Leaks			REPLACE VALVE STEM
Cracked		CUSTOMER STATES ALL OF THE VALVE STEMS ARE CRACKED AND DRY.	VERIFIED CONCERN, FOUND ALL 4 VALVE STEMS WERE BAD, DISMOUNTED AND REMOUNTED ALL 4 TIRES, INSTALLED NEW STEMS, RECHECKED, OK 13374 REPLACE VALVE STE 1700A 50 TIRE HAVE BEEN CHECK FOR NAILS NO NAILS FAUND, VALVE STEM HAVE BEEN CHECK IS BROKE VALVE STEM HAVE BEEN REPLACE TIRE HAVE BEEN MAUNT AND BALANCE, TIRE PRESSURE HAVE BEEN SET AT 35PSI TIRE
Broken		CUSTOMER STS LOW TIRE LIGHT ON AND CHECK FLAT TIRE AND ADVISE	PRESSURE LIGHT HAVE BEEN RESET

Leaks	CHECK FOR RIGHT REAR TIRE HAS A LEAK	CHECK TIRE NEEDS VALVE STEM. CHECK TIRE AND FOUND VALVE STEM WAS LEAKING. INSTALL NEW VALVE STEM INSPECTED AND FOUND RIGHT FRONT WHEEL LEAKING AROUND RIM REMOVED TIRE CLEANED RIM,REPLACED VALVE STEM,RE MOUNTED TIRE ON RIM AND BALANCED ASM
Leaks	CLIENT STATES THE LOW TIRE PRESSURE LIGHT IS ON	CHECKED FOR TIRE LEAK, FOUND LEAKING FROM VALVE STEM. REPLACED VALVE STEM AND RETESTED CONCERN REPAIRED
Leaks	CHECK FOR LEFT REAR TIRE GOES FLAT AFTER ABOUT 24 HOURS.	VALVE STEMS HAVE SEVERAL CRACKS AT THE BASE, 1 ACTUALLY WENT FLAT AND THE OTHER 2 WERE CRACKED BUT HOLDING AIR, CUSTOMER HAD 1
Cracked	CUSTOMER STATES VALVE STEM IS BAD ON ALL 4 WHEELS SEE GARY	ALREADY REPLACED AT LOCAL TIRE SHOP. 10165 VERIFY CUSTOMERS CONCERN. REMOVE AND REPLACE RIGHT REAR VALVE STEM. TORQUE WHEEL TO 90FT.LBS. SET TIRE TOP PROPER INFLATION.
Leaks	CUSTOMER STATES THE VALVE STEM IS LEAKING ON RT REAR TIRE. REPLACE VALVE STEM UNDER WARRANTY IF FAILURE WAS NOT CAUSED BY OUTSIDE INFLUENCE.	ALL FOUR VALVE STEMS SEEM TO BE DRY ROTTED, WHITE CORE VISABLE WHEN BENT
Dry rotted	CUSTOMER STATES THAT LEFT REAR TIRE LOST AIR THRU THE VALVE STEM PLEASE REPLACE VALVE STEM AND PLACE SPARE TIRE BACK INTO PLACE	REPLACE ALL FOUR VALVE STEMS
Leaks	C S ALL THE VALVE STEMS ARE CRACKING AND LEAKING AIR	VALVE STEM FAILED REPLACED FAULTY VALVE STEM
Cracked	VALVE STEM COVERS ARE FROZEN ON	REPLACE 4 VALVE STEMS;17000 01 CHECK VALVE STEMS BROKE DOWN AND REPLACED ALL FOURSIEZED STEMS WHEEL SENSOR BANDS BROKEN ON DISASSE MBLY REPLACED ALL AND BALANCED ALL TIRES RELEARNEDALL SENSORS RECHECK OK

TPMS light	CHECK TIRE PRESSURE WARNING LIGHT ON	CHECKED FOR LEAKAGE ON LEFT REAR TIRE LOW IN PRESSURE WHEN TESTED REQUIRED TO REPLACE VALVE STEM ASSY AND RESET TIRE PRESS AND REPROGRAM ON COMPLETION .
Cracked	Replace tire	INSPECTED DAMAGED TIRE AND WHEEL, VALVE STEM CRACKED AT BASE, VALVE STEM BROKE WHILE DRIVING ON INTERSTATE, TIRE DAMAGED BEFORE CUSTOMER COULD PULL OF ROAD. INSPECTED ALL OTHER VALVE STEMS, FOUND ALL CRACKED ALSO, REPLACED LEAKING TIRE(S) OR WHEEL(S)
TPMS light	CUSTOMER STATES PSI LIGHT CAME ON	REPLACE R R INOP TIME TO INSPECT TIRES TO DETERMINE ALL 4 VALVE STEMS ARE DRY ROTTED; NECESSARY TO REPLACE ALL 4 VALVE STEMS
TPMS light	CUSTOMER STATES PSI LIGHT IS ON	
Cracked	CUST STATES VALVE STEMS CRACKED AND TIRES HAVE AIR LOSS	R R 4 TIRES TO REPLACE VALVE STEMS
Leaks	REPAIR FOR VALVE STEMM LEAKING (TC8)	REPLACE THE LEAKING VALVE STEM LEFT REAR TIRE
Leaks	THE LEFT FRONT TIRE LEAKS AIR VALVE STEM CAPS WILL NOT COME OFF INSTALL RUBBER STEMS W PLASTIC CAPS.	LT FRONT TIRE VALVE STEM LEAKS AIR. DISMOUNT, MOUNT & BALANCE LT FRONT WHEEL. REPLACE VALVE STEM. 1700 41 REPLACE ALL 4 VALVE STEMS
Leaks	REPAIR FLAT TIRE AND PUT ON RIGHT FRONT CC B65	VALVE STEM LEAKING CHECK OUT FOR CAUSE OF LEAK AND FOUND VALE STEM LEAKING REMOVE AND REPLACE B65
Leaks	O K HERE IS THE DEAL THE L F TIRE HAS A BAD VALVE STEM AND A POSSABLE NAIL LEAK REPORT AND PLEASE CK ALL THE OTHER VALVE STEMS AND TIRES THANK YOU	14157 D4 R I TIRE AND REPLACE VALVE STEM AND REBALANCE TIRE

Cracked	Replace tire	RIGHT FRONT TIRE SUDDENLY WENT FLAT WHILE DRIVING ON INTERSTATE HIGHWAY. BEFORE OWNER WAS ABLE TO SLOW AND PULL INTO EMERGENCY LANE TIRE SIDEWALL WAS DAMAGED.	INSPECTED TIRE, FOUND VALVE STEM CRACKED AT BASE, INSPECTED OTHER WHEELS, FOUND SAME PROBLEM. REPLACED ONE TIRE, REPLACED ALL VALVE STEMS 7128 ALL 4 VALVE STEMS ARE DRY ROTTED VERY BADLY, LEAKING AIR DISMOUNTED ALL 4 TIRES TO REPLACED THE VALVE STEMS REPLACED VALVE STEMS, BALANCED ALL 4 TIRES ALL OK AT THIS TIME
Cracked		C S VALVE STEMS ON ALL TIRES ARE DRY ROTTED AND ON THREE TIRES STEMS ARE CRACKED WITH L R LEAKING AIR. BALANCE TIRES. DO NOT ROTATE TIRES WERE RECENTLY ROTATED	BROKEN VALVE STEM REPLACE BROKEN VALVE STEM ON L R TIRE
Broken		CK VALVE STEM BROKEN ON L R TIRE	REPLACED LEAKING VALVE STEM AND REMOUNTED AND BALANCED LEFT FRONT TIRE.
Leaks		CHECK LEFT FRONT TIRE FOR LEAKS.	7359 DIAG AND INSTALL NEW VALVE STEM LEAKING RETEST
Leaks		CHECK RIGHT FRONT TIRES IS FLAT	PASS
TPMS light		CUSTOMER STATES LOW TIRE PRESSURE LIGHT ON	VERIFIED CONCERN VALVE STEM LEAKING DISMOUNT TIRE
Replace		CUST REPORTS RIGHT FRONT TIRE WENT FLAT	INSTALL NEW VALVE STEM REMOUNT REBALANCE OK
Leaks		TIRE HAS A FLAT PLEASE REPAIR OR REPLACE, DETERMINE FAILURE	REPLACED VALVE STEM IN RIGHT FRONT WHEEL VALVE STEM LEAKING
Leaks		CHECK RIGHT REAR TIRE CUSTOMER BELIEVES STEM IS LEAKING PLEASE CHECK ALL TIRES	REPLACED STEM AND BALANCED TIRE
Leaks		CUSTOMER STATES :RIGHT REAR TIRE KEEPS LOOSING AIR	BASIC 1700 CC TC8 (VALVE STEMS) CHECKED CONCERN, REPLACED VALVE STEMS CONFIRMED COMPLAINT FOUND BAD VALVE STEM REPLAC ED AS NEEDED ALL OK AT THIS TIME
Replace		PNEU ARR DROIT A PLAT. MIS DE L AIR DEDANS VOIR POUR REPARER.	DEMONTET PNEU;VERIFIER ET REMPLACER VALVE. MT TIME NEEDED TO VERIFY CONCERN,FOUND DRIVER'S SIDE FRONT TIRE VALVE STEM LEAKING.R&R D.S. FRONT VALVE STEM,VERIFIED,OK
Leaks		TIRE IS LOOSING AIR.	NOW.NO OP CODE.
Leaks		TIRE REPAIR	REPLACED VALVE STEM LR
Leaks		LR TIRE LOOSES AIR	TIRE

Leaks	LEFT FRONT TIRE IS LOSEING AIR	8584 CHECK LEFT FRONT TIRE GOES FLAT REMOVE TO REPLACE VALVE STEM IT WAS LEAKIN DRIVERS FRONT TIRE FLAT CHECK FOR LEAKS FOUND VALVE STEM LEAKING REMOVE AND REPLACE VALVE STEM AND RESET TIRE SENSOR PER TIRE LIGHT ON TECH 406 USED ACTUAL M TIME NO LABOR
Leaks	CUST STATES DRIVERS SIDE FRONT TIRE IS FLAT CK ADVISE	OPERATION FOR REPLACING VALVE STEM
Leaks	LEFT REAR TIRE IS LOOSING AIR AROUND VALVE STEM	VERIFIED CONCERN OF LR TIRE LOSES AIR AROUND VALVESTEM REPLACED UNDER 3 36 PROCEDED TO CHECK TIRE P RESSUREES FOUND ALL OTHER VALVE STEMS SEVERLY CRAKED FOUND NECESSARY TO REPLACE REPLACED UNDER 3 36
Leaks	CHECK TIRE VALVE STEMS LEAKING	VERIFY VALVE STEMS LEAKING REPLACED VALVE STEMS CORROSION ON ALL 4 WHEELS ON EDGES, REPLACED 4 WHEELS AND TRANSFER
Broken	ALL 4 WHEELS CORRRODED AT OUTER EDGES	SENSORS TO NEW WHEELS / BALANCE AND ROAD TESTED.
Broken	VALVE STEM BROKEN	REPLACE BROKEN VALVE STEM
Replace	C S LF TIRE GOES LOW	CK TIRE AND REPLACED VALVE STEM
Cracked	CUSTOMER REQUESTS MOUNT, BALANCE AND INSTALL 1 NEW TIRE VALVE STEEM DEFECTIVE	VALVE STEM CRACKED DIAG TIRE FOUND VALVE STEM CRACKED REPLACE VALVE STEM AND REPLACE RIGHT REAR TIRE
Leaks	CUSTOMER STATES LEFT REAR TIRE LEAKING AIR WAS TOLD ITS VALVE STEM	4616 LR TIRE LEAKING AIR WAS TOLD ITS VALVE STEM. 15138 BAD SEAL VERIFIED CUST. CONCERN. FOUND NECC. TO REPLACE VALVE
Broken	C S LEFT REAR TIRE GOING FLAT, VALVE STEAM BROKEN.	STEM. R&R VAVLE STEM. RECHECKED OK.
Replace	REPLACE PASS. SIDE REAR VALVE STEM AND RE BALANCE TIRE	B65 63 1007 COMPLETED

		11345 1700 PUT VEHICLE UP ON LIFT INSPECTION FOUND ALL THREE REMAINING VALVE STEMS TO BE CRACKED THREE TIRES DISMOUNT REPLACE VALVE STEMS REMOUNT AND BALANCE ROAD TEST
Cracked	CUSTOMER STATES ONE TIRE LOOSING AIR STOPPED AT OUTSIDE TIRE STORE THEY REPLACED ONE VALVE STEM AND SAID THE OTHER THREE NEEDED REPLACING CK CUSTOMER STATES THE DRIVERS SIDE FRONT TIRES STEM IS LEAKING CUSTOMER JUST REPLACED REAR DRIVERS SIDE VALVE STEM CUSTOMER WOULD LIKE ALL TIRES INSPECTED PLEASE CHECK AND ADVISE C/S TIRES VALVE ARE DEFORMED	
Cracked Replace		4881 RUUBER VALVE STEMM CRACKED LEAKING AIR REINDEX THREE TIRES TO REPLACE THREE VAVLE STEMS DUE TO LEAKING AIR CRACKING VERFIED RPL TIRE VALVES 11616 REPLACED ALL 4 VALVE STEMS PER CUSTOMER REQUEST #9472
Leaks	ALL 4 VALVE STEMS LEAKING	
Leaks	RH FT TIRE LOW	VERIFIED CONCERN, FOUND VALVE STEM LEAKING. REPLACE VALVE STEM. ALL OK. 15795 DRY ROTTED AND LEAKING INSPECT AND RENEW RF LF LR VALVE STEMS LEAKING DRY ROTTED REASSEMBLE REMOUNT RETEST PASS
Dry rotted	CK VALVE STEM LEAKING ON R F TIRE R R HAS BEEN REPLACED	REMOVED TIRE CHECKED VALVE STEM FOUND CRACK ON WHEEL SIDE REPLACE STEM AND BALANCE. CHECKED VALVE STEM FOUND VALVE STEM TORN , REPLACED VALVE STEM REMOVE RIGHT REAR TIRE DIP TANK REPLACE VALVE STEMREASSEMBLE REMOUNT AND RETEST OK
Cracked	CUST. STATES VALVE STEM IS LEAKING ON LT REAR. IS NOT SEALING PROPERLY. CUSTOMER STATES LEFT REAR TIRE VALVE STEM KEEPS LEAKING TIRE GOES LOW	PERF DIAG CK FOUND ALL VALVE STEMS CRACKED AND LEAKING REPLACED ALL VALVE STEMS CKED VALVE STEM ADDITIONAL MISC. REPAIRS
Torn		
Leaks	PASSENGERS REAR TIRE LOW.	
Cracked	CUST STATES LOW TIRE LIGHT ON POSSABLE LEAK IN RT REAR CUSTOMER STATES VALVE STEMS LEAKING	
Leaks	TIRES KEEP LOSING AIR SEEM TO BE LEAKING FROM VALVE STEMS CHECK ALL VALVE STEMS TIRE IS LEAKING FROM VALVE STEM CK AND ADV	FOUND DEFECTIVE VALVE STEM REPLACE VALVE STEM CHANGED VALVE STEM REPAIR TIRE

Leaks		CUSTOMER STATES L REAR TIRE AIR LEAKING FROM VALVE STEM LEFT REAR TIRE VALVE STEM LEAKING AIR	REPLACE VALVE STEM REPAIR TIRE REPAIR L REAR TIRE REPAIR TIRE
Leaks		RR VALVESTEM LEAKING AIR IN BED OF TRUCK TIRE LIGHT ON ADVISE	DRY ROTTED TIME TO REPLACE ALL 4 VALVE STEMS VERIFIED CONCERN FOUND ALL 4 STEMS CRACKED REPLACED ALL 4 AFTER BREAKING TIRES DOWN
Dry rotted			
Cracked		CUSTOMER STATES AIR IS LEAKING FROM RIGHT FRONT AND BOTH REAR VALVE STEMS, ADVISE	TECH CHECKED AND REPLACE VALVE STEM THAT WAS LEAKING
Leaks		CUST STS CHECK RF TIRE FOR LEAKING	
Cracked		W ALL 4 TIRES VALVE STEMS CRACKED AND LEAKING	REP VALVE STEMS CRACKED
Replace		REPLACE RIGHT FRONT VALVE STEM	INSTALL 3 VALVE STEMS AND REBALANCE
Leaks		CUST STATES TIRE WENT LOW AND WAS DAMAGED DUE TO LEAKING VALVE STEM ***NO DI REQUIRED PER SCOTT YERK FORD DI PROGRAM***	REPLACE 1 TIRE AND BALANCE DOT P5XV 46MB 5006
Leaks	Replace tire		4851 VALVE STEMS DRY ROTTED ALL 4 VALVE STEMS
Leaks		CK TIRE IN SPARE VALVE STEM LEAKING CK ALL	DRY ROTTED. REPLACE VALVE STEMS RECHECKED NOW OK
Cracked		C S ALL FOUR VALVE STEMS ARE CRACKED CUT	16521 REMOVED AND REPLACED ALL FOUR VLAVE STEMS.
Cracked		ADVISE CUST STATES OTHER WHEELS VALVE STEMS DRYROTTED AND SEVERELY CRACKED ADVISE	DRY ROTTED BROKE DOWN TOP BEAD ON ALL WHEELS AND REPLACED VALVE STEMS, RESET ALL TPM SENSORS.
Cracked		C S THE LEFT REAR VALVE STEM IS LEAKING	15474 INSPECTED STEM CRACKED AT BASE NO DAMAGE TO RIM REPLACED STEM ON LEFT REAR RIM
Dry rotted		REFUND CUSTOMER ALL VALVE STEMS DRY ROTTED & CRACKED CAUSING FLAT TIRES INVOICE ATTACHED	1 CUSTOMER SEEKING REIMBURSEMENT FOR EMERGENCY REPAIR COST INCURRED TO REPLACE ALL 4 DRY ROTTED VALVE STEMS.\$47.93
Leaks		CUSTOMER STATES THE RIGHT REAR TIRE BLEW OUT CUST STATES ALL 4 VALVE STEMS ARE LEAKING CUST STATES HE WANTS THE TIRE IN THE TRUNK PUT ON	DEFECTIVE REPLACE R R TIRE REPLACED ALL FOUR VALVE STEMS



		QFC COMPLETE CP:1700 MOUNT AND BALANCE 2 NEW GOODYEAR TIRES TECH
Replace	MOUNT AND BALANCE 2 TIRES AND REPLACE VALVE STEMS	TIME IS .6 HOURS 59.40 NEW DOT 'S M6VX18HR1008 X 2 VERIFIED CONCERN FOUND RT FRONT VALVE STEM SEPARATED IN CENTER OF STEM THE REST OF STEM IS STILL IN WHEEL NO DAMAGE
Separated	Replace tire	VALVE STEM ON RIGHT FRONT WHEEL SEPARATED WHILE DRIVING ON HIGHWAY AND DESTROYED TIRE
		TOWHEEL TIRE IS RUBBED THROUGH ON SIDEWALLS REPLACE BOTH OK
		. REMOVED ALL TIRES AND SPARE BROKE DOWN ONE SIDE OF TIRE REPLACE ALL VALVE STEMS SET PSI TO FACTORY SPECS VALVE STEMS WERE LEAKING ON ALL TIRES VEHICLE FROM ANOTHER DEALER
Leaks	CUST STATES CHECK ALL TIRES PLUS SPARE VALVE STEMS LEAKING CHECK AND ADVISE	CUSTOMER STATES TIRES LEAK DOWN AND MUST ADD AIR ALL THE TIME
Leaks	CHECK REAR TIRE LOSING AIR	REPAIR DEFECTIVE VALVE STEM
Leaks	CUSTOMER STATES TIRE LOOSES AIR CHECK AND ADVISE	PUT TIRE IN WATER TANK, FOUND VALVE STEM LEAKING REPLACE D VALVE STEM OK AT THIS TIME
Cracked	CUSTOMER STATES RT REAR TIRE LOOSING AIR AND HAS A BULGE IN IT, PLEASE CHECK AND ADVISE BULGE IN IT, PLEASE CHECK AND ADVISE BULGE IN IT, PLEASE CHECK AND ADVISE	TIRE FLAT NO HOLE FOUND IN TIRE VALE STEM CRACKED AND LEAKING ALO FOUND ALL OTHER VALVE STEMS TO BE BADLY CRACKED REPLACE ALL VALVE STEMS(4) REPLACED STEM LEAKING REPLACED
Leaks	CHECK PASS REAR FOR FLAT.. CUST STATES POSS VALVE STEM.....CHECK AND ADV....	VALVE STEM RIGHT REAR TIRE LEAKING AT BASE DIAG AND FIND VALVE STEM HAD FAILED R&I TIRE AND REPLACED VALE STEM
TPMS light	LOW TIRE PRESSURE INDICATOR IS ON AND LT. REAR TIRE IS LOW. CUSTOMER REPORTS ALL VALVE STEMS ARE CRACKED AND LEAKING AIR	REMOUNT AND BALLANCE TIRE
Cracked		1 REPLACE ALL VALVE STEMS
Leaks	THE LEFT FRT TIRE IS LOOSING AIR AROUND VALVE STEM AREA	REMOVE TIRE REPLACE VALVE STEM REBALANCE TIRE

Leaks	CUSTOMER STATES FRONT TIRE GOING FLAT	CHECKED OUT TESTED FOR LEAK AND REPLACED VALVE STEM MOUNT AND BALANCE TIRE INSTALLED TIRE OK
Leaks	TIRE PRESSURE ON LEFT REAR TIRE GOES FLAT	REPLACE LEFT REAR VALVE STEM LEAKING
Leaks	CHECKED TIRE FOR LEAK R/F(B65)	INSPECT AND VERIFY R/F TIRE LEAKING, REPLACED VALVE STEM REBALANCED AND RESEALED
Broken	TIRE IS LOSING AIR	1 REMOVED AND REPLACED BROKEN VALVE STEM
Cracked	CK ALL VALVE STEMS CRACKED LEAKING AND ESPECIALLY CK ONE IN REAR REPAIR AND PUT BACK ON LEFT FRT	INSPECTED ALL VALVE STEMS ALL CRACKED LF VALVE STEM CAUSED TIRE TO GO FLAT AND NEC TO REPLACE TIRE RUINED
Cracked	GENERAL QUICK LANE REPAIRS TC8 CUST STATES VALVE STEMS ARE SPLITTING AND LOOSING AIR PRESSURE	REPL. ALL VALE STEMS BALANCE.
Leaks	CUST STATES DRIVERS FRONT TIRE LOOSES AIR	31416 VALVE STEM LOOSES AIR 30 REPLACED L FRONT TIRES VALVE STEM BALANCE AND SET PSI
Dry rotted	CUSTOMER REPORTS CHECK ALL TIRES, VALVE STEMS ARE ROTTED, BOTH REAR TIRES WENT FLAT. CHECK ALL WHEELS CUSTOMER STATES THAT ALL VALVE STEMS ARE ROTTED	4604 DIAG INSPECTED VALVE STEMS FRO TIRES AND FOUND THEY WERE ALL LEAKING AIR.REPLACED ALL 4 STEMS. 5900 CHECKED VALVE STEMS AND THEY WERE ROTTED. REPLACDE 4 VALVE STEMS.
Dry rotted	CHECK ALL WHEELS CUSTOMER STATES THE VALVE STEMS ARE ROTTED.	8346 INSPECTED VALVE STEMS AND FOUND THEY WERE DRY ROTTED.REPLACED 4 VALVE STEMS.
Dry rotted	CHECK ALL TIRES CUSTOMER STATES VALVE STEMS ARE ROTTED AND LEAKING.	19555 REPLACE ALL FOUR VALVE STEMS 1.6 HRS LABOR BROKE DOWN TIRE REPLACED VALVE STEM
Leaks	RT REAR VALVE STEM LEAKING	DIAGNOSED CONCERN AND REPLACED LEAKING VALVE STEM AS NEEDED.
	CHECK R F TIRE LEAKING	

Wheel Valve Stem Field Return Catalog

No.	VIN	MY	Make	Model	Tire Size	Tire Mfg	Tire Brand	Wheel Size	Wheel Mat'l	Whl Mfg	Bld date	Sale Date	Mileage	Repair Date	Dealer/Owner Location	Sample #1	Sample#2	Sample #3	Sample#4	Sample #5
1	1ZVFT80N477	2007	Ford	Mustang	P235/55ZR17 99W A/S	Pirelli	PZERO NERO M&S 98W	17x8.0	Aluminum	Superior	18-Apr-07	25-Sep-07	10,292	19-May-08	Devine, TX	Topseal TR414 Mid #6 Cavity #14	Topseal TR414 Mid #6 Cavity #36	Topseal TR414 Mid #6 Cavity #149	Topseal TR414 Mid #8 Cavity #140	NA
2	2FAFP71W27X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	18-Jan-07	9-Feb-07	Unknown	Parts Received @ Ford PDC April 21,2008	Florida State Police	Topseal TR414 Valves sent to Central Lab before Mid and Cavity information record	Topseal TR414 Valves sent to Central Lab before Mid and Cavity information record	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
3	2FAAP71W37X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	27-Nov-06	19-Dec-06	Unknown	Parts Received @ Ford April 21,2008	Florida State Police	Topseal TR414 Mid #6 Cavity #181	Topseal TR414 Mid #6 Cavity #65	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
4	2FAP71W57X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	27-Sep-06	8-Nov-06	27,509	21-May-08	St. John County Sheriff, Florida	Topseal TR413 Mid #5 Cavity #45 Non Production Valve	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
5	2FAP71W47X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	21-Sep-06	31-Oct-06	Unknown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #99	(**) Topseal TR414 Mid #8 Cavity #108	(**) Topseal TR414 Mid #6 Cavity #115	(**) Topseal TR414 Mid #6 Cavity #143	Valve stem not returned for identification
6	2FAP71W87X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	22-Sep-06	24-Oct-06	Unknown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #8 Cavity #168	(**) Topseal TR414 Mid #8 Cavity #89	(**) Topseal TR414 Mid #6 Cavity #78	(**) Topseal TR414 Mid #6 Cavity #172	Valve stem not returned for identification
7	2FAP71W67X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	21-Sep-06	24-Oct-06	Unknown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #33	(**) Topseal TR414 Mid #6 Cavity #23	(**) Topseal TR414 Mid #6 Cavity #114	(**) Topseal TR414 Mid #6 Cavity #92	Valve stem not returned for identification
8	2FAP71W97X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17x17.5	Steel	Hayes	1-Feb-07	6-Mar-07	Unknown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #158	(**) Mfg Unknown TR413 Non Production Valve	(**) Mfg Unknown TR413 Non Production Valve	Valve stem not returned for identification	Valve stem not returned for identification
9	1FMCU49H28 (VIN Not Found)	2008	Ford	Escape	TBD	TBD	TBD	TBD	TBD	TBD	TBD	TBD	16,580	Parts Received @ Ford PDC July 16,2009	Palm Beach County Mgmt.	Topseal TR414 Mid #8 Cavity #87	Topseal TR414 Mid #8 Cavity #183	Topseal TR414 Mid #8 Cavity #59	Topseal TR414 Mid #8 Cavity #183	Valve stem not returned for identification
10	1FMCU92Z087 (Same VIN as #12)	2008	Ford	Escape	P235/70R-16T BSW A-S	Continental	ContiTrac 104T	TBD	TBD	TBD	24-Jan-07	6-Apr-07	19,703	Parts Received @ Ford PDC July 7,2008	Palm Beach County Mgmt.	Topseal TR414 Mid #8 Cavity #14 Sample given to G. Gunlock for Exec. Garage Review	Topseal TR414 Mid #8 Cavity #172 Samples given to D. Rohweder for analysis	Topseal TR414 Mid #8 Cavity #59 Samples given to D. Rohweder for analysis	Topseal TR414 Mid #8 Cavity #20 Samples given to D. Rohweder for analysis	Valve stem not returned for identification
11	1FMCU49H58K	2008	Ford	Escape	P235/70R-16T BSW A-S	Continental	ContiTrac Eco Plus 104T	TBD	TBD	TBD	5-Feb-07	26-Feb-07	12,948	Parts Received @ Ford PDC July 7,2008	Palm Beach County Mgmt.	Topseal TR414 Mid #7 Cavity #150 Returned to Baolong (Raul)	Topseal TR414 Mid #8 Cavity #84	Topseal TR414 Mid #8 Cavity #62 Returned to Baolong (Raul)	Topseal TR414 Mid #6 Cavity #44 Returned to Baolong (Raul)	Valve stem not returned for identification
12	1FMCU92Z087 (Same VIN as #10)	2008	Ford	Escape	P235/70R-16T BSW A-S	Continental	ContiTrac 104T	TBD	TBD	TBD	24-Jan-07	6-Apr-07	19,731	Parts Received @ Ford PDC July 7,2008	Palm Beach County Mgmt.	Topseal TR414 Mid #8 Cavity #138 Returned to Baolong (Raul)	Topseal TR414 Mid #8 Cavity #145 Returned to Baolong (Raul)	Topseal TR414 Mid #8 Cavity #145 Returned to Baolong (Raul)	Topseal TR414 Mid #8 Cavity #124	Valve stem not returned for identification
13	1FCMU59H08K (VIN Not Found)	2008	Ford	Escape	TBD	TBD	TBD	TBD	TBD	TBD	TBD	TBD	10,854	Parts Received A Ford PDC	Palm Beach County Mgmt.	(**) Topseal TR414 Mid #8 Cavity #170	(**) Topseal TR414 Mid #8 Cavity #109	(**) Topseal TR414 Mid #8 Cavity #129	(**) Topseal TR414 Mid #8 Cavity #112	Valve stem not returned for identification
14	1FMCU49H08KA12159	2008	Ford	Escape	P235/70R-16T BSW A-S	Continental	ContiTrac Eco Plus 104T	TBD	TBD	TBD	8-Feb-07	26-Feb-07	14,835	Parts Received A Ford PDC	Palm Beach County Mgmt.	(**) Topseal TR414 Mid #8 Cavity #186	(**) Topseal TR414 Mid #7 Cavity #98	(**) Mfg Unknown TR413 Non Production Valve	Valve stem not returned for identification	Valve stem not returned for identification

Wheel Valve Stem Field Return Catalog

No.	VIN	MY	Make	Model	Tire Size	Tire Mfg	Tire Brand	Wheel Size	Wheel Mat'l	Whl Mfg	Bld date	Sale Date	Mileage	Repair Date	Dealer/Owner Location	Sample #1	Sample#2	Sample #3	Sample#4	Sample #5
15	1FMCU59HX8K	2008	Ford	Escape	P235/70R-16T BSW A-S	Continental	ContiTrac Eco Plus 104T	TBD	TBD	TBD	23-Jan-07	22-Mar-07	21,136	Parts Received A Ford PDC	Palm Beach County Mgmt.	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
16	1FTRX12W17	2007	Ford	F150	P235/70R 17 A/S BSW TIRES	Hankook	DynaPro AS	17 inch	TBD	TBD	31-Jan-07	21-Feb-07	14,460	Parts Received A Ford PDC	Palm Beach County Mgmt.	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
17	1FTRX12W17	2007	Ford	F150	P235/70R 17 A/S BSW TIRES	Hankook	DynaPro AS	17 inch	TBD	TBD	7-Feb-07	22-Mar-07	13,614	Parts Received A Ford PDC	Palm Beach County Mgmt.	Topseal TR414 Mld #8 Cavity #15	Topseal TR414 Mld #8 Cavity #22	Topseal TR414 Mld #8 Cavity #115	Topseal TR414 Mld #8 Cavity #70	Valve stem not returned for identification
18	1FTPF12V47K	2007	Ford	F150	P235/70R 17 A/S BSW TIRES	Hankook	DynaPro AS	17 inch	TBD	TBD	22-Jan-07	7-Feb-07	16,983	Parts Received @ Ford PDC July 7,2008	Lakewood Fordland/DL Peterson Ph&H	Valve bulb missing from returned part. Could not identify Mfg.	Valve bulb missing from returned part. Could not identify Mfg.	Valve bulb missing from returned part. Could not identify Mfg.	Valve bulb missing from returned part. Could not identify Mfg.	Valve stem not returned for identification
19	VIN Not Identified - Valve stems return via Robert Jackson	2007	Ford	Crown Vic	TBD	TBD	TBD	17 inch	TBD	TBD	TBD	TBD	TBD	TBD	Woody Anderson Ford	Topseal TR414 Mld #6 Cavity #190	Topseal TR414 Mld #8 Cavity #57	Topseal TR414 Mld #8 Cavity #170	Topseal TR414 Mld #6 Cavity #171	Valve stem not returned for identification
20	1FTPF12V27K	2007	Ford	F150	P235/70R 17 A/S BSW TIRES	Hankook	DynaPro AS	17 inch	TBD	TBD	22-Jan-07	6-Feb-07	9,770	31-Jul-08	Cherokee Ford / Comcast	Topseal TR414 Mld #8 Cavity #154	Topseal TR414 Mld #8 Cavity #147	Topseal TR414 Mld #8 Cavity #45	Topseal TR414 Mld #8 Cavity #156	Topseal TR414 Mld #8 Cavity #89
21	1FTPF12VX7K	2007	Ford	F150	P235/70R 17 A/S BSW TIRES	Hankook	DynaPro AS	17 inch	TBD	TBD	22-Jan-07	6-Feb-07	28,091	31-Jul-08	Cherokee Ford / Comcast	Topseal TR414 Mld #6 Cavity #95 Returned w/Non Prod Pacific cap	Topseal TR414 Mld #6 Cavity #15	Topseal TR414 Mld #6 Cavity #119	Topseal TR414 Mld #6 Cavity #25	Topseal TR414 Mld # Cavity #190
22	1FTRX14W77N	2007	Ford	F150	LT245/70R17D BSW A/T	General	Grabber TR 114/110S	17 inch	TBD	TBD	12-Feb-07	27-Mar-07	26,575	Parts Received @ Ford PDC August 18th,2008	Georgia Power	Topseal TR414 Mld #8 Cavity #178	Topseal TR414 Mld #8 Cavity #129	Valve stem not returned for identification	Valve stem not returned for identification	Valve stem not returned for identification
23	1FTPF12V77K	2007	Ford	F150	P235/70R 17 A/S BSW	Hankook	DynaPro AS	17 inch	TBD	TBD	22-Jan-07	7-Feb-07	15,226	25-Jul-08	Cherokee Ford / Comcast	Topseal TR414 Mld #8 Cavity #095 Right Front Sample given to C. Mracna (Central Lab)	Topseal TR414 Mld #8 Cavity #148 Left Front Sample given to C. Mracna (Central Lab)	Topseal TR414 Spare Sample given to C. Mracna (Central Lab)	Valve stem not returned for identification	Valve stem not returned for identification
24	1FTPF12V88K	2008	Ford	F150	P235/70R 17 A/S BSW	Hankook	DynaPro AS	17 inch	TBD	TBD	23-Jan-08	7-Feb-08	3,383	25-Jul-08	Cherokee Ford / Comcast	Topseal TR414 Mld #6 Cavity #59 Spare Sample given to C. Mracna (Central Lab)	Topseal TR414 Mld #6 Cavity #161 Sample given to C. Mracna (Central Lab)	Topseal TR414 Mld #6 Cavity #033	Topseal TR414 Mld #6 Cavity #153	Topseal TR414 Mld #11 Cavity #095 Right Front
25	1ZVHT84N2	2007	Ford	Mustang	P235/55ZR17 99W A/S	Pirelli	PZERO NERO M&S 98W	17 inch	TBD	TBD	11-Apr-07	13-Oct-07	14,388	4-Aug-08	LEITH FORD	Topseal TR414 Mld #6 Cavity #168	Topseal TR414 Mld #6 Cavity #39	Topseal TR414 Mld #6 Cavity #59	Topseal TR414 Mld #6 Cavity #167	Valve stem not returned for identification
26	1FAPP31N17V	2007	Ford	Focus	P195/60R 15T BSW	Hankook	Optimo H725	TBD	TBD	TBD	19-Dec-06	12-Mar-07	9,725	16-Jun-08	FIESTA FORD, INDIO C	Topseal TR414 Mld #8 Cavity #194	NA	NA	NA	NA
27	3FAHP0812	2007	Ford	Fusion	P225/50VR 17	Michelin	Pilot HX MXM4 93V	17 inch	TBD	TBD	5-Jan-07	3-Mar-07	23,592	4-Sep-08	RICH FORD LINCOLN-MERCURY - ARCHBOLD, OH	Topseal TR414 Mld #8 Cavity #132	Topseal TR414 Mld #8 Cavity #105	Topseal TR414 Mld #8 Cavity #98	Topseal TR414 Mld #8 Cavity #146	NA
28	3FAHP08177F	2007	Ford	Fusion	P225/50VR 17	Michelin	Pilot HX MXM4 93V	17 inch	TBD	TBD	16-Jan-07	28-Apr-07	9,181	6-Sep-08	FIVE STAR FORD - NORTH RICHLAND HILLS, TX	Topseal TR414 Mld #8 Cavity #37	Topseal TR414 Mld #8 Cavity #114	Topseal TR414 Mld #8 Cavity #150	Topseal TR414 Mld #8 Cavity #121	Topseal TR414 Mld #8 Cavity #104


(\*) Valve stems received did not identify from which vehicle VIN numbers that they were removed from

# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update


Crown Vic/Grand Marquis
Mustang
F150
Edge/MKK
Expedition/Navigator
Ranger

15 Inch Wheels		D2SHC D2SHD D2SHG D2SHB D2SHB D2SC4 D2SC5 D2SAF																														
X AXIS	Valve Stem Flex Angle	15	15	21	25	26	40	40	42																							
Y AXIS	R/1000	0.16	0.1	0	0	0	4.02	1.1	0.04																							
16 Inch Wheels		D2XAH D2XGQ D2YB8 D2XE5 D2XCU D2XCT D2XFQ D2XTV D2XAH D2XTN D2XVD D2XVE D2XCP D2XD9																														
X AXIS	Valve Stem Flex Angle	22	32	32	42	42	42	42	29	42	20	23	27	29	29																	
Y AXIS	R/1000	0.07	0.46	0.00	0.00	0.08	5.43	1.22	0.02	0.00	0	0.00	0.16	0	0																	
17 Inch Wheels		D2YCN D2YAE D2YCA D2YF7 D2YFE D2YBB D2YEA D2YBA D2YBC D2YFZ D2YM1 D2YMI D2YCA D2FAT D2YG3 D2YEA D2YEW D2YE3 D2YFE D2YEG																														
X AXIS	Valve Stem Flex Angle	24	25	35	25	50	17	28	30	30	32	32	36	17	21	30	31	31	40	44	45											
Y AXIS	R/1000	0	0	0.39	0.06	7.19	0.05	0	0.62	0.71	0.06	0.15	1.89	0	0.06	0.1	0	0.06	0	2.45	0.03											
18 Inch Wheels		D2UVE D2UBW D2UCW D2UBY D2UDH D2UCL D2UBS D2ULK D2UB8 D2UB8 D2UDN D2UBF D2ULK D2UAJ D2UCS D2UB7 D2ULS D2UAK D2UCV D2UVD D2ULS D2ULU D2ULR D2ULT D2UBY D2UBY D2UBZ D2UAJ D2UB7 D2UAN D2UBX																														
X AXIS	Valve Stem Flex Angle	22	25	31	31	33	33	36	24	25	25	26	27	27	30	30	31	31	32	32	21	27	29	30	41	14	22	23	26	30	33	41
Y AXIS	R/1000	0.13	0	1.15	0	0	0	0.1	0	0	0	0.09	0	0.23	0.29	0	0	0.33	0.18	0.07	0.68	0	0.05	3.66	0	0	0	0	0	0	0	1.29
20 Inch Wheels		D2FAT D2FAK D2FAK D2FAU D2FA4 D2FA7 D2FAV D2FAS																														
X AXIS	Valve Stem Flex Angle	21	25	25	25	28	24	24	29																							
Y AXIS	R/1000	0	0.02	0.02	0	0	0	0																								


# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

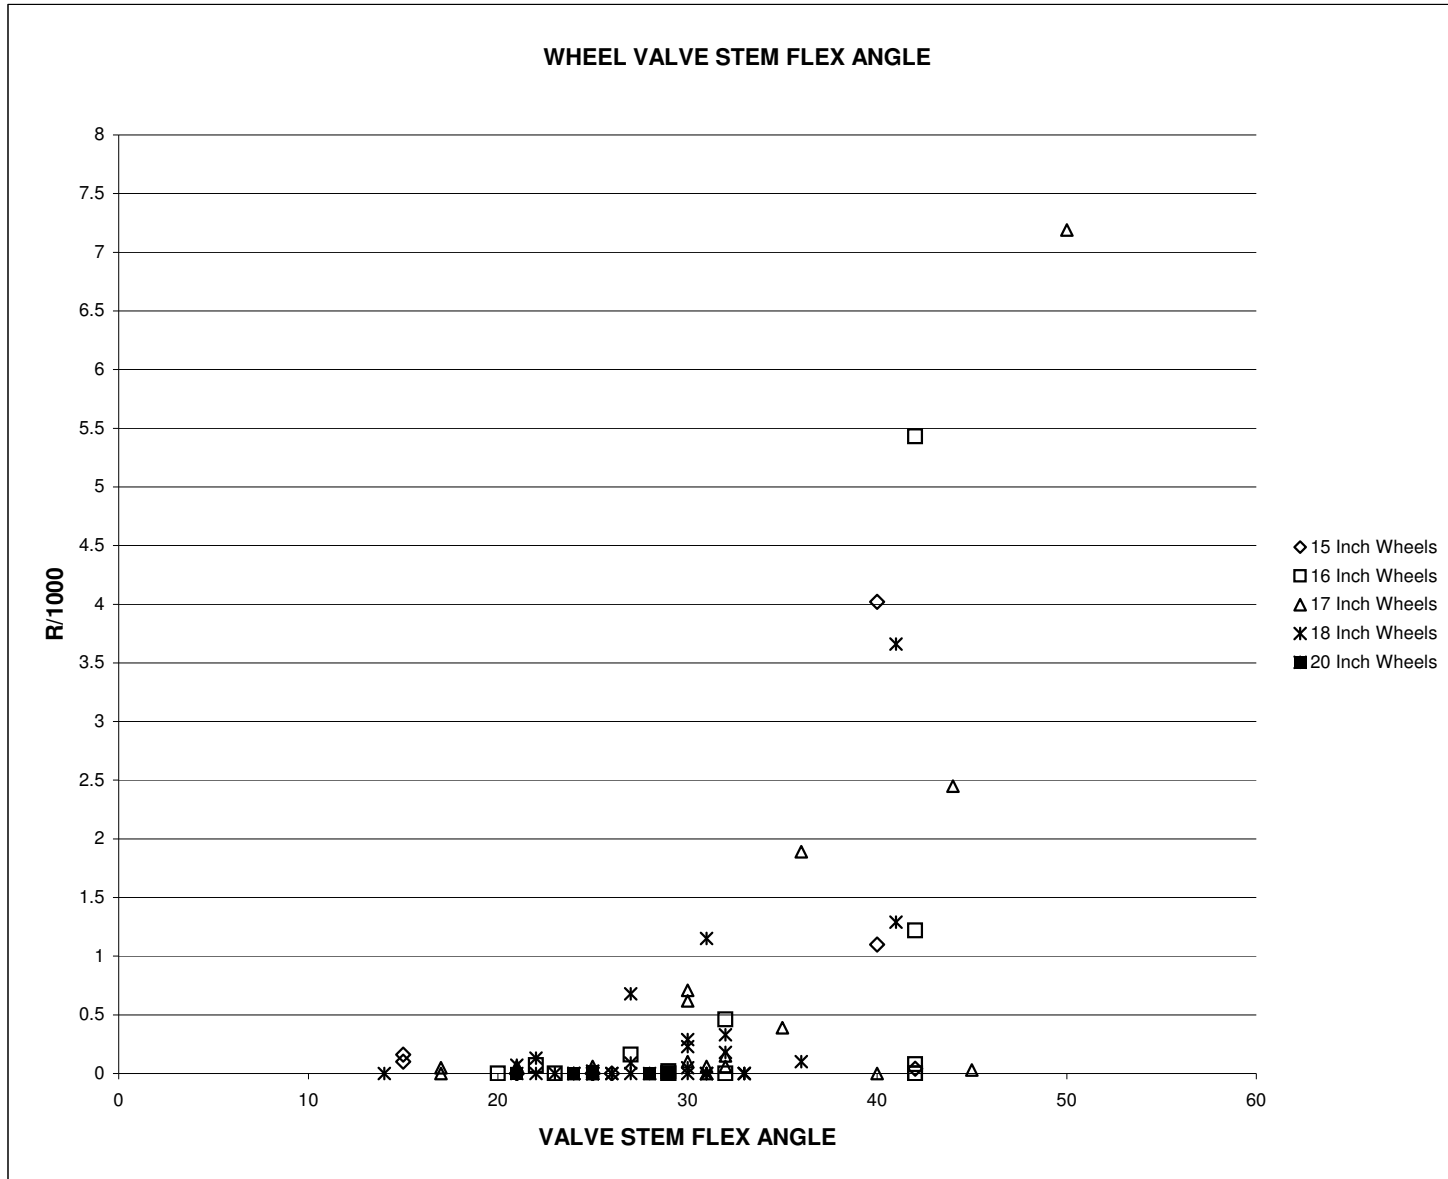

# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

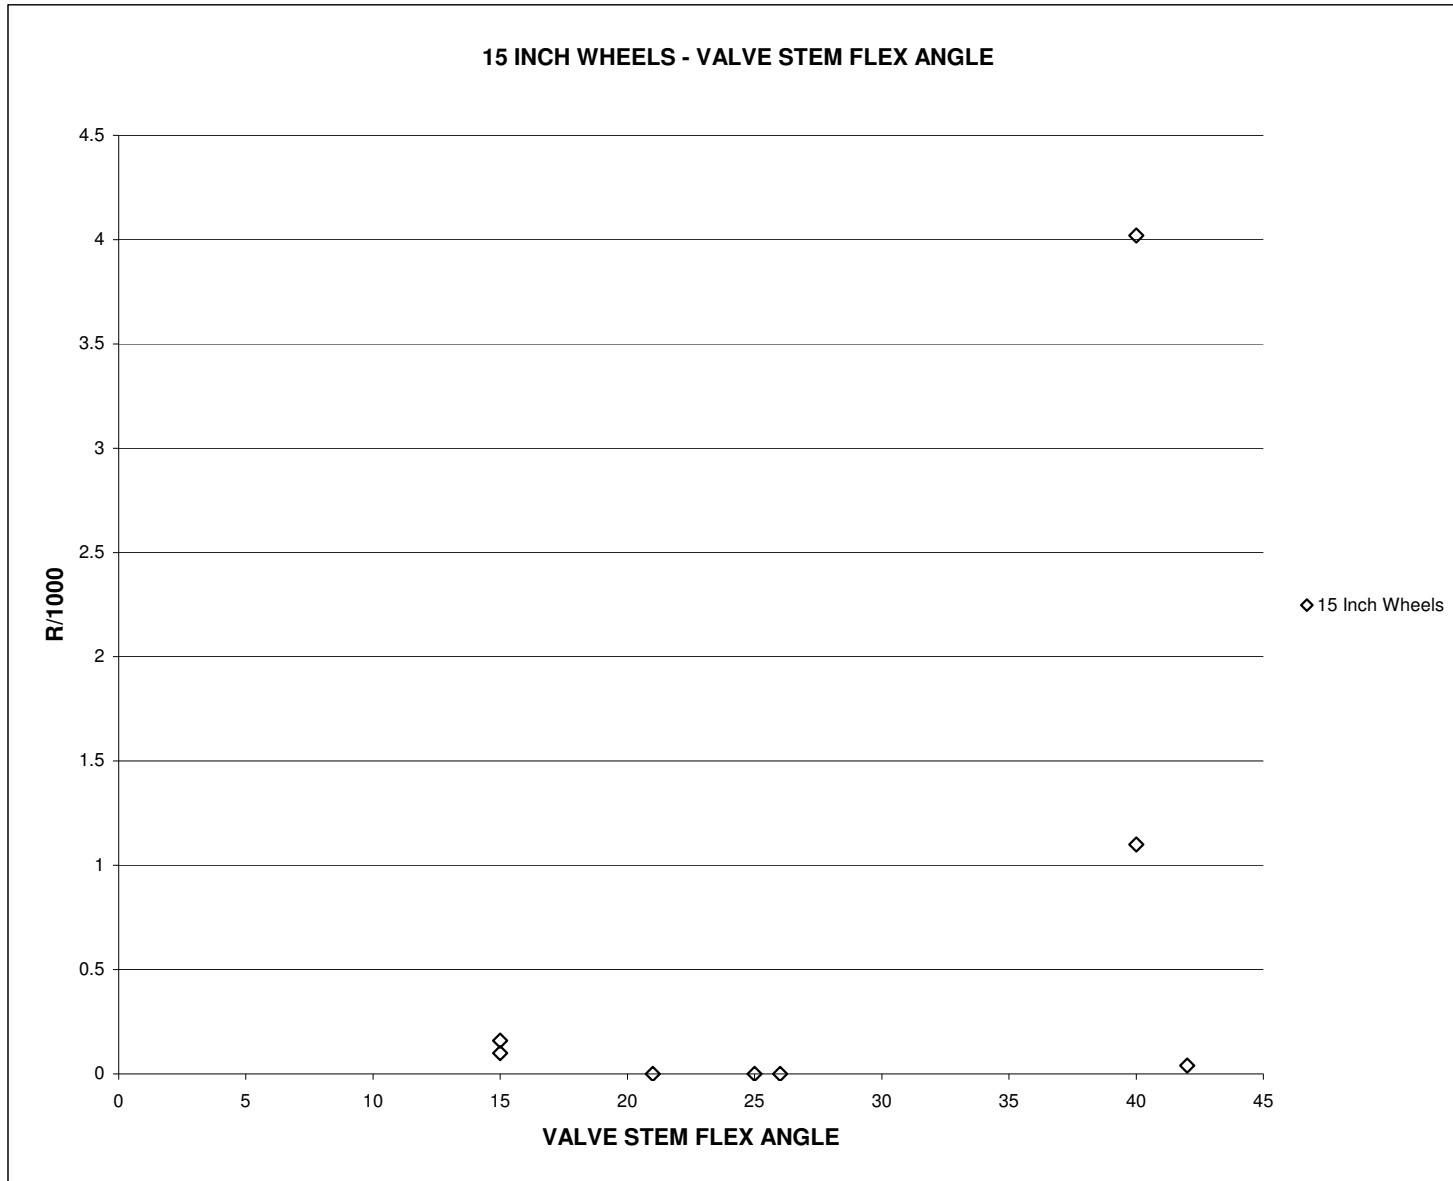


WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

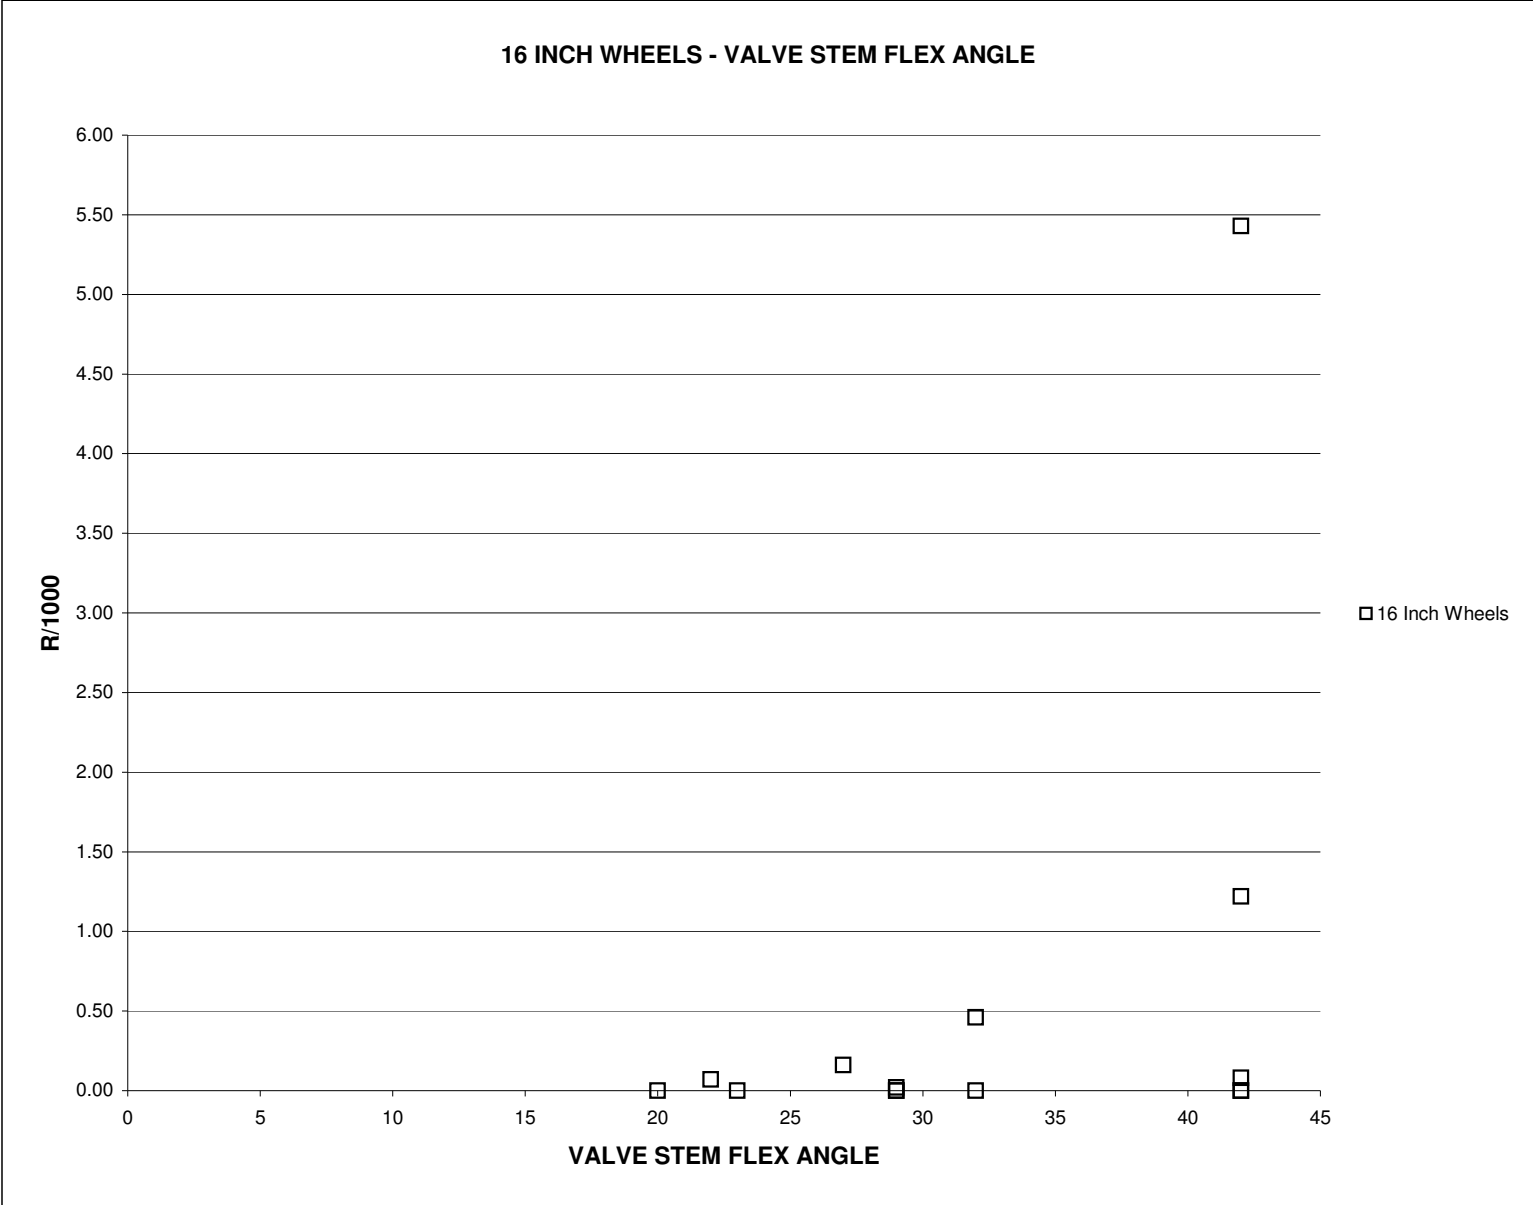





# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

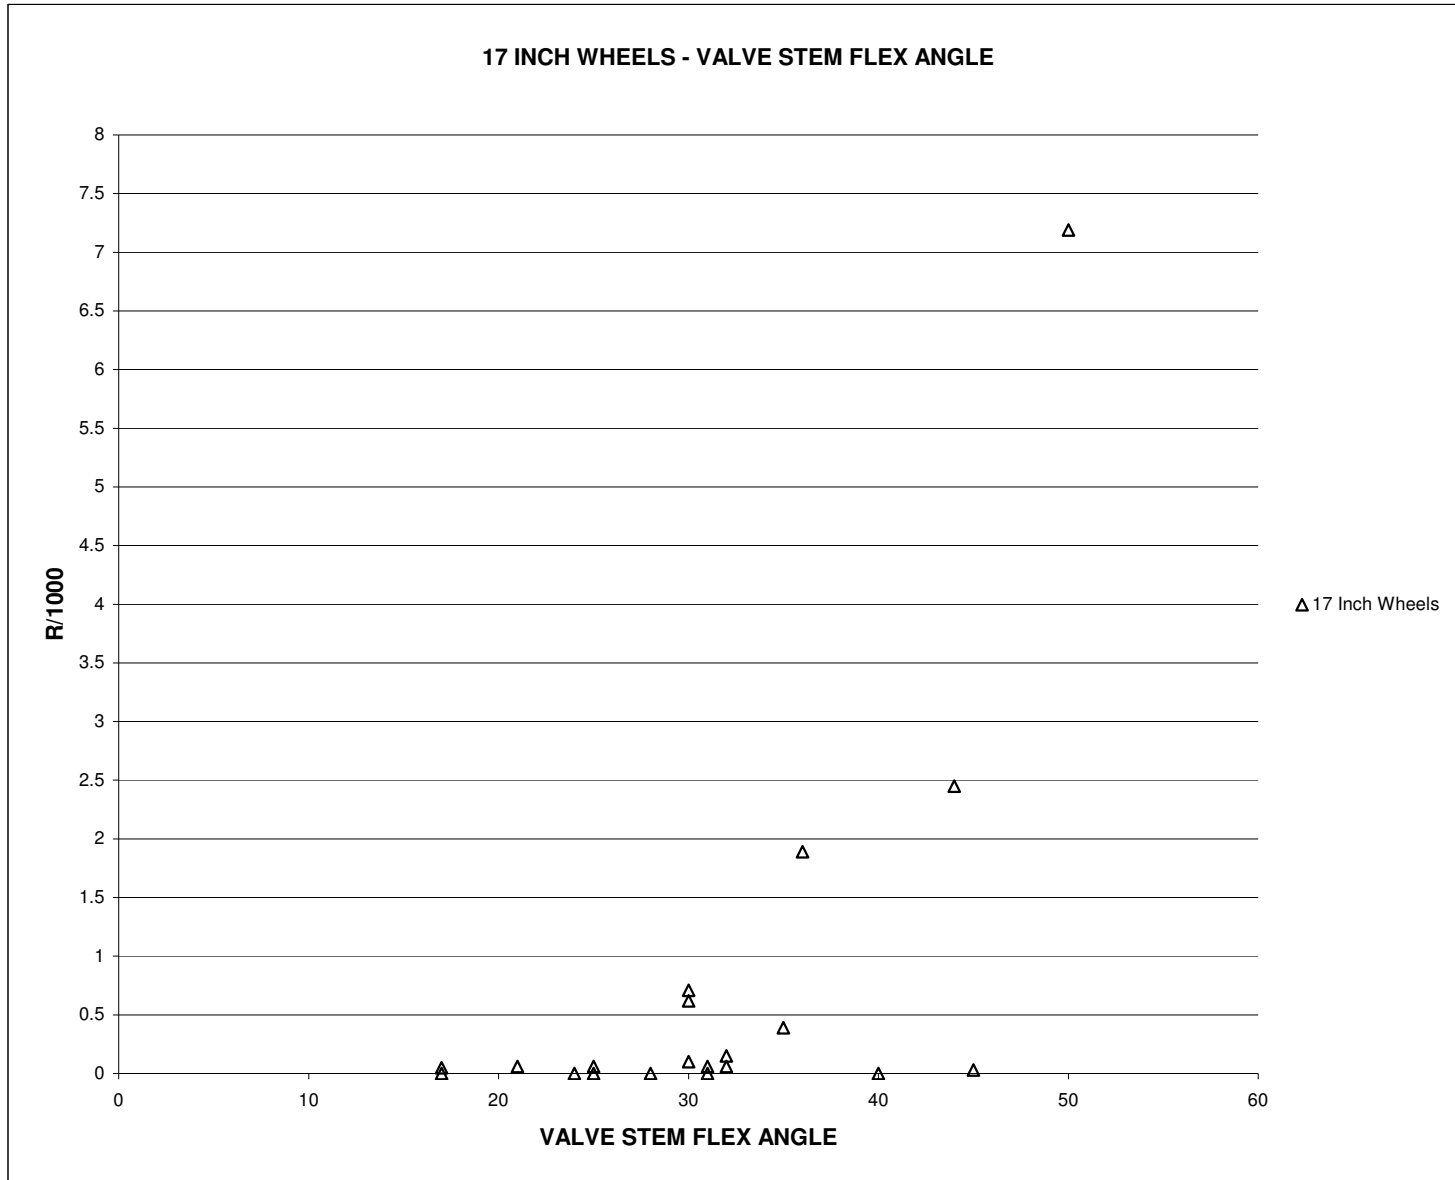

# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

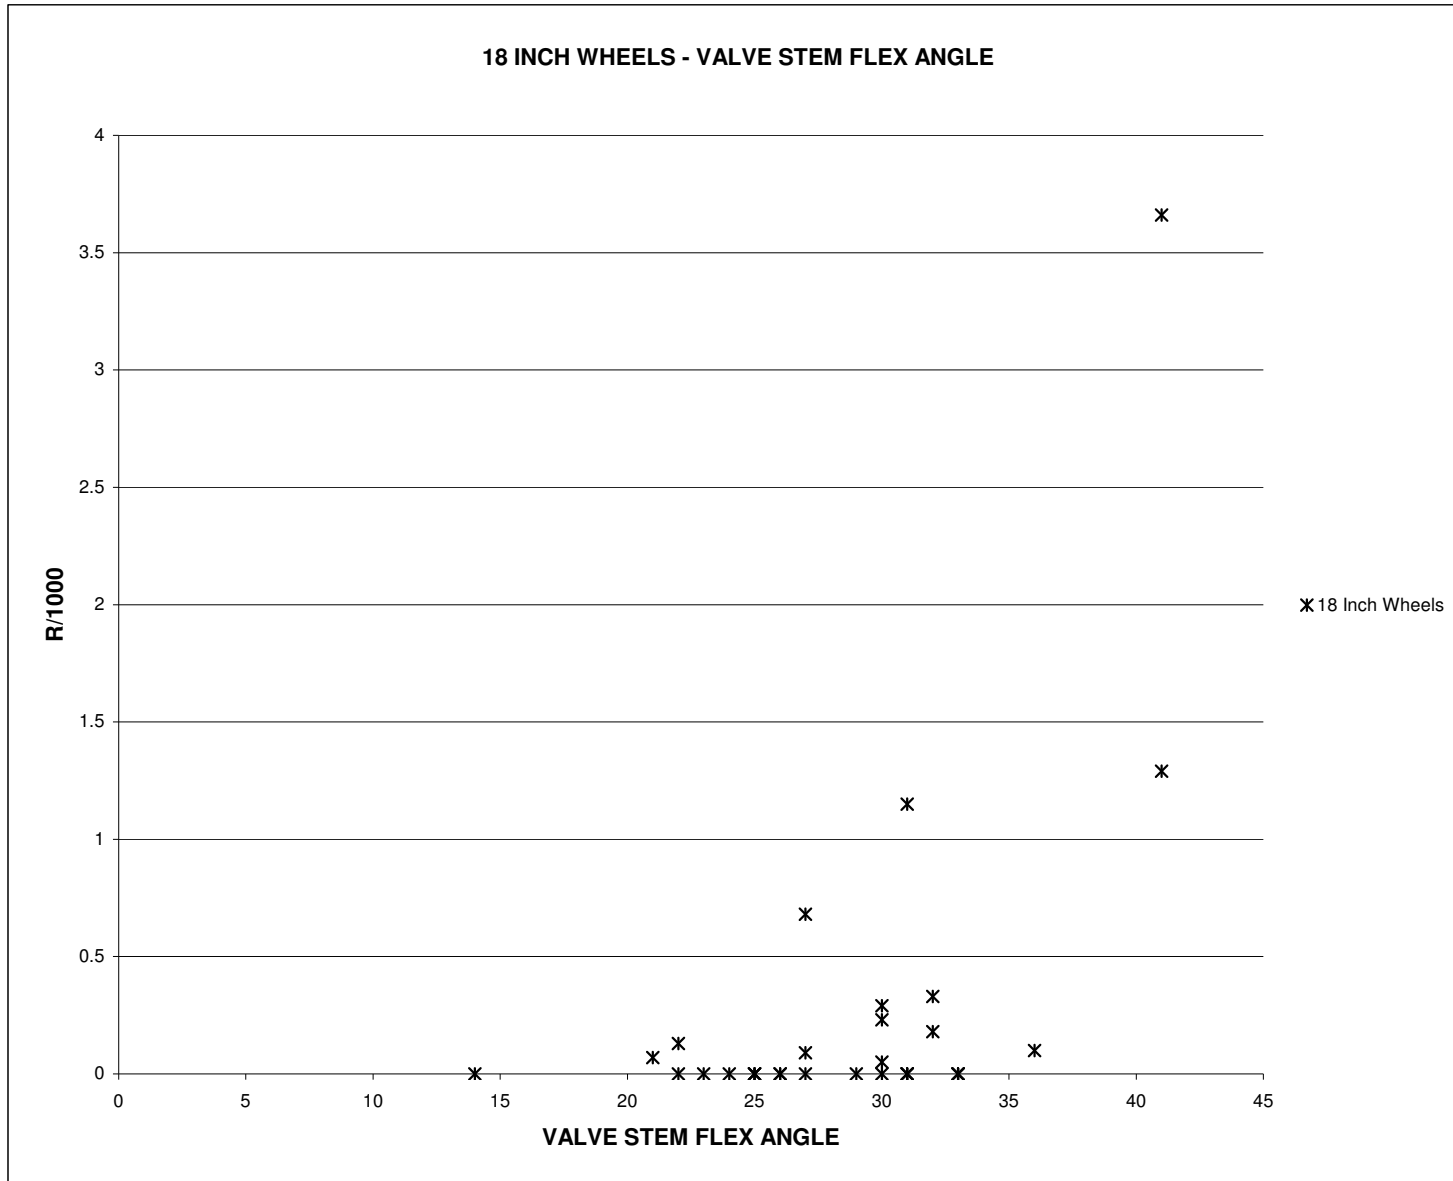

# WHEEL VALVE STEM FLEX ANGLE - September 2008 Update

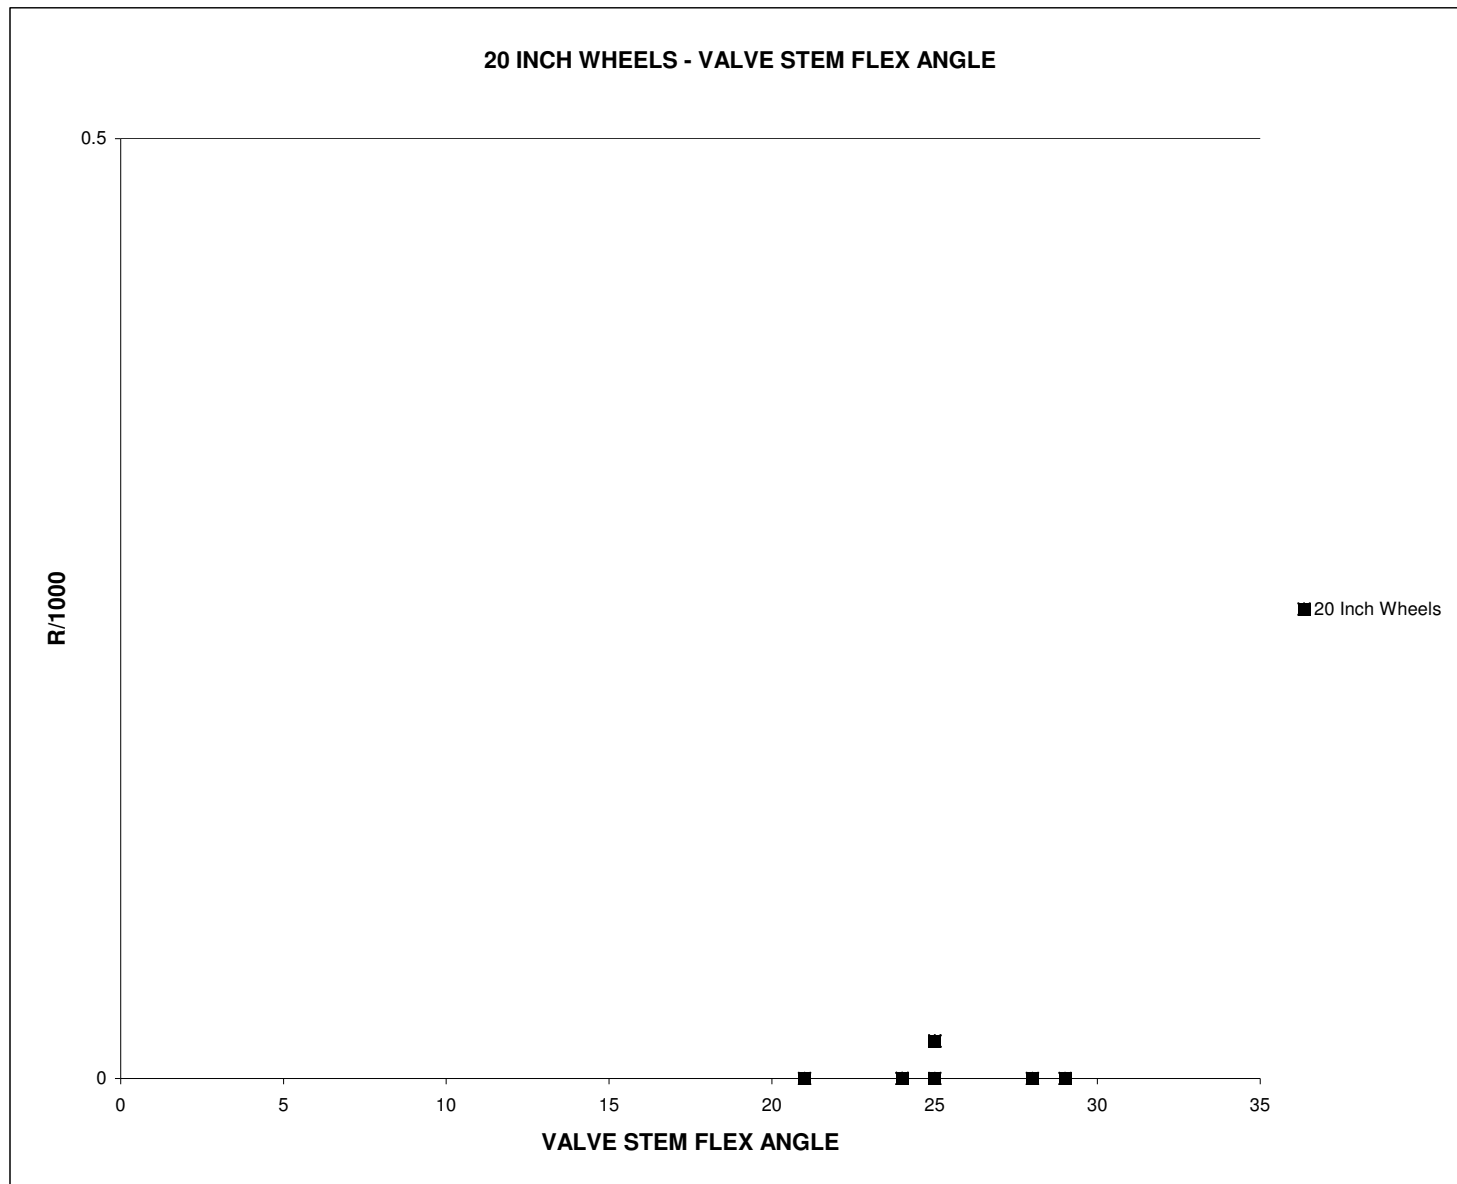

FHP#	YR	Color	Make	Model	VIN	District	Valve		Build
1100	7	CB	Ford	CVPI	2FAHP71W07X	LC			
1101	7	CB	Ford	CVPI	2FAHP71W67X	CC			
1154	7	cb	Ford	CVPI	2FAHP71W67X	LC	Y		11/23/2006
1237	7	Cb	Ford	CVPI	2FAHP71W07X	OC			
1272	7	CB	Ford	CVPI	2FAHP71W27X	LC	Y		1/18/2007
1279	7	CB	Ford	CVPI	2FAHP71W27X	OC	Y		11/23/2006
1418	7	CB	Ford	CVPI	2FAHP71W87X	OC	Y		1/17/2007
1493	7	CB	Ford	CVPI	2FAHP71W47X	GV			
1558	7	CB	Ford	CVPI	2fahP71w37X	LC			
1562	7	CB	Ford	CVPI	2FAHP71W67X	CC			
1641	7	CB	Ford	CVPI	2FAHP71W37X	OC	Y		11/23/2006
192	7	For	Ford	CVPI	2FAHP71W17X	GV			
1952	7	CB	Ford	CVPI	2FAHP71W27X	LC			
1963	7	CB	Ford	CVPI	2FAHP71W87X	CC	Y		1/16/2007
2041	7	CB	Ford	CVPI	2fahp71w67X	OC	Y		1/16/2007
2143	7	CB	Ford	CVPI	2FAHP71W87X	LC	Y		1/18/2007
2145	7	Cb	Ford	CVPI	2FAHP71W97X	GV			
2147	7	CB	Ford	CVPI	2FAHP71W27X	LC			1/17/2007
267	7	CB	Ford	CVPI	2FAHP71W47X	LC			
284	7	CB	Ford	CVPI	2FAHP71W77X	GV			
306	7	CB	Ford	CVPI	2FAHP71W87X	LC			10/26/2006
338	7	CB	Ford	CVPI	2FAHP71W67X	CC			
393	7	CB	Ford	CVPI	2FAHP71W47X	GV			11/23/2006
53	7	CB	Ford	CVPI	2FAHP71W37X	OC			3/2/2007
549	7	cb	Ford	CVPI	2FAHP71W17X	GV			
676	7	CB	Ford	CVPI	2FAHP71W57X	OC	Y		11/22/2006
725	7	CB	Ford	CVPI	2FAHP71W57X	CC			
879	7	cb	Ford	CVPI	2FAHP71W97X	GV	Y		11/23/2006
885	7	CB	Ford	CVPI	2FAHP71W47X	OC	Y		11/22/2006
889	7	cb	Ford	CVPI	2FAHP71W47X	GV			
928	7	CB	Ford	CVPI	2Fahp71w37X	LC			

---

**From:** Yao, Michael (G.C.)  
**Sent:** Thursday, May 29, 2008 9:16 PM  
**To:** Camilleri, Robert (R.H.)  
**Subject:** RE:

**Attachments:** warranty.xls

Robert, currently I can't know due to label and parts have been separated and not one-to-one correspondence. I copy the VIN from label into attached.  
There are different Mark text on the valve so that distinguish them from different supplier. thanks



warranty.xls  
(20 KB)

Best Regards

Yao GuoCheng (Michael)

---

**From:** Camilleri, Robert (R.H.)  
**Sent:** 2008年5月29日 23:21  
**To:** Yao, Michael (G.C.)  
**Subject:** RE:

Michael do you have the VIN numbers for the returned parts? Do you have identified by VIN, which where the Baolong valves and which where not? Thanks

---

**From:** Yao, Michael (G.C.)  
**Sent:** Wednesday, May 28, 2008 3:56 AM  
**To:** Camilleri, Robert (R.H.)  
**Cc:** Xu, Jackie (N.J.); Campbell, Keith (K.A.)  
**Subject:** RE:

All the parts number which I ordered are 7L34-1700-AA. The vehicle is following,

2007MY: Grand Marquis, Mustang, Focus, Fusion, ZEPHYR.  
2006MY: Fusion, Five Hundred.

Most of them are from Mustang.

Best Regards

Yao GuoCheng (Michael)

---

**From:** Yao, Michael (G.C.)  
**Sent:** 2008年5月27日 20:43

**To:** Camilleri, Robert (R.H.)  
**Cc:** Xu, Jackie (N.J.); Campbell, Keith (K.A.)  
**Subject:** Tire valve

Robert,

Attachment shows how to order the parts from warranty center. I booked them by this. I sent 27 pcs to BaoLong but 11 pcs are from BaoLong. Others are from Schrader, Dill, SBR, WanTong(China), HuangHai(China). We can't make sure what's dealer's process and why have so many kinds tire valve. I will sent to you what's vehicle line tomorrow.

<< File: Warranty Part.doc >> << File: My request.pdf >>

*Make everyday exciting!*

*Yao GuoCheng (Michael)* 姚国成

**Chassis Engineer**  
**Ford Motor Research & Engineering (Nanjing) Co., Ltd**  
☎: 86 -25- 51187917

Veh	VIN	ENG
2007 MUSTANG	1ZVFT80NX75 [REDACTED]	7L341700AA
	1ZVFT82H175 [REDACTED]	
	1ZVFT82HX75 [REDACTED]	
	1ZVFT82H775 [REDACTED]	
	1ZVFT80N875 [REDACTED]	
2007 FOCUS	1FAFP34N27W [REDACTED]	
	1FAFP31N67W [REDACTED]	
	1FAHP36N37W [REDACTED]	
	1FAFP34N27W [REDACTED]	
	1FAFP34N27W [REDACTED]	
2007 FUSION	3FAHP06Z27R [REDACTED]	
	3FAHP011X7R1 [REDACTED]	
2006 FUSION	3FAFP08146R [REDACTED]	
2006 FIVE HUNDRED	1FAFP24156G [REDACTED]	
2007 GRAND MAROUTIS	2MEFM74VX7X [REDACTED]	
2007 ZEPHYR/MKZ	3LNHM26T67R [REDACTED]	

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Monday, May 19, 2008 12:26 PM  
**To:** Kircheis, Bryce (A.); Bush, Gary (G.); Mayberry, Debbie (Debra L.); Neilson, Eric (E.); Stavropulos, George (G.); Jansen, Michael (M.R.); Linna, Kevin (K.); Lombard, Loretta (L.); Papp, Eric (E.D.); Popejoy, Mark (M.); Raley, Allen (A.); Samples, Mark (M.J.); Tolbert, Jerry (J.); Yerk, Scott (S.); Zelecki, Tom (K.)  
**Cc:** Gunlock, George (G.W.)  
**Subject:** RE: Valve stem failures

As a follow up to the original request for Valve stems. Please let the dealer know that they are being requested to determine the root cause of the problem.

Also request the valve stem be removed as carefully as possible to avoid further damage. If the wheel is being replaced as a result of the damage, we would like to get them back still intact.

As always, a 700 tag will be issued for the request.

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Tuesday, May 13, 2008 1:32 PM  
**To:** Bush, Gary (G.); Debbie Mayberry; Eric Neilson; George Stavropulos; Jansen, Michael (M.R.); Linna, Kevin (K.); Lombard, Loretta (L.); Papp, Eric (E.D.); Popejoy, Mark (M.) (mpopejo2@ford.com); Raley, Allen (A.) (araley@ford.com); Samples, Mark (M.J.); Tolbert, Jerry (J.) (jtolbe17@ford.com); Yerk, Scott (S.); Zelecki, Tom (T.) (tzelecki@ford.com)  
**Subject:** Valve stem failures

Starting today, if we get a claim with a valve stem failure, we will need to get the parts back. This is across all vehicle lines, concentrating on 07 and newer models.

Ralph the Mustang PVT will be coordinating the collection of the valve stems at this time.

If you get a claim, please forward the claim set to me.

*Bryce Kircheis*

Group Leader  
Ford Digital Imaging  
6 Sigma Center  
15080 Commerce Dr. N  
Dearborn MI, 48120  
313-206-2017



---

**From:** Camilleri, Robert (R.H.)  
**Sent:** Friday, July 18, 2008 1:47 PM  
**To:** Dripps, David (D.S.)  
**Cc:** Gunlock, George (G.W.)  
**Subject:** RE: Report Summary for the CQIS Report#8GRAX001; P235/70R 17 A/S BSW TIRES

David, please have the entire valve stem returned. In the pictures sent, it appears that the bulb has separated from the valve body. I need valve stem bulbs and caps returned, if at all possible. Please have the valve stem from the spare tire valve stem marked as such. Contact me, if you have any questions. Thanks

---

**From:** Gunlock, George (G.W.)  
**Sent:** Friday, July 18, 2008 1:24 PM  
**To:** Campbell, Keith (K.A.); Camilleri, Robert (R.H.)  
**Subject:** FW: Report Summary for the CQIS Report#8GRAX001; P235/70R 17 A/S BSW TIRES

David will be retrieving all five stems.

Regards.....George Gunlock  
313-323-8987, cell 313-580-4873  
ggunlock@ford.com, PDC 2B-G21

---

**From:** Dripps, David (D.S.)  
**Sent:** Friday, July 18, 2008 12:32 PM  
**To:** Humphries, Glenn (G.L.); Gunlock, George (G.W.)  
**Subject:** FW: Report Summary for the CQIS Report#8GRAX001; P235/70R 17 A/S BSW TIRES

Have you ever seen this? This fleet is having to have all these valve stems replaced on almost every one of their trucks.

David Dripps  
Field Service Engineer  
Ford Motor Company  
SE Market  
678-358-8458

---

**From:** DDRIPPS@ford.com [mailto:DDRIPPS@ford.com]  
**Sent:** Friday, July 18, 2008 11:56 AM  
**To:** Dripps, David (D.S.)  
**Subject:** Report Summary for the CQIS Report#8GRAX001

**Attachments :** 2

**Report# :** 8GRAX001 FCSDFS  
**CCRG/EPRC:**

**Reviewed Status:**

**Received:** 07/18/2008  
**Date:**

**Vehicle:** 2007,F150 4X2,REG CAB,STYSD ,1FTPF12VX7K [REDACTED] **Build Date:** 01/22/2007  
**Odometer :** 14,020 M **Engine:** 5.4L 3V FF **Calibration:** 7F61FA0N  
**Transmission:** 4R75E-L **Axle:** 3800F3.55L **A/C:** YES  
**Dealer:** USA 00274 CHEROKEE FORD **Phone#:** (404) 592-0090  
**City:** Woodstock **State:** Georgia **Country :** USA  
**Originator:** RICK FOLTZ  
**Symptom:** 3 06 2 01 CHASS.,TIRES/WHEELS,AIR LOSS,SLOW LEAK  
**Status:**  
**VFG:** V88 TIRES  
**Additional Symptom:** ROTTING VALVE STEMS  
**Fix:** **Causal Component :**  
**Condition Code:**  
**Region Code:** S1 **Region Name:** Atlanta

**DTCs:**  
KOEO:  
KOEC:  
KOER:

**Comments :**

**OWNER** 07/18/2008 11:49AM DAVID DRIPPS(FSE) MSS - FCSD - REG - ATLANTA  
FLEET HAS OVER 20 F150'S OPERATING IN GEORGIA AND THE VALVE STEMS ON  
THE TIRES ARE DRY ROTTING AND CUTTING AT LOW MILEAGE.  
**TECH/C** 07/18/2008 11:49AM DAVID DRIPPS(FSE) MSS - FCSD - REG - ATLANTA  
HAD TO REPLACE VALVE STEMS

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIVViewAttachment\\_Mainx.asp?ReportNumber=8GRAX001](https://www.gcqis.dealerconnection.com/gcqis/asp/DIVViewAttachment_Mainx.asp?ReportNumber=8GRAX001)

---

**From:** Williams, Dan (DW.)  
**Sent:** Monday, May 05, 2008 8:48 AM  
**To:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.)  
**Cc:** Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** RE: Defective valve stem in warranty  
**Attachments:** 2008MY\_valve\_stem\_issues.xls

What all vehicle lines use Baolong valve stems?

I'd like to put in a warranty part return request to capture some of these and see if I get a plugged/defective one. There are about 100 claims in ECB relating to valves, 5 of them are for valves being inop (see attached file).

**Dan Williams**

P221 Resident Chassis Engineer  
Kansas City Assembly Plant  
Phone: 816-459-1977  
Mobile: 816-200-3866  
FAX: 816-459-1970  
[TANGO Paintball Club](#)

---

**From:** Bill Thon Jr [mailto:billjr@thonassociates.com]  
**Sent:** Thursday, May 01, 2008 7:18 AM  
**To:** Williams, Dan (DW.)  
**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.); 'Chris Bruce'  
**Subject:** RE: Defective valve stem in warranty

Hi Dan,

Yes we agree both air staying in the tire and also the ability to inflate being able to go in are equally important. My people have been notified of this issue and will try to determine the root cause however it may be difficult without seeing the part.

We currently check:

100% valve core torque  
100% valve core pin height  
200% leak test

We test 6 pcs airflow (in) through the valve core every 6 hours

We believe this is a very isolated incident. We have supplied approximately 40,000,000 valves to Ford since being sourced and this is the first time we have been notified of this condition.

Regards,

Bill Thon, Jr.  
BAOLONG  
248-625-5426

---

**From:** Williams, Dan (DW.) [mailto:dwill122@ford.com]  
**Sent:** Wednesday, April 30, 2008 5:35 PM  
**To:** Bill Thon Jr

11/26/2008

PE08-060 1069

**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** RE: Defective valve stem in warranty

Unfortunately, the part was thrown away.

As a customer, I feel it is equally important for the valve stem to both retain air and accept air. Is there a reason that you are only checking for lack of airflow in one direction and not also checking for the ability of air to flow in the opposite direction?

**Dan Williams**

P221 Resident Chassis Engineer  
Kansas City Assembly Plant  
Phone: 816-459-1977  
Mobile: 816-200-3866  
FAX: 816-459-1970  
[TANGO Paintball Club](#)

---

**From:** Bill Thon Jr [mailto:billjr@thonassociates.com]  
**Sent:** Wednesday, April 30, 2008 2:35 PM  
**To:** Williams, Dan (DW.)  
**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** RE: Defective valve stem in warranty

Thanks for the clarification.

Currently we leak test every valve 200%. As for testing the air flow into the valve we currently test 6 pcs per batch. Each batch consists of 10,000 pcs. This amounts to checking parts about every 6 hours.

Is it possible for us to see the valve and evaluate?

Bill

---

**From:** Williams, Dan (DW.) [mailto:dwill122@ford.com]  
**Sent:** Wednesday, April 30, 2008 2:44 PM  
**To:** Bill Thon Jr  
**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** RE: Defective valve stem in warranty

In talking to the dealership, the valve core was missing and there was solid rubber where the core should have been.

My original question was whether or not the valve stem assembly was 100% checked by putting air through the valve. What functional checks are done by Baolong?

**Dan Williams**

P221 Resident Chassis Engineer  
Kansas City Assembly Plant  
Phone: 816-459-1977  
Mobile: 816-200-3866  
FAX: 816-459-1970  
[TANGO Paintball Club](#)

---

**From:** Bill Thon Jr [mailto:billjr@thonassociates.com]  
**Sent:** Wednesday, April 30, 2008 11:57 AM

**To:** Williams, Dan (DW.)  
**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** RE: Defective valve stem in warranty

Hi Dan,

Can you please confirm was the valve stem (valve core) blocked which would not allow air to travel through the valve? The claim below states there was no stem inside the stem. We take this statement that there was no valve core.

Thanks,

Bill Thon, Jr.  
BAOLONG  
248-625-5426

---

**From:** Williams, Dan (DW.) [mailto:dwill122@ford.com]  
**Sent:** Wednesday, April 30, 2008 9:09 AM  
**To:** billjr@thonassociates.com  
**Cc:** Lauffer, Scott (SJL.); Camilleri, Robert (R.H.); Koenig, Neal (N.D.); Kane, Michael (M.D.); Nammalwar, Giri (G.)  
**Subject:** Defective valve stem in warranty

Is the ability of the valve stem to accept air something that is 100% checked either in the US or in China? This is not something we will ever find in the plant, as we do not use the valve stem in our normal assembly process.

## Claim Detail Report

*Note: All costs are in US dollars*  
**Model Year = 2008; Claim Key = 747891**

### Vehicle Information

Model Year: 2008  
Market Derived: F - FORD  
Body/Cab Type: T/BC - DOUBLE CAB (CREW CAB)  
Version/Series: T/AL-150S SERIES  
Drive Type: T/E-4 WHL L/H PART TIME DRIVE  
Vehicle Line: T/F6-P221/P397/P415 [04-09]  
Warranty Start Date:  
Production Date: 07-APR-2008  
VIN: 1FTPW14V78K [REDACTED]

### Dealer Information:

Dealer Name: RANDALL REED'S PLANET FORD  
Dealer Code: 04462 - \*  
Address: 19000 EASTEX FRWY  
City: HUMBLE

### Claim Information

Document Number: 41180602  
Repair Date: 18-APR-2008  
Distance: 8  
TIS: -1

### Expense Information

Customer Paid Amount: .00  
Deductible Amount: .00  
Dealer Paid Amount: .00  
Labor Cost: 23.64  
Misc. Expense Amount: .00

State: TX Zip Code:77338  
Country: USA Region Code: NA  
Phone: (281)446-9171

Part Markup Amount: .28  
Material Cost: .97  
Total Cost Gross: 24.61

Cust. Concern Code: B65 - WHEEL/HUBCAP TROUBLES

Condition Code: 01 - BROKEN/CRACKED

Technician Comment: BREAK DOWN TIRE TO REPLACE VALVE STEM DUE TO STEM HAD NO STEM  
INSIDE AND WOULD NOT ALLOW AIR TO BE ADDED

Customer Comment: B65 RT REAR TIRE HAS VALVE STEM WHICH WONT ACCEPT ANY AIR

<u>Labor Op Code</u>	<u>Labor Op Description</u>	<u>Labor Op Cost</u>
1007AF	TIRE(S) REPLACE	23.64

<u>Causal Flag</u>	<u>Full Part Number</u>	<u>Part Description</u>	<u>Part CPSC</u>	<u>Part Quantity</u>	<u>Extended Amount</u>
N	* OSP	* OUTSIDE PART	040401	1	.97
Y	* 1015	* WHEEL ASSY	040401	0	.00

DTC Sections: Mil. Light On = \*

<u>Flag</u>	<u>Test Type</u>	<u>Malfunction Cd</u>	<u>Malfunction Cd Description</u>	<u>Monitor Cd</u>	<u>Monitor Cd Description</u>
-------------	------------------	-----------------------	-----------------------------------	-------------------	-------------------------------

**Dan Williams**

P221 Resident Chassis Engineer  
Kansas City Assembly Plant  
Phone: 816-459-1977  
Mobile: 816-200-3866  
FAX: 816-459-1970  
[TANGO Paintball Club](#)

No viruses found in this incoming message  
Scanned by **iolo AntiVirus 1.5.3.5**  
<http://www.iolo.com>

No viruses found in this outgoing message  
Scanned by **iolo AntiVirus 1.5.3.5**  
<http://www.iolo.com>

No viruses found in this incoming message  
Scanned by **iolo AntiVirus 1.5.3.5**  
<http://www.iolo.com>

No viruses found in this outgoing message  
Scanned by **iolo AntiVirus 1.5.3.5**

<http://www.iolo.com>

---

No viruses found in this incoming message  
Scanned by **iolo AntiVirus 1.5.3.5**

<http://www.iolo.com>

---

No viruses found in this outgoing message  
Scanned by **iolo AntiVirus 1.5.3.5**

<http://www.iolo.com>

PRODN_DT	MIL_GE	VIN_CD	REPAIR_DIAGNOSIS	CUST_TXT	TECH_TXT	TOT_COST_GROSS	MTR_L_COST	LBR_COST	BOD_CAB_STL_CD	DRIVE_CD	ENG_CD	ECBE01_VFG_C
29-Oct-07	2	1FTNE14W28D	VALVE STEM REPLACED	CHECK RR TIRE WILL NOT INFLATE OR DEFLATE	10 DISMOUNT TIRE FOUND BAD VALVE STEM REMOUNT TIER AND BALANCE AND RECHECK ALL OK	42.18	1.68	40.5	T/VC - REGULAR VAN	T/B - 2	T/VN - R-M 4.6L	V88 - TIRES
1-Nov-07	5879	1FTWW33R78E	VALVE STEM CORE DEFECTIVE	CHECK RIGHT FRONT TIRE VALVE STEM WONT TAKE AIR	INSPECTED, VERIFIED VALVE STEM WONT TAKE AIR AT RIGHT FRONT WHEEL, REPAIRED STEM AND RETESTED OK.	15.24	0	15.24	T/BC - DOUBLE CAB (CREW)	T/E - 4	T/QL - 6.4L OHV	V88 - TIRES
25-Jan-08	3	1FDWX36Y08E	VALVE STEM CORE DEFECTIVE	STATES LEFT FRONT TIRE WILL NOT ACCEPT AIR	UPON PDI INSPECTION FOUND VALVE STEM CRACKED DUE TO IMPROPER INSTALLATION REMOVED TIRE AND WHEEL DISMOUNTED TIRE AND REPAIRED VALVE STEM	38.48	8.96	29.52	T/BD - SUPER SINGLE CAB	T/B - 2	T/YH - 6.8L 3V	V88 - TIRES
21-Feb-08	44	1FTPW04568K	VALVE STEM REPLACED	C S CANNOT SERVICE LEFT FRONT TIRE VLAVE STEM WILL NOT ALLOW AIR IN	LEFT FRONT TIRE STEM WILL NOT ALLOW AIR IN VERIFY REPLACE VALVE STEM	16.51	1.51	15	T/BC - DOUBLE CAB (CREW)	T/E - 4	T/WX - MOD 5.4L	V88 - TIRES
7-Apr-08	8	1FTPW14V78K	VALVE STEM REPLACED	B65 RT REAR TIRE HAS VALVE STEM WHICH WONT ACCEPT ANY AIR	BRKAK DOWN TIRE TO REPLACE VALVE STEM DUE TO STEM HAD NO STEM INSIDE AND WOULD NOT ALLOW AIR TO BE ADDED	24.61	0.97	23.64	T/BC - DOUBLE CAB (CREW)	T/E - 4	T/WX - MOD 5.4L	V88 - TIRES



ECBE01_CUST_CRN_C	D E S I	M A N U I	S U P	CLM_KEY	MDL_YR	ECB E01 _PL _ANT	PLANT_DESC	ECB E01 _VL _CO	COMMON_VL_DE SC	WRTY_STA RT_DT	RPR_DT	TI S _WS D	LBR _HR S	VRT	VFG	CCC	MK T _DE RI	VER_SERIES_CD	TRANS_CD
B65 - WHEEL/HUBCAP TROUBLES		X		286481	2008	BH	OHIO ASSEMBLY PT BUILD	E1	ECONOLINE		6-Dec-07	-1	0.5	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/AM - 150 SERIES	T/B7 - 4 SP A/T 4R75E LIVONIA
B65 - WHEEL/HUBCAP TROUBLES			X	425677	2008	A1	KENTUCKY TRUCK PLANT BUILD	F7	F-SERIES OVER 8500	15-Nov-07	4-Feb-08	3	0.2	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/CD - 350 SERIES	T/BE - 5 SPD AUTO 5R110W - HI/TORQUE
B65 - WHEEL/HUBCAP TROUBLES			X	441847	2008	A1	KENTUCKY TRUCK PLANT BUILD	F7	F-SERIES OVER 8500	21-Feb-08	11-Feb-08	0	0.4	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/CD - 350 SERIES	T/TQ - 5 SPD AUTO TRANS NAAO 5R110W
B65 - WHEEL/HUBCAP TROUBLES			X	579498	2008	AJ	KANSAS CITY PLANT BUILD	FS	F-SERIES <8500 CREWCAB		5-Mar-08	-1	0	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/AM - 150 SERIES	T/B7 - 4 SP A/T 4R75E LIVONIA
B65 - WHEEL/HUBCAP TROUBLES			X	747891	2008	AJ	KANSAS CITY PLANT BUILD	FS	F-SERIES <8500 CREWCAB		18-Apr-08	-1	0.3	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/AL - 150S SERIES	T/B7 - 4 SP A/T 4R75E LIVONIA

CLR_TRIM_CD	PAINT_CD	DOC_NUM	WCC_CD	PRT_NUM	PRT_NUM	PR_T	PART_DESCRIPTION	COND_CD	CPSC_6_C_AUSL_CD	RPR_DL_R_C	RP_DL_R	RPR_RE_GIO_NC	RPR_NAME	RPR_PH_NUM	RPR_ST_CN_OV	RPR_CN_TRY_CD	SLS_DLR_CD	SLS_CN_TRY_CD	S_L	SL_S_RE_GI	T_X_N	LOAD_DT	ECBE01_LOAD_Y
000NF - MEDIUM FLINT INTERIOR	PNYW3 - OXFORD WHITE SOLID C/C	439007B	5K02	F42Z	1700	A	VALVE & CAP ASY	42 - DOES NOT OPERATE PROPERLY	0404XX	8932	*	NA	AUTOFAIR FORD, LP	603 6252540	NH	USA	111575	USA	*	NA	1	17-Dec-07	19-Dec-07
000DW - CHARCOAL BLACK	PNEGD - VERMILION WB C/C-W/B	094463C	5K02	*	1700	*	VALVE & CAP ASY	42 - DOES NOT OPERATE PROPERLY	40401	4569	*	NA	GRANDE TRUCK CENTER	210 6614121	TX	USA	152909	USA	*	NA	1	7-Feb-08	12-Feb-08
000HB - MEDIUM STONE	PNYW5 - OXFORD WHITE WB C/C-W/B	168043A	5K01	*	1007	*	WHEEL ASSY	01 - BROKEN/CRACKED	40401	2414	*	NA	BILLINGSLEY FORD, INC.	580 2263300	OK	USA	152207	USA	*	NA	1	13-Feb-08	15-Feb-08
000ZH - EBONY	PNYW3 - OXFORD WHITE SOLID C/C	092816A	5K01	*	1007	*	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	40401	61	*	NA	PURVIS FORD, INC.	540 8983000	VA	USA	127440	USA	*	NA	1	20-Mar-08	22-Mar-08
000BY - MEDIUM PEBBLE	PNUAA - EBONY SOLID C/C	41180602	5K01	*	1015	*	WHEEL ASSY	01 - BROKEN/CRACKED	40401	4462	*	NA	RANDALL REED'S PLANET FORD	281 4469171	TX	USA	152046	USA	*	NA	1	28-Apr-08	30-Apr-08

---

**From:** Jones, Rick (W.P.)  
**Sent:** Thursday, May 29, 2008 3:07 PM  
**To:** Campbell, Keith (K.A.)  
**Subject:** FW: Valve Stems  
**Signed By:** rjones6@ford.com

[Hi Keith, here is the note from Ralph Arning about the valve stem sales.](#)

---

**From:** Arning, Ralph (R.)  
**Sent:** Wednesday, May 28, 2008 4:06 PM  
**To:** Jones, Rick (W.P.)  
**Subject:** Valve Stems

Hi Rick, I wouldn't figure too many dealers would use the Ford valve stems, but would by them locally. In looking at the parts sales for the stems, we are selling more than I would have thought and the part sales increased after we made a part number change...

SERVICE PART: F42Z- 1700-A\_\_\_ VALVE ASY  
BACKCAST: Y DEMAND GROUP: \_\_

A

C	YEAR	Quantity	Replaced Part Number	Message
-	----	-----	-----	-----
	2008	1312		
	2007	2941		
	2006	1103	5L3Z- 1700-A	REPLACED
	2005	1113		
	2004	694		
	2003	479		
	2002	204		
	2001	220		
	2000	155		
	1999	84		
	1998	36		
	1997	29		
	1996	22		

Regards,

***Ralph Arning***

Ford Customer Service Div.  
Mustang PVT/Launch Team  
Phone: 734-782-7914  
Cell Phone: 734-752-9639  
e-mail: RARNING@Ford.com

---

**From:** Wickenheiser, Francis (F.J.)  
**Sent:** Tuesday, September 09, 2008 10:51 AM  
**To:** Ott, David (D.J.)  
**Subject:** FW: Valve Stems

**Attachments:** FW: Valve stem issues; FW: Power Steering Pumps; RE: Returned valve stems; RE: Returned valve stems; RE: Valve stem defects; Untitled

[Some fleet inquiries attached...](#)

---

**From:** Blackmer, Michael (M.P.)  
**Sent:** Thursday, June 12, 2008 1:08 PM  
**To:** Wickenheiser, Francis (F.J.)  
**Subject:** Valve Stems



FW: Valve stem issues



FW: Power Steering Pumps



RE: Returned valve stems



RE: Returned valve stems



RE: Valve stem defects



Untitled

Joe -

Here are the main ones.

**Michael Blackmer**

Special Vehicle Engineering Supervisor  
Police, Ambulance, Ship Thru  
PDC MD 410, 1H-C12

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** Blackmer, Michael (M.P.)  
**Sent:** Tuesday, May 20, 2008 7:11 PM  
**To:** Gillman, Paul (P.D.); Campbell, Keith (K.A.)  
**Subject:** FW: Valve stem issues  
**Attachments:** Tire Bulletin from St. Johns County.doc

FYI only...

**Michael Blackmer**

Special Vehicle Engineering Supervisor

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** Spears, Ken [mailto:KenSpears@flhsmv.gov]  
**Sent:** Tuesday, May 20, 2008 2:56 PM  
**To:** Blackmer, Michael (M.P.)  
**Subject:** FW: Valve stem issues

Michael,  
See attached that originated from St. John's County Sheriffs Office (south of Jacksonville).  
Anything back from Central Lab?  
K. Spears

Captain Kenneth L. Spears  
Fleet & Property Management  
Florida Highway Patrol  
Neil Kirkman Building, MS-47  
Tallahassee, FL 32399  
Phone: (850) 617-2939  
Fax: (850) 617-5128  
[KenSpears@flhsmv.gov](mailto:KenSpears@flhsmv.gov)  
<http://www.fhp.state.fl.us>

**COURTESY ♦ SERVICE ♦ PROTECTION**

---

**From:** Gene Spaulding [mailto:genespauling@flhsmv.gov]  
**Sent:** Tuesday, May 20, 2008 11:10 AM  
**To:** Hardin, Larry; Kelley, Rick; 'Jerrel Crews'  
**Cc:** Carrick, Grady; Spears, Ken  
**Subject:** FW: Valve stem issues

FYI,

Attached is a bulletin that came out on the MDTs from St. John's County S.O. It looks like the same problem that was noted in Troop B.

Captain Gene S. Spaulding  
District Commander  
Florida Highway Patrol

10/28/2008

PE08-060 1079

7322 Normandy Boulevard  
Jacksonville, FL 32205  
Office: (904) 695-4099  
Fax (904) 695-4114  
[genespauling@flhsmv.gov](mailto:genespauling@flhsmv.gov)  
[www.flhsmv.gov](http://www.flhsmv.gov)

---

**From:** Larry Hardin [mailto:larryhardin@flhsmv.gov]

**Sent:** Wednesday, April 23, 2008 8:24 AM

**To:** gaston.keith@fhp.hsmv.state.fl.us; 'Rick Kelley'; 'Gene Spaulding'; 'Jerry Crews'; 'Tim Hines'; 'R. C. Brown'; 'Steven Harris'; 'Ron Tompkins'; 'Kevin Blom'; strickland.jonathon@fhp.hsmv.state.fl.us; 'Michael J. DuBois'

**Cc:** carrick.grady@fhp.hsmv.state.fl.us; 'Leeper, William'; 'Evelyn Wyse'

**Subject:** Valve stem issues

All,

FHP Lake City has encountered Valve Stem Problems with their 2007 Crown Vics. The attached Photos show some of examples of what they have encountered. I have heard nothing from any of our people on this problem but I recommend that we check **ALL** of our vehicles for the problems shown in the photographs. Any vehicles found with defects that are under warranty should go back to the dealer for repair. All other vehicles, not under warranty, should be taken back to Tubels or other Goodyear vendors for replacement of the valve stems. If any of these valve stems are encountered, please have the troopers, get the valve stems from the Vendor or Dealer and turn them into me in case they are needed for further study. Thanks for all your help.

Our Mission: Providing Highway Safety and Security through Excellence in Service, Education and Enforcement.

--BEGIN MESSAGE--

\*\*\*\*\* BOLO ALERT FROM THE CAD DISPATCHER [ / ] \*\*\*\*\*

Notes:

UBJECT: OFFICER SAFETY ALERT

\*\*\*\*\*OFFICER SAFETY\*\*\*\*\*OFFICER SAFETY\*\*\*\*\*

2007 FORD CROWN VIC VALVE STEM FAILURES

OUR AGENCY HAS EXPERIENCED WHEEL VALVE STEM FAILURES ON MOST OF OUR 2007 FORD CROWN VICTORIA POLICE CARS. WE HAVE NOTIFIED FORD MOTOR COMPANY AND THEY CLAIM THEY ARE UNAWARE OF THE ISSUE, BUT FOR OFFICER SAFETY, WE URGENTLY RECOMMEND INSPECTION OF YOUR FLEET. WHEN THESE STEMS FAIL, A SUDDEN LOST OF AIR AND POSSIBLE LOSS OF CONTROL OF THE VEHICLE MAY OCCUR. THE SPECIFIC FAILURE HAS BEEN OCCURRING WHERE THE STEM MEETS THE RIM ON THE OUTSIDE. THESE ARE CRACKS THAT ARE CAUSING SEPARATION IMMEDIATELY.

THANKS FOR ALL ASSISTANCE

OPER/ 3235 ST JOHNS COUNTY SHERIFFS OFFICE

\*\*\*\*\* BOLO ALERT SENT [ 10:13 on 05/20/2008 ] \*\*\*\*\*

--END MESSAGE--

---

**From:** Blackmer, Michael (M.P.)  
**Sent:** Wednesday, May 28, 2008 12:25 PM  
**To:** Campbell, Keith (K.A.); Gillman, Paul (P.D.)  
**Subject:** FW: Power Steering Pumps  
**Importance:** High

FYI...

**Michael Blackmer**

Special Vehicle Engineering Supervisor

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** Terpak, Drew [mailto:AndrewTerpak@miamibeachfl.gov]  
**Sent:** Wednesday, May 28, 2008 12:11 PM  
**To:** Blackmer, Michael (M.P.)  
**Subject:** RE: Power Steering Pumps  
**Importance:** High

Michael, have you had any complaints regarding valve stems? We are experiencing a very significant number of factory stems failing on 2007 CVPI causing low tire pressure and ultimately flats. They all seem to be breaking off at the base. This is a serious concern. Pls let me know if you have anything on this. Tks, drew

**MIAMIBEACH**

**Andrew Terpak, Director**

**FLEET MANAGEMENT**

140 MacArthur Causeway, Miami Beach, FL 33139

305-673-7641 / Fax: 305-673-7639 / [andrewterpak@miamibeachfl.gov](mailto:andrewterpak@miamibeachfl.gov)

*We are committed to providing excellent public service and safety to all who live, work and play in our vibrant, tropical, historic community*

---

**From:** Blackmer, Michael (M.P.) [mailto:mblackme@ford.com]

**Sent:** Tuesday, May 27, 2008 3:33 PM

**To:** Al Robinson - Nevada DPS; Terpak, Drew; Beth Campbell - FBI; Bill Hollars - Oklahoma DPS; Brad Bernhardt - Kansas Highway Patrol; Brad Brewer - Vancouver BC PD; Bruce MacLean - Charles Cty (MD) Sheriff's Office; Ed Hanlon - Kansas Turnpike Authority; Gary Smith - Greensboro (NC) PD; George Schwartz - City of Harrisburg ; Greg Hester - DC Metropolitan PD; Jeff Browne - Arizona DPS; Jim Hanson - Vernon County (WI) Sheriff's Dpet.; John Alley - San Diego PD; John Blackwood - Seminole Cty Sheriffs Dept.; Keith Branner - Harris Cty, TX; Lt. Brian Moran - LASD; Lt. David Halliday - MI State Police; Mark Caron - MA State Police; Mike McCants - Palm Beach Cty Sheriff's Office; Mike McClary - Indianapolis PD; Paul Powers - Ontario Provincial Police; Rick Lanham - U.S. Marshals Service; Scott Rector - NY State Police

**Subject:** Power Steering Pumps

At the last PAB meeting, I received an action assignment to send you all a paper I wrote on the power steering pump issue from the 2006 and early 2007 model years. TSB 06-23-05 was issued to change those pumps to a high flow pump to increase fluid flow. During the last meeting, there was discussion that some vehicles, built after the TSB period, exhibit the concern.

I met with the steering technical specialist before sending the paper to make sure all issues were addressed. As a result, I updated it with a new paragraph and chart at the end of the paper.

I am now forwarding it to you for your use. Let me know if you have any questions.



**Michael Blackmer**

Special Vehicle Engineering Supervisor

Police, Ambulance, Ship Thru

PDC MD 410, 1H-C12

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** David Richter [DavidRichter@flhsmv.gov]  
**Sent:** Tuesday, April 29, 2008 11:45 AM  
**To:** Blackmer, Michael (M.P.)  
**Cc:** 'Spears, Ken'  
**Subject:** RE: Returned valve stems  
**Attachments:** TRP B Valve Stem Defect List.xls

Michael,

Please find attached a list of all VINs of 97 CVPI's assigned to Troop B. Ones that we know we have replaced specifically with the Valve stem issue are notated.

Please feel free to contact me if you have any further questions.

Sincerely,

David

David G. Richter  
Office Operations Manager I  
Troop B Headquarters- Lake City  
Florida Highway Patrol  
1350 W US HWY 90  
Lake City, FL 32055  
Office: (386) 758-0520 Fax: 386-758-0572  
[DavidRichter@FLhsmv.gov](mailto:DavidRichter@FLhsmv.gov)  
[www.FLhsmv.gov/FHP](http://www.FLhsmv.gov/FHP)

*COURTESY ♦ SERVICE ♦ PROTECTION*

---

**From:** Blackmer, Michael (M.P.) [mailto:mblackme@ford.com]  
**Sent:** Tuesday, April 29, 2008 11:04 AM  
**To:** David Richter; Spears, Ken  
**Subject:** RE: Returned valve stems

Dave and Ken -

The tire guys don't need any more parts samples, but they would like to get the VIN from any other vehicles that you find bad valve stems on. This will help determine if this is a manufacturing problem with only a lot or a more widespread problem with the manufacturing process.

Thanks.

**Michael Blackmer**  
Special Vehicle Engineering Supervisor  
Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** Blackmer, Michael (M.P.)

10/28/2008

PE08-060 1084

**Sent:** Tuesday, April 29, 2008 10:14 AM

**To:** 'David Richter'

**Subject:** RE: Returned valve stems

Dave -

Call me. I've got a couple of more questions regarding how they were determined to be bad (inspection method) and how they are extracted (how much of the damage we are seeing is due to extraction and how much is the problem that we are investigating).

Thanks.

**Michael Blackmer**

Special Vehicle Engineering Supervisor

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** David Richter [mailto:DavidRichter@flhsmv.gov]

**Sent:** Wednesday, April 23, 2008 10:20 AM

**To:** 'Succi, Jeffrey'; Gillman, Paul (P.D.)

**Cc:** 'Spears, Ken'; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)

**Subject:** RE: Returned valve stems

Captain Succi's response is identical to Lake City's response. Mileage on the vehicles is in the teens on all affected vehicles.

Sincerely,

David Richter

The Department of Highway Safety and Motor Vehicles is committed to Service, Integrity, Courtesy, Professionalism, Innovation and Excellence in all we do. Please let us know how we are doing via our online customer service survey at [www.flhsmv.gov](http://www.flhsmv.gov).

**From:** Succi, Jeffrey [mailto:JeffreySucci@flhsmv.gov]

**Sent:** Wednesday, April 23, 2008 9:56 AM

**To:** Gillman, Paul (P.D.); Richter, David

**Cc:** Spears, Ken; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)

**Subject:** RE: Returned valve stems

**Here is the deal plain and simple. Most of our marked cars are driven in "pursuit" mode daily reaching speeds of 120+. Our unmarked cars although they are pursuit rated are rarely driven at those kinds of speeds.**

**My car (unmarked) that had 4 cracked valve stems has 19K miles on it and I don't believe it has ever been driven over 90 mph. When we change tires, the dealer is required to also change the valve stems, that is why some of our cars we only changed one or two stems as they have had new tires installed since the vehicle was put into service.**

**The defective valve stems are only OEM valve stems**

**Captain Jeffrey L. Succi**

Our Mission: Providing Highway Safety and Security through Excellence in Service, Education and Enforcement.

**From:** Gillman, Paul (P.D.) [mailto:pgillman@ford.com]

**Sent:** Wednesday, April 23, 2008 9:25 AM

**To:** Richter, David; Succi, Jeffrey

**Cc:** Spears, Ken; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)

10/28/2008

PE08-060 1085

**Subject:** Returned valve stems

David and Jeffery,

I am the Ford tire/wheel engineer on the Crown Vic program.

I have some questions that will help with my investigation

- 1) What is the typical driving mode for the three units that the valve stems were returned from; FHP 1558, FHP1001, FHP 1272.
- 2) How many miles are on each vehicle.
- 3) How many times has the tires been changed on each vehicle.

Paul Gillman

Expedition & Navigator Tires/Wheels

Panther Tires/Wheels

Phone: (313) 805-3412

FHP#	YR	Color	Make	Model	VIN	District	Valve
1100	7	CB	Ford	CVPI	2FAHP71W07X	LC	
1101	7	CB	Ford	CVPI	2FAHP71W67X	CC	
1154	7	cb	Ford	CVPI	2FAHP71W67X	LC	Y
1237	7	Cb	Ford	CVPI	2FAHP71W07X	OC	
1272	7	CB	Ford	CVPI	2FAHP71W27X	LC	Y
1279	7	CB	Ford	CVPI	2FAHP71W27X	OC	Y
1418	7	CB	Ford	CVPI	2FAHP71W87X	OC	Y
1493	7	CB	Ford	CVPI	2FAHP71W47X	GV	
1558	7	CB	Ford	CVPI	2fahP71w37X	LC	
1562	7	CB	Ford	CVPI	2FAHP71W67X	CC	
1641	7	CB	Ford	CVPI	2FAHP71W37X	OC	Y
192	7	For	Ford	CVPI	2FAHP71W17X	GV	
1952	7	CB	Ford	CVPI	2FAHP71W27X	LC	
1963	7	CB	Ford	CVPI	2FAHP71W87X	CC	Y
2041	7	CB	Ford	CVPI	2fahp71w67X	OC	Y
2143	7	CB	Ford	CVPI	2FAHP71W87X	LC	Y
2145	7	Cb	Ford	CVPI	2FAHP71W97X	GV	
2147	7	CB	Ford	CVPI	2FAHP71W27X	LC	
267	7	CB	Ford	CVPI	2FAHP71W47X	LC	
284	7	CB	Ford	CVPI	2FAHP71W77X	GV	
306	7	CB	Ford	CVPI	2FAHP71W87X	LC	
338	7	CB	Ford	CVPI	2FAHP71W67X	CC	
393	7	CB	Ford	CVPI	2FAHP71W47X	GV	
53	7	CB	Ford	CVPI	2FAHP71W37X	OC	
549	7	cb	Ford	CVPI	2FAHP71W17X	GV	
676	7	CB	Ford	CVPI	2FAHP71W57X	OC	Y
725	7	CB	Ford	CVPI	2FAHP71W57X	CC	
879	7	cb	Ford	CVPI	2FAHP71W97X	GV	Y
885	7	CB	Ford	CVPI	2FAFHP71W47X	OC	Y
889	7	cb	Ford	CVPI	2FAHP71W47X	GV	
928	7	CB	Ford	CVPI	2Fahp71w37X	LC	

---

**From:** David Richter [DavidRichter@flhsmv.gov]  
**Sent:** Wednesday, April 23, 2008 10:20 AM  
**To:** 'Succi, Jeffrey'; Gillman, Paul (P.D.)  
**Cc:** 'Spears, Ken'; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)  
**Subject:** RE: Returned valve stems

Captain Succi's response is identical to Lake City's response. Mileage on the vehicles is in the teens on all affected vehicles.

Sincerely,

David Richter

The Department of Highway Safety and Motor Vehicles is committed to Service, Integrity, Courtesy, Professionalism, Innovation and Excellence in all we do. Please let us know how we are doing via our online customer service survey at [www.flhsmv.gov](http://www.flhsmv.gov).

**From:** Succi, Jeffrey [mailto:JeffreySucci@flhsmv.gov]  
**Sent:** Wednesday, April 23, 2008 9:56 AM  
**To:** Gillman, Paul (P.D.); Richter, David  
**Cc:** Spears, Ken; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)  
**Subject:** RE: Returned valve stems

**Here is the deal plain and simple. Most of our marked cars are driven in "pursuit" mode daily reaching speeds of 120+. Our unmarked cars although they are pursuit rated are rarely driven at those kinds of speeds.**

**My car (unmarked) that had 4 cracked valve stems has 19K miles on it and I don't believe it has ever been driven over 90 mph. When we change tires, the dealer is required to also change the valve stems, that is why some of our cars we only changed one or two stems as they have had new tires installed since the vehicle was put into service.**

**The defective valve stems are only OEM valve stems**

**Captain Jeffrey L. Succi**

Our Mission: Providing Highway Safety and Security through Excellence in Service, Education and Enforcement.

**From:** Gillman, Paul (P.D.) [mailto:pgillman@ford.com]  
**Sent:** Wednesday, April 23, 2008 9:25 AM  
**To:** Richter, David; Succi, Jeffrey  
**Cc:** Spears, Ken; Blackmer, Michael (M.P.); Campbell, Keith (K.A.)  
**Subject:** Returned valve stems

David and Jeffery,

I am the Ford tire/wheel engineer on the Crown Vic program.

I have some questions that will help with my investigation

- 1) What is the typical driving mode for the three units that the valve stems were returned from; FHP 1558, FHP1001, FHP 1272.
- 2) How many miles are on each vehicle.
- 3) How many times has the tires been changed on each vehicle.

Paul Gillman  
Expedition & Navigator Tires/Wheels

Panther Tires/Wheels  
Phone: (313) 805-3412

---

**From:** David Richter [DavidRichter@flhsmv.gov]  
**Sent:** Friday, April 18, 2008 10:18 AM  
**To:** 'Spears, Ken'; 'Succi, Jeffrey'; Blackmer, Michael (M.P.)  
**Cc:** 'Major Rick Carpenter'  
**Subject:** RE: Valve stem defects  
**Attachments:** P4190005.JPG; P4190002.JPG; P4190003.JPG; P4190004.JPG

Captains & Michael,

I got more hands on today and looked at some on the rims. The ones that Sgt Bishop turned in are not the best examples. The pictures above came off two Unmarked Patrol unit. I have yet to get these stems pulled, but will try to get them pulled today and sent out for delivery Monday.

FHP 1001 VIN: 2fahP71W47X [REDACTED] Pictures 002 (crack at 00 Deg Mark), 003 (crack @260 deg) , 004 (crack @ 00 Degree)  
Affected tires are Driver  
FT & R and Rear Pass. (All tires are OEM)  
FHP 1272 VIN: 2FAHP71W27X [REDACTED] Pictures 005 (note crack at 90deg mark) (only 2 front tires are OEM)

My apologies for the dirty fingers in the photos.

I will see if I can grab some more photos when we get them off the car.

Thanks

David

---

**From:** Spears, Ken [mailto:KenSpears@flhsmv.gov]  
**Sent:** Friday, April 18, 2008 9:27 AM  
**To:** Succi, Jeffrey; Blackmer, Michael (M.P.); Richter, David  
**Subject:** RE: Valve stem defects

**Jeff,**  
Thanks for your input. Michael will promptly inspect and reply.

**David,**  
Please ship them overnight DHL to Michael Blackmer at the address previously supplied. In the meantime, if you can, take a couple of digital photos of the defective stems and email to me, Michael, and Jeff.

Thanks.  
K. Spears

Captain Kenneth L. Spears  
Fleet & Property Management  
Florida Highway Patrol  
Neil Kirkman Building, MS-47  
Tallahassee, FL 32399  
Phone: (850) 617-2939  
Fax: (850) 617-5128  
[spears.ken@hsmv.state.fl.us](mailto:spears.ken@hsmv.state.fl.us)  
<http://www.fhp.state.fl.us>

**COURTESY ♦ SERVICE ♦ PROTECTION**



---

**From:** Succi, Jeffrey  
**Sent:** Thursday, April 17, 2008 8:20 PM  
**To:** Blackmer, Michael (M.P.); Richter, David; Spears, Ken  
**Subject:** RE: Valve stem defects

Just my two cents.

It does not appear to be an installation issue. It appears to be a product defect. The cracking or splitting is just above the nipple at the end of where the metal valve is vulcanized. There is no way that the splitting could occur during installation in the rim.

**Captain Jeffrey L. Succi**

---

**From:** Blackmer, Michael (M.P.) [mailto:mblackme@ford.com]  
**Sent:** Thursday, April 17, 2008 8:15 PM  
**To:** Richter, David; Spears, Ken  
**Cc:** Succi, Jeffrey  
**Subject:** RE: Valve stem defects

I only need VINs from the vehicle that you had to replace the valve stem on. We can identify the shift that it was built as well as the installer if it is determined to be the root cause. If it is a supplier quality issue, it wouldn't matter.

**Michael Blackmer**

Special Vehicle Engineering Supervisor

Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com

---

**From:** David Richter [mailto:DavidRichter@flhsmv.gov]  
**Sent:** Thursday, April 17, 2008 11:01 AM  
**To:** 'Spears, Ken'; Blackmer, Michael (M.P.)  
**Cc:** 'Succi, Jeffrey'  
**Subject:** RE: Valve stem defects

I have two off of FHP1558 here that I can get out today. I can also provide VINs for all the cars that are assigned to Troop B that are 07s

I have yet to hear nor seen invoices for repairs except for FHP1558 (Sgt had it done at Goodyear dealer as he had to get tires already). All of these 07 vehicles are under 36K miles. I think if we have a defect issue, we really should get them to our local Ford dealer and it should be N/C to us. We are talking about \$13/wheel, as the tire will have to be balanced after the valve stems are replaced.

Our Servicing dealers are :  
Ocala Lincoln Mercury  
Gainesville Ford  
White Ford (Chiefland)  
Rountree-Moore Ford (Lake City)

Very Respectfully,

David

The Department of Highway Safety and Motor Vehicles is committed to Service, Integrity, Courtesy, Professionalism, Innovation and Excellence in all we do. Please let us know how we are doing via our online

PE08-060 1091

10/28/2008

customer service survey at [www.flhsmv.gov](http://www.flhsmv.gov).

**From:** Spears, Ken [mailto:KenSpears@flhsmv.gov]  
**Sent:** Thursday, April 17, 2008 10:49 AM  
**To:** Blackmer, Michael (M.P.)  
**Cc:** Succi, Jeffrey; Richter, David  
**Subject:** FW: Valve stem defects  
**Importance:** High

**Michael,**

See additional follow up below from our Ocala District Commander. I will try to get samples sent to you. Can you give me an address to ship them to? How many would you like?

**Jeff/David,**

Can you retrieve some of the valve stems that were original OEM parts and deemed be defective? We also need VIN's for the affected vehicles if possible.

For your convenience, I am pasting the response from the Ford Police Engineer Supervisor.

We have not heard of this with OEM parts; aftermarket parts, yes, but not OEM.

I've been asked to get a couple of them back for analysis and VINs from any affected vehicles so we can determine build date and shift.

**Michael Blackmer**

Special Vehicle Engineering Supervisor

Phone: (313) 845-8594; Cell: (313) 805-3083; [mblackme@ford.com](mailto:mblackme@ford.com)

Thanks.

K. Spears

Captain Kenneth L. Spears  
Fleet & Property Management  
Florida Highway Patrol  
Neil Kirkman Building, MS-47  
Tallahassee, FL 32399  
Phone: (850) 617-2939  
Fax: (850) 617-5128  
[spears.ken@hsmv.state.fl.us](mailto:spears.ken@hsmv.state.fl.us)  
<http://www.fhp.state.fl.us>

**COURTESY ♦ SERVICE ♦ PROTECTION**

---

**From:** Succi, Jeffrey  
**Sent:** Wednesday, April 16, 2008 8:13 PM  
**To:** Spears, Ken  
**Subject:** FW: Valve stem defects  
**Importance:** High

10/28/2008

PE08-060 1092

**Ken, are you aware of this? We have checked our 2007 and almost everyone that has not had a tire replaced has a cracked valve stem. My car has 19k on it and I have not changed the tires. All four were cracked.**

**Captain Jeffrey L. Succi**

I was contacted by Sgt. Keith Hudson with the Department of Agriculture regarding some problems they were having with valve stems on their 2007 Ford Crown Victoria vehicles. He said that two of their vehicles had the tires go flat while traveling down the road and that one valve stem on another vehicle, came off while it was being washed with a brush. In order to check the valve stem you need to use a flashlight and bend them at about a 45 degree angle in all directions. I checked mine and I have two that have the cracks. It looks similar to dry rot to me. I suggest that each Trooper check their vehicle and report any problems to their supervisor for correction.

Sergeant William Trampas Bishop  
District Supervisor  
Florida Highway Patrol Troop - B  
1350 US Hwy 90 West Suite 101  
Lake City, Fl 32055


Office: 386-758-0515 Ext 232  
Fax: 386-758-0499  
Suncom 885-0515

[WilliamBishop@flhsmv.gov](mailto:WilliamBishop@flhsmv.gov)

Web page [www.flhsmv.gov/fhp](http://www.flhsmv.gov/fhp)

*COURTESY \* SERVICE \* PROTECTION*

Our Mission: Providing Highway Safety and Security through Excellence in Service, Education and Enforcement.

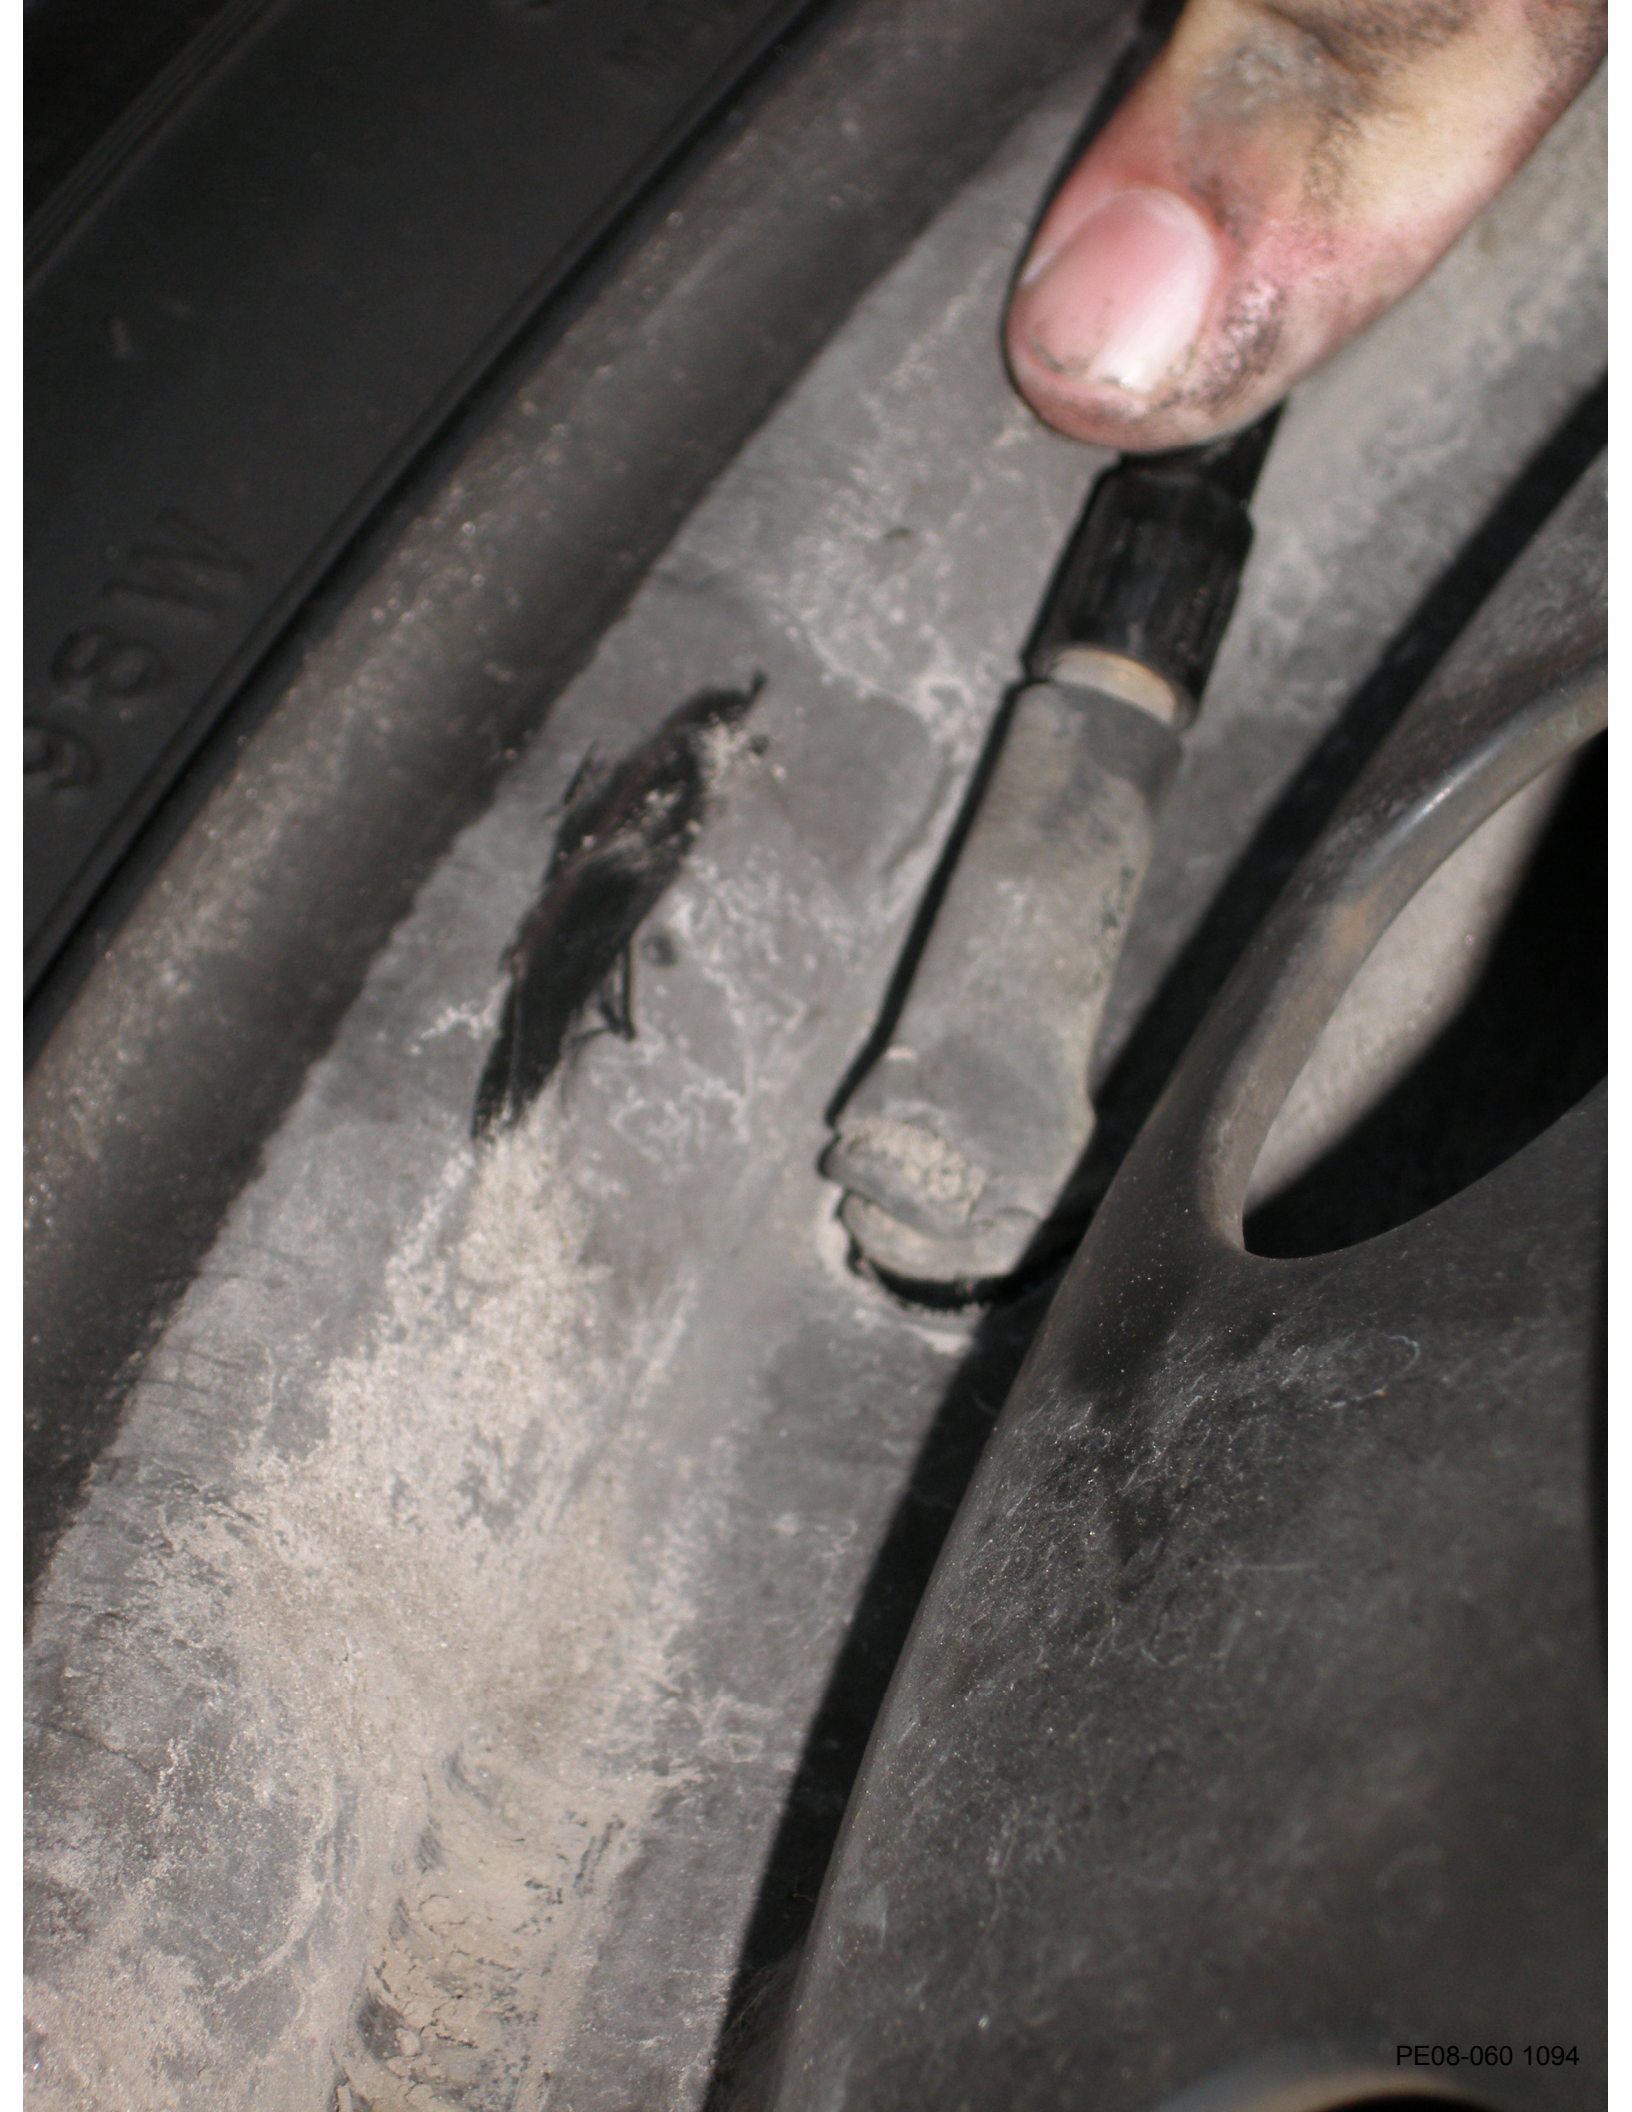



005  
(SAI 005) (SAI 005)





---

**From:** Blackmer, Michael (M.P.)  
**Sent:** Tuesday, April 29, 2008 10:05 AM  
**To:** Campbell, Keith (K.A.)

The following was copied from one of the earlier notes:

I was contacted by Sgt. Keith Hudson with the Department of Agriculture regarding some problems they were having with valve stems on their 2007 Ford Crown Victoria vehicles. He said that two of their vehicles had the tires go flat while traveling down the road and that one valve stem on another vehicle, came off while it was being washed with a brush. In order to check the valve stem you need to use a flashlight and bend them at about a 45 degree angle in all directions. I checked mine and I have two that have the cracks. It looks similar to dry rot to me. I suggest that each Trooper check their vehicle and report any problems to their supervisor for correction.

**Michael Blackmer**

Special Vehicle Engineering Supervisor  
Police, Ambulance, Ship Thru  
PDC MD 410, 1H-C12  
Phone: (313) 845-8594; Cell: (313) 805-3083; mblackme@ford.com



---

**From:** Jones, Rick (W.P.)  
**Sent:** Thursday, May 29, 2008 3:07 PM  
**To:** Campbell, Keith (K.A.)  
**Subject:** FW: Valve Stems  
**Signed By:** rjones6@ford.com

[Hi Keith, here is the note from Ralph Arning about the valve stem sales.](#)

---

**From:** Arning, Ralph (R.)  
**Sent:** Wednesday, May 28, 2008 4:06 PM  
**To:** Jones, Rick (W.P.)  
**Subject:** Valve Stems

Hi Rick, I wouldn't figure too many dealers would use the Ford valve stems, but would by them locally. In looking at the parts sales for the stems, we are selling more than I would have thought and the part sales increased after we made a part number change...

SERVICE PART: F42Z- 1700-A\_\_\_ VALVE ASY  
BACKCAST: Y DEMAND GROUP: \_\_

A

C	YEAR	Quantity	Replaced Part Number	Message
-	----	-----	-----	-----
	2008	1312		
	2007	2941		
	2006	1103	5L3Z- 1700-A	REPLACED
	2005	1113		
	2004	694		
	2003	479		
	2002	204		
	2001	220		
	2000	155		
	1999	84		
	1998	36		
	1997	29		
	1996	22		

Regards,

***Ralph Arning***

Ford Customer Service Div.  
Mustang PVT/Launch Team  
Phone: 734-782-7914  
Cell Phone: 734-752-9639  
e-mail: RARNING@Ford.com

---

**From:** Gunlock, George (G.W.)  
**Sent:** Monday, May 19, 2008 1:54 PM  
**To:** Campbell, Keith (K.A.); Camilleri, Robert (R.H.)  
**Cc:** Branik, David (D.P.); Bagley, Matt (M.R.); Steele, Kimberly (K.A.)  
**Subject:** FW: Valve stem failures

Digital Imaging is alerted to look for leaking valve stems. This is apparently because of a Mustang tire damage claim that mentioned a leaking valve stem.

They have heard of other reports, and will be asking to have the stems (or the whole wheel, if damaged) returned to the WPAC.

F Y I

Regards.....George Gunlock  
313-323-8987, cell 313-580-4873  
ggunlock@ford.com, PDC 2B-G21

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Monday, May 19, 2008 12:26 PM  
**To:** Kircheis, Bryce (A.); Bush, Gary (G.); Mayberry, Debbie (Debra L.); Neilson, Eric (E.); Stavropulos, George (G.); Jansen, Michael (M.R.); Linna, Kevin (K.); Lombard, Loretta (L.); Papp, Eric (E.D.); Popejoy, Mark (M.); Raley, Allen (A.); Samples, Mark (M.J.); Tolbert, Jerry (J.); Yerck, Scott (S.); Zelecki, Tom (K.)  
**Cc:** Gunlock, George (G.W.)  
**Subject:** RE: Valve stem failures

As a follow up to the original request for Valve stems. Please let the dealer know that they are being requested to determine the root cause of the problem.

Also request the valve stem be removed as carefully as possible to avoid further damage. If the wheel is being replaced as a result of the damage, we would like to get them back still intact.

As always, a 700 tag will be issued for the request.

---

**From:** Kircheis, Bryce (A.)  
**Sent:** Tuesday, May 13, 2008 1:32 PM  
**To:** Bush, Gary (G.); Debbie Mayberry; Eric Neilson; George Stavropulos; Jansen, Michael (M.R.); Linna, Kevin (K.); Lombard, Loretta (L.); Papp, Eric (E.D.); Popejoy, Mark (M.) (mpopejo2@ford.com); Raley, Allen (A.) (araley@ford.com); Samples, Mark (M.J.); Tolbert, Jerry (J.) (jtolbe17@ford.com); Yerck, Scott (S.); Zelecki, Tom (T.) (tzelecki@ford.com)  
**Subject:** Valve stem failures

Starting today, if we get a claim with a valve stem failure, we will need to get the parts back. This is across all vehicle lines, concentrating on 07 and newer models.

Ralph the Mustang PVT will be coordinating the collection of the valve stems at this time.

If you get a claim, please forward the claim set to me.

*Bryce Kircheis*

Group Leader  
Ford Digital Imaging  
6 Sigma Center  
15080 Commerce Dr. N  
Dearborn MI, 48120



---

**From:** Sanchez, Luis (L.F.)  
**Sent:** Monday, October 06, 2008 5:38 PM  
**To:** Camilleri, Robert (R.H.)  
**Subject:** FW: V88\_Fowler\_ECB\_Jun12\_Sep11.xls  
**Signed By:** There are problems with the signature. Click the signature button for details.  
**Attachments:** V88\_Fowler\_ECB\_Jun12\_Sep11.xls

Rob

Do you have any update on valve stems leaks?

**Ing. Luis Felipe Sánchez Curiel**

CD3/B299N Tires & Wheels.

☎ (011-5255) 5899 7261 FordNet: (8) 943 7261

✉ lsanch41@ford.com

---

**From:** Steele, Kimberly (K.A.)  
**Sent:** Monday, October 06, 2008 4:23 PM  
**To:** Eggleston, Chauncy (C.R.); Sanchez, Luis (L.F.); Farmer, Marty (M.F.); Joandrea, Maria (M.); Jones, Darryl (D.L.); Magolan, Allen (A.M.)  
**Cc:** Stevenson, Gary (G.L.); Steele, Kimberly (K.A.)  
**Subject:** FW: V88\_Fowler\_ECB\_Jun12\_Sep11.xls

Assignments from Quality meeting:

AAI - Chauncy,

- 1) Wheel damage - what is the BSAQ in the system that Jeff Lin put in to fix the VO equipment scratching the wheels
- 2) Stud Stripped - what is the BSAQ for the lug nut change
- 3) The other yellows - do we have anything on these?

HSAP - Marty/Luis

- 1) Chrome peeling - I do not think we have anything new on this
- 2) Valve Stem Leaking - do you guys know anything about this?

KCAP(SUV) - Maria

- 1) Wheel Noise - interim containment is in place, need a BSAQ?
- 2) Wheel ornament falling off - Maria checking with STA

WSAP - Darryl/Allen

- 1) Wheel loose/lug nut - what is this? Allen do you know anything about this?
- 2) Wheel finish of cover - what is the BSAQ for this? Implementation?

**Kimberly Steele**

Tire & Wheel D&R Supervisor  
Ford Motor Company / PDC 2B-K36  
Cell Phone: (313) 805-3457  
E-mail: ksteele3@ford.com

---

**From:** Stevenson, Gary (G.L.)

**Sent:** Monday, October 06, 2008 2:02 PM

**To:** Allard, Chris (C.E.); Baldwin, Mark (M.E.); Bona, Sal (.); Branik, David (D.P.); Docimo, Tony (A.F.); Eggleston, Chauncy (C.R.); Farmer, Marty (M.F.); Freeman, Paul (P.W.); Garrett, Scott (S.A.); Gillman, Paul (P.D.); Gregorchik, Chris (C.); Herron, Micheal (M.C.); Joandrea, Maria (M.); Jones, Darryl (D.L.); Koenig, Neal (N.D.); Kotlyarova, Tanya (T.); Kurth, Kelly (K.J.); LaBroad, Steve (S.G.); Lauffer, Scott (SJL.); Lloyd, Dave (D.B.); Male, Michael (M.J.); Messervey, Brandon (B.C.); Morris, Wesley (W.G.); Peschiutta, Mark (M.A.); Richardson, Brian (B.D.); Roberts, Paul (P.W.); Steele, Kimberly (K.A.); Syed, Shaheen (Q.); Taylor, Rich (R.G.); Valachovic, Christian (C.); Williams, Dan (DW.); Willmer, Paul (P.H.); Wroblewski, Mike (M.J.)

**Subject:** V88\_Fowler\_ECB\_Jun12\_Sep11.xls

All,

Updated from this mornings meeting. If additional revisions are required, please send to me and I will maintain the 'master copy'.

<<...>>

V88 - ECB for Jun12-Sep11

**AAI - B65** 14

Whl damage	4
Whl stud stripped	2
Ctr caps discolored	2
Whl finish	2
Ctr caps missing	2
TPMS - Band broke	1
Lock lug nuts miss	1

**BSAQ#**

TBD - Lug nut grade change C. Eggleston / Mike Wroblewski

**CAP - B65** 21

Whl peeling	9
Whl damage	6
Whl finish	3
Whl balance	2
Whl leak	1

SAQ2008055227

**DTP - B65** 1

Whl Leak	1
----------	---

**HSAP - B65** 10

Whl finish - Chr peel	2
Valve stem - leak	2
Whl cap - peel	1
Whl cvr - loose	1
Whl finish - Paint	1
Whl stud - broken	1
Whl finish -	1
Whl vibrate	1

**KCAP - SUV - B65** 14

Whl noise	4
Whl orn - falling off	4

SAQ2008056784  
TBD

Wh orn missing	1	(8L8Z-1007-H)
		(MAZDA - 6M6Z-1130-A)
Whl flaw - bal wgts	1	
Whl orn - broken	1	
Whl orn - emb missi	1	
Whl orn - corr	1	
Whl - Chrome rust	1	

**KTP - B65** 11

TPMS	3	(2) fob missing;
		(1: Chr clad mislocated); request
Whl orn - falling off	3	part return (mis-aligned);
Valve stem - dually	1	rework?
Valve stem - leak	1	
Lug nut loose	1	
Whl cvr - cracked	1	impact damage skip plate - visual inspection
Whl cvr - chrome pe	1	(supplier)

**MTP - B65** 1

Whl -Chr clad flaw	1
--------------------	---

**OAC - B65** 25

		(lug nut install)	
Whl damage	5		SAQ200805683
Whl - peeling	4		SAQ2008053259
Whl - Noise	4		SAQ8008053258
TPMS	3		Presently under Investigation
Misbin	2		? More Info required Investigated by supplier - Customer used unapproved cleaning agent In plant process problem.
Whl defect - finish	2		Now contained
Infl kit missing	1		? More Info required
Whl cvrs- flaw	1		SAQ2008056865
Whl - Balance	1		? More Info required
Lug nut	1		In plant process problem.
Valve stem	1		Now contained
<b><u>OHAP - B65</u></b>	1		
Whl cvrs - fell off	1		I had called the Dealer and he indicated that the customer came in because one hubcap fell off The Dealer installed a new hubcap with no issues assembling the new hubcap. At OHAP, we do not install the hubcaps. We place them in the vehicle and is the dealer responsibility to install the hubcaps during pre-delivery.
<b><u>STAP - B65</u></b>	6		
			SAQ2008056930 The issue is contained with the plant addressing the work station with visual factory and re-establishing the primary control point for
Whl cvr - wrong	5		
Whl cvr - fit	1		
<b><u>TCAP - B65</u></b>	5		
			SAQ2008056869 (red/red) Vibration - as all three were for the steel rim out of round, only applies. Some parts have already been analyzed and were within spec, we still have at least one more SAQ2008056871 Tire Flash - green/green As the Spare Tire Winch has been primarily caused by the customer utilizing the wrong end of the stick and tearing it up. This could only be addressed by
Vibration	3		
Tire - cosmetic	1		
Sp tire winch inop	1		
<b><u>WSAP - B65</u></b>	24		
			We have already been investigating missing wheel covers. Starting Jan 2009, missing wheel cover R/1000's will no longer appear on ECB reports (CPU's do not appear now). The shipping company is responsible for items on the loose item check list, and dealers are suppose to contact the
Whl cvrs missing	6		
		Lug nut cover or lug nut? BSAQ?	
Whl loose / lug nut	6		I will investigate end of line wheel lug torque. We have already been investigating wheel cover finish
		Discoloring - BSAQ	
Whl finish	3		
TPMS Lt	2		
Lug nut / stud	2		
Whl cvr - noise	1		
TPMS - Band broke	1		
Tire - Leak	1		
Valve stem	1		
Misbin	1		

PD	ECBE01	ECBE01	ECBE01	REPAIR	DESIGN	MANUF	SUPP BI	CLM_KE	MDL_YR	ECBE01	PLANT_D	ECBE01	COMMON	VIN_CD	PRODN	WRTY_S	RPR_DT	TIS_WSD	MILGE	MTRL_C	LBR_CO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - STUD/LUG NUT		X		2804	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT89S79 5██████	2-Jul-08		17-Jul-08	-1	10	1.71	53.4
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - FLAW IN WHEEL			X	4486	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S39 5██████	3-Jul-08	24-Jul-08	25-Jul-08	1	10	451.18	34.78
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - CENTER CAP			X	4634	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT82H69 5██████	12-Jun-08	2-Jul-08	21-Jul-08	1	905	84	13.98
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	TPMS		X		5313	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT80N49 5██████	18-Jun-08	9-Jul-08	7-Aug-08	1	2035	38.67	24.23
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	- REPLACE TIRE (R1H/FLAT SPOTTING)			X	6105	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT80N59 5██████	31-Jul-08		7-Aug-08	-1	11	369.98	20.19
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - FLAW IN WHEEL			X	6800	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S69 5██████	23-Jul-08	12-Aug-08	11-Aug-08	0	20	451.18	56.16
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - CENTER CAP		X		8298	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S59 5██████	31-Jul-08		20-Aug-08	-1	2	14.46	0
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - CENTER CAP		X		9566	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT80N89 5██████	13-Aug-08		22-Aug-08	-1	1	12.82	7.44
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - CENTER CAP		X		11800	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S89 5██████	6-Aug-08		3-Sep-08	-1	11	14.46	19.2
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - ASSEMBLY DAMAGE		X		12399	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT85H39 5██████	4-Aug-08		28-Aug-08	-1	3	267.18	70.51
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES					13111	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZA	MUSTANG (LESS SVT) (NA)	1ZVHT80N79 5██████	22-Aug-08		5-Sep-08	-1	37	0	0
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - STUD/LUG NUT		X		13405	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S89 5██████	3-Jul-08	6-Aug-08	11-Sep-08	2	2651	0	0
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - FLAW IN WHEEL			X	14119	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S89 5██████	7-Aug-08		9-Sep-08	-1	6	451.18	84.74
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL/TIRE - FLAW IN WHEEL			X	14765	2009	CL	FLATROCK ASSEMBLY PLANT - USA	ZS	MUSTANG SVT (NA)	1ZVHT88S59 5██████	1-Aug-08		20-Aug-08	-1	22	451.18	247.8



LBR_HR	TOT_CO	VRT	VFG	CCC	MKT_DE	BOD_CA	VER_SER	DRIVE_C	ENG_CD	TRANS	CLR_TRI	PAINT_C	DOC_NU	WCC_CD	PRT_NU	PRT_NU	PRT_NU	PRT_NU	PART	COND_C	CUST_TX	TECH_TX
0.6	55.11	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BH - 2 DOOR CONVERTIBLE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PN3JE - VAPOR SILVER PEARL	125889C	5V01	4R3Z	1107	AA	HUB BOLT	42 - DOES NOT OPERATE PROPERLY	CK LF WHEEL STUD STRIPPED	REPLACED LF WHEEL STUD	
0.4	485.96	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PNNCA - COLORADO RED SOLID	38798101	5K01	7R3Z	1007	A	WHEEL ASSY	05 - POOR METAL FINISHING	ON L F WHEEL NO MARK ON RIM UNDER WHEEL	MARK ON EDGE OF RIM UNDER WHEEL	
0.2	97.98	S07 - EXTERIOR ORNAMENT	EXTERIOR TRIM & BUMPER FUNCTION	B66 - OTHER EXTERIOR TRIM TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/HZ - MOD 4.6L 3V OHC VCT NA ALV8	C/TL - 5 SPD AUTO TRANS NAAO 5R55S	000DW - CHARCOAL BLACK	PN3JE - VAPOR SILVER PEARL	25944301	5K02	5R3Z	1130	B	HUB CAP	81 - TARNISHED/FADED	STATES CHROME DIS COLORED ON ALL 4	FINISH REPLACED ALL 4 CENTER	
0.3	62.9	S09 - ELECTRICAL	ELECTRICAL ACCESSORIES FUNCTION	PRESSURE MONITORING TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/NE - COLOGNE 4.0L SOHC EFI NA V6 G	C/TL - 5 SPD AUTO TRANS NAAO 5R55S	000C4 - CAMEL	PN3JK - SANGRIA RED	4705351	5K07	6F2Z	1A193	C	TPMS BAND KIT	01 - BROKEN/CRAKED	LOW TIRE PRESSURE LIGHT ON	PRESSURE LIGHT REPLACED TIRE	
0.3	390.17	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/NE - COLOGNE 4.0L SOHC EFI NA V6 G	C/TL - 5 SPD AUTO TRANS NAAO 5R55S	000DW - CHARCOAL BLACK	PN3JK - SANGRIA RED	63309201	5K01	8R3Z	1007	Q	WHEEL ASSY	14 - SURFACE ROUGH/UNEVEN	COAT IS PEELING OFF RIGHT REAR RIM	REPLACED R REAR RIM	
0.7	507.34	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000EP - MIDNIGHT BLACK/CRIMSON RED	PNUAA - EBONY SOLID C/C	18182701	5K01	7R3Z	1007	A	WHEEL ASSY	70 - CHIPPED/SCRATCHED	CK FOR THE RT RIM IS SCRATCHED	REPLACED THE RT REAR RIM, INSTALL	
0	14.46	S08 - INTERIOR TRIM	V74 - OTHER INTERIOR TRIM	T53 - INTERIOR MOLDINGS FIT POORLY	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PN3JE - VAPOR SILVER PEARL	45406003	5K02	2M5Z	1130	AA	HUB CAP	39 - MISSING PART	MISSING CENTER CAP	INSTALLED CENTER CAP	
0.1	20.26	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/NE - COLOGNE 4.0L SOHC EFI NA V6 G	C/RF - 5 SPD MAN TRNS T50D/TR3150	000DW - CHARCOAL BLACK	PN3JE - VAPOR SILVER PEARL	9529602	5K02	4R3Z	1130	BA	HUB CAP	33 - LOOSE PART	1 WHEEL CAP MISSING	INSTALLED CAP	
0.2	33.66	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PNUAA - EBONY SOLID C/C	063101B	5K02	2M5Z	1130	AA	HUB CAP	81 - TARNISHED/FADED	CENTER CAP HAS BLEMISH, FOUND DURING	REPLACE RT REAR CENTER CAP DUE TO	
0.7	337.69	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BH - 2 DOOR CONVERTIBLE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/HZ - MOD 4.6L 3V OHC VCT NA ALV8	C/TL - 5 SPD AUTO TRANS NAAO 5R55S	000DW - CHARCOAL BLACK	PN3FE - VISTA BLUE	712773A	5K01	6R3Z	1007	H	WHEEL ASSY	06 - DENTS/DINGS	WHEEL HAS GOUGE AT RIM DIRECTION	AND BALANCE 1 TIRE, INSTALL	
0	0	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	C/AB - BASE VERSION - CAR	C/B - 2 WHL L/H REAR DRIVE	C/NE - COLOGNE 4.0L SOHC EFI NA V6 G	C/TL - 5 SPD AUTO TRANS NAAO 5R55S	000EN - MEDIUM DOVE	PN3JE - VAPOR SILVER PEARL	197506C	5K01	F2LY	1A043	A	WHEEL NUT - ANTI THEFT	39 - MISSING PART	LOCKING LUG NUTS MISSING	39 ORDERED ON THIS RO	
0	40.71	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PNUAA - EBONY SOLID C/C	154489A	5V01	*	1107	*	HUB BOLT	69 - FROZEN/SEIZED/BINDING	REFUND TO CUSTOMER	CUSTOMER FOR REPLACEMENT OF	
0.7	535.92	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000EP - MIDNIGHT BLACK/CRIMSON RED	PNUAA - EBONY SOLID C/C	12108701	5K01	7R3Z	1007	A	WHEEL ASSY	34 - DISTORTED/WRINKLED/WAVY	VEHICLE WITH CHROME ON WHEEL	APPROVAL CODE P13XX ORDERED WHEEL AS	
2.8	698.98	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/BJ - 2 DOOR COUPE-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/N8 - 5.4L 4V DOHC EFI S/C ALUM V8 G	C/VE - 6 SPD MAN TRANS NAAO T56	000DW - CHARCOAL BLACK	PN3FE - VISTA BLUE	66571801	5K01	7R3Z	1007	A	WHEEL ASSY	06 - DENTS/DINGS	STATES THAT THE PASSENGER REAR	OKED BY CARRESE LEJUE WHEEL	

CPSC_6	RPR_DL	RPR_DL	RPR_RE	RPR_NA	RPR_PH	RPR_ST	RPR_CN	SLS_DLR	SLS_CNT	SLS_DLR	SLS_REG	TXN_CD	LOAD_D	ECBE01	VRT	VFG	CCC	Total
0401XX	8	*	NA	LEN STOLER FORD, INC.	410 3567000	MD	USA	127034	USA	*	NA	1	24-Jul-08	25-Jul-08	TRUE	TRUE	TRUE	
40401	20411	*	NA	FIVE STAR FORD	480 9463900	AZ	USA	171174	USA	*	NA	1	4-Aug-08	5-Aug-08	TRUE	TRUE	TRUE	
40403	5876	*	NA	GRINDSTAFF FORD, INC.	423 5424136	TN	USA	147440	USA	*	NA	2	5-Aug-08	6-Aug-08	FALSE	FALSE	FALSE	
0404XX	10939	*	NA	PFEIFFER LINCOLN- MERCURY INC	616 9497800	MI	USA	141041	USA	*	NA	2	8-Aug-08	9-Aug-08	FALSE	FALSE	FALSE	
40401	5611	*	NA	EDDIE GILSTRAP MOTORS, INC.	812 8833481	IN	USA	147523	USA	*	NA	1	13-Aug-08	14-Aug-08	TRUE	TRUE	TRUE	
40401	3423	*	NA	WOODHOUS E FORD, INC.	402 4264126	NE	USA	153507	USA	*	NA	1	18-Aug-08	19-Aug-08	TRUE	TRUE	TRUE	
40403	1401	*	NA	HAGERSTO WN FORD	301 7333673	MD	USA	127463	USA	*	NA	1	25-Aug-08	26-Aug-08	FALSE	FALSE	FALSE	
0404XX	7965	*	NA	CRONIN FORD, INC.	513 3675300	OH	USA	147463	USA	*	NA	1	28-Aug-08	29-Aug-08	TRUE	TRUE	TRUE	
40403	1864	*	NA	POWER FORD VALENCIA	661 2556600	CA	USA	171491	USA	*	NA	1	8-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
301	8559	*	NA	LANDMARK FORD, INC.	503 6391131	OR	USA	174022	USA	*	NA	1	9-Sep-08	10-Sep-08	TRUE	TRUE	TRUE	
40401	6700	*	NA	MAGIC CITY FORD LINCOLN MERCURY	540 3450911	VA	USA	127080	USA	*	NA	1	11-Sep-08	12-Sep-08	TRUE	TRUE	TRUE	
60000	4357	*	NA	DOBBS FORD AT WOLFCHASE	901 3825555	TN	USA	123002	USA	*	NA	1	12-Sep-08	13-Sep-08	TRUE	TRUE	TRUE	
40401	669	*	NA	MICHAEL STEAD'S HILLTOP FORD	510 2224444	CA	USA	172016	USA	*	NA	1	16-Sep-08	17-Sep-08	TRUE	TRUE	TRUE	
40401	7755	*	NA	HARPER MOTORS	707 4437311	CA	USA	172413	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE	

PD	ECBE01	ECBE01	ECBE01	REPAIR	DE	MA	S	CL	MD	EC	PLANT	EC	COMM	VIN_CD	PRODN	WRTY	RPR_D	TI	MI	MTR	LBR	LB	TOT	VRT	VFG	CCC	MK	BOD	VER_S
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WEIGHT - MISINSTALL ED / REBALANCE		X		1150	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R79G	13-Jun-08	30-Jul-08	24-Jun-08	0	6	0	47.29	0.5	47.29	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	4267	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R49G	2-Jul-08	17-Jul-08	31-Jul-08	1	25	646.74	44.7	0.5	691.44	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL DAMAGED IN TRANSPORT		X		6904	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM94R69G	17-Jun-08		4-Aug-08	-1	2	412.94	39.2	0.4	452.14	S01 - SHEET METAL	V31 - SHEET METAL FUNCTION	B02 - BODY PANEL FITS POORLY	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	7865	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM94R59G	25-Jul-08	15-Aug-08	14-Aug-08	0	11	481.62	65.03	0.7	546.65	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	8467	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R79G	7-Aug-08	12-Aug-08	12-Aug-08	0	5	1453.1	71.14	0.8	1524.2	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	9219	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R39G	1-Aug-08	2-Sep-08	11-Aug-08	0	55	481.62	65.03	0.7	546.65	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	9403	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM94RX9G	25-Jul-08	12-Aug-08	20-Aug-08	1	511	542.51	34.78	0.4	577.29	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL SCRATCHED		X		11243	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R79G	24-Jun-08		20-Aug-08	-1	7	451.25	49.61	0.7	500.86	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	12823	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R19G	24-Jul-08	22-Sep-08	5-Sep-08	0	69	1701.5	156.5	1.7	1857.9	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL DAMAGED IN TRANSPORT			X	13155	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R29G	31-Jul-08	29-Aug-08	25-Aug-08	0	5	8.22	28.79	0.3	37.01	S13 - RIDE & HANDLING	V89 - RIDE & HANDLING	H62 - IMPROPER TIRE WEAR	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	13528	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM94R39G	24-Jul-08	23-Sep-08	4-Sep-08	0	1	1943.3	156.5	1.7	2099.71	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/BC - DELUXE VERSION
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	13966	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R19G	8-Aug-08	11-Sep-08	27-Aug-08	0	7	1926.5	146.3	1.7	2072.77	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14429	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R69G	13-Aug-08	26-Aug-08	26-Aug-08	0	10	481.62	52.76	0.7	534.38	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14825	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R99G	7-Aug-08		28-Aug-08	-1	51	963.23	44.47	0.5	1007.7	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]

F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14842	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM94R09G	24-Jul-08		5-Sep-08	-1	14	481.62	65.03	0.7	546.65	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14853	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R59G	5-Aug-08	10-Sep-08	10-Sep-08	0	90	1444.8	119.6	1.4	1564.42	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14854	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R09G	6-Aug-08	30-Aug-08	13-Sep-08	1	298	971.13	50.84	0.6	1021.97	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	14883	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R69G	7-Aug-08	23-Aug-08	15-Sep-08	1	###	963.23	48.89	0.6	1012.12	S04 - PAINT/PAIN T DAMAGE	V33 - PAINT APPEARANC E	F10 - PAINT SPRAY OVER BODY FINISH	L	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL FINISH DEFECTIVE			X	15066	2009	AD	CHICAGO PLANT BUILD	LE	LINCOLN MKS (NA-CAP)	1LNHM93R99G	13-Aug-08	13-Sep-08	8-Sep-08	0	13	1448.1	63.3	0.7	1511.42	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	L	C/FC - 4 DOOR SEDAN-6 LITE	C/AB - BASE VERSION - CAR
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	TIRE PINHOLE IN SIDEWALL	X	X	#####	2008	AD	CHICAGO PLANT BUILD	PG	FIVE HUNDRE D (NA-CAP)	1FAHP24W28G	30-Jul-08	14-Aug-08	28-Aug-08	1	601	279.93	60.32	0.7	340.25	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	C/FC - 4 DOOR SEDAN-6 LITE	* - [N/A]	
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL AND TIRE REBALANCE	X	X	#####	2008	AD	CHICAGO PLANT BUILD	PB	TAURUS X/FREEST YLE (NA-CAP)	1FMDK05W78G	20-Jun-08	5-Jul-08	22-Aug-08	2	###	0	18.3	0.3	18.3	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/KE -	

DRIVE	ENG_CD	TRANS	CLR	PAINT	DOC	WC	PRT	PRT	P	PART	COND_C	CUST_TX	TECH_TX	CP	RP	F RP	RPR_N	RPR_P	R	RP	SLS	SL	S	SL	T	LOAD	ECBE0	VRT	VFG	CCC	TOT		
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	3246552	5K04	*		FRBAL	*	FRONT WHEEL BALANC E	D9 - OUT OF BALANCE	STATES WHEEL WEIGHTS INCORRECT	INTERNAL FAULT BALANCED RF WHEEL	40401	####	*	NA	SESI LINCOLN- MERCURY	734 68600	MI	USA	345350	USA	*	NA	1	3-Jul-08	8-Jul-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	061980 C	5K01	8A5Z	1007		C	WHEEL ASSY	D4 - FLAW IN MATERIAL	STATES SURFACE SPOTS ON RIGHT REAR	CONFIRM NECESSARY TO REPLACE	40401	####	*	NA	BURLINGT ON LINCOLN- MERCURY	609 3864900	NJ	USA	315036	USA	*	NA	1	1-Aug-08	2-Aug-08	TRUE	TRUE	TRUE	
C/E - 4 WHL L/H PART TIME DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3FF - SMOKEST ONE	087291 C	5K01	8A5Z	1007		B	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	NEED TO REPLACE DAMAGED WHEEL	REPLACE WHEEL	40401	####	*	NA	VISTA LINCOLN- MERCURY	818 3489600	CA	USA	354251	USA	*	NA	1	18-Aug-08	19-Aug-08	FALSE	FALSE	FALSE	
C/E - 4 WHL L/H PART TIME DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	301448 A	5K01	8A5Z	1007		C	WHEEL ASSY	D4 - FLAW IN MATERIAL	LFT FR WHL FINISH IS PEELING	WARRANTY VERIFIED FLAW IN FINISH ON	40401	####	*	NA	DEMME LINCOLN MERCURY, INC.	313 2748800	MI	USA	345070	USA	*	NA	1	21-Aug-08	22-Aug-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	3E+07	5K01	8A5Z	1007		C	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	WHEELS CAME WITH PLASTIC PROTECTIV	1007 C WHEELS X 3 ONE WHEEL SENSOR	40401	####	*	NA	VARSITY LINCOLN- MERCURY, INC.	248 3055300	MI	USA	345335	USA	*	NA	1	25-Aug-08	26-Aug-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	301261 A	5K01	8A5Z	1007		C	WHEEL ASSY	D4 - FLAW IN MATERIAL	FINISH FR RHT FRNT WHEEL OK TO	WARRANTY VERIFIED FLAW IN FINISH ON	40401	####	*	NA	DEMME LINCOLN MERCURY, INC.	313 2748800	MI	USA	345070	USA	*	NA	1	27-Aug-08	28-Aug-08	TRUE	TRUE	TRUE	
C/E - 4 WHL L/H PART TIME DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3KQ - TUXEDO BLACK METALLIC	3565501	5K01	8A5Z	1007		C	WHEEL ASSY	D4 - FLAW IN MATERIAL	CLEAR MISSING FROM RT FRONT	RIM CLEARCOAT ISSUES, DETERIORA	40401	1758	*	NA	HILLTOP FORD- LINCOLN- MERCURY,	517 5462250	MI	USA	345181	USA	*	NA	1	28-Aug-08	29-Aug-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000SI - CASHM ERE	PN3JG - CINNAMO N	259428 E	5K01	8A5Z	1007		B	WHEEL ASSY	70 - CHIPPED/S CRATCHED	RIGHT FRONT WHEEL SCRATCHED	FIND RIGHT FRONT WHEEL SCRATCHED	40401	8053	*	NA	FORD LINCOLN MERCURY, INC.	217 2228700	IL	USA	363590	USA	*	NA	1	4-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3KQ - TUXEDO BLACK METALLIC	5143301	5K01	8A5Z	1007		B	WHEEL ASSY	D1 - POROSITY	WHEELS PEELING B65	WHEELS PEELING. NECC TO REPLACE	40401	####	*	NA	LITAN LINCOLN- MERCURY, LLC	734 4254300	MI	USA	345345	USA	*	NA	1	10-Sep-08	11-Sep-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3HW - DARK INK BLUE	4178381	5K07	6F2Z	1A193		K	TPMS BAND KIT	42 - DOES NOT OPERATE PROPERLY	FRONT WHEEL GOUGED (TRANSPOR	INSTALLED LEFT FRONT WHEEL (IN TRUNK)	40403	8746	*	NA	GALPIN FORD	**	CA	USA	354015	USA	*	NA	2	11-Sep-08	12-Sep-08	FALSE	FALSE	FALSE	
C/E - 4 WHL L/H PART TIME DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3JG - CINNAMO N	5139101	5K01	8A5Z	1007		C	WHEEL ASSY	CORROSIO N (PERFORA TION)	STATES DISCOLOR IN BOTH REAR	MANAGER VERIFIED ALL FOUR WHEELS	40401	####	*	NA	LITAN LINCOLN- MERCURY, LLC	734 4254300	MI	USA	345345	USA	*	NA	1	12-Sep-08	13-Sep-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000SI - CASHM ERE	PN3JG - CINNAMO N	2.3E+07	5K01	8A5Z	1007		C	WHEEL ASSY	D4 - FLAW IN MATERIAL	PAINT IS PEELING ON ALL FOUR WHEELS.	REPLACE ALL FOUR WHEELS	40401	####	*	NA	BROTHER S LINCOLN MERCURY, LLC	225 9247068	LA	USA	322408	USA	*	NA	1	15-Sep-08	16-Sep-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3JG - CINNAMO N	1.4E+07	5K01	8A5Z	1007		C	WHEEL ASSY	49 - CONTAMIN ATED/FORE IGN	CLEANING CAR FOR DELIVERY PULLED	NEW WHEEL DISMOUNT TIRE ON	40401	####	*	NA	CORTESE LINCOLN- MERCURY, INC.	585 2720220	NY	USA	318288	USA	*	NA	1	16-Sep-08	17-Sep-08	TRUE	TRUE	TRUE	
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	PN3JK - SANGRIA RED	3E+07	5K01	8A5Z	1007		C	WHEEL ASSY	38 - WRONG PART		CC 14 VERIFIED CONCERN AND APON	40401	####	*	NA	VARSITY LINCOLN- MERCURY, INC.	248 3055300	MI	USA	345335	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE	

C/E - 4 WHL L/H PART TIME DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3JG - CINNAMO N	302374 C	5K01	8A5Z	1007	C	WHEEL ASSY	D4 - FLAW IN MATERIAL	FRONT WHEEL HAS FLAW IN FINISH	WARRANTY VERIFIED CHIPS IN RIGHT	40401	####	*	NA	DEMME LINCOLN MERCURY, INC.	313 2748800	MI	USA	345070	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	124897 A	5K01	8A5Z	1007	C	WHEEL ASSY	14 - SURFACE ROUGH/UN EVEN	CHECK LEFT FRT WHEEL FINISH ON RIM PEELED	REPLACED LEFT FRT LEFT REAR AND RIGHT	40401	####	*	NA	LINCOLN MERCURY OF INDEPEND	216 5240770	OH	USA	318483	USA	*	NA	2	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3JK - SANGRIA RED	5159701	5K01	8A5Z	1007	C	WHEEL ASSY	05 - POOR METAL FINISHING	FOR DELIVERY. CHROME WASHED	INSTALLED NEW RIMS. ALL OK AT THIS TIME.	40401	####	*	NA	GENESEE VALLEY LINCOLN MERCURY	810 2302500	MI	USA	345147	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	PN3KQ - TUXEDO BLACK METALLIC	611803 A	5K01	8A5Z	1007	C	WHEEL ASSY	05 - POOR METAL FINISHING	STATES FINISH PEELING OFF BOTH	REPLACE WHEELS	40401	####	*	NA	LEITH LINCOLN- MERCURY	919 8729500	NC	USA	326654	USA	*	NA	2	17-Sep-08	18-Sep-08	FALSE	FALSE	FALSE
C/A - 2 WHL L/H FRONT DRIVE	C/RM - 3.7L 4V-DAMB PFI V6 NA GAS	C/WJ - 6 SPD AUTO TRANS 6F	000BH - SAND	WHITE CHOCOLA TE TRI- COAT	4.1E+07	5K01	8A5Z	1007	C	WHEEL ASSY	D4 - FLAW IN MATERIAL	STATES LEFT FRONT, RIGHT	AUTH FOR 3 RIMS PAATN	40401	2405	*	NA	CITIES FORD LINCOLN MERCURY	214 3588800	TX	USA	367510	USA	*	NA	1	18-Sep-08	19-Sep-08	TRUE	TRUE	TRUE
C/A - 2 WHL L/H FRONT DRIVE	C/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS	C/WJ - 6 SPD AUTO TRANS 6F	000SV - MEDIU M LT STONE	PNUAA - EBONY SOLID C/C	4.6E+07	5K01	8G1Z	1007	A	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	CONCERNE D WITH DRIVERSIDE REAR TIRE	APPROVAL PAAEN TO REPLACE WHEEL	40401	2091	*	NA	PLANET FORD	281 7193700	TX	USA	156016	USA	*	NA	2	1-Sep-08	2-Sep-08	TRUE	TRUE	TRUE
T/E - 4 WHL L/H PART TIME DRIVE	T/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS	T/WJ - 6 SPD AUTO TRANS 6F	000SV - MEDIU M LT STONE	PN3HW - DARK INK BLUE	114998 A	5K04	*	FRBAL	*	FRONT WHEEL BALANC E	D9 - OUT OF BALANCE	CHECK TIRES	END VIBRATES AT 55MPH CHECKED	40401	####	*	NA	AVIS RAC - RALEIGH	**	NC	USA	158807	USA	*	NA	2	3-Sep-08	9-Sep-08	TRUE	TRUE	TRUE

PF	ECBE0	ECBE01	ECBE01	REPAIR	DESI	MA	SU	CLM	MDL	ECB	PLAN	EC	COMMO	VIN_CD	PRODN	WRTY_S	RPR_DT	TIS_WSD	MILGE	MTRL_C	LBR_CO	LBR_HR	TOT_CO
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL REPLACED -			X	1243957	2008	AF	DEARB ORN	FD	F-SERIES (NA-DTP)	1FTRX14W8 8F [REDACTED]	24-Jun-08	10-Jul-08	23-Jul-08	1	1679	172.44	28.52	0.4	200.96

VRT	VFG	CCC	MKT_DE	BOD_CA	VER_SE	DRIVE_C	ENG_CD	TRANS	CLR_TRI	PAINT_C	DOC_NU	WCC_CD	PRT_NU	PRT_NU	PRT_NU	PART	COND_C	CUST_TX	TECH_TX
STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BD - SUPER	17AM - T50 SERIES	17E - 4 WFL L/H PART	17VN - R-M 4.6L SOHC	17B7 - 4 SP A/T 4R75E	000BY - MEDIUM	PN3AF - DARK BLUE	6709851	5K01	7L3Z	1015	C	WHEEL ASSY	42 - DOES NOT	CUSTOMER STATES	RIM NOT SEALING



CPSC_6	RPR_DL	RPR_DL	RPR_RE	RPR_NA	RPR_PH	RPR_ST	RPR_CN	SLS_DLR	SLS_CNT	SLS_DLR	SLS_RE	TXN_CD	LOAD_D	ECBE01	VRT (ECB	VFG (ECB	CCC (ECB	total Claims
40401	1200	*	NA	NICK NICHOLAS	352 7261231	FL	USA	156016	USA	*	NA	2	29-Jul-08	30-Jul-08	TRUE	TRUE	TRUE	

PF	ECBE0	ECBE01	ECBE01	REPAIR	D	M	SU	CLM	MD	E	PLANT	EC	COMMO	VIN_CD	PROD	WRTY	RPR_D	TI	MI	MTR	LBR	LB	TOT	VRT	VFG	CCC	M	BOD	VER	DRIVE	ENG_CD
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	RIM DEFECTIVE			X	5560	2009	A3	HERMOSILO PLANT BUILD	ZP	MKZ/ZEPHYR (NA-HSAP)	3LNHM26T59 F██████	27-Jun-08	17-Jul-08	7-Aug-08	1	840	518.73	36.81	0.4	555.5	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	L	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	VALVE DEFECTIVE			X	6605	2009	A3	HERMOSILO PLANT BUILD	ZP	MKZ/ZEPHYR (NA-HSAP)	3LNHM26T09 F██████	4-Aug-08		14-Aug-08	-1	1	1.83	15.58	0.2	17.41	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	L	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	HUB CAP DEFECTIVE			X	8053	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP06ZX9 F██████	29-Jul-08		7-Aug-08	-1	5	26.18	16.64	0.2	42.82	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	RIM DEFECTIVE			X	8116	2009	A3	HERMOSILO PLANT BUILD	ZP	MKZ/ZEPHYR (NA-HSAP)	3LNHM26T89 F██████	24-Jul-08		20-Aug-08	-1	13	515.93	60.84	0.9	576.8	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	L	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL COVER DEFFECTIVE			X	8411	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP06Z29 F██████	20-Jun-08	28-Jul-08	20-Aug-08	1	700	26.18	7.94	0.1	34.12	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	VALVE DEFECTIVE			X	8445	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP08Z59 F██████	6-Aug-08		25-Aug-08	-1	5	1.83	14.8	0.2	16.63	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL DEFECTIVE			X	12274	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP08Z79 F██████	24-Jun-08	26-Jul-08	12-Aug-08	1	935	193.34	915.8	1.7	1109	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	LUG NUT			X	13165	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP08Z89 F██████	6-Aug-08		29-Aug-08	-1	6	53.09	103.6	1.4	156.7	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	WHEEL DEFECTIVE			X	13220	2009	A3	HERMOSILO PLANT BUILD	ZP	MKZ/ZEPHYR (NA-HSAP)	3LNHM26T59 F██████	28-Jun-08	31-Jul-08	9-Sep-08	2	812	517.76	122.1	1.6	639.8	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	L	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/N5 - 3.5L 4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	TIRE BALANCE			X	14120	2009	A3	HERMOSILO PLANT BUILD	DE	FUSION (NA-HSAP)	3FAHP07Z19 F██████	2-Sep-08		16-Sep-08	-1	9	0	48.42	0.4	48.42	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB BCAP TROUBLES	F	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/A - 2 WHL L/H FRONT DRIVE	C/GZ - 2.3L-4V DOHC EFI NA I4 GAS

TRANS_C	CLR_TR	PAINT	DOC	WC	PR	PR	PR	PART	COND_C	CUST_TXT	TECH_TXT	CPSC	RPR	R	RP	RPR_NA	RPR_P	RP	RP	SLS	SL	S	SL	T	LOAD_	ECBE0	VRT (E)	VFG (E)	ECCC (I)	Claims
C/VX - 6 SPD AUTO TRANS AISIN F21	000DW - CHARCOA L BLACK	TUXEDO BLACK METALLI C	5E+06	5K01	6H6Z	1007	BA	WHEEL ASSY	D7 - CORROSION (PERFORATI ON)	DRV SIDE REAR WHEEL IS PITTING B65	COMPLAINT CHROME PEELING CCD7 NECC TO REPLACE BRIAN GRAHAM REPLACED OLD WITH	40401	11164	*	NA	TAN LINCOLN- MERCURY, LLC	734 4254300	MI	USA	345345	USA	*	NA	1	11-Aug-08	13-Aug-08	TRUE	TRUE	TRUE	
C/VX - 6 SPD AUTO TRANS AISIN F21	000NH - DARK CHARCOA L/SAND	TUXEDO BLACK METALLI C	3E+06	5K02	F42Z	1700	A	VALVE & CAP ASSY	IMPROPERL Y ADJUSTED/F ITS POORLY	STATES THE RIGHT REAR TIRE HAS A SLOW LEAK, CHEKC	THE RIGHT REAR TIRE WAS LEAKING THROUGH THE VALVE STEM. TECH REPLACED THE VALVE	NANANA	7463	*	NA	CASTRUCCI FORD LINCOLN MERCURY	859 4489400	KY	USA	346104	USA	*	NA	1	15-Aug-08	16-Aug-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000SV - MEDIUM LT STONE	PN3AB - REDFIRE	6E+06	5K02	7E5Z	1130	A	HUB CAP	D4 - FLAW IN MATERIAL	UPON DOING PDI,FOUND ONE HUBCAP PEELING AND FLAKING.	HUB CAP REPLACED HUB CAP WITH NEW	40403	5654	*	NA	JACK KAIN FORD, INC.	859 8736666	KY	USA	147112	USA	*	NA	1	22-Aug-08	23-Aug-08	TRUE	TRUE	TRUE	
C/VX - 6 SPD AUTO TRANS AISIN F21	000DW - CHARCOA L BLACK	BRILLIAN T SILVER METALLI C	131048 A	5K01	6H6Z	1007	BA	WHEEL ASSY	05 - POOR METAL FINISHING	LEFT REAR WHEEL CHROME PEELINGG	WHEEL,RIM, TRANSFERRED TIRE PRESSURE MONITOR SENSOR WITH EW BAND	40401	10359	*	NA	REINEKE LINCOLN MERCURY MAZDA INC.	419 2277400	OH	USA	345219	USA	*	NA	1	22-Aug-08	23-Aug-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000SV - MEDIUM LT STONE	PN3HW - DARK INK BLUE	4E+06	5K02	7E5Z	1130	A	HUB CAP	33 - LOOSE PART	WHEEL COVER CAME LOSS AND GOT BENT RIGHT FRT WHEEL	VERIFY CONCERN REPLACE RIGHT FRONT WHEEL COVER	40403	7467	*	NA	WOLTZ & WIND FORD, INC.	412 2794551	PA	USA	113568	USA	*	NA	2	25-Aug-08	26-Aug-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000DW - CHARCOA L BLACK	PN3JE - VAPOR SILVER PEARL	058160 A	5K02	F42Z	1700	A	VALVE & CAP ASSY	01 - BROKEN/CR ACKED	LEFT REAR TIRE LEAKS AIR	LEAKING. VALVE STEM BAD. REPLACED VALVE STEM TO CORRECT PROBLEM.	0404XX	9273	*	NA	DEML FORD LINCOLN- MERCURY, INC.	507 8353425	MN	USA	158625	USA	*	NA	1	25-Aug-08	26-Aug-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000DW - CHARCOA L BLACK	TUXEDO BLACK METALLI C	194384 A	5K01	*	1007	*	WHEEL ASSY	D4 - FLAW IN MATERIAL	PRIMER SHOWING THROUGH ON ALL 4 WHEELS	SENT WHEELS TO HUBCAP HEAVEN AND WHEELS INC. REFINISHED 4 WHEELS.	40401	3016	*	NA	KENNY ROSS FORD SOUTH, INC.	412 8810001	PA	USA	144005	USA	*	NA	2	9-Sep-08	10-Sep-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000DW - CHARCOA L BLACK	PN3JD - WHITE SUEDE	058238 A	5V01	6E5Z	1104	AB	HUB ASSY- FRONT	01 - BROKEN/CR ACKED	TWISTED OFF WHEN TORQUING LUGNUTS FOR PDI	TORQUING LUGNUTS A WHEEL STUD TWISTED OFF ON RIGHT FRONT WHEEL. REPLACED HUB	40104	9273	*	NA	DEML FORD LINCOLN- MERCURY, INC.	507 8353425	MN	USA	158625	USA	*	NA	1	11-Sep-08	12-Sep-08	TRUE	TRUE	TRUE	
C/VX - 6 SPD AUTO TRANS AISIN F21	000SU - LT STONE	TUXEDO BLACK METALLI C	2E+07	5K01	6H6Z	1007	BA	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	STATES LEFT REAR WHEEL APEEARS PITTED PART IN	TIRE & REMOVE TIRE PRESSURE SENSOR TO REPLACE WHEEL. INSTALL NEW CLAP ON	40401	11603	*	NA	KARRAS LINCOLN- MERCURY, INC.	941 7564004	FL	USA	325007	USA	*	NA	2	11-Sep-08	12-Sep-08	TRUE	TRUE	TRUE	
C/B5 - 5 SPD AUTO MAZDA FNR5	000DW - CHARCOA L BLACK	TUXEDO BLACK METALLI C	1E+07	5K04	*	ALBA L	*	ALL WHEEL BALANC E	D9 - OUT OF BALANCE	FRONT WHEEL VIBRATION AT FREEWAY SPEEDS	VERIFY CUSTOMER CONCERN. PERFORM 4 WHEEL BALANCE. FOUND ALL WHEELS EXCEPT THE	40402	669	*	NA	MICHAEL STEAD'S HILLTOP FORD	510 2224444	CA	USA	172016	USA	*	NA	1	16-Sep-08	17-Sep-08	TRUE	TRUE	TRUE	

PF	ECBE	ECB	ECBE0	REPAI	D	M	S	CLM	MD	E	PLANT	EC	COMM	VIN_CD	PRODN	WRTY	RPR_DT	TIS	MIL	MTRL	LBR	LB	TOT	VRT	VFG	CCC	M	BOD	VER SE	DRIVE C	ENG C
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	CAPS MISSING		X		10230	2009	AJ	CITY PLANT BUILD	M6	HYBRID (NA-	X9KA24986	18-Aug-08		26-Aug-08	-1	3	0	0	0	0	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	F	DOOR LIGHT	T/EF - FORD SERIES	L/H FRONT DRIVE	CYC 2.5 4V PFI I4
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP	REFINISH		X	X	12974	2009	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS	1FMCU93G69KA227	19-Aug-08		28-Aug-08	-1	3	0	250	0	250	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP	F	T/WE - 5 DOOR	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL	T/SG - 3.0L 4V OHC V6
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLE S					14230	2009	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS HYBRID) (NA)	1FMCU94729KA02410	23-Jun-08	31-Jul-08	26-Aug-08	1	1801	940.34	215.8	2.1	1156.2	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/WE - 5 DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	T/S7 - 2.5L DOHC PFI 4 CYL GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLE S					15166	2009	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS HYBRID) (NA)	1FMCU04G19KA17539	22-Jul-08	9-Aug-08	13-Sep-08	2	1150	1707.38	157.4	1.7	1864.8	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/WE - 5 DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	T/SG - 3.0L 4V OHC V6 DURATEC 230HP
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLE S	CENTER CAP BROKEN			X	1E+06	2008	AJ	KANSAS CITY PLANT BUILD	MR	MARINER (LESS HYBRID) (NA)	4M2CU87188KJ54755	20-Jun-08		3-Jul-08	-1	28	15.22	17.79	0.2	33.01	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	M	T/WE - 5 DOOR LIGHT TRUCK	T/EL - LINCOLN/MERCURY SERIES	T/A - 2 WHL L/H FRONT DRIVE	T/LD - MOD 3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLE S	WHEEL COVERS REPLAC E		X		1E+06	2008	AJ	KANSAS CITY PLANT BUILD	MR	MARINER (LESS HYBRID) (NA)	4M2CU97178KJ51321	17-Jun-08	30-Aug-08	21-Jul-08	0	5	15.22	6.62	0.1	21.84	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	M	T/WE - 5 DOOR LIGHT TRUCK	T/EL - LINCOLN/MERCURY SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	T/LD - MOD 3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLE S	WHEEL REPLAC ED - WARPED			X	1E+06	2008	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS HYBRID) (NA)	1FMCU94178KE78128	12-Jun-08	30-Jun-08	14-Jul-08	1	434	853.11	26.96	0.3	880.07	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/WE - 5 DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	T/LD - MOD 3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	CAP DISCOLO R		X		1E+06	2008	AJ	CITY PLANT BUILD	MR	MARINER (LESS HYBRID) (NA)	X8KJ51242	17-Jun-08	26-Jul-08	11-Aug-08	1	425	32.61	6.66	0.1	39.27	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	M	DOOR LIGHT	LINCOLN/MERCURY	L/H FRONT DRIVE	4V DOHC EFI NA I4
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLE S	HUBCAP CHROME PEELING		X		1E+06	2008	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS HYBRID) (NA)	1FMCU03198KE82677	17-Jun-08	5-Aug-08	25-Jul-08	0	15	426.55	62.28	0.7	488.83	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/WE - 5 DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	T/LD - MOD 3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	CAPS LOOSE		X		1E+06	2008	AJ	CITY PLANT BUILD	MR	(LESS HYBRID)	4M2CU91158KJ54579	20-Jun-08	6-Aug-08	20-Aug-08	1	853	15.22	9.22	0.1	24.44	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP	M	DOOR LIGHT	LINCOLN/MERCURY	L/H FULL TIME DRIVE	3.0L DOHC EFI NA V6
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP	HUB CAP LOOSE		X		1E+06	2008	AJ	KANSAS CITY PLANT BUILD	MR	MARINER (LESS HYBRID) (NA)	4M2CU871X8KJ5457	17-Jun-08	18-Jul-08	18-Aug-08	2	1852	15.22	6.69	0.1	21.91	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP	M	T/WE - 5 DOOR	T/EL - LINCOLN/MERCURY	T/A - 2 WHL L/H FRONT DRIVE	T/LD - MOD 3.0L DOHC
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLE S	HUB CAP REPLAC ED		X	X	1E+06	2008	AJ	KANSAS CITY PLANT BUILD	MR	(LESS HYBRID) (NA)	4M2CU91108KJ51220	17-Jun-08	29-Jul-08	3-Sep-08	2	842	38.7	0	0	38.7	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLES	M	DOOR LIGHT TRUCK	LINCOLN/MERCURY SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLE S	HUB CAP MISSING		X		2E+06	2008	AJ	KANSAS CITY PLANT BUILD	MR	(LESS HYBRID) (NA)	4M2CU81148KJ54535	17-Jun-08	31-Jul-08	11-Sep-08	2	2672	15.22	8.05	0.1	23.27	S10 - CHASSIS	V88 - TIRES	WHEEL/HUBCAP TROUBLES	M	DOOR LIGHT TRUCK	LINCOLN/MERCURY SERIES	T/A - 2 WHL L/H FRONT DRIVE	3.0L DOHC EFI NA V6 G*NAAO
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLE S	WHEEL REPLAC ED - DEFECTI VE		X		2E+06	2008	AJ	KANSAS CITY PLANT BUILD	M4	ESCAPE (LESS HYBRID) (NA)	1FMCU03128KE82813	18-Jun-08	23-Jul-08	29-Aug-08	2	2258	1713.55	389.1	4.3	2102.6	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUBCAP TROUBLES	F	T/WE - 5 DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	T/LD - MOD 3.0L DOHC EFI NA V6 G*NAAO

TRANS	CLR	PAIN	DOC	WC	PRT	PR	P	PAR	COND_C	CUST_TXT	TECH_TXT	CPS	RP	R	R	RPR_NA	RPR_P	R	RP	SLS	SL	S	S	T	LOAD	ECBE0	VRT (1VFG (ICCC (I		
AUTO TRANS*P	000ST - STONE	MONTE	9075552	5K02	6L8Z	1130	B	HUB CAP	MISSING PART	MISSING LITTLE CENTER HUB CAPS PER HARLEY	INSTRALL MISSING CENTER CAPS	40403	5466	*	NA	DREW FORD	619 4647777	CA	USA	171080	USA	*	NA	1	1-Sep-08	2-Sep-08	TRUE	TRUE	TRUE
T/W6 - 6 SPD	000ST - STONE	PN3E3 - LT	078668B	5K01	*	1007	*	WHEEL	D4 - FLAW IN	MARKS ON REAR WHEELS CAUSED BY	REFINISH WHEELS	40401	1213	*	NA	HALDEMAN FORD	609 5867600	NJ	USA	116200	USA	*	NA	1	11-Sep-08	#####	TRUE	TRUE	TRUE
T/W6 - 6 SPD AUTO TRANS 6F MID-RANGE	000Y9 - CHARC OAL	PN3KD - STERLING GRAY METALLIC	1836101	5K01	8L8Z	1007	H	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	CUST STATES VEHICLE MAKES NOISE WHEN YOU MAKE RIGHT TURNS	ROAD TEST EXTENSIVLY TO VERIFY CONCERN. HEARD NOISE FROM FRONT BRAKE AREA. DISASSEMBLE FRONT BRAKES AND LUBE CALIPER SLIDES & PINS. REASSEMBLE AND ROAD TEST AGAIN, NOISE STILL THERE. CONTACT HOT LINE	40401	4085	*	NA	WYCKOFF FORD, INC.	201 8914445	NJ	USA	113157	USA	*	NA	2	16-Sep-08	#####	TRUE	TRUE	TRUE
T/W6 - 6 SPD AUTO TRANS 6F MID-RANGE	000Y9 - CHARC OAL	PN3KD - STERLING GRAY METALLIC	9357951	5K01	8L8Z	1007	H	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	USE SPO 08250001 CHECK FOR CLICK AT SLOW SPEEDS FROM WHEELS SEE DIAG SHEET WHEN WINDOWS ARE DOWN	REPLACE ALL WHEELS AND TIRE SENSORS DUE TO WHEELS MAKING NOISE REPLACED ALL TIRE SENSORS DUE TO BROKEN AND SPLIT VALVE STEMS BALANCE ALL WHEELS AND	40401	5466	*	NA	DREW FORD	619 4647777	CA	USA	171080	USA	*	NA	1	18-Sep-08	#####	TRUE	TRUE	TRUE
SPD AUTO TRANS NAAO	000ST - STONE	PN3AB - REDFIRE	2981252	5K02	6M6Z	1130	A	HUB CAP	01 - BROKEN/CRAKED	REPLACE DAMAGED CENTER WHEEL CAP	INSTALL WHEEL COVER BROKEN	40403	11899	*	NA	FREEWAY LINCOLN-MERCURY	909 8893514	CA	USA	354235	USA	*	NA	1	10-Jul-08	11-Jul-08	TRUE	TRUE	TRUE
SPD AUTO TRANS NAAO	000Y9 - CHARC OAL	LIGHT ICE BLUE METALLIC	116112A	5K02	6M6Z	1130	A	HUB CAP	D4 - FLAW IN MATERIAL	EMBLEM ON HUBCAP IS MISSING ON L R SIDE	REPLACE WHEEL COVER EMBLEM MISSING	40403	9279	*	NA	JOHN WIESE FORD, INC.	320 3526561	MN	USA	343011	USA	*	NA	1	28-Jul-08	29-Jul-08	TRUE	TRUE	TRUE
SPD AUTO TRANS NAAO CD4E	000Y9 - CHARC OAL	PNZJC - SILVER MET C/C #2	8353052	5K01	8L8Z	1007	H	WHEEL ASSY	D4 - FLAW IN MATERIAL	REPLACE RIMS NOISY SEE NICK SOP HERE	REPLACED RIGHT FRONT AND LEFT REAR RIM PER WARRANTY AND NEW RIM BANDS WITH OLD WHEEL SENSORS. RIMS DEFORMED	40401	2737	*	NA	VILLAGE FORD INC	313 5653900	MI	USA	148027	USA	*	NA	1	31-Jul-08	1-Aug-08	TRUE	TRUE	TRUE
SPD AUTO	000Y9 - CHARC OAL	MONTE	6896301	5K02	6M6Z	1130	A	HUB CAP	BROKEN/CRAKED	CUSTOMER STATES CENTER CAPS CORODED	CUSTOMER STATES CENTER CAPS CORODED CONFIRM AND REPLACE	40403	10552	*	NA	LEAF LINCOLN-	309 9443298	IL	USA	342253	USA	*	NA	2	14-Aug-08	#####	TRUE	TRUE	TRUE
SPD AUTO TRANS NAAO	000ST - STONE	PN3FE - VISTA BLUE	3.3E+07	5K01	8L8Z	1007	H	WHEEL ASSY	D4 - FLAW IN MATERIAL	RIGHT FRONT WHEEL CHROME FINISH IS PEELING LOOKS RUSTED	CODE D4 MILEAGE 16 REPLACED RIGHT FRONT RIM INSTALLED SENSOR BAND AND SENSOR ALSO	40401	2736	*	NA	VARSITY FORD	734 9962300	MI	USA	148426	USA	*	NA	1	19-Aug-08	#####	TRUE	TRUE	TRUE
SPD AUTO	000ST - STONE	LT SAGE	8.8E+07	5K02	6M6Z	1130	A	HUB CAP	33 - LOOSE PART	CUST STATES THE CENTER CAP KEEPS	REPLACED CENTER CAP	40403	11079	*	NA	TOLL LINCOLN	215 7574961	PA	USA	315146	USA	*	NA	1	22-Aug-08	#####	TRUE	TRUE	TRUE
T/DJ - 4 SPD	000ST - STONE	PN3E3 - LT	1.3E+07	5K02	6M6Z	1130	A	HUB CAP	42 - DOES NOT	THE RIGHT FRONT CENTER CAP COMES OFF	REPLACE LOOSE CENTER CAP. WONT STAY ON	40403	9989	*	NA	MARK MARTIN	870 7934461	AR	USA	322529	USA	*	NA	2	1-Sep-08	2-Sep-08	TRUE	TRUE	TRUE
SPD AUTO TRANS	000ST - STONE	MONTE REY/BL	9290251	5K02	6M6Z	1130	A	HUB CAP	24 - LOOSE FASTENER	CUST STATES ONE OF THE CENTER CAPS IS BROKEN AND ONE HAD	VERIFY CONCERN REMOVE AND REPLACE 2 HUB CAPS RECK OK	40403	11234	*	NA	LINCOLN MERCURY OF WAYNE	973 6969700	NJ	USA	314324	USA	*	NA	1	5-Sep-08	9-Sep-08	TRUE	TRUE	TRUE
SPD AUTO TRANS	000ST - STONE	MONTE REY/BL	132929C	5K02	6M6Z	1130	A	HUB CAP	39 - MISSING PART	CUST STATES CHECK LEFT FRONT CENTER CAP FELL OFF WHILE	2672 INSTALLED NEW CENTER CAP DRIVER FRONT	40403	12210	*	NA	DICK BARKER, INC.	985 8765333	LA	USA	322614	USA	*	NA	1	15-Sep-08	#####	TRUE	TRUE	TRUE
T/DJ - 4 SPD AUTO TRANS NAAO CD4E	000Y9 - CHARC OAL	PNZJC - SILVER MET C/C #2	265345A	5K01	8L8Z	1007	H	WHEEL ASSY	42 - DOES NOT OPERATE PROPERLY	THERE IS A SLIGHT CLICKING NOISE HEARD FROM THE 3 REMAINING RIMS NOW THAT THE LOUDEST HAS BEEN REPLACED. PARTS RECEIVED.	2258 C.C. 42 BPN 1007 ROAD TESTED THE VEHICLE VERIFIED THE NOISE CONCERN WAS GENRATING FROM THE CHROME CLADDED WHEELS. VERIFIED THAT THE RIGHT FRONT AND BOTH REAR RIMS WERE MAKING NOISE. NECESSARY	40401	2703	*	NA	BOB THIBODEAU, INC.	586 7552100	MI	USA	148426	USA	*	NA	2	16-Sep-08	#####	TRUE	TRUE	TRUE

PF	ECBE01	ECBE01	ECBE01	REPAIR	DESIGN	MANUF	SUPP BI	CLM KE	MDL_YR	ECBE01	PLANT D	ECBE01	COMMO	VIN_CD	PRODN	WRTY_S	RPR_DT	TIS_WSD	MILGE	MTRL_C	LBR_CO	LBR_HR	TOT_CO	VRT	VFG	CCC	MKT_DE	BOD_CA	VER_SE	DRIVE_C	ENG_CD	TRANS	CLR TRI
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL DEFECTIVE			X	1096073	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WV3158	25-Jun-08	10-Jul-08	30-Jun-08	0	10	0	34.53	0.5	34.53	STU - CHASSIS	V21 - BRAKING	B65 - VIBRATION	F	17BC - DOUBLE	17CD - 350 SERIES	17E - 4 WHL L/H PART	17WX - MOD 5.4L-3V	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	VALVE STEMS NOT	X			1138945	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WV33Y	30-Jun-08		8-Jul-08	-1	8	0	24.96	0.3	24.96	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BC - DOUBLE	17CD - 350 SERIES	17E - 4 WHL L/H PART	17YH - 6.8L 3V EFI NA	17YQ - 5 SPD AUTO	000C4 - CAMEL
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	VALVE STEM			X	1344057	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1SX2037/8	26-Jun-08	14-Jul-08	10-Jul-08	0	5	4.41	30.08	0.4	34.49	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17BD - 250 SERIES	17E - 2 WHL L/H REAR	17WX - MOD 5.4L-3V	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL CHROME			X	1360850	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1SW21R5	24-Jun-08	15-Jul-08	4-Aug-08	1	1325	338.75	39.58	0.4	378.33	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BC - DOUBLE	17BD - 250 SERIES	17E - 4 WHL L/H PART	17QL - 6.4L OHV DUAL	17BE - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	TPMS - TEACH FOB	X			1382637	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WX31Y4	2-Jul-08	21-Jul-08	18-Jul-08	0	5	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17CD - 350 SERIES	17E - 4 WHL L/H PART	17YH - 6.8L 3V EFI NA	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	TPMS - TEACH FOB	X			1391284	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WX31Y6	2-Jul-08	21-Jul-08	18-Jul-08	0	5	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17CD - 350 SERIES	17E - 4 WHL L/H PART	17YH - 6.8L 3V EFI NA	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	LOG NOTS LOOSE	X			1528896	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WX3090	3-Jul-08	19-Aug-08	9-Sep-08	1	6147	45.14	0	0	45.14	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17CD - 350 SERIES	17E - 2 WHL L/H REAR	17WX - MOD 5.4L-3V	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	HUBCAP LOOSE			X	1532346	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1SX21R7	26-Jun-08	21-Aug-08	10-Sep-08	1	278	109.29	21.19	0.2	130.48	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17BD - 250 SERIES	17E - 4 WHL L/H PART	17QL - 6.4L OHV DUAL	17YQ - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					1562857	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1SW2155	12-Aug-08	23-Aug-08	16-Sep-08	1	2646	36.43	0	0	36.43	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BC - DOUBLE	17BD - 250 SERIES	17E - 4 WHL L/H PART	17QL - 6.4L OHV DUAL	17BE - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					1564578	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1SW21R0	17-Jun-08		15-Sep-08	-1	172	36.43	13.85	0.2	50.28	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BC - DOUBLE	17BD - 250 SERIES	17E - 4 WHL L/H PART	17QL - 6.4L OHV DUAL	17BE - 5 SPD AUTO	000RB - MEDIUM
F2 - Chassis	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					1565883	2008	A1	KENTUCKY	F8	F-SERIES SUPERDUT	1FT1WX31R7	19-Aug-08		10-Sep-08	-1	4	21	9.24	0.1	30.24	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	17BU - SUPER	17CD - 350 SERIES	17E - 4 WHL L/H PART	17QL - 6.4L OHV DUAL	17BE - 5 SPD AUTO	000RB - MEDIUM

PAINT C	DOC_NU	WCC_CD	PRT_NU	PRT_NU	PRT_NU	PART	COND C	CUST_TXT	TECH_TXT	CPSC_6	RPR_DL	RPR_DL	RPR_RE	RPR_RE	RPR_RE	RPR_RE	RPR_RE	RPR_CN	SLS_DLR	SLS_CNT	SLS_DLR	SLS_RE	TXN_CD	LOAD_D	ECBE01	VRT (ECB)	VFG (ECB)	CCC (ECB)	Total Claims
VERMILION	8784602	5V01	*	1K105	*	BODY ASSY - WARM HUB	42 - DOES NOT	LOW TIRE PRESSURE LIGHT ON	DISMOUNT RT REAR TIRE AND HOOK TIRE SENSOR UP TO BAND	50306	5751	*	NA	PEARCE MOTOR CO	502 6334535	KY	USA	147615	USA	*	NA	1	2-Jul-08	8-Jul-08	TRUE	FALSE	FALSE		
PNYWS - OXFORD	107909A	5K01	*	1015	*	WHEEL ASSY	17 - HOLE INCOMPLETE	LEFT REAR INNER VALVE STEM IS NOT CLOKED CORRECTLY .CAN NOT CHECK	8 VERIFIED CONCERN, REMOVED HUB CAP AND LEFT OUTE R TIRE AND	40401	4917	*	NA	GATOR FORD	813 9803673	FL	USA	124902	USA	*	NA	1	11-Jul-08	12-Jul-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	4275451	5K02	6C3Z	1700	A	VALVE & CAP ASY	01 - POROSITY	LR VALVE STEM IS LEAKING	VALVE STEM REMOVED AND REPLACED LEFT REAR VALVE STEM	40402	469	*	NA	BUNDT'S FORD, INC.	334 7925171	AL	USA	141085	USA	*	NA	2	13-Aug-08	14-Aug-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	6610203	5K01	8C3Z	1015	C	WHEEL ASSY	42 - DOES NOT	CUSTOMER STATES D'S HUB CAP KEEPS COMING OFF	VERIFIED CONCERN, FOUND CHROME CLADDING ON WHEEL, NOT FORMED TO	40401	772	*	NA	BARBER-DYSON	580 2250450	OK	USA	152241	USA	*	NA	2	15-Aug-08	16-Aug-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	446754A	5K07	8C2Z	1A203	A	TRANS ASSY - TIR PRESS	12 - IMPROPER	MISBUILT TIRE PRESSOR REMOTE	SUPPLY TIRE CALIBR WAS NOT SHIPPED FROM FACTORY	40404	7863	*	NA	DOWNTOWN FORD	916 4426931	CA	USA	172201	USA	*	NA	1	19-Aug-08	20-Aug-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	446755A	5K07	8C2Z	1A203	A	TRANS ASSY - TIR PRESS	12 - IMPROPER	MISBUILT TIRE PRESSOR REMOTE	SUPPLY TIRE CALIB CALIBRATH WAS NOT SHIPPED FROM FACTORY	40404	7863	*	NA	DOWNTOWN FORD	916 4426931	CA	USA	172201	USA	*	NA	1	20-Aug-08	21-Aug-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	501371A	5K01	2C2Z	1012	AA	WHEEL LUG NUT	42 - DOES NOT	RIGHT FRONT WHEEL LUG NUTS BACKED OFF AND DAMAGED LUG NUTS	8147 REPLACED WALLERED OUT LUG NUTS	40401	2511	*	NA	BANKSTON FORD OF	817 5353673	TX	USA	116088	USA	*	NA	2	12-Sep-08	13-Sep-08	TRUE	TRUE	TRUE		
VERMILION	018685A	5K02	5C3Z	1130	KA	HUB CAP	33 - LOOSE PART	C'S HUB CAPS DON'T STAY ON WHEELS.THEY POP OFF AS WHEELS HIT	278 INSTALLED NEW HUB CAPS	40403	9749	*	NA	FORD OF SMITHTOW	631 2652340	NY	USA	113098	USA	*	NA	2	12-Sep-08	13-Sep-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	517621C	5K02	5C3Z	1130	LA	HUB CAP	42 - DOES NOT	RIGHT FRONT HUB CAP FELL OFF, CAP IS MISSING	2646 SERVICE U REPLACED THE RIGHT FRT HUB CAP ASSY	40403	2459	*	NA	SAW PACK'S FIVE STAR	972 2426415	TX	USA	152014	USA	*	NA	2	18-Sep-08	19-Sep-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	2691401	5K02	5C3Z	1130	KA	HUB CAP	39 - MISSING	CUSTOMER STATES LEFT REAR WHEEL COVER HAS A CRACK	INSPECTED AND FOUND A CRACK IN WHEEL COVER.NO IMPACT MARK WAS VERIFIED CROME PEELING. REPLACED	40403	5109	*	NA	JENSEN HILDEN	573 4382174	MO	USA	153786	USA	*	NA	1	18-Sep-08	19-Sep-08	TRUE	TRUE	TRUE		
PNYWS - OXFORD	11364701	5K02	7C3Z	1130	B	HUB CAP	81 - TARNISHED	RIGHT FRONT HUB CAP CROME PEELING	RIGHT FRONT CENTER HUB CAP.	40403	7822	*	NA	FORD, INC.	209 8470356	CA	USA	172500	USA	*	NA	1	18-Sep-08	19-Sep-08	TRUE	TRUE	TRUE		

PF	ECBE	ECB	ECBE0	REPAI	I	S	CLM	MD	E	PLANT	E	COMMO	VIN_CD	PRODN	V	RPR_D	T	M	MTR	LB	L	TOT	VR	VFG	CCC	N	BOD_	VER	DRIVE_	ENG_C	TRANS	CLR_T	PAINT	DOC
F2 - Chassis	S10 - CHASSI S	V88 - TIRES	WHEEL/H UBCAP TROUBLE S	WHEELS - CHROME PEELING		X	1E+06	2008	AP	MICHIGA N PLANT BUILD	B3	EXPEDITIO N (NA-MTP)	1FMFU1951 8L [REDACTED]	16-Jun-08		27-Jun-08	-1	13	479.7	75.8	0.9	555.5	S10 - CHA SSIS	V88 - TIRES	WHEEL/H UBCAP TROUBLE S	F	T/WD - 4 DOOR WAGON	FORD SERI ES	T/B - 2 WHL L/H REAR DRIVE	MOD 5.4L- 3V SOHC GAS/ESSE X	T/C7 - 6 SPD AUTO TRANS (6R75)	000DW - CHARCO AL BLACK	PNUAA - EBONY SOLID C/C	196414 A



W	PR	PRT_	P	PART	COND_C	CUST_TXT	TECH_	CPS	R	R	R	RPR	RPR_P	RP	RP	SLS	SL	S	S	LOAD	ECBE	VRT (I	VFG (I	CCC (I	Claims	
5K0				WHEEL	34 - DISTORTED	CHROME CLADDING RIGHT FRONT WHEEL	HAS THE CHROME PLATING					FAMIL Y														
1	7L1Z	1007	D	ASSY	/WRINKLED /WAVY	WRINKLED NOTED AT PDI	WRINKLE	40401	192	*	NA	FORD, INC.	770 4458891	GA	USA	1E+05	USA	*	NA	1	7-Jul-08	8-Jul-08	TRUE	TRUE	TRUE	

PF	ECBE0	ECB	ECBE01	REPA	D	M	S	CLM	MD	EC	PLANT	EC	COM	VIN_CD	PRODN	WRTY	RPR_D	TI	MIL	MTRL	LBR	LBR	TOT	VRT	VFG	CCC	M	BOD	VER_SE	DRIVE	ENG_CD
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM DAMAGED		X		1194	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK52C69E	13-Jun-08		25-Jun-08	-1	15	1640.37	134.72	1.6	1775.1	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	INFLATOR KIT MISSING		X		3309	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMEK63C09E	13-Jun-08	19-Aug-08	15-Jul-08	0	10	80.82	0	0	80.82	EXTERIOR ORNAME	EXTERIOR TRIM	EXTERIOR TRIM TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	ORNAMENT FADED		X		4601	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK53C49E	30-Jun-08	11-Jul-08	17-Jul-08	1	480	18.98	17.89	0.2	36.87	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM SCRATCHED		X		5079	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK51C39E	29-Jul-08	30-Aug-08	5-Aug-08	0	10	765.51	54.25	0.7	819.76	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	DOOR GLASS RUN	X	X	X	5242	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK52C79E	30-Jul-08		7-Aug-08	-1	4	0	20.53	0.3	20.53	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM DEFECT		X		6384	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK51C59E	21-Jul-08		8-Aug-08	-1	3	765.51	34.54	0.4	800.05	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM DEFECT		X		8265	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK53C89E	24-Jun-08		23-Jul-08	-1	4	997.22	48.58	0.6	1045.8	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	OR MOLDING		X	X	9415	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK52C59E	7-Aug-08		14-Aug-08	-1	6	396	51.25	0.6	447.25	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM DAMAGED		X		9960	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK53C89E	11-Aug-08	28-Aug-08	15-Aug-08	0	5	490.39	35.46	0.4	525.85	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES					14341	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK53C99E	20-Aug-08		8-Sep-08	-1	5	500.44	62.74	0.7	563.18	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	* - [N/A]	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES					14638	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMDK51C29E	30-Jul-08		5-Aug-08	-1	4	769.46	34.81	0.4	804.27	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES					14707	2009	AS	OAKVILLE PLANT BUILD	P3	(NA-OAKVILLE)	2FMEK63C19E	26-Jun-08	7-Aug-08	11-Sep-08	2	1569	69.01	53.46	0.6	122.47	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	DOOR LIGHT TRUCK	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM DAMAGED -	X		X	1164988	2008	AS	OAKVILLE PLANT BUILD	MX	N MKX (NA-OAKVILLE)	2LMDU68C58E	20-Jun-08		10-Jul-08	-1	4	459.22	57.86	0.7	517.08	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	L	T/WD - 4 DOOR WAGON	LINCOLN/MERCURY SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM NOISE	X		X	1378770	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK49C28E	6-Aug-08		12-Aug-08	-1	4	1271.48	96.93	1.1	1368.4	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	LIGHT ON - RETRAI	X		X	1392977	2008	AS	OAKVILLE PLANT BUILD	MX	N MKX (NA-OAKVILLE)	2LMDU88C78E	28-Jul-08	9-Aug-08	19-Aug-08	1	283	0	68.83	0.7	68.83	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	L	T/WD - 4 DOOR WAGON	LINCOLN/MERCURY SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM NOISE	X		X	1395365	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK39C38E	31-Jul-08		18-Aug-08	-1	152	2542.96	113.18	1.6	2656.1	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM DEFECT		X		1399674	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK49C88E	30-Jul-08	30-Aug-08	14-Aug-08	0	3	636.65	35.8	0.3	672.45	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	WHEEL RIM NOISE	X		X	1464485	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK49C18E	1-Jul-08		9-Aug-08	-1	45	2724.6	166	1.6	2890.6	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS

F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	E VIBRATES - RE-	X	X	X	1464646	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK36C08E	19-Aug-08	2-Sep-08	28-Aug-08	0	3	0	44.56	0.5	44.56	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM NOISE - 20 INCH	X		X	1479206	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK49C68E	6-Aug-08	16-Aug-08	28-Aug-08	1	610	1907.22	132.18	1.5	2039.4	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM DAMAGED -				1485848	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK39C78E	18-Aug-08		29-Aug-08	-1	3	681.15	27.2	0.3	708.35	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	RIM DAMAGED -				1493592	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK49C68E	31-Jul-08	18-Aug-08	3-Sep-08	1	336	635.74	63.65	0.7	699.39	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/F - 4 WHL L/H FULL TIME DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	T COVER DAMAG				1495435	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK39C68E	22-Aug-08		5-Sep-08	-1	21	3.88	16.04	0.2	19.92	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	LIGHT ON - DEFECT				1520010	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK39C58E	25-Aug-08		9-Sep-08	-1	10	60.79	30.12	0.4	90.91	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES					1553812	2008	AS	OAKVILLE PLANT BUILD	Q1	(NA-OAKVILLE)	2FMDK36C38E	18-Aug-08		15-Sep-08	-1	108	0	49.78	0.6	49.78	S10 - CHASSIS	V88 - TIRES	WHEEL/HUB CAP TROUBLES	F	T/WD - 4 DOOR WAGON	T/EF - FORD SERIES	T/A - 2 WHL L/H FRONT DRIVE	4V DOHC VCT SMPI V6 GAS

TRANS	CLR_T	PAINT	DOC	WC	PR	PRT	P	PART	COND_C	CUST_TX	TECH_TX	CPS	RPR	R	RP	RPR_NA	RPR_PH	RP	RP	SLS	SLS	S	SL	T	LOAD	ECBE0	VRT (E)	VFG (E)	CCC (E)	CI
T/WJ - 6 SPD AUTO TRANS 6F	000SU - LT STONE	PN3JG - CINNAMON	196292A	5K01	8A8Z	1007	C	WHEEL ASSY	12 - IMPROPER ASSEMBLY	FRONT WHEEL AND RIGHT REAR	REPLACED BOTH RIGHT SIDE RIMS,	40401	192	*	NA	FAMILY FORD, INC.	770 4458891	GA	USA	121578	USA	*	NA	1	7-Jul-08	8-Jul-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000SU - LT STONE	EBONY SOLID C/C	196641A	5K02	8S4Z	3	A	KIT-TIR REP	39 - MISSING PART	KIT MISSING FROM FACTORY	INFLATER KIT INSTALL INFLATER	0002X X	8933	*	NA	ACTON FORD, INC.	978 8977000	MA	USA	111215	USA	*	NA	1	28-Jul-08	29-Jul-08	FALSE	FALSE	FALSE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	WHITE PLATINUM TRI-	1905302	5K02	6L2Z	1130	AA	HUB CAP	D4 - FLAW IN MATERIAL	3 CENTER CAP FADED	REMOVE LEFT AND RIGHT	40403	3523	*	NA	N FORD SALES, INC.	313 5842250	MI	USA	148017	USA	*	NA	2	5-Aug-08	6-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	EBONY SOLID C/C	579742C	5K01	8A8Z	1007	B	WHEEL ASSY	70 - CHIPPED/SC RATCHED	FRONT RIM IS KNICKED UP AROUND	VERIFIED CONCERN. REPLACED	40401	6069	*	NA	FOX FORD	616 9565511	MI	USA	148515	USA	*	NA	1	7-Aug-08	9-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000SU - LT STONE	WHITE PLATINUM TRI-	3670202	6H19	*	7E+06	*	FRONT DOOR GLASS	02 - BENT/BUCK LED/KINKED	DOOR OUTSIDE WINDOW	SITTING IN WINDOW CORRECTLY	01XXX X	4155	*	NA	REIMSCHI SEL FORD, INC.	260 8242300	IN	USA	148662	USA	*	NA	1	8-Aug-08	9-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	PN3AB - REDFIRE	172050B	5K01	8A8Z	1007	B	WHEEL ASSY	NOT OPERATE PROPERLY	WHEEL DEFECT	3 WHEEL FINISH DEFECT	40401	8325	*	NA	DAN WIEBOLD FORD	208 4664615	ID	USA	156596	USA	*	NA	1	14-Aug-08	15-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	PN3JD - WHITE SUEDE	2.4E+07	5K01	8A8Z	1007	D	WHEEL ASSY	70 - CHIPPED/SC RATCHED	WHEELS ARE DAMAGED	BOTH REAR WHEELS REPLACED	40401	262	*	NA	ERNEST MCCARTY FORD INC	205 6633831	AL	USA	121017	USA	*	NA	1	25-Aug-08	26-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000SU - LT STONE	LIGHT ICE BLUE METALLI	6.2E+07	6H21	8A8Z	7E+06	A	RUN-RR DOOR GLASS L	02 - BENT/BUCK LED/KINKED	SIDE EXTERIOR B PILLAR	MOLDING HANGING LOOSE	10702	2163	*	NA	KLABEN FORD, INC.	330 6733139	OH	USA	144083	USA	*	NA	1	28-Aug-08	29-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	WHITE PLATINUM TRI-	2.1E+07	5K01	8A8Z	1007	D	WHEEL ASSY	D4 - FLAW IN MATERIAL	FRONT WHEEL HAS A FLAW IN	D4 B65 R AND R RIM REPLACED	40401	6724	*	NA	BILL TALLEY FORD, INC.	804 2262000	VA	USA	127073	USA	*	NA	1	29-Aug-08	30-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	EBONY SOLID C/C	1.9E+07	5K07	6F2Z	1A193	K	TPMS BAND KIT	NOT OPERATE PROPERLY	WHEEL SCRATCHED DAMAGE	70(1007) VERIFIED CONCERN	40403	7944	*	NA	MULLAHEY FORD	805 4813673	CA	USA	171474	USA	*	NA	1	16-Sep-08	17-Sep-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	PN3AB - REDFIRE	280380B	5K01	8A8Z	1007	B	WHEEL ASSY	70 - CHIPPED/SC RATCHED	ER HAS SCRATCHES BY LUG NUT	PLASTIC AT TIME OF DELIVERY	40401	2686	*	NA	BRIARWO OD FORD, INC.	734 4295478	MI	USA	148435	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	EBONY SOLID C/C	215531B	5K07	7L1Z	1A189	A	TPMS SENSOR KIT	01 - BROKEN/CR ACKED	PRESSURE DEFAULT DISPLAY IS	01 VERIFY CONCERN, FOUND	0404X X	5340	*	NA	ROYAL OAK FORD	248 5484100	MI	USA	148040	USA	*	NA	2	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000GL - LIGHT CAMEL	EBONY SOLID C/C	2.5E+07	5K01	8A1Z	1007	A	WHEEL ASSY	DISTORTED/ WRINKLED/ WAVY	LEFT FRON WHEEL RIM PEELING	PEELING, REPLACE RIM	40400	11644	*	NA	LINCOLN- MERCURY, INC.	727 8496699	FL	USA	325104	USA	*	NA	1	16-Jul-08	17-Jul-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	VAPOR SILVER PEARL	6.4E+07	5K01	8T4Z	1007	A	WHEEL ASSY	68 - SEALER MISSING/SKI PPED	MAKING NOISE CUSTOMER	BOTH REAR WHEELS MAKING	40401	1431	*	NA	FORD SALES, INC.	215 6987000	PA	USA	116019	USA	*	NA	1	19-Aug-08	20-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	EBONY SOLID C/C	286507B	5K07	*	1A150	*	TRANS ASY-TIRE PRESS	NOT OPERATE PROPERLY	STATES TIRE WARNING	DIAG. CODES B2872.	40404	12334	*	NA	LINCOLN- MERCURY INC	703 8930800	VA	USA	345345	USA	*	NA	2	20-Aug-08	21-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	VAPOR SILVER PEARL	167945A	5K01	8T4Z	1007	A	WHEEL ASSY	68 - SEALER MISSING/SKI PPED	STATES THERE IS A POPPING	FOUR WHEELS, INCLUDES	40401	378	*	NA	MOTOR COMPANY, INC.	256 5741819	AL	USA	121586	USA	*	NA	1	21-Aug-08	22-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	VAPOR SILVER PEARL	082790A	5K01	8T4Z	1007	A	WHEEL ASSY	DISTORTED/ WRINKLED/ WAVY	WHEEL HUBCAP TROUBLE	FRONT WHEEL HAS A BLEMISH	40401	7818	*	NA	JAMES FORD INC	650 7264496	CA	USA	172038	USA	*	NA	1	21-Aug-08	22-Aug-08	TRUE	TRUE	TRUE	
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	VAPOR SILVER PEARL	215554A	5K01	8T4Z	1007	A	WHEEL ASSY	68 - SEALER MISSING/SKI PPED	STATES THAT THERE IS A	DRIVE VEHICLE AND	40401	1711	*	NA	FORD LIBERTYVI LLE	847 3624550	IL	USA	141082	USA	*	NA	1	2-Sep-08	3-Sep-08	TRUE	TRUE	TRUE	

T/WJ - 6 SPD AUTO TRANS 6F	000C4 - CAMEL	PN3HE - CREME BRULEE	209600B	5K01	*	1007	*	WHEEL ASSY	NOT OPERATE PROPERLY	CHECK SLIGHT SHIMMY	BALANCED 2 FRONT TIRES	40401	2222	*	NA	FORD LINCOLN MERCURY,	440 9676191	OH	USA	144433	USA	*	NA	1	2-Sep-08	3-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	PN3CG - ORANGE CRUSH	6.4E+07	5K01	8T4Z	1007	A	WHEEL ASSY	NOT OPERATE PROPERLY	NOISEY CUSTOMER STATES	BOTH FRT AND LR WHEELS	40401	1431	*	NA	FORD SALES, INC.	215 6987000	PA	USA	116019	USA	*	NA	1	4-Sep-08	9-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000C4 - CAMEL	PN3HE - CREME BRULEE	3.5E+07	5K01	8T4Z	1007	A	WHEEL ASSY	05 - POOR METAL FINISHING	WHEEL HAS CHROME MISSING ON	WHEEL, BALANCE TIRE	40401	274	*	NA	CHEROKE E FORD	770 5920090	GA	USA	121423	USA	*	NA	1	5-Sep-08	9-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000DW - CHARCOA L BLACK	VAPOR SILVER PEARL	032946A	5K01	8T4Z	1007	A	WHEEL ASSY	D4 - FLAW IN MATERIAL	FRONT RIM CHROME IS BUBBLING	RIM PER PREVIOUS DIAG.	40401	796	*	NA	TASCA FORD	401 6811300	RI	USA	111023	USA	*	NA	1	8-Sep-08	9-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000SV - MEDIUM LT STONE	WHITE CHOCOL ATE TRI-	1.8E+07	5K01	6L2Z	1012	BA	WHEEL LUG NUT	NOT OPERATE PROPERLY	FRT WHEEL HAS A LUG NUT BAD	REPLACED THE LUG NUT	40401	3423	*	NA	WOODHO SE FORD, INC.	402 4264126	NE	USA	153507	USA	*	NA	1	8-Sep-08	9-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000SV - MEDIUM LT STONE	WHITE CHOCOL ATE TRI-	2322903	5K07	7L1Z	1A189	A	TPMS SENSOR KIT	NOT OPERATE PROPERLY	CHECK TIRE PRESSURE LIGHT IS ON	NO CODES, MONITOR PIDS, RIGHT	0404X X	1013	*	NA	N FORD LINCOLN- MERCURY	910 7386281	NC	USA	121773	USA	*	NA	1	11-Sep-08	12-Sep-08	TRUE	TRUE	TRUE
T/WJ - 6 SPD AUTO TRANS 6F	000SV - MEDIUM LT STONE	VAPOR SILVER PEARL	1.4E+07	5K01	*	1007	*	WHEEL ASSY	12 - IMPROPER ASSEMBLY	FOUND BOTH R S VALVE	BOTH R S WHEELS AND	40401	1281	*	NA	FORD LINCOLN MERCURY	610 6833553	PA	USA	116510	USA	*	NA	2	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE

PF	ECBE0	ECB	ECBE	REP	D	M	S	CLM_	MD	EC	PLANT_D	EC	COMM	VIN_CD	PROD	WRTY	RPR_D	TI	MIL	MTR	LBR	LB	TOT	VRT	VFG	CCC	M	BOD_C	VER_S	DRIVE_	ENG_C
F2 - Chassis	S10 - CHASSIS	V88 - TIRES	WHEEL/ HUBCA P TROUBL ES	WHEEL HUB CAP REPLA GED		X		1155448	2008	BH	OHIO ASSEMBLY PT BUILD	E1	E-SERIES (NA)	1FMNE11L7 8D	16-Jun-08	20-Jun-08	14-Jul-08	1	2048	86.69	13.81	0.2	100.5	S10 - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB CAP TROUBLES	F	T/WA - REGULAR WAGON	T/AM - 150 SERIES	T/B - 2 WHL L/H REAR DRIVE	T/VZ - W- MOD 5.4L SOHC EFI NA V8 G- NP

TRANS	CLR	PAINT_C	DOC	WC	PRT	PRT	P	PART	COND	CUST_T	TECH_T	CPS	RPR	RPR	RPR_NA	RPR_PH	RP	RP	SLS	SL	S	SL	T	LOAD	ECBE0	VRT	VFG	CCC	T	
T/B7 - 4 SP A/T 4R75E LIVONIA	000NF - MEDIU M FLINT INTERI OR	PN3AH - DARK BLUE PEARL	617101	5K02	F8UZ	1130	AA	HUB CAP	33 - LOOSE PART	R STATES WHILE DRIVING HIGHWAY DRIVER	CONCERN INSTALLE D NEW HUB CAPS ON	40403	7494	*	NA	WHITEHALL FORD, INC.	231 8944002	MI	USA	148625	USA	*	NA	1	15-Jul-08	16-Jul-08	TRUE	TRUE	TRUE	

Function	EC BE01_V	EC BE01_V	EC BE01_CUST_CRN_C	REPAIR DIAGNOSIS	D E	M A	S U	CL M_L_Y	MD Y	EC BE01	PLANT_DESC	EC BE01	COMM ON_VL_DESC	VIN_C D	PROD N_DT	WRTY T_DT	RPR_D T	S W	MIL GE	RL_CO	LB_R_CO	LB_R_CO	TOT_T_GR	VRT	VFG	CCC	BOD_T	CAB_STL_C	VER_S_CD	DRIVE_CD	ENG_C D	TRANS_CD	CLR_T RIM_CD	
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVERS - WRONG						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V39X [REDACTED]	28-Jul-08	22-Aug-08	14-Aug-08	0	3	100.9	16.4	0.2	117.32			B65 - WHEEL/HUBCAP TROUBLES	S10 - CHASSIS	V88 - TIRES	C/FA - 4 DOOR SEDAN-4 LITE	C/AB - BASE VERSION - CAR	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000DW - CHARCOAL BLACK
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVERS - WRONG						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V49X [REDACTED]	7-Aug-08		4-Sep-08	-1	3	0	0	0	0			B65 - WHEEL/HUBCAP TROUBLES	S10 - CHASSIS	V88 - TIRES	C/FA - 4 DOOR SEDAN-4 LITE	C/AB - BASE VERSION - CAR	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000DW - CHARCOAL BLACK
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVERS - WRONG						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V69X [REDACTED]	25-Aug-08		3-Sep-08	-1	3	0	0	0	0			B65 - WHEEL/HUBCAP TROUBLES	S10 - CHASSIS	V88 - TIRES	C/FA - 4 DOOR SEDAN-4 LITE	C/AB - BASE VERSION - CAR	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000DW - CHARCOAL BLACK
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVERS - WRONG						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V89X [REDACTED]	7-Aug-08		3-Sep-08	-1	3	0	0	0	0			B65 - WHEEL/HUBCAP TROUBLES	S10 - CHASSIS	V88 - TIRES	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000DW - CHARCOAL BLACK
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVER LOOSE						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V09X [REDACTED]	28-Jul-08		13-Sep-08	-1	5	66.16	14	0.2	80.17			B65 - WHEEL/HUBCAP TROUBLES	S10 - CHASSIS	V88 - TIRES	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000SV - MEDIUM LT STONE
F2 - Chassis	S10 - CHASSIS	V88 - TIRE S	B65 - WHEEL/HUBCAP TROUBLES	WHEEL COVERS - WRONG						AW	ST. THOMAS PLANT BUILD	FB	CROWN VICTORIA (NA-STAP)	2FAHP71 V38X [REDACTED]	13-Jun-08	24-Jun-08	18-Jun-08	0	2	0	0	0	0		S07 - EXTERIOR TRIM & BUMPER FUNCTION	V75 - EXTERIOR TRIM BUMP	B66 - OTHER EXTERIOR TRIM TROUBLES	C/FA - 4 DOOR SEDAN-4 LITE	* - [N/A]	C/B - 2 WHL L/H REAR DRIVE	C/VN - R-M 4.6L SOHC EFI NA CIV8 GNP	C/B7 - 4 SP A/T 4R75E LIVONIA	000DW - CHARCOAL BLACK	



PAINT_CD	DOC_NUM	C_CD	PRI_NUM	PR_NUM	PA_RT	COND_CD	CUST_TXT	TECH_TXT	C_6_CA	R_DL	P_R	R_RE	RPR_ME	RPH	R_RST	RPCN	SLS_CD	SL_CN	S_L	S_L	S_X	LOAD_DT	1_LOA_D_Y	(ECB=AWS)	(ECB=AWS)	(ECB=AWS)	to	
PNZGC - PERFORMANCE WHITE C/C	6.3E+07	5K02	3W7Z	1130	B	HUB CAP	42 - DOES NOT OPERATE PROPERLY	NOTED AT PDI WHEEL COVERS DIFFERENT SIDE TO SIDE	40403	3795	*	NA	TED RUSSELL FORD LINCOLN MERCURY	**	TN	USA	121222	USA	*	NA	1	22-Aug-08	23-Aug-08	TRUE	TRUE	TRUE		
PNZGC - PERFORMANCE WHITE C/C	112781A	5K02	7W7Z	1130	A	HUB CAP	12 - IMPROPER ASSEMBLY	VEHICLE HAS HUB CAPS ON LEFT SIDE VEHICLE NEEDS FULL SIZE WHEEL COVERS ON LEFT SIDE TO MATCH RIGHT SIDE	40403	7993	*	NA	HARRMOTOR COMPANY, INC.	**	MA	USA	111110	USA	*	NA	1	10-Sep-08	11-Sep-08	TRUE	TRUE	TRUE		
PNUAA - EBONY SOLID C/C	112723A	5K02	7W7Z	1130	A	HUB CAP	12 - IMPROPER ASSEMBLY	VEHICLE HAS INCORRECT WHEEL COVERS ON RIGHT SIDE	40403	7993	*	NA	HARRMOTOR COMPANY, INC.	**	MA	USA	111110	USA	*	NA	1	10-Sep-08	11-Sep-08	TRUE	TRUE	TRUE		
PNZGC - PERFORMANCE WHITE C/C	112725A	5K02	7W7Z	1130	A	HUB CAP	12 - IMPROPER ASSEMBLY	INCORRECT WHEEL COVERS ON DRIVERS SIDE	40403	7993	*	NA	HARRMOTOR COMPANY, INC.	**	MA	USA	111110	USA	*	NA	1	10-Sep-08	11-Sep-08	TRUE	TRUE	TRUE		
PNKSA - DARK BLUE SOLID	1.5E+07	5K02	7W7Z	1130	A	HUB CAP	34 - DISTORTED/WRINKLED/WAVY	LEFT CENTER CAPS DO NOT FIT PROPERLY	40403	2010	*	NA	STEPHENS AUTO CENTER	304 369 241	1	WV	USA	147792	USA	*	NA	1	16-Sep-08	17-Sep-08	TRUE	TRUE	TRUE	
PNUPL - SILVER BIRCH METALLIC C/C	1.1E+07	5K02	3W7Z	1130	B	HUB CAP	42 - DOES NOT OPERATE PROPERLY	CUSTOMER STATES 2 WRONG HUB CAPS ON CAR	40403	4092	*	NA	BILL WAITS COUNTRYSIDE AUTO MALL	**	KY	USA	147069	USA	*	NA	1	23-Jul-08	24-Jul-08	FALSE	FALSE	FALSE		

Fu ncti on	E01 _VR T_C	E01 _VF G_C	E01 _CUS T_C	AIR _DIA GNO	E SI G	A N U	U P	CLM_ KEY	MDL _YR	C B E0	NT_ DES C	BE 01 _V	COMM ON_VL _DESC	VIN_CD	PRODN _DT	WRTY_ START _DT	RPR_ D T	I S	MIL GE	MTR L_C OST	LBR _CO ST	R_ HR S	_CO ST_ GRO	VR T	VF G	CCC	K T	_CAB _STL _CD	R_ SE DRIV	DRIV E_CD	ENG_ CD	TRAN S_CD	CLR_ TRIM _CD	PAIN T_CD	DOC_ NUM	WC C_C D
F2 - Cha ssis	S10 - CHAS SIS	V88 - TIRES	B65 - WHEEL L/HUB CAP TROUB LES	ROAD FORC E HIGH			X	1282137	2008	AX	TWIN CITIES PLANT BUILD	R1	RANGER (NA)	1FTYR10D 68F	24-Jun-08	4-Aug-08	29-Jul-08	0	11	270.6	173.09	2.2	443.7	S10 - CHA SSIS	V88 - TIRE S	B65 - WHEEL /HUBC AP TROUB LES	F	T/BB - SINGLE CAB (REGU LAR CAB)	T/EF FOR D SERI ES	T/B - 2 WHL L/H REAR DRIVE	T/GY - FORD/M AZDA 2.3L 4V NA I4 GAS	T/RQ - 5 SPD MAN TRANS MAZDA M5R1	000NC - MEDIU M/DAR K FLINT	PNZJC - SILVER MET C/C #2	128146A	5K01
F2 - Cha ssis	S10 - CHAS SIS	V88 - TIRES	WHEEL L/HUB CAP TROUB D	PROB LEM FOUN D	X			1348938	2008	AX	TWIN CITIES PLANT BUILD	R1	RANGER (NA)	1FTYR10D 58F	16-Jun-08	8-Aug-08	11-Aug-08	1	67	0	63.18	0.7	63.18	S10 - CHA SSIS	V88 - TIRE S	WHEEL /HUBC AP TROUB F	F	SINGLE CAB (REGU LAR CAB)	FOR D SERI ES	WHL L/H REAR DRIVE	FORD/M AZDA 2.3L 4V NA I4	SPD AT EAO A5LDE- NR/5R44/	MEDIU M PEBBL O	PN3B1 - PUEBL O GOLD	2E+07	2G88
F2 - Cha ssis	S10 - CHAS SIS	V88 - TIRES	B65 - WHEEL L/HUB CAP TROUB LES	RIM BAD ORDE R			X	1452035	2008	AX	TWIN CITIES PLANT BUILD	R1	RANGER (NA)	1FTYR10D 88F	26-Jun-08	2-Aug-08	25-Aug-08	1	1354	163.1	117.55	1.2	280.7	S10 - CHA SSIS	V88 - TIRE S	B65 - WHEEL /HUBC AP TROUB LES	F	T/BB - SINGLE CAB (REGU LAR CAB)	T/EF FOR D SERI ES	T/B - 2 WHL L/H REAR DRIVE	T/GY - FORD/M AZDA 2.3L 4V NA I4 GAS	T/RQ - 5 SPD MAN TRANS MAZDA M5R1	000NC - MEDIU M/DAR K FLINT	PNZJC - SILVER MET C/C #2	1.2E+07	5K01
F2 - Cha ssis	S10 - CHAS SIS	V88 - TIRES	B65 - WHEEL L/HUB CAP TROUB LES	SPAR E TIRE WINC H INOP			X	1495909	2008	AX	TWIN CITIES PLANT BUILD	R1	RANGER (NA)	1FTYR15E 58F	13-Aug-08	25-Aug-08	6-Sep-08	1	209	65.73	56.74	0.7	122.5	S10 - CHA SSIS	V88 - TIRE S	B65 - WHEEL /HUBC AP TROUB LES	F	T/BD - SUPER SINGLE CAB (SUPE R CAB)	T/EF FOR D SERI ES	T/E - 4 WHL L/H PART TIME DRIVE	T/NE - COLOGN E 4.0L SOHC EFI NA V6 G	T/SI - 5 SPD MAN TRANS MAZDA - R1HD	000NC - MEDIU M/DAR K FLINT	PN3AB - REDFI RE	4.7E+07	5U07
F2 - Cha ssis	S10 - CHAS SIS	V88 - TIRES	WHEEL L/HUB CAP TROUB LES	RIM BAD ORDE R			X	1522378	2008	AX	TWIN CITIES PLANT BUILD	R1	RANGER (NA)	1FTYR11E 78F	8-Aug-08	25-Aug-08	4-Sep-08	1	655	266.9	51.89	0.7	318.8	S10 - CHA SSIS	V88 - TIRE S	WHEEL /HUBC AP TROUB LES	F	SINGLE CAB (REGU LAR CAB)	T/EF FOR D SERI ES	WHL L/H PART TIME DRIVE	COLOGN E 4.0L SOHC EFI NA V6 G	SPD AT EAO A5LDE- NR/5R44/ 55E	000NC - MEDIU M/DAR K FLINT	PNUAA - EBONY SOLID C/C	3884501	5K01

T_N UM CA	NUM CA USL	RT N U	RT DE SC	CON D_C D	CUST_TXT	TECH_TXT	C_6 CAU SL	RPR DLR CD	P R	P R	RPR NAM E	RPR PH_N UM	P R	R CN TR	SLS DLR CD	S CN TR	S DL R	L S R	X N	LOAD DT	ECBE0 1_LOA D_Y	(ECB =AWS )	VFG (ECB= AWS)	CCC (ECB= AWS)	ot al Cl
1L5Z	1015	EA	WHEEL ASSY	13 - OUT OF ROUND	C S AT 65 VIBRATION IN VEHICLE ADVISE	11 TEST DRIVE TO VERIFY CONCERN ROADFORCE BALANCE 4 TIRES LR 14LB RR 20LB RF 28LB NECESSARY TO FORCE MATCH BALANCE RF TIRE TO LOWER ROADFORCE ROADFORCE LOWERED TO 23 LB LF TIRE HAD 45 LB OF ROADFORCE AND RIM WAS OUT OF ROUND RIM RUNOUT WAS	40401	6529	*	NA	TREAD WELL FORD	251 4783351	AL	USA	123003	USA	*	NA	1	1-Aug-08	2-Aug-08	TRUE	TRUE	TRUE	
*	NPF	*	PROBLE M FOU	FREIGHT/PO STAG E/MAI	FREEWAY RIGHT REAR TIRE WAS WOBLING	1 TIRE FLASHING WAS NOT REMOVED WHEN TIRE MADE. APPEARS AS TIRE WOBBLE, BUT TIRE IS STRAIGHT. REMOVED FLASHING.	615	9149	*	NA	FORD OF NATION AL	619 4772711	CA	USA	171082	USA	*	NA	1	13-Aug-08	14-Aug-08	TRUE	TRUE	TRUE	
1L5Z	1015	EA	WHEEL ASSY	13 - OUT OF ROUND	STATES THERE IS A VIBRATION AT 60 TO 65 MPH IN THE FRONT SUSPENSION	VERIFY COMPLAINT CHECKED ROADFORCE AND BALANCE BOTH WHEELS AND TIRES OK NOTICED RF WHEEL OUT OF ROUND MADE SURE CONED PROPERLY IT WAS, NEEDS RIM REPLACED ORDERED PART REPLACED RIM AND STRAP RELEARNED	40401	2645	*	NA	PRICE- GNADE FORD MERCURY, INC.	636 3569000	M O	USA	153341	USA	*	NA	1	29-Aug-08	30-Aug-08	TRUE	TRUE	TRUE	
7L5Z	1A480	A	LIFT ASY SPARE WHEEL	42 - DOES NOT OPERATE PROP	SPARE TIRE WINCH INOP WONT LIFT TIRE UP INSTALL SOP	REPLACED SPARE TIRE WINCH AND REINSTALL SPARE TIRE	20501	4227	*	NA	GERMA IN FORD	614 8897777	OH	USA	147146	USA	*	NA	1	8-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
YL5Z	1015	BA	WHEEL ASSY	POOR META L FINISHING	VIBRATION AT 60 MPH. CK/ADV	FROM REAR FOUND WHEEL BENT NO DAMAGE TO WHEEL REPLACED WHEEL AND MOUNTED SENSOR TO NEW WHEEL WITH NEW STRAP AND BALANCED TEST DROVE RETEST OK	40401	5076	*	NA	JOHN NORTH FORD, INC.	620 3431700	KS	USA	153655	USA	*	NA	2	11-Sep-08	12-Sep-08	TRUE	TRUE	TRUE	

PF	ECBE0	ECBE0	ECBE01_	REPAIR	D	M	S	CLM	MD	EC	PLAN	EC	COMMO	VIN_CD	PRODN	WRTY_	RPR_D	TI	MIL	MTR	LBR	LB	TOT_	VRT	VFG	CCC	N	BOD_	VER_	DRIVE_		
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL COVER			X	6114	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP34N 69	22-Jul-08		8-Aug-08	-1	10	24.19	14.92	0.2	39.11	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	TPMS - SENSOR			X	10298	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 79	21-Jul-08	14-Aug-08	21-Aug-08	1	5	85.24	42.6	0.6	127.84	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					10761	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP36N 69	22-Jul-08	21-Aug-08	25-Aug-08	1	370	0	33.51	0.4	33.51	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					11109	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 99	14-Aug-08		26-Aug-08	-1	1	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	C/GE - SE	C/A - 2	WHL L/H	
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					11268	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP36N X9	23-Jul-08		29-Aug-08	-1	56	0	106.2	1.1	106.19	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					11556	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP34N X9	12-Aug-08		22-Aug-08	-1	8	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					13747	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N X9	24-Jul-08	19-Aug-08	11-Sep-08	1	419	243.9	44.26	0.5	288.14	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					14792	2009	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP34N 09	12-Aug-08		12-Sep-08	-1	3	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	LOG NOT LOOSE /		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 78	12-Jun-08		18-Jun-08	-1	3	8.01	15.93	0.2	23.94	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL SCRATCHE		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 48	18-Jun-08	22-Jul-08	26-Jun-08	0	3	245.4	48.66	0.6	294.1	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL COVERS		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP32N 88	23-Jun-08	2-Aug-08	5-Jul-08	0	2	0	0	0	0	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/BJ - 2	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	VALVE STEM		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 48	26-Jun-08	7-Aug-08	14-Jul-08	0	22	1.67	11.8	0.2	13.47	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	RIMS DAMAGED		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 08	17-Jun-08	19-Jul-08	7-Jul-08	0	4	798.3	119.2	1.4	917.57	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEELS DAMAGED			X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 88	30-Jun-08	10-Jul-08	7-Jul-08	0	5	266.1	98.31	1.1	364.42	S05 - SQUEAK &	V39 - SQUEAKS &	N39 - OTHER	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL LUG NUTS		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 18	26-Jun-08	6-Aug-08	11-Jul-08	0	5	0	136.4	1.2	136.44	S05 - SQUEAK &	V39 - SQUEAKS &	N50 - SQUEAK/RA	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL CENTER		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 48	12-Jun-08	28-Jul-08	17-Jul-08	0	5	0	0	0	0	STU - SHEET	V31 - SHEET METAL	B02 - BODY PANEL FITS	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL LOOSE		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 08	23-Jun-08	26-Aug-08	9-Aug-08	0	91	0	55.42	0.6	55.42	S05 - SQUEAK &	V39 - SQUEAKS &	N39 - OTHER	F	C/FC - 4	C/KE - SEL	C/A - 2	WHL L/H	
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL COVER		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP34N 18	25-Jun-08	21-Jul-08	4-Aug-08	1	485	4.2	0	0	4.2	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL LUG NUTS		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 48	17-Jun-08	24-Jul-08	12-Aug-08	1	596	0	139.4	1.8	139.38	STU - CHASSIS	V87 - STEERING	N38 - STEERING	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL STUD		X	X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP33N 08	26-Jun-08	12-Jul-08	23-Aug-08	2	3662	16.21	46.35	0.5	62.56	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/BJ - 2	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	WHEEL STUD		X		1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 58	18-Jun-08	7-Jul-08	8-Aug-08	2	3435	257.3	56.54	0.8	313.88	ST13 - RIDE &	V89 - RIDE & HANDLING	N22 - VEHICLE	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	TPMS - SENSOR			X	1E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP33N 98	25-Jun-08	26-Jul-08	25-Aug-08	2	520	47.78	61.44	0.6	109.22	S09 - ELECTRICAL	V17 - ELECTRICAL	A40 - TIRE PRESSURE	F	C/BJ - 2	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB					2E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 38	30-Jun-08	28-Jul-08	9-Sep-08	2	3754	4.65	14	0.2	18.65	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H
F2 - Cha	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	TIRE DEFECTIVE			X	2E+06	2008	AZ	WAYNE PLANT	AU	FOCUS (LESS SVT)	1FAHP35N 98	27-Jun-08	29-Aug-08	9-Sep-08	1	289	0	29.9	0.3	29.9	STU - CHASSIS	V88 - TIRES	B65 - WHEEL/HUB	F	C/FC - 4	DOOR	* - [N/A]	C/A - 2	WHL L/H

ENG_C	TRANS	CLR_T	PAINT	DOC_N	WC	PRT	PRT	P	PART	COND_C	CUST_TX	TECH_TX	CPSC	RP	R	R	RPR_NA	RPR_P	RP	RP	SLS	SL	S	SL	T	LOAD	ECBE0	VRT (E)	VFG (E)	CCC (E)	CI
C/H4 - 2.0L 91	C/RP - 5 SPD MAN	000HB - MEDIUM	FN3JK - SANGRIA	22399201	5K02	6S4Z	1130	B	HUB CAP	42 - DOES NOT	TECHNICIAN NOTICED	REPLACED RIGHT REAR	40403	7496	*	NA	STUCKEY FORD	614 6959862	PA	USA	144451	USA	*	NA	1	13-Aug-08	14-Aug-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3JK - SANGRIA	044366A	5K07	7L1Z	1A189	A	TPIMS SENSOR KIT	33 - LOOSE PART	TIRE LIGHT ON ON	FOUND REAR SENSOR	0404XX	####	*	NA	AVIS RAC - RENO	**	NV	USA	171228	USA	*	NA	2	1-Sep-08	2-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN0AA - EBONY	149238A	5K01	*	1007	*	WHEEL ASSY	01 - POROSITY	OK LEFT REAR TIRE,	RESEAL LEFT REAR	40401	2841	*	NA	BROOKLYN FORD	317 5922112	MI	USA	148559	USA	*	NA	1	3-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3JK - SANGRIA	87737201	5K02	9S4Z	1130	A	HUB CAP	39 - MISSING	WHEEL COVERS	REPLACE WHEEL	40403	2918	*	NA	EWALD'S HARTFORD	262 6735180	WI	USA	141380	USA	*	NA	1	4-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN0AA - EBONY	40024701	5K01	*	1007	*	WHEEL ASSY	08 - FAILED GASKET/SE	G29 OTHER WARNING	PERF BCE TEST B2872	40401	9575	*	NA	ANDERSON S ROCK	615 2290510	IL	USA	141411	USA	*	NA	2	4-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN0AA - EBONY	20958501	5K02	6S4Z	1130	B	HUB CAP	39 - MISSING	WHEEL COVERS	REPLACED MISSING	40403	9366	*	NA	ANDERSON FORD, INC.	715 6844520	WI	USA	158424	USA	*	NA	1	5-Sep-08	9-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3KD - STERLING	332646A	5K01	8S4Z	1007	E	WHEEL ASSY	33 - LOOSE PART	CUSTOMER REPORTS	REPLACED WHEEL	40401	3812	*	NA	GORDIE BOUCHER	262 2559010	WI	USA	141323	USA	*	NA	2	15-Sep-08	16-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN2AQ - LIGHT ICE	272608B	5K02	6S4Z	1130	B	HUB CAP	24 - LOOSE FASTENER	REPLACE MISSING	INSTALL MISSING	40403	8564	*	NA	COURTESY FORD INC	360 6972700	WA	USA	174538	USA	*	NA	1	17-Sep-08	18-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3EG - VERMILIO	17294402	5K01	8S4Z	1012	B	WHEEL NUT	02 - STRIPPED,		REPLACED LF LUG NUT	40401	8153	*	NA	MIKE MURPHY	309 2632311	IL	USA	141346	USA	*	NA	1	20-Jun-08	8-Jul-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/RP - 5 SPD MAN	000HB - MEDIUM	FN2AQ - LIGHT ICE	2206802	5K01	*	1007	*	WHEEL ASSY	70 - CHIPPED/SC	RIGHT REAR WHEEL HAS	RIGHT REAR WHEEL HAS	40401	5334	*	NA	LAIRD NOLLER	785 2359211	KS	USA	153026	USA	*	NA	1	2-Jul-08	8-Jul-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3EG - VERMILIO	110080C	5K02	6S4Z	1130	B	HUB CAP	12 - IMPROPER	HUB CAPS MISSING	VERIFIED HUB CAPS	40403	4183	*	NA	LITHIA FORD	309 7352511	WA	USA	174440	USA	*	NA	1	10-Jul-08	11-Jul-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3EG - VERMILIO	14342003	5K02	F42Z	1700	A	VALVE & CAP ASY	34 - DISTORTED/	CUSTOMER STATES	VERIFY CONCERN	NANANA	7517	*	NA	JOE TAYLOR	614 6769295	PA	USA	144120	USA	*	NA	1	16-Jul-08	17-Jul-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN2AQ - LIGHT ICE	174626C	5K01	8S4Z	1007	E	WHEEL ASSY	06 - DENTS/DING	REPLACE THREE	REPLACE 3 WHEEL	40401	9757	*	NA	LUTHER FAMILY	701 2822350	ND	USA	158600	USA	*	NA	1	18-Jul-08	19-Jul-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN0AA - EBONY	13457502	5K01	*	16102	*	SHLD,P/FDR SPLASH R	07 - IMPROPERL	RIGHT REAR WHEEL HAS	1007 C012 DEFORMED	10204	5126	*	NA	GARY CROSSLEY	616 7814844	MO	USA	153014	USA	*	NA	1	24-Jul-08	25-Jul-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3EG - VERMILIO	2694261	5K01	*	1007	*	WHEEL ASSY	42 - DOES NOT	CHECK CLUNKING	ROAD TEST, VERIFY	40401	7894	*	NA	HANSEL FORD	707 5437300	CA	USA	172205	USA	*	NA	1	30-Jul-08	31-Jul-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3JF - SILVER	027120A	5K02	97BZ	1130	AA	HUB CAP	38 - WRONG PART	INSTALL CENTER	5 PARTS ONLY CLAIM	40403	####	*	NA	JOHNSON FORD LINC-	413 4436432	MA	USA	111890	USA	*	NA	1	6-Aug-08	9-Aug-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN2AQ - LIGHT ICE	65001802	5K01	*	1007	*	WHEEL ASSY	33 - LOOSE PART	FRONT END DEPARTME	ROAD TEST VERIFY	40401	5513	*	NA	CITRUS MOTORS	909 3900930	CA	USA	171430	USA	*	NA	2	12-Aug-08	13-Aug-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3JE - VAPOR	17215502	5K02	6S4Z	1K011	A	CAP-WHL NUT	12 - IMPROPER	CUSTOMER STATES	INSTALLED	40403	4638	*	NA	PAUL HARVEY	317 2988814	IN	USA	147028	USA	*	NA	1	15-Aug-08	16-Aug-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3EG - VERMILIO	1163401	5A03	*	1225	*	BEARING ASY REAR	33 - LOOSE PART	CUSTOMER STATES	HEARD WHEN	50200	1311	*	NA	KELLER BROS.	717 6262000	PA	USA	116509	USA	*	NA	2	18-Aug-08	19-Aug-08	TRUE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3JF - SILVER	201474A	5V01	YS4Z	1107	AA	HUB BOLT	01 - BROKEN/CR	LEFT REAR WHEEL	REPLACED ONE LEFT	60201	5574	*	NA	PALM SPRINGS	760 3282102	CA	USA	171430	USA	*	NA	1	27-Aug-08	28-Aug-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3JE - VAPOR	3500801	5V01	F5RZ	1107	A	HUB BOLT	01 - BROKEN/CR	VECHILE MAKES A	CSL 1107 LUG STUDS	NANANA	8767	*	NA	RIVERSIDE AUTOPLEX	918 6472228	OK	USA	123562	USA	*	NA	2	27-Aug-08	28-Aug-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000HB - MEDIUM	FN3FE - VISTA	10635701	5K07	6F2Z	1A193	B	TPIMS BAND KIT	42 - DOES NOT	C S TIRE PRESSURE	DIAGNOSED . TESTED	0404XX	3745	*	NA	PARK AVENUE	201 5689205	NJ	USA	113147	USA	*	NA	2	29-Aug-08	30-Aug-08	FALSE	FALSE	FALSE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3FE - VISTA	24595602	5K01	8S4Z	1012	B	WHEEL NUT	07 - IMPROPERL	NEEDS LG NUT ON RT	LOG NOT GONE	40401	3337	*	NA	FORD OF CHAMPAIGN	217 3568366	IL	USA	141208	USA	*	NA	2	9-Sep-08	10-Sep-08	TRUE	TRUE	TRUE	
C/H4 - 2.0L 91	C/D2 - 4 SPD	000DW - CHARCO	FN3JE - VAPOR	4013051	2G8 8	*	NPF	*	NO PROBLEM	82 - FREIGHT/PO	LEFT REAR TIRE AIR	PALIED SEAL	615	3356	*	NA	WEBB FORD	630 5984700	IL	USA	141060	USA	*	NA	2	12-Sep-08	13-Sep-08	TRUE	TRUE	TRUE	

---

**From:** McClenaghan, Dean (D.C.)  
**Sent:** Friday, June 06, 2008 10:21 AM  
**To:** Rohweder, David (D.S.)  
**Subject:** FW: Tire Valve Stem Failures

**Importance:** High

**Attachments:** DSCN0206.JPG; DSCN0207.JPG



DSCN0206.JPG



DSCN0207.JPG

Dave we are not looking into this but just happen this came to me today from a early warning fleet I have

Life is not measured by the number of breaths we take, but by the moments that take our breath away.

Critical Concerns/Safety  
Truck Vehicle Center  
20901 Oakwood Boulevard  
Dearborn, Michigan 48121  
313 805 3721 cell

-----Original Message-----

From: Cain, Calvin Eugene, Jr. [mailto:CECAIN@southernco.com]  
Sent: Friday, June 06, 2008 10:08 AM  
To: Smith, Kevin (K.P.)  
Cc: McClenaghan, Dean (D.C.); Carden, G; Thompson, James; Hopkins, Steve; Bates, James  
Subject: Tire Valve Stem Failures  
Importance: High

KP, I have had some reports for tire valve stem failure on 07 & 08 F150'S . Two trucks in particular 1FTRX14W77NA57042, and 1FTRX14W48FB87663 are both 4x4 trucks that are used off road at times but not on a regular basis. The first truck has had the valve stems broke off 3 times and the other truck has had them broke off 2 times. Attached is two pictures of a tire & wheel from a 08 F150 4x2 chassis, the valve stem sticks out to far and it will get broke off. Why is Ford putting these long rubber stems in the wheel? Also, just I have noticed that the F250's and F350's have a short metal valve stem that secures with a nut that is protected by the wheel so that this should not happen.

Thanks,  
Calvin Cain  
Fleet Maintenance Supervisor (GPC)  
8-608-5927  
Office: (404) 608-5927  
Cell: (678) 431-3661  
Radio # 20610

<<DSCN0206.JPG>> <<DSCN0207.JPG>>







---

**From:** Arning, Ralph (R.)  
**Sent:** Wednesday, August 06, 2008 8:24 AM  
**To:** Jones, Rick (W.P.)  
**Subject:** FW: TAR OPEN AT Matthews-Currie Ford Company USA 03591 Phone : (941) 488-6787 FOR , ON 2007 MUSTANG VIN : 1ZVFT84N175305653 GCQIS : 8HEAM047

Hi Rick, Here's a report on valve stems. Dealer is holding part for the FSE.

By the way, how was Mid Ohio?

Regards,

**Ralph Arning**

Ford Customer Service Div.  
Mustang PVT/Launch Team  
Phone: 734-782-7914  
Cell Phone: 734-752-9639  
e-mail: RARNING@Ford.com

---

**From:** Echtime, T (T.)  
**Sent:** Wednesday, August 06, 2008 7:51 AM  
**To:** Arning, Ralph (R.); Querio, Jennifer (J.)  
**Subject:** FW: TAR OPEN AT Matthews-Currie Ford Company USA 03591 Phone : (941) 488-6787 FOR , ON 2007 MUSTANG VIN : 1ZVFT84N175 [REDACTED] GCQIS : 8HEAM047

---

**From:** System on behalf of [mailto:CQIS@ford.com]  
**Sent:** Tuesday, August 05, 2008 10:58 AM  
**To:** Kuffel, Adam (A.B.); Morrison, Bill (B.E.); Hall, Christopher (C.); Hanson, Chris (C.); Conroy, David (D.J.); Carey, John (J.P.); Gibula, Jeff (J.P.); McCall, Kris (K.J.); McClung, Shannon (S.T.); Echtime, T (T.)  
**Cc:** Carey, John (J.P.)  
**Subject:** TAR OPEN AT Matthews-Currie Ford Company USA 03591 Phone : (941) 488-6787 FOR , ON 2007 MUSTANG VIN : 1ZVFT84N175 [REDACTED] GCQIS : 8HEAM047

A request for technical assistance has been OPENED for :

, FS  
USA 03591 Name : Matthews-Currie Ford Company

By : FCSD REGION FSEIR

Unit Down :

With a concern on :  
2007 MUSTANG

11/4/2008

PE08-060 1140

VIN :1ZVFT84N175305653

It is filed under GCQIS report number : 8HEAM047

Following TECH ASSIST REFERRAL procedure, the dealership has been notified that someone from the Region will contact them in the near future. This letter is notification of the referral. The report will be in GCQIS for your review.

[https://www.gcqis.dealerconnection.com/gcqis/asp/WBRES\\_RptSummaryUpdMain.asp?rptnbr=8HEAM047](https://www.gcqis.dealerconnection.com/gcqis/asp/WBRES_RptSummaryUpdMain.asp?rptnbr=8HEAM047)

THANK YOU , FROM THE FCSD REGION FSEIR

**Attachments :**

<b>Report# :</b>	8HEAM047 FCSDFS	<b>Received:</b>	08/05/2008
<b>CCRG/EPRC:</b>		<b>Reviewed Status:</b>	<b>Date:</b>
<b>Vehicle:</b>	2007,MUSTANG,1ZVFT84N175	<b>Build Date:</b>	02/09/2007
<b>Odometer :</b>	10,301 M	<b>Engine:</b>	4.0L SOHC <b>Calibration:</b> 7ZF1B60A
<b>Engine Serial Number:</b>	077368533884		
<b>Transmission:</b>	5R55S	<b>Axle:</b>	<b>A/C:</b> YES
<b>Transmission Serial Number:</b>	030107298695		
<b>Dealer:</b>	USA 03591 Matthews-Currie Ford Company	<b>Phone#:</b>	(941) 488-6787
<b>City:</b>	Nokomis	<b>State:</b>	Florida <b>Country :</b> USA
<b>Originator:</b>			
<b>Symptom:</b>	306299 CHASS.,TIRES/WHEELS,AIR LOSS,NOT LISTED		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	VALVE STEM CRACK		
<b>Fix:</b>	<b>Causal Component :</b>		
<b>Condition Code:</b>			
<b>Region Code:</b>	S3	<b>Region Name:</b>	Orlando

**OWNER 08/05/2008 10:58AM JOHN CAREY(FSE) MSS - FCSD - REG - ORLANDO**  
CUSTOMER HAD EMERGENCY REPAIR AT OUTSIDE SERVICE FACILITY.  
INSPECTION  
THERE REVEALED THAT ONE TIRE HAD BEEN DAMAGE BY OPERATING UNDER  
LOW  
INFLATION AND ALL FOUR VALVE STEMS WERE CRACKED ON THE OUTSIDE OF  
EACH  
RIM WHERE THE STEM PROTRUDES THROUGH THE RIM. DEALERSHIP  
REPLACED ALL  
FOUR VALVE STEMS AND ONE TIRE UNDER WARRANT FOR CUSTOMER. 3 OF 4  
VALVE  
STEMS ARE MARKED WITH " TR414 " . DEALERSHIP HAS PARTS (VALVE STEMS)  
FOR FSE.

This email was generated by the server FCWS413

---

**From:** Querio, Jennifer (J.)  
**Sent:** Wednesday, April 02, 2008 9:52 AM  
**To:** Kircheis, Bryce (A.)  
**Subject:** FW: S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

Hi Bryce,  
Can we get the valve stems back from report #8C1AC013...

THANKS!!! :o)

Sincerely,

Jennifer Querio  
Mustang PVT - FCSD Product Concern Engineer  
(313) 323-2381  
jquerio@ford.com

---

**From:** Lin, Jeff (J.H.)  
**Sent:** Tuesday, April 01, 2008 8:35 AM  
**To:** 'JQUERIO'  
**Subject:** RE: S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

Jennifer,

Could you get 4 valve stems back from first item - 1ZVFT82H875 [REDACTED]? Thanks.

*Jeff Lin*  
Mustang Chassis PVT  
734-783-8288, cell: 313-805-2527  
jlin6@ford.com

---

**From:** JQUERIO [mailto:JQUERIO]  
**Sent:** Tuesday, April 01, 2008 5:09 AM  
**To:** JLIN6  
**Subject:** S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

This email contains 15 report summary(s).

**Attachments :** 24

<b>Report# :</b>	8C1AC013 NHLDIG--or-- HD 200800165026	<b>Received:</b>	03/28/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,GT ,COUPE ,1ZVFT82H875 [REDACTED]	<b>Build Date:</b>	04/13/2007
<b>Odometer :</b>	10,348 M	<b>Calibration:</b>	7ZF2G80A
<b>Transmission:</b>	T3650 MAN	<b>A/C:</b>	YES
<b>Dealer:</b>	USA 04843 Maroone Ford of Fort Lauderdale	<b>Phone#:</b>	(954) 564-3221 PE08-060 1142

11/13/2008

**City:** Fort Lauderdale **State:** Florida **Country :** USA  
**Originator:** brian stahl  
**Symptom:** 3 06 2 01 CHASS.,TIRES/WHEELS,AIR LOSS,SLOW LEAK  
**Status:**  
**VFG:** V88 TIRES  
**Additional Symptom:** Processed  
**Fix:** **Causal Component :** --  
**Condition Code:**  
**Region Code:** S4 **Region Name:** Miami

**DTCs:**  
**KOEO:**  
**KOEC:**  
**KOER:**

**Comments :**

**CONCER** 03/27/2008 08:46AM  
All four wheels, valve stems are dry rotting and cracked resultine in air loss from tire. Passenger side rear tire suddenly lost pressure while customer was on highway, resulting in destruction of tire. Remedy is replacement of all four valve stems, replacement of passenger side rear tire.

**RECOMM** 03/27/2008 08:46AM  
Tires are not yet on the DI program. Thx Loretta 3-27-08

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8C1AC013](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8C1AC013)

---

**Attachments : 0**

**Report# :** 8C5AD256 NHL **Received:** 03/31/2008  
**CCRG/EPRC:** **Reviewed Status:** **Date:**  
**Vehicle:** 2007,MUSTANG,GT ,COUPE ,1ZVFT82H075 **Build Date:** 07/26/2006  
**Odometer :** 8,654 M **Engine:** MOD 4.6L **Calibration:** 7ZF1G80A  
**Transmission:** 5R55S **Axle:** **A/C:** YES  
**Dealer:** USA 07496 Stuckey Ford **Phone#:** (814) 695-9862  
**City:** Hollidaysburg **State:** Pennsylvania **Country :** USA  
**Originator:** JEFFREY WILT  
**Symptom:** 3 06 A 99 CHASS.,TIRES/WHEELS,INDICATOR,NOT LISTED  
**Status:**  
**VFG:** V88 TIRES

**Additional**  
11/13/2008

PE08-060 1143

**Symptom:** B2872 WITH ALL SENSORS TRAINED

**Fix:** **Causal Component :** --

**Condition Code:**

**Hotliner:** MCIOT **Phone:** 000 317-9127 **Regn Cd:** G4 Pittsburgh

**Engineering:** BRAD KUMMLER **Phone:** 000 000-0000 **TAR:**

**Dlr Contact:** JEFFREY WILT **Phone:** 814 695-9862 **Title Cde:** T

**DTCs:**

KOEO:B2872

KOEC:

KOER:

**Comments :**

**REPAIR** 03/31/2008 03:34PM MATTHEW CIOT MSS - FCSD - TECH SVC HOTLINE  
WEB FORM DATA: DESCRIPTION OF VEHICLE CONCERN: TPMS  
FAULT DIAGNOSTICS ALREADY COMPLETED: SELF TEST SYSTEM AND TRAIN  
WHEELS PARTS REPLACED: NONE TECHNICIAN QUESTION: IS THE SPARE TIRE  
MONITORED BY THE TPMS SYSTEM? FORM QUESTION: WERE YOU ABLE TO VERIFY  
THE CONCERN? ANSWER: YES FORM QUESTION: IS THERE AN APPROPRIATE  
PINPOINT TEST IN THE WSM FOR THIS CONCERN? ANSWER: YES FORM QUESTION:  
WAS THE PINPOINT TEST FOLLOWED? ANSWER: YES CALL DATA: AFTER  
PROGRAMMING THE CODE AND ERROR MESSAGE ARE STILL PRESENT. THE PIDS  
CHANGE WITH PRESSURE CHANGES.

**RECOMM** 03/31/2008 03:34PM MATTHEW CIOT MSS - FCSD - TECH SVC HOTLINE  
\*WHILE ON THE PHONE PROGRAMMED THE TPMS SENSORS AGAIN AND BEFORE  
CYCLING THE KEY PERFORMED A CLEAR ALL CMDTC'S AND THE CONCERN WAS  
STILL PRESENT. \*TAKE THE VEHICLE OUTSIDE AWAY FROM OTHER VEHICLES,  
ENSURE ALL SENSORS ARE ACTIVATED THEN PERFORM THE PROGRAMMING  
AGAIN. \*IF THE CONCERN IS STILL PRESENT REPLACE THE SJB. ISM  
07-12-012 TPMS INDICATOR ILLUMINATED WITH DTC C2780

---

**Attachments :** 0

<b>Report# :</b>	8C2AJ029 NHL	<b>Received:</b>	03/28/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,GT ,COUPE ,1ZVFT82H775 [REDACTED]	<b>Build Date:</b>	12/05/2006
<b>Odometer :</b>	44 M	<b>Engine:</b>	MOD 4.6L
<b>Transmission:</b>	T3650 MAN	<b>Calibration:</b>	7ZF2U80A
<b>Dealer:</b>	CAN B6050 Advantage Ford Sales Ltd	<b>A/C:</b>	YES
<b>City:</b>	Calgary	<b>Phone#:</b>	(403) 225-3600
<b>Originator:</b>	JEFF HANTOS	<b>Province:</b>	Alberta
<b>Symptom:</b>	3 06 A 14 CHASS.,TIRES/WHEELS,INDICATOR,LOW PRESSURE		
		<b>Country :</b>	CAN

**Status:**

**VFG:** V88 TIRES

**Additional Symptom:** NEEDS TEAR TAG NUMBER,SALEEN

**Fix:** **Causal Component :** --

**Condition Code:**

**Hotliner:** GJACKS12      **Phone:** 000 317-4492      **Regn Cd:** 06 06 FCSD REGION-CANADA

**Engineering:**      **Phone:**      **TAR:**

**Dlr Contact:** JEFF HANTOS      **Phone:** 000 000-0000      **Title Cde:** SM

**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**REPAIR** 03/28/2008 10:04AM GREGORY JACKSON MSS - FCSD - TECH SVC HOTLINE  
WEB FORM DATA: DESCRIPTION OF VEHICLE CONCERN: TIRE SENSORS GO OFF AFTER VEHICLE IS SHUT OFF AND RESTARTED DIAGNOSTICS ALREADY COMPLETED: CHECKED SMART JUNCTION. PARTS REPLACED: NONE TECHNICIAN QUESTION: WE NEED THE 4 DIGIT CODE TO RELOAD FORM QUESTION: CAN THIS CONCERN BE VERIFIED? ANSWER: YES FORM QUESTION: IS THERE AN APPROPRIATE PINPOINT TEST IN THE WSM FOR THIS CONCERN? ANSWER: YES FORM QUESTION: WAS THE PINPOINT TEST FOLLOWED? ANSWER: YES CALL DATA: \*LOW TIRE PRESSURE SENSOR LIGHT COMES ON. \*LOOKING TO GO INTO THE SJB BUT CANNOT COMMUNICATE WITH THE VEHICLE BECAUSE IT IS A SALEEN. \*CANNOT FIND THE TEAR TAG ON THE PCM.

**RECOMM** 03/28/2008 10:04AM GREGORY JACKSON MSS - FCSD - TECH SVC HOTLINE  
\*JEFF, ACCORDING TO THIS VIN, THE ORIGINAL TEAR TAG NUMBER WAS CUY2. \*MAKE SURE THE VEHICLE IS IDENTIFIED WITH THE KEY IN THE OFF POSITION TO PREVENT ANY PCM REPROGRAMMING.

**Attachments : 0**

<b>Report# :</b>	8C2AJ125 RTDAHL	<b>Received:</b>	03/28/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2008,MUSTANG,GT ,COUPE ,1ZVHT82HX85 [REDACTED]	<b>Build Date:</b>	11/12/2007
<b>Odometer :</b>	456 M	<b>Calibration:</b>	8ZF1G80A
<b>Transmission:</b>	5R55S	<b>A/C:</b>	YES
<b>Dealer:</b>	USA 04572 Russell & Smith Ford, Inc.	<b>Phone#:</b>	(713) 663-4205
<b>City:</b>	Houston	<b>State:</b>	Texas
<b>Originator:</b>	FRANK ESPINALES	<b>Country :</b>	USA

**Symptom:** 3 01 A 00 CHASS.,SERVICE BRAKE ,INDICATOR,OTHER-CODE NA  
**Status:**  
**VFG:** V21 BRAKING  
**Additional Symptom:** P078R N/COM  
**Fix:** **Causal Component :** MODULE-BRK ANTI/LK -- RPL  
**Condition Code:**

**Region Code:** C2

**Region Name:** Houston

**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**REPAIR** 03/28/2008 02:27PM ERIC ESTES MSS - TSO - KELSEY-HAYES RTDA  
TECH STATES INTERMITTENT NO COMMUNICATION USING THE IDS, HAS ABS,RED,  
& TC LAMPS ON THAT WILL NOT CLEAR UNTIL YOU UNPLUG THE ECU THEN PLUG  
IT IN AND IT WORKS GOOD UNTIL YOU CYCLE THE KEY THEN THE LAMPS COME  
BACK ON WITH NO CODES AGAIN. TECH DOES STATES HE HAS U1900 & U0121 IN  
THE PCM.

**RECOMM** 03/28/2008 02:27PM ERIC ESTES MSS - TSO - KELSEY-HAYES RTDA  
ADVISED TECH DID CHECK ALL THE TERMINAL TENSIONS TO THE IGN FEED AND  
THE CAN BUS CIRCUITS AT THE ECU CONN.. TECH DID TIGHTEN GROUND G101  
ALSO HAS .05 OHMS. ADVISED WHEN THE LAMPS ARE OFF NO CODES ARE STORED  
IN THE ABS MODULE.

---

**Attachments : 0**

**Report# :** 8C2BF004 NHL **Received:** 03/28/2008  
**CCRG/EPRC:** **Reviewed Status:** **Date:**  
**Vehicle:** 2008,MUSTANG,GT ,COUPE ,1ZVHT82H085 **Build Date:** 10/24/2007  
**Odometer :** 280 M **Engine:** MOD 4.6L **Calibration:** 8ZF2G80A  
**Transmission:** T3650 MAN **Axle:** **A/C:** YES  
**Dealer:** CAN B1210 EDWARDS FORD SALES (KINGSTON) **Phone#:** (613) 546-2211  
**City:** Kingston **Province** Ontario **Country :** CAN  
**Originator:** SHAWN LEES  
**Symptom:** 3 02 1 01 CHASS.,PARKING BRAKE ,NO RELEASE,MECHANICAL  
**Status:**  
**VFG:** V21 BRAKING  
**Additional Symptom:** PARK BRAKE WON'T RELEASE COLD  
**Fix:** **Causal Component :** --



**Condition Code:****Hotliner:** TFUMEROL**Phone:** 313 317-9383**Regn Cd:** 01 01 FCSD REGION-CANADA**Engineering:****Phone:****TAR:****Dlr Contact:** SHAWN LEES**Phone:** 613 546-2211**Title Cde:** T**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**REPAIR** 03/28/2008 10:35AM TOM FUMEROLA MSS - FCSD - TECH SVC HOTLINE  
 WEB FORM DATA - CONCERN: CUST STATES WHEN VEHICLE SITS FOR COUPLE OF DAYS, WITH E-BRAKE ON, WHEN VEHICLE GOES TO MOVE CLUNK OR BANG NOISE FROM REAR LIKE BRAKES ARE STUCK ON. DIAGNOSTICS: INSPECTED BRAKES AND E-BRAKE CABLES CONCERN NOT HAPPENING WHEN CUST DROVE VEHICLE TO DEALERSHIP TODAY. TECH QUESTION: ANY KNOWN REPAIRS FOR THIS CONCERN.07  
 TSB FOR REAR BRAKES STICKING ON ?

**RECOMM** 03/28/2008 10:35AM TOM FUMEROLA MSS - FCSD - TECH SVC HOTLINE  
 SHAWN, IF THIS ONLY IS HAPPENING IN FREEZING WEATHER THAN SUSPECT WATER LEAKED INTO THE PARK BRAKE CABLE AND FROZE LIKE IN THE OLDER MUSTANGS. CHECK THE CABLE SHEATH AND SEALING FOR CRACKS OR DAMAGE. IF THIS DOES NOT OCCUR IN TEMPERATURES ABOVE FREEZING THAN REPLACE THE CABLE FOR WATER INTRUSION.

**Attachments : 13**

<b>Report# :</b>	8C2AV166 NHLDIG--or-- HD 200800165517	<b>Received:</b>	03/29/2008
<b>CCRG/EPRC:</b>	<b>Reviewed Status:</b>	<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,GT ,COUPE ,1ZVFT82H375 [REDACTED]	<b>Build Date:</b>	05/15/2007
<b>Odometer :</b>	9,757 M	<b>Engine:</b>	MOD 4.6L
<b>Transmission:</b>	T3650 MAN	<b>A/C:</b>	YES
<b>Dealer:</b>	USA 02199 BOB GILLINGHAM FORD INC	<b>Phone#:</b>	(216) 398-1300
<b>City:</b>	Parma	<b>State:</b>	Ohio
<b>Originator:</b>	Mike Murad	<b>Country :</b>	USA
<b>Symptom:</b>	3 06 7 04 CHASS.,TIRES/WHEELS,APPEARANCE,PEELING		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	Approved - PAAHR		
<b>Fix:</b>	<b>Causal Component :</b>	--	
<b>Condition Code:</b>			

**Region Code:** G4

**Region Name:** Pittsburgh

**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**CONCER** 03/28/2008 11:13AM

rims corroding around center caps necessary to replace rims thanks  
mike murad

SORRY IT TOOK SO LONG COMPUTER CONCERNS ALL 4 WHEELS PICTURES ENCLOSED

**RECOMM** 03/28/2008 11:13AM

Please provide a clear overall image of each entire wheel. Thanks,  
Mark P.

Approved to replace 4 wheels, delaminating around center caps.

Thanks, Mark P.

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8C2AV166](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8C2AV166)

---

<>

---

**From:** Querio, Jennifer (J.)  
**Sent:** Thursday, May 08, 2008 9:22 AM  
**To:** Kircheis, Bryce (A.)  
**Subject:** FW: S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

Hi Bryce,  
[Can we get the valve stems sent back to the plant?](#)

---

**From:** Lin, Jeff (J.H.)  
**Sent:** Thursday, May 08, 2008 9:12 AM  
**To:** 'JQUERIO'  
**Subject:** RE: S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

Jennifer,

I need 4 valve stems back for VIN# 1ZVHT82H275 [REDACTED].  
Steering wheel belongs to Diane Snoeyink, let her know next time. Thanks.

*Jeff Lin*  
Mustang Chassis PVT  
734-783-8288, cell: 313-805-2527  
jlin6@ford.com

---

**From:** JQUERIO [mailto:JQUERIO]  
**Sent:** Thursday, May 08, 2008 5:11 AM  
**To:** JLIN6  
**Subject:** S10 - CHASSIS - Report Summary(s) from a GCQIS Query Disposition

This email contains 3 report summary(s).

**Attachments :** 2

<b>Report# :</b>	8EFBT307 NHLDIG--or-- HD 200800174390	<b>Received:</b>	05/07/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2008,MUSTANG,GT ,COUPE ,1ZVHT82H285 [REDACTED]	<b>Build Date:</b>	01/02/2008
<b>Odometer :</b>	1,671 M	<b>Engine:</b>	MOD 4.6L
<b>Transmission:</b>	5R55S	<b>Axle:</b>	
<b>Dealer:</b>	USA 05534 Friendly Ford	<b>Calibration:</b>	8ZF1G80A
<b>City:</b>	Las Vegas	<b>A/C:</b>	YES
<b>Originator:</b>	Bob Woodsford	<b>Phone#:</b>	(702) 877-6541
<b>Symptom:</b>	3 03 A 01 CHASS.,STRG/HANDLING ,STEERING WHEEL ,APPEARANCE		
<b>Status:</b>			

**VFG:** V87 STEERING  
**Additional Symptom:** Denied  
**Fix:** **Causal Component :** --  
**Condition Code:**  
**Region Code:** W3 **Region Name:** Phoenix

**DTCs:**  
KOEO:  
KOEC:  
KOER:

**Comments :**

**CONCER** 05/06/2008 04:55PM  
mark in steering wheel need to replace steering wheel

**RECOMM** 05/06/2008 04:55PM

Warranty denied to replace the steerint wheel. Images provided show the steering wheel has been cut or scratched by an outside source.  
Thanks, Mark P.

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8EFBT307](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8EFBT307)

---

**Attachments : 2**

<b>Report# :</b>	8EFBT056 NHLDIG--or-- HD 200800174138	<b>Received:</b>	05/07/2008
<b>CCRG/EPRC:</b>	<b>Reviewed Status:</b>	<b>Date:</b>	
<b>Vehicle:</b>	2008,MUSTANG,SHELBY ,COUPE ,1ZVHT88S185 [REDACTED]	<b>Build Date:</b>	01/28/2008
<b>Odometer :</b>	236 M	<b>Engine:</b>	5.4L SHEL B
<b>Transmission:</b>	6 SPD T56	<b>Axle:</b>	
<b>Dealer:</b>	USA 03090 Best Ford Lincoln Mercury	<b>A/C:</b>	YES
<b>City:</b>	Nashua	<b>State:</b>	New Hampshir
<b>Originator:</b>	harrison kendall	<b>Phone#:</b>	(603) 889- 0161
<b>Symptom:</b>	3 06 7 05 CHASS.,TIRES/WHEELS,APPEARANCE,DAMAGED	<b>Country :</b>	USA
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	Denied		
<b>Fix:</b>	<b>Causal Component :</b>		--
<b>Condition Code:</b>			
<b>Region Code:</b>	N2	<b>Region Name:</b>	Boston

DTCs:  
KOEO:  
KOEC:  
KOER:

**Comments :**

CONCER 05/06/2008 09:57AM  
customer states defect in the LF tire and wheel

**RECOMM**

**05/06/2008 09:57AM**  
Warranty denied to replace the left front wheel. This is impact damage.

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8EFBT056](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8EFBT056)

---

**Attachments : 4**

<b>Report# :</b>	8EFBT306 NHLDIG--or-- HD 200800174389	<b>Received:</b>	05/07/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,GT ,COUPE ,1ZVHT82H275 [REDACTED]	<b>Build Date:</b>	12/20/2006
<b>Odometer :</b>	15,044 M	<b>Calibration:</b>	7ZF2U80A
		<b>Engine:</b>	MOD 4.6L
<b>Transmission:</b>	T3650 MAN	<b>A/C:</b>	YES
<b>Dealer:</b>	USA 01203 Fred Beans Ford-Lincoln-Mercur	<b>Phone#:</b>	(215) 348-2900
<b>City:</b>	Doylestown	<b>State:</b>	Pennsylvania
<b>Originator:</b>	Bruce Paynter	<b>Country :</b>	USA
<b>Symptom:</b>	3 06 7 00 CHASS.,TIRES/WHEELS,APPEARANCE,OTHER-CODE NA		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	Approved - PAARZ		
<b>Fix:</b>	<b>Causal Component :</b>	--	
<b>Condition Code:</b>			
<b>Region Code:</b>	N3	<b>Region Name:</b>	Philadelphia

DTCs:  
KOEO:  
KOEC:  
KOER:

**Comments :**

CONCER 05/06/2008 05:08PM  
customer request to replace cracking valve stems, tech verified cracking on all 4 stems, no visible rub marks on stems or signs of damage,customer no longer waiting

**RECOMM**

**05/06/2008 05:08PM**

approved to replace 4 valve stems. thanks gary

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8EFBT306](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8EFBT306)

---

---

**From:** McDonald, Joseph (J.)  
**Sent:** Wednesday, September 10, 2008 2:46 PM  
**To:** Jones, Rick (W.P.)  
**Subject:** FW: Report Summary for the CQIS Report#8IJAV099

FYI

---

**From:** JMCDON27@ford.com [mailto:JMCDON27@ford.com]  
**Sent:** Wednesday, September 10, 2008 1:44 PM  
**To:** McDonald, Joseph (J.)  
**Subject:** Report Summary for the CQIS Report#8IJAV099

**Attachments :** 6

<b>Report# :</b>	8IJAV099 FCSDFS	<b>Received:</b>	09/10/2008
<b>CCRG/EPRC:</b>	S	<b>Reviewed Status:</b>	<b>Date:</b> 09/10/2008
<b>Vehicle:</b>	2007,FUSION,SES ,SEDAN ,3FAHP08177R [REDACTED]	<b>Build Date:</b>	01/16/2007
<b>Odometer :</b>	9,181 M	<b>Engine:</b>	3.0L DOHC <b>Calibration:</b> 7DE1F60A
<b>Transmission:</b>	6SPD AISIN	<b>Axle:</b>	<b>A/C:</b> YES
<b>Dealer:</b>	USA 02486 Five Star Ford	<b>Phone#:</b>	(817) 498-8838
<b>City:</b>	North Richland H	<b>State:</b>	Texas <b>Country :</b> USA
<b>Originator:</b>	JOE MCDONALD		
<b>Symptom:</b>	3 06 2 01 CHASS.,TIRES/WHEELS,AIR LOSS,SLOW LEAK		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	VALVES STEMS CRACKED.		
<b>Fix:</b>	<b>Causal Component :</b>		
<b>Condition Code:</b>			
<b>Region Code:</b> C1	<b>Region Name:</b> Dallas		

**DTCs:**  
KOEO:  
KOEC:  
KOER:

**Comments :**

OWNER 09/10/2008 02:35PM JOSEPH MCDONALD(FSE) MSS - FCSD - REG - SOUTHWEST  
CUSTOMER STATES THAT THE RIGHT FRONT TIRES LOSES AIR. TECH INSPECTED  
TIRES AND FOUND THE VALVE STEM CRACKED AND LEAKING AIR. TECH INSPECTED  
OTHER WHEELS AND THE OTHER 3 VALVES STEM WERE CRACKED WITH 1 LEAKING.  
SEE ATTACHED PICTURES.

Please click on the link below to view the attachments associated with this report

[https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment\\_Mainx.asp?ReportNumber=8IJAV099](https://www.gcqis.dealerconnection.com/gcqis/asp/DIViewAttachment_Mainx.asp?ReportNumber=8IJAV099)



---

**From:** Arning, Ralph (R.)  
**Sent:** Wednesday, July 23, 2008 7:17 AM  
**To:** Jones, Rick (W.P.)  
**Subject:** FW: MUST-VALVE STEM - Report Summary(s) from a GCQIS Query Disposition

[Rick, Not sure if you are on distribution for these reports.](#)

Regards,

**Ralph Arning**

Ford Customer Service Div.  
Mustang PVT/Launch Team  
Phone: 734-782-7914  
Cell Phone: 734-752-9639  
e-mail: RARNING@Ford.com

---

**From:** JQUERIO [mailto:JQUERIO]  
**Sent:** Wednesday, July 23, 2008 1:08 AM  
**To:** RARNING  
**Subject:** MUST-VALVE STEM - Report Summary(s) from a GCQIS Query Disposition

This email contains 2 report summary(s).

**Attachments :** 0

<b>Report# :</b>	8GVAN001 NHL	<b>Received:</b>	07/22/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,BASE ,CONV ,1ZVFT84N975 [REDACTED]	<b>Build Date:</b>	03/01/2007
<b>Odometer :</b>	6,246 M	<b>Engine:</b>	4.0L SOHC
<b>Transmission:</b>	5R55S	<b>Axle:</b>	
<b>Dealer:</b>	USA 05432 RANCHO FORD L-M	<b>Calibration:</b>	7ZF1M60A
<b>City:</b>	Temecula	<b>A/C:</b>	YES
<b>State:</b>	California	<b>Phone#:</b>	(951) 699-1302
<b>Country :</b>	USA	<b>Country :</b>	USA
<b>Originator:</b>	GEORGE COX		
<b>Symptom:</b>	3 06 2 01 CHASS.,TIRES/WHEELS,AIR LOSS,SLOW LEAK		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES		
<b>Additional Symptom:</b>	VALVE STEM LEAK		
<b>Fix:</b>	<b>Causal Component :</b>	--	
<b>Condition Code:</b>			
<b>Hotliner:</b>	MMCKAY2	<b>Phone:</b>	313 317-4281
		<b>Regn Cd:</b>	W1 Los Angeles

**Engineering:**

**Phone:**

**TAR:**

**Dlr Contact:** GEORGE COX

**Phone:** 951 699-1302

**Title Cde:** SM

**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**REPAIR** 07/22/2008 08:08AM MICHAEL MCKAY MSS - FCSD - TECH SVC HOTLINE  
WEB FORM DATA - CONCERN: 3RD VALVE STEM LEAKING. LOOKS LIKE SPLITTING  
ON THE INSIDE OF THE VALVE STEM. ANY KNOW CONCERNS? DIAGNOSTICS: SEE  
ABOVE TECH QUESTION: SEE ABOVE

**RECOMM** 07/22/2008 08:08AM MICHAEL MCKAY MSS - FCSD - TECH SVC HOTLINE  
GEORGE, ONLY SUGGESTION IS TO REPLACE VALVE STEMS WITH OEM PART  
NUMBERS. HAVE SEEN SOME ISSUES WITH AFTERMARKET VALVE STEMS DRY  
ROTTING AND LEAKING. INSPECT AND REPAIR AS NEEDED.

**Attachments :** 0

<b>Report# :</b>	8GVAI008 NHL	<b>Received:</b>	07/22/2008
<b>CCRG/EPRC:</b>		<b>Date:</b>	
<b>Vehicle:</b>	2007,MUSTANG,BASE ,COUPE ,1ZVFT80N175 [REDACTED]	<b>Build Date:</b>	11/16/2006
<b>Odometer :</b>	7,913 M	<b>Engine:</b>	4.0L SOHC
<b>Transmission:</b>	5R55S	<b>Axle:</b>	
<b>Dealer:</b>	USA 04665 Capitol City Ford Inc	<b>A/C:</b>	YES
<b>City:</b>	Indianapolis	<b>State:</b>	Indiana
<b>Originator:</b>	ROSS TILYOU	<b>Phone#:</b>	(317) 898-0700
<b>Symptom:</b>	3 06 2 01 CHASS.,TIRES/WHEELS,AIR LOSS,SLOW LEAK		
<b>Status:</b>			
<b>VFG:</b>	V88 TIRES	<b>Country :</b>	USA
<b>Additional Symptom:</b>	VALVE STEM ISSUE		
<b>Fix:</b>	<b>Causal Component :</b>	--	
<b>Condition Code:</b>			

**Hotliner:** PBISHO17

**Phone:** 313 248-8233

**Regn Cd:** G3 Cincinnati

**Engineering:**

**Phone:**

**TAR:**

**Dlr Contact:** ROSS TILYOU

**Phone:** 317 898-0700

**Title Cde:** SM

**DTCs:**

KOEO:

KOEC:

KOER:

**Comments :**

**REPAIR** 07/22/2008 11:56AM PAUL BISHOP MSS - FCSD - TECH SVC HOTLINE  
WEB FORM DATA - CONCERN: CUSTOMER HAS FLAT TIRE, TIRE IS RUINED,  
HAPPENED IN CONSTRUCTION ZONE, ALL VALVE STEMS ON VEHICLE ARE CRACKED  
DIAGNOSTICS: CHECKED ON LINE, FOUND INFORMATION THAT CHINESE  
MANUFACTURER HAS SOLD VALVE STEMS TO SEVERAL AUTO MAKERS AND 6 MILLION  
ARE BEING RECALLED TECH QUESTION: WE CAN ONLY ASSUME THIS IS A NORMAL  
WARRANTY SITUATION AT THIS POINT, WOULD YOU CONCUR WITH THIS?

**RECOMM** 07/22/2008 11:56AM PAUL BISHOP MSS - FCSD - TECH SVC HOTLINE  
ROSS, WE ARE UNAWARE OF ANY VALVE STEM ISSUES AT THIS POINT. REPLACE  
THE VALVE STEMS AS NEEDED.

---

---

**From:** Gunlock, George (G.W.)  
**Sent:** Wednesday, April 23, 2008 4:02 PM  
**To:** Campbell, Keith (K.A.); Camilleri, Robert (R.H.); Gillman, Paul (P.D.); Bagley, Matt (M.R.)  
**Subject:** FW: From DigitalCopier 55cpm

[More Info.](#)

Regards.....George Gunlock  
313-323-8987, cell 313-580-4873  
ggunlock@ford.com, PDC 2B-G21

---

**From:** Jackson, Robert (R.P.)  
**Sent:** Wednesday, April 23, 2008 2:58 PM  
**To:** Gunlock, George (G.W.)  
**Subject:** RE: From DigitalCopier 55cpm

I am going to the Dealer/and the Police Fleet tomorrow afternoon. The SM said that they have had a total of 11 failures of the stems all with Vehicle build dates of 12/07 the fleet has cars back to 2002 models, but those 2007's are the only ones that have leaked. I was told that they have ruined 2 tires because they lost air?? I will find out more details tomorrow PM

Robert P. Jackson  
Field Service Engineer  
Southeast Market  
Ford Customer Service Division  
rjackso4@ford.com  
Phone 1-770-865-1165

---

**From:** Gunlock, George (G.W.)  
**Sent:** Wednesday, April 23, 2008 8:20 AM  
**To:** Jackson, Robert (R.P.)  
**Subject:** RE: From DigitalCopier 55cpm

Nothing new on any openings at this time. I went through the interview with Leo Hughes anyway. He suggested that then we have it out of the way if / when something would open up. I also told Leo that with tires coming into D.I., I wanted to get that working smoothly before I would consider a new assignment. Thanks for asking.

I will check with my colleagues on the valve stem issue to see if we have an official answer.

Regards.....George Gunlock  
313-323-8987, cell 313-580-4873  
ggunlock@ford.com, PDC 2B-G21

**From:** Jackson, Robert (R.P.)  
**Sent:** Tuesday, April 22, 2008 8:40 PM  
**To:** Gunlock, George (G.W.)  
**Subject:** FW: From DigitalCopier 55cpm

George, Any news on the open positions??

Below is my response back to the the Service Manager, on a Police fleet do you know of any more on this, I have not seen the stems/Vehicles yet, I will be there Next week. Thanks

Robert P. Jackson  
Field Service Engineer  
Southeast Market  
Ford Customer Service Division  
rjackso4@ford.com  
Phone 1-770-865-1165

---

**From:** PATRICK CARROLL [mailto:pcarroll@woodyandersonford.com]  
**Sent:** Tuesday, April 22, 2008 12:37 PM  
**To:** Jackson, Robert (R.P.)  
**Cc:** 'Gardner, Matt'  
**Subject:** FW: From DigitalCopier 55cpm

Robert,

I have several Police Interceptors that the valve stems are actually dry rotting causing the tires to go flat and ruining the tire .This is just on there 2007 models they have in service. They still use the same cleaning chemicals and process as they have with all there previous models in the past, this was one of the questions I had? I'm stumped and concerned by what could be causing this, also I have a couple of the valve stems they took off if you need to see them. This message was sent from our friends at the city of Huntsville garage. Please let me know if you get the attachment with VIN# numbers the ones that are in the bold are the current affected vehicles so far.

Thank you  
Pat Carroll  
Woody Anderson Ford

---

**From:** Gardner, Matt [mailto:Matt.Gardner@hsvcity.com]  
**Sent:** Tuesday, April 22, 2008 10:46 AM  
**To:** pcarroll@woodyandersonford.com; Weeks, Marisa (M.J.)  
**Cc:** Durham, Joel; Stone, Celena  
**Subject:** FW: From DigitalCopier 55cpm

Pat ,

The attachment shows the 2007 Crown Victoria's that are in question. The cars in bold we have had problems with and have replaced the valve stems on all four wheels.

Two tires that I am aware of when down while the units where being driven.

**My concern is if a tire goes down and causes an accident due to a valve stem malfunction. I don't want to cause a panic. But I need to address this immediately.**

We have called Fleet ford customer service today to see if they could help us.(Chris 1-800-392-3673) They are going to call back.

**From:** Gardner, Matt

**Sent:** Friday, April 18, 2008 2:38 PM

**To:** pcarroll@woodyandersonford.com

**Subject:** FW: From DigitalCopier 55cpm

Pat,

This is one car that came in this morning with valve stems cracking. Just wanted to let you know.

Thanks for your support. Matt Service Manager in Fleet

---

---

**From:** Gunlock, George (G.W.)  
**Sent:** Monday, April 28, 2008 8:30 AM  
**To:** Campbell, Keith (K.A.); Branik, David (D.P.); Steele, Kimberly (K.A.); Lloyd, Dave (D.B.); Camilleri, Robert (R.H.)  
**Subject:** FW: 08 Escapes & F150 Valve Stems.

More valve stem reports.

Regards.....George Gunlock  
313-323-8987, cell 313-580-4873  
ggunlock@ford.com, PDC 2B-G21

-----Original Message-----

From: Hoyt, Samantha (S.A.)  
Sent: Monday, April 28, 2008 8:16 AM  
To: Gunlock, George (G.W.); Burkeen, Craig (D.C.)  
Cc: Crichton, Mike (M.P.)  
Subject: FW: 08 Escapes & F150 Valve Stems.

George, Craig,

Please see the note below on tires on Escape and F-150. I do not know which manufacturer, but the fleet contact is below. (This is not a dealer, it's a big fleet account.)

Samantha Hoyt  
Retail Communications and Tires Manager  
Retail Channel - FCSD  
(O) 313-323-1515 (F) 313-322-0514

-----Original Message-----

From: Crichton, Mike (M.P.)  
Sent: Thursday, April 24, 2008 11:02 PM  
To: Meier, Kenneth (K.W.); Hoyt, Samantha (S.A.)  
Subject: FW: 08 Escapes & F150 Valve Stems.

Ken & Sam,

The following info just came to me from Palm Beach County. Can you please pass this on to the appropriate people so if there is a problem we can correct it ASAP.

Please advise as you see appropriate.

Thank you.

-----Original Message-----

From: Mario Doran [mailto:mdoran@co.palm-beach.fl.us]  
Sent: Thursday, April 24, 2008 2:09 PM  
To: Crichton, Mike (M.P.)  
Cc: Larry Anstee  
Subject: 08 Escapes & F150 Valve Stems.

Mike,

Just want to share with you a possible defect we are experiencing on 08 Escapes and F150. We have already replaced valve stems on three Escapes and had a F150 towed in with a blow out, all due to cracked tire valve stems. Wondering if you have heard complaints from other customers. All of the above mentioned vehicles mileage were within 15,000 mile to 20,000 miles range. Would appreciate your response and input.

Mario Doran  
Shop Supervisor/LV Shop  
Fleet Management Division  
P (561) 233-4574  
F (561) 233-4575



---

**From:** Camilleri, Robert (R.H.)  
**Sent:** Tuesday, June 17, 2008 5:18 PM  
**To:** Rohweder, David (D.S.)  
**Subject:** Baolong Topseal Field Return Data

**Attachments:** Valve Stem Field Returns.xls

Dave, the attached file identifies the vehicle information for the valve stems field returns. Some of the initial returns received by George Gunlock did not have a VIN identified for them, so I did not include them in this file. Please review and let me know if there are any additional categories we need to add. I will use this document to track any future returns to our department. FYI, I will be at Dearborn Truck all day tomorrow and will follow up with you at the end of the day. Thanks



Valve Stem  
Field Returns.xls (

Wheel Valve Stem Field Return Catalog

VIN	MY	Make	Model	Tire Size	Tire Mfg	Tire Brand	Wheel Size	Wheel Mat'l	Whl Mfg	Bld date	Sale Date	Mileage	Repair Date	Dealer/Owner Location	Valve Stem Field Samples			
															Sample #1	Sample#2	Sample #3	Sample#4
1ZVFT80N475	2007	Ford	Mustang	P235/55ZR17 99W A/S	Pirelli	PZERO NERO M&S 98W	17*8.0	Aluminum	Superior	18-Apr-07	25-Sep-07	10,292	19-May-08	Devine, TX	Topseal TR414 Mid #6 Cavity #14	Topseal TR414 Mid #6 Cavity #36	Topseal TR414 Mid #6 Cavity #149	Topseal TR414 Mid #8 Cavity #140
2FAHP71W27X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	18-Jan-07	9-Feb-07	Unkown	Parts Received @ Ford PDC April 21,2008	Florida State Police	Topseal TR414 Mid #TBD Cavity #TBD	Topseal TR414 Mid #TBD Cavity #TBD	NA	NA
2FAAP71W37X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	27-Nov-06	19-Dec-06	Unkown	Parts Received @ Ford April 21,2008	Florida State Police	Topseal TR414 Mid #6 Cavity #181	Topseal TR414 Mid #6 Cavity #65	NA	NA
2FAFP71W57X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	27-Sep-06	8-Nov-06	27,509	21-May-08	St. John County Sheriff, Florida	Topseal TR413 Mid #5 Cavity #45 Non Production Valve	NA	NA	NA
2FAFP71W47X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	21-Sep-06	31-Oct-06	Unkown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #99	(**) Topseal TR414 Mid #8 Cavity #108	(**) Topseal TR414 Mid #6 Cavity #115	(**) Topseal TR414 Mid #6 Cavity #143
2FAFP71W87X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	22-Sep-06	24-Oct-06	Unkown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #8 Cavity #168	(**) Topseal TR414 Mid #8 Cavity #89	(**) Topseal TR414 Mid #6 Cavity #78	(**) Topseal TR414 Mid #6 Cavity #172
2FAFP71W67X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	21-Sep-06	24-Oct-06	Unkown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #33	(**) Topseal TR414 Mid #6 Cavity #23	(**) Topseal TR414 Mid #6 Cavity #114	(**) Topseal TR414 Mid #6 Cavity #92
2FAFP71W97X	2007	Ford	Crown Vic	P235/55R 17 A/S BSW	Goodyear	Eagle RS-A 98H	17*17.5	Steel	Hayes	1-Feb-07	6-Mar-07	Unkown	Parts Received @ Ford PDC June 12,2008	Bozard Ford, Florida (Local Sheriff Cruiser)	(**) Topseal TR414 Mid #6 Cavity #158	(**) Mfg Unkown TR413 Non Production Valve	(**) Mfg Unkown TR413 Non Production Valve	NA

Count of VIN	
Model Year	Total
2006	856
2007	1097
2008	298
2009	1
Grand Total	2252

Count of VIN	Model Year				Grand Total
Time In Service	2006	2007	2008	2009	Grand Total
0	88	80	39		207
1	63	69	60	1	193
2	34	50	23		107
3	44	27	27		98
4	28	29	16		73
5	26	24	17		67
6	27	27	16		70
7	26	47	11		84
8	22	33	11		66
9	25	44	14		83
10	24	40	9		73
11	19	42	7		68
12	25	68	5		98
13	17	74	5		96
14	25	70	12		107
15	19	84	9		112
16	19	109	9		137
17	25	78	6		109
18	34	42	1		77
19	17	28			45
20	26	19			45
21	21	2			23
22	36				36
23	22	1			23
24	22	2			24
25	26	1			27
26	19	1			20
27	12	1			13
28	10				10
29	16				16
30	9				9
31	5				5
32	6				6
33	5				5
34	5				5
35	2				2
36	1				1
(blank)	6	5	1		12
Grand Total	856	1097	298	1	2252

DI reviewed		AWA		Denied Wheel Vins	
Total process by DI	354	Claims pad DI dealers	1192	Denied Paid on wheels	3
Approved	289	Warranty	842	AWA out of warr	1
Denied	51	Under DI limit	454	Under limit	1
Processed	14	Tire	15	DI overturned	1
		Not DI	11		
		Noise, under parts	3		
		Unknown	1		
		ACES	6		
		Out of warranty	90		
		OK	232		
		Graduated before repair	30		
		campain	315		
		MVC	17		
		SPW	17		
		AWA	40		
		P01 ZM AWA	3		
		P05 Dealer AWA	32		
		P08 SPW AWA	1		
		P54 Consumer relations AWA	1		
		P98 General offic AWA	1		
		W04 Fleet awa	2		
		AWA ?	1		

MDL _YR	VIN_CD	PRODN_D T	WRTY_ST ART_DT	NAME	DOC_NUM M	WCC _CD	PART_NUM _CAU	PAR_TN UM_	PAR_TN UM_	T_C ONC	ND_TXN _C_CD	RPR_DT	TIS _SD	MILGE	MTRL_COST	LBR_COST	TOT_GROSS	LBR_S	DLR_CD	TECH_TX T1	TECH_TX T2	CUST_TX T	Comment	
2008	1FMCU03148K	10-Aug-07	24-Aug-07	MCCOTTER FORD - ME	210381A	5K02	*	1130	*	B65	42	1	21-Aug-07	0	1	70.34	0	70.34	0	4944	1 W PDI ROAD TEST		?	
2007	3FAHP06Z37R	14-Feb-07	28-Mar-07	DON CHALMERS FORD	4337251	5K02	7E5Z	1130	A	N51	42	1	3-Aug-07	5	6201	91	17.59	108.59	0.2	1487	1 HUB INSTOCK ORDER 3 MORE		CUSTOMER STATES HUB CAPS STILL MAKING NOISE. REPLACE HUBCAPS	ACES
2006	2MEHM75V16X632423	10-Feb-06	6-Sep-06	HOLMAN FORD LINCOLN	217074A	5K02	3W3Z	1130	AA	B65	30	2	13-Jun-07	10	3973	97.84	17.07	114.91	0.2	2848	3973 PAINT PEELING OFF CENTER CAPS INSTALL SOP VERIFIED CONCERN R&R CENTER CAPS X INSTALLED SOP CAPS		CUSTOMER STATES THE PAINT ON LEFT REAR AND RIGHT FRONT CENTER CAPS ARE PEELING XX SOP	ACES
2007	1FAFP34N67W149491	4-Aug-06	30-Oct-06	KINDLE FORD MERCURY	32053901	5K02	6S4Z	1130	B	B65	D4 E84		9-Jul-07	9	20535	121.01	0	121.01	0	1237	REPLACE CENTER CAPS		PEELING CHECK CENTER CAPS ON ALL FOUR RIMS HAVE CORROSION ON THEM	ACES
2005	1FMDK05105GA12155	22-Oct-04	24-Nov-04	LYONS-RYAN FORD SA	105435B	5K02	5F9Z	1130	AA	B65	5 E84		8-Jun-07	31	32210	74.7	18.96	93.66	0.2	1505	RPL PEELING HUB CAPS		B65	ACES

2005 1FMYU02Z95K	11-Aug-04	5-Sep-04	TOWN AND COUNTRY I	2530051	5K01	5L8Z	1007 CA	B65	81 E84	12-Jun-07	34	34989	734.81	44.24	779.05	0.6	5755	WHEELS DISCOLORED AND WILL NOCOME CLEAN WITH ANY CLEANER ALSO CENTER CAPS BOTH REAR AND RH FRONT CENTER CAP ON WHEELS ARE PEELING, ADVISE CUST STATES TIRE INFLATION KIT MISSING FROM CAR	ACES	AWA/Field
2004 1FTPW12574K	19-May-04	11-Oct-04	TOWN AND COUNTRY I	2503854	5K02	4L3Z	1130 DD	B65	81 E84	4-Jun-07	33	35944	122.26	14.75	137.01	0.2	5755	WHEELS DISCOLORED AND WILL NOCOME CLEAN WITH ANY CLEANER ALSO CENTER CAPS BOTH REAR AND RH FRONT CENTER CAP ON WHEELS ARE PEELING, ADVISE CUST STATES TIRE INFLATION KIT MISSING FROM CAR	ACES	AWA/Field
2005 1FAFP90S35Y	19-Nov-04	29-Mar-07	ENFIELD FORD	15339102	5K02	4G7Z	19L52AA	A99	82 P53	5-Jul-07	4	2001	210	0	210	0	8821	FORD AUTH#J048R, PROGRAM CODE P53	ACES	AWA/Field

2006 1ZVFT85H765	17-Oct-05	4-Nov-05	COOK-WHITEHEAD FOI013390A	5K01	6R3Z	1007 C	N25	D9 E84	10-Aug-07	22	32928	211.32	21.17	232.49	0.3	4910	2519	32928 OUT OF ROUND NVH DIAG, CHECK TIRE WHEEL RUNOUT, RT RR WHEEL OUT OF ROUND, NO SIGNS OF DAMAGE S R&R RT RR WHEEL BALANCE D, OK.TECH CLEAR PEELING REPLACE D L R RIM FOR HIDDEN DAMAGE FOUND DURING PDI. NECC TO INSTALLE D TPMS SENSOR BAND AND TRANSFE R SENSOR.	C S THAT THERE ISA VIBRATIO N COMING FROM THE VEHICLE AT SPEEDS OVER 65 MPH. SEE HISTORY	GRAD	
2008 1FAHP25W78G	29-May-07		KELLY FORD	12294001	5K01	8G1Z	1007 C	B65	81	1	10-Jul-07	-1	12	345.7	52.08	397.78	0.7	4808	1079 REMOVE D OLD CENTER CAPS INSTALLE D NEW ONES	LEFT REAR RIM DAMAGE D UNDER PROTECT IVE COVER CHECK CENTER CAPS. CUSTOM ER STATES THEY ARE DISCOLO RED.	Grad
2007 1FTPX14V07F	13-Apr-07	9-Jul-07	GRAND LEDGE FORD, I066126A	5K02	4L3Z	1130 AB	B65	34	1	23-Jul-07	1	1079	70.34	15.32	85.66	0.2	9099			Grad	



2007 1ZVFT80N275	4-Aug-06	26-May-07	NORRIS FORD	9232251	5K01	6R3Z	1007 E	B65	42	1	7-Aug-07	3	7205	235.34	23.92	259.26	0.3	34	STAINED TIRE(S) OR WHEEL(S) ) REPLACE	CHECK FRT RIM	Grad
------------------	----------	-----------	-------------	---------	------	------	--------	-----	----	---	----------	---	------	--------	-------	--------	-----	----	--	------------------	------

2007 1FAHP24157	29-Nov-06	3-Aug-07	JACK SCHMITT FORD	L090023A	5K01	*	1007 *	N24	82	2	8-Aug-07	1	301	0	97.54	97.54	1.1	8193	CHECK VIBRATIO N AT HIGHWA Y SPEEDS. 4 TIRES.AD DED 1 2 OZ OF STATIC WEIGHT TO RIGHT FRT TIRE AND 1 2 OF DYNAMIC WEIGHT TO LEFT REAR.RO AD TEST AGAIN.	CHECK VIB HWY SPEEDS	GRAD
-----------------	-----------	----------	-------------------	----------	------	---	--------	-----	----	---	----------	---	-----	---	-------	-------	-----	------	---	----------------------------	------

2008	1FMCU03158K	26-Apr-07	2-Jun-07	FRITTS FORD	9653451	5K01	*	1007	*	N50	33	2	7-Jun-07	1	358	0	268.12	268.12	3.1	5557	FOR NOISE, VERIFY CONCERN CONNECT CHASSIS EARS. NOISE COMING FROM LEFT FRONT WHEEL REMOVE BRAKE ASSY, REMOVE KNUCLE, REMOVE STRUT FOR ACCESS REPOSITION BACKING PLATE, SECURE REASSEMBL	RUT KNUCLE AND ROTOR, RE TEST NO MORE NOISE HERD AFTER REPAIR	CUST STATES FT END OF VEHICLE MAKING A GRINDING NOISE WHILE DRIVING AND GETS LOUDER WHEN BRAKING. CHECK AND ADVISE	GRAD
2007	1FTPW14V97K	23-Mar-07	22-Jun-07	GRANDE TRUCK CENTI	090464A	5K01	*	1007	*	N25	D9	2	28-Jun-07	1	553	5.6	100	105.6	0	4569	ROAD TESTED, VERIFIED VIBRATION AT HWY SPEEDS, SUBLET REPAIR TO BALANCE ALL TIRES.	CHECK VIB IN TRUCK 50 MPH	GRAD	

2007 1FTPW14VX7F	6-Sep-06	6-Jan-07	MAXWELL FORD	789297A	5K01	*	1007	*	G29	42	2	9-Jun-07	6	1915	0	91.85	91.85	1.1	2923	1915 EEC TEST HAD CODE FOR RIGHT FRONT TIRE CHECK TIRE PRESSU RES RF LOW FOUND VALVE STEM CRACKE D REMOVE D TIRE AND INSTALLE D NEW STEM MOUNT AND BALANCE TIRE RETEST OK DONE	C S TIRE PRESSU RE LIGHT ON & PASSEN GERSIDE TIRE LEAKING C S CHROME IS PEELING FROM DRIVERS REAR WHEEL	GRAD GRAD
2007 5LTPW18567F	5-Sep-06	3-Apr-07	NORTH SHORE L-M INC	181788A	5K01	7L7Z	1007	K	B65	55	2	12-Jun-07	3	3500	582.61	25.19	607.8	0.3	10004	REPLACE D WHEEL RETSTED OK	WHEEL	GRAD

2007 1FMEU75817U	28-Mar-07	29-Apr-07	MOSSY FORD	16021401	5K01	7L2Z	1007 E	N50	42	2	4-Aug-07	4	3604	702.72	254.79	957.51	2.9	5428	IN HE FROM BUT THE L/F SITLL WHEEL HEAR ON AREA HE RIGHT PLATIC REAR WHEEL WHEEL CAPS REMOVE MAKING BOTH NOISED RIGHT WHEN SIDE WH EEL WHEELS IS AND ROTATIN TRANFER G TEST R WHELL DROVE AIR VEHIC;E PRESSU VISUALLY R INSPECT ESNSOR HUB AND USING CLIENT ROTONA NEW STATES L WHEEL SRAPS WHEN PARTS INSTALL MAKING PUT NEW A RIGHT SPARE VALVE TURN TIRE ON STEM ON THERE IS FRON BOTH A WHEEL RIMS CLICKING AND THE AND NOSIE NOISE SWITHC CO GRAD PEELING CONFIRM ED CONCER N, FOUND ALL 4 WHEELS PITTING. REPLACE D ALL WHEELS & BALANCE D. C S ALL FOUR WHEELS ARE PEELING THE CLEAR COAT SOP IN GRAD
2007 1FMEU31K37U	12-Apr-06	16-Jun-07	KELLY FORD	12365301	5K01	6L2Z	1007 BA	B65	D4	2	21-Jul-07	2	5987	1001.1	59.53	1060.59	0.8	4808	4881800 REPLACE RIM REPLACE R R WHEEL EXCESSI VE RIM RUN OUT REPLACE R R WHEEL EXCESSI VE RIM REMO8-060 1174 RUN OUT GRAD
2004 1FAFP45X44F	21-Feb-04	12-Nov-04	PARADISE FORD	1772351	5K01	3R3Z	1007 CA	B65	41 E84		4-Aug-07	34	2837	329.95	22.16	352.11	0.3	3942	

2006	1FTPX14V46N	11-Apr-06	24-Jun-06	KELLY FORD	12224501	5K02	4L3Z	1130	JA	B65	42	E84	28-Jun-07	13	12236	111.5	14.88	126.38	0.2	4808	1283	CRACKIN G REPLACE D 4 CENTER CAPS DUE TO CRACKIN G CLEAR COAT 401	ALL 4 WHEEL CENTER CAPS CLEAR COAT IS CRACKIN G	GRAD
2004	1FAFP48Y14F	14-Jan-04	17-Dec-04	DAVE SINCLAIR FORD,	43722501	5K01	3R3Z	1007	EA	B65	5	E84	21-Aug-07	33	12257	570	29.49	599.49	0.3	8199	INSTALLE D SOP WHEEL FROM RIM HAD METAL DEBREE ON HUB TEST DROVE NVH DIAG CHECK STEERIN G OMPONE TS AND BALL JOINTS AND DRIVESH AFT CHECK WHEEL RUNOUT AND REMOVE WHEEL RIGHT FRONT AND SAND OFF METAL	C S RT REAR TIRE HAS CHROME COMING OFF INSTALL ORDERE D PART	GRAD	
2005	1FAFP34N85W	8-Dec-04	23-Apr-05	MOSSY FORD	15698301	5K01	*	1015	*	N23	42	E84	11-Jun-07	26	13100	0	87.85	87.85	1	5428	METAL HUB	CLIENT ING THE STATE RIM NOT STEERIN G WHEEL TO BE SHIMMIE S AT ANY FLAT AGAINST SPEED	GRAD	

2005 1FMYU93165K	7-Jan-05	23-Jul-05	ISLAND FORD, INC.	276939A	5K01	5L8Z	1007 DB	B65	1 E84	21-Jul-07	25	14493	782.88	87.34	870.22	0.8	3650	REMOVE D AND REPLACE D ALL DEFECTE D RIMS REMOVE WHEELS AND REPLACE ALL 4 CENTER CAPS	REMOVE D AND REPLACE D ALL DEFECTE D RIMS REMOVE WHEELS AND REPLACE ALL 4 CENTER CAPS	CUSTOMER STATES ALL FOUR RIMS ARE PITTING SOP FOUR RIMS	GRAD
2005 2MEFM75W45X	30-Jun-05	18-Jul-05	ELMHURST LINCOLN-M	6494051	5K02	3W3Z	1130 AA	B65	D4 E84	28-Jul-07	25	14902	161.46	0	161.46	0	13660	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE	CLIENT STATES PASSENGER REAR WHEEL FINISH IS STARTING TO CRACK	GRAD
2005 1FAFP27135G	29-Nov-04	5-Apr-06	MOSSY FORD	15909208	5K01	7G1Z	1007 B	B65	34 E84	18-Jul-07	16	15852	253.67	26.36	280.03	0.3	5428	CHROME PEELING FROM WHEEL REPLACE WHEEL	CHROME PEELING FROM WHEEL REPLACE WHEEL	CHECK LEFT REAR RIM CHROME PEELING CUSTOMER STATES ALL FOUR CENTER CAPS ARE CORRODED ADVISOR 160 ORDER PARTS AND PARTS ARE HE	GRAD
2006 1FMEU74E26U	8-Aug-05	20-Oct-05	B & B FORD SALES INC	7689602	5K01	6L2Z	1007 EA	B65	5 E84	3-Jul-07	21	17863	301.5	20.78	322.28	0.3	6329	WHEEL COVERS WHEEL RING HUB CAP WHEEL COVER REPLACE	WHEEL COVERS WHEEL RING HUB CAP WHEEL COVER REPLACE	ORDER PARTS AND PARTS ARE HE	GRAD
2005 2MEFM75W65X	4-May-05	26-May-05	ELMHURST LINCOLN-M	6378051	5K02	3W3Z	1130 AA	B65	81 E84	18-Jun-07	26	17890	161.46	19.95	181.41	0.2	13660			ORDER PARTS AND PARTS ARE HE	GRAD

2006 2MEFM74V56X	4-May-06	15-Sep-06	ELMHURST LINCOLN-M	6559051	5K02	5W3Z	1130	DA	N50	42	E84	17-Aug-07	12	18098	194.58	79.79	274.37	0.8	13660	ROAD TEST VERIFY CONCERN DIAGNOSE AND REPLACE WHEEL COVERS	CUSTOMER, THERE IS NOISE WHILE DRIVING AT TTIMES	GRAD
																				FOUND LEAK IN RIM. REPLACE D RIM. HAD TO TAKE OLD TIRE OFF OLD RIM. MOUNTED AND BALANCED OLD TIRE ON NEW RIM. INSTALLED HUB	CHECK AND ADVISE CUSTOMER STATES AIR IS LEAKING FROM PASSENGER FRONT RIM WHERE RIM IS WELDED TOGETHER ON INSIDE	GRAD
2006 1FDAF56P26E	6-Aug-05	11-Apr-06	FRITTS FORD	9613651	5K01	6C3Z	1015	D	A85	D1	E84	5-Jun-07	15	19517	222.67	77.85	300.52	0.9	5557			

2005	1FTWF30545E	8-Dec-04	3-Jun-05	RUSTY ECK FORD, INC	32478901	5K01	5C3Z	1015 PA	B65	1 E84	7-Jul-07	26	20670	222.67	35.09	257.76	0.4	5319	REINSTA CHECKE D CONCER N FOUND COVER ON LF RIM MAKING LOUD SQUEAKI NG NOISE R&R RIM MOUNT AND BALANCE TIRE 25073 REPLACE D 2, IN STOCK. ORDERE D THE THIRD	VEH.	D WHEEL W;DIA AIR LEAK FROM WHEEL ASY;SOA P TESTED AND FOUND THE WHEEL WAS LEAKING FROM THE WELDED SEAM;RE MOVED TIRES AND REPLACE D TIRE;REB ALANCED OLD TIRE ON A NEW WHEEL AND	CUSTOM ER STATES THAT THEY HAVE BEEN LOSING AIR FROM THEIR TIRE, HAD IT CHECKE D AND THE RIM SEEMS TO BE CRACKE D AND LEAKING AIR, CHECK AND ADVISE RIGHT FRONT	GRAD
2006	1FTPW14566K	6-Sep-05	7-Oct-05	SANDERS FORD INC	15225501	5K01	7L3Z	1015 B	B65	42 E84	4-Jun-07	21	23829	162.02	21.53	183.55	0.3	6658	TIRE 25073 REPLACE D 2, IN STOCK. ORDERE D THE THIRD		CUSTOM ER STATES LEFT FRONT WHEEL MAKING NOISE	GRAD	
2004	1FTRW12W24K	15-Apr-04	15-Jan-05	GRAND LEDGE FORD, I	1064830C	5K02	4L1Z	1130 BA	B65	D7 E84	16-Jun-07	30	25073	100.51	15.32	115.83	0.2	9099	THIRD		ORDER CORROD ED P 08-060 1178 CAPS	GRAD	



2005	1FTYR10D85P	26-Jul-05	28-Sep-05	JOE MACHENS FORD L	51379404	5K01	YL2Z	1015	AA	B65	P4	E84	6-Aug-07	23	25336	248.43	68.69	317.12	0.8	8006	REPLACE RIGHT FRONT AND RIGHT REAR AND LEFT REAR WHEELS	CUSTOM ER STATES PAINT PEELING FROM RIGHT FRONT, RIGHT REAR, AND LEFT REAR WHEELS ...	GRAD
2004	1FAFP40424F	20-Aug-03	19-Aug-04	ENFIELD FORD	15280001	5K02	3R3Z	1130	BA	B65	D4	E84	21-Jun-07	35	28037	161.34	15.76	177.1	0.2	8821	REPLACE PEELING WHEEL COVERS	CUST STATES INSTALL S O WHEEL COVERS DUE TO PEELING SEE PART CAR, TECH 24 C S THE LEFT REAR TIRE KEEPS LOOSING AIR	GRAD
2004	1LNHM83W14Y	28-Jun-04	31-Mar-05	NORTH SHORE L-M INC	182279B	5K01	4W1Z	1007	AA	B65	55	E84	2-Jul-07	28	29991	544.19	25.19	569.38	0.3	10004	REPOLAC ED PARTS TETRERE T		GRAD
2005	1FTSW21PX5E	23-Feb-05	24-Mar-05	PARADISE FORD	1749951	5K01	5C3Z	1007	PA	B65	81	E84	31-Jul-07	29	34551	752.14	29.54	781.68	0.4	3942	REPLACE D RIGHT REAR WHEEL FOR PEELING.	SOP WHEEL DELAMIN ATING R R	GRAD

2004	5LMEU88H34Z	5-Sep-03	24-Jul-04	LIBERTY FORD LINC	195815A	5K02	2C5Z	1130 AA	B65	81 E84	21-Jun-07	36	34734	212.86	17.05	229.91	0.2	2222	34734 REPLACE D ALL FOUR CENTER CAPS. VEH WAS IN SHOP AND ACTUAL MILES WERE CHECKE D AND ENTERED . MILEAGE FROM THE OTHER DEALERS HIP PA CODE 03273 WAS RECORE DI	NCORRE CT	C S CENTER CAPS ON WHEELS PEELING BUBBLIN G SOP IN	GRAD	
2007	3FAHP06Z87R	1-Feb-07	16-Mar-07	PHIL LONG FORD, LLC	78210101	5K02	*	1130 *	N50	7	1	25-Jul-07	5	6116	0	98.88	98.88	1.1	3140	TEST DROVE VERIFIED SQUEAK HUBCAP S SQUEAKI NG WHEN FLEXING MT TIME TO REMOVE ALL HUBCAP S INSULAT ED CLIPS RETEST DROVE NOISE GONE		CUSTOM ER STATES HE HEARS A CHURPIN G NOISE COMING FRONT FRONT OF VEHICLE WHEN WHEELS ARE TURNING SEEMS TO COME FROM PASS SIDE FRONT CHECK AND ADVISOR	1180

2006 1FAFP34N86W	13-Jan-06	22-Feb-06	VALLEY ISLE MOTORS	368689B	5K02 *	1130 *	N50	33 E84	11-Jun-07	16	7095	15.4	80.84	96.24	0.8	7839	VERIFIED CONCER N. PINPOINT TO HUB CAP. CHECK OA SIS SSM TSBS FOUND. TSB 060905 BACK ORDER AND INSTLED TAPE NOISE GONE COVERS OTHER ITEMS DID ROAD ROAD TEST INSP NOTED ESP DRIVING BY WALLS A CLICKING S CREAKIN G TYPE NOISE CHANGE S WITH TURNING IN SHOP INSP NO LOOSE WHEELS NUTS NOTED INSP RETORQ UE UNDER SIDE	C S THERES A CLICKING NOISE COMING FROM FRONT TIRES WHEN DRIVING. CHECK AND ADVISE	Noise
2006 2FMDA51636E	16-Dec-05	12-Jan-06	SOUND FORD INC	15979903	5K02 *	1130 *	N51	7 E84	11-Jul-07	19	24955	0	193.91	193.91	2.2	8511	WER CONTRO L ARM REAR AXLE TRAILING LINKAGE S INSP LISTEN TO STRUT BEARING S LEFT CUST TO RIGHT STATES NO THERE IS A HUMMIN G NOISE ESP WHEN TURNING , SEEMS LIKE FROM REAR LEFT	Noise	

2007 1FTPW14V87K	16-Mar-07	GRANDE TRUCK CENTI090405A	5K01 *	1007 *	N25	D9	1	26-Jun-07	-1	157	8.96	120	128.96	0	4569	ROAD TESTED, VERIFIED VIBRATION AT HWY SPEEDS, SUBLET REPAIR TO BALANCE ALL FOUR TIRES, RETESTED OK.	REPAIR VIBRATION AT HWY SPEEDS	Not DI
------------------	-----------	---------------------------	--------	--------	-----	----	---	-----------	----	-----	------	-----	--------	---	------	--	--------------------------------	--------

2007 1FMFU17597L	11-May-07	31-Aug-07	GARY YEOMANS FORD	57860001	5K01	7L1Z	1007 D	B65	34	1	5-Jul-07	0	11	303.32	72	375.32	0.9	4790	RIGHT REAR WHEEL HUB TOO BIG IN DIAMETER FOR HUB CAP. REPLACED RIGHT REAR WHEEL AND REMOVED INSTALLED TIRE PRESSURE MONITOR SENSOR.	CUSTOMER STATES THE RH REAR WHEEL PLASTIC CENTERING HUB IS FRACTURED...ORDER AS REQUIRED.	Not DI
------------------	-----------	-----------	-------------------	----------	------	------	--------	-----	----	---	----------	---	----	--------	----	--------	-----	------	---	---	--------



2006 1FMDK02116G	2-Mar-06	5-Sep-06	POWER FORD TUSTIN	176682F	5K01	*	1007 *	C50	33	2	7-Aug-07	12	11236	0	147.58	147.58	1.6	5414	11236 NVH DIAG FOUND RT LOWER CONTRO L ARM LOOSE 1007D 0.7 3078A 0.6 3001A 0.4 1.7 RETORQ UE RT LOWER ARM CHECK ALIGNME NT TEST DROV CONFIRM TIRE LIGHT ON, RETRAIN SYSTEM AS PER TSB 06 03	C50 OVER BUMPS OR DIPS FRONT END SQUEAKI NG NOISE ALSO WHEN TURNING AT TIMES CLUNKS ADVISE C50 2659 336	Not DI
2006 2FMZA51676B	31-Jan-06	15-Jun-06	MILLER FORD SALES	1023631	5K01	*	1007 *	G29	42	E84	14-Aug-07	15	12857	0	80.18	80.18	0.9	1336	07  LOANER AUTHORI ZED FOR	CHECK FOR TIRE LIGHT ON	Not DI
2006 1FTPW14526F	23-Jan-06	11-Sep-06	VALLEY ISLE MOTORS	371019F	5K01	*	1007 *	L65	82	E84	16-Jul-07	11	17128	0	0	146.09	0	7839	\$146.09	AUTHORI ZED LOANER FOR 3 DAYS PER TAMMY.	Not DI

2005 1FTYR10UX5P	9-Jun-05	20-Aug-05	MAXWELL FORD	791645A	5K01 *	1007 *	N24	42 E84	6-Jul-07	23	14415	0	317.3	317.3	3.8	2923	CC42	14415 NVH DIAG, PINPOINT VIBRATIO N TO FRONT WHEELS TIRES, PERFOR M ROAD FORCE BALANCE ON BOTH FRONT TIRES, WELL WITHIN SPECS, 9 11LBS. REBALAN CED AND RETEST, OK AT THIS TIME. T1147	STEERIN G WHEEL VIBRATIO N SHIMMY ABOVE 45 MPH C S THAT VEH VIB REAL BAD AT SPPED OF 60 70 STEERIN G WHEEL MOVES SIDE TO SIDE	Not DI
------------------	----------	-----------	--------------	---------	--------	--------	-----	--------	----------	----	-------	---	-------	-------	-----	------	------	--	---	--------

S  
 RUNNING  
 ROUND L SPARK  
 POOR PLUG W/  
 CONNEC #7 CYL  
 TION AT STLL  
 #6 OIL MISESS  
 CONNEC ON #6  
 TOR EEC CYL  
 TEST INSTALL  
 PIMPOINT NOID  
 TEST,MO LIGHT ON  
 NITOR #6 CYL  
 ROAD FOUND  
 TEST PIN #2 IN  
 INTERMIT CONNEC  
 TANT TOR 116  
 MISFIRE CIRCUIT  
 ON #6 10125 DG  
 SWAPEE YE WIRE  
 D #6 COIL PULLED CLIENT  
 W CYL #7 OUT OF STATES  
 STILL CONNEC THAT  
 MISSES OT THE  
 ON #6 REFASTE CHECK  
 POWER R PIN ENGINE  
 BLACNE AND LIGHT IS  
 ROAD ROAD LIT AND  
 TEST TEST THE  
 SWAPPE FINAL VEHICLE  
 D 36 CY TEST WA Not DI

2006 1ZVHT82H565 [REDACTED] 3-Feb-06 30-Mar-06 MOSSY FORD 16087501 5K01 \* 1025 \* E29 X2 E84 15-Aug-07 17 11903 0 289.93 289.93 3.3 5428



2005 1FDXF46Y45E	23-Dec-04	29-Dec-04	EXPRESSWAY FORD-M/075591A	5K01	6C3Z	1015 D	N25	2 E84	18-Jun-07	31	28073	477.15	722.81	1199.96	9.9	5142	DRIVESH	AND	WHEELS AND CUSTOMER STATES THE CENTER STORAGE COVER IN THE MIDDLE OF THE DASH IS DELAMINATING. JUSTIN IMAGED DI AUTH	Not DI
2005 1FAHP281X5G	11-Mar-05	24-Mar-05	DON CHALMERS FORD	4496853	5K02	5G1Z	1130 BA	B02	33 E84	20-Aug-07	30	28113	104.2	43.98	148.18	0.5	1487	COVER.	PAA2V	Not DI

VERIFIED  
 CONCERN OF VIBRATION WHILE DRIVING. NVH TESTER SHOWS 1ST ORDER TIRE WHEEL VIBRATION AND 1ST ORDER DRIVE LINE VIBRATION. CHECKED RUNNOUT ON DRIVESHAFT IS OK REINDEXED  
 LL HAS DRIVELINE VIBRATION BALANCE D DRIVESHAFT WITH NVH TESTER. BALANCE BOTH FRONT TIRES AND ALL FOUR REAR TIRES. THERE IS A SEVERE VIBRATION AT 55 MPH (RECENTLY HAD NEW TIRES AND WHEELS CUSTOMER STATES THE CENTER STORAGE COVER IN THE MIDDLE OF THE DASH IS DELAMINATING. JUSTIN IMAGED DI AUTH

2007	2LMDU88C47E	30-May-07	9-Sep-07	PALM SPRINGS FORD I	160358A	5K01	7A1Z	1007 B	N50	42	1	19-Jun-07	0	10	1447.8	133.05	1580.87	1.5	5574	ROAD TEST,FO UND RIMS MAKING CRUNCHI NG NOISE, REMOVE D ONE TIRE AT A TIME WITH STOCK UNIT ((7MX83)) FOUND FOUR WHEEL NOISY, CHECK OASIS (TSB 7 11 14) O,K, S,O,P, DISMOUN D AND T TIRES AND INSTALLE D NEW BANDS F	OR TPS SENSOR S MOUNTE D AND BALANCE D,POST ROAD TEST OK	THERE IS A CRUNCHI NG RUBBING TYPE NOISE WHILE DRIVING SLOW OR HIGH SPEEDS	OK
2008	1FTWW31R78E	12-Jun-07	21-Aug-07	KORUM FORD, INC.	54430801	5K01	7C3Z	1015 E	B65	D4	1	3-Jul-07	0	27	322.01	36.7	358.71	0.4	8651	REPLACED LEFT FRONT WHEEL INSTALLE D NEW WHEELS AND SENSOR S APPROV ED BY PAAMU	WHEEL DISCOLO RED ALL 4 WHEELS HAVE CORROSI ON UNDER CLEAR COAT FINISH	OK	
2007	4M2CU87187K	12-Jun-06	14-Aug-07	COMMERCIAL MOTOR I	056626A	5K01	6E6Z	1007 C	F11	D7	1	14-Aug-07	0	44	1157.6	115.75	1273.33	1.7	4405				OK

2007 2FMDK49CX7E	19-Jun-07	FAMILY FORD, INC.	22005801 5K01 7T4Z 1007 F B65 55 1	27-Aug-07 -1	49 1306.3 58.86 1365.18 0.8 3372	ACES CODE PAALX REPLACE D FOUR WHEELS MOUNT AND BALANCE D SWAPPE D OVER AND PROGRA MED FOUR TIRE PRESSU RE MONITOR S REPLACE 4 TIRE PRESSU RES MONITOR	WHEELS OXIDIZIN G OK
------------------	-----------	-------------------	------------------------------------	--------------	----------------------------------	---	----------------------------

2006 1FMEU62E96Z	26-Sep-05	6-Aug-07 MIDPAC AUTO CENTEF	19399201 5K01 6L2Z 1007 AA B65 D4 1	6-Aug-07 0	54 905.19 150.26 1055.45 1.7 1804	WHEELS WEBBING . DI AUTH PAAWX. REPLACE WHEELS. INSTALL STRAPS FOR TPM SENSOR S. ACTIVAT E SENSOR S. VERIFIED REPAIRS.	WHEELS ARE WEBBING OK
------------------	-----------	-----------------------------	-------------------------------------	------------	-----------------------------------	--	-----------------------------

2007 1ZVFT85HX75	22-Aug-06	12-Apr-07	PHIL SMITH FORD OF F	16818102	5K01	6R3Z	1007 A	B65	81	1	16-Aug-07	5	1718	367.5	24.05	391.55	0.3	4351	REPLACE D DAMAGE D RIM APPROV ED BY DI PAAWT UNDER RO 167495 03 THATS WERE THE RIM WAS ORDERE D	INSTALL SOP DR SIDE FR RIM DI APPROV ED FOR PEELING ISSUE	OK
2007 1FMFK20567L	19-Sep-06	17-Nov-06	APPLE FORD INC	48047301	5K01	7L1Z	1007 D	B65	42	1	13-Jun-07	7	9480	1330.1	170.24	750.15	2.1	84	B65 42 1007 PAAWR MARK SAMPLES REPLACE D 4 RIMS AND WHEEL SENSOR S, REMOUN TED AND BALLENC ED TIRES REPLACE D ALL 4 WHEELS, MOUNT,B ALANCE AND REPLACE ALL 4 TIRE PRESSU RE SENSOR STRAPS PRIOR AUTH#PA A2S	CLICKING TYPE NOISE COMING FROM THE WHEELS, HAPPENS WHEN TURNING OR TORQUIN G THE VEHICLE	OK
2007 2FMDK49C77E	19-Dec-06	5-Jan-07	DON SEELYE FORD, IN	75586601	5K01	7T4Z	1007 F	B65	14	1	10-Aug-07	8	9643	1306.3	126.67	1432.99	1.7	9708		CUST STATES ALL WHEELS ARE CORRODI NG ALONG EDGES	OK

2007 1LNHM82V27Y	20-Dec-06	27-Jul-07	GREENVILLE FORD LIN	1784551	5K02	6W1Z	1130	BA	B65	D4	1	8-Aug-07	1	272	166.6	14.21	180.81	0.2	2484	CENTER CAPS PEELING WHEEL RING HUB CAP WHEEL COVER REPLACE	CUSTOM ER STATES THE BLACK PAINT IS PEELING OFF OF THE CENTER CAPS	OK
2008 1FTSW21R38E	26-Apr-07	31-May-07	HUB CITY FORD, INC.	10947601	5K01	5C3Z	1015	JA	B65	33	1	7-Jun-07	1	293	356.18	80.28	436.46	1.1	6481	33 LOOSE 1012 CHECKE D LEFT REAR LUG NUTS VERIFIED CONCER N REMOVE D AND REPLACE D LEFT REAR STUDS,L UGS AND WHEEL. RR RIM HAS CORROSI ON,PRIO R APPROV AL PAA7S,R PL RIM ASSY AND RPL SENSOR IN RIM	CUST STATES CK LUGS ON ALL RIMS LFT REAR WHEEL LOOSE CK FOR DAMAGE	OK
2007 5LTPW18507F	18-Oct-06	2-Jul-07	LYONS-RYAN FORD SA	106744A	5K01	7L7Z	1007	K	B65	5	1	31-Jul-07	1	623	676.52	66.36	742.88	0.7	1505		B65	OK

2007 1ZVHT88S775	17-Apr-07	9-Jun-07	BRONDES FORD INC.	15872301	5K01	7R3Z	1007 A	B65	D4	1	6-Jul-07	1	715	410.81	22.74	483.55	0.3	3010	INSPECT RIM, FOUND PAINT FROM INSIDE OF RIM ON OUTSIDE REPLACE RIM, MOUNTED & BALANCE D TIRE	CUSTOMER STATES IMPERFECTION IN PSNGR FRONT RIM	OK
------------------	-----------	----------	-------------------	----------	------	------	--------	-----	----	---	----------	---	-----	--------	-------	--------	-----	------	--	---	----

2008 1FTXW43R98E	14-May-07	20-Jun-07	DAHL FORD LA CROSS	149138A	5K01	5C3Z	1007 KA	B65	D4	1	27-Jun-07	1	785	670.1	47.99	718.09	0.6	6209	331 MOUNT RIGHT REAR OUTSIDE TIRE ON NEW RIM BY HAND TRIED TO BALANCE AND THE MACHINE WE HAVE WILL NOT BALANCE IT TOOK IT TO GOODYEAR THEY COULDN'T DO IT, TOOK IT TO FRED'S AND THEY COULDN'T DO IT NALLY HAD IT DONE AT POMPS TIRE	CUSTOMER STATES THERE IS AN IMPERFECTION IN THE RIGHT REAR RIM	OK
------------------	-----------	-----------	--------------------	---------	------	------	---------	-----	----	---	-----------	---	-----	-------	-------	--------	-----	------	--	--	----

2007 2FMDK49C47E	16-Apr-07	27-Apr-07	FULLERTON FORD	6083651	5K01	7L2Z	1007 E	N50	42	1	11-Jul-07	3	1329	866.35	108.41	974.76	1.1	20651	ACE PLATING PITTING PEELING PITTING TIRE(S) OR WHEEL(S) ) REPLACE WPI	CLICKING SOUND FROM WHEELS WHEN TURNING . VERIFIED BY RON. PARTS ORDERE D. CONFIRM WHICH WHEELS ARE CAUSING THE NOISE. CUST THINKS THE R F IS NOISEY AGAIN(BE EN REPLACE D)	OK
2007 5LMFU28527L	21-Feb-07	3-Apr-07	ORCHID ISLE AUTO CE	4010851	5K01	7L7Z	1007 K	B65	D4	1	20-Jun-07	3	1500	1260.8	145.6	1406.41	1.6	7761	PEELING ON THE EDGE S/O/P REPLACE D RIM	BOTH RH FRT & REAR RIMS PLATING PEELING	OK
2006 1FTPX145X6F	30-Nov-05	30-Sep-06	MORROW FORD LINCC	2348601	5K01	7L3Z	1015 B	B65	D4	1	27-Jul-07	11	2005	162.02	20.3	182.32	0.3	7327		B65 CUSTOM ER STATES THE LEFT FRONT RIM IS	OK

2007	4M2EU48847U	16-May-07	6-Jun-07	JACK BYRNE FORD & N353885A	5K01	6L9Z	1007 A	N50	42	1	20-Jul-07	2	2284	1991.3	394.43	2385.7	5.3	20700	TEST VERIFY NOISE REMOVE WHEEL CK OASIS REMOVE ALL WHEELS REBAL WITH NEW WEIGHTS STILL THERE REROAD TEST CALLED HOTLINE REPLACE ALL 4 WHEELS AND SWAP TIRE SENSOR S RETRAIN WHEEL SENSOR	O NOISE	CUSTOM ER STATES LOUD NOISE IN WHEEL AREA CLICKING NOISE WHEN TURNING	TO LEFT OK
------	-------------	-----------	----------	----------------------------	------	------	--------	-----	----	---	-----------	---	------	--------	--------	--------	-----	-------	---	---------	---	------------



ROADTE  
 ST AND WHEEL  
 VERIFY STUDS  
 CONCER PROPERL  
 N COULD Y  
 HEAR INSPECT  
 NOISE WHEEL  
 COMING FOUND  
 FROM BOLT  
 LEFT PATTERN  
 FRONT MISSDRIL  
 WHEEL LED AND  
 AREA NOT  
 REMOVE CENTERE  
 LF D  
 WHEEL CAUSING  
 AND WHEEL  
 INSPECT TO SEAT  
 BRAKES IMPROPE  
 SUSPENS RLY ON CUST  
 ION AND HUB STATES  
 HUB REMOVE HEARING  
 ASSEMBL AND A  
 IES REPLACE CHERPIN  
 REMOUN WHEEL G SOUND  
 T WHEEL MOUNT WHEN  
 FOUND AND SLIGHTL  
 WHEEL BALANCE Y  
 NOT TIRE TO TURNING  
 FITTING NEW TO THE  
 HUB AND WHEEL RIGHT OK

2007 2FMDK39C97E ████████ 1-Mar-07 30-Apr-07 BANKSTON FORD OF F 498277A 5K01 7T4Z 1007 F N58 17 1 3-Jul-07 3 2550 279.17 67.71 346.88 0.8 2441

2007 1FAFP31N17W	17-Nov-06	4-Feb-07	DON CHALMERS FORD	4048051	5K01	4S4Z	1007 AA	C50	42	1	3-Jul-07	5	2744	60.43	123.14	183.57	1.4	1487	TP AT 30PSI, PEROFM RED NVH TEST DRIVE WITH EVA HAD 14 HZ VIB AT 60MPH, BALANCE D ALL 4 WHEELS ON GSP9700, FOUND RIGHT FRONT WHEEL .026 INCH RUNOUT, REPLACE D RF WHEEL AND BALANCE D, RECHEC KED	OPPERAT ION NORMAL	CUSTOM ER STATES ABOVE 40 MPH THEIR IS A VIBRATIO N POSSIBL Y IN TIRES DURING CLEAN UP FOUND RIGHT FRONT WHEEL HAS UNEVEN AREA DI APPROV AL	OK
2007 1ZVHT88S075	6-Jun-07	23-Jun-07	CARL GREGORY FORD	9381801	5K01	7R3Z	1007 A	B65	D4	1	22-Jun-07	0	2992	410.81	46.58	457.39	0.7	2684	RIGHT FRONT RIM HAS A DEFECT REPLACE D RIGHT FRONT RIM		PAAMV	OK

2007 1FMEU74E37U	12-Feb-07	7-Apr-07	EWALD'S VENUS FORC	51486601	5K01	7L2Z	1007 E	N58	42	1	11-Jun-07	3	3204	1395.6	140.32	1535.96	1.7	3774	S	PLASTIC FRTS ON WHEELS REPLACE D 4 WHEELS AND SENSOR BRACKET S, PROGRA MED WHEEL SENSOR	CUSTOM ER STATES A CLICKING NOISE ON ACCELERATION AND TURNIN	OK
2007 2FMDK49C97E	10-May-07	16-May-07	OASIS FORD	1530551	5K01	7T4Z	1007 F	A40	42	1	3-Aug-07	3	3257	410.55	67.53	478.08	0.7	3604	REPLACE D RIGHT REAR WHEEL TIRE(S) OR WHEEL(S) )	REPLACE D RIGHT REAR WHEEL TIRE(S) OR WHEEL(S) )	KEEPS COMING ON SOP RIGHT REAR RIM HOLE IN RIM SEE JAMES	OK

2007 1FAFP31N17W [REDACTED] 21-Aug-06 1-Apr-07 COURTESY FORD 307514C 5K02 6S4Z 1130 A B65 2 1 9-Jun-07 3 3453 90.16 15.43 105.59 0.2 1625 GONE

3453  
ROAD  
TEST  
VEHICLE  
TO  
VERIFY  
CONCER  
N,REMOV  
E HUB  
CAPS  
ROAD  
TEST  
AGAIN  
VIBRATIO  
N  
GONE,RE  
PLACE  
HUB  
CAPS  
WITH  
NEW  
ONES  
AND  
ROAD  
TEST  
AGAIN,VI  
BRATIO N  
GONE

C S ALL  
FOUR  
HUB  
CAPS  
ARE  
BENT OK

2007	2FMDK49C37E	30-Apr-07	19-May-07	CAMPBELL FORD LINC	030458A	5K01	7L2Z	1007 E	N50	33	1	31-Jul-07	3	4020	697.82	107.46	805.28	1.5	2744	4020 ROAD TEST FOR NOISE.C REAKING NOISE IN FRONT WHEELS. REPLACE BOTH FRONT WHEELS, TRANSFE R TIRE PRESSU RE MONITOR SENSOR S ONTO NEW WHEELS. INSTALL NEW VALVE STEMS AND BALANCE BOTH FRONT TIRES.	CUSTOM ER STATES HEARING NOISE IN FRONT PASSAN GER SIDE WHEEL WHEN DRIVING 40 50 MPH	OK
------	-------------	-----------	-----------	--------------------	---------	------	------	--------	-----	----	---	-----------	---	------	--------	--------	--------	-----	------	---	---	----

2007 1FMEU53817U	22-May-07	23-May-07	KRUG HILLTOP FORD-L	1877801	5K01	7L2Z	1007 E	N50	42	1	25-Jul-07	3	4075	697.8	49.92	747.72	0.6	1758	42 1007 VERIFIED CLICKING SOUND WHILE DRIVING. DIAG., FOUND LF WHEEL AND LR WHEEL NOISY. REPLACE D LF AND LR WHEELS AND SENSOR RINGS. ROAD TESTED, VERIFIED REPAIR. REQUES T DIAG TIME TO PINPOINT	CE OF NOISE. 5562	CHECK FOR CLICKING TYPE SOUND, WHILE MOVING, CAN HEAR MORE WHEN SLOWING DOWN,	OK
------------------	-----------	-----------	---------------------	---------	------	------	--------	-----	----	---	-----------	---	------	-------	-------	--------	-----	------	---	-------------------------	---	----

2007 3FAHP06Z67R	4-Sep-06	15-Jan-07	LITHIA FORD LINCOLN	355746C	5K02	7E5Z	1130 A	B65	42	1	2-Jul-07	6	4705	91	16.53	107.53	0.2	3897	4705 HUB CAPS SQUEEKI NG C S SQUEEKI NG NOISE FROM WHEELS VERIYF ON ROADTE ST REMOVE HUBCAP S AND ROADTE ST NO NOISE FOUND TSB 6 21 13 REPLACE ALL FOUR HUB CAPS NVH DIAG.ISO LATE NOISE TO LEFT REAR WHEEL CHROME CLADDIN G.REPLA CED WHEEL & TIRE PRESSU RE MONITOR BAND AND MOUNT.R ETEST AND VERIFY.	CUSTOM ER STATES VEHICLE MAKING A SQUEEKI NG NOISE FROM WHEEL AREA CHECK HUB CAPS MAY BE LOOSEE	OK
2007 1FMEU74E07U	23-Apr-07	27-Apr-07	ROY O'BRIEN, INC.	42164301	5K01	7L2Z	1007 E	N59	42	1	2-Aug-07	4	4957	348.9	85.22	462.12	1	2934	ROTATIO NAL NOISE WHEN DRIVING AND CRUNCHI NG NOISE FORWAR D AND REVERSE	OK	

2007	1MEHM43187G	25-Sep-06	30-Jun-07	CAMPBELL FORD LINC	030670A	5K01	7G1Z	1007 A	B65	D1	1	6-Aug-07	2	5944	1141.8	114.62	1256.4	1.6	2744	VERIFIED CUSTOMER CONCERN. RECEIVED PRIOR APPROVAL FROM DIGITAL IMAGING PAAAR TO REPLACE MOUNT AND BALANCE FOUR NEW WHEELS.	CHECK ALL WHEELS PITTED	OK
2006	1FTPW14506F	12-Oct-05	16-Nov-06	ROBERTS FORD	149814A	5K01	7L3Z	1015 B	B65	D4	1	10-Jul-07	8	6075	520.79	18.29	539.08	0.2	9883	6075 LF & BOTH REAR WHEELS CHROME PEELING 3 MOUNT & BALANCE LF & BOTH REAR WHEELS REPLACE	CUSTOMER STATES DRIVE FRONT WHEEL, BOTH REAR WHEELS CHROME IS PEELING	OK
2007	4M2EU48847U	15-May-07	30-May-07	LAZARE LINCOLN-MER	35032001	5K01	6L9Z	1007 A	B65	42	1	16-Jul-07	2	7023	407.73	55.46	463.19	0.7	10243	VERIFIED CONCERN WITH CLICKING, FOUND LEFT REAR RIM FLEXING. INSTALLED NEW RIM.	CUSTOMER STATES THERE IS A CLICKING IN REAR WHEEL.	OK



2006	1LNHM82V26Y	16-Sep-05	26-Sep-06	CREST LINCOLN-MERC	20681201	5K02	6W1Z	1130	BA	B65	5	1	20-Jul-07	10	8026	166.6	17.79	184.39	0.2	13304	FOUND BLACK COMING OFF HUB CAPS. AUTH PAACN REPLACE D ALL 4 HUB CAPS. REPLACE BOTH LEFT SIDE AND R F HUBCAP S CODE	CUSTOM ER STATES BLACK IS COMMING OFF ALL 4 HUB CAPS CUSTOM ER STATES ALL 4 HUB CAPS CENTER S ARE	OK
2007	2MEFM74V87X	22-Jan-07	17-Mar-07	TOMS RIVER LINCOLN-	3438751	5K02	5W3Z	1130	DA	B65	D4	1	30-Jul-07	5	8027	151.87	18.34	170.21	0.2	10489	PAAMU	FADING	OK
2006	1FTRW12W26F	17-May-06	24-Aug-06	COMMERCIAL MOTOR	055252A	5K01	4L3Z	1007	AB	F11	5	1	21-Jun-07	11	8111	413.28	34.05	447.33	0.5	4405	APPROV ED PAAWV TO REPLACE BOTH FRT WHEELS	ALL FOUR WHEELS HAVE CORROSI ON STARTIN G UNDER CLEAR COAT FINISH	OK
2007	1FTPW14V37K	18-Dec-06	29-Dec-06	BOB ALLEN FORD, INC.	734185D	5K01	7L3Z	1007	J	B65	34	1	6-Jun-07	6	10216	1699.6	67.96	1767.56	0.8	5167	REPLACE D MOUNTE D AND BALANCE ALL 4 TIRES FINISH INPERFE CTIONS	STATE THAT ONE OR MORE WHEELS ARE LOSING AIR AND FINISH ALSO	OK

2008 1FTWW31R78E	25-May-07	HENRY DAY FORD, INC	81242601	5K01	7C3Z	1015 E	B65	12	2	12-Jun-07	-1	4	644.03	51.28	695.31	0.6	3030	D	VERIFIED CONCERN RIMS HAVE A LIP THAT PREVENT CENTER CAPS FROM ATTACHING TO LUG NUTS 1758 R AND R REAR TIRE REPLACE RIMS MOUNT AND BALANCE TWO REAR TIRES QUALITY CHECK	VEHICLE CAME FROM FACTORY WITH TWO REAR RIMS THAT HAVE A LIP WHICH ARE PREVENTING CENTER CAPS FROM INSTALLING	OK
2007 1FAHP34NX7W	23-Oct-06	18-Jul-07 PHIL LONG FORD, LLC	78177901	5K02	6S4Z	1130 B	B65	81	2	20-Jul-07	1	225	90.16	44.95	135.11	0.5	3140	#PAAKN	MT TIME TO REMOVE 4 TIRES & WHEELS TO REPLACE 4 HUBCAPS AND PLASTIC TRIM NUTS DISCOLORED RED APPROVAL	CUSTOMER STATES THAT ALL HUBCAPS ARE YELLOW TINGED POSSIBLE TO SUN DAMAGE, WOULD LIKE REPLACED, CK & ADV	OK

2007 1FAFP38Z47W	17-Oct-06	15-Aug-07	DONLEY FORD-LINCOL	50913701	5K01	5S4Z	1007 BA	B65	81	2	14-Aug-07	0	358	442.76	35.42	478.18	0.5	8287	DI AUTH NUMBER PAAHZ REPLACE D BOTH DRIVERS SIDE FRT AND REAR WHEELS. 502 REPLACE SPARE TIRE RIM APPRV	DRIVERS SIDE FRT AND DRIVERS SIDE REAR WHEEL HAS MARKS IN IT SOME CLEARC OAT COMING OFF. CHECK SPARE TIRE UOTSIDE EDGE IS	OK
2007 1FTWF31P07E	14-May-06	31-May-07	TASCA FORD	438815D	5K01	5C3Z	1007 LA	B65	D4	2	11-Jun-07	1	502	473.54	34.8	508.34	0.4	796	PAAHX LOAD FORCE TIRES FOUND RIGHT REAR RIM OUT OF ROUND REPLACE RIGHT REAR RIM INSTALL NEW LOW TIRE PRESSU RE STRAP APP CODE	VEHICLE HAS A VIBRATIO N AROUND 60 MPH	OK
2007 1FTYR11U27P	29-Nov-06	14-Dec-06	JARRETT-GORDON FOI	10856102	5K01	YL5Z	1015 BA	N25	13	2	11-Jun-07	6	1482	272.13	50.91	323.04	0.7	3781	PAAAX REPLACE D WHEELS FOR PITTING APPROV AL	CUSTOM ER STATES SPOTS ON WHEELS	OK
2007 1FAHP24177G	20-Nov-06	25-Apr-07	IMLAY CITY FORD LINC	2083025	5K01	7G1Z	1007 A	B65	D4	2	31-Jul-07	4	3037	570.89	42.53	613.42	0.5	2672	PAAVU	WHEELS	OK

2007 4M2EU48E97U	28-Feb-07	12-Apr-07	NORTHLAND LINCOLN	3929901	5K01	6L9Z	1007 A	B65	12	2	14-Jul-07	4	3559	1590.1	126.77	1916.86	1.7	10638	REPLACE FOUR WHEELS PER APPROV AL	NOISE LIKE ROCKS INSIDE HUBCAP S	OK
																		4081 PAAZV CP#1007, CC#34 CONFIRM ED CONCER N. FOUND RIM NEAR LUG NUT OPENING SET AT PEELING SET AT FLAKING. 32 PSI. RAN ONE LUG OASIS. NUT DISMOUN LOOKS TED TIRE LIKE IT FROM MIGHT OLD RIM. HAVE MOUNTE BEEN D AND DROPE BALANCE D D OLD DURING TIRE ON ASSEMBL NEW RIM, Y. LUG INSTALLI NUT NOT NG NEW IN	CUST SAYS CHROME FINISH FLAKING ON LEFT REAR WHEEL PART IS HERE	OK	
2007 2FMDK39C07E	20-Oct-06	24-Mar-07	WALNUT CREEK FORD	535019A	5K01	7T4Z	1007 F	B65	D4	2	6-Jun-07	3	4081	283.48	34.76	318.24	0.3	7820	VALVE STOCK.	CUSTOMER STATED RT FRONT WHEEL HAS CHROME DEFECT INDENTE D	OK
2007 1FTPX14V77F	30-Jan-07	21-Feb-07	BROADWAY FORD	17249001	5K01	7L3Z	1007 J	B65	5	2	17-Jul-07	5	9101	427.84	25.25	453.09	0.3	3850	REPLACE RF RIM MOUNT AND BALANCE TIRE	CHECK ALL 4 WHEELS ARE PITTING	OK
2007 5LTPW18507F	26-Oct-06	13-Jan-07	VAN DRISSE LINCOLN	023013C	5K01	7L7Z	1007 K	B65	D4	2	24-Jul-07	7	9327	2520.1	136.36	2656.42	1.7	12505	WPI	PE08-060	1206

2007 1ZVFT85H175	2-Nov-06	14-Nov-06	KRUG HILLTOP FORD-L	1824401	5K01	7R3Z	1007 F	B65	D4	2	10-Jul-07	8	10348	2501.2	66.57	2567.76	0.8	1758	VERIFY ALL FOUR WHEELS PITTING NESS TO REPLACE , DISMOUNT FOUR TIRES AND REMOVE TIRE PRESSURE SENSORS, MOUNT S ON ALL WHEELS AND BALANCE INSTALL TIRES ON NEW FOUR BANDS NEW WHEELS AND WHEELS BRACKET AND S ON REMOUNT FOUR T ON CAR WHEELS SET AND PRESS CHECK FOR REINSTALL TIRE RESET. WHEELS PITTING, INSPECT AND ADVISE. ALL 4 RIMS ARE DISCOLORING. OK
2005 1FMDU77K45U	24-Jun-05	6-Jul-07	VALLEY ISLE MOTORS	370312C	5K01	2L5Z	1007 AA	B65	5 E84	5-Jul-07	0	69	1143.4	80.84	1224.19	0.8	7839	AUTH CODE: PAAYU WHEEL RING HUB CAP WHEEL COVER REPLACE AUTH # PAAJN C S RATTLE NOISE COMING FROM RIMS OF THE VEHICLE OK	
2006 1FTRE14W46D	8-Feb-06	21-Mar-06	OASIS FORD	1402251	5K02	4C2Z	1130 AB	B65	42 E84	19-Jul-07	17	10755	379.81	19.29	399.1	0.2	3604	AUTH CODE: PAAYU WHEEL RING HUB CAP WHEEL COVER REPLACE C S RATTLE NOISE COMING FROM RIMS OF THE VEHICLE OK	

2005	1FAFP36N25W	13-Oct-04	25-Feb-05	JORGENSEN FORD SAI	807502	5K01	4S4Z	1007 AA	B65	5 E84	19-Jul-07	30	12681	235.14	59.93	295.07	0.7	3523	BASIC 1007 CC 05 APP#PAA 8R MOUNT AND BALANCE D BLACK STEEL WHEELS 1 REPLACE ALL CENTER CAPS. AUTH #PAAJV	CUST STATES ALL FOUR 15 INCH BLACK STEEL WHEELS ARE RUSTING B65	OK
2007	1LNHM82W47Y	6-Dec-06	31-Jan-07	GERVAIS LINCOLN-MEI	12840203	5K02	6W1Z	1130 BA	B43	D4 E84	15-Aug-07	7	14501	166.6	17.27	183.87	0.2	13100	14687 DIGITAL IMAGING AUTH# PAADV FOUR WHEEL COVERS INSTALL FOUR WHEEL COVERS DIGITAL IMAGE ACCES CODE PAA7T REPLACE ALL 4 WHEEL COVERS	CUSTOM ER STATES THAT ALL FOUR WHEEL COVERS, THE FINISH IS PEELING OFF	OK
2007	1FAFP34NX7W	30-Sep-06	16-Nov-06	MULLINAX FORD EAST	165167A	5K02	6S4Z	1130 B	B65	42 E84	14-Jun-07	8	14687	90.16	17.15	107.31	0.2	2157			OK
2005	1MEFM50U95A	9-Aug-04	28-Jun-05	HERB CHAMBERS FOR	7682203	5K02	3W3Z	1130 AA	B65	81 E84	20-Jun-07	25	14785	150.7	18.76	169.46	0.2	8828		C S ALL 4 WHEEL COVERS PEELING	OK

2007 1FTSW21P17E [REDACTED] 20-Nov-06 22-Dec-06 CHAMPION FORD KATY526369A 5K01 6C3Z 1007 A B65 2 E84 30-Jul-07 8 15468 719.19 31.5 750.69 0.4 4617 AL PAALU

THAT  
FRONT  
DRIVER  
RIM  
SPLIT  
INSPECT  
ED RIM  
AND  
FOUND  
MAJOR  
SPLIT  
REMOVE  
D TIRE  
FOR  
FURTHER  
INSPECTI  
ON. NO  
OBVIOUS  
IMPACT  
DAMAGE  
TO TIRE  
OR  
WHEEL.  
REPLACE  
D  
WHEEL,  
REMOUN  
TED  
TIRE. DI  
APPROV  
CUSTOM  
ER  
STATES  
THAT  
THE  
DRIVERS  
FRONT  
RIM IS  
SPLIT OK

2007	1FMEU31K67U	2-Mar-06	3-Jul-06	WINDWARD FORD	6078151	5K01	6L2Z	1007	BA	H45	42	E84	18-Jul-07	13	15528	1001.1	169.56	1170.62	1.7	7708	60394.07	528	MILES	PERFORM MED INSPECTION, DI APPROVAL PAAZW, MOUNTED, BALANCED ALL FOUR TIRES, REPLACE TIRE SENSORS, INSTALLED FOUR TIRES AND RECHECKED, DELAY OF SUBMISSION DUE TO SPO, RO	CHECK ALL FOUR RIMS SPIDER WEBBING IN CLAER COAT SPO PARTS IN OK THREE OUT OF FOUR CENTER CAPS ARE LOSING THEIR FINISH WILL REQUIRE DIGITAL IMAGING ADVISE OK
2006	1FTPW14V76K	7-Feb-06	4-Mar-06	HELLER FORD SALES I	18031701	5K02	4L3Z	1130	JA	B65	5	E84	20-Jul-07	17	15544	119.46	15.17	134.63	0.2	20054	782			REPLACE 4 CENTER CAPS	HUB CAPS ARE PEELING OK
2005	1MEFM55SX5A	18-Aug-04	27-Sep-05	NEW HOLLAND FORD	44536803	5K02	3W3Z	1130	AA	B65	D4	E84	3-Aug-07	23	16520	150.7	15.02	165.72	0.2	1360				AUTH # PAA8W REPLACE D 4 HUB CAPS	HUB CAPS ARE PEELING OK



2005 2MEHM75W65X	28-Jun-05	27-Sep-05	SOUTHGATE LINCOLN	70151 5K02	3W3Z	1130 AA	B65	5 E84	16-Aug-07	23	18113	150.69	17.32	168.01	0.2	10671	1130	CONFIRM ED CUSTOM ER CONCER N GOT APROVEL FROM FORD TO REPLACE ALL 4 CENTER CAPS PAAEN REPLACE D 4 CENTER CAPS BASIC #	WHEEL CENTER CAPS OK PER BILL COLLINS. OK
------------------	-----------	-----------	-------------------	------------	------	---------	-----	-------	-----------	----	-------	--------	-------	--------	-----	-------	------	--	--

2005 1FTZR45E95P	5-Aug-04	24-May-05	DONS FORD, INC.	61391301 5K01	2L5Z	1007 AA	B65	5 E84	22-Aug-07	28	19114	1136.6	52.24	1188.87	0.8	582	PAALX .	ALL FOUR RIMS WERE CARROD ED, DISMOUN TED 4 TIRES MOUNTE D AND BALANCE D 4 TIRES ON 4 NEW RIMS. RETORQ UE WHEELS AFTER 50 MILES ACES AUTH CODE	CUSTOM ER STATES ALL FOUR RIMS ARE CARRODI NG. SOP RIMS ARE IN DITIAL AURIZATI ON APPROV ED OK
------------------	----------	-----------	-----------------	---------------	------	---------	-----	-------	-----------	----	-------	--------	-------	---------	-----	-----	---------	---	---

2005	1FMYU93175K	4-Feb-05	14-Feb-05	LIBERTY LINCOLN MER	115162H	5K01	5L8Z	1007 DB	B65	14 E84	6-Jul-07	30	20289	391.44	40.87	432.31	0.5	11000	20289 REPLACE D BOTH REAR WHEELS OKED DIGITAL IMAGING ACES #PAADU	BOTH REAR WHEELS FINISH IS CORRODI NG AROUND CENTER CAPS	OK
2006	1FTWF31P86E	27-Mar-06	31-May-06	NEW HOLLAND FORD	44328601	5K01	5C3Z	1007 LA	B65	D4 E84	17-Jul-07	14	21145	952.64	45.07	997.71	0.6	1360	TARNISH ED NECESSA RY TIME TO GET DIG IMAGE AUTH PAATX AND REPLACE 2 WHEELS APP CODE TO REPLACE ALL 4 WHEELS PAA1Z VERIFY CONCER N AND REPLACE ALL 4 WHEELS	CUSTOM ER STATES PASSEN GER SIDE WHEELS HAVE DULL SPOTS AND FINISH IS FADED	OK
2005	1FMNU40L75E	1-Apr-05	23-Dec-05	JARRETT-GORDON FOI	11104801	5K01	4C3Z	1007 JA	B65	81 E84	13-Aug-07	20	21970	1528.3	72.72	1601.02	1	3781	WHEELS	C S WHEELS CORRODI NG AROUND HOLES	OK

2006 1FTWW31P46E	21-Apr-06	29-Sep-06	NEWBERG FORD MERC	9322901	5K01	6C3Z	1007 A	B65	5 E84	3-Aug-07	11	22092	2859.1	77	2936.14	0	8465	VERIFIED CONCERN. PERFORMED DIGITAL IMAGING PRIOR APPROVAL PROCESS. SUBLET TO TIRE FACTORY TO MOUNT AND BALANCE 4 WHEELS APPROVAL CODE PAA1X WAITING ON WARREN TY APPROVAL REPLACE D ALL 4 HUB CAPS.	CUSTOMER STATES ALL FOUR WHEELS ARE DELIMITING. CHECK AND ADVISE.	OK
2004 1FAFP40614F	13-Apr-04	14-Mar-05	SARAT FORD SALES, I	26674302	5K02	3R3Z	1130 BA	B65	55 E84	25-Jul-07	29	22369	161.34	15.13	176.47	0.2	9137	CUSTOMER STATES LR HUB CAP HAS HAS CORROSION CHECK AND ADVISE CENTER CAP	OK	

2006 1FMYU02Z36K	13-Jun-05	31-Aug-05	DEWEY FORD, INC.	43014701	5K01	6L8Z	1015 C	F25	D4 E84	4-Jun-07	22	24429	341.26	63.41	404.67	0.8	3540	METAL ON WHEELS WERE NOT CORROSION PROTECTED BEFORE PAINTED, CAUSING METAL TO RUST THROUGH H REPAIR ALL FOUR WHEELS PER WARRANTY. AUTHO CODE#PA	CUSTOMER IS CONCERNED THAT HIS WHEELS ARE RUSTING. ALL WHEELS HAVE RUST CORROSION.	OK
------------------	-----------	-----------	------------------	----------	------	------	--------	-----	--------	----------	----	-------	--------	-------	--------	-----	------	---	--	----

2005 1FTSW21P35E	5-Mar-05	24-Mar-05	KORUM FORD, INC.	54803602	5K01	5C3Z	1007 MA	B65	1 E84	9-Aug-07	29	24994	524.65	36.7	561.35	0.4	8651	VERIFIED CRACKS IN WHEEL, SENT PICS. TO D.I. FOR APPROVAL REPAIRMENT APPROVAL CODE PAAPS, REPLACE D WHEEL	LEFT FRONT WHEEL HAS A HOLE IN IT.	OK
------------------	----------	-----------	------------------	----------	------	------	---------	-----	-------	----------	----	-------	--------	------	--------	-----	------	---	------------------------------------	----

2005 1MEFM42115G	31-Jan-05	25-Feb-05	MORROW FORD LINCC	2372601	5K01	7T5Z	1007 A	B65	D4 E84	4-Aug-07	30	25241	1058.8	54.14	1112.93	0.8	7327	B65 VERIFIED WHEELS PEELING. SENT DIGITAL IMAGES TO FORD. FORD APPROV ED REPLAC MENT OF ALL FOUR WHEELS. MOUNT AND BALANCE D TIRES ON NEW RIMS. PEELING REPLACE 4 CENTER CAPS APPROV AL CODE PAALW	CUSTOM ER STATES ALL THE WHEELS ARE PEELING. OK
2005 1FMZU73K35U	18-Aug-04	16-Jul-05	EWALD'S VENUS FORE	51500004	5K02	4L2Z	1130 CA	B65	D4 E84	13-Jun-07	24	26325	124.49	16.51	141	0.2	3774	PREAUTH ORIZED PAAKR TO REPLACE WHEEL COVERS FROM DETERIO RATION. REPL WHEEL COVERS ALL 4 RIMS.	C S THAT ALL FOUR CENTER CAPS ARE PEALING OK
2004 1FTPX14514N	2-Apr-04	25-Oct-04	VAN BORTEL FORD, IN	59614202	5K02	4L1Z	1130 BA	B65	81 E84	3-Aug-07	34	26611	134.01	14.61	148.62	0.2	7590		CORRSO SION ON WHEEL CENTER CAPS ALL 4 WHEELS OK

2005 1FMZU67K25U	15-Nov-04	28-Feb-05	DIFFEE FORD LINC-ME 185326A	5K01	2L5Z	1007 AA	B65	42 E84	8-Aug-07	30	27221	284.16	21.79	305.95	0.3	6835	27221 APPROV AL CODE PAATZ. REPLACE D LEFT FRONT WHEEL. QC9623	25050	CUST STATES LEFT FRONT WHEEL FINISH IS PEELING OFF	OK
2005 1FAFP34NX5W	24-Sep-04	20-May-05	JARRETT-GORDON FOI 11096801	5K01	4S4Z	1007 AA	B65	81 E84	10-Aug-07	28	27445	235.14	50.9	286.04	0.7	3781	APP CODE PAASR VERIFY CONCER N OF ALL 4 WHEELS RUSTING NECESSA RY TO REPLACE WHEELS BREAK DOWN TIRES AND REMOUN T AND BALANCE ALL TIRES INSPOEC T PEELING RIMS, OBTAIN APPROV AL CODE PAA VZ , REPLACE	4 RIMS	C S VEHICLE WHEELS IS RUSTED . ALL 4	OK
2004 5LMFU28R84L	1-May-04	11-Jun-04	ACTON LINCOLN MERC 243015A	5K01	2L7Z	1007 AB	B65	81 E84	23-Jul-07	38	28169	1487.8	107.28	1595.12	1.2	13144	REPLACE D WHEEL AUTH NUMBER PAANV		CUSTOM ER STATES ALL 4 CHROME WHEELS ARE PEELING CUSTOM ER STATES CHROME BUBBLIN G ON RT REAR WHEEL	OK
2006 1FTRW14W86F	26-May-06	1-Jun-06	IMLAY CITY FORD LINC 1969828	5K01	5L3Z	1007 HA	B65	D4 E84	18-Jun-07	13	30549	569.83	25.52	595.35	0.3	2672				OK

2005 1LNHM87A45Y	10-Sep-04	8-Jan-05	CLINTON FAMILY FORE	3706801	5K01	1W6Z	1007 CA	B65	42 E84	26-Jun-07	30	30960	444.92	45.24	490.16	0.6	1142	CK TIRE PRESSU RE, TIRE PRESSU RE LOW, OBTAIN D DI PRIOR APPROV AL R&R RIGHT FRONT WHEEL, RECHEC K 33219 CUST STATES THE TIRE IS GOING FLAT OVER NIGHT. DROP TIRE INTO WATER TANK AND FOUND PINHOLE LEAK IN THE CENTER OF THE RIM. CONTACT DI ACES PAAGN AUTH TO REPL WHEEL. REMOVE EL AND TIRE AND RECHEC REPLACE K FOR WHE LEAKS.	RIGHT FRONT TIRE KEEPS GOING FLAT	OK
2005 1FAFP53U15A	2-Dec-04	6-Dec-04	CHAMPION FORD KATY524806A	5K01	4F1Z	1007 CA	B65	1 E84	10-Jul-07	32	33219	163.21	23.63	186.84	0.3	4617	CS THE TIRE IS GOING DOWN OVER NIGHT.	OK		

2005	1FTZR45E05P	2-Dec-04	15-Apr-05	DONLEY FORD-LINCOL	50911701	5K01	2L5Z	1007 BA	B65	81 E84	13-Aug-07	29	34319	849.03	56.66	905.69	0.8	8287	DRIVERS SIDE FRT AND REAR, PASS SIDE FRT, CLEARC OAT COMING OFF REPLACE D WHEELS PER DI APPR #PAA8Q	CUSTOM ER STATES CLEARC OAT COMING OFF WHEELS. OK
2005	1FTZR45E95P	3-Dec-04	24-Sep-05	DONLEY FORD-LINCOL	50856301	5K01	2L5Z	1007 BA	B65	81 E84	20-Jul-07	23	35074	1132	56.66	1188.7	0.8	8287	REPLACE D ALL 4 WHEELS PER DI AUTH #PAAAW	CUST STATES FINISH COMEING OFF AL 4 WHEELS OK C S RF WHEEL CHROME PEELING NOT ALLOWIN G BEAD TO SEAL OK
2004	1LNHM83W24Y	22-Mar-04	13-Oct-04	BLUEBONNET MOTORS	48044701	5K01	4W1Z	1007 CA	B65	2 E84	15-Aug-07	35	35263	280.28	25.16	305.44	0.3	4570	APPROV AL PAALX . ACES CODE: PAANR INSPECT ED AND CONFIRM ES CUSTOM ERS CONCER NS THAT RIM ARE PEELING AND NEED TO BE REPLACE	CUSTOM ER STATES THAT ALL 4 RIMS ARE PEELING. CUSTOM ER OK
2004	5LMFU28RX4L	13-Oct-03	18-Feb-04	APPLE VALLEY FORD L	63732401	5K01	2L7Z	1007 AB	B65	42 E84	9-Jul-07	42	36215	1384.5	119.56	1504.05	1.2	9217	D.	CUSTOM ER OK



ID	Vehicle ID	Start Date	End Date	Customer	VIN	Model	Year	Make	Model	Color	MPG	MSRP	Actual Price	Trade In	Residual	Commission	Net	Notes	Comments			
2004	5LMEU88H64Z	1-Jul-04	26-Aug-04	HERB CHAMBERS FOR	7968403	5K02	2004	C5Z	1130	AA	B66	81	E84	6-Aug-07	36	36626	212.86	18.76	231.62	0.2	8828	AUTH # PAAZS VERIFY CONCER N. DIGITAL IMAGE PRIOR APPROV AL CODE PAAZS REPLACE ALL 4 CENTER CAPS DUE TO PEELING COROSIO N REPLACE ALL 4 RIMS MOUNT AND BALANCE TIRES REPLACE 4 PEELING AND PITTED RIMS... ACES... CODE....P AALM VERIFIED CONCER N. REPLACE D CENTER CAPS PER DIGITAL IMAGING CODE#PA AHU CUSTOM ER STATES ALL FOUR WHEEL CENTER CAPS ARE EITHER PEELING OR RUSTING OK CUSTOM ER STATES... ...CHECK RIMS ARE PITTED AND PEELLIN G.... CHECK ALL OK
2003	5LMFU28R13	17-Jul-03	30-Sep-03	HEMPSTEAD LINCOLN	74640701	5K01	2003	L7Z	1007	AB	B65	D4	E84	9-Jul-07	46	37170	1539.5	126.3	1665.81	1.2	11208	CUSTOM ER STATES THE CLEAR COAT IS PEELING ON ALL 4 WHEELS. CHECK AND ADVISE. OK
2005	5LMEU68H25Z	26-Jul-05	3-Feb-06	DONLEY FORD LINCOL	11194104	5K02	2005	C5Z	1130	AA	B65	81	E84	27-Jul-07	18	40355	212.86	15.06	227.92	0.2	2263	CUSTOM ER STATES THE CLEAR COAT IS PEELING ON ALL 4 WHEELS. CHECK AND ADVISE. OK

ID	PLATE	DATE	NAME	VEHICLE	VIN	TYPE	CLASS	SEAT	EXPIRES	STATUS	AMOUNT	AMOUNT	AMOUNT	AMOUNT	AMOUNT	AMOUNT	AMOUNT	AMOUNT	AMOUNT	REMARKS	STATUS			
2003	5LMEU78H63Z	13-Mar-03	26-Mar-04	NICK MAYER	LINCOLN-	15501901	5K02	2C5Z	1130	AA	B65	42	E84	10-Aug-07	42	44517	212.86	17.04	229.9	0.2	10705	REPLACE D CENTER CAPS, AUTH PAANN	C STATES ALL 4 CENTER CAPS ARE CORRODI NG	OK
2004	5LMFU28R94L	26-Sep-03	27-Dec-03	DIFFEE FORD	LINC-ME	184994G	5K01	2L7Z	1007	AB	B65	5	E84	2-Aug-07	44	45453	1384.5	87.16	1471.65	1.2	6835	45453 ACESII AUTHORI ZATION CODE PAAVZ. REPLACE D ALL 4 WHEELS. REPLACE D 2 AIR PRESSU RE SENSOR S. BALANCE D TIRES. RETEST OK. QCJC.	CHROME PEELING FROM WHEELS CUSTOM ER STATES ALL TIRES KEEP LOOSING AIR DI AUTH#PA AQX	OK
2004	5LMEU88H94Z	11-Jun-04	30-Jun-04	DEMPEWOLF	FORD LIN	1605751	5K01	2C5Z	1007	AA	B65	42	E84	22-Aug-07	39	47198	924.95	90.02	1014.97	1.1	5668	INSTALLE D NEW WHEELS AND CENTER COVERS WPI	STATES ALL TIRES KEEP LOOSING AIR DI AUTH#PA AQX	OK

2007 2FMDK38C57E	11-Jun-07	27-Jul-07	VARSITY FORD	30436601	5K01	7T4Z	1007 F	B65	D4	2	30-Jul-07	1	316	326.57	59.6	386.17	0.7	2736	316	RIGHT REAR WHEEL CROME BUBBLIN G UP CODE 42 REPLACE D RIGHT REAR WHEEL AND TIRE PRESSURE SENCER BAND ENDING MILES	THE PASSENGER SIDE REAR RIM IS STARTING TO BUBBLE DI AUTH CODE PAAJW OK C S THAT THE RIGHT REAR WHEEL HAS DENT IN IT. OK
2008 1FTNX20508E	30-May-07	13-Jun-07	JOE SARTAIN FORD, IN	24185301	5K01	5C3Z	1015 MA	B65	34	2	18-Jun-07	1	462	222.67	13.86	236.53	0.2	5732	1 REPLACE D WITH NEW WHEEL	733 DID ROAD FORC WHEELS TIRES RT FRT BAD WHEEL HAD TO ORDER 1 RT FRT 56 RT REAR 11 LEFT FRT 5 LEFT REAR 12	N25 VIBRATION ABOVE 45 MPH OK
2007 1FMFU20547L	4-May-07	24-Jul-07	GOLDEN CIRCLE FORD	224679A	5K01	7L1Z	1007 D	N25	D9	2	16-Aug-07	1	733	248.71	77.62	326.33	1.1	5885	REAR 12		

2007	1FTPW14V37F	8-May-07	27-Jul-07	NORTH BROS. FORD, II	205871A	5K01	7L3Z	1007 J	B65	D4	2	17-Aug-07	1	776	425.47	43.5	468.97	0.5	2975	776 CC 42 REMOVE D TIRE REMOVE D RIM, INSTALLE D NEW TIRE, ON NEW RIMT BALANCE D TIRE	LEFT REAR RIM CROME PLATING IS FLAKING OFF	OK
2008	2MEHM75V68X	31-May-07	30-Jun-07	CAMPBELL FORD LINC	029634A	5K01	7W3Z	1007 A	F38	81	2	12-Jul-07	1	1140	202.6	21.49	224.09	0.3	2744	VERIFIED CUSTOM ER CONCER N. CLEAR COAT HAD PEELED FOFF RIM RECEIVE D PRIOR APPROV AL FROM DIGITAL IMAGING AND REPLACE D THE RIM REPLACE D 3 RIM AND ALSO REPLACE D 3 VALVE STEMS	CUSTOM ER STATES TO REPLACE RIM	OK
2006	1LNHM82VX6Y	14-Sep-05	30-Nov-06	GRIFFIN FORD LINCOLN	010462A	5K01	6W1Z	1007 DA	B65	42	2	8-Jun-07	7	1601	1144.4	65.17	1209.54	0.8	6360	REPLACE D ALL 4 CENTER CAPS FOR PEELING	C S THE TOPCOAT ON THE WHEELS IS PEELING CUST STATES CHECK ALL WHEEL COVERS ARE PEELING PI	OK
2007	1LNHM82V27Y	8-Nov-06	11-Apr-07	DICK BARKER, INC.	121094A	5K02	6W1Z	1130 BA	B65	D4	2	7-Aug-07	4	2381	166.6	7.57	174.17	0.1	12210			OK

2007 1FMEU75E57U [REDACTED] 21-Feb-07 18-May-07 SUNSET AUTO CO INC 3702501 5K01 7L2Z 1007 E C50 42 2 18-Jul-07 3 3202 348.9 67.62 416.52 0.7 8198

WHEEL L  
REAR  
PART  
1007  
CODE 42  
R  
TESTED  
PINPOINT  
ED NOISE  
TO LEFT  
REAR  
WHEEL  
AREA.  
WHEEL  
IS  
MAKING  
NOISE.  
ORDERE  
D WHEEL  
AND  
BAND.....  
REPL  
LEFT  
REAR  
WHEEL,  
SENSOR  
BAND LANCED THE LEFT  
AND .....NOIS REAR ON  
VALVE E RIGHT  
STEM, CORREC TURNS  
MOUNTE TED. E C50 OK

2007 5LTPW18517F [REDACTED]	17-Oct-06	24-Apr-07	DONLEY FORD-LINCOLN	50761002	5K01	7L7Z	1007 K	B65	81	2	6-Jun-07	2	3275	1890	92.08	1982.12	1.3	8287	<p>AUTH NUMBER PAAKT 3 OUT OF FOUR WHEELS HAVE PITS OR PEELING REPLACE D BOTH FRT WHEELS AND RT REAR WHEEL NEW WHEELS CAME WITHOUT TIRE PRESSU RE SENSOR S, HAD TO INSTALL NEW SENSOR</p> <p>REPLACE 4 RIMS AND BANDS</p>	<p>CUSTOMER STATES ALL FOUR WHEELS ARE PITCHED OK C STS CK FOR CORROSION ON CENTER CAPS OK</p>
2007 1ZVHT80N7752 [REDACTED]	27-Sep-06	21-Feb-07	TOMS FORD, INC.	398855A	5K01	7R3Z	1007 E	B65	D4	2	17-Aug-07	6	4475	1314.5	157.47	1471.97	1.7	20639	<p>S 4475 REPLACE 4 RIMS AND BANDS WPI</p>	<p>CUSTOMER STATES ALL FOUR WHEELS ARE PITCHED OK C STS CK FOR CORROSION ON CENTER CAPS OK</p>

2007 1FMEU74EX7U	15-Feb-07	14-Apr-07	NORTHGATE FORD, IN	139469A	5K01	7L2Z	1007 E	N59	42	2	20-Jul-07	4	4588	1402.2	244	1646.19	2.9	2663	DEFECT IN WHEELS REPLACE S, INCL PER TRANSFER HOTLINE R ALL TEST SENWOR DROVE S, W VEH NEW HEARD FORD NOISE,C WHEELS, HECKED REINSTA OASIS,SP LLED ON OKE W REAR HOTLINE PUT REGARDI REAR TO NG FRONT NOISE SO FSE FROM COULD WHEELS, DRIVE FORD AGAIN,PE SENT R FSE ENGINEE REPLACE RS TO D ASSESSS REMAINI PROBLE NG TWO CLICKING M,PER WHEELS NOISE FSE,REP INCL FROM LACED SENSOR FRONT BOTH FT ASSYS,R WHILE WHEEL EBAL ALL TURNING OK		
2007 1ZVFT80N075	28-Sep-06	28-Feb-07	BOB GILLINGHAM FORI	157209A	5K01	7R3Z	1007 E	B66	42	2	17-Jul-07	5	6424	470.68	86.9	557.58	1.1	2199	REPLACE BOTH REAR WHEELS AND TRANSFER RED TPM SENSOR S TO NEW WHEELS	BOTH REAR WHEELS ARE CORRODED AROUND CENTER CAP	OK
2007 1FTWW31P57E	21-Nov-06	17-Feb-07	JACK BYRNE FORD & N	354540A	5K02	5C3Z	1130 PA	B65	33	2	3-Aug-07	6	7867	171.2	14.88	186.08	0.2	20700	SSM 19673 PAAFT CHECK AND REPLACE HUBCAP S	CUSTOMER STATES NOISE IN WHEEL AREA	OK

2007 1FTRW12567F	21-Sep-06	24-Nov-06	DAHL FORD LA CROSS 150464A	5K01	7L3Z	1007 H	B65	D4	2	20-Jul-07	8	8634	355.52	56	411.52	0.7	6209	8634 MOUNTED NEW RIM ON RIGHT FRONT. SWAPPED SENSOR FROM OLD RIM TO NEW RIM DIFFERENT CASUAL PART	CUSTOMER STATES THE RIGHT FRONT WHEEL PEELING OK
																		SENSOR BANDS ON NEW WHEELS. MOUNT AND WHEELS BALANCE AND SAME CENTER TIRES CAPS ONTO ALL 4 NEW WHEELS. TRAIN TIRE PRESSURE AND TIRE SENSOR MODULE TO TIRE PRESSURE FROM RE SENSOR PRESSURE S. INSTALL NEW WHEEL CENTER STATES ALL WHEELS PITTED OK	
2007 4M2CU971X7K	9-May-06		ENERGY COUNTRY FO	251203	5K01	6E6Z	1007 C	B65	70 E84	26-Jun-07	-1	20	1010.6	131.56	1142.19	1.7	4517	R	ROAD TEST,



2007	1FMEU31KX7U	12-Apr-06	26-Aug-07	MCCOTTER FORD - ME 210097A	5K01	6L2Z	1007 AA	B65	42 E84	14-Aug-07	0	324	898.47	126.36	1024.83	1.7	4944	SENSOR 4452 RUST AT INTERNA L OR BORDER CAUSE LEAK W .50 DISMOUN T AND MOUNT NEW RIM ALSO BLANCE	CUSTOM ER STATES THE COATING ON THE RIMS IS DEFECTI VE	OK
2005	1FAHP60A65Y	4-Aug-04	28-May-05	WORLD FORD/KENDAL 036365C	5K01	4W6Z	1007 AA	B65	D8 E84	9-Aug-07	27	4452	499.86	24.09	523.95	0.3	4920	CENTER CAPS REPLACE D REAR WHEEL CENTER CAPS DUE TO PEELING CON	AUTH PAAAS STILL LEAKING AIR THROUGH H LEFT REAR TIRE CUSTOM ER STATES BACK GROUND ON CENTER CAPS IS PEELING PLEASE CK AND ADVISE. (RIGHT FRONT AND LEFT REAR)	OK
2005	1MEFM50U75	2-Jul-04	31-May-05	SOUTHGATE LINCOLN 9931251	5K02	3W3Z	1130 AA	F19	5 E84	11-Jul-07	26	4995	75.35	17.32	92.67	0.2	10671	CERN. REPL RIGHT SIDE WHEELS WPI	CHECK RIGHT SIDE WHEEL ARE PEELING	OK
2006	5LTPW18566F	16-Feb-05	25-Mar-05	VAN DRISSE LINCOLN-022731A	5K01	2L7Z	1007 AB	B65	D4 E84	5-Jul-07	28	5043	692.24	48.12	740.36	0.6	12505			OK

2006 3LNHM261X6P	24-Feb-06	27-Mar-06	DONLEY FORD LINCOL	11149301	5K01	6H6Z	1007 BA	B65	81 E84	29-Jun-07	16	5386	474.01	22.59	496.6	0.3	2263	REPLACE D RF WHEEL FOR PITTING. APPROV AL CODE FOR WHEEL REPLACE MENT PAARR	CUSTOM ER STATES PASSEN GER FRONT RIM HAS RUST. REPLACE PER DIGITAL IMAGING	OK
------------------	-----------	-----------	--------------------	----------	------	------	---------	-----	--------	-----------	----	------	--------	-------	-------	-----	------	--	--	----

2006 1FMFU20566L	27-Jul-05	8-Apr-06	SMITH FORD OF LOWE	24470701	5K01	5L1Z	1007 AA	B65	42 E84	8-Aug-07	17	6294	431.45	82.96	514.41	1	1580	VERIFIED LR TIRE LEAK. REMOVE D LR TIRE NO PUNCTU RES IN TIRE. REMOVE D SPARE INSTALLE D SPARE TIRE ON TRUCK CHROME RIM TIRE LOST AIR OVER NIGHT. REPLACE D LR RIM ASM PUT ORIGINAL LR TIRE ON NEW RIM NOW	K. REMOUN TED TIRE ON SPARE RIM, INSTALLE D SPARE.W PI	LR TIRE LOOSES 4 5 LBS OF AIR OVERNIG HT, NO INTRUSIO NS IN TIRE.	OK
------------------	-----------	----------	--------------------	----------	------	------	---------	-----	--------	----------	----	------	--------	-------	--------	---	------	--	---	---	----

2006 1ZVFT82H765	11-Mar-06	28-Jun-06	SAWGRASS FORD	65205803	5K01	F2LY	1A04:A	B65	42 E84	18-Jul-07	13	7219	397.94	170.75	568.69	2.1	4908	MT 1.0 LOCK FROOZE N ON STUD DAMGEE D RIM DURRING REMOVA L TECH 58448 ROAD TEST REMOVE L.R. AXLE SHAFT WITH TIRE AS AN ASSEMBL Y NESS TO HEAT AND CUST STUD OUT OF AXLE REPL RIM AND STUDS	C S THE WHEEL LOCKS WILL NOT COME OFF.SEE JOHN F. NEED ASAP	OK
------------------	-----------	-----------	---------------	----------	------	------	--------	-----	--------	-----------	----	------	--------	--------	--------	-----	------	---	---	----

2004	1FAFP48Y74F	6-Jan-04	7-Aug-04	LANDMARK FORD, INC.667547C	5K01	3R3Z	1007 EA	B65	42 E84	20-Jun-07	35	8280	570	28.91	598.91	0.3	8559	8280 WARRAN TY LEAK TESTED, FOUND AIR LEAKING FROM BEAD. DISMOUN TED TIRE, FOUND CHROME COMING OFF INSIDE OF WHEEL. MOUNTE D AND BALANCE D TIRE ON NEW WHEEL, RETESTE D, OK.	RT REAR WHEEL LOOSING AIR	OK
2005	1MEFM50U25A	16-Aug-04	26-Mar-05	VAN DRISSE LINCOLN-1022724C	5K02	3W3Z	1130 AA	B65	5 E84	5-Jul-07	28	9165	150.7	16.04	166.74	0.2	12505	REPL ALL 4 HUB CAPS WPI	CORROD ED AND PEALING C S WHEEL COVERS CORROD ED AND DELAMIN ATING	OK
2004	1FTRF14W94N	9-Mar-04	4-Sep-04	COLONY FORD, L.L.C. 177590A	5K02	4L1Z	1130 BA	B65	D4 E84	14-Jun-07	34	9565	134.01	17.13	151.14	0.2	1714	CK & INSTALL 4 CENTER CAPS	ATING	OK
2005	1MEFM50U85A	9-Nov-04	2-Jul-05	MORROW FORD LINCC 2271101	5K02	3W3Z	1130 AA	B65	34 E84	28-Jun-07	25	9866	150.7	13.54	164.24	0.2	7327	D B65 VERIFIED CENTER CAPS ARE DISCOLO RED. REPLACE D CENTER CAPS.	CUSTOM ER STATES THE CENTER CAPS ARE DISCOLO RE	OK

2005	1FTZR45E45P	15-Feb-05	18-Jun-05	JOHN LANCE FORD	144995A	5K01	2L5Z	1007 AA	B65	D4 E84	3-Jul-07	25	9927	284.16	25.98	310.14	0.3	2284	9927 REPLACE WHEEL VALVE STEM BALANCE BOTH LEFT SIDE WHEEL CENTER CAPS CENTER IS PEELING OFF REPLACE D BOTH LEFT FRONT AND LEFT REAR WHEEL CENTER CAPS CODE	CUSTOM ER STATES RIGHT FRONT WHEEL CLEAR COAT PEELING	OK	
2004	1FTPW14554K	30-Jul-04	29-Sep-04	DON CHALMERS FORD	4316554	5K02	4L3Z	1130 DD	F06	34 E84	1-Aug-07	35	10587	81.51	17.59	99.1	0.2	1487	42 LABOR	.2 DI AUTH PAAKR	CUSTOM ER STATES LEFT WHEEL LUG COVER SEEMS TO BE PEELING. DI AUTH PAAKR	OK
2006	1LNHM82V66Y	13-Feb-06	22-Mar-06	LINCOLN MERCURY VC	5036701	5K02	6W1Z	1130 BA	B65	42 E84	12-Jun-07	15	10800	83.3	85.06	168.36	0.2	10981	BLACK WAS COMING OFF OF LETTERS ON CENTER CAPS 1130 CODE 42 REPL.BO TH REAR WHEEL CENTER CAPS QC GW	AND LETTERS (PER SCOTT AT DI WHEEL AND CENTER CAPS DO NOT REQUIRE APPROV AL 4 30 07) SOP FROM	0108060 1231 OK	

2006 1FTRF12266N	15-Nov-05	20-Jun-06	BEECHMONT FORD INC	360867A	5K01	4L1Z	1015 AA	B65	81 E84	19-Jul-07	14	10816	162.81	22.39	185.2	0.3	2058	10818	10816 .5 REPLACE D WHEEL	CUSTOM ER STATES THE EDGE OF 1 RIM IS RUSTING, DI APPROV AL TO REPLACE RIM APPROV AL CODE PAAPZ	OK
2006 1ZVHT80N865	28-Nov-05	19-Mar-06	STAR FORD	70454302	5K02	4R3Z	1130 FA	B65	33 E84	24-Jul-07	17	11028	87.2	18.42	105.62	0.2	5537	CAP	REPLACE D CENTER CAP	CUSTOM ER STATES THE REAR CENTER CAP HAS BECOME UNSECU RED	OK
2004 1FTRF14W24N	2-Aug-04	31-Aug-04	NEW COUNTRY FORD,	235310C	5K02	4L1Z	1130 BA	B65	81 E84	20-Jun-07	35	11327	134.01	15.6	149.61	0.2	20551	OXIDIZED 11955 VERIFIED CUST CONCER N ALL WHEELS RUSTED XX MOUNT AND BALANCE D ALL FOUR TIRES ON NEW RIMS	CUSTOM ER STATES: CENTER CAPS APPEARS TO BE OXIDIZED . CHECK	OK	
2005 1FAHP34N55W	4-Jan-05	22-Feb-05	HOLMAN FORD-MOUNT	1380677C	5K01	4S4Z	1007 AA	B65	81 E84	2-Jul-07	29	11955	318.62	61.87	380.49	0.7	1325			CUST STATES ALL FOUR WHEELS RUSTED	OK



2004	5LMFU28R54L	18-Jun-04	15-Oct-04	HEMPSTEAD LINCOLN	74551404	5K01	2L7Z	1007 AB	B65	D4 E84	18-Jun-07	33	14068	692.24	105.26	797.5	1	11208	L F & R R WHEELS PEELING. CHECK WHEELS PEELING. FOUND L F & R R WHEELS PEELING. REPLACE TWO WHEELS, MOUNT & BALANCE TIRES.	CUSTOM ER STATES... ...CHECK LEFT FRONT RIM IS PEELING. .. PLEASE CHECK THE OTHER 3 STEERIN G SUSPENS ION CONCER N N50 CUSTOM ER STATES HEARS SQUEAK WHILE DRIVING LEFT FRONT WHEEL IS MAKING NOISE	OK
2007	1FMFU17577L	22-Nov-06	4-Jan-07	BOB TOMES FORD, INC	63458001	5K01	7L1Z	1007 D	B50	33 E84	12-Jul-07	7	14536	296.11	42.05	338.16	0.5	2531	REPLACE D LEFT FRT WHEEL. SQUEAK.	REPLACE D LEFT FRT WHEEL. SQUEAK.	OK
2006	1FTPX12596F	27-Mar-06	30-Aug-06	ELYRIA FORD	088590A	5K02	4L3Z	1130 JA	B65	42 E84	21-Aug-07	12	15300	111.5	16.6	128.1	0.2	4163	REPLACE ALL 4 CENTER CAPS	REPLACE ALL 4 CENTER CAPS ARE PEELING ALL 4 CENTER CAPS HAVE CORROSION.	OK
2006	1FTPW145X6F	17-Jan-06	31-Mar-06	BOB GILLINGHAM FORI	156023A	5K02	4L3Z	1130 JA	B66	5 E84	11-Jun-07	15	15459	111.5	0	111.5	0	2199	REPLACE 4 CENTER CAPS	REPLACE 4 CENTER CAPS HAVE CORROSION.	1060 1234 OK



2004 1FTYR10DX4P	1-Jun-04	5-Mar-05	L F DONNELL INC	419643A	5K01	YL2Z	1015 AA	F06	D4 E84	28-Jul-07	30	15808	331.24	60.25	391.49	0.8	2220	REPLACE D ALL 4 RIMS FROM PAINT PEELING	CUSTOM ER STATES SILVER PAINT IS PELLING OFF ALL 4 RIMS	OK
2006 1FMYU94136K	11-Oct-05	9-Dec-05	MORROW FORD LINCC	2292001	5K01	6L8Z	1007 A	B65	D4 E84	6-Jul-07	20	15820	1122.1	54.14	1176.22	0.8	7327	B65 VERIFIED ALL WHEELS PEELING. SENT PHOTOS TO DIGITAL IMAGING. THEY APPROV ED REPLACE MENT OF WHEELS. MOUNTE D AND BALANCE D TIRES ON NEW WHEELS AND REPLACE D THE TIRE SENSOR S. LUGS NUTS ARE RUSTING. R&R ALL LUG NUTS.	CUSTOM ER STATES ALL FOUR WHEELS ARE PEELING.	OK
2006 1FTRX14546F	19-Sep-05	15-Mar-06	ULRICH MOTOR CO.	11652101	5K02	6L3Z	1120 BA	F11	30 E84	4-Aug-07	17	16137	279.22	89.88	369.1	1.3	3457		R&R LUG NUTS	OK



2007 1FMEU65E37U	30-Nov-06	4-Feb-07	COURTESY FORD	309550A	5K01	7L2Z	1007 E	B65	33 E84	12-Jul-07	6	16473	603.01	38.59	641.6	0.5	1625	16474 33 ROAD TEST CLICKING NOISE COMING FROM FRONT WHEEL COVERS POOR FIT ON CHROME COVERS ON RIMS REMOVE AND REPLACE FRONT RIMS POST TEST OK 16532 REPL RH REAR WHEEL. TRANSFE R TIRE SENSOR & TRAIN ALL PRESSU RE SENSOR	CUSTOM ER STATES CLICKING NOISE WHEN VEHICLE IN MOTION COMING FROM FRONT WHEELS. INSTALL S O PART AS PER DI AUTH (AUTH# PAA9X) REFER TO RO# 307727	OK
2005 5LMEU88H35Z	20-Jul-05	6-Jan-06	LIBERTY LINCOLN MER	114624A	5K01	2C5Z	1007 DA	B65	14 E84	14-Jun-07	18	16532	388.19	73.57	461.76	0.9	11000	S.  CK OUT REPLACE BOTH RIGHT SIDE RIMS CORRODI NG	CHROME PEELING FROM RIGHT REAR WHEEL CUST STATES BOTH RIGHT SIDE WHEELS CLEAR COAT IS BUBBLIN G NEAR CENTER CAP MUST DI	OK
2005 1FMYU93155K	28-Feb-05	26-Jul-05	BOB GILLINGHAM FORI	155919D	5K01	5L8Z	1007 DB	B66	5 E84	8-Jun-07	23	16534	391.44	47.4	438.84	0.6	2199			OK

2006 1FMFU20546L	6-Sep-05	28-Jun-06	KENNY ROSS FORD	680809B	5K01	5L1Z	1007 AA	B65	D4 E84	21-Jun-07	12	16759	393.31	53.49	446.8	0.7	7350	16759 RF WHEEL PITTING R&R RF TIRE & REPLACE WHEEL & SENSOR ASS BALANCE WHEEL & SET AIR PRESS RECALIB RATE TPM SYS WHEEL COVERS WARRAN TY FOUND ROTATIO NAL SQUEAK NOISE FROM WHEEL COVERS CALLED OASIS, FOUND TSB 6 21 13. PERFOR MED DIGITAL IMAGING PRIOR APPROV AL PROCES S. RECEIVE D APPROV AL, ACES CODE	CUSTOM ER STATES WHEELS PITTING	OK
2006 3FAFP06ZX6R	16-Mar-06	26-Sep-06	LANDMARK FORD, INC.	670853C	5K02	7E5Z	1130 A	B65	42 E84	20-Jul-07	10	16817	91	19.28	110.28	0.2	8559	EPLACED ALL FOUR WHEEL COVERS. RETEST DROVE OK.	ROTATIO NAL NOISE WHEN DRIVING SLOW NEXT TO WALL	OK

2005	1FAFP24165G	29-Oct-04	31-Mar-05	LIBERTY LINCOLN MER	115304A	5K01	7G1Z	1007 B	B65	81 E84	11-Jul-07	28	17063	502.57	49.04	551.61	0.6	11000	17063 REPLACE D BOTH LEFT SIDE FRT AND REAR RIMS	CLEARC OAT PEELING ON BOTH LEFT SIDE WHEELS OK
2005	1FAFP34NX5W	31-Aug-04	7-Dec-04	WOODY ANDERSON FC	5309051	5K01	4S4Z	1007 AA	F25	42 E84	17-Jul-07	32	17154	235.15	53.54	288.69	0.7	5892	REPLACE D ALL 4 RIMS, MOUNT AND BALANCE 4 TIRES	CUST STATES WHEELS ARE RUSTING PREMAT URELY, ADVISE OK
2007	1FAFP53U87A	4-May-06	13-Jun-06	CAL WORTHINGTON FC	35156704	5K01	YF1Z	1007 FA	N24	42 E84	20-Jul-07	14	17358	90.44	124.7	215.14	1.3	8619	TEST DRIVE VERIFY CONCER N PERFRO M WHEEL RUNOUT FOUND LEFT FR WHEEL HAD EXCESSI VE RADI RUN OUT. REPLACE WHEEL AND REBALCA NCE RECHEC K RUN OUT IS OK	C S STEERIN G WHEEL SHAKES WHEN AT 65 TO 70 MPH OK
2006	2FMZA52226B	24-Oct-05	15-Nov-05	TOWN AND COUNTRY I	2528451	5K02	3F2Z	1130 BB	B65	81 E84	12-Jun-07	20	17631	121.02	14.75	135.77	0.2	5755	HUB CAPS BLEMISH ED WHEEL RING HUB CAP WHEEL COVER REPLACE	ALL 4 HUB CAPS ARE BLEMISH ED PE08-000 1239

2006 1ZVFT85H665	31-Oct-05	4-Nov-05	RUSS MILNE FORD, INC	420752	5K01	6R3Z	1007 D	B65	D4 E84	17-Jul-07	21	17890	874.1	68.1	942.2	0.8	2890	PEELING TIRE(S) OR WHEEL(S) REPLACE	CK ALL FOUR WHEELS HAVE FLAWS ON THE SPOKES. OK
																		FAULTY WHEEL PAINT 1.6 M TIME TO STRIP AND PAINT ALL 4 WHEELS DIGITAL IMAGING ACES CODE# PAAKR, BY MARK, RE FINISHED ALL FOUR WHEELS, VERIFIED REPAIR	CUSTOMER STATES THAT ALL FOUR VEHICLES RIMS ARE RUSTED, HAVE BAD APPERANCE OK
2006 3FAFP06Z06P	3-May-06	17-May-06	TERRY HOLMES FORD	5146901	5K01	*	1007 *	B65	81 E84	13-Jul-07	15	17972	19.76	117.87	137.63	1.6	3261	REPLACE ENTER CAPS, OXIDATION ON CENTER CAPS, WAS TOLD NO APPROVAL NEEDED FOR WHEELS,	CUSTOMER STATES FINISH ON CENTER CAPS ARE CORRODING, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING OK PE08-060 1240
2004 1FTRF14514N	14-Apr-04	5-Aug-04	LUNDGREN MOTORS, I	031538A	5K02	4L1Z	1130 BA	B65	5 E84	11-Jun-07	35	18100	134.01	15.4	149.41	0.2	9304	REPL 2 LEFT SIDE CENTER CAPS WPI	
2006 2MEFM75V86X	20-Apr-06	6-May-06	VAN DRISSE LINCOLN-I	023351C	5K02	3W3Z	1130 AA	B65	70 E84	10-Aug-07	16	18305	75.35	16.04	91.39	0.2	12505		

2006	1FAFP31N66W	7-Nov-05	13-Jan-06	LANDMARK FORD, INC.	667675A	5K02	6S4Z	1130 B	B65	42 E84	21-Jun-07	18	18395	22.54	86.74	109.28	0.9	8559	DIGITAL	LEFT FRONT HUB CAP W ROAD TEST FOUND LEFT FRONT HUB CAP TO BE MAKING NOISE. REMOVE HUB CAP AND ROAD TEST NOISE STILL THERE APPLY MORE FOAM TAPE TO HUB CAP NOISE STILL THERE PERFOR M	AGING APPROV AL CODE PAAYV REPLACE LEFT FRONT HUB CAP RETEST CHECKS OK NO NOISE AT THSI	SQUAWK NOISE CONTINU ES AT LEFT FRONT WHEEL WHILE DRIVING CUSTOM ER STATES THERE BUBBLES IN CHROME RIMS RIGHT FRONT, REAR LEFT BOTH BUBBLIN G FROM CENTER PLEASE ADVISE	OK
2005	1FMZU74W25U	23-Nov-04	31-Aug-05	MULLINAX FORD EAST	167373A	5K01	5L2Z	1007 CA	B65	5 E84	26-Jul-07	24	18830	448.78	85.76	534.54	1	2157	18830 ORDERE D RIMS NOW LOCATED AT RR AND LF OF VEHICL			OK	

2004	5LMEU68H44Z	29-Oct-03	19-Dec-03	ISLAND LINCOLN MERC	7912353	5K02	2C5Z	1130	AA	B65	81	E84	14-Jun-07	43	19211	212.86	14.86	227.72	0.2	11643	CENTER CAPS CORRODING REPLACED CENTER CAPS PER DI. CENTER CAPS CONFIRMED CUSTOMER CONCERN REPLACED 4 CENTER CAPS	CUSTOMER STATES ALL FOUR CENTER CAPS ARE CORRODING APPROVAL PAAHW OK
2005	2MEHM75W55X	5-Aug-04	30-Mar-05	SOUTHGATE LINCOLN	9788851	5K02	3W3Z	1130	AA	B65	5	E84	4-Jun-07	27	19264	150.7	17.32	168.02	0.2	10671	REPLACE ALL 4 WHEEL COVERS	REPLACE CENTER CAPS ON ALL FOUR WHEELS OK NOISE COMING FROM WHEEL AREAS OK
2006	3MEFM07ZX6F	1-Feb-06	5-Sep-06	WALLACE LINCOLN-ME	089223A	5K02	7N7Z	1130	A	B65	42	E84	1-Aug-07	12	19500	113.9	15.59	129.49	0.2	10781	VERIFIED CONCERN, REPLACED ALL FOUR WHEELS AND REINSTALLED PRESSURE SENSORS ON NEW WHEELS	WHEELS ARE PITTING AND RUSTING CHECK/ADVISE B65 APPROVAL TO REPLACE ALL 4 WHEELS #PAARV OK
2006	5LMFU28566L	26-Sep-05	12-Oct-05	DOENGES FORD	13817503	5K01	5L7Z	1007	CA	B65	42	E84	30-Jul-07	22	19750	2272	146.41	2418.39	2.1	6820	QC JWP	



2005 1ZVHT82H955	15-Sep-04	19-Nov-04	L F DONNELL INC	418465A	5K01	6R3Z	1007 D	B65	5 E84	16-Jun-07	32	19885	1010.7	60.25	1070.94	0.8	2220	DISMOUNTED 4 TIRES REMOUNT RETURN OLD RIMS TO PARTS CORRECTED CONCERN	CUSTOMER STATES ON ALL 4 WHEELS THE CHROME IS COMING OFF	OK
2005 1FMZU77K85U	3-Feb-05	4-Apr-05	LIBERTY FORD LINCOLN	195460A	5K01	3L2Z	1007 MA	B65	81 E84	13-Jun-07	27	20071	418.57	42.64	461.21	0.5	2222	20071 MOUNTED AND BALANCED 2 PASSENGER SIDE RIMS FOR PITTING.	CUSTOMER STATES WHEELS AND CENTER CAPS ARE CORRODING REPLACE RIGHT FRONT WHEEL AND ALL 4 CENTER CAPS 3	OK
2004 5LMEU68H14Z	21-Nov-03	21-Aug-04	ISLAND LINCOLN MERC	7887856	5K02	2C5Z	1130 AA	B65	81 E84	6-Jun-07	34	20243	212.86	14.86	227.72	0.2	11643	CORROSION	CUSTOMER STATES WHEELS AND CENTER CAPS ARE CORRODING REPLACE RIGHT FRONT WHEEL AND ALL 4 CENTER CAPS 3	OK
2004 1FTRW12W64K	6-May-04	11-Sep-04	BLUEBONNET MOTOR	47218501	5K01	4L3Z	1007 AA	B65	81 E84	28-Jun-07	35	20258	464.24	50.32	514.56	0.6	4570	C S LEFT SIDE RIMS PEELING. R&R BOTH LEFT SIDE RIMS.	FINISH ON BOTH LEFT SIDE RIMS ARE PEELING SOP IS IN CODE	PA 1108-000 1243

2005	1MEFM55S25A	14-Oct-04	21-Oct-04	FERRARIO FORD LINC	027614A	5K02	3W3Z	1130	AA	B65	D4 E84	6-Jun-07	32	20310	75.35	12.95	88.3	0.2	3366	REPLACED LEFT REAR AND RIGHT REAR WHEEL CENTERS BLISTERING	CUSTOMER STATES: LEFT AND RIGHT REAR WHEEL CENTER CAPS BLISTERING	OK
2006	3MEHM07116F	21-Oct-05	24-Feb-06	LANDMARK LINCOLN M	4390501	5K02	6N7Z	1130	AA	B65	81 E84	25-Jul-07	18	20501	90.72	17.48	108.2	0.2	11056	FOUR WHEEL CAPS FOUND REAR RIMS PEELING DISCOLORED RED REPLACE D AND REBALANCE REAR RIMS ALL GOOD WHEELS REPLACE D BOTH REAR WHEELS DUE TO METAL PITTING	REAR WHEELS FADING	OK
2005	1FTPW14575K	22-Jul-05	4-Mar-06	VAN BURKLEO FORD	115415A	5K01	5L3Z	1007	BA	B65	34 E84	8-Jun-07	16	20786	566.47	61.84	628.31	0.8	4241	GOOD WHEELS REPLACE D BOTH REAR WHEELS DUE TO METAL PITTING	REAR WHEELS FADING	OK
2006	3LNHM26196F	13-Mar-06	30-Mar-06	SOUTHGATE LINCOLN	52951	5K01	6H6Z	1007	BA	B65	5 E84	13-Aug-07	17	20939	948.02	43.29	991.31	0.5	10671	CON CERN.	CUSTOMER STATES BOTH REAR RIMS ARE PITTING	OK
2006	1FMYU93146K	7-Dec-05	7-Jul-06	NEMER FORD	017090A	5K01	6L8Z	1007	A	B65	5 E84	3-Jul-07	13	21331	1115.4	114.34	1229.7	1.7	3608	2136 35	CLEAR COAT IS PEELING OFF ALL 4 WHEELS	OK
2007	1MEFM40137G	17-May-06	2-Jun-06	VAN DRISSE LINCOLN	023190A	5K01	7G1Z	1007	B	B65	D4 E84	2-Aug-07	15	21546	251.29	24.06	275.35	0.3	12505	REPL LF WHEEL ASM PEELING WPI	LEFT FRONT WHEEL IS PEELING	OK

2006 3FAFP06Z06R	31-Mar-06	29-Apr-06	METRO FORD AUTO SA	2477752	5K01	6E5Z	1015 BA	H62	D4 E84	1-Aug-07	16	21629	273.06	50.89	323.95	0.8	5977	WHEELS RUSTED TIRE(S) OR WHEEL(S) REPLACE	C S ALL 4 WHEELS HAVE RUST SHOWIN G THREW HUBCAP S CUSTOM ER STATES THE PASSENGER REAR WHEEL IS CORRODI NG	OK
2005 1FMZU77K65U	25-Feb-05	30-Jun-05	MULLINAX FORD NORT	309888B	5K01	2L5Z	1007 AA	B65	42 E84	31-Jul-07	26	21770	284.16	24.17	308.33	0.3	2370	VERIFIED CONCERN,REPLACED WHEEL,R ECHECKED,OK		OK
2005 1FMZU67KX5U	1-Dec-04	15-Dec-04	TOWN AND COUNTRY I	2618151	5K01	3L2Z	1007 MA	F06	81 E84	10-Jul-07	32	22217	823.98	58.99	882.97	0.8	5755	WHEELS DISCOLORED TIRE(S) OR WHEEL(S) REPLACE LIGHT REPAIR NVH ROAD TESTED AND FOUND HUBCAP MAKING NOISE REPLACED ALL FOUR HUB CAPS AND RETESTED	CEHCK ALL FOUR RIM CLEAR COAT PEELING	OK
2006 3MEFM07ZX6R	9-Mar-06	8-Apr-06	ALBUQUERQUE LINCOLN	11868101	5K02	7N7Z	1130 A	L69	42 E84	8-Jun-07	15	22298	113.9	75.28	189.18	0.8	10140		HUB CAPS MAKE A SQUEAKING TYPE NOISE WHILE DRIVING SOP HUB CAP INSTALL	OK

2005 1FTWF33P05E	9-Nov-04	6-Dec-04	EMERLING FORD MERC	6815851	5K01	6C3Z	1007 B	B65	1 E84	26-Jul-07	33	22444	420.1	28.78	448.88	0.4	572	VERIFIED CONCERN AND REPLACED WHEEL TIRE(S) OR WHEEL(S)	CUSTOMER STATES THERE IS A CRACK IN RIGHT FRONT WHEEL BY VALVE STEM CHECK CAUSE: CUSTOMER STATES WHEELS ARE PEELING	OK	
2006 5LMFU28576L	5-Aug-05	10-Oct-06	FAIRWAY FORD LINCO	102466A	5K01	5L7Z	1007 AA	B65	D4 E84	23-Jun-07	9	22445	2575.8	96.07	2671.87	1.2	20050	REPL ALL 4 WHEELS CLOSED BY WPI REPLACED BOTH LEFT SIDE WHEELS AND RIGHT FRONT WHEEL DUE TO PREMATURE CORROSION AROUND CENTER CAP AND SPOKES	CUSTOMER STATES: BOTH LEFT SIDE WHEELS HAVE CORROSION AROUND CENTER CAP AND SPOKES	OK	
2005 1FMZU77K25U	18-May-05	29-Jun-05	NEW COUNTRY FORD,	235604A	5K01	2L5Z	1007 AA	B65	D7 E84	28-Jun-07	25	22607	868.6	62.4	931	0.8	20551	WHEEL REPLACED RIGHT FRONT WHEEL	CK FRONT END/SUSPENSION CUSTOMER STATES THAT FINISH IS FLAKING OFF OF LEFT REAR WHEEL	OK	
2005 1FTRF14W95N	18-Feb-05	19-Mar-05	BLOOMINGTON FORD,	1694401	5K01	4L3Z	1007 AB	B65	42 E84	22-Jun-07	28	22633	221.48	22.56	244.04	0.3	4691	9209	WHEEL REPLACED RIGHT FRONT WHEEL	WHEEL REPLACED	OK

2006	3FAFP06Z46P	25-Apr-06	20-May-06	METRO FORD AUTO SA	2280251	5K01	6E5Z	1015 BA	B65	81 E84	19-Jun-07	14	22650	204.79	50.89	255.68	0.8	5977	STEEL WHEELS ARE RUSTING, REPLACE FRONT AND REAR ON LEFT SIDE AND RIGHT REAR WHEELS TIRE(S) OR WHEEL(S) REPLACE RPL LR WHEEL ASSY,,CHROME	C S PAINT ON WHEELS BEHIND HUBCAPS IS COMING OFF	OK
2003	5LMEU78H43Z	7-Aug-03	30-Sep-03	LYONS-RYAN FORD SA	105749B	5K01	2C5Z	1007 DA	B65	5 E84	21-Jun-07	46	23149	414.65	47.4	462.05	0.5	1505	PEELING CHECKED AND FOUND ALL WHEELS CORRODED AND TIRE S KEEP LEAKING, REPLACE D ALL WHEELS	CROME PEELING OFF 3 RIMS B65	OK
2005	1LNHM87A55Y	12-Aug-04	15-Jul-05	ACTON LINCOLN MERC	242139A	5K01	1W6Z	1007 CA	B65	81 E84	26-Jun-07	24	23339	1779.7	71.52	1851.2	0.8	13144	WHEELS	WHEELS CORRDOED INSTALL SOP	OK

2005 1FTZR15E45P	28-Sep-04	16-Aug-05	KENNY ROSS FORD	683022A	5K01	2L5Z	1007 AA	B65	D4 E84	15-Aug-07	25	23716	1136.6	61.13	1197.76	0.8	7350	23716 REMOVE D TIRES OFF ORIGINAL RIMS. INSTALLE D TIRES ON NEW RIMS. INSTALLE D NEW VALVE STEMS. SPIN BALANCE D NEW WHEELS. 23771 DISMOUN T MOUNT & BALENCE 4 WHEELS DIGITAL IMAGING PRIOR APPROV AL NUMBER	REPLACE ALL FOUR WHEELS (CORROD ING) UTH# PAAKR	OK
2004 1FTPX14584N	28-Jul-04	27-Sep-04	YORK FORD INC	366291A	5K01	4L3Z	1007 AA	B65	68 E84	13-Jun-07	33	23771	928.48	70.02	998.5	0.8	8888	PAAKW	RIMS PEELING	OK

2006	3FAFP06Z66P		24-Jun-06	24-Aug-06	LITHIA FORD LINCOLN	359689A	5K02	7E5Z	1130 A	B65	42 E84	7-Aug-07	12	23791	91	16.53	107.53	0.2	3897	ART 1130	23792 FAILED WHEEL COVERS 20 VERIFIED NOISE FROM WHEELS, REMOVE D WHEEL COVERS AND NOISE WENT AWAY. FOUND IN OASIS TSB 06 21 13. INSTALLE D UPDATED COVERS AS NEEDED. RETESTE D, PASS. CAUSALP	CUSTOM ER STATES SHE CAN HEAR A TICKING NOISE COMMING FROM THE RIGHT FRONT OF VEHICLE AND IT GETS LOUDER WHEN YOU SLOW DOWN	OK
2004	1LNHM86S14Y		2-Sep-03	3-Mar-05	GANLEY LINCOLN-MER	101504A	5K01	4W4Z	1007 EA	B65	5 E84	6-Jul-07	29	23920	2487.5	63.2	2550.72	0.8	10736	23834 DI RIMS REPLACE FOUR RIMS AND BALANCE TIRES	A TICKING NOISE IN PASS REAR WHEN STOPPIN G	OK	

2005 1FTPX14535F	4-Apr-05	23-Sep-05	KRUG HILLTOP FORD-L	1910001	5K01	4L3Z	1007 AB	B65	D4 E84	1-Aug-07	23	24432	833.28	66.57	899.85	0.8	1758	VERIFY ALL FOUR WHEELS DELAMINATING, REPLACEMENT APPROVED REMOVE CENTER CAPS AND UBOLT FOUR WHEELS FROM VEHICLE. DEPRESSER AND REMOVE TIRES FROM RIMS, INSTALL VALVE STEMS FOUR NEW WHEELS OUT OF ROUND RIM, PREAPPROVED, PAAMJ. REPLACE RIM, REINSTALLED WHEEL.	D MOUNT FOUR TIRES, BALANCE AND REINSTALL WHEELS AND WHEELS CHECK WHEELS DELAMINATING	OK
2005 1FTRX14W85F	28-Jan-05	12-Mar-05	VAN BORTEL FORD, IN	59636504	5K01	7L3Z	1015 B	N25	13 E84	7-Aug-07	30	24655	162.02	21.92	183.94	0.3	7590	RIM, PREAPPROVED, PAAMJ. REPLACE RIM, REINSTALLED WHEEL.	CHECK FOR LEFT REAR TIRE HOPPING AROUND 35 45MPH.	OK



2004	5LMFU28R04L	6-Aug-03	23-Dec-03	SOUTHGATE LINCOLN	9813451	5K01	2L7Z	1007	AB	F19	5	E84	11-Jun-07	43	24786	1384.5	103.9	1488.39	1.2	10671	REPLACE WHEELS TIRE(S) OR WHEEL(S) )	CUSTOM ER STATES ALL 4 RIMS ARE PEELING PLEASE CK AND ADVISE. (APPROV AL CODE# P121T)	OK
2005	1FMZU77K85U	24-Aug-04	16-Feb-05	WORLD FORD/KENDAL	036600A	5K01	2L5Z	1007	AA	B65	42	E84	13-Aug-07	31	24851	1143.4	96.36	1239.71	1.2	4920	24851 MT 1.6 H REPLACE D ALL RIMS MOUNT AND BALANCE TIRES SET AIR PRESSU RE TIRES ETC	CUSTOM ER STATES REPLACE ALL RIMS AP #PAAMT	OK
2005	1FTZR15E15P	29-Jul-05	25-Aug-05	JOHN LANCE FORD	145089A	5K01	2L5Z	1007	BA	B65	5	E84	5-Jul-07	23	24859	283.01	25.98	308.99	0.3	2284	24859 REPLACE LEFT REAR RIM MOUNT AND BALANCE VERFIED AND REPLACE D WHEELS COVERS	CUSTOM ER STATES DRIVERS REAR RIM IS BUBBLIN G	OK
2004	1FTRX12W04N	17-Jun-04	11-May-05	DON TESTER FORD LIN	2269602	5K02	4L1Z	1130	BA	B65	42	E84	6-Jun-07	26	25122	134.01	14.82	148.83	0.2	2335	WHEEL COVER IS CORRIDE D	OK	

2005 1FTZR15E65P	27-Aug-04	8-Dec-04	NEW HOLLAND FORD	43899601	5K01	2L5Z	1007	BACIB65	D1 E84	11-Jun-07	31	25356	194.56	22.53	217.09	0.3	1360	L R RIM HAS A PIN HOLE ON IT I SUBMITT ED 2 SETS OF IMAGING AND AM WAITING FOR RESULTS FROM FORD MOTOR CO DIG IMA. REPLACE LEFT REAR RIM AS NEEDED. SOP RIMS AND CENTER CAPS SOP RIMS AND CENTER CAPS CORRODI NG DI NG DI APPROV AL RIMS A	CUSTOM ER STATES F R TIRE LOOSES A FEW PUNDS OF PRESSU RE OVER NIGHT.	OK
2005 5LMEU68H25Z	17-Dec-04	29-Jan-06	ISLAND LINCOLN MERC	8069853	5K01	2C5Z	1007	AA B65	81 E84	2-Aug-07	19	26774	1137.8	81.71	1219.52	1.1	11643	ND CENTER CAPS CORRODI NG DI APPROV AL PAAKU	CUSTOM ER STATES WHEELS ARE CORRODI NG DI APPROV AL PAAKU	OK
2005 1FMYU93165K	4-Feb-05	1-Aug-05	JOHN LANCE FORD	142979A	5K01	5L8Z	1007	DB B65	14 E84	6-Jun-07	23	28175	782.88	69.28	852.16	0.8	2284	CHRIS LOOKED AT ALL FOUR RIMS VERIFIED BUBBLIN G REPLACE D ALL FOUR RIMS AND LOOKS GOOD NOW	CUSTOM ER STATES ALL FOUR RIMS ARE BUBBLIN G AROUND CENTER CAPS	1252

2006	1FMDK05136G	11-Aug-05	9-Dec-05	WENDLE FORD SALES	416932C	5K01	5F9Z	1007 AA	B65	A8 E84	14-Aug-07	21	28198	957.43	64.41	1021.84	0.8	8684	REPLACE D WHEELS DUE TO PITTING	WHEELS ARE PITTING BADLY	OK
2004	1FAFP40624F	21-Apr-04	5-Mar-05	MATHEWS FORD LINCOLN	240751A	5K02	3R3Z	1130 BA	B65	14 E84	26-Jul-07	30	28322	80.67	15.06	95.73	0.2	2265	28322 REPLACE D BOTH REAR CENTER CAPS FOR CORROD ED DIGITAL IMAGE APPROV AL (PAALU) BY MARK SAMPLES	2 CTR CAPS HAVE SURFACE PEELING (BOTH REAR CAPS)	OK
2005	2MEHM75W75X	16-Aug-04	30-Nov-04	SOUTHGATE LINCOLN	9926456	5K02	3W3Z	1130 AA	F19	5 E84	10-Jul-07	32	28961	150.69	17.32	168.01	0.2	10671	WHEEL CENTER CAPS REPLACE 3 WHEEL CENTERS DUE TO PITTING CORROSI ON.	ARE CORROD ED PLEASE CK AND ADVISE.	OK
2003	5LMEU78H83Z	14-May-03	13-Sep-03	NICK MAYER LINCOLN-	15479701	5K01	2C5Z	1007 AA	B65	42 E84	3-Aug-07	48	28966	1137.8	68.14	1205.95	0.8	10705	REPLACE WHEELS PER DITAL IMA	REPLACE D WHEELS APPROV ED FOR REPLACE MENT BY DIGITAL IMAGING AUTH # PAAHX	OK
2007	1FTPW14587F	15-Nov-06	30-Nov-06	OASIS FORD	1436152	5K01	7L3Z	1007 J	B65	14 E84	24-Jul-07	8	29102	2375	135.06	2510.07	1.4	3604	X TIRE(S) OR WHEEL(S) ) REPLACE	4 WHEELS (VINNY PARTS R IN)	OK

2005	1FMZU67KX5U	10-Sep-04	14-Mar-05	MIDLAND FORD LINCOLN	23903504	5K01	2L5Z	1007 AA	B65	D4 E84	6-Jun-07	28	29242	1136.6	60.09	1196.72	0.8	9801	REPLACE FOUR WHEELS AND BALANCE	WHEELS ARE PEELING	OK	
2004	1FTPW14594K	26-May-04	23-Sep-04	PORCARO FORD	64953802	5K01	4L3Z	1007 AA	B65	42 E84	26-Jun-07	34	29422	701.27	68	769.27	0.8	6190	APPROVAL TO REPLACE AFFECTED RIMS ONLY RIMS ARE ON ORDER REPLACE 3 RIMS MOUNT AND BALANCE TIRES AUTH PAA7T PAUL APPLE APPLE SE	CLOSED AT WPI	PAINT FALLING OFF RIMS CENTER CAPS ON WHEELS ARE CORRODING PAINT IS CHIPPING OFF HUBS AND TURNING YELLOW WHEEL COVERS	OK
2004	1FTPF12514N	16-Aug-04	8-Oct-04	FRIENDLY FORD, INC.	149469B	5K02	4L1Z	1130 AA	B65	81 E84	2-Jul-07	34	29831	126.11	17.13	143.24	0.2	2662	29831 REPLACE ALL CENTER CAPS		OK	
2006	1FAHP34N36W	11-Aug-05	23-Nov-05	GRAND TRAVERSE AU	27601301	5K02	6S4Z	1130 B	B65	81 E84	9-Jul-07	20	29899	90.16	14.35	104.51	0.2	9668	REPLACE ALL 4 WHEEL COVERS HOLE IN RIM FOUND A HOLE IN THE RIM, REPLACED RIM LEFT REAR		OK	
2005	2MEHM75W15X	17-Sep-04	24-Feb-05	ISLAND LINCOLN MERC	7928251	5K01	5W3Z	1007 AA	B65	49 E84	19-Jun-07	29	30233	428.92	22.28	451.2	0.3	11643		CUSTOMER STATES WHEEL PITTED LEAKING AIR	08-0001254	

ID	PLATE	DATE	DESCRIPTION	VIN	TYPE	REG	CLASS	EXPIRES	STATUS	REMARKS	STATUS	REMARKS							
2005 1FTPW14545K	[REDACTED]	4-May-05	27-Jan-06 COUNTY MOTOR COMF	19002301	5K01	5L3Z	1007 BA	B65	81 E84	13-Aug-07	19	30327	281.67	20.47	302.14	0.3	944	REPLACE D LEFT FRONT WHEEL 30000 VERIFY CONCERN REPLACE ALL FOUR RIMS	CHK CLEARC OAT PEELING ON LEFT FRNT WHEEL OK
2005 1FMYU92Z75K	[REDACTED]	27-Feb-04	29-Mar-05 JOHN LANCE FORD	145722A	5K01	6L8Z	1015 C	B65	D7 E84	13-Jul-07	28	30653	341.26	69.28	410.54	0.8	2284	RIMS	CUSTOMER STATES WHEELS ARE RUSTING OK CLEARC OAT APPEARS TO BE COMING OFF ALL 4 WHEELS.
2005 2MEFM75W05X	[REDACTED]	31-Jan-05	16-Feb-05 TRI FORD-MERCURY, II	320530A	5K01	3W3Z	1007 AA	B65	5 E84	19-Jun-07	29	30993	1129.6	69.78	1199.4	0.8	8294	ALL 4 WHEELS ARE CORRODED. REPLACE D 4 WHEELS. MOUNT AND BALANCE TIRE ON NEW WHEEL. MOUNT SPARE BACK UNDER TRUCK. CHECK OPERATION OK	...B65 OK
2005 1FTSW21P65E	[REDACTED]	22-Feb-05	16-Mar-05 ULRICH MOTOR CO.	11517701	5K01	5C3Z	1007 DA	B65	1 E84	27-Jun-07	28	31175	383.82	34.57	418.39	0.5	3457	ON OK	CHECK LEAK IN RIM ADVISE OK
2005 1FTPX125X5F	[REDACTED]	28-Apr-05	25-Jul-05 NORTHGATE FORD, IN	139146A	5K01	4L3Z	1007 AB	B65	D4 E84	3-Jul-07	24	31237	833.28	67.31	900.59	0.8	2663	31237 REPLACE D ALL FOUR WHEELS, FINISH WAS PEELING OFF OTHER WHEELS.	ALL FOUR WHEELS FINISH IS PEELING OK

2004	1FTPX14534N	22-Oct-03	17-Sep-04	FERRARIO FORD LINC	028741A	5K02	4L3Z	1130 GA	B65	D4 E84	25-Jul-07	35	31398	151.03	12.95	163.98	0.2	3366	ALL 4 WHEEL CENTER CAPS BLISTERING REPLACED CENTER CAPS	CUSTOMER STATES: ALL 4 WHEEL CENTER CAPS BLISTERING	OK
2005	1FMZU77K25U	14-Jan-05	29-Mar-05	LINDQUIST FORD, INC.	235043A	5K01	2L5Z	1007 AA	B65	D7 E84	26-Jun-07	28	31484	1136.6	56.45	1193.08	0.8	20238	31484 REPLACED ALL FOUR WHEELS, REMOUNTED TIRES	CUSTOMER STATES CORROSION ON ALL FOUR WHEELS	OK
2005	1FTZR15E25P	29-Nov-04	23-Apr-05	ED MULLINAX FORD	267447A	5K01	2L5Z	1007 BA	B65	81 E84	31-Jul-07	28	31693	1138.8	68.22	1242.98	0.8	2283	31693 REPLACED 4X WHEEL, MOUNT & BALANCED OLD TIRES ON NEW WHEELS PER REQUEST. OTHER WHEEL WEIGHTS CENTER CAPS REPLACED ALL 4 CENTER CAPS DUE TO PEELING CONCERN.	CS, CLEAR COAT ON RIMS IS PEELING RIMS ARE PITTING SEE AARON FOR PARTS.	OK
2005	2MEHM75W65X	29-Oct-04	5-Jul-05	SOUTHGATE LINCOLN	9903751	5K02	3W3Z	1130 AA	B65	5 E84	3-Jul-07	25	31757	150.7	17.32	168.02	0.2	10671	N.	CUSTOMER STATES ALL CENTER CAPS ARE PEELING	OK

2004 5LMFU28R64L	10-Oct-03	14-Nov-03	PURVIS FORD, INC.	077624A	5K01	2L7Z	1007 AB	B65	5 E84	18-Jul-07	45	32083	1384.5	97.88	1482.37	1.2	61	CHROME FINISH PEELING OFF FROM INNER EDGES OF ALL 4 WHEELS VERIFY MOUNT AND BALANCE TIRES ON 4 NEW WHEELS	C S, CHROME FINISH PEELING OFF FROM INNER EDGES OF ALL 4 WHEELS 8 SPOKE 18 INCH	OK
2004 2FMDA58224B	24-Mar-04	9-Mar-05	DOWNS FORD, INC.	9082752	5K02	3F2Z	1130 BB	B62	D4 E84	12-Jul-07	29	32200	81.08	17.93	99.01	0.2	20681	PASS FRT AND REAR CAPS PEELING WHEEL RING HUB CAP WHEEL COVER REPLACE REPLACE BOTH REAR WHEEL THAT WERE FLAKING	O S PASS FRONT AND REAR CENTER CAPS PEELING	OK
2004 5LMFU28R44L	30-Jul-04	28-Dec-04	WALLACE LINCOLN-ME	089192G	5K01	2L7Z	1007 AB	B65	42 E84	30-Jul-07	32	32366	692.24	54.57	746.81	0.7	10781		BOTH REAR WHEEL ARE PEALING	OK

2004	1FTRW14W84K	8	20-Dec-03	19-Nov-04	TRI FORD-MERCURY, II	321144A	5K01	7L3Z	1015 B	N27	42 E84	28-Jun-07	32	32527	1049.7	549.54	1599.23	6.3	8294	DIAG VIBRATIO N, SUSPECT DRIVESH AFT, REPLACE , BETTER, BALANCE DRIVESH AFT, CHANGE VIBRATIO N RANGE, SWITCH TIRES FROM NEW TRUCK, OK, REPLACE TIRES, NO HELP, REPLACE WHEELS AND IT IS FIXED	VIBRATIO N IN DRIVELIN E 59 MPH OK
2005	1MEFM55S65A		11-Nov-04	12-Mar-05	LIBERTY LINCOLN MER	115640E	5K02	3W3Z	1130 AA	B65	14 E84	25-Jul-07	29	32701	75.35	16.35	91.7	0.2	11000	32701 REPLACE BOTH RT SIDE HUB CAPS. PAINT WAS PEELING.	CENTER CAPS ARE PEELING OK CHECK WHEELS CORROD ED AROUND CENTER CAPS ON ALL 4 WHEELS OK
2005	1FMYU94165K		27-Apr-05	19-Jul-05	RUSS MILNE FORD, INC	459251	5K01	2L8Z	1007 GA	B65	14 E84	24-Jul-07	25	32849	796.21	68.1	864.31	0.8	2890	PITTED,C ORRODE D TIRE(S) OR WHEEL(S) ) REPLACE	



2004 5LMFU28R94L	13-Feb-04	4-Sep-04	WOODHOUSE LINCOLN	767311	5K01	2L7Z	1007 AB	B65	42 E84	12-Jun-07	34	32850	1384.5	94.68	1479.17	1.2	10670	VERIFIED CONCERN. REPLACE D ALL FOUR WHEELS.	CHROME PLATING COMING OFF WHEELS AND RUBBING ON BACKING PLATES. OK
																			C S LEFT REAR TIRE GOES FLAT EVERY 3 DAYS DISCOUNT SAYS IT S BECAUSE THE FINISH ON THE RIM WHERE THE TIRES BEAD GOES IS FLAKING OFF CK AND REPORT APPROVAL CODE IS PAAXM OK
2004 1LNHM83W24Y	22-Mar-04	13-Oct-04	BLUEBONNET MOTOR	47229601	5K01	4W1Z	1007 CA	B65	13 E84	29-Jun-07	33	33029	280.28	16.77	297.05	0.2	4570	REPLACE D LEFT REAR RIM VERIFY CONCERN FOUND HOLES IN RIM SLIGHTLY ELONGATED CAUSING CENTER CAP NOT TO SIT TIGHTLY	
																			CUST STATES LEFT FRONT CENTER CAP RATTLES OK
2004 1FTNW21P64E	3-Dec-03	23-Dec-04	MCPMAHON FORD	12113005	5K01	4C3Z	1007 AC	B65	16 E84	12-Jun-07	31	33382	491.81	37.99	529.8	0.4	4166		

2004	1FTPX14594K	1-Sep-04	26-Oct-04	BEECHMONT FORD INC	359287E	5K02	4L1Z	1130	BA	B65	33	E84	18-Jun-07	33	33599	100.51	14.93	115.44	0.2	2058	33599 REPLACE D CENTER CAP 1007 42 B65 VERIFY CONCER N. REPLACE RH REAR WHEEL, INCLUDE S TRANSFE RING TIRE PRESSU RE MONITOR SENSOR AND BALANCI NG THE COMPLET E ASSY. ROAD TEST TO VERIFY TPM SYSTEM FUNCTIO NING PROPERL	CUSTOM ER STATES RIGHT FRONT CENTER CAP IS PEELING OK
2004	1FMZU75W24Z	27-Aug-03	4-Oct-04	LINDQUIST FORD, INC.	233915B	5K01	3L2Z	1007	KA	B65	42	E84	11-Jun-07	33	33701	315.62	35.28	350.9	0.5	20238	Y. G	RIGHT REAR RIM CRACKIN G OK

2005	1FAFP34N25W	20-Apr-05	5-May-05	AUFFENBERG FORD, IL	142248D	5K02	5S4Z	1130	AA	N59	33	E84	25-Jul-07	28	33833	48.3	99.4	147.7	1.1	8017	DIAG TICK FOUND,T NOISE EST WHEN DRIVE DRIVING, WITH DRIVE CUST TO ON PINPOINT STREET NOISE.N AND IN OIOSE IN PARKING LEFT LOT TO FRONT CONFIRM WHEEL NOISE,RA VARYS ISE ON WITH HOIST TIRE AND SPEED,R INSPECT EMOVE SUSPENS WHEEL ION,STEE COVER RING AND AND TEST TIRES.IN DRIVE SPECT NOISE TIRES GONE,IN FOR SULATE SCREWS COVER AND LUGS FLAT WITH SPOTS TAPE NO AND CONCER TEST	LOUD TICKING NOISE HEARD FROM FRONT DRIVERS SIDE TURN LEFT GOES AWAY RIGHT IT GETS LOUDER AND INCREAS ES WITH SPEED PAINT FALLING OFF CENTER CAP ON L S B65	OK
2006	2MHFM75V76X	29-Mar-06	21-Apr-06	LYONS-RYAN FORD SA	106145A	5K02	3W3Z	1130	AA	B65	5	E84	9-Jul-07	15	33836	80.73	18.96	99.69	0.2	1505	RPL 2 CENTER CAPS,PE ELING  REPLAXC ED ALL 4 CENTER CAPS REPLACE D CENTER CAPS FOR PEELING FINISH	OFF CENTER CAP ON L S B65 REPLACE ALL FOUR CENTER CAPS FINSH STARTIN G TO COME OFF AUTH # PAA7N	OK
2004	1FTPX14574F	22-Sep-04	4-Oct-04	VARSITY FORD	30552201	5K02	4L1Z	1130	BA	B65	D4	E84	15-Aug-07	35	33866	134.01	17.03	151.04	0.2	2736			

2003	5LMEU88H93Z	26-Feb-03	9-Sep-03	ELMHURST LINCOLN-M	6551751	5K02	2C5Z	1130	AA	B65	D7 E84	14-Aug-07	48	34221	228.06	19.95	248.01	0.2	13660	VERIFY AND REPLACE ALL FOUR WHEEL COVERS	CUSTOMER, ALL 4 WHEEL COVERS ARE CORRODED	OK
2004	1FTPW14564K	4-Jun-04	21-Dec-04	ED MULLINAX FORD	267004C	5K02	4L3Z	1130	DD	B65	81 E84	20-Jul-07	32	34271	81.51	17.05	98.56	0.2	2283	34271 ORDERED LEFT SIDE CENTER CAPS PER ASM 9. WILL CONTACT CUSTOMER WHEN THEY ARRIVE REPELLED TWO LEFT SIDE CENTER CAPS DUE TO PEELING	CHECK CENTER CAPS ON LEFT SIDE OF VEHICLE (FRONT AND REAR) ARE PEELING.	OK
2005	1FTYR44U25P	13-Jan-05	26-Mar-05	ROBERTS FORD	149222A	5K01	3L5Z	1007	AA	B65	34 E84	11-Jun-07	27	34506	627	45.73	672.73	0.5	9883	34506 BOTH REAR WHEELS PEELING ON EDGES REPLACE BOTH REAR WHEELS 2 MOUNT & BALANCE	BOTH REAR WHEELS ARE PEELING ALONG EDGES OF WHEELS	OK

2005	1FMDU74W75Z	6-Jan-05	22-Jan-05	BEECHMONT FORD INC	361025C	5K01	5L2Z	1007 CA	B65	D7 E84	23-Jul-07	31	34957	740.45	89.57	830.02	1.2	2058	35194 CHECK FOR WHEEL AT CENTER CAPS AREA RUTSING REPLACE RF WHEEL AND RR WHEEL AND LR WHEEL HAD TO INSTALL TIRE SENSOR ON LR WHEEL WAS UNABLE TO REMOVE SENSOR FROM OLD WHEEL	CHECK FOR WHEEL AT CENTER CAPS AREA RUSTING OK CUSTOM ER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE OK CUST STATES THAT 2 WHEEL CENTER CAP LOGOS ARE PEELING OK
2005	2MEFM75WX5X	27-May-05	12-Jun-05	LUNDGREN MOTORS, I	032535D	5K02	3W3Z	1130 AA	B65	D4 E84	24-Jul-07	26	35238	75.35	15.4	90.75	0.2	9304	REPLACE D 2 CENTER CAPS	THAT 2 WHEEL CENTER CAP LOGOS ARE PEELING OK
2004	1FTRF14W24N	8-May-04	7-Aug-04	LITHIA FORD LINCOLN	353245A	5K02	4L3Z	1130 DD	B65	D4 E84	8-Jun-07	35	35294	81.51	16.53	98.04	0.2	3897	35294 0 INSTALLE D 2 CENTER CAPS (#72402)	PEELING OK PE08-060 1263

2005	1FMYU03175K	22-Jun-04	31-Jan-05	JOHN LANCE FORD	149304E	5K01	5L8Z	1007 DB	B65	42 E84	27-Aug-07	32	35395	782.88	69.28	852.16	0.8	2284	35395 REPLACE 4 WHLS	CUSTOMER STATES WHEELS ARE BUBBLING	OK
2004	5LMFU28R34L	16-Jan-04	21-Jul-04	BUSS FORD SALES	1336371	5K01	2L7Z	1007 AB	N50	5 E84	5-Jun-07	35	37239	741.69	62.21	803.9	0.7	1857	REPLACE BOTH FRONT WHEELS. PLATING SEPERATING FROM BACK SIDE OF WHEELS. REPLACE CENTER CAPS	C/S ROTATIONAL NOISE PASSENGER FRONT. CENTER ARE PEELING	OK
2004	5LMEU88H34Z	17-Nov-03	19-Jul-04	HAMMONASSET FORD,	511902	5K02	2C5Z	1130 AA	B65	5 E84	23-Jun-07	36	38238	212.86	19.17	232.03	0.2	3617	DIGITAL IMAGE APPROVED REPLACE D 4 WHEEL CENTER CAPS CONFIRMED WHEELS DELAMINATING, MOUNTED 4 NEW WHEELS	CUSTOMER STATES WHEEL CENTER CAPS PEELING, DIGITAL IMAGE APPROVED REPLACE 4 CENTER CAPS	OK
2004	5LMEU88HX4Z	26-May-04	15-Oct-04	SUNSHINE FORD LINC	10624801	5K02	2C5Z	1130 AA	B65	D4 E84	24-Jul-07	34	40121	212.86	17.9	230.76	0.2	3605		WHEELS DELAMINATING	OK
2006	5LTPW18586F	27-Jun-05	13-Dec-05	KRUG HILLTOP FORD-L	1740901	5K01	2L7Z	1007 AB	B65	D4 E84	20-Jun-07	19	44417	1384.5	66.57	1451.06	0.8	1758			OK

2004 5LMFU28R94L	19-Dec-03	23-Feb-04	SOUTHGATE LINCOLN	9907851	5K01	2L7Z	1007 AB	F19	5 E84	5-Jul-07	41	48950	692.24	60.61	752.85	0.7	10671	WHEELS REPLACE D RIGHT AND LEFT FRONT WHEELS DUE TO PEELIN	G CONCER N.	CUSTOM ER STATES DRIVERS FRONT AND PASSEN GER RIMS ARE PEELING PLEASE CK AND ADVISE.	OK
------------------	-----------	-----------	-------------------	---------	------	------	---------	-----	-------	----------	----	-------	--------	-------	--------	-----	-------	--	-------------------	---	----

2004 5LMFU28R24L	1-Dec-03	29-Dec-03	KRUG HILLTOP FORD-L	1668301	5K01	2L7Z	1007 AB	B65	D4 E84	4-Jun-07	42	49234	1384.5	99.85	1484.34	1.2	1758	D7 1007 P02JN VERIFIED NOISE IN LF. DIAG., FOUND CHROME PEELING ON ALL 4 WHEELS. REPLACE D ALL 4 WHEELS. VERIFIED REPAIR.		LEFT FRONT WHEEL NOISY WHILE DRIVING	OK
------------------	----------	-----------	---------------------	---------	------	------	---------	-----	--------	----------	----	-------	--------	-------	---------	-----	------	---	--	---	----

2005 5LMFU28555L	17-Dec-04	12-Jan-05	KRUG HILLTOP FORD-L	1845801	5K01	5L7Z	1007 AA	N50	D4 E84	16-Jul-07	31	49635	1704	99.86	1803.84	1.2	1758	VERIFIED NOISE WHILE DRIVING FOUND THREE RIMS CROME DELAMIN A TING CROME FALLING APART REPLACE BOTH LT SIDE RIMS AND RT REAR RIM VEHICLE NEEDS TIRES AT 3 32 CUSTOM ER DECLINE	NOISE LEFT FRONT BRAKES	OK	
2007 1FMEU63E27U	15-Jun-07	16-Aug-07	LONG-LEWIS FORD	41133501	5K01	7L2Z	1007 A	B65	17	1	26-Jul-07	0	14	224.61	23.85	248.46	0.3	225	WHEEL NOT SEATING ON HUB DUE TO WHEEL NOT MACHINE D PROPERL Y TECH 9907 REPLACE D RIGHT REAR WHEEL	STATES THERE IS A VIBRATIO N AND LEFT REAR WHEEL IS WOBLIN G	OK ATF



2007 1FTRX14W97F	8-Aug-06	19-Jun-07	EMERLING FORD MERC	6616151	5K01	7L3Z	1015 B	N25	2	2	8-Jun-07	0	31	844.26	122.33	966.59	1.7	572	VERIFIED CONCER N AND PERFOR MED DIAGNOS IS, REPLACE D ALL WHEELS AND AIR MONITOR ING BANDS 42705 CONDITI ON D1 PERFOR MED LEAK CHECK FOUND AIR LEAKING THROUG H RIM. REPLACE D RIM AND RECHEC KED.	CUSTOM ER STATES ON ROAD TEST THERE WAS A VEBRATI ON AT 45 MPH	OK atf
2006 3FRNF65F86V	21-Mar-06	16-Jun-06	GATOR FORD TRUCK	S091460A	5K01	4C4Z	1007 BB	B65	D1	2	24-Jul-07	14	42705	131.82	55.74	187.56	0.7	4917	C S LEFT FRONT RIM IS DEFECTI VE WILL NOT SEAL PROPERL Y.....B65	Out of Warr	

2006	3FRWX65EX6V	16-May-05	12-Sep-05	RUSTY ECK FORD, INC	32460004	5K01	4C4Z	1007 DA	N25	42	2	5-Jul-07	23	90283	338.38	225.28	563.66	1.4	5319	D FRONT WHEEL BEARING S AND FOUND THEY ARE A LITTLE LOOSE. ADJUSTED FRONT WHEEL BEARING S. SPUN THE WHEELS AND CHECKED FOR WHEELS WOBBLING. ABOUT 18 OF WOBBLE. JACKED UP THE REAR AND CHECKE	D FRONT WHEEL BEARING S AND FOUND THEY ARE A LITTLE LOOSE. ADJUSTED FRONT WHEEL BEARING S. SPUN THE WHEELS AND CHECKE ALSO. RAN THE TRUCK ON JACK STANDS AND WITH TIRES THE WHEELS AND DRUMS OFF TO CHECK THE	EEL BEARING S AND THEY WERE OK. THE WHEELS WOBBLING ON THE REAR REPAIR FOR THE TRUCK SHIMMING AT 65 MPH TIRES HAVE BEEN BALANCE D AND THE FRONT	Out of Warr
																				7624	INSPECT WHEELS. SUBMIT DIGITAL IMAGE PHOTOS. ALL FOUR WHEEL CHROME IS PEELING. APPROVAL CODE PAACZ. REPLACE D ALL 4 RIMS. BALANCE WHEELS	FINISH ON WHEELS IS	
2004	1LNHM83W24Y607252	8-Aug-03	15-Dec-03	NORTHGATE FORD, IN	139294C	5K01	4W1Z	1007 AA	B65	D4 E84		11-Jul-07	44	7624	2183.3	67.31	2250.64	0.8	2663	WHEELS	PITTSBURGH	Out of Warr	

2004 2MEFM74W74X	13-Feb-04	30-Jul-04	JIM CLICK FORD, LINCC	50060403	5K02	5W3Z	1130 AA	B65	33	E84	18-Jul-07	37	13183	37.3	0	37.3	0	20402	1 INSTALLE D NEW CENTER CAP	CUSTOM ER STATES LEFT REAR HUB CAP WONT STAY ON ADVISE B65	Out of Warr
2004 1FTPW14514K	29-Apr-04	14-Jul-04	HELLER FORD SALES I	17984501	5K02	4L3Z	1130 DD	B65	5	E84	2-Jul-07	37	15044	174.66	15.17	189.83	0.2	20054	TECH 676 REMOVE D AND REPLACE D ALL 4 HUBCAP	ALL FOUR WHEEL COVERS ARE DISCOLO RED AND THE FINISH IS COMING OFF WILL REQUIRE DIGITAL IMAGING ADVISE	Out of Warr
2004 1FAFP33P44W	11-Dec-03	30-Jun-04	BOB TOMES FORD, INC	63296203	5K01	E83Z	1012 A	B65	1	E84	22-Jun-07	37	16738	0.97	42.05	43.02	0.5	2531	REPL. WHEEL STUD & NUT	STUD BAD ON DRIVERS FRONT WHEEL H26	Out of Warr

2004 2MRDA20204B	28-Jan-04	28-Jun-04	CAMPBELL FORD LINCOLN	028363A	5K01	*	1007	*	G29	42	E84	11-Jun-07	36	17392	0	35.82	35.82	0.5	2744	SUSPECT	ROAD TEST, VERIFY LOW TIRE WARNING LIGHT STAYS ON. CHECKED TIRE P.S.I. RIGHT FRONT DOWN 8LBS. ALSO CHECKED TIRE OUTER DIA. BOTH FRONT TIRES WORN 5.50MM MORE THAN THE TWO REAR TIRES.	IRE AIR LEAK IN RIGHT FRONT AND FRONT TIRE WEAR TOGETHER MAY CAUSE THE LOW TIRE WARNING LIGHT TO STAY ON...	CHECK TIRE LIGHT ON AGAIN	Out of Warr
2004 1FMZU74K44U	26-Jan-04	16-Jul-04	FAIRLANE FORD SALES	223774C	5K01	2L2Z	1007	CA	B65	5	E84	26-Jun-07	36	19780	832.27	103.1	935.37	1.2	3050	19784 42 1007 REPLACE 3 WHEELS FOR PEELING 20025 REPLACED CENTER CAPS ALL 4 PERFORM DIGITAL IMAGING AUTH	B65 ALL 4 WHEELS PAINT BUBBLING AROUND CENTER CAP .5 45.00	Out of Warr		
2004 1FAFP406X4F1	4-Feb-04	7-Jun-04	YORK FORD INC	366065D	5K02	3R3Z	1130	BA	B65	68	E84	7-Jun-07	37	20025	161.34	17.5	178.84	0.2	8888	#PAACN	CHECK RIMS PEELING	Out of Warr		

PE08-060 1270

2004 1FAFP52U24G	3-Nov-03	18-Aug-04	ABLE FORD, INC.	271665B	5K02 *	1130 *	N11	42 E84	11-Jul-07	36	20858	0	74.25	74.25	0.7	9893	20858 ROAD TEST AND VERIFY CONCER N, NOISE COMING FROM HUB CAP, REMOVE HUB CAPS AND INSTALL DEADENI NG MATERIA L AS PER TSB 05 25 01 TIME 0.8 HOUR OP 052501A BASIC 1130 CD	CUSTOM ER STATES THAT THERE IS A SQUEEKI NG NOISE FROM THE PASSEN GER SIDE FRONT END MORE SO AT A SLOWER SPEED	Out of Warr
------------------	----------	-----------	-----------------	---------	--------	--------	-----	--------	-----------	----	-------	---	-------	-------	-----	------	--	--	-------------

2004	1FMDU74W54Z	12-May-04	24-Aug-04	DONS FORD, INC.	61392501	5K01	2L2Z	1007 CA	B65	5 E84	22-Aug-07	37	21329	832.27	78.36	910.63	1.2	582	DISMOUNTED THE 3 TIRES AND REPLACED BOTH FRONT AND THE ONE REAR RIM, SWAPPED PRESSURE VALVE STEMS AND MOUNTED AND BALANCED THE TIRES, ALL OK AT THIS TIME CUSTOMER STATES THAT BOTH FRONT RIMS AND THE RIGHT REAR RIM IS CORRODED, SOP RIMS ARE IN, DIGITAL AUTHORIZATION APPROVED CUSTOMER STATES WHEEL CENTER CAPS ARE OXIDIZING CENTER CAPS ARE PEELING	Out of Warr
2004	1LNHM86S74Y	13-Nov-03	12-Feb-04	DAYTONA LINCOLN ME	11066602	5K02	3W4Z	1130 DA	B65	30 E84	13-Aug-07	43	21609	171.58	15.13	186.71	0.2	10378	REPLACE ALL FOUR CENTER CAPS REPLACE HIUB CAP	Out of Warr
2003	1LNHM81W53Y	30-Apr-03	13-Aug-03	NORTH SHORE L-M INC	181607D	5K02	4W1Z	1130 BA	B65	42 E84	5-Jun-07	47	24242	143.64	16.79	160.43	0.2	10004	REPLACE HIUB CAP	Out of Warr

2004 1FTPW14554F	17-May-04	3-Sep-04	WILLEY FORD - BOUNT	60289202	5K02	4L3Z	1130	DD	B66	81	E84	16-Aug-07	36	25187	40.75	8.63	49.38	0.1	3028	JP1626	1 INSTALLE D NEW CENTER CAP	GUEST STATES:L UG CAP ON DRIVERS SIDE FRONT IS FADING CHECK AND ADVISE	Out of Warr
																					FOUND TWO CENTER CAPS FINISH PEELING OFF. TOOK PICTURE S AS PER FORD PRIOR APPROV AL. APPROV ED PAANU. REMOVE D AND REPLACE D CENTER CAPS.	CUSTOM ER STATES ALL FOUR CENTER CAPS ARE DISCOLO RED AND THE PAINT IS CRACKE D AND PEELING.	
2004 1FTPX14524N	12-May-04	26-Jun-04	DAVIES FORD	12636503	5K02	4L3Z	1130	DD	B65	5	E84	5-Jun-07	36	25398	81.51	14.09	95.6	0.2	7329				Out of Warr

2004	1FMPU16L24L	17-Mar-04	31-Aug-04	HOLMAN FORD-MOUNT	1383121A	5K02	4L1Z	1130 BA	B65	81 E84	16-Aug-07	37	25712	181.58	17.68	199.26	0.2	1325	25712 CC81 VERIFIED CENTER CAP DELAMIN ATING ON PREVIU S RO X HAD DIGITAL IMAGING APPROV AL X REPLACE D 4 CENTER CAPS	INSTALL SOP WHEEL CAPS	Out of Warr
2004	1FAFP42R34F	30-Sep-03	12-Aug-04	ROSEMURGY MOTORS	20956001	5K01	3R3Z	1007 AA	B65	42 E84	23-Jul-07	36	25926	985.07	63.65	1048.72	0.8	6366	APPROV ED TO REPLACE WHEELS PER CODE LACK OF CORROSI ON PROTECT ION ON WHEELS. WPI		Out of Warr
2005	1FTPW14515K	20-Sep-04	1-Oct-04	DONS FORD, INC.	61254401	5K02	5L3Z	1130 S	B65	5 E84	17-Aug-07	36	26057	44.02	13.06	57.08	0.2	582	VERIFIED CONCER N AT LAST VISIT REMOVE D AND REPLACE D BOTH RIGHT SIDE CENTER CAPS	CUSTOM ER STATE THE RIGHT SIDE WHEEL CENTER CAPS ARE PEELING SOP CENTER CAPS ARE IN	Out of Warr



2004	1LNHM81W64Y	12-May-04	25-Jun-04	LAZARE LINCOLN-MER	34909803	5K02	4W1Z	1130	BA	B65	14	E84	11-Jun-07	37	26202	143.64	15.85	159.49	0.2	10243	VERIFIED PROBLEM REPLACED CENTER CAPS, ALL OK AT THIS TIME.	CUSTOMER STATES THAT THE CENTER CAPS ARE DISCOLORING	Out of Warr
2003	5LMEU78H03Z	16-Jul-03	21-Aug-03	NICK MAYER LINCOLN-	15500201	5K01	2C5Z	1007	DA	B65	42	E84	10-Aug-07	49	26379	1548	93.7	1641.71	1.1	10705	VERIFIED CUSTOMER CONCERN WHEELS ARE PEELING NECESSARY TO REMOVE AND REPLACE ALL 4 WHEELS AND BALNCE AS NECESSARY PER DIGITAL IMAGING APPROVAL #PAAVW	CUSTOMER STATES THAT THE RIMS ARE PEELING	Out of Warr
2004	1LNHM83W54Y	8-Oct-03	29-Jan-04	NORTHLAND LINCOLN	3889701	5K01	4W1Z	1007	AA	B65	14	E84	29-Jun-07	42	27167	2176.8	59.66	2236.44	0.8	10638	REPLACE ALL FOUR WHEELS CENTERS	ALL WHEEL CENTERS ARE PITTING	Out of Warr
2004	1LNHM83WX4Y	11-Aug-03	27-Feb-04	FAIRWAY FORD LINCO	102053A	5K01	3W1Z	1007	AA	B65	D4	E84	11-Jun-07	41	29263	2248.3	64.05	2312.37	0.8	20050	R R 4 WHEELS CLOSED BY WPI	CUSTOMER STATES CHROME PEELING OFF WHEELS	Out of Warr

2004	1FTPX14554N	30-Mar-04	28-Jun-04	BEECHMONT FORD INC	359568A	5K02	4L1Z	1130 BA	B65	81 E84	22-Jun-07	37	29807	134.01	14.93	148.94	0.2	2058	29807 REPLACE D CENTER CAPS	CUSTOM ER STATES ALL 4 CENTER CAPS ARE CORRED ED SEE RO 359561 APPROV AL CODE PAAEU BY ERIC PART 4L1Z 1130 BA CUSTOM ER STATE STHE WHEEL COVERS ARE COMING APART	Out of Warr
2003	5LMEU78H13Z	28-Jan-03	5-Aug-03	NEW HOLLAND FORD	44540201	5K02	2C5Z	1130 AA	B65	D4 E84	3-Aug-07	49	29913	212.86	15.02	227.88	0.2	1360	REPLACE D CENTER CAPS		Out of Warr

2004	1FAFP36374W	27-Jan-04	16-Jul-04	BOWEN SCARFF	FORD258687F	5K02 *	1130 *	N50	42 E84	12-Jun-07	36	30089	0	68.3	68.3	0.8	8588	G	30090 CUSTOM ER STATES THERE IS UIDE A WEDGE SQUEAKI SQUEAKI NG TYPE NG IF NOISE YOU FROM PUSH ON REAR OF LIFTGATE VEHICLE. CAN .ROAD HEAR. TEST REPOSITI CUSTOM VEHICLE ON AND ER USING LUBRICA STATES CHASSIS TE. ALSO THAT EARS. VERIFIED THERE VERIFIED SQUEAKI ISA A INTERMIT NG SQUEEKI TEN NOISE NG TYPE FROM 9 NOISE NOISE SPOKE FROM FROM WHEEL VEHICLE REAR COVERS. AT ALL LIFTGATE PERFOR SPEEDS, AREA. M TSB 06 NOISE IS INSPECT. 9 5 COMING .FOUND ISOLATE FROM LIFTGATE WHEEL REAR OF COVERS VEHICLE. Out of Warr	
2004	1FTPW12504K	19-Dec-03	14-Jul-04	MCCOMBS WEST FORI	8210251	5K01	4L3Z	1007 DA	B65	D4 E84	15-Jun-07	36	30610	1452	123.64	1575.65	1.6	4545	WHEELS DISCOLO RED TIRE(S) OR WHEEL(S) REPLACE	CUST STATES ALL 4 WHEELS AND 4 CENTER CAPS ARE CORROD ED MATERIA L FLAKING APART Out of Warr

2004 2MEFM74W14X	16-Jun-04	4-Sep-04	TASCA FORD	444670A	5K02	3W3Z	1130 CA	B65	33 E84	24-Jul-07	36	31263	22.34	8.7	31.04	0.1	796	31263 INSTALLE D CENTER CAP. NOTE RO 441127 WAS RT FRT AND RT REAR. THIS RO IS THE LEFT FRT	LEFT FRONT CENTER CAP FELL OFF STICKER S ON RIMS PEELING BACK	Out of Warr
2004 1FTPW145X4K	1-Jun-04	3-Jul-04	BRONDES FORD INC.	15733207	5K02	4L3Z	1130 DD	B65	81 E84	4-Jun-07	36	31371	163.02	15.16	178.18	0.2	3010	REPLACE D 4 CENTER CAPS WHEEL CENTER CAP CLEAR PEELING OFF.REP LACED RIGHT REAR CENTER CAP.	WHEEL CENTER CAP CLEAR PEELING OFF	Out of Warr
2004 1FTPX12554F	13-May-04	9-Sep-04	JACK SCHMITT FORD	L089961B	5K02	4L3Z	1130 DD	B65	81 E84	7-Aug-07	36	32080	43.67	8.87	52.54	0.1	8193	REPLACE D ALL FOUR RIMS AND VALVE STEMS AND BALANCE D THEN TEST DRIVE AFTER	WHEEL CENTER CAP CLEAR PEELING OFF	Out of Warr
2004 1LNHM86S24Y	8-Sep-03	15-Jul-04	DON TESTER FORD LIN	2232001	5K01	4W4Z	1007 EA	B65	42 E84	6-Jun-07	36	32546	2481	118.56	2599.53	1.6	2335	REPLACE D ALL FOUR RIMS AND VALVE STEMS AND BALANCE D THEN TEST DRIVE AFTER	CHROME PEELING OFF OF WHEELS	Out of Warr

2004 1LNHM86S14Y	5-Jan-04	27-Apr-04	LIBERTY LINCOLN MER115915A	5K01	4W4Z	1007 EA	B65	14 E84	6-Aug-07	40	33110	2487.5	65.39	2552.91	0.8	11000	DI PAATZ	33110 CK ALL RIMS LOOSING AIR, PITTED AND PEELING CHROME REPLACE ALL 4 WHEELS	CUST STATES PASS FRONT RIM KEEPS LOOSING AIR ABOUT 22 LBS WEEKLY CUST WANTS ALL RIMS CHECKE D ALL OTHERS ARE LOOSING AIR BUT NOT AS MUCH AS	Out of Warr
2004 1FMZU73E34U	17-Jun-04	31-Jul-04	FERRARIO FORD LINC(028927B	5K01	*	1007 *	N50	42 E84	31-Jul-07	37	34265	0	45.33	45.33	0.7	3366	TEST DRIVE...C OULD NOT VERIFY CUSTOM ER CONCER N AT THIS TIME	TEST DRIVE...C OULD NOT VERIFY CUSTOM ER CONCER N AT THIS TIME	ER STATES THERE IS A SQUEAK NOISE OVER BUMPS. CHECK AND ADVISE	Out of Warr

2004 1LNHM86S04Y	17-Oct-03	24-Nov-03	KRUG HILLTOP FORD-L	1877201	5K01	4W4Z	1007 EA	B65	D7 E84	24-Jul-07	45	34440	2487.5	66.57	2554.09	0.8	1758	REMO VE	W 20041 VIRIGY ALL FOUR WHEELS INSIDE PEELING AND CORROD ED, CORROSI O NO SPREADI NG TO WHEEL SPOKES. NESS TO REPLACE FOUR WHEELS REMOVE FOUR WHEELS FROM VEHICLE, REMOVE WEIGHTS AND DISMOUN T TIRES	OUNT ON NEW RIMS,BAL ANCE FOUR TIRES AND MOUNT ON	FACTORY RIMS HAVE SHEETS OF MATERIA L PEELING OFF OF	Out of Warr
2004 4M2ZU86K64U	20-Aug-03	26-Jun-04	ELMHURST LINCOLN-M	6369751	5K01	3L2Z	1007 TC	B65	14 E84	15-Jun-07	37	34519	1477.5	109.71	1587.21	1.1	13660	REPLACE	WHEELS TIRE(S) OR WHEEL(S) )	CUSTOM ER STATES THAT ALL 4 WHEELS ARE HEAVILY CORROD ED. PARTS ORDERE D AND IN. REFER TO RO#6304 0 ON 052907 AT 34029 MILES	Out of Warr	

2003 1LNHM87A03Y	9-May-03	20-Oct-03	TASCA FORD	447683G	5K01	3W4Z	1007 GA	B65	42 E84	15-Aug-07	47	34557	616.53	26.1	642.63	0.3	796	REPLACE D LEFT REAR WHEEL	LH REAR WHEEL LOSEING AIR FROM AROUND VALVE STEM	Out of Warr
2004 1FTPX14594N	4-Jun-04	24-Jun-04	FRIENDLY FORD, INC.	148936A	5K02	4L3Z	1130 DD	B62	81 E84	18-Jun-07	37	35259	163.02	17.13	180.15	0.2	2662	35259 INSTALLE D CENTER CAPS	C S FINISH ON WHEEL CENTER CAPS PEELING	Out of Warr
2004 2FTRF073140	7-Apr-04	22-Jul-04	GARY YEOMANS FORD	57647503	5K01	3L3Z	1007 AA	B65	D4 E84	15-Jun-07	36	35555	350.9	24	374.9	0.3	4790	CC 14 REPLACE D AND REBALAN CED RIGHT FRONT WHEEL.	PASSEN GER FRONT RIM HAS A CASTING FLAW DI PAAMX	Out of Warr
2004 1LNHM85W14Y	31-Mar-04	3-Jul-04	GOLDEN CIRCLE FORD	222395A	5K01	4W1Z	1007 AA	B65	81 E84	20-Jun-07	37	36403	544.19	21.17	565.36	0.3	5885	36403 1 TIRE 37313 REPLACE D ALL 4 CENTER CAPS	PER RO 221833	Out of Warr
2004 1LNHM87A44Y	17-Oct-03	26-Dec-03	TASCA FORD	442099A	5K02	3W4Z	1130 CA	B65	D4 E84	5-Jul-07	43	37313	177.46	17.4	194.86	0.2	796	PAATV	ALL 4 CENTER CAPS PEELING	Out of Warr
2004 1LNHM86S94Y	5-Feb-04	26-Mar-04	JOE MACHENS FORD L	51205001	5K01	4W4Z	1007 EA	B65	D4 E84	23-Jul-07	41	37591	1240.5	51.52	1292	0.6	8006	REPLACE LEFT SIDE WHEELS AND BALANCE TIRES 35 PSI ...	STATES CHROME PEELING FROM BOTH LEFT SIDE WHEELS. . INSTALL SOP PER LAST VISIT	Out of Warr

2004	1LNHM83WX4Y	22-Apr-04	30-Jun-04	HUB CITY FORD-MERC	124483A	5K01	4W1Z	1007 AA	B65	33 E84	17-Aug-07	39	38954	544.19	19.33	563.52	0.3	4918	RIM	REPLACE D RT RR WHEEL	C S TIRE WILL NOT SEAT ON RIM BECAUSE OF CHROME IS PEELING FRON THE INSIDE OF THE RIM.	Out of Warr
2003	1LNHM87A03Y	17-Jun-03	12-Nov-03	FIESTA LINCOLN MERC	11323406	5K01	3W4Z	1012 AA	B65	33 E84	6-Jul-07	45	40065	9.8	54.22	64.02	0.6	11896	HRS	TECH 721 FOUND LOOSE STUD, REMOVE D BRAKE CALIPER, AND BRAKE ROTOR, REMOVE D LOOSE STUD, AND REPLACE D WITH NEW, REATATC HED ROTOR AND CALIPER, CONCER N CORREC TED, WORK M PAY .7	LEFT REAR WHEEL STUD LOOSE IN HUB	Out of Warr



2004 5LMEU88H74Z	9-Dec-03	28-Apr-04	ED SHERLING FORD, IN	8772504	5K02	2C5Z	1130	AA	B65	81	E84	3-Aug-07	40	40770	212.86	12.53	225.39	0.2	401	ALL 4 CENTER CAPS PEELING REPLACED ALL 4 CENTER CAPS ACES CODE#PA A8V	TECH FOUND THE 4 CENTER CAPS PEELING	Out of Warr
2004 5LMEU68H04Z	9-Jan-04	9-Sep-04	DESOTO FORD-MERCL	9452851	5K02	2C5Z	1130	AA	B65	D4	E84	8-Jun-07	34	40976	212.86	15.11	227.97	0.2	4865	VERIFIED REPLACED ALL CENTER CAPS PER DIGITAL IMAGING RECHECKED OK	CUSTOMER STATES CENTER CAP ARE DISCOLORED APPROVED BY JACKIE	Out of Warr
2004 5LMFU27R24L	7-Oct-03	19-Nov-03	AUTOWAY LINCOLN ME	323051B	5K01	2L7Z	1007	AB	B65	81	E84	1-Aug-07	46	40990	1391	100.21	1491.25	1.2	11605	40990 4 RIMS PEALING DI AUTH PAAYX REPLACED ALL 4 RIMS BALANCE TIRES AND ROTATEED THEM THEN RETRAIN ED TIRE PRESSER SENSOR	B65 CUST STATE ALL 4 WHEELS CHROME IS COMING OFF	Out of Warr
2004 5LMEU88H54Z	28-Jan-04	16-Aug-04	YORK FORD INC	368781A	5K02	2C5Z	1130	AA	B65	68	E84	23-Aug-07	37	41201	212.86	17.5	230.36	0.2	8888	41201 REMOVE & REPLACE CENTER CAPS	4 CENTER CAPS PITTED	Out of Warr

2004	1LNHM83WX4Y	12-Nov-03	22-Jan-04	LIBERTY LINCOLN MER116073F	5K01	3W1Z	1007 AA	B65	14 E84	13-Aug-07	44	42979	2098.4	65.39	2163.82	0.8	11000	42979 REPLACE WHEELS W BALANCE (4)	CHECK WHEELS PEELING APPROV AL # PAAPS TO REPLACE RIMS	Out of Warr	
2004	1LNHM83WX4Y	6-Oct-03	28-Oct-03	BAY LINCOLN-MERCUF220726A	5K01	4W1Z	1007 AA	B65	D1 E84	1-Aug-07	46	44549	544.19	20.72	564.91	0.3	10248	44549 REPLACE D AND BALANCE D PASSEN GER FRONT WHEEL DUE TO AIR LEAK IN WHEEL	C S RIM HAS SLOW LEAK SOP IN CUSTOM ER STATES THAT THE CHROME IS PEELING OFF OF INSIDE OF BOTH REAR WHEELS	Out of Warr	
2004	1LNHM86S04Y	5-Jan-04	28-Oct-04	DONLEY FORD-LINCOL	5K01	4W4Z	1007 EA	B65	81 E84	4-Jun-07	32	45329	1240.5	35.42	1275.9	0.5	8287	CHROME PEELING REPLACE D BOTH REAR WHEELS AUTH PAAUC 49903 FORCIBL E REMOVE SWOLLE N NUTS. REPLACE NINE LUG NUTS.	CHECK ALL LUG NUTS RUSTED AND SWELLE D UP CENTER CAPS HAS DISCOLO RATION.	Out of Warr	
2003	1LNHM87A53Y	23-Jan-03	15-Nov-03	LIBERTY LINCOLN MER116550A	5K01	3W4Z	1012 AA	B65	69 E84	30-Aug-07	47	49903	44.1	40.87	84.97	0.5	11000	REPLACE D CENTER CAPS.		Out of Warr	
2004	1FTWW33P34ED	27-May-04	29-Jul-04	WOODHOUSE LINCOLN	773527	5K02	3C3Z	1130 DA	B65	42 E90	25-Jun-07	36	20010	99.74	15.78	115.52	0.2	10670			Out of Warr

2005	1FTSW21P35E	28-Jan-05	1-Apr-05	BERGLUND FORD	350730A	5K01	5C3Z	1007 PA	B65	42 P01	9-Aug-07	29	55037	910.27	34.8	964.04	0.4	6717	ED CUSTOM ER CONCER N CONTACT ED STEVE SMALL OUR FORD REP AND HE AGREED TO COVER UNDER P01 E AUTHORI ENTITL ZATION D TO REPLACE ACCORDI D WHEEL NG TO AND TIRE STATE TO OF VA CORREC CODE T AND THE CUST CONCER 25% STATES N OTHER THAT WHEEL IS THE IS SPLIT DIFFERE SYSTEM AT NCE IN PAYS. SPOKE. Out of Warr
2003	1FMZU75W03Z	29-Oct-02	22-Nov-02	GRAND FORD, INC.	061231A	5K01	3L2Z	1007 KA	B65	1 P01	13-Jun-07	56	58386	1262.5	68.26	1330.72	1.1	7417	SERVICE DEPT CALLED SZR JOHN MORSE WHO GAVE APPROV AL K14XJ TO REPLACE ALL 4 RIMS ORDERE D AND REPLACE D RIMS CUSTOM ER STATES ALL 4 WHEELS ARE CRACKIN G AND BUBBLIN G UP AGAIN AFTER REPLACE MENT ON 11 18 2004 RO 045189 Out of Warr

2003	1FMZU75W93U	8-May-03	1-Sep-03	APPLE VALLEY FORD L	63849101	5K01	3L2Z	1007 KA	B65	42 P01	12-Jul-07	48	77962	946.85	119.56	1066.41	1.2	9217	1007 CCD7 CLEAR COATING COMING OFF THE LEFT REAR AND BOTH FRONT RIMS. REPLACE D THREE RIMS PER COLE D. TECH VERIFIED THE CONCER N REMOVE D AND REPLACE D THE RIM CHECKS FINE.	CUSTOM ER STATES THE CLEAR IS PEELING ON ALL RIMS BUT THE RIGHT REAR CODE:B6 5 APPROV AL CODE IS K107H	Out of Warr
2004	2MEFM75WX4X	1-Aug-03	11-Sep-03	MANGOLD FORD MERC	9421901	5K01	3W3Z	1007 AA	B65	D4 P05	20-Aug-07	48	19582	284	22.76	306.76	0.3	20249	21284 REPLACE REPLACE RIGHT FRONT AND RIGHT REAR CENTER CAP. PAINT IS BUBBLIN G.	CUST STATES THE ALUMINU M WHEEL HAS A PIN HOLE IN IT. CUSTOM ER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLIN G UP	Out of Warr
2004	1FTPX14564NE	27-Feb-04	18-May-04	KENNY ROSS FORD	682970A	5K02	4L3Z	1130 DD	B65	D4 P05	14-Aug-07	40	21284	81.51	15.28	96.79	0.2	7350	CAP ASY WHEEL RING HUB CAP WHEEL COVER REPLACE	CUST STATES CENTER CAP KEEPS FALLING OFF	Out of Warr
2004	2FMDA576X4E	6-Nov-03	1-Dec-03	MCCOMBS WEST FORI	8389952	5K02	3F2Z	1130 DA	B65	42 P05	5-Jul-07	44	22566	11.37	7.73	19.1	0.1	4545		PE08-060 1286	Out of Warr

2004 1FMZU75W44U	4-Nov-03	19-Dec-03	RUSS MILNE FORD, INC	266851	5K01	3L2Z	1007 KA	B65	D4 P05	15-Jun-07	43	26319	631.23	59.59	690.82	0.7	2890	CHROME PEELING TIRE(S) OR WHEEL(S) REPLACE	CK THE 2 FRONT CHROME 17 WHEELS ARE CORRODING NEAR THE CENTER CAPS. \$200.00	Out of Warr
2004 1FTZR45E94P	3-Nov-03	28-Nov-03	BEECHMONT FORD INC	360899A	5K01	*	1007 *	N50	82 P05	20-Jul-07	45	27527	457.45	59.71	517.16	0.8	2058	TEST DROVE AND REPLACE ALL 4 TIRES PER TSB	CUSTOMER STATES HEARS WHOMPING NOISE AT HIGHWAY SPEEDS	Out of Warr
2004 1FTYR15E74P	29-Sep-03	10-Jun-04	BEECHMONT FORD INC	359360A	5K01	*	1007 *	N25	42 P05	19-Jun-07	37	28898	632.8	59.71	566.23	0.8	2058	28898 1.2 REPLACE D 4 TIRES DOT#MD CU C6AR 2107(X4).	WRANGLER RT S 9001 13784000 39. INSTALL TIRES DUE TO CUPPING ,	Out of Warr
2004 1FTPX145X4N	12-Mar-04	13-Jul-04	EWALD'S VENUS FOR	51682501	5K02	4L1Z	1130 BA	B65	D4 P05	31-Jul-07	38	32200	134.01	16.51	150.52	0.2	3774	PEELING REPLACE ALL 4 CENTER CAPS P05	DISCOLORED	Out of Warr

2004 1FMZU85WX4U	31-Oct-03	29-Apr-04	JOE MACHENS FORD L	50969301	5K01	3L2Z	1007 KA	B65	D7 P05	30-Jun-07	39	35100	1262.5	94.45	1356.91	1.1	8006	1 REPLACE WHEELS AND MOUNT AND BALANCE TIRES ...	STATES WHEELS PEELING CHROME. INSTALL 4 NEW WHEELS 20% DEDUCT CHG TO NEW CAR SALES PER LARRY SIDBERR Y.. HAS BEEN INSPECT ED BY RALPH DUMAS ...	Out of Warr
2004 1FAHP60A24Y	13-Oct-03	13-May-04	PALM BAY FORD, INC.	16311901	5K01	4W6Z	1007 AA	B65	D1 P05	21-Jun-07	38	35396	499.86	22.28	522.14	0.3	2938	POROSIT Y R R RIGHT REAR WHEEL BALANCE TIRE P05	C S DEFECT IN R R WHEEL LOSING AIR	Out of Warr
2004 1FTPW14594K	14-May-04	5-Jun-04	LITHIA FORD LINCOLN	354579D	5K02	4L3Z	1130 DD	B65	42 P05	21-Jun-07	38	35976	40.75	8.26	49.01	0.1	3897	35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	CUSTOM ER STATES LF HUBCAP PEELING	Out of Warr
2004 1FTRX12W84N	12-Mar-04	29-Jul-04	GARY YEOMANS FORD	57875701	5K01	4L3Z	1007 AA	N25	D9 P05	6-Jul-07	36	36473	464.24	48	512.24	0.6	4790	INSTALL 2 RIGHT SIDE WHEELS PER BILL POSEY NEW STEMS AND BALANCE CC42 M O	CUST STS PASSEN GER WHEELS ARE OUT OF ROUND. SOP IN PER BILL POSEY	Out of Warr

2005	2FAFP71W85X	2-May-05	24-May-05	LANDMARK FORD, INC.673578A	5K01	5W7Z	1007 AA	H62	42	P05	15-Aug-07	28	36826	136.42	48.19	184.61	0.5	8559	36826 WHEELS WARR P05 FOUND 2 DEFECTI VE WHEELS. REPLACE D 2 WHEELS. PO5 1 VERIFY CONCER N, REPLACE ALL 4 WHEELS AND MOUNT AND BLANCED ALSO REPLACE D 4 CENTER CAPS.	CK TIRES FOR TIRE RECALL	Out of Warr
2004	1FMDU75WX4Z	18-Aug-03	6-Nov-03	ATCHLEY FORD INC	5K01	3L2Z	1007 KA	B65	1	P05	18-Jul-07	46	37125	1306.8	134.3	1441.11	1.7	7130	WHEELS AND MOUNT AND BLANCED ALSO REPLACE D 4 CENTER CAPS.	RIMS ARE SPLITTIN G AND CRACKIN G PO5 WITH 100\$ DUCTI BLE	Out of Warr
2005	1FAFP25115G	15-Mar-05	4-May-05	HARBIN MOTOR COMP.154548A	5K02	5G1Z	1130 BA	B65	81	P05	27-Jun-07	27	38893	15.05	6.64	21.69	0.1	378	REPLACE CENTER CAP	CUST STATES FINSH IS COMING OFF WHEEL CENTER CAP GOODWI LL REFUND TOWARD REPAIRS OFF INVOICE 637836 AS PER CAC REQUES T.CUST \$50.00 CO PAY REFUND TO BE	Out of Warr
2004	1FMRU17W94LB67453	27-May-04	13-Sep-04	SAWGRASS FORD	5K01	*	1007 *	G29	42	P05	9-Aug-07	36	39556	0	0	405.82	0	4908	GOODWI LL REFUND FOR REPAIRS 637836	TO BE 08-060 1289 \$405.82	Out of Warr

2003	1FMZU75K43U	21-Mar-03	21-Aug-03	KENNY ROSS FORD	680120A	5K01	3L2Z	1007 KA	B65	D4 P05	5-Jun-07	47	40025	1262.5	84.05	1346.51	1.1	7350	40025 CHROME IS PEELING FROM THE CENTERS OF THE WHEELS. REPLACE 4 RIMS MOUNT AND BALANCE 4 TIRES	CUSTOM ER STATES WHEELS PEELING	Out of Warr
2006	1FTSW21P96E	18-Jan-06	2-Mar-06	JOE SARTAIN FORD, IN	24137801	5K01	6C3Z	1007 A	B65	70 P05	30-Jul-07	18	41504	1432.4	0	1432.37	0	5732	1 PERFOR M NVH DIAG FOUND BOTH FRONT WHEEL OUT OF ROUND USED HUNTER 9700 DIAG OVER SPEC LIMITS	C S VIBRATIO N AT 65 MPH FINISH PEELING	Out of Warr
2004	1FTZR45E24P	12-Nov-03	19-Feb-04	DEWEY FORD, INC.	43073801	5K01	1L5Z	1007 EB	B65	D4 P05	11-Jun-07	41	42243	391.54	23.78	415.32	0.3	3540	1 REPLACE D WHEEL 42400 REPLACE D WHEEL, PART ONLY AS GOODWI LL, WHEEL CRACKE D IN WELD	ON R F WHEEL  CUST STATES TIRE GOING FLAT. WHEEL FOUND TO DEFECTI VE	Out of Warr
2006	1FTPX14586N	21-Apr-06	5-May-06	MAGIC CITY MOTOR CC	181438A	5K01	7L3Z	1015 B	B65	61 P05	7-Aug-07	16	42400	162.02	0	162.02	0	6700			Out of Warr



2003	2MEFM74W93X	25-Jun-03	20-Oct-03	PAUL CERAME LINC-MI	293453A	5K02	5W3Z	1130	EA	B65	42	P05	15-Aug-07	47	45457	201.26	40.99	254.48	0.4	12825	01	REPLACE ALL 4 WHEEL COVERS AS PER TSB 04 21	B65 WHEEL COVERS ARE CLICKING . REPLACE COVERS AS PER TSB 04 21	Out of Warr
2005	1FDXF46P15E	9-Feb-05	3-Jun-05	DOWNS FORD, INC.	9231151	5K01	*	1007	*	N25	42	P05	7-Aug-07	27	47945	62.85	403.51	466.36	4.5	20681	ROA	ROAD TEST CK DRIVESH AFT RUN OUT AND REINDEX AND CK SHAFT ANGLE FOUND OK. CK REAR TIRE BAL AND REIDEX TIRES ON WHEELS TO CORREC T ROAD FORCE, CK FRT TIRE BAL ALSO EXCESSIV E ROAD FORCE, REINDEX AS NEC	D TEST OK CK ABS SYSTEM FOUND CODE C1236, PERFOR MED NEC PINPOINT TESTS FEELS VIBRATIO N IS STEERIN G ALL THE TIME STEERIN G WHEEL SENSITIV E & ABS LIGHT IS ON	Out of Warr
2005	1FTSW21P95E	28-Oct-04	10-Mar-05	JONES FORD	7241901	5K01	5C3Z	1015	JA	B65	D4	P05	23-Jul-07	29	50266	222.67	26.34	249.01	0.4	6721	RIM	REPLACE BAD RIM REPLACE RIM	WHEEL WARPED	Out of Warr

2006 1FTWW33PX6E	28-Jul-05	30-Aug-05	DAVE SINCLAIR FORD, 43687701	5K01	6C3Z	1007 B	TB6	1 P05	16-Aug-07	24	51578	420.1	0	445.63	0	8199	SMALL CRACK AT VALVE STEM. CHECK OUT & VERIFIED LEAK REPLACE D VALVE STEM AND AIR TO DESIRED PRESSU RE. RECHEC K VERIFIED STRAIN CRACK AT VALVE STEM. NECESSA RY TO REPLACE WHEEL	C S WHEEL HAS A CRACK AT VALVE STEM OF ALUMINU M WHEEL CHECK AND ADVISE	Out of Warr
2003 1FMZU75K73Z	6-Aug-03	24-Sep-03	BRONDES FORD INC. 16001201	5K01	3L2Z	1007 KA	B65	81 P05	6-Aug-07	48	52421	1306.8	83.39	1390.2	1.1	3010	1 REPLACE D 4 RIMS, MOUNTE D & BALANCE D TIRES	CUST STATES THE RIMS ARE PEELING APART	Out of Warr

2004	1FTRF145X4N	13-Jan-04	31-Jan-04	ED MULLINAX FORD	265182B	5K01	*	1007 *	N25	42	P05	6-Jun-07	41	53510	246.6	187.59	444.19	2.2	2283	53517 P05 ROAD FORCE BALANCE 4 TIRES, FOUND L F TIRE FAILING TIRE DOT ROADFO MKB9 RCE, LRWV REPLACE 3006, L F TIRE HAS 14 AND TO 15 32 STEM. TR RIM OK REPLACE PASSES, AND NEW BALANCE TIRE 1ST NEW FAILING TIRE, BAL., HAS NEW 38PSI DOTS AND MKB9 37PSI LRWV AFTER 0107, TURNING ROAD . ORDER TEST 2ND NEW AFTER TIRE. REPAIRS OK.	P05. VIBRATIO N WHEN DRIVING 55 70MPH OTHER WHEEL WEIGHTS MT ROAD FORCE BALANCE	Out of Warr
2003	1FMZU75W43U	16-Jun-03	7-Aug-03	FRIENDLY FORD, INC.	148533A	5K01	3L2Z	1007 KA	B65	1	P05	8-Jun-07	47	53550	315.62	42.82	358.44	0.5	2662	REPLACE CHROME WHEEL FOR RIGHT REAR WHEEL ON CUSTOM ERS VEHICLE	PASSEN GER SIDE REAR WHEEL IS CRACKIN G AROUND THE CENTER CAP CLEAR COAT COMING OFF OF LEFT FRONT WHEEL	Out of Warr
2004	1FMDU65W24Z	24-May-04	19-Jun-04	JOE SARTAIN FORD, IN	24195801	5K01	4L2Z	1007 FA	B65	81	P05	20-Jun-07	37	54523	343.97	34.66	378.63	0.5	5732	1 REPLACE D LEFT FRONT WHEEL	FRONT WHEEL	Out of Warr

2003	1FMDU75W43U	6-Dec-02	28-Dec-02	JOHN LANCE FORD	144037E	5K01	3L2Z	1007 KA	B65	D4 P05	20-Jun-07	55	57671	1306.8	112.58	1419.39	1.3	2284	57671 REPLACE D ALL FOUR RIMS AND CAPS BECAUSE OF PEEL ING	CUSTOM ER STATES ALL FOUR WHEELS ARE PEELING AND IS THE SECOND TIME NEEDS REPLACE D	Out of Warr
2005	2FAFP71W85X	2-May-05	2-Jun-05	LANDMARK FORD, INC.	67362501	5K01	5W7Z	1007 AA	H62	42 P05	15-Aug-07	27	57987	68.21	77.1	145.31	0.8	8559	WHEEL WARR P05 FOUND 1 DEFECTI VE WHEEL. REPLACE D WHEEL 64030 WARR FOUND 4 WHEELS FAIL INSPECTI ON. REPLACE D 4 WHEELS		Out of Warr
2005	2FAFP71WX5X1	2-May-05	23-May-05	LANDMARK FORD, INC.	675473A	5K01	5W7Z	1007 AA	H62	34 P05	29-Aug-07	28	64030	272.83	77.1	349.93	0.8	8559	66704 WHEELS WARR P05 FOUND 4 DEFECTI VE WHEELS. REPLACE D 4 WHEELS	CK ON WORN WHEELS	Out of Warr
2005	2FAFP71W65X	2-May-05	3-Jun-05	LANDMARK FORD, INC.	673748A	5K01	5W7Z	1007 AA	H62	42 P05	16-Aug-07	27	66704	272.83	77.1	349.93	0.8	8559	66704 WHEELS WARR P05 FOUND 4 DEFECTI VE WHEELS. REPLACE D 4 WHEELS	CK ON BAD WHEELS PER RECALL	Out of Warr

2003	1FMDU85W03Z	21-Jul-03	18-Aug-03	MIDLAND FORD LINCOI	23983701	5K01	3L2Z	1007 KA	B65	1 P05	5-Jul-07	48	71422	1306.8	82.62	1389.43	1.1	9801	1007 CC01 REPLACE FOUR WHEELS AND BALANCE	REPLACE WHEELS. ..CRACKE D ALL AROUND CENTER HOLE AWA \$100 DEDUCT	Out of Warr
2003	1FMFU18L03L	4-Apr-03	26-May-03	LANDMARK FORD, INC.	667179A	5K02	2L1Z	1130 CA	B65	42 P08	16-Jun-07	50	38028	81.73	9.64	91.37	0.1	8559	38028 SPW WARRAN TY KEEPERS ON HUB CAPS BROKEN REPLACE D WITH NEW 1130 42 TECH 5719 REPLACE RIGHT FRONT HUBCAP AND CENTER CAP POST CHECK OK	SERVICE PART WARRAN TY, REPLACE BROKEN WHEEL CAPS	Out of Warr
2004	2MEFM74W34X	11-Nov-03	4-Jan-04	FIESTA LINCOLN MERC	11271101	5K02	5W3Z	1130 EA	A99	82 P98	20-Jun-07	43	55684	72.66	9.04	81.7	0.1	11896	1130A .1	REPLACE RIGHT FRONT HUB CAP P98 FORD PAYING FOR 80.00 CHECK STEEL WHEELS FOR CRACKIN G W04 PER FORD REP AS PER RECALL	Out of Warr
2003	2FAFP73W93X	27-May-02	26-Jun-02	JORDAN FORD, LTD.	4104351	5K01	5W7Z	1007 AA	A99	82 W04	5-Jun-07	61	66100	349.23	128.91	478.14	1.6	4546	07S48G STEEL WHEEL	07S48	Out of Warr



2006	3MEFM07166F	17-May-06	30-Oct-06	ELMHURST LINCOLN-M	6331351	5K02	6N7Z	1130	AA	B65	2	1	5-Jun-07	8	11447	97.2	19.95	117.15	0.2	13660	REPLACE CROSS SWITCH TIRES AND ROAD TEST 10 MILES	REPLACE CENTER CAPS WHEEL RING HUB CAP WHEEL COVER	CUSTOMER STATES ALL FOUR CENTER CAPS ARE DISTORTED PART WERE ORDERED AND PARTS ARE HERE	Tire
2008	1FTSW21R68E	2-Apr-07	7-Jul-07	KINDLE FORD MERCUF	32149701	5K01	*	1007	*	H25	7	2	24-Jul-07	1	1078	0	84.69	84.69	1	1237	8925 W CK SHAKES NVH TIME TO DIAG CK ROADFORCE BALANCE REROAD FIRCE BALANCE	8925 W CK SHAKES NVH TIME TO DIAG CK ROADFORCE BALANCE REROAD FIRCE BALANCE	PULLS HARD TO THE LEFT	Tire
2007	3FAHP07Z17F	18-Nov-06	10-Feb-07	NORTH BROS. FORD, II	205528B	5K01	*	1007	*	C50	7	2	13-Aug-07	7	8925	0	147.9	147.9	1.7	2975	8925 W CK SHAKES NVH TIME TO DIAG CK ROADFORCE BALANCE REROAD FIRCE BALANCE	8925 W CK SHAKES NVH TIME TO DIAG CK ROADFORCE BALANCE REROAD FIRCE BALANCE	CAR SHAKES AT HIGHWAY SPEEDS ADVISE REPLACE 3 OF THE 4 CHROME WHEELS PER D.I. AUTHORIZATION #PAANV (REPLACE BOTH FRONT AND THE PASSENGER SIDE)	Tire
2006	1FTPW14586F	26-Jul-06	29-Jul-06	FRIENDLY FORD, INC.	148548A	5K01	5L3Z	1007	HA	B65	81	E84	8-Jun-07	11	13757	1709.5	94.2	1803.68	1.1	2662	13757 REPLACED THREE OUT OF 4 TIRES	13757 REPLACED THREE OUT OF 4 TIRES	REAR)	Tire

2007 1FTPX12507K	6-Nov-06	31-Jan-07	LA PLACE FORD, INC.	7113602 5K01 *	1007 *	N23	D9	2	19-Jun-07	5	3859	0	126.41	126.41	1.7	4127	OK.	VERIFY COMPLAI NT.RAN DIAG.CK RUN OUT. BALANCE ALL TIRES & TEST DROVE S WHILE DRIVING	C S STEERIN G WHEEL VIBRATE S WHILE DRIVING	Tire
------------------	----------	-----------	---------------------	----------------	--------	-----	----	---	-----------	---	------	---	--------	--------	-----	------	-----	--	--	------

2007 1FTPW14V57K	12-Mar-07	25-May-07	MAXWELL FORD	793180A 5K01 *	1007 *	N25	42	2	26-Jul-07	3	4798	0	200.4	200.4	2.4	2923	T1340	4813 TIRES OUT OF BALANCE 42 NVH DIAG,CH ECK RUN OUT OF TIRES,RO AD FORCE BALANCE ,RE INDEX ALL,RE BALANCE ALL,INDE X ON VEHICLE, ROAD TEST OK VEHICLE RIDES FINE	VEHICLE VIBRATE S WHEN DRIVING OVER 45 MPH	Tire
------------------	-----------	-----------	--------------	----------------	--------	-----	----	---	-----------	---	------	---	-------	-------	-----	------	-------	--	---	------



2007 1FTPW14V87K	6-Sep-06	31-Jan-07	MONTGOMERY FORD L	3558101	5K01 *	1007 *	N24	13	2	18-Jun-07	5	5562	0	142.52	142.52	1.9	6309	CP:1007 CODE D1 ROAD TSET TO VERIFY TIRE VIBRATION TO MEASURED TIRE & WHEEL & WHEEL RUNOUT & ROAD FORCE VARIATION ALL TIRES WITHIN SPECS BALANCE D WHEELS & PERFORM	HUB SPEC.	SUSPENSION/BRAKES C/S VEHICLE SHAKES BAD WHILE DRIVING 68 73 MPH STATES TIRES HAVE BEEN BALANCE D AT ANOTHER DEALER ADVISE	Tire
------------------	----------	-----------	-------------------	---------	--------	--------	-----	----	---	-----------	---	------	---	--------	--------	-----	------	---	--------------	--	------

2007 1FTRF12207N	1-Mar-07	20-Apr-07	MAXWELL FORD	789425A	5K01 *	1007 *	N24	42	2	11-Jun-07	2	6320	0	183.7	183.7	2.2	2923	6336 REINDEX TIRES, DISMOUNTED 3 TIRES REMOVED, REBALANCED TIRE ROADFORCED, TEST DROVE	T1021	C/S TRUCK VIBRATE S WHILE DRIVING AT HWY SPEEDS	Tire
------------------	----------	-----------	--------------	---------	--------	--------	-----	----	---	-----------	---	------	---	-------	-------	-----	------	---	-------	---	------

2005 1ZVFT82HX55	2-Apr-05	22-Apr-05	CRESTMONT FORD, IN	155623A	5K02	F42Z	1700 A	H62	1 E84	16-Aug-07	29	11359	178.66	24.16	202.82	0.3	4369	14806	REPLACE D RIGHT FRONT TIRE FOR TIRE WENT FLAT CAUSED BY VALVE STEM, REPLACE D VALVE STEM OLD DOT N9EKF66 10905 NEW DOT N9EKF66	CUSTOM ER WAS DRIVING ON HIGHWA Y AND RIGHT FRONT TIRE WENT FLAT. STE	Tire
2006 3LNHM26136R	24-Jun-06	15-Oct-06	NORTH SHORE L-M INC	182312A	5K01	6H6Z	1007 BA	B65	42 E84	3-Jul-07	9	13000	474.01	25.19	499.2	0.3	10004	O K	REPAIRE D AND RETETED	CORROIS ION TO WHEEL BEAD	Tire

2007 1FAFP53U07A	11-Oct-06	26-Oct-06	MAXWELL FORD	793594A	5K01	*	1007 *	N22	42 E84	31-Jul-07	10	16989	0	175.35	175.35	2.1	2923	NVH DIAG, PIN POINT TEST, ROADTE ST CONFIRM CUSTOM ER CONCER N, ROTATE TIRES FRONT TO BACK AND REROAD TEST, NEUTRAL IZE EXHAUST , CHECK REBALAN CE TIRES AND REROAD TEST FOR RUNOUT, REINDEX	RES AND REROAD TEST	C S VIBRATIO N WHILE DRIVING Tire VALVE STEM CAPS WONT COME OFF		
2006 4M2EU48866U	13-Jan-06	24-Mar-06	METRO FORD	109672B	5K01	*	1007 *	B65	41 E84	13-Jun-07	15	17844	0	92.74	92.74	1.2	7616	17801 CUT OFF CAPS		SEEKING REIMBUR SEMENT FOR TIRE REPLACE MENT	SEEKING REIMBUR SEMENT FOR TIRE REPLACE MENT	Tire
2006 1FTSW21P16E	13-Mar-06	4-Sep-06	MULLINAX FORD	454007B	5K01	*	1012 *	C50	42 E84	16-Jun-07	10	19032	0	0	858.74	0	3073					Tire

2007 1FAHP34N77W	30-Jul-07	BERGLUND FORD	350767E	5K02	6S4Z	1130 B	B65	1	1	9-Aug-07	-1	2	22.54	0	22.54	0	6717	WHILE PERFORMING PDI WENT TO INSTALL HUBCAPS AND FOUND 1 DAMAGED INSIDE OF WRAP ORDERED AND REPLACED TO CORRECT CONCERN.	HUBCAP BROKEN UPON ARRIVAL REPLACE	Under Limit
2007 3FAHP06ZX7R	2-Jun-07	9-Jul-07 JONES FORD	7156701	5K02	F42Z	1700 A	B65	42	1	20-Jun-07	0	3	1.68	19.76	21.44	0.3	6721	VERIFY CONCERN REMOVE WHEEL REMOVE TIRE R&R VALVE STEM BALANCE TIRE AND REINSTALL RE CHECK OK	CUSTOMER STATES RIGHT REAR TIRE LEAKING AT VALVE STEM	Under Limit
2008 1FTXW43RX8E	20-Jun-07	CITRUS FORD	61451202	5K02	5C3Z	1130 NA	B65	1	1	11-Jul-07	-1	5	42.8	8.84	51.64	0.1	5513	INSTALLED CAPDI CODE PAAIU	RF HUB CAP CHROME PEALING C S LF TIRE GOES FLAT...TIRE PRESSURE LIGHT ON	Under Limit
2007 1FMEU64E67U	6-Jun-07	22-Aug-07 MIKE SHAD FORD	370658A	5K02	*	1700 *	A40	D8	1	19-Jun-07	0	5	0.49	24.26	24.75	0.3	4867	REPLACE LEFT FRONT WHEEL VALVE STEM LEAKING	REPEALING C S LF TIRE GOES FLAT...TIRE PRESSURE LIGHT ON	Under Limit

2008	1FTNE24L88D	7-Aug-07	5-Sep-07	MILLER FORD SALES	1031442	5K01	*	1007	*	G29	42	1	31-Aug-07	0	5	0	26.73	26.73	0.3	1336	TIRE PRESSURE LIGHT ON, RESET TIRE PRESSURES, WAKE AND RESET ALL 4 SENSOR VALVE STEM IS LEAKING TIRE REINDEX	TIRE PRESSURE MONITOR LIGHT ON	Under Limit
2007	1FAHP31N07W	21-Dec-06	9-Aug-07	KOONS COLLEGE PARI	1603851	5K02	*	1700	*	B65	D1	1	18-Jul-07	0	5	0	45.35	45.35	0.5	10	5 34 1130 WARR REPLACE 4 CENTER CAPS	FLAT TIRE B65 OWNER REPORTS FINISH PEELING FROM CENTER CAPS	Under Limit
2007	4M2EU38837U	5-Jun-07	16-Aug-07	AUTOWAY LINCOLN ME	321173A	5K02	5E6Z	1130	AA	B65	81	1	29-Jun-07	0	5	52.02	16.7	68.72	0.2	11605	5 MISS BUILT UNIT VEH HAD NON CHROME LUG NUTS REMOVE ALL 5 AND INSTALL NEW CHROME LUG NUTS BASIC#	MISS BUILT UNIT WRONG LUG NUTS ON RIGHT REAR WHEEL	Under Limit
2008	1FMDK06W58G	24-Jul-07	6-Sep-07	NORTH BROS. FORD, II	204739A	5K01	6L2Z	1012	BA	B53	38	1	30-Jul-07	0	5	21.56	78.3	99.86	0.9	2975	1012	CUST STATES THAT THE CENTER CAP FELL OFF	Under Limit
2007	2FMDK49C97E	8-May-07	9-Jun-07	PARK FORD	25315601	5K02	6L2Z	1130	AA	B65	33	1	10-Jul-07	2	5	5.75	15.7	21.45	0.2	3853	INSTALLED CENTER CAP ON LEFT FRONT WHEEL	PE08-060 1303	Under Limit

2008 1FTXW43R38E	13-Apr-07	MIDWAY FORD TRUCK	292277B	5K01 *	1007 *	B65	12	1	19-Jun-07	-1	6	0	53.24	53.24	0.6	5009	ATTEMPT TO ADJUST TIRE PRESSURE DURING PDI, FOUND TIRE OFF BEAD, WILL NOT INFLATE. RAISE VEHICLE AND REMOVE RIGHT SIDE WHEELS AND TIRES. RESEAT BEAD AND INFLATE TO SPEC IN TIRE CAGE. CHECK RIM AND REPLACE HUBCAP ON RIGHT REAR WHEEL	TIRE FOR LEAKS, NONE FOUND AT THIS TIME. REINSTALL ON VEHICLE.	CORRECT FOR RIGHT INNER TIRE FLAT	Under Limit
2008 1FTWX31R78E	15-Mar-07	TRI FORD-MERCURY, II	323668B	5K02 7C3Z	1130 AA	B65	7	1	8-Aug-07	-1	7	27.89	17.45	45.34	0.2	8294	HUBCAP FLEW OFF WHEN TEST DRIVING C S ONE WHEEL COVER DID NOT HAVE MERCURY EMBLEM ON IT	HUBCAP FLEW OFF WHEN TEST DRIVING C S ONE WHEEL COVER DID NOT HAVE MERCURY EMBLEM ON IT	Under Limit	
2007 3MEHM07Z77R	19-Jun-07	NORTH SHORE L-M INC	182496B	5K02 7N7Z	1130 A	B02	33	1	12-Jul-07	-1	10	28.48	0	28.48	0	10004	REPLACE HUB CAP	REPLACE HUB CAP	Under Limit	

2007 1FAFP34N17W	29-Jun-07	JOE MACHENS FORD L	51273702	5K02	6S4Z	1130 A	B65	25	1	27-Jul-07	-1	10	22.54	8.59	31.13	0.1	8006	1 REPLACE RIGHT FRONT HUB CAP THAT WAS MISSING RING ... WHEEL STUD STRIPPE D. REPLACE D STRIPED WHEEL STUD ON RT.REAR WHEEL	CUSTOM ER STATES PASS. FRONT HUB CAP WILL NOT STAY	Under Limit
2007 1ZVFT80N175	11-Jun-07	HELFMAN FORD INC	5710951	5K01	6W7Z	1012 BA	B65	42	1	29-Jun-07	-1	10	28.25	39.82	68.07	0.5	4587	REPLACE D ALL LUG NUTS 11 REPLACE D LEFT FRONT CENTER CAP INSPECT ED AND REBALAN CED FRONT TIRES. RETESTE D ALLOK	RIGHT REAR WHEEL HAS DAMAGE TO STUD NUT IS MISSING MIS BUILT UNIT. WRONG LUG NUTS ON RIGHT FRONT WHEEL.	Under Limit
2007 2FMDK46C37E	13-Apr-07	16-Jul-07 ISLAND FORD, INC.	276698A	5K01	6L2Z	1012 BA	B62	38	1	16-Jul-07	0	10	17.25	21.84	39.09	0.2	3650	REPLACE D LEFT FRONT CENTER CAP INSPECT ED AND REBALAN CED FRONT TIRES. RETESTE D ALLOK	EMBLEM ON CENTER CAP FELL OFF	Under Limit
2008 1FAHP24W88G	7-Jun-07	25-Aug-07 CRESTMONT FORD, IN	153742A	5K02	8G1Z	1130 D	B65	33	1	15-Jun-07	0	11	18.37	8.05	26.42	0.1	4369	RETESTE D ALLOK	CK FOR A FRONT END SHIMMY WHEN DRIVING	Under Limit
2007 1FAHP37N57W	29-May-07	GRIFFIN FORD LINCOLN	012173A	5K01	*	1007 *	N24	33	1	16-Jul-07	-1	15	0	40.73	40.73	0.5	6360			Under Limit

2007 1FTPX12V57K	15-Nov-06	14-Jul-07	CARL GREGORY FORD	9432201 5K01 *	1007 *	N25	42	1	12-Jul-07	0	46	0	46.58	46.58	0.7	2684	DROVE VIBRATION NONE THERE TEST DROVE VECH FOR 5 MILES FROM 15 TO 65 MPH DID NOT FEEL ANY ABNORMAL VIBRATION NOISE WAS COMING FROM A CAN IN BED OF TRUCK TEST DROVE VECH WITH CHASSIC EARS	CUST STATES VIBRATION AT VARIOUS SPEEDS	Under Limit
2007 1FAFP28187G	16-Aug-06	20-Jun-07	BUSS FORD SALES	1346291 5K02 5G1Z	1130 BA	B65	81	1	3-Jul-07	1	60	16.13	8.89	25.02	0.1	1857	REPLACE DRIVERS SIDE FRONT CENTER CAP MISSING AT RT FRONT WHEEL ORDERED AND REPLACED MISSING CENTER CAP	RT FRONT CENTER CAP IS MISSING FOUND AT DELIVERY DROP OFF	Under Limit
2007 5LTPW18527F	30-May-07	20-Jul-07	ALBUQUERQUE LINCOLN	11900305 5K02 7L7Z	1130 B	L69	42	1	15-Jun-07	0	62	24.77	9.41	34.18	0.1	10140			Under Limit



2007 1FTPW14547F	13-Feb-07	4-Jun-07	MAXWELL FORD	789278A	5K01 *	1007 *	G29	42	1	9-Jun-07	1	104	0	41.75	41.75	0.5	2923	110 SENSOR S UNTRAIN ED TPMS DIAG,PIN POINT TEST,MO NITOR PIDS,ONE OF THE SENSOR S NOT READING PROPERL Y,RE TRAIN SENSOR S,ROAD TEST OK LIGHT OFF BEFORE LF(OD580 1)LR(OD5 841)RF(O D597B)R R(OB8C0 5) AFTER T1340	C S TIRE LIGHT ON AFTER IT WAS IN HERE YESTERD AY	Under Limit	
2007 1FTPW12V87F	1-Jun-07	18-Jul-07	TAMIAMI FORD, INC.	24319401	5K02	6L3Z	1130 D	B65	D4	1	1-Aug-07	1	125	50.43	0	50.43	0	1286	VERIFIED CONCER N INSTALLE D CENTER CAPS IN DRIVEWA Y	C S PASS FT AND RR WHEEL CENTER CAPS ARE PEELING	Under Limit
2007 1FAFP31N97W	14-May-07	31-Jul-07	PARR FORD, INC.	18647801	5K02	6S4Z	1K01 A	B65	33	1	8-Aug-07	1	129	8.71	8.53	17.24	0.1	8606	VERIFIED , ORDERE D PARTS. GAVE PARTS TO CUSTOM ER TO INSTALL	TO RIGHT REAR LUG COVERS POPPED OFF	Under Limit



2007 2FMDK46C47E	29-Mar-07	8-Aug-07	PHIL LONG FORD, LLC	78348201	5K01	7T4Z	1A04:A	B65	1	1	9-Aug-07	1	262	44.1	17.98	62.08	0.2	3140	999A TIME TO REPLACE LOCKING LUG NUTS BROKEN TOO SHORT REPLACE D ALL WITH NEW LUGS. CK ALL WHEELS REINDEX LR TIRE BALANCE ALL WHEELS REINDEX LR TIRE CK RUNOUT REBAL ALL WHEELS	CUSTOMER STATES THAT THE WHEEL LOCK LUG NUTS HAVE BROKEN OFF. PLEASE REPLACE WITH NEW LOCKING LUGS.	Under Limit
2007 1FMEU63E47U	21-Feb-07	11-Jun-07	CARL GREGORY FORD	9354501	5K01	*	1007 *	N23	D9	1	13-Jun-07	1	337	0	79.85	79.85	1.2	2684	REPLACE D CENTER CAP ON RF WHEEL.	CUSTOMER STATES VEH HAS VIB AT 75 80 MPH	Under Limit
2007 1FAHP24197G	12-Oct-06	30-Apr-07	DONLEY FORD LINCOL	11148301	5K02	5G1Z	1130 CA	B65	33	1	28-Jun-07	2	350	15.05	7.53	22.58	0.1	2263		RF CENTER CAP FELL OFF, COULD NOT FIND.	Under Limit



2007	2MEFM74V37X	13-Dec-06	21-May-07	PAUL CERAME LINC-MI	292961A	5K02	5W3Z	1130	DA	B65	42	1	30-Jul-07	3	766	23.06	10.25	33.31	0.1	12825	REPLACE D DRIVERS FRONT WHEEL COVER ASSY IS LOOSE AND WOBBLE S AFTER ATTACHI NG NUTS ARE TIGHTEN ED. TRACED AND DIAG. INSTALLE D CHASSIS EAR. COULD NOT DUPLICA TE CUSTOM ERS CONCER NS AT THIS TIME	B65 CUST SAYS L F HUB CAP IS LOOSE AND RATTLES, WONT TIGHTEN, VERIFIED IN SERVICE ISLE	Under Limit
2008	1FTXW43R88E	12-May-07	22-May-07	LILLISTON FORD, INC.	196490D	5K01	*	1007	*	N59	42	1	19-Jun-07	1	809	0	56.4	56.4	0.7	1254	CUSTOM ER STATES RATTLE NOISE FROM REAR AREA	Under Limit	
2007	3FRML55Z87V	16-Nov-06		KIMNACH FORD INC	5277201	5K02	*	1700	*	H62	7	1	19-Jun-07	-1	820	0	25.47	25.47	0.3	6716	R R R REAR TIRE TO SECURE VALVE STEM.	CUST STATES RIGHT REAR TIRE WILL NOT HOLD AIR PRESSU RE	Under Limit

2007 1FAHP28197G	18-Aug-06	29-May-07	DEWEY FORD, INC.	43102102	5K02	5G1Z	1130 BA	F41	34	1	14-Jun-07	1	914	30.1	15.85	45.95	0.2	3540	FLAW IN MATERIAL COATING OVER THE WHEEL COVER REPLACE WHEEL COVERS	CUSTOMER STATES RIGHT FRONT AND RIGHT REAR CENTER CAPS ARE PEELING	Under Limit
2007 2MEFM74V67X	22-Mar-07	18-Jul-07	BAY LINCOLN-MERCUF220454A	5K02	5W3Z	1130 DA	B65	P3	1	24-Jul-07	1	1060	23.06	6.91	29.97	0.1	10248	1060 VERIFIED L.R HUB CAP HAS PEELING CROME REPLACE D HUB CAP REPAIRED	C S LEFT REAR HUB CAP IS PEELING CROME SOP	Under Limit	
2007 1FMFU15577L	22-Mar-07	28-May-07	THORNHILL FORD-MEF083501A	5K01	*	1007 *	B43	42	1	9-Jun-07	1	1095	0	45.55	45.55	0.6	6844	TEST DROVE DID NOT PULL CHECKED ALIGN AND SET FRONT TOE TO LEVEL STEERING WHEEL	TRK PULLS TO THE RIGHT HARD	Under Limit	
2008 1FTXW43R08E	30-May-07	30-Jun-07	NICK NICHOLAS FORD,	4989853	5K02	8C3Z	1130 C	B65	7	1	12-Jul-07	1	1348	64.81	13.64	78.45	0.2	1200	REPLACE REAR HUB CAP FELL OFF REPLACE MISSING REAR HUB CAP	CUSTOMER STATES LEFT REAR HUBCAP CAME OFF	Under Limit

2008 1FMCU03Z58K	23-Apr-07	19-May-07	CAVALIER FORD	936888A	5K02	*	1708	1	N59	33	1	18-Jul-07	3	1425	0	69.6	69.6	0.8	6633	WAR ROADTE ST VERIFIED 2 DIFFERENT RATTLES, FOUND A PORTABLE VACCUM CLEANER IN RIGHT STOWAGE, REMOVE & DROVE AGAIN,1 RATTLE PULL OFF SIDE OF ROAD 7 FOUND JACK NOT SECURE D AND HANDLE LOOSE,IN STALL P	ROPERLY AND TIGHT ,ROADTE ST WITH CUSTOMER AND VERIFIED CONCERN FIXED. (SAM WILL NEED M	REAR OF VEH A RATTLE NOISE,SA ID POSSIBLE REAR HATCH AREA.NO T NOTICING DOME LITE FLICKER	Under Limit
2008 1FTWW33R38E	25-Jun-07	13-Jul-07	DON CHALMERS FORD	4513151	5K02	5C3Z	1130	XA	C50	42	1	21-Aug-07	2	1485	61.77	0	61.77	0	1487	PART ONLY	CUSTOMER STATES RIGHT REAR HUBCAP FELL OFF ON HIGHWAY AND WAS RUN OVER BY BIG TRUCK SOP PART REORDERED AND IS IN	Under Limit	

2007 1FAHP31N67W	30-May-07	30-Jun-07	LANDMARK FORD, INC.673248A	5K02	6S4Z	1K01 A	B66	33	1	13-Aug-07	2	1540	4.35	9.64	13.99	0.1	8559	1540 WARR FOUND LUG NUT COVER MISSING. INSTALLE D LUG NUT COVER.	MISSING LUG NUT LEFT REAR WHEEL	Under Limit	
2007 2FMDK46C37E	28-Mar-07	5-May-07	PHIL LONG FORD, LLC 78422601	5K01	7T4Z	1A04 A	B65	1	1	17-Aug-07	4	1580	44.1	17.98	62.08	0.2	3140	999A TIME TO REPLACE LOCKING LUG NUTS	WHEEL LOCK BROKE IN HALF CUST ST FRONT WHEEL WELLS MAKES NOISE W TURNS & SOMETIM ES GOING STRAIGH T	Under Limit	
2007 2FMDK48C77E	15-May-07	28-May-07	OASIS FORD	1495151	5K02	* 1130 *	N59	42	1	31-Jul-07	3	2011	0	19.29	19.29	0.2	3604	CLICKING NOISE ADDITION AL MISC. REPAIRS		Under Limit	
2007 1FAFP34N47W	5-Mar-07	1-May-07	SOUND FORD INC	16094003	5K02	6S4Z	1130 A	B65	33	1	31-Jul-07	4	2032	22.54	8.81	31.35	0.1	8511	HUB CAP FELL OFF TORQUE D RIM TO SPECS & INSTALLE D NEW HUB CAP, CHECK OPPERAT ION IS NORMAL AT THIS TIME.	CUST STATES ONE REAR HUBCAP FLEW OFF DRIVING	Under Limit
2007 1FAHP34N87W	20-Mar-07	12-Apr-07	ELYRIA FORD	086964B	5K02	6S4Z	1K01 A	B65	33	1	12-Jul-07	4	2450	4.35	7.86	12.21	0.1	4163	REPLACE LUG NUT COVER	C S RT FRT WHEEL LUG NUT COVER FELL OFF	Under Limit



2007 1FMDK02147G	28-Jun-06	6-Apr-07	BERGSTROM NEENAH-	10166303	5K01	6L2Z	1012 BA	B65	5	1	7-Jun-07	3	2704	12.94	16.23	29.17	0.2	6226	REPLACE D 3 RUSTED LUG NUTS NUT MISSING ON HUBCAP HAD TO REMOVE WHEEL TO REMOVE CAP REPLACE W NEW OK	GUEST STATES THAT DRIVERS SIDE REAR TIRE LUGS ARE RUSTING REST OF TIRES ARE NOT	Under Limit
2007 1FAFP34N97W	16-Feb-07	1-May-07	HERB CHAMBERS FOR	7889902	5K02	6S4Z	1130 B	B65	33	1	24-Jul-07	3	3067	22.54	9.38	31.92	0.1	8828	OK	PASS FRONT VALVE STEM CAP MISSING	Under Limit
2007 1ZVFT82HX75	18-Aug-06	19-Mar-07	CASA FORD LINCOLN	1670815B	5K01	*	1007 *	A40	42	1	22-Jun-07	4	3127	0	29.8	29.8	0.4	20455	3127 CHECK AT SET TIRES PSI TO 35 RESET TIRES WITH OTC TOOL CLEAR LIGHT TEST DROVE A40 3 36 WARR	LOW TIRE WARNIN G LAMP CANNOT BE RESET	Under Limit
2007 1FAHP34N37W	12-Mar-07	30-Apr-07	JACK BYRNE FORD & N	353934B	5K02	6S4Z	1K01 A	B65	33	1	23-Jul-07	3	3135	13.06	14.88	27.94	0.2	20700	REPLACE MISSING CAPS	MISSING LUG CAPS	Under Limit

3192 C  
 1007  
 CC30  
 1007D3T  
 0.7 FLAG  
 TECH 449  
 070 TEST  
 DROVE  
 VEHICLE  
 VERIFIED  
 VIBRATIO  
 N  
 CONCENTR  
 N.  
 INSPECT  
 ED  
 FRONT  
 AND  
 REAR  
 TIRES  
 FOR  
 BALANCE  
 . TIRES SET TIRE  
 OUT OF PRESUR CHECK  
 VALANCE RE. AND  
 D REROAD ADVISE  
 CAUSED TEST TO STEERIN  
 VEBRATI VERIFY G  
 ON. SPIN REPAIRS WOBBLE  
 BALANCE FLAG S IN

2007 1FAFP34N77W [REDACTED] 27-Mar-07 6-Apr-07 SANTA MARGARITA FO361541A 5K01 \* 1007 \* H21 33 1 10-Aug-07 5 3189 0 67.25 67.25 0.7 1597 TIRES. TECH 449 GENERAL Under Limit

2007 1FTRF12217K	29-Aug-06	20-Feb-07	RICART FORD	240919A	5K02	*	1708	1	N40	41	1	6-Jun-07	4	3197	0	77.93	77.93	1	2185	RATTLE TEST DROVE VERIFY CONCER N .NOISE ON RT SIDE ADJUSTE D AND LUBE RIGHT SIDE DOOR LATCHES TEST DROVE NOISE STILL THERE REMOVE D JACK AND TOOLS.T EST DROVE PUT FOAM TAPE BEHIND BRACKET	PUT FOAM TAPE UNDER JACK AND TOOLS DROVE NOISE GONE	CUST STATES THE DR SIDE DOOR RATTLES WHEN YOU HIT A BUMP, INTERMIT TANTLY LIKE THE DOOR IS NOT SHUT ALL THE WAY , GOING OVER RAIL ROAD BUMPS	Under Limit
2007 1FAFP34N97W	27-Mar-07	10-May-07	BEECHMONT FORD INC	360301D	5K01	6S4Z	1012	BA	B65	33	1	9-Jul-07	3	3279	4.82	14.93	19.75	0.2	2058	3284 CHECK FOR ONE LUG NUT HAS NO COVER INSTALL NEW LUG NUT ON RIGHT FRONT		CHECK FOR ONE OF THE LUG NUTS HAS NO COVER CAP	Under Limit
2007 1FAHP34N17W	19-Feb-07	9-May-07	DONLEY FORD-LINCOL	50839101	5K02	6S4Z	1K01	A	B65	33	1	11-Jul-07	3	3476	8.71	14.17	22.88	0.2	8287	LUG NUT COVERS FELL OFF LEFT FRONT REPLACE 2 LUG NUT COVERS		REPLACE LUG NUT COVERS PE08-060 1317	Under Limit

2008 1FTSW20Y88E	28-Mar-07	12-Apr-07	CITRUS FORD	61156701	5K02	7C3Z	1130 A	B65	33	1	12-Jun-07	3	3547	26.03	0	26.03	0	5513	REPLACE D HUP CAP THAT FELL OFFNO CHARGE LABOR	HUP CAP FELL OFF WHILE DRIVING	Under Limit
2007 3FAHP07Z27R	26-Aug-06	13-May-07	PASADENA FORD, INC.	3076952	5K02	6E5Z	1130 AA	B65	7	1	13-Aug-07	4	3548	23.81	8.82	32.63	0.1	4223	WHEEL RING HUB CAP WHEEL COVER REPLACE CORROSI ON DIGITAL IMAGES SENT TO FORD, FORD APPROV ED REPLACE MENT OF ALL 4 CENTER CAPS.	R FRONT WHEEL COVER FALLS OFF	Under Limit
2007 4M2CU97117K	30-Aug-06	14-Oct-06	HEMPSTEAD LINCOLN	74612501	5K02	5E6Z	1130 AA	B65	D4	1	2-Jul-07	9	3551	52.02	21.05	73.07	0.2	11208	INSTALL BROKEN CENTER CAP	CENTER CAPS CUSTOM ER STATES LUGNUT IS MISSING FROM THE HUB CAP	Under Limit
2007 1FTRX14W27N	28-Aug-06	30-Apr-07	CHAPMAN FORD SALE	15478901	5K02	5L3Z	1130 EA	B65	42	1	6-Jul-07	3	3815	57.34	7.46	64.8	0.1	3955			Under Limit

2007 3MEHM07147R	30-Aug-06	15-Jan-07	SOUTHGATE LINCOLN	9836252	5K02	6N7Z	1130 AA	B65	5	1	15-Jun-07	6	4121	45.36	17.32	62.68	0.2	10671	INSPECT VERIFY CONCERN, REMOVE RIGHT FRONT AND LEFT REAR TIRE ASSY., REMOVE CENTER PIECES RE INSTALL VERIFY REPAIRS TIME RAN ON PREVIOUS LINES	CUSTOMER STATES TWO CENTER CAPS ARE OXIDIZING	Under Limit
2007 1FTPW12V77K	27-Feb-07	8-Jun-07	CHAMPION FORD KATY	526520C	5K02	5F9Z	1700 AB	B65	1	1	1-Aug-07	2	4247	1.64	15.75	17.39	0.2	4617	4247 INSPECTED TIRES FOR LEAK FOUND VALVE STEM CORE TO BE LEAKING BROKE DOWN TIRE REPLACED VALVE STEM CORE REMOUNTED & BALANCED TIRE RETESTED, NO LEAKS FOUND	C S THAT FRONT DRIVERSIDE TIRE HAS SLOW LEAK.	Under Limit

2007 2FMDK49C17E	11-Apr-07	3-May-07	MIDWAY FORD TRUCK 293378C	5K01 *	1007 *	N51	33	1	10-Jul-07	3	4400	0	62.11	62.11	0.7	5009	VERIFIED CONCERN IDENTIFIED BOLTS TO SPARE TIRE HANGER LOOSE TIGHTEN BOLTS AND RECHECK OPERATION OK. MTIME FOR ABNORMAL DIAGNOSIS. CHECKED FOR NOISE UNABLE TO DUPLICATE AT THIS TIME	CORRECT FOR RATTLE TYPE NOISE IN REAR OF VEHICLE	Under Limit
2007 3FAHP02107P	24-Nov-06	14-Dec-06	DAVIDSON MOTOR COI095788D	5K01 *	1007 *	N58	63	1	13-Aug-07	9	4428	0	13.8	13.8	0.2	7509	CHECK PANEL UNDERNEATH STEERING COLUMN LOOSE.	Under Limit	

2007 1FMEU64E17U	30-Aug-06	27-Mar-07	PAYTON-WRIGHT FORI487416B	5K02 *	1708	1	N59	33	1	25-Jun-07	4	4625	0	16.2	44.2	0.2	2413	4625 LOOSE SPARE TIRE CC33 17081 TEST DROVE VEH TO VERFIY CONCER N TRACED CONCER N TO LOOSE SPARE TIRE THIGHEN LOOSE SPARE TIRE RE TEST DROVE WITH SERVICE ADVISOR OK AT THIS TIME CHECKE D ROAD TEST UNABLE TO DUPLICA TE AT THIS TIEM	N59 RATTLE FROM REAR OF VEH RT SIDE ON BUMPS CANNOT TELL IF ITS INSIDE OR OUTSIDE	Under Limit
2007 3LNHM26TX7F	30-Nov-06	2-Apr-07	DAVIDSON MOTOR COI093981C	5K01 *	1007 *		N58	33	1	25-Jun-07	3	4659	0	48.29	48.29	0.7	7509	CHECK STEERIN G COMING APART.	Under Limit	

2007 1FAHP31N57W	14-Dec-06	17-Apr-07	SAWGRASS FORD	64815701	5K01	6S4Z	1012 BA	B65	42	1	13-Jun-07	2	5261	9.63	16.26	25.89	0.2	4908	INSPECT ED FOUND BAD THREADS ON TWO LUG NUTS REPLACE D TWO LUG NUTS CHECK ALL OTHERS OK	TWO LUG NUTS ARE COMMING ON AND OFF TIGHT	Under Limit
2007 1FTPW14517F	9-Jan-07	27-Feb-07	TASCA FORD	446618D	5K02	5L3Z	1130 EA	B65	33	1	7-Aug-07	6	5270	57.34	8.7	66.04	0.1	796	REPLACE HUB CAP	C S THAT THE LEFT REAR HUB CAP IS MISSING FORD EMBLEM.	Under Limit
2007 1FAHP24187G	3-Oct-06	9-Apr-07	HUB CITY FORD, INC.	11277301	5K02	5G1Z	1130 CA	B66	82	1	26-Jul-07	4	5328	15.05	7.3	22.35	0.1	6481	FELL OFF CC82 REINSTA LL CAP	CUST STATES CENTER CAP FELL OFF OF LEFT FRONT WHEEL.	Under Limit



2007	1FAFP34N27W		26-Jul-06	22-Nov-06	CUTTER FORD, INC.	405805A	5K02	6S4Z	1K01 A	B65	33	1	20-Jul-07	9	5355	4.35	9.99	14.34	0.1	7908	5355 CUST STATES THAT L R LUG NUT COVER COMES OFF. CHK & VERIFIED CUST CONCER N. L R LUG NUT LOOSE. INSTALL NEW LUG NUT COVER VERIFIED ALL REPAIRS PERFOR MED QUALITY CHECK	CUST STATES THAT LUG NUT COVER ON THE LEFT REAR IS COMES OFF MT1K011 NO OPERATI ON NUMBER FOR REPAIRS	Under Limit
------	-------------	--	-----------	-----------	-------------------	---------	------	------	--------	-----	----	---	-----------	---	------	------	------	-------	-----	------	--	---	-------------

2007 1FTYR10D67P		21-Aug-06	7-Oct-06	JIM CLICK FORD, LINCC 47100604 5K01 *	1007 *	N27	D9	1	4-Jun-07	9	5401	0	74.87	74.87	0.9	20402	OFF ROAD FORCE HIGH CHECK BALANCE AND ROAD FORCE, REINDEX THREE TIRES TO LOWER ROAD FORCE AND REBALANCE FOUR. R T OK. NOTE THAT SOME ROAD FEEL WILL BE NORMAL WITH RACK AND PINION STEERIN	FACTORY WARRANTY FRONT END CUSTOMER STATES VEHICLE SHAKES AT HWY SPEEDS	N27	Under Limit
------------------	--	-----------	----------	---------------------------------------	--------	-----	----	---	----------	---	------	---	-------	-------	-----	-------	--	---	-----	-------------

2007 1ZVHT80N4752	15-Nov-06	23-Feb-07	JIM CLICK FORD, LINCOLN	49750902	5K01	*	1007	*	G32	42	1	13-Jul-07	5	5524	0	66.56	66.56	0.8	20402	1 UPON INSPECTION L F 31 PSI, R F 32 PSI, R R 30 PSI, L R 33 PSI. INFLATED TO 35 PSI, AS PER FACTORY SPEC. TEST DROVE, AND FAULT STILL PRESENT. RE TRAINED TIRE MONITOR S. ROAD TESTED GOOD. INDICATOR REMAINED OFF.	CUSTOMER STATES TIRE PRESSURE MONITOR FAULT INDICATORS STAYS ON AT ALL TIMES. CHECK AND ADVISE.	G32	Under Limit
2007 2MEFM74VX7	22-Mar-07	3-May-07	FIESTA LINCOLN MERC	11292902	5K02	3W3Z	1130	CA	B65	33	1	26-Jun-07	2	5892	22.34	9.04	31.38	0.1	11896	TECH VERIFIED CENTER CAP CAME OFF, INSTALLED NEW CENTER CAP ON RIGHT SIDE WHEEL	FRONT RIGHT WHEEL CENTER CAP CAME OFF, NO PART TO RETURN		Under Limit
2007 1FAFP34N57W	2-Apr-07	22-May-07	FAMILY FORD, INC.	21872601	5K02	6S4Z	1K01	A	B02	1	1	7-Jul-07	2	5930	8.71	14.71	23.42	0.2	3372	INSTALL 2 LEFT REAR LUG NUT COVERS	INSTALL SOP 2 LUG NUT COVERS		Under Limit
2006 1FAHP28106G	13-Jan-06	23-Feb-07	B & B FORD SALES INC	7689701	5K02	5G1Z	1130	BA	B65	5	1	3-Jul-07	5	5931	15.05	6.93	21.98	0.1	6329	REPLACE WHEEL CENTER CAP	WHEEL CENTER CHROME	PER 106-060-0325	Under Limit

2007 1FAHP34N37W	13-Dec-06	2-Jan-07	JOHN LANCE FORD	143798B	5K01	6S4Z	1012 BA	B65	7	1	18-Jun-07	6	6015	9.63	17.32	26.95	0.2	2284	6015 REPLACE 2 LUG NUTS ON LEFT FRT WHEEL 6162 TIRES OUT OF BALANCE RAISED VEHICLE AND REMOVE D WHEELS, CHECKE D WHEEL BALANCE ON ALL FOUR WHEELS. LR OUT OF BALANCE BY 1.25 OZ, LF 1.75 OZ, RF 1.5 OZ, RR OK. REBALAN CED WHEELS AS NEEDED,	ROVE VEHICLE IN HIGHWA Y WITH SPEEDS RANGING 55 75 MPH, NO VIBRATIO NS FELT.	CUSTOM ER STATES LUG NUT COVERS COMING OFF LOOK AT DRIVERS FRONT TIRE	Under Limit
2007 1FTPW14V37K	14-Feb-07	14-May-07	LITHIA FORD LINCOLN	361533A	5K01	*	1015 *	N25	42	1	23-Aug-07	4	6152	0	41.32	41.32	0.5	3897	999A TIME TO REPLACE LOCKING LUG NUTS TOO SMALL BROKE OFF		LOCKING NUTS TO SMALL AND BROKE OFF	Under Limit
2007 2FMDK49C77E	8-Mar-07	28-Apr-07	PHIL LONG FORD, LLC	78292301	5K01	7T4Z	1A04:A	B65	1	1	2-Aug-07	4	6200	44.1	17.98	62.08	0.2	3140			PE08-060 1326	Under Limit

2008	1FDAW57R58E	23-Feb-07	9-Apr-07	COMMERCIAL MOTOR	1056090C	5K02	2C3Z	1700	CA	N50	D4	1	25-Jul-07	4	6494	25.19	0	25.19	0	4405	REPL VALVE STEM IN L R OUTSIDE WHEEL	BOTH REAR OUTSIDE TIRES LOSE AIR	Under Limit
2007	1FTZR45E47P	8-May-06	19-Feb-07	FINISH LINE FORD, INC	21420304	5K02	5L2Z	1130	BA	B65	D4	1	8-Aug-07	6	6644	11.88	7.62	19.5	0.1	20192	NEEDS NEW ONE 1 ROAD TEST VERIFY NOISE INSTALL CHASSIS EARS TIGHTEN HCU COVER	CUSTOMER STATES THAT WHEEL COVER IS LOOSE DAMAGE D	Under Limit
2006	2FMZA52226B	7-Sep-05	25-Aug-06	LILLISTON FORD, INC.	197277B	5K01	*	1007	*	R30	42	1	11-Jul-07	11	6821	0	56.4	56.4	0.7	1254	RIGHT FRONT WHEEL CIOVER HAS LOST THE PLASTIC CAP THAT COVER S THE LUG NUT.FULL COVER , 6 SPOKE	Under Limit	
2007	1FAFP31N57W	10-Nov-06	30-Jan-07	RUSTY ECK FORD, INC	32603701	5K02	6S4Z	1130	B	B65	33	1	26-Jul-07	6	6985	22.54	8.77	31.31	0.1	5319	INSTALL LUG NUT CAP FOR WHEEL COVER ON RIGHT FRONT WHEEL	Under Limit	

2007 1FAFP34N77W	11-Aug-06	15-Dec-06	CLAIR FORD LINCOLN	256927A	5K01 *	1007 *	H25	D9	1	16-Jun-07	7	7057	0	79.78	79.78	1.1	8814	ROAD TEST, VERIFY PULL. SET AIR PRESSURE LOW ROTATE TIRES. FOUND TIRE SHAKE. PULL AND BALANCE ALL 4 TIRES ALSO FOUND HUB CAPS TO SIT OFF CENTER	CONCERN. VEHICLE PULLS TO THE LEFT WHEN DRIVING	Under Limit	
2007 1FAHP36N47W	1-Nov-06	17-Nov-06	GRAND FORD, INC.	061758A	5K01	6S4Z	1012 BA	B65	42	1	20-Jul-07	9	7156	4.82	6.21	11.03	0.1	7417	TECH REPLACE D CHROME LUG NUT REPLACE ALL 4 HUB CAPS	CUSTOMER STATES LUG NUT COVERS FELL OFF WHILE DRIVING LEFT REAR WHEEL HUB CAPS ARE PEELING	Under Limit
2006 4M2EU47E76U	4-Apr-06	28-Oct-06	H & L FORD, INC.	11496301	5K02	5E6Z	1130 AA	B65	5	1	26-Jun-07	9	7200	52.02	13.36	65.38	0.2	677	TECH VERIFIED AND ORDERED AND REPLACED CAP	FORD EMBLEM CAME OFF RIGHT FRONT HUB CAP	Under Limit

2006	2MEFM74VX6X	4-May-06	11-Nov-06	ELMHURST LINCOLN-M	6410951	5K02	*	1130	*	N50	33	1	28-Jun-07	8	7418	0	19.95	19.95	0.2	13660	99A VERIFY CONCERN, LUBE AND TIGHTEN ALL WHEEL CAPS AS NEEDED. RETEST OK	CUSTOMER STATES THAT THERE IS A RATTLING TYPE OF NOISE WHEN DRIVING OR OVER BUMPS FROM RIGHT SIDE OF VEHICLE.	Under Limit
2007	2MEFM74V47X	2-Mar-07	30-Apr-07	MONTGOMERY FORD L	3692903	5K02	*	1130	*	N50	33	1	11-Jul-07	3	7507	0	37.51	37.51	0.5	6309	CP:1130 ROAD TEST, CK STEERING AND SUSPENSION TIGHTEN HUB CAPS ROAD TEST TO VERIFY REPAIR	SUSPENSION/BRAKES C/S THAT THERE IS A CLICKING NOISE FROM THE RIGHT FRONT WHEEL WHEN GOING 30 C/S THAT COVER CAME OFF CENTER	Under Limit
2007	1FAHP34N37W	6-Nov-06	22-Nov-06	ELYRIA FORD	086536A	5K02	6S4Z	1K01	A	B65	33	1	29-Jun-07	8	7520	4.35	7.86	12.21	0.1	4163	REPLACE CENTER CAP	CAP	Under Limit
2006	1FAHP28136G	9-Nov-05	27-Feb-07	ENFIELD FORD	15422702	5K02	5G1Z	1130	BA	B65	D4	1	27-Jul-07	6	7636	60.2	15.76	75.96	0.2	8821	VERIFY CONCERN ORDERED 4 HUB CAPS REPLACE PEELING HUB CAPS	CUSTOMER STATES HUB CAPS ARE PEELING	Under Limit PE08-060 1329

2007	1FAHP34N67W	11-Sep-06	28-Nov-06	DONLEY FORD LINCOLN	11104702	5K01	6S4Z	1012 BA	B65	33	1	6-Jun-07	7	8442	4.82	15.06	19.88	0.2	2263	LUG NUT MISSING, REPLACE	CHECK RF WHEEL, HAS LUG NUT MISSING.	Under Limit
2006	3LNHM26116R	20-May-06	20-Jul-06	MORROW FORD LINCOLN	2270105	5K02	4W1Z	1130 BA	B65	33	1	28-Jun-07	12	8472	35.91	6.77	42.68	0.1	7327	TTLES FOUND CENTER CAP LOOSE REPLACE CENTER CAP	B65 LEFT FRT CENTER CAP ON WHEEL LOOSE AND RA	Under Limit
2006	1FAHP25116G	8-Dec-05	2-Sep-06	POWER FORD TUSTIN	177109B	5K01	*	1007 *	N17	42	1	15-Aug-07	12	8635	0	55.34	55.34	0.6	5414	8635 L F WHEEL SLIGHTLY LOOSE 1007 CC 33 PERFORMED NVH DIAGNOSIS, FOUND L F WHEEL TWO LUGNUTS SLIGHTLY LOOSE CAUSING WHEEL TO MAKE NOISE. TIGHTENED LUGNUTS AND ROAD TESTED.	CUST STATES CLICK NOISE ON TURNS CHECK AND ADVISE B43	Under Limit
2006	1FTPX14576N	7-Feb-06	29-Dec-06	FAIRLANE FORD SALES	223158D	5K02	4L3Z	1130 AB	B65	D4	1	11-Jun-07	6	8695	52.75	17.18	69.93	0.2	3050	8695 42 1130 REPLAC 3 HUB CAPS WERE PEELING	EMBLEM S ON 3 OF THE WHEEL CENTER CAPS ARE PEELING	Under Limit



2007	1FTYR14D17P		1-May-07	19-May-07	COURTESY FORD INC	7240301	5K01	*	1007	*	N24	42	1	6-Aug-07	3	8811	0	78.91	78.91	0.9	6743	E.	THE CONCERN, CHECKED OASIS. PERFORMED MEDICAL DIAGNOSIS. PERFORMED MEDICAL ROAD FORCE BALLANCE. FOUND THAT ALL TIRES HAD GOOD ROADFORCE VARIATIONS, FOUND THAT THE LEFT REAR TIRE WAS OUT OF BALLANCE.	D OK. CC# D9	CUSTOMER STATES VEHICLE BEGAN TO HAVE A VIBRATION TWO DAYS AGO. HE STATED IT WAS MILD AT FIRST, BUT THEN BECAME PROGRESSIVELY WORSE. NOW THE VIBRATION IS VERY BAD, ESPECIALLY AT A STEADY	Under Limit
------	-------------	--	----------	-----------	-------------------	---------	------	---	------	---	-----	----	---	----------	---	------	---	-------	-------	-----	------	----	--	--------------	--	-------------

2007	1FMFK20537L	24-Oct-06	20-Jan-07	ATCHLEY FORD INC	36762003	5K01	*	1007	*	B65	12	1	22-Jun-07	6	9059	0	39.5	39.5	0.5	7130	1	ROAD TEST, CHECK FOR NOISE, REMOVE LEFT FRONT TIRE, NOISE IN TIRE, DISMOUNT TIRE, FOUND FORIEGN DEBRIS INSIDE OF TIRE REMOVE AND SAVE DEBRIS, ROAD TEST, OK	CUSTOMER SAID HAS A RATTLE NOISE	Under Limit
2006	4M2EU36E76U	25-Jul-06	30-Sep-06	ISLAND LINCOLN MERC	8000151	5K02	5E6Z	1130	AA	B65	81	1	11-Jul-07	10	9229	52.02	14.86	66.88	0.2	11643	1	CENTER CAPS CORRODING PULLED EACH WHEEL OFF AND REPLACED CENTER CAPS	STATES WHEEL CENTER CAPS ARE CORRODING..ODE RE 4 CENTER CAPS USE SPO 07187005	Under Limit

2007 3FAHP06Z87R	1-Sep-06	3-Oct-06	FORD OF CLERMONT, I	1152651	5K02	*	1130	*	N59	33	1	9-Aug-07	11	9546	0	15.37	43.37	0.2	8951	PLACED VEHICLE ON 4 POST LIFT AND VERIFIED NOISE COMING FROM FRONT WHEELS. FOUND LOOSE HUB CAP, REMOVE D HUB CAPS AND FOUND NOISE NOT PRESENT ANYMORE. REINSTALLED HUB CAPS AND REROD TEST, DRIVING	Under Limit	
2007 1FMDK02167G	28-Jun-06	20-Nov-06	DAVIDSON MOTOR COI	094672D	5K01	*	1007	*	N58	63	1	13-Jul-07	8	9615	0	20.7	20.7	0.3	7509	CUSTOMER STATES CLICKINK NOISE FROM DRIVER FRONT WHEN DRIVING ROADTEST VEHICLE FOR NVR. VERIFIED CUSTOMER CONCERN ROAD TEST CHECKED FOR NOISE UNABLE TO DUPLICATE AT THIS TIME	W BUG SHIELD LOOSE	Under Limit

2007	1FMFU18597L	15-Sep-06	24-Nov-06	CHAPMAN FORD SALE	15627501	5K02	*	1130	*	B65	33	1	14-Aug-07	9	9651	0	14.91	14.91	0.2	3955	VERIFIED NOISE IN RIGHT FRONT COMING FROM RIGHT FRONT WHEEL COVER REMOVE WHEEL TIGHTEN WHEEL COVER REINSTALL WHEEL TEST	CUSTOMER STATES THERE IS RUBBING NOISE WHILE DRIVING & ON RIGHT HAND TURNS COMING FROM FRONT OF VEHICLE ROTATIONAL NOISE SLOW YOU GO SLOWER THE NOISE	Under Limit
2006	1ZVHT80N565	17-May-06	19-Jun-06	EWALD'S VENUS FORD	51524201	5K02	4R3Z	1130	FA	B65	33	1	19-Jun-07	13	9679	25.93	8.25	34.18	0.1	3774	LOOSE REPLACE CENTER CAP	CENTER TRIM ON RIGHT REAR WHEEL FELL OFF	Under Limit
2007	1FBSS31L57	2-Apr-07	17-Apr-07	DEWEY FORD, INC.	43661803	5K02	F5TZ	1130	J	B65	7	1	14-Aug-07	4	9684	63.36	7.93	71.29	0.1	3540	1 REPLACE D COVER	HUB CAP FELL OF DRIVING	Under Limit
2007	1FAHP34N57W	16-Nov-06	28-Nov-06	WOODY ANDERSON FC	4967551	5K01	6S4Z	1012	BA	B65	30	1	7-Jun-07	7	9775	4.82	0	4.82	0	5892	WORN REPLACE D WHEEL NUT	CUSTOMER STATES WHEEL NUT TREAD HAS WORN AND WHEEL NUT WILL NOT TIGHTEN, ADVISE FOR WARRANTY.	Under Limit

2007	1FAFP34N87W	16-Oct-06	12-Feb-07	GRAND LEDGE FORD, I066152C	5K01	6S4Z	1012 BA	B65	33	1	24-Jul-07	6	9833	19.26	7.66	26.92	0.1	9099	9833 REMOVE D AND INSTALLE D 4 WHEEL NUTS.TH E COVERS ON THEM CAME OFF. ROAD TEST AND VERIFIED CUSTOM ERS CONCER N INSPECT ED BRAKES AND FOUND NO PROBLE M. NOTICED WHEEL COVERS HAD MARKS WHERE HITTING THE WHEEL RAN OASIS AND FOUND TSB # 06	EVERY WHELL IS MISSING ONE CHROME LUG COVER, PLEASE ORDER	Under Limit
2006	1FAFP34N86W	3-Mar-06	12-Aug-06	ED MULLINAX FORD	266543B	5K02 *	1130 *	N50	42	1	10-Jul-07	12	9851	0	68.22	68.22	0.8	2283	9 5 ROAD TEST TO VERIFY REPAIR PASS .	CS, TICKING NOISE IN LFT FRT SLOWER SPEEDS	Under Limit

2007	1FAHP37N07W	21-Sep-06	16-Oct-06	SUNSET AUTO CO INC	3666104	5K02	6S4Z	1130 B	B65	42	1	11-Jul-07	9	10278	22.54	0	22.54	0	8198	REPLACED HUBCAP	CUSTOMER STATES: THE LEFT FRONT HUBCAP IS FLAKING. SUBMIT TO DIGITAL IMAGE AND ADVISE.	65	Under Limit
2006	1FMPU15586L	20-Jun-06	14-Sep-06	VALLEY ISLE MOTORS	371016C	5K02	F42Z	1700 A	G29	D1	1	16-Jul-07	11	10328	1.68	70.74	72.42	0.7	7839	VERIFIED CONCERN. REPLACE RIGHT REAR WHEEL AIR STEM. RECHECKED. ALL GOOD.	INSPECT AND ADVISE. TIRE LIGHT STAYS ON		Under Limit
2007	1FAHP34N97W	24-May-06	5-Jul-06	DEWEY FORD, INC.	43009401	5K01	6S4Z	1012 BA	B65	69	1	4-Jun-07	12	10443	4.82	31.7	36.52	0.4	3540	1 REPLACE ONE LUG NUT ON LEFT REAR	CAN NOT REMOVE ONE LUG NUT TOWED IN LUG NUT WILL NOT COME OFF		Under Limit
2006	1FTRX14W96N	17-Feb-06	17-Nov-06	BARTON FORD-LINC-M	3404703	5K01	*	1007 *	N25	D9	1	6-Jun-07	7	10644	0	59.56	59.56	0	6747	CP 1007 OSL TO ROAD FORCE BALANCE TIRES INVOICE 14117736 CP:1007 NEEDS GRD FORCE BALANCE	WHEN YOU GO OVER 30 MPH THE LEFT SIDE OF THE TRUCK SHAKES	08-060 1336	Under Limit

2008	1FTXW43RX8E	7-Feb-07	18-Mar-07	RICART FORD	244183G	5K02	5C3Z	1130 NA	B65	14	1	28-Jun-07	4	10960	42.8	7.79	50.59	0.1	2185	10967 8055 PASS. FRONT CENTER CAP CHROME PEELING OFF. WARR. INSPECT ED PASS. FRONT CENTER CAP. FOUND CHROME PAINT PEELING OFF. NEC. TO REMOVE OLD CHROME CAP AND INSTALL NEW ONE. INSTALLE D. OK AT	S TIME. 8055	CUST STATES THE PASS SIDE FRT CENTER CAP CHROME IS PEELING INSTALL SOP	Under Limit
2006	4M2EU48866U	2-Mar-06	10-Oct-06	LAZARE LINCOLN-MER	35161902	5K02	5E6Z	1130 AA	B65	81	1	23-Aug-07	11	11414	52.02	15.85	67.87	0.2	10243	VERIFIED .REPLAC ED CENTER CAPS		STATES WHEEL CENTER CAPS ARE CLOUDIN G UP C S RR LUG NUT CAPS KEEP LOOSING OFF	Under Limit
2007	1FAHP34N27W	13-Feb-07	1-Mar-07	DEMPEWOLF FORD LIM	1525351	5K01	6S4Z	1012 BA	B65	7	1	26-Jul-07	5	11645	14.45	16.37	30.82	0.2	5668	INSTALLE D TWO LUG NUTS WPI			Under Limit

2007 1FAFP34N47W	1-Nov-06	20-Jan-07	HARRELSON FORD, INC	7603351	5K01	6S4Z	1012 BA	B65	1	1	29-Aug-07	8	12014	22.82	47.29	70.11	0.6	1071	BROKEN BOLT(S) REAR HUB REPLACE	C S THAT DRIVERS SID REAR LUG NUT HARD TO GET OFF AND PASS SIDE REAR MISSING CK AND ADV	Under Limit
2007 1FAFP34N77W	22-Nov-06	8-Aug-07	ULRICH MOTOR CO.	11692301	5K02	6S4Z	1K01 A	B65	39	2	16-Aug-07	1	3	4.35	6.91	11.26	0.1	3457	REPLACE LUG NUT COVER	LUG NUT COVER MISSING	Under Limit
2007 1FTNE24W27D	26-Apr-07	5-Jun-07	MONACO AND SONS M	271137A	5K02	F8UZ	1130 AA	B65	7	2	24-Jul-07	2	5	40.47	7.76	48.23	0.1	8896	VERIFIED HUB CAP WILL NOT STAY ON PROPERLY, REPLACE D AND RECHECK, OK. REMOVE D RIGHT FRONT AND REAR TIRES, REMOVE D FORD LGO CENTER CAPS, INSTALLED MERCURY LOGO CENTER CAPSPUT TIRES BACK ON	A HUB CAP FELL OFF WHEN DRIVING FROM DEALERSHIP	Under Limit
2007 4M2EU37E07U	31-Aug-06		CITRUS FORD	61500502	5K02	5E6Z	1130 AA	B65	33	2	17-Jul-07	-1	16	26.01	17.68	43.69	0.2	5513	VEHICLE		Under Limit



2008 2FAHP74V88X	7-May-07	5-Jun-07	JIM CLICK FORD, LINCK 48144202 5K01 *	1007 *	H19	42	2	19-Jun-07	1	77	0	49.91	49.91	0.6	20402	1 CHECKE D TIRE PRESSU RE AND ADJUSTE D OK RETRAIN NED TIRE PRESSU RE SENSOR S RETESTE D OK. 148 C 1007 CC 30 1007D3T .8 TECH 449 080 TEST DROVE VEHICLE VERIFY VIBRATIO N CONCER N.SPIN BALANCE D FRONT AND REAR TIRES OUT OF BALANCE D CAUSE VIBRATIO N, SET TIRE PRESSU RE. REROAD TEST VEHICLE	FACTORY WARRAN TY CUSTOM ER STATES TIRE MONITOR CONTINU ALLY GOES OFF ADVISE H19	Under Limit	
2007 1FTNE14W47D	1-Dec-06	17-Jul-07	SANTA MARGARITA FO360499A 5K01 *	1007 *	N27	30	2	21-Jul-07	1	145	0	76.86	76.86	0.8	1597	OPER .	ATING AS DESIGNE D AT THIS TIME FLAG TECH 449	C50 DIAGNOS E AND INSPECT ON CAUSE OF SHIMMY IN FRONT WHEELS	Under Limit

2007 3LNHM28T87R	3-Jan-07	26-Jun-07	SOUTHGATE LINCOLN	9898951	5K02	4W1Z	1130 DA	T53	D4	2	2-Jul-07	1	269	39.86	8.66	48.52	0.1	10671	CENTER CAP REPLACE D LEFT FRONT CENTER CAP LETTERING IS NOT PAINTED.	CUSTOMER STATES CENTER CAP IS MISSING PAINT IN LETTERING PLEASE CHECK AND ADVISE. (LEFT FRONT CAP)	Under Limit	
2007 1FAHP24137G	22-Sep-06	31-May-07	BYERLY FORD INC	378259A	5K02	5G1Z	1130 CA	B65	1	2	14-Aug-07	3	324	30.1	0	30.1	0	5702	324 REPL 2 CENTER CAPS	C S LEFT FT AND RT REAR CENTER CAPS ARE BROKEN? CUST STATES HEAR NOISE FROM L REAR WHILE DRIVING INSTALL SOP	Under Limit	
2007 1ZVHT85H775	10-Apr-07	17-Jul-07	VISTA FORD	017416B	5K02	6R3Z	1130 E	N51	D4	2	28-Jul-07	1	506	23.7	9.08	32.78	0.1	7923	506 INSTALLED LR HUB CAP	FOUND VIBES IN WHEEL AT 50MPH CHECKED AND BALANCED TIRES AND PUT BEST ON FRONT RETESTED ALL OK 1227 WARR REPLACE D CENTER CAP	WHEN YOU APPLY BRAKES THE STEERING WHEEL SQUEAKS C S LEFT REAR CENTER CAP IS BROKEN? PE08-08606340	Under Limit
2007 1ZVFT80N475	2-Feb-07	19-May-07	THORNHILL FORD-MEF	083510B	5K01	*	1007 *	B43	42	2	9-Jun-07	1	1176	0	75.92	75.92	1	6844			Under Limit	
2007 1FAHP24117G1	5-Feb-07	8-Jun-07	BYERLY FORD INC	379459A	5K02	5G1Z	1130 CA	B65	1	2	30-Aug-07	3	1227	15.05	7.68	22.73	0.1	5702			Under Limit	



2006	2MEFM74V96X	1-Feb-06	19-Apr-07	ELMHURST LINCOLN-M	6330151	5K02	5W3Z	1130	DA	B65	1	2	5-Jun-07	2	1527	49.41	19.95	69.36	0.2	13660	WHEEL COVERS WHEEL RING HUB CAP WHEEL COVER REPLACE	CUSTOMER STATES BOTH REAR WHEEL COVERS CHROME FINISH IS CRACKING AND PEELING CUSTOMER STATES DRIVERS SIDE REAR TIRE LOSES AIR RIGHT REAR TIRE HAS LUG NUT CAP MISSING	Under Limit
2006	1FTWX31566E	14-Feb-06	31-Jan-07	MATHEWS FORD LINCOLN	238650A	5K02	5F9Z	1700	AB	B65	42	2	19-Jun-07	5	1630	1.64	22.59	24.23	0.3	2265	1630 REPLACED FAULTY VALVE STEM		Under Limit
2007	1FAHP34N77W	2-Aug-06	24-Jul-07	PORCARO FORD	81101	5K01	YS4Z	1012	BA	B65	33	2	29-Aug-07	2	1776	4.61	17	21.61	0.2	6190	REPLACED LUG NUT. WPI CHARGED AND LOAD TEST BATTERY WITH ROTUNDRACHARGE R PASS CHECKED CHARGING SYSTEM OK	C S THAT THE VEHICLE STARTED AND DIED AND WOULD NOT RESTART NO CRANK	Under Limit
2008	1FMCU49H88K	5-Apr-07	24-Apr-07	GRIFFIN FORD LINCOLN	011867A	5K01	*	1100	*	D02	42	2	9-Jul-07	3	2000	0	73.32	73.32	0.9	6360			Under Limit

2007 1FAHP31N77W	30-Apr-07	13-Jun-07	LANDMARK FORD, INC.670666C	5K02	6S4Z	1K01 A	B65	42	2	19-Jul-07	2	2214	4.35	19.28	23.63	0.2	8559	2214 WARRAN TY VERIFIED CONCER N OF MISSING LUGNUT COVER ON RIGHT WHEEL. INSTALLE D NEW LUGNUT COVER CHECKE D OTHER LUGNUT COVERS. ALL OK AT THIS TIME FAILED VALVE STEMS NECESSA RY TIME TO INSPECT AND FOUND BOTH REAR TIRE VALVE STEMS LEAKING RIM REPLACE BOTH AND REINSTA LL	MISSING LUG COVER RIGHT FRONT WHEEL CUSTOM ER STATES RIGHT TIRE LOOSES AIR SEEMS TO END UP AT 60 65 LBS CUSTOM ER STATES DRIVER SIDE APPEARS TO BE DOING THE SAME	Under Limit	
2007 1FTSX21P37EA	26-Jul-06	20-Apr-07	NEW HOLLAND FORD	43837401	5K02	*	1700 *	B65	D1	2	5-Jun-07	2	2245	5.6	45.07	50.67	0.6	1360	LL	SAME	Under Limit

2007 2MEFM74V37X	30-Mar-07	4-May-07	TASCA FORD	444960E	5K02	3W3Z	1130	CA	B65	33	2	26-Jul-07	3	2561	45.4	8.7	54.1	0.1	796	2561 HUB CAP NG CAUSING CENTE CAP TO FALL OUT .1 VERIFIED CONCER N REPLACE D CENTER CAP AND FOUND THAT NEW CAP FELL OUT ALSO INSP HUB CAP FOUND TO BE NG REPLACE D HUB CAP AND RECHEC K WAS OK	CUST, STATES THE RT FRONT CENTER CAP KEEPS FALLING OFF AND CUST REPLACE D IT ALREADY WITH 1 AND THA	Under Limit
2007 1FAHP34N37W	3-Oct-06	25-May-07	MONACO AND SONS M	271615A	5K02	2M5Z	1130	AB	B65	24	2	3-Aug-07	3	2659	14.78	7.76	22.54	0.1	8896	THE RIGHT REAR WHEEL COVER WILL NOT STAY SECURE D, REPLACE D, OK.	THE RIGHT REAR CENTER CAP WILL NOT STAY SECURE D	Under Limit

2007 1FTSW21P67EA	10-Aug-06	16-Apr-07	ULRICH MOTOR CO.	11664301	5K02 *	1130 *	B65	7	2	8-Aug-07	4	2749	0	34.57	34.57	0.5	3457	DIAGNOS E NOISE CONCER N. TEST DRIVE. BRING IN ON HOIST AND INSPECT. FOUND HUB CAP OUT OF ALIGNME NT. REPOSITI ON HUB CAB. TEST DRIVE OK	INTERMIT TENT NOISE LEFT FRONT WHEEL	Under Limit
2007 1FAFP34N97W	18-Dec-06	24-Mar-07	BEAVERTON FORD	044691A	5K02 6S4Z	1130 A	B65	33	2	15-Jun-07	3	2760	22.54	9.21	31.75	0.1	8729	INSTALL RIGHT FRONT HUBCAP	LEFT FRONT HUB CAP FLEW OFF WHILE DRIVING	Under Limit
2007 2FAHP71W37X1	27-Apr-07	23-Jul-07	BLUEBONNET MOTORS	48107002	5K02 3W7Z	1130 BA	B65	42	2	20-Aug-07	1	2899	56.08	8.39	64.47	0.1	4570		C S RT REAR CENTER CAP FELL OFF	Under Limit

2007 1FAHP37N07W	21-Nov-06	10-Apr-07	MULLAHEY FORD	17945101 5K01 *	1A10*	N50	42	2	21-Jun-07	3	3082	0	25.73	25.73	0.3	7944	CODE 42 (1A108) CHECK OUT CONCER N ROAD TEST HEARD NOISE IN FRONT CENTER CAP LOOSE ON WHEELS RE MOVED RIGHT FRONT TAPE FOAM FROM SQUEAK AND RATTLE KIT, RE ASSEMBL E ROAD TEST RE CHECK OK NOW.	CUSTOM ER STATES THERE IS A CLICKING TYPE NOISE FROM WHEELS POSSIBL Y FRONT. (B65)	Under Limit
2007 1ZVFT84N775	7-Mar-07	3-Apr-07	LONG-LEWIS FORD	40842401 5K02 *	1705 *	B65	D1	2	18-Jun-07	3	3199	1.4	23.85	25.25	0.3	225	REPLACE D RIGHT FRONT VALVE STEM	CUSTOM ER STATES THAT DRIVER FRONT TIRE IS LEAKING.	Under Limit



2007	1FMYU02Z87K	11-Dec-06	29-Mar-07	BEECHMONT FORD INC 360122D	5K01 *	1015 *	N51	33	2	5-Jul-07	4	3324	0	29.86	29.86	0.4	2058	3338 LOOSE JACK IN COMPAR TMENT I VERIFIED THE NOISE AND FOUND THAT THE JACK IN THE COMPAR TMENT IS LOOSE AND NEEDED TIGHTEN E D UP I DID AND DROVE ALL OK NOW NO MORE CONNCE R S PRESENT	CUSTOM ER STATES WITH SOMEON E SITTING IN THE BACK RIGHT HAND SIDE OF SEAT , CNA HEAR A SHOCK TYPE NOISE GOING ABOUT 40 MPH.DOE S NOT KNOW IF NORMAL OR NOT	Under Limit
------	-------------	-----------	-----------	----------------------------	--------	--------	-----	----	---	----------	---	------	---	-------	-------	-----	------	---	--	-------------

2007 1FTPX14577F	8-Jan-07	19-Jun-07	LEGACY FORD	10349302	5K01	*	1007	*	N24	D9	2	21-Aug-07	3	3541	0	72.53	72.53	1	585	RUNOUT	ROAD FORCE BALANCE D FOUND EXCESSIVE WEIGHT REQUIRED TO REBALANCE R F TIRE. BALANCE EST TO D ALL 4. VERIFY ROADFORCE MACHINE SHOWS NO INDICATION OF FLAT SPOTS, CUPPING OR CHOPPING CHECKED	REPAIRS. CUST STEERING STATES GETTING VIBRATION FROM FRONT TIRES WHILE DRIVING WAS TOLD FRONT TIRES HAVE FLAT SPOTS RIGHT REAR CENTER CAP IS PEELING PART ORDERED SEE HISTORY C S LF CENTER CAP CAME OFF WHILE DRIVING AND CUST COULD NOT STOP TO GET	Under Limit
2007 1FAHP25137G	15-May-06	21-Jun-07	VARSITY FORD	30620401	5K02	5G1Z	1130	BA	B65	D4	2	24-Aug-07	3	3637	15.05	8.51	23.56	0.1	2736	ASSY.	REPLACE R R CENTER CAP	3822 INSTALL NEW CENTER CAP CONCERN RESOLVED NO DAMGAGE NOTED	Under Limit
2007 1FAHP24197G1	5-Feb-07	12-Mar-07	FRIENDLY FORD, INC.	151858A	5K02	5G1Z	1130	CA	B65	42	2	29-Aug-07	6	3822	15.05	8.56	23.61	0.1	2662	E NOTED			Under Limit

2007 1FAHP24117G	5-Jan-07	18-Jun-07	PALM COAST FORD	4915003	5K02	5G1Z	1130 CA	B65	33	2	13-Jul-07	1	3926	15.05	7.56	22.61	0.1	3326	1 REPLACE D CENTER CAP 4619 N C REPLACE D R FR. CANERC AP THAT WAS FLAKING DURING ABOVE REPAIR. TECH	C S CENTER CAP ON LEFT REAR WHEEL FELL OUT WHILE DRIVING	Under Limit
2008 1FTSW21R18E	27-Feb-07	31-Mar-07	PAYTON-WRIGHT FORI	487421F	5K02	7C3Z	1130 B	F06	70	2	25-Jun-07	3	4602	26.03	0	26.03	0	2413	2409	F06 RT FT WHEEL COVER CHROME PEELING ROTATE TIRES AND CHECK BRAKES	Under Limit
2007 1FMYU59HX7K	3-Nov-06	30-Jan-07	SUNRISE FORD OF NOI	290306A	5K01	*	1007 *	B65	42	2	8-Aug-07	7	4768	0	72.81	72.81	0.8	5453	ROTATE TIRES CHECK BRAKES	CUSTOM ER STATES FORD EMBLEM MISSING FROM RR CENTER CAP	Under Limit
2006 1FTSW21576E	25-Jan-06	2-Jan-07	IMLAY CITY FORD LINC	2056126	5K02	5C3Z	1130 KA	B66	39	2	20-Jul-07	7	4840	42.8	8.51	51.31	0.1	2672	VERIFIED EMBLEM MISSING ON CENTER CAP, REPLACE CAP	CUSTOM ER STATES THERES A VIBRATIO N AT OR ABOVE 60 MPH PLEASE CK AND ADVISE	Under Limit
2007 3FAHP08Z87R1	25-Sep-06	22-May-07	AUSTIN FORD-LINC-ME	146501	5K01	6E5Z	1007 BA	N25	D9	2	21-Aug-07	4	4890	0	56.11	56.11	0.8	9300	TEST DROVE BALANCE D ALL 4 TIRES		Under Limit

2006	4M2CU56196K	17-Oct-05	24-Aug-06	MCCOTTER FORD - ME 208593A	5K01 *	1007 *	L29	42	2	25-Jun-07	11	5124	0	74.33	74.33	1	4944	5139 42 TIRE LIGHT ON W SELF TEST SYSTEM PASS INSTALL WDS AND MONITOR PIDS. REPROG RAM WHEEL SENSOR S. RUN OASIS	CUSTOM ER STATES THE TIRE PRESSU RE LOW LIGHT IS ON AGAIN	Under Limit	
2007	4M2CU97147K	1-Sep-06	10-Jan-07	NICK MAYER LINCOLN-	15429704 5K02	5E6Z	1130 AA	B65	42	2	16-Jul-07	7	5304	52.02	17.04	69.06	0.2	10705	TECH INSPECT ED FOR WHEEL CENTER CAPS CONCER N & VERIFIED & WENT THROUG H DIGITAL IMAGE SYSTEM & WAS APPROV ED #PAAKR TECH REPLACE D ALL 4 CENTER CAPS AS NEEDED	CUST STATES ALL 4 CENTER CAPS ARE FLAKING & PEELING	Under Limit
2006	1FTPW14V26F	26-Jan-06	5-Jul-06	NICK NICHOLAS FORD,	4819151 5K01	2L1Z	1012 AA	B65	1	2	4-Jun-07	12	5500	6.09	34.11	40.2	0.5	1200	STUB BROKEN REPLACE ONE STUB BROKEN	CUSTOM ER STATES STUD ON RIGHT FRONT WHELL SNAP OFF	Under Limit

2007 1FAHP24137G1	29-Jan-07	22-Feb-07	BYERLY FORD INC	378009A	5K02	5G1Z	1130 CA	B65	1	2	9-Aug-07	6	5530	15.05	0	15.05	0	5702	5530 REPL CENTER CAP	C S LEFT FT CENTER CAP IS BROKEN? CUSTOM ER REPORT S CENTER CAP AT RF WHEEL HAS FALLEN OFF REPLACE CAP	Under Limit
2007 1ZVHT85H375	1-Aug-06	4-Feb-07	FUTURE FORD OF CON	101738A	5K02	5R3Z	1130 B	B65	33	2	7-Aug-07	7	5669	18.56	11.95	30.51	0.1	4058	REPLACE D CAP; RECHEC K NORMAL.	CAP	Under Limit
2006 1ZVFT80N465	16-May-06	13-Nov-06	HARBIN MOTOR COMP.	155199A	5K02	4R3Z	1130 FA	B65	7	2	18-Jul-07	9	6041	25.93	6.64	32.57	0.1	378	R*R CENTER CAP	CUST STATES CENTER CAP WILL NOT STAY ON	Under Limit
2007 1FTRF12W37N	20-Feb-07	18-Apr-07	CLAIR FORD LINCOLN	256788A	5K01	*	1007 *	TB7	7	2	12-Jun-07	2	6049	0	79.78	79.78	1.1	8814	CONFIRM ED CONCER N.ADJSU TED TIRE PRESSU RE AND CH ECKED FRONT END,WAS TIGHT.PE RFORME D ALIGNME NT O N FRONT END,ROT ATED TIRES.RE TESTED OK.	CUSTOM ER STATES THE TIRES ARE WEARIN G ON THE INSIDIE EDGE	Under Limit

2006 1ZVFT82H165	18-May-06	27-Nov-06	CHAPMAN FORD SALE	15349201	5K02	6R3Z	1130 E	B65	42	2	4-Jun-07	7	6122	23.7	7.46	31.16	0.1	3955	CUSTOMER CONCERN PERFORMED DIGITAL IMAGING AND RETRIEVED AUTHORIZATION TO REPLACE WHEEL CENTER COVER AUTHORIZATION CODE PAAUT REMOVE D AND REPLACE D CENTER WHEEL COVER AND VERIFIED	CUSTOMER STATES THE RIGHT FRONT WHEEL COVER CENTER PIECE FELL OFF	Under Limit	
2007 1FTPW14V77FA	16-Jan-07	29-Mar-07	COOK-WHITEHEAD FOI	013594B	5K01	*	1007 *	N25	D9	2	14-Aug-07	5	6337	0	77.62	77.62	1.1	4910	6337 ROTATED AND BALANCED TIRES DUE TO TIRES BEING OUT OF BALANCE WHEN SENT FROM FACTORY TIRES WERE OFF BALANCE IN EXCESS OF 1 OZ ON ALL 4 TIRES	WHILE DRIVING HWY SPEEDS HAS A VIBRATION, MAY NEED	08-060 1352 BALANCE	Under Limit

2007 3MEHM08137E	3-Aug-06	21-Nov-06	DAYTONA LINCOLN ME	11054001	5K01	*	1007	*	D50	7	2	8-Aug-07	9	6376	0	15.13	15.13	0.2	10378	VEHICLE, NO ABNORMAL CONDITION FOUND. ROAD TEST 7 MILES STILL NO ABNORMAL CONDITION FOUND. OASIS. COMPARED TO 2 OTHER VEHICLES ALL OPERATE THE SAME. NO PROBLEM FOUND AT THIS TIME.	AT SHIELD WAS NOT CONTACTING FLOOR PAN PER TSB 07 11 7, VERIFIED BRAKE, FUEL, AND VAPOR LINES WERE IN THEIR	CUSTOMER STATES THERE IS A VIBRATION YOU FEEL IN THE STEERING WHEEL, BRAKE PEDAL AND SEAT, IT FEELS AT ALL TIMES. IS A LITTLE WORSE WHEN AC IS ON. CHECK AND ADVISE. FINAL REPAIR ATTEMPT	Under Limit
2007 2FMDK49C87E	13-Dec-06	21-Feb-07	SARAT FORD SALES, I	26686201	5K01	6L2Z	1012	BA	B65	1	2	27-Jul-07	6	6495	8.62	15.13	23.75	0.2	9137	REPLACED TWO LUG NUTS AND REPAIRED STUDS.	CUSTOMER STATES: LUG NUTS NOT TIGHTENING CORRECTLY	Under Limit	

2007 1FAHP27177G	4-Jan-07	24-Feb-07	ATCHLEY FORD INC	36765401	5K02	5G1Z	1130	CA	B65	42	2	23-Jun-07	4	6511	60.2	15.8	76	0.2	7130	6 26 07, AT 6602 MILES INSTALLE D ALL 4 CENTER CAPS	3 OF THE CENTER CAPS HAVE FALLEN OFF AT DIFF TIME AND NOW THE 4TH ONE IS CRACKE D, DZ INSPECT ED	Under Limit
2007 1FMFU17517L	21-Dec-06	8-Jan-07	PARADISE FORD	1655551	5K02	*	1705	*	B65	1	2	16-Jul-07	7	6561	23.52	0	23.52	0	3942	REPLACE ALL 4 VALVE STEMS SPLIT REPLACE D 4 VALVE STEMS	RT REAR VALVE STEM IS SPLIT CK ALL VALVE STEMS	Under Limit
2007 1FAHP34N97W	9-Aug-06	10-Mar-07	JOHN LANCE FORD	148222B	5K01	6S4Z	1012	BA	B65	42	2	20-Aug-07	6	6762	67.42	43.3	110.72	0.5	2284	6762 INSPECTI ON REPLACE ALL 16 LUG NUTS ALL CAPS FELL OFF CHECKE D TIRE FOR LEAK VERIFIED VALVE CORE LEAKING TIGHTEN ED VALVE CORE RETESTE D OK AT THIS TIME	CUSTOM ER STATES MISSING LUG NUT COVERS	Under Limit
2007 1FAFP27187	8-Jun-06	20-Feb-07	JOHN KENNEDY FORD	21573201	5K02	*	1700	*	B65	D1	2	24-Jul-07	6	7018	0	43.73	43.73	0.5	1330		CUST STS RIGHT REAR TIRE LEAKING PE08-060 1354	Under Limit



2007	1FTWX31P07E	22-Jun-06	3-Mar-07	DAVIDSON MOTOR COI094373A	5K01 *	1007 *	N58	63	2	5-Jul-07	5	7534	0	20.7	20.7	0.3	7509	CHECKED FOR NOISE OVER BUMPS COVERS ON STEERING STOPS LOOSE TIGHTEN ED CHECK TIRES FOR LEAKS FOUND BOTH FRONT TIRES LEAKING AROUND RIM BROKE DOWN TIRES RESEALED AND REBALAN CE RR WHEEL, REP VALVE STEM, REBALAN CE WHEEL	RATTLE OVER BUMPS.	Under Limit
2007	1FAHP24137G	26-Sep-06	5-Apr-07	BOB GILLINGHAM FORI157894C	5K01 *	1007 *	B65	42	2	7-Aug-07	5	7577	0	39.5	39.5	0.5	2199	CK TIRE PRESSURE FRONT LOOK LOW	Under Limit	
2006	1ZVFT80N765	1-May-06	29-Aug-06	BATTLEFIELD FORD 059778D	5K01 *	1007 *	H45	1	2	17-Aug-07	12	7795	1.68	39.49	41.17	0.5	3765	CK LEAKING VALVE STEM	Under Limit	

2006 1FTPW14566K	28-Nov-05	28-Oct-06	LITHIA FORD LINCOLN 361075A	5K01 *	1007 *	N24	42	2	20-Aug-07	10	8131	0	66.11	66.11	0.8	3897	8134 WHEELS OUT OF BALANCE VERIFIED CONCER N NOT BRAKE RELATED , RAISED VEHICLE AND REMOVE D WHEELS FOUND WHEELS OUT OF BALANCE , LF 1.50, RF 1.00, LR 2.00, RR .75. REBALAN CED WHEELS AS NEEDED, RETESTE	D, PASS.	CUSTOM ER STATES VIBRATIO N AT ABOUT 55MPH THAT YOU CAN FEEL IN THE STEERIN G WHEEL	Under Limit
2006 1FTRE14W06D	8-Sep-06	28-Oct-06	GRIFFIN FORD LINCOLN 012807B	5K01 *	1007 *	N12	42	2	30-Jul-07	10	8443	0	57.02	57.02	0.7	6360	TEST DRIVE AND DIAGNOS IS FOR NOISE AND NEUTRAL IZE MOTOR AND RETEST NOISE GONE	FOR A STOP LIGHT OR STOP SIGN AND THEN AT IDLING, U SUALLY WITH FOOT ON BRAKE BUT NOT ALWAYS	Under Limit	

2007 1FMEU51K97U	22-Feb-06	23-Aug-06	DON TESTER FORD LIN	2310403	5K01	*	1007	*	N50	42	2	25-Jun-07	11	9728	0	51.87	51.87	0.7	2335	LLY HEARS BACKING OUT OF DRIVE TO THE RIGHT S O SHE CAN GO TO THE LEFT RUN NCH DIAGNOS IS LUBED STEERIN G STOPS PER SS M 19303 REDROV E OK	CRUNCHI NG, CRACKIN G NOISE COMING LH FRONT REA ADD ON WARRANT TY REPAIR. CUST STATES THE LUG NUT LOST A CAP	Under Limit
2007 1FAFP37N07W	8-Aug-06	18-Nov-06	CRESTMONT FORD, IN	154446B	5K01	6S4Z	1012	BA	B65	33	2	9-Jul-07	8	9847	4.82	16.11	20.93	0.2	4369	9847 REPLACE D LUG NUT ON DRIVERS FRT WHEEL.	REPAIR. CUST STATES THE LUG NUT LOST A CAP	Under Limit

2006	3FAFP07Z26P	13-Jun-06	30-Aug-06	PARR FORD, INC.	18596001	5K02	7E5Z	1130 A	B65	42	2	30-Jul-07	12	9940	22.75	17.05	39.8	0.2	8606	ROAD TESTED AND VERIFIED CONCERN. PINPOINTED NOISE TO BE COMING FROM THE RIGHT FRONT. REMOVED WHEEL COVER AND INSPECTED. FOUND 1 PIECE OF HARD RUBBER TAPE WAS MISSING. CHECKED OASIS AND FO	CUSTOMER STATES FRONT RIGHT WHEEL SQUEAKS WHILE DRIVING AT LOWER SPEEDS	Under Limit
2006	1FMZK01196G	28-Nov-05	9-Aug-06	NORTHGATE FORD, IN	138482A	5K02	4F9Z	1130 AA	B65	33	2	4-Jun-07	10	10187	17.51	8.41	25.92	0.1	2663	10187 HUBCAP FELL OFF MISSING. REPLACED MISSING HUBCAP 10329. REPLACED 1 RIGHT REAR LUG NUT DUE TO CAP SEPERATING FROM NUT. CC.	PASS FRONT CENTER CAP HAS FALLEN OFF	Under Limit
2007	1FAFP37N07W	8-Aug-06	18-Nov-06	CRESTMONT FORD, IN	154658A	5K01	6S4Z	1012 BA	B65	1	2	16-Jul-07	9	10329	4.82	16.11	20.93	0.2	4369	01	PASSENGER REAR TIRE LUGNUT CAP FELL OFF	Under Limit

2007	1FAHP24177G	6-Feb-07	28-Feb-07	LAFAYETTE FORD	4383351	5K02	5G1Z	1130	CA	B66	33	2	7-Aug-07	6	10481	15.05	8	23.05	0.1	960	VERIFIED CONCER N. LEFT REAR CENTER CAP FLEW OFF. REPLACE D CENTER CAP. CAUSE: LOOSE PART. TPM SENSOR S NEEDED TRAINING VERIFIED TPM MESSAG E DISPLAY ED IN MESSAG E CENTER. EEC DIAG. DTC B2872 (TIRE PRESSU RE SENSOR FAULT) RECOVE RED. SET TIRE PRESSU RES TO 35PSI. MONITOR	USE SPO 07212016 CHECK CENTER CAP FLEW OFF	Under Limit
2006	5LMFU285X6L	2-Jun-06	28-Aug-06	LITHIA FORD LINCOLN	356738A	5K01	*	1007	*	A40	42	2	11-Jul-07	11	10578	0	24.79	24.79	0.3	3897	ED PID IS STATUS NEEDS	Under Limit	



2007 1FAHP34N37W	15-Aug-06	11-Oct-06	BRONDES FORD INC.	15896004	5K01	6S4Z	1012 BA	B65	33	2	12-Jul-07	10	11941	4.82	15.16	19.98	0.2	3010	REPLACE D 1 LUG NUT	CUSTOMER STATES ONE OF THE CAPS HAS COME OFF THE LUG NUTS	Under Limit
2007 1FTPX14557F	28-Aug-06	21-Dec-06	PALM SPRINGS FORD I	167191B	5K02	*	1700 *	B65	D8	2	21-Aug-07	9	11979	0.62	26.61	27.23	0.3	5574	R & I LEFT REAR TIRE FOR ACCESS TO REPLACE LEAKING VALVE STEM,RE TEST OK	CUSTOMER STATES THE LEFT FRONT TIRE LEAKS FROM THE STEM, TIRE IS IN THE BED NOW	Under Limit
2007 1FMEU31K47U	16-Mar-06		NORTH BROS. FORD, II	203975D	5K01	*	1007 *	G29	42 E84		17-Jul-07	-1	10	0	0	0	0	2975	10 CC 42 AIRED ALL 4 TIRES, TPM DIAG FOUND OPSI AT ALL 4 WHEELS NECESSARY TO REPROGRAM TIRE SENSOR	AIR TIRES AND RESET TIRE LIGHT.NO CHARGE LINE.	Under Limit
2006 2MEFM74V16X	27-Oct-05	27-Apr-06	DICK BARKER, INC.	120720C	5K02	3W3Z	1130 CA	B65	1 E84		25-Jul-07	16	3481	22.34	7.57	29.91	0.1	12210	INSTALLED NEW LF CENTER CAP CLIP FAILURE	CUSTOMER STATES CHECK LEFT FRONT CENTER CAP FELL OFF WHILE DRIVING	Under Limit PE08-060 1361

2006	3MEFM07Z66F	28-Mar-06	23-May-06	NORTHLAND LINCOLN	3837901	5K02	7N7Z	1130	A	B65	D4 E84	12-Jun-07	13	3857	113.9	14.91	128.81	0.2	10638	DIAG AND REPLACE WHEEL CENTER AS PER TSB	METAL SOUND WHEN HITTING BUMPS	Under Limit
2006	1FAFP31N76W	24-Oct-05	3-Feb-06	CAL WORTHINGTON FC	34804602	5K02	*	1130	*	N17	42 E84	6-Jun-07	17	4428	0	76.74	76.74	0.8	8619	TECH CHECKED FOR THE NOISE IN THE LF WHEEL AREA. FOUND TSB 06 9 5.PLACED TAPE ON ALL HUB CAPS ROADTESTED OK.	REPAIR FOR NOISE HEARD COMING FROM THE LF BRAKE SIDE.	Under Limit
2006	2MEFM74W86	21-Apr-06	21-May-06	GERVAIS LINCOLN-ME	12824601	5K02	5W3Z	1130	DA	N58	30 E84	8-Aug-07	15	5810	23.06	8.63	31.69	0.1	13100			Under Limit
2005	1FTWW33P25E	14-Dec-04	8-Jan-05	DITSCHMAN/FLEMINGT	64461701	5K02	2C3Z	1700	CA	B65	42 E84	20-Jun-07	30	7452	32.24	37.64	69.88	0.4	4216	VERIFIED CONCERN INSPECTED TIRE OK PUT IN DUNK TANK FOUND VALVE STEM LEAKING REPLACED BALANCED TEST DROVE OK	CUSTOMER STATES R F TIRE LEAKING	Under Limit



2006 1ZVHT82H5651	11-Sep-05	27-Sep-05	DESOTO FORD-MERCL	9698051	5K02	6R3Z	1130 E	B65	33 E84	14-Aug-07	23	7590	23.7	7.56	31.26	0.1	4865	VERF FOUND CAP LOOSE NOT STAYING ON REMOVE D & REPLACE D WITH SOP CAP RETESTE D OOK	USE SPO 07225019 RH CENTER CAP FALLS OFF	Under Limit
2006 1FTPX14536N	1-Mar-06	27-Jul-06	SKALNEK FORD INC	10298402	5K02	4L3Z	1130 JA	B65	D4 E84	14-Aug-07	13	8521	27.87	8.53	36.4	0.1	2700	FAULTY PART REPLACE WHEEL CENTER CAP	RT FRT CENTER CAP EMBLEM FELL OFF	Under Limit
2006 1FMPU16576L	22-Nov-05	9-Feb-06	HOLMAN FORD-MOUN	1379914A	5K02	6L1Z	1130 CA	B65	81 E84	19-Jun-07	17	8554	42.47	8.84	51.31	0.1	1325	8554 VERIFIED CONCER N XX FORD ON CENTER OF CENTER CAP IS PEELING XX REPLACE D CENTER CAP ON D S REAR WHEEL XX RECHEC K XX ALL OK	CUST STS THE D S REAR CENTER CAP IS DELAMIN ATING WHERE THE FORD EMBLEM IS LOCATED	Under Limit
2006 3MEFM08116F	7-Dec-05	19-Jun-06	LIBERTY LINCOLN MER	114966A	5K02	5T5Z	1130 AA	B65	14 E84	27-Jun-07	13	8800	67.62	16.35	83.97	0.2	11000	REPLACE CENTER CAPS	WHEEL COVERS ARE PEELING	Under Limit

2005 1FTZR45E25	20-Sep-04	24-Mar-06	BERGSTROM NEENAH-	10219301	5K02	5L2Z	1130 BA	B65	81 E84	19-Jun-07	16	9020	11.09	8.12	19.21	0.1	6226	REPLACE D LF CENTER CAP	FORD EMBLEM ON LEFT FRONT WHEEL PEELING, CENTER CAP CUST STATES LEFT WHEEL LUG MISSING COVER CHECK AND ADVISE	Under Limit
2006 1FAHP34N26W	30-Aug-05	17-Jun-06	KOETTING FORD, INC.	15877702	5K02	6S4Z	1K01 A	B65	33 E84	13-Aug-07	15	9058	4.67	8.86	13.53	0.1	8205	OFF 9604 ROAD TESTED AND VERIFIED CONCER N. REFFERE D TO TEB #06 09 05 AND REMOVE D ALL HUB CAPS AND APPL IED FOAM TAPE FOLLOWI NG TSB AND REINSTA LLED, TH EN REROAD TESTED NOISE NOW GONE.	WHILE DRIVING CAN HEAR A DRAGGIN G TYPE NOISE AS DRIVING FASTER ROTATIO N OF NOISE INCREAS ES (ITHC)	Under Limit
2005 3FAFP31N15R	25-Jan-05	10-Feb-05	TASCA FORD	448539A	5K02	*	1130 *	N50	42 E84	22-Aug-07	31	9604	0	69.6	69.6	0.8	796			Under Limit

2006 1LNHM81V86Y	1-Dec-05	31-Mar-06	HEMPSTEAD LINCOLN	74574102	5K02	6W1Z	1130 AA	B65	D4 E84	22-Jun-07	15	9610	41.65	10.53	52.18	0.1	11208	SUBMITTED TO DIGITAL IMAGING. AS PER FORD AT THIS TIME CAN ONLY COVER ONE CENTER CAP FOR PEELING CONDITION. SURFACE CRACKS ON CLEAR COAT CONCERN.	C S FROM LAST SERVICE CENTER CAPS HAVE SCRATCHES AROUND THE RIDGES, PLEASE CHECK AND ADVISE	Under Limit
2006 1FAHP36N36W	31-Oct-05	12-Feb-06	LANDMARK FORD, INC.	672968D	5K02	6S4Z	1K01 A	B65	33 E84	9-Aug-07	19	9833	4.35	9.64	13.99	0.1	8559	9833 REPLACE MISSING LUG NUT COVER ON L R WHEEL. WARRANTY	MISSING WHEEL LUG NUT COVER	Under Limit
2005 1FDXE45S25HB	25-Feb-05	29-Dec-05	CAMPBELL FORD LINC	028913A	5K01	F2UZ	1012 B	B66	39 E84	25-Jun-07	19	10028	17.75	0	17.75	0	2744	CUSTOMER TOOK PARTS WITH THEM TO INSTALL ON THEIR OWN	SOP PART FOR LUG NUTS	Under Limit

2005 1FAFP24195G1	23-Aug-04	26-Mar-05	FULLERTON FORD	5883952	5K02	5G1Z	1130 CA	B65	34 E84	4-Jun-07	27	10077	37.2	19.71	56.91	0.2	20651	CENTER CAPS THE FORD EMBLEM S ARE PEELING OFF REPLACED CENTER CAP EMBLEM S LEFT SIDE OF VEHICLE	CUSTOMER STATES ON CENTER CAPS THE FORD EMBLEM S ARE PEELING OFF	Under Limit
2006 1ZVHT84N165	3-Feb-06	24-Apr-06	GRESHAM FORD	479601	5K01 *		1007 *	B09	42 E84	23-Jun-07	15	10214	1.23	50.51	51.74	0.6	8572	.6 HRS T09 PERFORMED NVH DIAGNOSIS. TEST DROVE VEHICLE. LIFTED VEHICLE. TIGHTENED MOUNT BOLTS. NOISE NOW GONE AT THIS TIME.	LOUD RATTLE FROM PASS DOOR AREA WHEN OVER BUNMPS ADVISED HUM NOISE PASSED AT 30 MPH 15RPM ADVISED	Under Limit
2006 2MEFM74W76X	5-Aug-05	8-Jun-06	FIESTA LINCOLN MERC	11455701	5K02	3W3Z	1130 CA	B65	33 E84	16-Aug-07	15	10404	22.34	9.04	31.38	0.1	11896	REPLACE LEFT FRONT CENTER CAP	CENTER CAPS WILL NOT STAY ON HAS LOST 2	Under Limit
2005 1FAHP28165G	16-Jun-05	17-Aug-05	LAFAYETTE FORD	4028551	5K02	5G1Z	1130 BA	B65	34 E84	12-Jun-07	23	10533	15.05	7.93	22.98	0.1	960	REPLACED LEFT REAR CENTER CAP	CENTER CAP WILL NOT STAY IN PLACE	Under Limit

2006	1FAFP34N86W	2-Sep-05	21-Mar-06	DITSCHMAN/FLEMINGT	64098401	5K02	6S4Z	1K01 A	B65	33	E84	11-Jun-07	15	11467	33.44	47.05	80.49	0.5	4216	INSTALLED PLASTIC WHEEL LUG NUT COVERS. 6 HAVE COME OFF AND WERE LOST	CUSTOM ER STATES 6 LUG COVERS HAVE FALLEN OFF WHEELS	Under Limit
2005	1LNHM87A45Y	5-May-05	27-Jul-05	COPPER COUNTRY FO	6625051	5K01	3W4Z	1012 AA	B65	1	E84	3-Aug-07	25	11539	17.36	39.91	57.27	0.6	6267	2 STUDS BROKEN BOLT(S) REAR HUB REPLACE	BROKEN STUD ON RIGHT REAR WHEEL	Under Limit
2006	4M2YU571X6K	13-Jan-06	25-Mar-06	FAIRWAY FORD LINCO	101935A	5K02	5E6Z	1130 AA	B65	D4	E84	6-Jun-07	15	11673	55.74	16.01	71.75	0.2	20050	REPL ALL WHEEL COVERS CLOSED BY WPI	CUSTOM ER STATES CENTER CAPS ARE PEELING	Under Limit
2005	1ZVFT85HX55	21-Jun-05	14-Oct-05	KRUG HILLTOP FORD-L	1967304	5K01	6W7Z	1012 BA	B65	D4	E84	14-Aug-07	23	11800	64.68	16.64	81.32	0.2	1758	W 20041 VERIFY LUG NUTS RUSTING, NESS TO REPLACE 15 LUGS WITH RUST	CHECK FOR LUG NUTS RUSTING,	Under Limit

2005	2MEFM74W25X	25-Apr-05	20-Jul-05	RANDALL NOE	FORD M322250A	5K01	*	1007	*	N59	33	E84	11-Jun-07	24	12070	0	44.91	44.91	0.6	2524	12070 1007D 0.7 VERIFIED CONCERN, NOISE IN FRONT AND REAR OF CAR. LUBRICATED ALL FRONT AND REAR BUSHINGS. VERIFIED REPAIR DROVE VEHICLE VERIFY VIBRATION CONCERN. INSPECTED TIRES AND SPIN BALANCED FRONT AND REAR TIRES WAS OUT OF BALANCE D CAUSE VIBRATION. SET TIRE PRESSURE. REROAD TEST VEHICLE OPERATING AS DESIGNED	CUSTOMER STATES FRONT END MAKING SQUEAK NOISE WHEN TURNING	.	Under Limit
2007	1ZVFT84N075	25-Sep-06	9-Oct-06	SANTA MARGARITA	FO361148A	5K01	*	1007	*	N25	30	E84	3-Aug-07	10	12181	0	76.86	76.86	0.8	1597	TECH D FLAG 449.	C50 DIAGNOSIS AND INSPECTION CAUSE OF AT FREEWAY SPEEDS THERE A VIBRATION SEE EDDIE PER HIS ROAD TEST	Under Limit	

2006 1FDAF57P56E	18-Jun-05	31-Mar-06	MONACO AND SONS M 270543A	5K01	2C2Z	1012 AA	B65	C2 E84	11-Jul-07	16	12356	12.54	15.52	28.06	0.2	8896	DURING CUSTOM ERS FIRST TIRE ROTATIO N, TWO OF THE FRONT LUG NUTS CAME OFF HARD. STUDS CHECKE D OK, REPLACE D TWO WHEEL NUTS, WERE CROSST HREADE D FROM ASSEMBL Y. INSPECT CENTER CAPS AND REPLACE	2 LUGS WONT GO ON STUDS TIGHT L F C S THAT ALL 4 CEMTER CAPS ARE PEELING	Under Limit	
2005 1FAFP25135G2	29-Jun-05	28-Sep-05	ELYRIA FORD	086005C	5K02	5G1Z	1130 BA	B65	42 E84	18-Jun-07	21	12378	60.2	15.71	75.91	0.2	4163	INSPECT CENTER CAPS AND REPLACE	2 LUGS WONT GO ON STUDS TIGHT L F C S THAT ALL 4 CEMTER CAPS ARE PEELING	Under Limit

2007 1FAHP24157G	1-Feb-07	20-Feb-07	GATOR FORD TRUCK S093034A	5K02	5G1Z	1130 CA	T53	42 E84	24-Aug-07	7	12417	60.2	15.93	76.13	0.2	4917	12417 VERIFIED CONCERN CENTER CAPS ON WHEELS KEEP COMING LOOSE CUSTOMER STATES TWO CENTER CAPS HAD COME OFF VEHICLE WHILE DRIVING 12496 REPLACE D BOTH LH CENTER CAPS FOR CORROSION	C.S CENTER CAP WILL NOT STAY ON WHEELS. ...ADVISE ...T53	Under Limit
2006 3MEFM07106F	12-Apr-06	7-Jun-06	MATHEWS FORD LINCOLN 241347B	5K02	6N7Z	1130 AA	B65	14 E84	7-Aug-07	15	12496	45.36	15.06	60.42	0.2	2265	REPLACE 2 HUB CAPS FOR CORROSION	Under Limit	
2006 3FAFP06Z56F	12-May-06	14-Jul-06	DARLING'S BANGOR FORD 49410303	5K02	*	1130 *	N50	24 E84	15-Jun-07	12	12594	0	30	30	0.4	9044	VERIFIED RATTLE IN REAR RT WHEEL REMOVE D HUB CAP AND FOUND ISOLATE RS MISSING ON HUB CAP INSTALLED NEW AND ROAD TESTED OK	CUSTOMER STATES THERE IS A TICKING WITH ROTATION OF WHEELS AT SLOW SPEED. LIKE SOMETHING IN THE TIRE.	Under Limit PE08-060 1370



2006	3MEFM07Z76F	21-Jun-06	16-Nov-06	GERVAIS LINCOLN-ME	12731401	5K02	7N7Z	1130 A	N58	7 E84	6-Jul-07	8	12781	28.48	8.63	37.11	0.1	13100	ROADTESTED FOR NOISE AND REPLACED CENTER CAP	CHECK NOISE FROM LEFT FRONT WHEEL	Under Limit
2006	2FAHP71W76X1	11-Apr-06	13-Jun-06	ROBERTS FORD	150432A	5K02	7W7Z	1130 A	B66	33 E84	8-Aug-07	15	12810	44.63	9.15	53.78	0.1	9883	12810 LR WHEEL COVER EMBLEM FELL OFF REPLACE WHEEL COVER DI AUTHORIZED PAAHN TO REPLACE ALL 4 WHEEL COVERS REPLACE D ALL 4 WHEEL COVERS	REAR DRV SIDE FORD EMBLEM FELL OFF HUB CAP	Under Limit
2006	1FAHP28166G	9-Nov-05	12-Jan-06	VAN BORTEL FORD, INC	59412501	5K02	5G1Z	1130 BA	B65	81 E84	27-Jun-07	18	12868	60.2	14.61	74.81	0.2	7590	VERIFIED CONCERN FOUND WHEEL COVER CONTACT POINTS IN NEED OF LUBE LUBED ALL CONTACT POINTS RECHECKED OK	CUSTOMER STATES CLEAR COAT COMING OFF ALL HUB CAPS	Under Limit
2005	2MEFM74WX5X	18-Oct-04	29-Apr-05	ELMHURST LINCOLN-M	6416851	5K02	*	1130 *	N50	33 E84	2-Jul-07	27	12924	0	19.95	19.95	0.2	13660		CUSTOMER STATES R F AREA HAS A SQUEAK GOING OVER BUMPS	Under Limit

2006	1FAFP28166G	23-Sep-05	16-Sep-06	FERRARIO FORD LINC	029479D	5K02	5G1Z	1130	BA	B65	81	E84	21-Aug-07	12	12957	15.05	6.48	21.53	0.1	3366	REPLACE WHEEL CENTER TO DUPLICATE CUSTOMER CONCERN ROAD TEST AT FWY AND STREET SPEEDS RACK AND INSPECT, ALL TIGHT AND GOOD. OASIS HAS MESSAGE FOR NORMAL FLUTTER NOISE WHEN REAR WINDOWS DOWN, SSM	CUSTOMER STATES CLEAR COAT PEELING OFF RIGHT REAR CENTER CAP	Under Limit
2006	3FAFP07Z96R1	24-Nov-05	13-May-06	VACAVILLE FORD-MER	14906601	5K02	*	1130	*	N51	42	E84	14-Jun-07	14	13014	0	63.16	63.16	0.6	398	19764. SEIZED LUG NUTS M TIME, TIME TO REMOVE 4 SEIZED LUG NUTS & REPLACE	CUSTOMER STATES CAN HEAR A TICKING NOISE OUTSIDE THE CAR WHEN DRIVING WITH WINDOWS DOWN, DESCRIBED AS CARD IN BICYCLE SPOKE	Under Limit
2007	1FAFP34NX7W	4-Aug-06	22-Oct-06	HARRELSON FORD, INC	7382652	5K01	6S4Z	1012	BA	B65	69	E84	19-Jul-07	10	13027	19.26	78.81	98.07	1	1071	REPLACE	CUSTOMER STATES THAT WHEEL LUG NUT IS HARD TO GET OFF. ADV PE08-060 1372	Under Limit

2007 1FAHP24107G	12-Dec-06	13-Apr-07	NICK NICHOLAS FORD,	5105551	5K02	5G1Z	1130 CA	B65	7 E84	7-Aug-07	4	13272	15.05	6.82	21.87	0.1	1200	WHEEL CAP FELL OFF AND IS NOW GONE REPLACE WHEEL CAP COVER DISCOLO RED CENTER CAP. REMOVE AND INSTALL CENTER CAP.	USE SPO 07204033 RT REAR CENTER CAP LOOSE	Under Limit
2005 1ZVFT80N355	3-Dec-04	11-Jul-05	LEGACY FORD	10290901	5K02	4R3Z	1130 FA	B65	14 E84	13-Aug-07	26	13401	25.93	7.25	33.18	0.1	585	WHEEL CAP.	CUSTOM ER STATES CHECK CENTER CAP DISCOLO RED.	Under Limit
2006 1FAFP31N76W	18-Nov-05	17-Feb-06	CERRITOS FORD	40578701	5K02	5S4Z	1130 AA	N59	33 E84	3-Jul-07	17	13456	67.62	18.55	86.17	0.2	5401	WF 1130 CC42 HEARD CLICKING NOISE FROM 7 SPOKE WHEEL COVERS. INSTALLE D SPECIAL ORDER WHEEL COVERS AND ROAD TESTED VEHICLE NO ABNORM AL NOISE HEARD AFTER NEW WHEEL COVERS WERE INSTALLE D.	CUSTOM ER STATES THERE IS A CLICKING NOISE FROM WHEELS WHEN DRIVING AT LOW SPEEDS. INSTALL SOP.	Under Limit

2005	1FTPX125X5N	7-Mar-05	30-Mar-05	BEUCKMAN FORD, INC	186879D	5K02	4L3Z	1130	AB	B65	33	E84	10-Jul-07	28	13901	17.58	10.31	27.89	0.1	8012	13901 ORDERE D CENTER CAP REPLACE MISSING WHEEL COVER CHECKE D AND REPAIRE D RIGHT REAR TIRE	CENTER HUB CAP MISSING	Under Limit
2007	1FAFP53U07A	5-Sep-06	29-Dec-06	DAVIDSON MOTOR COI	093452A	5K01	*	1007	*	H62	42	E84	11-Jun-07	6	14124	0	13.8	13.8	0	7509	FINISH COMING OFF BOTH FRONT WHEEL CENTERS SOP PARTS INSTALL BOTH FRONT WHEEL CENTERS	REPAIR RIGHT REAR TIRE	Under Limit
2006	4M2EU48826U	6-Mar-06	19-Oct-06	DONLEY FORD-LINCOL	50946302	5K02	5E6Z	1130	AA	B65	81	E84	27-Aug-07	11	14145	26.01	14.17	40.18	0.2	8287	14336 VERIFIED CONCER N. REMOVE D AND REPLACE D ALL FOUR WHEEL CENTER CAPS.	CUST STATES BOTH FRONT WHEEL CENTER FINISH COMEING OFF	Under Limit
2006	1FAFP25186G	21-Jul-05	16-Aug-05	FRIENDLY FORD, INC.	148807A	5K02	5G1Z	1130	BA	B65	81	E84	15-Jun-07	23	14336	60.2	17.13	77.33	0.2	2662		CUSTOM ER STATES ALL 4 CENTER CAPS TARNISH ED	Under Limit

2006	1FAFP53U16	15-Nov-05	22-Nov-05	MOSES FORD INC	153016A	5K02	5F1Z	1130 AA	B65	42 E84	23-Aug-07	22	14397	18.87	7.65	26.52	0.1	1989	CUSTOMER STATES THAT WHEEL COVER CAME OFF WHEN DRIVING. REPLACED WHEEL COVER. TESTED WITH CUSTOMER. VERIFIED SQUEAK NOISE FROM R H SIDE OF VEHICLE. CHECKED OASIS FOR TSB AND SSM, NONE APPLY AT THIS TIME. REMOVE D R H WHEEL COVERS. ROAD TESTED, NOISE GONE. WHEEL COVERS	CUSTOMER STATES THAT WHEEL COVER CAME OFF WHILE DRIVING	Under Limit
2005	1FAFP34N45W	31-May-05	25-Jun-05	EVERGREEN FORD	32315301	5K02	*	1130 *	B65	42 E84	18-Jun-07	25	14547	0	79.41	79.41	0.9	8305	H CLE	ANED R F AND R R WHEEL COVERS AND LUBED CONTACT FOR POINTS OF WHEEL THAT GETS LOUDER AND FASTER WITH SEE HISTORY	Under Limit
2005	4M2YU57125	15-Feb-05	14-May-05	NORTHLAND LINCOLN	4023601	5K02	5E6Z	1130 AA	B65	42 E84	16-Aug-07	28	14581	52.02	14.91	66.93	0.2	10638	DIAG REPLACE ALL WHEEL CENTERS	WHEEL CENTERS ARE PEELING	Under Limit

2005	1FAFP251X5G	25-Apr-05	20-Dec-05	BRONDES FORD INC.	15956801	5K02	5G1Z	1130	BA	B65	81	E84	26-Jul-07	20	14584	60.2	15.16	75.36	0.2	3010	REPLACED CENTER CAPS	CUSTOMER STATES CENTER CAPS ARE PEELING VEHICLE VIBRATION BELOW	Under Limit
2004	1FTVF14564N	6-Mar-04	11-Jan-06	HEALEY FORD OF ANS	17090001	5K01	*	1007	*	N22	42	E84	18-Jun-07	18	14637	0	68.73	68.73	0.7	3615	PERFORM TSB 07 04 05	Under Limit	
2007	1FAHP34N47W	29-Sep-06	23-Feb-07	SUNSET AUTO CO INC	3693906	5K01	6S4Z	1012	BA	B65	33	E84	17-Jul-07	5	14782	4.82	0	4.82	0	8198	REPLACED LUGNUT WITH MISSING CAP	CUSTOMER REQUESTS REPLACE LUG NUT COVER CS THAT THERE IS A POPPING NOISE IN THE RIGHT FRONT WHEN U ARE MOVING A LITTLE ACROSS THE DRIVE WAY	Under Limit
2006	1FTPW14VX6F	21-Mar-06	31-May-06	JOE SARTAIN FORD, IN	24179301	5K01	*	1007	*	N50	82	E84	14-Jun-07	13	14826	0	48.52	48.52	0.7	5732	CK FOR POPPING NOISE OVER BUMPS ON DRIVE WAY.NPF .CK FOR LOOSE FRONT END PARTS NPF.	Under Limit	

2006	3MEFM07Z86F	21-Jun-06	24-Aug-06	CERRITOS FORD	41014001	5K02	*	1130	*	N50	42	E84	28-Aug-07	13	14945	0	18.55	46.55	0.2	5401	REP	AIRS.	WF 1130 CC42 ROAD TESTED VEHICLE HEARD TWO DIFFREN T NOISES FOUND ONE NOISE TO BE THE WHEEL COVERS. R&R ALL WHEEL COVERS CLEANED MOUNT AREA AND APPLI REROAD TESTED AND NO ABNORM AL NOISE HEARD AFTER	CUSTOM ER STATES CK FOR CLICKING NOISE AT LOW SPEED AND THUMB NOISE AT FWY SPEEDS FROM RIGHT	Under Limit
2006	1LNHM81VX6Y	4-May-06	6-Jul-06	GANLEY LINCOLN-MER	101014A	5K02	6W1Z	1130	AA	B65	33	E84	20-Jun-07	12	14979	41.65	7.9	49.55	0.1	10736	14979 REPLACE DR SIDE FRT CENTER CAP	FRT CENTER CAP LOOSE MAKES NOISE	Under Limit		
2005	1FAHP28135G	27-Jan-05	9-Apr-05	DONLEY FORD OF GAL	40426301	5K02	5G1Z	1130	BA	B65	81	E84	1-Aug-07	29	15000	30.1	7.53	37.63	0.1	2201	REPLACE D CENTER CAPS. VERIFY SPARE TIRE LOCK STRIPPE D REPLACE OK	REPLACE CENTER INSERTS ON WHEELS. 2 CUSTOM ER STATES SPARE TIRE WONT COME	Under Limit		
2006	1FTWX31Y46E	25-Jan-06	15-Feb-06	BAY HARBOR FORD	087119A	5K02	*	1130	*	B75	91	E84	8-Aug-07	18	15020	22.36	14.92	37.28	0.2	4965	OK	DO NOT	Under Limit		

2007	1FAFP24197G	31-May-06	13-Sep-06	FRIENDLY FORD, INC.	150333A	5K01	*	1007	*	N59	42	E84	23-Jul-07	11	15027	10.19	17.13	27.32	0.2	2662	15027 CHECKE D TSB AND FOLLOW ED INSTRUC TIONS	C S CLUNK NOISE BRAKING AND BACKING UP AFTER SITTING CUSTOM ER STATES: LEFT REAR CENTER CAP OXIDIZIN G SOP ORDERE D 507486 6 11 07	Under Limit
2005	1FAFP25105G	27-Jun-05	14-Jul-05	JOE MACHENS FORD L	51128701	5K02	5G1Z	1130	BA	B65	D4	E84	16-Jul-07	25	15324	15.05	8.59	23.64	0.1	8006	VERIFIED HUB CAP CONCER N REPLACE LEFT REAR HUB CAP	13,926 CUST STATES HUB COVER EMBLEM PEALING CUSTOM ER STATES THAT THE RIGHT FRONT CENTER CAP IS MISSING	Under Limit
2006	1ZVHT82H865	29-Mar-06	11-Apr-06	LIBERTY FORD LINCOLN	195274A	5K02	4R3Z	1130	BA	B65	81	E84	7-Jun-07	15	15348	9.97	8.53	18.5	0.1	2222	15348 REPLACE PEALING WHEEL COVER	PEALING CUSTOM ER STATES THAT THE RIGHT FRONT CENTER CAP IS MISSING	Under Limit
2006	1FTZR45E36P	1-May-06	22-Aug-06	DEWEY FORD, INC.	43298102	5K02	5L2Z	1130	BA	B65	7	E84	6-Jul-07	11	15398	11.09	7.93	19.02	0.1	3540	1 REPLACE D CAP RF	STATES THAT THE RIGHT FRONT CENTER CAP IS MISSING	Under Limit



2006	1FTPW14596F	1-Nov-05	15-Jun-06	LITHIA FORD LINCOLN	354534A	5K01 *	1015 *	N22	42 E84	21-Jun-07	13	15433	0	41.32	41.32	0.5	3897	15433 UNBALAN CED TIRES 100 TEST DROVE VEHICLE AND FELT SHIMMY A 70 MPH. BALANCE D AND ROTATED TIRES. TEST DROVE AGAIN. SHIMMY IS NO LONGER FELT AND HIGH SPEEDS.	CUSTOM ER STATES SHIMMY 66 76 MPH	Under Limit
------	-------------	----------	-----------	---------------------	---------	--------	--------	-----	--------	-----------	----	-------	---	-------	-------	-----	------	--	--	-------------

2007	1FMEU73E57U	8-Nov-06	27-Nov-06	DICK EDWARDS FORD-359958A	5K02	*	1A10*	G29	42	E84	3-Aug-07	9	15567	0	68.87	68.87	0.9	5205	15572 CONNEC TED SCAN TOOL RETRIEV ED AND CLEARED CODE B2872 PERFOR MED PIN POINT TESTS RETRAIN ED ALL FOUR TPMS SENSOR S.L.F. 20F18781 ,L.R.20F1 875F,R.F. 20F1876E R.R.20F1 864E SELF TESTED SYSTEM OK	TESTED OK 4648	CUSTOM ER STATES THAT THE TPMS LIGHT KEEPS COMING ON BUT THE PRESSU RE IN TIRES IS FINE.CUS TOMER ADDES THAT TIRE SENSOR FAILIRE LITE CAME ON.	Under Limit		
2007	1FAHP37N17W	31-Oct-06	20-Nov-06	WILLIAMS MOTOR CO.,	320102	5K01	6S4Z	1012	BA	B65	39	E84	6-Aug-07	9	15623	9.63	16.82	26.45	0.2	2173	ROAD REPLACE D TWO LUG NUTS , MISSING CHROME CAPS.  R AND R LEFT FRONT HUB CAP COVER.		2 CHROME CAPS ON LUGNUTS FELL OFF. CHECK PAINT PEELING ON LEFT FRONT HUB CAP COVER	Under Limit
2005	1MEFM55SX5A	2-Jun-04	10-Feb-05	VAN DRISSE LINCOLN-1022427A	5K02	3W3Z	1130	AA	B65	D4	E84	18-Jun-07	29	15725	37.67	8.02	45.69	0.1	12505	WPI			Under Limit	

2005 1FDRE14L15H	12-Jan-05	3-Aug-05	RICART FORD	251676E	5K02	5F9Z	1700 A	B65	D8 E84	22-Aug-07	25	15747	3.95	31.17	35.12	0.4	2185	15747	15751 VALVE STEM LEAK CHECK TIRE, FOUND BUBBELS AROUND STEM. NEC C TO DISMOUNT TIRE. REPLACE STEM. REASEM BLE TIR E AND CHECK BALANCE . 1982	CUST STATES PASS REAR TIRE LOOSING AIR	Under Limit
2007 1FMEU63E17U	20-Sep-06		HOLMAN FORD-MOUNT	1379821C	5K02	5L2Z	1130 BA	B65	42 E84	16-Jun-07	-1	16055	15.02	8.84	23.86	0.1	1325	16055 CONFIRM COMPLAI NT. ONLY 1 IN STOCK, REPLACE D R.F. ORDERE D 1 MORE.	CUST STATES CENTER CAPS ON LEFT SIDE ARE MERCURY	Under Limit	
2006 1ZVHT85H765	27-Feb-06	28-Mar-06	POWER FORD NORTH	047671C	5K02	4R3Z	1130 FA	B65	33 E84	7-Jul-07	16	16062	25.93	8.77	34.7	0.1	20323	16062 1130, CODE 02 REPLACE D THE R F RIM SPINNER, FALLING OFF LOOSE	SPINNER COVER ON THE FRONT PASSENGER RIM FELL OFF	Under Limit	

2005	1FTPX12585N	22-Nov-04	30-Jul-05	HARRELSON FORD, INC	7215051	5K01	*	1007	*	N58	7	E84	13-Jun-07	23	16104	0	47.29	47.29	0.6	1071	INSPECT	WHEEL OUT OF POSITION BRAKE SHOES PAD ASSEMBL IES HYDRAUL IC	C S THAT SHE HEARS A NOISE ON PASSEN GER SIDE FRONT WHEN TURNING MORE TO LEFT AND ACCEL MAKES A CLICKING TYPE NOISE CK AND ADV	Under Limit
2007	1FAHP24117G	31-Jan-07	15-Feb-07	SUNSET AUTO CO INC	3697101	5K02	5G1Z	1130	CA	B65	1	E84	17-Jul-07	6	16345	60.2	0	60.2	0	8198	INSTALLE D ALL FOUR WHEEL COVERS 16365 R.R. WHEEL CENTER CAP SAYS MERCUR Y, REPLACE D WITH	ARE HAVING THE TROUBLE S	Under Limit	
2007	1FMEU63E17U	20-Sep-06		HOLMAN FORD-MOUNT	380196A	5K02	5L2Z	1130	BA	B65	42	E84	22-Jun-07	-1	16365	15.02	8.84	23.86	0.1	1325	FORD.	INSTALL SOP WHEEL CENTER	Under Limit	

2006	1FTPW14516F	2-May-06	30-Jun-06	COOK-WHITEHEAD FOI011710B	5K01 *	1007 *	N22	D9 E84	6-Jul-07	13	16576	0	56.45	56.45	0.8	4910	16576 OUT OF BALANCE 1.5 CHECK BALANCE AND RD FORCE ALL TIRES ALL TIRES GOOD RD FORCE, BALANCE OFF, BALANCE D TIRES PUT LOW RD FORCE #S UP FT, SET TIRES PSI TO SPECS, TWO FT WERE 42 PSI, TST, OK 15	CUSTOM ER STATES HAS VIBRATIO N ALL 0 SPEEDS	Under Limit		
2005	1FAFP23115G	15-Sep-04	24-Oct-04	GRAND LEDGE FORD, I065228B	5K02	4F9Z	1130 AA	B65	33 E84	26-Jun-07	33	16755	17.51	7.66	25.17	0.1	9099	16755 VERIFIED CONCER N. REPLACE D HUB CAP. CHECK ALL OK NOW.	FORD EMBLEM FELL OFF DRIVERS REAR HUB CAP	Under Limit	
2005	1FAFP28105G	3-Jan-05	27-May-05	COPPER COUNTRY FO	6531853	5K02	5G1Z	1130 BA	B65	81 E84	4-Jun-07	25	16825	60.2	13.3	73.5	0.2	6267	PITTED CAPS WHEEL RING HUB CAP WHEEL COVER REPLACE	WHEEL RING HUB CAP WHEEL COVER REPLACE	Under Limit

2005 4M2YU57135D	5-Jan-05	14-Feb-05	WALLACE LINCOLN-ME 089447D	5K02	5E6Z	1130 AA	B65	42 E84	14-Aug-07	31	16839	52.02	15.59	67.61	0.2	10781	REMOVE AND REPLACE WHEEL CENTER CAPS	CUSTOMER STATES THAT CENTER CAPS ARE CORRODED FOUND DURING CERTIFICATION CUSTOMER STATES: ALL FOUR CENTER CAPS ARE TURNING WHITE.	Under Limit	
2005 1FAHP28145G	17-Nov-04	21-Jan-05	COLONY FORD, L.L.C.	177647B	5K02	5G1Z	1130 BA	F36	81 E84	18-Jun-07	30	16905	60.2	17.13	77.33	0.2	1714	REPLACED WHEEL CAPS.ALL FOUR.		Under Limit
2005 1FAFP34N45W	31-May-05	25-Jun-05	EVERGREEN FORD	32688801	5K02	5S4Z	1130 AA	B65	42 E84	22-Aug-07	27	16908	45.08	8.82	53.9	0.1	8305	REPLACED FRONT WHEEL COVERS. OTHER METHODS OF REPAIR HAVE NOT CORRECTED NOISE.	INSTALL SOP HUB CAPS CLICKING NOISE FROM FRT HUB CAPS. REAR WHEEL CENTER CAP IS PEELING	Under Limit
2005 1FMDK021X5G	31-Mar-05	14-Apr-05	B & B FORD SALES INC	7750802	5K02	5G1Z	1130 BA	B65	5 E84	16-Aug-07	29	16978	15.05	6.93	21.98	0.1	6329	REPLACE CENTER CAP		Under Limit

2005	1FTPW14595K	11-May-05	15-Jul-05	BERGSTROM NEENAH-	10198002	5K02	5L3Z	1130	BA	B65	81	E84	14-Jun-07	24	17037	37.95	8.12	46.07	0.1	6226	VERIFY CONCERN AND REPLACE LEFT REAR CENTER CAP	GUEST STATES THE DRIVERS REAR LUG COVER CAP IS MISSING OR FADING THE F 150 SYMBOL	Under Limit
2007	1FAHP34NX7W1	18-Jul-06	3-Aug-06	PURVIS FORD, INC.	080648A	5K01	6S4Z	1012	BA	B65	42	E84	27-Aug-07	13	17104	28.89	24.47	53.36	0.3	61	RIGHT REAR WHEEL IS MISSING LUG NUT COVERS ALSO THE LEFT FRONT LUG NUT COVERS ARE MISSING REPLACE 17118 REPLACE D L F CENTER CAP,OTH ER CENTER CAP MISSING FORD LOGO.	CK FOR THE RIGHT REAR WHEEL IS MISSING LUG NUT COVERS ALSO THE LEFT FRONT LUG NUT COVERS ARE MISSING	Under Limit
2006	1FTPW14556F	13-Feb-06	28-Feb-06	NORTHGATE FORD, IN	139742A	5K02	4L3Z	1130	JA	B65	42	E84	4-Aug-07	18	17118	27.87	8.41	36.28	0.1	2663		CK LF CENTER CAP EMBLEM	Under Limit

2006	1FDNF21526E	25-Jul-05	8-Aug-05	FERRARIO	FORD LINC	029624G	5K01	*	1007	*	N27	42	E84	27-Aug-07	25	17204	0	45.33	45.33	0.7	3366	ROAD TESTED VEHICLE FOR VEHICLE PULLING WHILE BRAKING DID NOT EXPERIENCE CHECKED ALL BRAKES FRONT AND REAR ALL GOOD RECOMMEND TO CUSTOMER TO PERFORM BRAKE SERVICE ON FRONT BRAKES TECH REPLACE THE CENTER CAP AUTH#PA	CUSTOMER STATES WHILE BRAKING THE VEHICLE IS PULLING TO THE LEFT. CHECK AND ADVISE	Under Limit
2005	1FAFP25105G	2-May-05	22-Aug-05	MANGOLD	FORD MERC	9330103	5K02	5G1Z	1130	BA	B65	D4	E84	24-Jul-07	24	17362	16.13	7.59	23.72	0.1	20249	REPLACE D FOUR LUG NUTS CLOSED BY WPI	CUSTOMER STATES THE CENTER CAP IS PEELING. CUSTOMER STATES CHROME CAPS FELL OFF LUG NUTS	Under Limit
2007	1FAHP34N57W	25-Sep-06	2-Oct-06	FAIRWAY	FORD LINCO	102816A	5K01	6S4Z	1012	BA	B65	33	E84	5-Jul-07	10	17385	20.64	16.01	36.65	0.2	20050	17412 .2 REPLACE D L FRT HUB CAP	LEFT FRONT CENTER CAP FELL OFF	Under Limit
2006	2MEFM74W56X	9-Sep-05	6-Oct-05	TASCA	FORD	442321A	5K02	5W3Z	1130	DA	B65	D4	E84	6-Jul-07	22	17412	46.12	8.7	54.82	0.1	796			Under Limit



2005	1FAFP34NX5W	1-Jul-05	21-Jul-05	RUSTY ECK FORD, INC	32364401	5K01	4S4Z	1007 AA	B65	34 E84	19-Jun-07	24	17423	58.79	26.32	85.11	0.3	5319	WHEEL W HUB CAP WILL NOT STAY ATTACHE D TO WHEEL. REPALCE D WHEEL AND BALANCE D, HUB CAP FITS CORREC TLY	THE PASSEN GER FRONT HUB CAP IS CUTTING INTO THE VALVE STEM	Under Limit
2007	1FTPW14V47F	30-Aug-06	9-Jan-07	TERREBONNE FORD	328812A	5K01	2L1Z	1012 AA	B65	69 E84	27-Jul-07	7	17546	6.27	75.73	82	1	6466	17546 DIAG. 2 OF 6 LUG NUTS SEIZED ONTO TO RIM, CHISELD OFF 2 LUG NUTS & REPLACE D 4 DUE TO BEING ROUNDE D OFF, DIAG. CUST HAS FLAT TIRE, INSTALLE D SPARE ON TRUCK CUST WILL BRING BACK AT LATER DATE T	DIAG LUGS ON DRIVERSI DE REAR TIRE SIEZED WILL NOT COME OFF	Under Limit

2005	1FTWF31575E	25-Oct-04	24-Aug-05	CAMPBELL FORD LINC	028954B	5K01	*	1007	*	N50	D9 E84	26-Jun-07	23	17688	0	35.82	35.82	0.5	2744	117668 LEFT FRONT TIRE CHECK FRONT END AND WHEEL BEARING AND BLANCED LEFT FRONT TIRE	CUSTOM ER STATES LEFT FRT TIRE WOBBLE S AND SHAKES	Under Limit	
2007	1FTRW12W07K	1-Aug-06	18-Aug-06	BILL BRANDT FORD INC	058537A	5K01	*	1007	*	B65	42 E84	23-Aug-07	13	17693	0	65.08	65.08	0.6	7873	RELEARN TIRE SENSOR S VERIFIED THE CONCER N: ALL FOUR CENTER CAPS ON THE WHEELS WERE FLAKING AND REQUIRE D REPLACE MEN T. REPLACE D ALL FOUR CENTER CAPS AND VERIFIED THE REPAIR, NOTE: HAD TO REMOVE ALL FOUR	CHECKE NGINE LITE IS ON	Under Limit	
2006	4M2EU47E76U	26-Jul-06	4-Aug-06	AUFFENBERG FORD, I	141317E	5K02	5E6Z	1130	AA	B65	D4 E84	14-Jun-07	11	17743	55.74	18.07	73.81	0.2	8017	THE REPAIR, NOTE: HAD TO REMOVE ALL FOUR WHEELS	SAFELY REMOVE THE CAPS AND TO INSTALL NEW ONES.	B65 ALL CENTER HUB CAPS HAVE POOR APPEARA CNE	Under Limit

2006 3FAFP07196R	7-Oct-05	31-Mar-06	JORGENSEN FORD SAI	894704	5K02	*	1130	*	N50	42	E84	13-Aug-07	17	17882	0	68.49	68.49	0.8	3523	BASIC 1130 CC 42 CHECKE D FRT END ITS TIGHT REMOVE D ALL FOUR HUB CAPS NOISE WENT AWAY REINSTA LLED HUB CAPS NOISE WAS GONE.	CHECK FOR ROTATIO NAL CLICKING NOISE IN FRONT WHEN DRIVING GOES AWAY WHEN STOPPIN G	Under Limit
2005 1FTPW14505K	17-Mar-05	29-Mar-05	DONS FORD, INC.	60500001	5K02	4L3Z	1130	AB	B65	33	E84	26-Jul-07	29	17934	17.58	6.53	24.11	0.1	582	1 REMOVE AND REPLACE D RIGHT HUB COVER	CUSTOM ER STATES RIGHT FRONT HUB COVER EMBLEM FELL OFF FORD EMBLEM PEELING OFF	Under Limit
2006 1FMCU95H26K	23-Aug-05	31-Aug-05	EWALD'S VENUS FORC	51510301	5K02	6L8Z	1130	F	B65	34	E84	15-Jun-07	22	18022	18.75	8.25	27	0.1	3774	PEELING REPLACE CENTER CAP	CENTER CAPS PITTED WHEEL RING HUB CAP WHEEL COVER REPLACE	Under Limit
2006 4M2EU47E36U	1-Jun-06	16-Jun-06	EMERLING FORD MERC	6789651	5K02	5E6Z	1130	AA	B65	5	E84	20-Jul-07	14	18314	52.02	14.39	66.41	0.2	572	CENTER CAPS PITTED WHEEL RING HUB CAP WHEEL COVER REPLACE	CUSTOM ER STATES CENTER CAPS ARE PITTED AND PEELING C S	Under Limit
2006 1ZVFT80N465	29-Apr-06	31-Aug-06	ELYRIA FORD	086861A	5K02	5R3Z	1130	B	B65	42	E84	10-Jul-07	11	18383	18.56	7.86	26.42	0.1	4163	REPLACE CENETR CAP	CENTER CAPS PEELING	Under Limit

2007	1FAHP37N27W	27-Sep-06	28-Oct-06	JORDAN FORD, LTD.	4234652	5K01	6S4Z	1012	BA	B65	39	E84	15-Jun-07	8	18407	14.45	16.11	30.56	0.2	4546	MISSING REPLACE D 2 LUG NUTS	CUSTOMER WAS DRIVING HEAD A CLUNKING NOISE FROM RIGHT FRONT UPON LOOKING AT RIGHT FRONT SHE FOUND SPINNER MISSING	Under Limit
2005	1ZVFT84N955	20-Jul-05	4-May-06	MIDLAND FORD LINCOLN	23905001	5K02	4R3Z	1130	FA	B65	33	E84	7-Jun-07	14	18429	25.93	7.51	33.44	0.1	9801	1130 CC33 REPLACE SPINNER 18551 REMOVED THE TIRE OF THE VEHICLE AND REMOVED THE WHEEL CENTER CAP AND REPLACED IT, REAR WHEEL CENTER CAP CHROME WAS PEELING OFF	C S THE CHROME IS PEELING OFF THE PASSENGER REAR WHEEL CENTER CAP	Under Limit
2006	1FMEU65E96UE	10-May-06	15-Aug-06	CHAMPION FORD KATY	526666B	5K02	6L2Z	1130	AA	B65	81	E84	2-Aug-07	12	18551	5.75	7.88	13.63	0.1	4617	OFF		Under Limit

2005	1FMZU73K45U	2-Dec-04	20-Oct-05	LANDMARK FORD, INC.667349C	5K02	5L2Z	1130	BA	B65	42	E84	19-Jun-07	21	18573	11.09	9.64	20.73	0.1	8559	18573 WARRAN TY ROAD TESTED, HEARD NOISE IN LEFT FRONT, INSPECT ED WHEEL, CHECKE D LUGNUTS , OK. R&I CENTER CAP, ROAD TESTED, OK. R&R LEFT FRONT CENTER CAP, RET ESTED, OK. INSPECT ED AND FOUND NOISE FROM TRAILER HITCH	CHECK FOR CLICK NOISE IN LT FRT WHEEL AREA	Under Limit
2007	1FTSW21P77E	2-Aug-06	21-Nov-06	GRIFFIN FORD LINCOLN012185A	5K01	*	1007	*	N59	33	E84	16-Jul-07	8	18720	0	40.73	40.73	0.5	6360	CHECK FOR RATTLE IN REAR OVER BUMPS	Under Limit	

2005 1FAFP34N65W	30-Jul-04	28-Jan-05	GRAND FORD, INC.	061842A	5K02	*	1130	*	N50	42 E84	26-Jul-07	31	18768	0	49.64	49.64	0.8	7417	TEST WITH CUSTOMER AND VERIFIED CONCERN RAISED ON HOIST USING CHASSIS EARS DETERMINED NOISE COMING FROM WHEEL COVERS RAN OASIS CK TSBS FOLLOW IET TSB06 09 NOISE CUSTOM 05 APPLY TEST ER URETHA DROVE STATES NE TAPE AFTER NOISE TO CONCERN FRONT WHEEL N NO END COVERS LONGER WHILE TO QU PRESENT DRIVING Under Limit
2007 4M2CU39H47KJ	25-Jul-06	18-Sep-06	COPPER COUNTRY FO	6539751	5K02	6M6Z	1130	A	B65	D4 E84	8-Jun-07	9	18835	67.65	6.65	74.3	0.1	6267	FINISH PITTED WHEEL RING HUB CAP WHEEL COVER REPLACE LEFT FRONT HUB CAP PEALING Under Limit

2005	1FAFP34N75W	1-Sep-04	2-Apr-05	CRESTMONT FORD, IN	153863C	5K02 *	1130 *	N50	42 E84	20-Jun-07	27	18955	0	64.43	64.43	0.8	4369	ROAD TEST FOR RUBBING NOISE FROM WHEELS VERIFIED CONCERN, FOUND HUB CAPS MAKING NOISE CHECK SERVICE MESSAGES, FOUND TSB 06 95 REMOVE ALL HUB CAPS, CLEANED ALL HUB CAPS, INSTALL FOAM	LL HUB REROAD TEST TO VERIFY REPAIR	CUSTOMER STATES RUBBING NOISE FROM WHEELS WHILE DRIVING	Under Limit
2006	2MEFM74VX6X	24-Oct-05	13-Nov-06	GRIFFIN FORD LINCOLN	013496B	5K01 *	1007 *	C50	42 E84	13-Aug-07	10	19004	0	48.88	48.88	0.6	6360	TEST DRIVE AND CHECKED STEERING & SUSPENSION ALL OK AND NO PROBLEM FOUND AND NORMAL BUSHING TORQUE		C S THAT THERE IS A CREAKING NOISE HEARD FROM FRONT OF VEHICLE OVER BUMPS AND IPS AND DRIVEWAYS	Under Limit

2004	1FTPX12534N	23-Jun-04	18-Aug-04	BYERLY FORD INC	375129B	5K02	4L1Z	1130 BA	B65	D4 E84	19-Jun-07	35	19005	33.5	7.68	41.18	0.1	5702	19012 WARRAN TY REPLACE LEFT FRONT WHEEL CENTER CAP,APP OVEL CODE PAAHX	C S LEFT FRONT CENTER CAR HAS GLUE COMING OUT AROUND EMBLEM	Under Limit
2005	1FAFP34N35W	22-Jun-04	11-Jul-05	ROBERTS FORD	150062A	5K02	*	1130 *	N50	42 E84	23-Jul-07	25	19082	0	9.15	9.15	0.1	9883	19082 TEST DROVE WITH CUSTOM ER AND HEARD SQUEAKI NG NOISE FROM RT FRONT WHEEL AREA. CHECKE D AND FOUND COMING FROM HUB CAP. REPOSITI ON AND NOISE IS GONE. CHECK TORQUE ON FRONT LUG NUTS. ALL WERE LOOSE. TIGHTEN ED TO SPECS. RETEST OK.	ROARING SOUND LEFT REAR	Under Limit
2006	1LNHM82V86Y	17-Oct-05	1-Nov-05	JERRYS FORD SALES I	38455801	5K01	*	1012 *	N58	33 E84	20-Jun-07	20	19152	0	29.38	29.38	0.3	135		OWNER STATES FRONT END MAKES CLICKING NOISE WHEN TURNING AFTER VEHICLE WARMED UP.	Under Limit



2005	1FAFP38Z65W	13-Apr-04	14-May-05	ACTON LINCOLN MERC 241983A	5K01	*	1007	*	N22	82 E84	21-Jun-07	26	19523	0	62.58	62.58	0.7	13144	Y	ROAD FORCE BALANCE WHEELS FOUND SLIGHT OUT OF VARIANCE IN TWO WHEELS REPLACE PER FORD MOTOR COMPAN	ROADFO RCE BALANCE ALL WHEELS TIRES PER RON TODISCO FORD FSE	Under Limit
2006	1FAFP28136G	10-Nov-05	13-Feb-06	MULLINAX FORD EAST 166601D	5K02	5G1Z	1130	BA	B65	D4 E84	11-Jul-07	18	19528	60.2	17.15	77.35	0.2	2157	D	19528 ORDERE D DIGITAL IMAGING APPROV AL# PAAVN INSTALLE D SOP CENTER CAPS	CUSTOM ER STATES THAT EH CENTER CAPS ARE PEELING, BUBBLIN G	Under Limit
2004	5LMEU68H54Z	15-Sep-03	28-Aug-04	CENTRAL FLORIDA LIN 3306752	5K02	2C5Z	1130	AA	B65	42 E84	6-Jun-07	34	19610	53.21	15.95	69.16	0.2	10021	2	REPLACE D CENTER CAPS ON 2 WHEELS	CENTER CAPS ON WHEELS TWO FELL OFF WHILE DRIVING	Under Limit

2006	3MEFM07Z86R6	14-Mar-06	26-Apr-06	TRI FORD-MERCURY, II	321462E	5K02	7N7Z	1130 A	N57	7 E84	3-Jul-07	15	19728	61.02	17.45	78.47	0.2	8294	TRIED TO PUT RUBBER TO MAKE WHEEL COVERS FIT TIGHTER, DID NOT HELP, HAD TO REPLACE RIGHT SIDE HUBCAPS BECAUSE THEY DID NOT FIT PROPERLY, TEST DROVE AFTER NOISE IS GONE	STILL HEARS A CLICKING NOISE WHEN SITTING IN PASSENGER SEAT WITH WINDOW S DOWN AT SLOWER SPEEDS FROM FRONT TIRE AREA.	Under Limit
2005	1FAFP34N25W	14-Apr-05	27-May-05	VALLEY ISLE MOTORS	369922A	5K02	6S4Z	1130 A	B65	34 E84	28-Jun-07	26	19747	45.08	20.21	65.29	0.2	7839	REPLACED 2 WARPED HUBCAPS	DEFECT, NECESSARY TO REPLACE ALL 4 RIGHT FRONT CENTER CAP PEELING	Under Limit
2005	1FAHP28165G	23-Nov-04	9-Mar-05	SKYLINE SALES, INC.	9458203	5K02	5G1Z	1130 BA	B65	D4 E84	11-Jun-07	28	19799	15.05	8.8	23.85	0.1	8662	1 REPLACE RF HUB CAP		Under Limit

2005	3FAFP31N05P	30-Aug-04	10-Jan-05	PALM SPRINGS FORD I163281B	5K01	6S4Z	1012 BA	B65	33 E84	16-Jul-07	31	19956	24.08	17.74	41.82	0.2	5574	INSTALL A SOCKET ONTO EACH LUG NUT TO TEST THE COVERS, FOUND 5 NUTS WITH THE COVERS DETACHED REPLACE 5 LUG NUTS.	CUST STATES LUG NUT COVER CAME LOOSE FOR CHROME LUG NUT COVERS FALLING OFF AUTH NUMBER PAADS	Under Limit	
2005	1FAHP38Z95W	23-Sep-04	24-Oct-04	TED BRITT FORD SALE 60401003	5K01	6S4Z	1012 BA	B65	42 E84	7-Jun-07	32	20056	24.08	48.38	128.46	0.5	48	REPL SIX LUG NUTS TORQUE TO SPECS 20150 20150 INSTALLED NEW LUG NUTS ON 3 WHEELS ,STAINLESS COVERS CAME OFF MISSING	CUST STATES CAPS CAME OFF LUG NUTS CUSTOMER STATES COVER FOR R/R WHEEL LUG NUT CAME OFF	Under Limit	
2007	1FAFP34N07W	21-Aug-06	25-Aug-06	MULLINAX FORD EAST 168462A	5K01	6S4Z	1012 BA	B65	42 E84	10-Aug-07	12	20150	19.26	0	19.26	0	2157	LUG NUTS COVER COME OFF REPLCE COVER	CUST STATES COVER FOR R/R WHEEL LUG NUT CAME OFF	Under Limit	
2007	1FAHP31N77W	31-Jul-06	6-Sep-06	MOSSY FORD	16092403	5K01	6S4Z	1012 BA	B65	33 E84	16-Aug-07	12	20184	4.82	17.57	22.39	0.2	5428			Under Limit

2006 1FMZK02176G	15-Nov-05	30-Nov-05	JOE SARTAIN FORD, IN	24292002 5K01 *	1007 *	N50	82 E84	30-Jul-07	21	20362	0	41.59	41.59	0.6	5732	TEST DROVE CAR AND CK FOR NOISE TURNING LEFT NPF. CK FOR LOOSE PARTS NPF.	C S THAT WHEN YOU TURN TO THE LEFT IT MAKES A LOUD NOISE	Under Limit	
2006 1ZVFT80N865	22-Dec-05	11-Feb-06	STAR FORD	70377207 5K01	6W7Z	1012 BA	B65	42 E84	9-Jul-07	18	20366	4.31	18.42	22.73	0.2	5537	REPLACE D FAULTY LUG NUT	LUG NUT CHROME LOOSE . CUSTOM ER STATES THERE IS A TICKING NOISE IN THE WHEEL AREA WHILE DRIVING PLEASE CHECK AND ADVISE	Under Limit
2006 3FAFP06Z26R	2-Jan-06	17-Jan-06	CHAPMAN FORD SALE	15600501 5K02 *	1130 *	B65	42 E84	7-Aug-07	19	20416	70	14.91	84.91	0.2	3955	REPLACE WHEEL COVERS	RT REAR HUBCAP FORD PEELING	Under Limit	
2005 1FTSW21P65E	24-Feb-05	24-Aug-05	COPPER COUNTRY FO	6658852 5K02	5C3Z	1130 KA	B65	D4 E84	23-Aug-07	25	20537	42.8	6.65	49.45	0.1	6267	EMBLEM PEELED WHEEL RING HUB CAP WHEEL COVER REPLACE		Under Limit

2004 1FAHP36314W	24-Mar-04	22-Aug-04	GARY YEOMANS FORD	57506302	5K02	*	1130	*	B65	42	E84	4-Jun-07	34	20585	0	63.99	63.99	0.8	4790	TEST DRIVE HEARING NOISE FROM WHEEL COVERS, RUN OASIS FOUND TSB 060905A INSULATE WHEEL COVERS WITH HARD FOAM TAPE CC42 M O 20589 PERFORM MED TECHNICAL SERVICE BULLETIN TO QUIET SQUISH...	CUSTOMER STATES THERE IS A GRIND WHICH STATRTS WHEN THE VEH STARTS TO ROLL, WORSE SINCE TIRES WERE ROTATED . ALSO HAS A SQUISH, SQUISH, SQUISH NOISE AT OR AROUND 10 MPH ON ACCEL. OR DECEL.	Under Limit
2006 1FTPW14516K	10-Feb-06	3-Jul-06	MULLINAX FORD EAST	166497E	5K02	4L3Z	1130	AB	B65	D4	E84	9-Jul-07	13	20675	35.17	17.15	52.32	0.2	2157	20675 REPLACE D FRT CENTER CAPS BOTH PEELING	CUSTOMER STATES FRONT CENTER CAP IS PEELING	Under Limit
2006 3LNHM26186R	17-Jan-06	25-Jan-06	MANGOLD FORD MERC	9220001	5K02	4W1Z	1130	A	B65	D4	E84	23-Jun-07	18	20794	28.7	7.59	36.29	0.1	20249	REMOVE D AND REPLACE D CENTER CAP	CUSTOMER STATES REAR CENTER CAP IS PEELING	Under Limit
2006 1FMYU02Z06K	5-Dec-05	9-Mar-06	GRIFFIN FORD LINCOLN	010616D	5K01	*	1007	*	G29	33	E84	12-Jun-07	16	20925	0	65.17	65.17	0.8	6360	TIRE SENSOR	CUSTOMER STATES TIRE PRESSURE LIGHT IS ON	Under Limit

2006 1FTPX14536F	20-Dec-05	26-Dec-05	IMLAY CITY FORD LINC	2105025	5K02	4L3Z	1130	JA	B65	D4 E84	7-Aug-07	20	20931	55.75	17.01	72.76	0.2	2672	REPLACE D 2 CENTER CAPS	CUSTOM ER STATES TWO CENTER CAPS FINISH COMING OFF, CK AND ADVISE	Under Limit
2007 1FAHP34N97W	12-Sep-06	18-Sep-06	VARSITY FORD	30634301	5K01	6S4Z	1012	BA	B65	1 E84	27-Aug-07	12	21229	24.08	17.03	41.11	0.2	2736	01 BROKEN REPLACE D ONE LF TWO LR AND TWO RR LUG NUTS DUE TO CHROME CAP MISSING TORQUE D TO SPEC AND SET TIRE PRESSU RES 35 PSI LUG NUT CAME APART DUE TO FACTORY DEFECT REPLACE D ALL LUGNUTS ON R F WHEEL.	5 LUG NUTS MISSING CAPS	Under Limit
2005 3FAFP37N25F	3-Sep-04	23-Feb-05	EVERGREEN FORD	32525602	5K01	6S4Z	1012	BA	B65	33 E84	25-Jul-07	30	21378	19.26	17.65	36.91	0.2	8305	LUGNUT CAPS ARE LOOSE.	Under Limit	
2006 1FAFP34N46W	10-Apr-06	8-May-06	MULLINAX FORD EAST	165201E	5K01	6S4Z	1012	BA	B65	33 E84	15-Jun-07	14	21721	33.71	17.15	50.86	0.2	2157	21721 REPLACE D 7 LUG NUTS FOR LOOSE CAPS	CUST STATES CHECK LUGG NUTS MAKING NOISE	Under Limit

2006 1FAFP53U76A	12-May-05	28-May-05	VISTA FORD	018271A	5K02	*	1130	*	N50	41	E84	9-Aug-07	27	21770	0	45.38	45.38	0.5	7923	21770 181 DIAGNOS E AS HUB CAP SQUEEK LUBED ALL 4 CAPS MT	CUST STATES HEARS CLICKING TYPE NOISE AT SLOW SPEEDS ESPECIA LLY WHEN DRIVING NEXT TO WALLS	Under Limit
2006 1FAFP38Z56W	13-Feb-06	24-Apr-06	LANDMARK FORD, INC.	668914B	5K02	97BZ	1130	AA	B65	7	E84	3-Jul-07	15	21844	23.94	9.64	33.58	0.1	8559	21844 WARRAN TY REPLACE D MISSING HUB CAP ON RF WHEEL	MISSING WHEEL COVER	Under Limit
2006 1FTPX12596F	17-Jan-06	26-Aug-06	CAMPBELL FORD LINC	030900E	5K02	*	1130	*	B66	39	E84	10-Aug-07	12	21854	0	7.16	7.16	0.1	2744	VERIFRIE D CUSTOM ERS CONCER N REPLACE D CENTER CAP AFTER RECEIVIN G PRIOR APPROV AL FROM DIGITAL IMAGING PAAMU. SOP CENTER CAP	CUSTOM ER STATES CENTER CAP ON DRIVERS REAR MISSING FORD EMBLEM	Under Limit

2006 1FDAW57P56E	4-Jan-06	20-Apr-06	MORRISTOWN FORD, II	2215204 5K02 *	1700 *	H22	42 E84	23-Jul-07	16	22065	14.95	13.42	28.37	0.2	5684	CHECKED TIRE INFLATION GOES DOWN LOCATED LEAK AT VALVE STEM ORDERED ALUMINUM STEM AND INSTALLED RETESTED NO LEAK FOUND CP: 1700 INSPECTED AND FOUND VALVE STEM LEAKING	REPLACED VALVE STEM AND SET PRESSURE	TIRE CONCENTS CUSTOMER STATES THAT THE LEFT REAR OUTSIDE TIRE KEEPS LOOSING AIR	Under Limit
------------------	----------	-----------	---------------------	----------------	--------	-----	--------	-----------	----	-------	-------	-------	-------	-----	------	--	--------------------------------------	---	-------------

2006 1FTPW14V36K	15-Jun-06	23-Apr-07	VAN BURKLEO FORD	115623A 5K01 *	1007 *	N24	13 E84	20-Jun-07	2	22357	0	61.84	61.84	0.8	4241	VERIFIED CONCERN, PERFORM ROADFORCE BALANCE NEC TO ROAD FORCE ALL TIRES OUT OF SPEC WILL NOT BALANCE BEFORE REPAIR	FEELS A VIBRATION AT HWY SPEED	Under Limit
------------------	-----------	-----------	------------------	----------------	--------	-----	--------	-----------	---	-------	---	-------	-------	-----	------	--	--------------------------------	-------------



2005	1FAFP36N35W	6-Aug-04	26-Jan-05	WOODY ANDERSON FC	5509152	5K01	6S4Z	1012	BA	B65	33	E84	9-Aug-07	31	22642	19.26	15.3	34.56	0.2	5892	VERIFIED CUST CONCER N, REPLACE 2 NUTS ON L R,1 ON L F, 1 ON R F	CK CHROME LUGNUT COVERS ARE FALLING OFF OF LUGNUTS	Under Limit
2006	1FMEU73E16U	17-Nov-05	2-Dec-05	BANKSTON FORD OF F	500167A	5K01	*	1007	*	G29	D1	E84	2-Aug-07	21	22645	0	33.85	33.85	0.4	2441	22645 REPLACE D VALVE STEM .50 TEST,GO OD MOUNTE D AND RE BAL TIRE	RIGHT FRONT TIRE LEAKING, CHECK TIRE IN TRUNK..C HECK VALVE STEM	Under Limit
2006	1FTPX12596	17-Jan-06	26-Aug-06	CAMPBELL FORD LINC	031781A	5K02	4L3Z	1130	AB	B65	81	E84	30-Aug-07	13	22787	17.58	7.16	24.74	0.1	2744	VERIFIED CUSTOM ER CONCER N REPLACE D EMBLEM	REPLACE HUB CAP DRVS REAR FORD EMBLEM FELL OFF	Under Limit
2005	1FAFP25145G	16-Mar-05	31-Mar-05	APPLE VALLEY FORD L	64796001	5K02	5G1Z	1130	BA	B65	5	E84	17-Aug-07	29	22867	30.1	19.93	50.03	0.2	9217	VERRIFIE D REAR CENTER CAP PROBLE M AND SENT PICS TO FORD RECIEVE D ACES CODE PAARF TO HAVE PARTS INSTALLE D. PARTS ORDERE D AND INSTALLE D 8 22 07	CUST STATES THE REAR WHEEL CENTER CAPS PAINT PEELING AND COOROSI ON STARTIN G. PLEASE INSPECT.	Under Limit

2005	1FAFP34N75W	13-Aug-04	25-Oct-04	MULLINAX FORD NORT	307151D	5K01	6S4Z	1012 BA	B65	39 E84	4-Jun-07	32	22913	48.16	16.11	64.27	0.2	2370	VERIFIED CONCERN, REPLACED LUG NUT CAPS	CUSTOMER STATES CHECK LUG NUT CAPS MISSING NEED 1 WHEEL CENTER COVER ORDERED	Under Limit
2005	1FTSW21P75E	10-Feb-05	22-Feb-05	GOLDEN CIRCLE FORD	222767A	5K02	5C3Z	1130 AC	B65	33 E84	28-Jun-07	29	23196	40.81	7.06	47.87	0.1	5885	23196 WHEEL COVER INSTALLED	CHECK NOISE FROM FRT. SEE ERIC	Under Limit
2005	2MEFM74WX5X	23-Jun-05	27-Dec-05	LIBERTY LINCOLN MER	114815A	5K02	3W3Z	1130 CA	N50	42 E84	21-Jun-07	19	23249	45.4	16.35	61.75	0.2	11000	23249 REPLACE R FRT. HUBCAP	CUSTOMER STATES ROTATIONAL NOISE IN FRONT OF CAR, POSS FROM BRAKE SYSTEM CK AND ADV	Under Limit
2004	1FDWE35L64H	22-Jun-04	6-Dec-04	ENFIELD FORD	16020401	5K02	*	1130 *	B65	42 E84	21-Aug-07	33	23350	0	78.81	78.81	1	8821	ROAD TEST FOR NOISE, FOUND NOISE COMING FROM FRONT HUB CAPS	Under Limit	
2005	1FAFP36N65W	24-Aug-04	30-Apr-05	BILL ESTES FORD	10660101	5K02	*	1130 *	B65	42 E84	2-Jul-07	27	23448	0	60.54	60.54	0.8	3362	SQUEAK FROM WHEEL COVERS. PERFORM HUB REVISION TSB 06 9 5. REPL 6 PIECES OF TAPE ON HUB TABS. TEST DROVE TO VERIFY REPAIR	CK CLICKING IN WHEELS SINCE TIRES ROTATED	Under Limit

2005	4M2YU57135D	2-Mar-05	18-Aug-05	NORTHLAND LINCOLN	3884301	5K02	5E6Z	1130	AA	B65	D4 E84	28-Jun-07	23	23539	52.02	14.91	66.93	0.2	10638	REPLACE CENTERS ALL FOUR WHEELS	WHEEL CENTERS ARE PEELING	Under Limit
2005	1FAFP25115G	26-May-05	16-Jun-05	ULRICH MOTOR CO.	11673907	5K02	5G1Z	1130	BA	B65	30 E84	10-Aug-07	27	23618	30.1	13.83	43.93	0.2	3457		Under Limit	
2006	3FAFP06Z96P	12-Jan-06	27-Jan-06	SUNRISE FORD OF NO	286848A	5K02	7E5Z	1130	A	B65	42 E84	7-Jun-07	17	23658	22.75	9.1	31.85	0.1	5453	REPLACE D BAD HUB CAP	CLICKING SOUND FROM FRONT	Under Limit
2005	1FTPX04585K	23-Jun-05	5-Aug-05	FRIENDLY FORD, INC.	148644B	5K01	2L1Z	1012	AA	B65	69 E84	11-Jun-07	23	23753	9.41	42.82	52.23	0.5	2662	23753 USING BREAKER BAR AND TORCHE S REMOVE D 3 FROZEN LUG NUTS. APPLIED ANTI SEEZE TO THREAD SURFACE AND NUT SURFACE	PASSEN GER SIDE REAR TIRE HAS 3 LUG NUTS ON IT THAT WILL NOT MOVE	Under Limit

2004	1FTPW14544K	18-May-04	30-Sep-04	MORROW FORD LINCC	2373302	5K02	4L3Z	1130	DD	B65	D4	E84	6-Aug-07	35	23762	40.75	6.77	47.52	0.1	7327	B65 VERIFIED , SENT PHOTOS TO DIGITAL IMAGING. THEYAPP ROVED THE REPLACE MENT OF THE CENTER CAP ON LEF T REAR. REPLACE D CENTER CAP.	LEFT REAR CENTER CAP IS PEELING	Under Limit
2005	5LMFU28545L	25-Feb-05	11-Oct-05	GERVAIS LINCOLN-MEI	12810002	5K02	5L7Z	1130	AA	B43	D4	E84	3-Aug-07	23	24100	33.03	8.63	41.66	0.1	13100	VERIFY CONCER N. DETERMI NED WHEEL COVERS CAUSING NOISE INSULAT ED FRONT WHEEL COVERS	CUST STATES CLICKING NOISE COMING FROM WHEELS	Under Limit
2006	3MEFM07Z96F	2-Dec-05	6-May-06	PEARSON LINCOLN ME	20720501	5K02	*	1130	*	N50	33	E84	6-Jun-07	14	24138	0	15.66	15.66	0.2	12311			Under Limit

2005	1FAFP34N95W	5-May-05	16-May-05	DARLING'S BANGOR FC	49265301	5K02	5S4Z	1130	AA	N50	42	E84	7-Jun-07	26	24193	63.21	75	138.21	1	9044	TESTED AT VARIOUS SPEEDS, CORNERING, STOPPING OVER BUMPS WITH WINDOW UP AND WITH WINDOW DOWN AND WAS UNABLE TO DUPLICATE CONCERN. CHECKED OASIS AND FOUND NO SSMS OR TSBS THAT APPLY. ON LIFT	ED ALL FOUR HUB CAPS AND VERIFIED CONCERN IS REPAIRED.	CUSTOMER STATES THERE IS A SQUEAL NOISE COMING FROM FRONT END ALL OF THE TIME. PLEASE CHECK AND ADVISE	Under Limit
2005	1FAFP53U15	13-Oct-04	28-Oct-04	BEAVERTON FORD	047138A	5K02	*	1130	*	N50	33	E84	16-Aug-07	35	24412	0.01	27.62	27.63	0.3	8729	24412 TECH 3311 ROAD TEST CAP IS NOISEY. REMOVED HUB CAP INSTALLED RUBBER INSULATORS ON CAP .ROAD TEST .		CUSTOMER STATES TICKING NOISE IN RIGHT FRONT WHEEL AREA	Under Limit

2005 1FAFP34N35W	30-Jul-04	31-Dec-04	HARRELSON FORD, INC	7274051	5K02	6S4Z	1130 A	N17	7 E84	26-Jun-07	31	24468	22.54	7.88	30.42	0.1	1071	WHEEL COVER CAUSING NOISE WHEEL RING HUB CAP WHEEL COVER REPLACE	RUBBING NOISE LEFT FT WHEEL AREA DRIVING SLOW SPEEDS	Under Limit
------------------	-----------	-----------	---------------------	---------	------	------	--------	-----	-------	-----------	----	-------	-------	------	-------	-----	------	--	--	-------------

2005 1FAFP34N15W	17-Dec-04	22-Apr-05	SARAT FORD SALES, INC	26545402	5K02	*	1130 *	N50	41 E84	3-Jul-07	27	24501	0	7.56	7.56	0.1	9137	ROAD TESTED HEARD NOISE COMING FROM DRIVERS TIRE WHEEL AREA REMOVE D WHEEL COVER ROAD TESTED NOISE GONE INSTALLED ANTI SEIZE ON CONTACT POINTS OF WHEEL COVER ROAD TESTED NOISE GONE	CUSTOMER STATES THERES STILL A NOISE PRESENT IN FRONT END THAT CAN BE HEARD WHEN SLOWING DOWN WITH THE WINDOW S DOWN.	Under Limit
------------------	-----------	-----------	-----------------------	----------	------	---	--------	-----	--------	----------	----	-------	---	------	------	-----	------	--	---	-------------

2007 1FDNF20507E	31-Aug-06	20-Dec-06	BLUEBONNET MOTORS	47175901	5K02	5C3Z	1130 CB	T55	25 E84	26-Jun-07	7	24715	39.62	8.39	48.01	0.1	4570	INSTALLED NEW HUBCAP	LEFT REAR WHEEL CENTER CAP FELL OFF	Under Limit
------------------	-----------	-----------	-------------------	----------	------	------	---------	-----	--------	-----------	---	-------	-------	------	-------	-----	------	----------------------	-------------------------------------	-------------

2006	1FMYU96H56K	5-Aug-05	26-Nov-05	LANDMARK FORD, INC.	673216C	5K02	6L8Z	1130 F	B65	1 E84	11-Aug-07	21	24805	18.75	9.64	28.39	0.1	8559	24805 CENTER CAP WARRAN TY FOUND CENTER CAP RETAIN RS BROKEN WITH NO VISIBLE DAMAGE. REPLACE D CAP.	CENTER CAP IS BROKEN	Under Limit
2005	1FAFP34N45W	22-Sep-04	18-Nov-04	FRIENDLY FORD, INC.	149531A	5K01	6S4Z	1012 BA	B65	42 E84	2-Jul-07	32	24820	14.45	17.13	31.58	0.2	2662	24820 REPLACE D 3 LUG NUTS ON LR WHEEL CENTER CAPS ARE ALL CORROD ED WAITING FOR PARTS, THEN WAITING FOR CUST TO RETU	CUSTOM ER STATES LEFT REAR WHEEL LUG NUT CAPS FELL OFF THREE	Under Limit
2005	1FAHP281X5G	1-Jul-05	10-Aug-05	MOSINEE FORD	6004801	5K02	5G1Z	1130 BA	F11	42 E84	15-Jun-07	23	24837	60.2	12.72	72.92	0.2	6145	RN TO TOWN.	CUST STATES CENTER HUB CAPS ARE CORROD ED	Under Limit

2006 4M2EU48836U	23-Mar-06	16-Jun-06	SOUTHGATE LINCOLN	82451	5K02	5E6Z	1130 AA	F19	5 E84	21-Aug-07	15	24943	52.02	17.32	69.34	0.2	10671	CONFIRMED CUSTOMERS CONCERN GOT APPROVAL FROM FORD PAASR TO REPLACE ALL 4 CENTER CAPS REPLACED 4 CENTER CAPS BASIC# 1130	CUSTOMER STATES CENTER CAPS ARE OXDIZING PLEASE CHECK AND ADVISE.	Under Limit
2006 1FAFP53U26A	6-Jan-06	21-Jan-06	GRIFFIN FORD LINCOLN	012903A	5K02	*	1130 *	N57	42 E84	31-Jul-07	19	24984	0	73.32	73.32	0.9	6360	DIAGNOSIS FOR NOISE AND R&R ALL HUB CAPS & APPLIED ANTI RATTLE TAPS TO ALL HUB CAPS	C S THAT THERE IS A SQUEELING NOISE FROM RIGHT FRONT TIRE WHILE DRIVING	Under Limit
2007 1FAFP53U17A	4-Apr-06	16-Jun-06	VALLEY ISLE MOTORS	369222A	5K02	YF1Z	1130 AB	N50	2 E84	19-Jun-07	13	25003	34.43	70.74	105.17	0.7	7839	VERIFIED AND TRACED WITH ELETRONIC EARS TO RF HUB CAP	SQUEEK S & RATTLES ROTATIONAL NOISE FROM RF WHEN NEXT TO BUILDING OR VEH	Under Limit
2006 1FAFP34N36W	28-Mar-06	12-Apr-06	BARBER FORD, INC.	6704902	5K01	6S4Z	1012 BA	B65	5 E84	4-Aug-07	16	25066	4.82	6.8	11.62	0.1	3982	REPLACE RIGHT FRONT LUG NUT	RIGHT FRONT LUG NUT CHROME CAME OFF	Under Limit



2005 1FAFP36N15W	28-Apr-05	14-Jul-05	ROSEMURGY MOTORS	20688504	5K01	6S4Z	1012 BA	B65	1 E84	4-Jun-07	24	25134	12.25	31.82	44.07	0.4	6366	REPLACE D ONE LUG NUT AND STUD ON RIGHT REAR TIRE TO COMPLET E REPAIRS ADD ON BY PAUL. WPI	Under Limit
2005 1FTWW33P45E	8-Mar-05	28-Apr-05	DOWNS FORD, INC.	9129451	5K02	2C3Z	1700 CA	B65	69 E84	20-Jul-07	28	25244	33.75	53.8	87.55	0.6	20681	VALVE CAP SEIZED TO STEM BROKE TRYING TO REMOVE, R&R WHEEL ASSY R&R TIRE FROM WHEEL AND INST NEW STEM ASSY AND REBAL WHEEL ASSY TIRE CUSTOM ER STATES BOTH DRIVERS SIDE WHEEL CENTER CAPS PEELNG	Under Limit
2005 1FTPW14515K	20-Sep-04	1-Oct-04	DONS FORD, INC.	61035101	5K02	5L3Z	1130 S	B65	5 E84	10-Aug-07	35	25553	44.02	13.06	57.08	0.2	582	REPLACE D BOTH LEFT CENTER CAPS	Under Limit

2006 1FMZK04126G		15-Sep-05	30-Sep-05	GRIFFIN FORD LINCOLN	011124A	5K01	*	1007	*	N58	42 E84	21-Jun-07	21	25598	0	40.73	40.73	0.5	6360	INSPECTED FOR NOISE ON HARD TURNS PINPOINT TO STEERING STOPS. LUBED PER SSM AND RETEST OK	C S ON HARD TURNS THERE IS A CLUNKING NOISE	Under Limit
2006 1FAFP53U86A		2-Dec-05	17-Dec-05	TED BRITT FORD SALE	60745301	5K02	*	1130	*	N50	7 E84	2-Jul-07	19	25652	0	19.35	19.35	0.2	48	RESECURED LOOSE WHEEL COVER REPLACE D TWO RIGHT REAR LUG NUT CAPS.	CK FOR A SQUEAKING AND CLICKING NOISE FROM LEFT FRONT WHEEL WHILE DRIVING	Under Limit
2006 1FAHP34N66W		13-Mar-06	30-Jun-06	STAR FORD	70346805	5K02	6S4Z	1K01	A	H26	7 E84	3-Jul-07	13	25718	8.71	18.42	27.13	0.2	5537	25771 REPLACE PEELING CENTER CAPS	PERFORM MULTI POINT INSPECTION ON CUST STATES THAT 3 CENTER CAPS ARE PEELING	Under Limit
2005 1FAFP23105G1		5-Nov-04	21-Jul-05	MULLINAX FORD EAST	164582A	5K02	4F9Z	1130	AA	B65	D4 E84	4-Jun-07	23	25771	52.54	17.15	69.69	0.2	2157			Under Limit

Year	Plate	Reg Date	Ins Date	Ins Name	Ins Type	Ins Code	Ins Class	Ins Sub	Ins Val	Ins Unit	Ins Date	Ins Qty	Ins Amt	Ins Tax	Ins Fee	Ins Total	Ins Desc	Ins Status	Ins Limit		
2005	1FTSW21P85E	1-Apr-05	16-May-05	GARY YEOMANS FORD	57932203	5K02	5C3Z	1130 AC	B65	1	E84	11-Jul-07	27	26003	40.81	8	48.81	0.1	4790	CLIPS BROKE OFF PLEASE CHECK AND ADVISE	Under Limit
2006	1FAHP34N36W	9-Sep-05	25-Jan-06	DAVIDSON MOTOR COI	093217A	5K01	*	1007 *	N58	63	E84	4-Jun-07	17	26034	0	41.39	41.39	0.6	7509	CHECK NOISE IN FRONT END.	Under Limit
2006	1FMEU74E46U	15-Nov-05	5-Dec-05	MILLER FORD SALES	1027162	5K01	*	1007 *	C50	42	E84	22-Aug-07	21	26253	0	71.27	71.27	0.8	1336	CHECK FOR VIBRATION IN STEERING WHEEL	Under Limit

CUSTOMER REQUESTS GENERAL REPAIRS CUSTOMS CENTER CAP CLIPS BROKE OFF PLEASE CHECK AND ADVISE Under Limit

CHECK NOISE IN FRONT END. Under Limit

CHECK FOR VIBRATION IN STEERING WHEEL Under Limit

2005	1FTPW14585	28-Sep-04	23-Jul-05	DEWEY FORD, INC.	43337803	5K02	5L3Z	1130	EA	B65	D4	E84	10-Jul-07	24	26428	57.34	7.93	65.27	0.1	3540	1 REPLACE D RIGHT FRONT HUB CAP NOTE: PRIOR CAP REPLACE MENT WAS ON A DIFFERE NT WHEEL... R4 425737 01 WAS FOR A DIFFERE NT HUBCAP 1 REPLACE D 3 LUG NUT COVERS, RECHEC K ALL OK AT THIS TIME	CUSTOM ER STATES LOGO COMING OFF RIGHT FRONT HUB CAP	Under Limit
2006	1FAFP31N06W	10-Nov-05	20-Dec-05	ENFIELD FORD	15254804	5K02	6S4Z	1K01	A	B65	42	E84	14-Jun-07	19	26488	13.06	15.76	28.82	0.2	8821	CUST STATES 3 LUG NUT COVERS HAVE FALLEN OFF CK AND ADV	Under Limit	
2007	1FAFP34N07W	23-Jun-06	8-Jul-06	AUFFENBERG FORD, INC.	141572D	5K01	6S4Z	1012	BA	B65	33	E84	26-Jun-07	12	26625	15.48	27.11	42.59	0.3	8017	26625 VERIFIED CUSTOM ER CONCER NS FOUND LUGGE NUTS WHERE HARD TO REMOVE VERIFIED REPAIR	99 3 LUG NUTS HARD TO REMOVE	Under Limit

2005 1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CREEK FORD 536329A	5K02	5C3Z	1130 AC	B66	33 E84	20-Jun-07	26	26724	40.81	0	40.81	0	7820	26724 INSTALLE D NEW HUBCAP NO PART TO RETURN	CUST SAYS LEFT FRONT HUBCAP CAME OFF WHILE DRIVING	Under Limit
2005 1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CREEK FORD 536329B	5K02	5C3Z	1130 AC	B66	33 E84	20-Jun-07	26	26724	40.81	0	40.81	0	7820	26724 INSTALLE D HUBCAP NO PART TO RETURN	CUST SAYS RIGHT FRONT HUBCAP CAME OFF WHILE DRIVING	Under Limit
2005 1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CREEK FORD 536329C	5K02	5C3Z	1130 AC	B66	33 E84	20-Jun-07	26	26724	40.81	0	40.81	0	7820	26724 INSTALLE D HUBCAP NO PART TO RETURN	CUST SAYS LEFT REAR HUBCAP CAME OFF WHILE DRIVING	Under Limit
2005 1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CREEK FORD 536329D	5K02	5C3Z	1130 AC	B66	33 E84	20-Jun-07	26	26724	40.81	0	40.81	0	7820	26724 INSTALLE D HUBCAP NO PART TO RETURN	CUST SAYS RIGHT REAR HUBCAP CAME OFF WHILE DRIVING	Under Limit
2006 1FAHP34N16W	1-Feb-06	16-Mar-06	LIBERTY FORD LINCOL 196174B	5K02	6S4Z	1130 B	B65	D1 E84	2-Jul-07	16	26878	67.62	17.05	84.67	0.2	2222	26878 3 OUT OF THE 4 WHEELS ARE PEELING. ORDERE D.REPLA CED 3 OUT OF 4 WHEEL COVERS, LEFT FRONT ONLY O.E. ONE.	C S PAINT COMING OFF WHEELC OVERS	Under Limit PE08-060 1415

2006	1FAFP53U16A	17-Oct-05	1-Nov-05	JOE SARTAIN FORD, IN	24249002	5K01	*	1007	*	N51	82	E84	12-Jul-07	21	26887	0	41.59	41.59	0.6	5732	TEST DRV VEH AND PUT UP ON LIFT, FOUND NO PROBLE	RIGHT REAR NOISE LIKE SOMETHI NG IS LOSE	Under Limit
2005	3FAFP37NX5R	2-Dec-04	27-Dec-04	VISTA FORD	014952A	5K02	5S4Z	1130	AA	B65	33	E84	22-Jun-07	31	26976	22.54	9.08	143.62	0.1	7923	REPLACE THE LEFT REAR HUBCAP THAT FELL OFF WHILE DRIVING	CUST STATES L REAR HUBCAP FELL OFF WHILE DRIVING	Under Limit
2005	1FAFP34NX5W	25-Apr-05	10-Jun-05	JOHN LANCE FORD	147020B	5K02	*	1130	*	N59	42	E84	1-Aug-07	27	27027	0	69.28	69.28	0.8	2284	27027 VERIF CONCER N PERF TSB 06 09 5 ADDED FOAM TAPE TO WHEEL COVERS	CUST STATES THERE IS A ROTATIN G SWISHIN G SOUND COMING FROM WHEELS CANNOT TELL IF COMING FROM FRONT OR BACK	Under Limit

2005	1ZVFT82H955	1-Mar-05	7-Apr-05	PHIL LONG FORD, LLC	78104102	5K02	4R3Z	1130	BA	B65	7	E84	11-Jul-07	28	27144	19.94	17.98	37.92	0.2	3140	1 INSPECT REPLACE D LEFT FRONT & LEFT REAR CENTER WHEEL CAPS ADHESIV E FAILURE ON EMBLEM S APPROV AL #PAAFZ	CUSTOM ER STATES, THAT THE FORD EMBLEM S ON THE DRIVER FRT TIRE IS PEALING UP AND THE REAR TIRE IS BROKEN OFF. PLEASE CHECK AND ADIVSE.	Under Limit
2005	1FAFP34N75W	28-Jun-05	21-Jul-05	L F DONNELL INC	418383A	5K02	*	1130	*	N50	42	E84	14-Jun-07	24	27184	0	60.25	60.25	0.8	2220	TECH FOUND TSB 06 09 5 TAPED WHEEL COVER AND OUTSIDE EDGE COVER TO STOP SQUEAKI NG	CUSTOM ER STATES HAS NOISE FROM DRIVERS FRONT WHEEL AREA CHECK CENTER CAP CORROSI ON	Under Limit
2004	1FTRX12W84N	12-Jan-04	18-Nov-04	LIBERTY LINCOLN MER	115761C	5K02	4L1Z	1130	BA	B65	14	E84	31-Jul-07	33	27468	67	16.35	83.35	0.2	11000	27468 REPLACE 2 WHEEL COVERS	CUSTOM ER STATES THERE IS A CLICKING FROM WHEELS WHILE DRIVING SEE BOB MAXEY FRP	Under Limit
2005	3FAFP37NX5R	2-Dec-04	27-Dec-04	VISTA FORD	016669C	5K02	*	1130	*	N50	D4	E84	18-Jul-07	32	27555	0	18.15	18.15	0.2	7923	27555 181 LUBED NOISEY HUB CAPS	CUSTOM ER STATES THERE IS A CLICKING FROM WHEELS WHILE DRIVING SEE BOB MAXEY FRP	Under Limit

2006 1FTPW14596KB	3-Nov-05	5-Sep-06	LUNDGREN MOTORS, I	032564A	5K02	4L3Z	1130 JA	B66	14 E84	25-Jul-07	11	27566	55.75	15.4	71.15	0.2	9304	REPLACE D BOTH LEFT HUB CAPS TEST DRIVE AND DIAGNOS IS. COULD NOT DUPLICA TE CONCER N	HUB CAPS ARE CORROD ED AND PEELING	Under Limit	
2006 1FMEU73866U	5-Oct-05	29-Dec-05	GRIFFIN FORD LINCOLN	011569A	5K01	*	1007 *	H20	42 E84	29-Jun-07	19	27708	0	57.02	57.02	0.7	6360	27927 REPLACE D ALL 4 CENTER CAPS FOR DELAMIN ATING	CHECK FOR VEHICLE LURCHIN G WHILE BRAKING	Under Limit	
2005 4M2CU57145D	16-Feb-05	14-Jun-05	TASCA FORD	448383A	5K02	5E6Z	1130 AA	B65	D4 E84	21-Aug-07	27	27927	52.02	17.4	69.42	0.2	796		CHECK CENTER CAPS (PEELING )	Under Limit	
2006 1FMEU72E26U	26-May-06	1-Jun-06	KINGS FORD INC	2210403	5K01	*	1015 *	B65	42 E84	7-Jun-07	13	28096	0	22.59	22.59	0.3	1970	CP: 1015 0.3 VERIFY CONCER N. CHECK TIRE PRESSU RE FOUND LEFT FRONT TIRE HAS LOW TIRE PRESSU RE. RAISE VEHICLE ON HO	IST AND FOUND NAIL IN LEFT FRONT TIRE. PLUG TIRE AND SET TIRE PRESSU RE TO SPEC. ROAD TEST TO VERIFY REPAIR OK.	LOW PRESSU RE LIGHT IS ON CENTER CAP EMBLEM COMING OFF	Under Limit
2005 1FTPW14565K	29-Apr-05	7-Jun-05	DAVE HOLT FORD-MEF	16446901	5K02	5L3Z	1130 BA	B65	42 E84	5-Jul-07	26	28110	37.95	16.94	54.89	0.2	9463	INSTALLE D NEW CENTER CAP		Under Limit	



2005 1FAHP281X5G	11-Mar-05	24-Mar-05	DON CHALMERS FORD	4496854	5K02	5G1Z	1130 A	B02	34 E84	20-Aug-07	30	28113	0	17.59	17.59	0.2	1487	ALL FOUR HUB CAPS WERE PEELING. REPLACE THE HUB CAPS. CUSTOMER STATES HEARS NOISE COMING FROM L FRONT WHEEL ROAD TEST CAR, FOUND NOISE COMING FROM LF WHEEL AT ANY SPEEDS, FOUND NOISE COMING FROM LF HUB CAP, REPLACE HUB CAP WENT ON TEST DRIVE	CUSTOMER STATES ALL OF THE CENTER CAPS COATING IS PEELING OR HAS CORROSION DI AUTH PAAUM	Under Limit
2005 1FAFP34N05W	28-Jun-04	20-Aug-04	TASCA FORD	441589C	5K02	6S4Z	1130 A	B65	42 E84	30-Jun-07	35	28198	22.54	8.7	31.24	0.1	796	NOISE COMING FROM LF HUB CAP, REPLACE HUB CAP WENT ON TEST DRIVE	CHECK NOISE COMING FROM LEFT FRONT OF VEHICLE, CUST STATES VEHICLE IS MAKING A ROTATING SWOOSHING TYPE NOISE, CHECK AND ADVISE.	Under Limit

2006 3FAFP06Z26P	15-Mar-06	5-Apr-06	PALM COAST FORD	4925601	5K02	6E5Z	1130 A	B65	33 E84	17-Jul-07	16	28206	23.88	7.56	31.44	0.1	3326	RIGHT FRONT WHEEL COVER DEFORMED REPLACE RIGHT FRONT WHEEL COVER. NOISEY INSTALL FOAM PAD INCLUDES TIME TO REMOVE AND INSTA	C S RIGHT FRONT HUBCAP KEEPS FALLING OFF  SQUEAK RT REAR WHEEL WHEN DRIVING NOISE IS ROTATIO	Under Limit
2005 1FAFP53U85A	7-Apr-05	22-Apr-05	NORRIS FORD	9082851	5K02	*	1130 *	N51	42 E84	29-Jun-07	27	28471	0	63.79	63.79	0.8	34	INSTA LL WHEEL COVERS		Under Limit
2006 1ZVFT84N765	13-Dec-05	5-Jan-06	JOE COOPER FORD OF	423713G	5K02	4R3Z	1130 FA	B65	1 E84	27-Jun-07	18	28491	25.93	7.69	33.62	0.1	3036	28491 CC 01 BROKEN RETAINING TABS ON INSIDE OF WHEEL CENTER CAP CAUSING CAP TO FALL OFF CK ORDER AND REPLACE WHEEL CENTER CAP DMC 28503 REPLACE D CENTER WHEEL CAPS	L R WHEEL CENTER CAP LOOSE (PART INSIDE CAR) CHECK CENTER WHEEL HUBS FOR PEELING	Under Limit
2005 1FAHP28145G	3-Mar-05	30-Apr-05	LIBERTY LINCOLN MER	115251H	5K02	5G1Z	1130 BA	B65	14 E84	10-Jul-07	27	28503	60.2	32.7	92.9	0.4	11000			Under Limit

2005	1FMZU73K75	5-Oct-04	31-Mar-05	FRIENDLY FORD, INC.	150287C	5K02	4L2Z	1130 CA	B65	81 E84	21-Jul-07	29	28560	31.12	8.56	39.68	0.1	2662	28560 REPLACED THE RIGHT FRONT WHEEL CENTER CAP	CUSTOMER STATES PASSENGER FRONT CENTER CAP EMBLEM PEELING INSTALL SOP COSMETIC COVERS TO WHEEL LUGS LEFT FRONT WHEEL	Under Limit
2006	1FAFP34N56W	15-Aug-05	9-Sep-05	POWER FORD TORRAN	228352E	5K02	6S4Z	1K01 A	B65	33 E84	6-Jul-07	23	28585	4.35	19.18	23.53	0.2	5524	REPL MISSING CAP CORRODED REPLACED ALL 4 CENTER CAPS B65 42 1130 DIG IMAGING AUTH PAADR	C STATES ALL CENTER CAPS CORRODING BADLY	Under Limit
2005	4M2CU57115D	10-Feb-05	12-Mar-05	NICK MAYER LINCOLN-	15423809	5K02	5E6Z	1130 AA	B65	42 E84	12-Jul-07	29	28603	52.02	17.04	69.06	0.2	10705	29060 SQUEAKING FROM WHEEL COVERS WARRANT VERIFIED CONCERN PERFORMED TSB 06 9 5 RETEST DROVE VERIFIED REPAIR	CUST STATES THERE IS A CREACKING NOISE FROM THE LF WHILE DRIVING. TEST DROVE WITH TECH765	Under Limit
2005	1FAFP34NX5W	9-Sep-04	3-Mar-05	RICART FORD	246909A	5K02	*	1130 *	N50	42 E84	19-Jul-07	29	29056	0	62.34	62.34	0.8	2185	7653 8721	3.	Under Limit PE08-060 1421

2006 1FTSX21P86E	30-Jun-05	4-Aug-05	ROSEMURGY MOTORS	20906801	5K02	6C3Z	1700 A	H62	D1 E84	13-Jul-07	24	29148	4.41	31.82	36.23	0.4	6366	CHECKE D TIRE FOR LEAK FOUND VALVE STEM LEAKING AND BEAD LEAKING RESEAL D BEAD AND REPLACE D VALVE STEM WPI HAPPENS WITH THE ROTATIO N OF THE BEARING, WHEEL FOUND NOISY OPERATI HUBCAP NG OK S TSB WITH NO 06 9 5. NOISE. NOT DUE FOUND TO PREVIUO BEARING. S REPAIR TEST OK. DROVE RETEST VEHICLE, DROVE, COULD FOUND NOT SQUEAK CUST VERIFY NOISE AT STATES ROTATIO LOW NOISE IN NAL SPEEDS FRONT NOISE. MOST WHEEL HOISTED PROMINE AREA, VEHICLE NT ON STILL AND LEFT HAVING CHECKE FRONT. SAME D INSPECT PROBLE OPERATI ED LF M AS ON OF WHEEL, BEFORE, REPLACE FOUND SEE D TIRE HISTORY	Under Limit
2005 3FAFP31N15R	24-Feb-05	5-Apr-05	SOUND FORD INC	15810602	5K02	*	1130 *	N50	42 E84	11-Jun-07	27	29226	0	70.51	70.51	0.8	8511	D TIRE HISTORY	Under Limit

2006	1FAFP34N36W	26-Apr-06	31-Jul-06	JOE MACHENS FORD L	50718801	5K01	4S4Z	1007 AA	N25	2 E84	8-Jun-07	11	29361	58.79	77.28	136.07	0.9	8006	1 TEST DRIVE TO VERIFY VIBRATION LEFT FRONT WHEEL HAS EXCESSIVE RUN OUT REPLACE LEFT FRONT WHEEL AND REMOUNT TIRE AND BALANCE RETEST OK ...	STATES HAS STEERING SHIMMY 70 MPH..SEE BRENT H.	Under Limit
2005	1FMZU77K55U	2-Aug-04	20-Jul-05	COOK-WHITEHEAD FOI	012262D	5K01	*	1007 *	N25	D9 E84	18-Jul-07	25	29417	0	21.17	21.17	0.3	4910	28599 OUT OF ROUND NVH DIAG, FT TIRES FEATHERED, ROTATED AND BALANCED TIRES, NEEDS TIRES.	C S THAT AT 65 MPH THERE IS A VIBRATION COMING FROM THE VEHICLE. PLEASE ADVISE	Under Limit



2005	1FAFP34N55W	22-Nov-04	17-Feb-05	MAROONE FORD OF M.823304C	5K02	6S4Z	1130 A	N59	42 E84	6-Jul-07	29	30237	45.08	16.24	61.32	0.2	4820	30237 RUBBING NOISE FROM FRONT WHEELS AT SLOW SPEEDS W T1932 VERIFIED CONCER N PINPOINT ED TO FRONT HUBC APS R&R 2 FRONT HUBCAP S ROAD TEST CKS OK AT TH IS TIME.QUA LITY CK BY T1932 ROTATIO NAL CLICKING NOISE FROM VEH VERIFY REPLACE 2 CENTER CAPS	N59 CUSTOM ER STATES AN UNUSUAL RUBBING NOISE IS HEARD FROM THE DRIVER SIDE FRONT WHEEL AREA WHILE DRIVING SLOWLY, ALL TIMES.	Under Limit	
2005	1FTPW14525K	25-May-05	23-Jul-05	PURVIS FORD, INC.	080239B	5K02	5L3Z	1130 S	N59	7 E84	22-Aug-07	26	30308	44.02	16.31	60.33	0.2	61		C S THERE IS A ROTATIO NAL CLICKING NOISE COMING FROM VEHICLE.	Under Limit
2005	1FTRF14W85N	20-Aug-04	17-Sep-04	NEW HOLLAND FORD	43808103	5K02	4L3Z	1130 AB	B66	D4 E84	4-Jun-07	34	30456	17.58	7.51	25.09	0.1	1360			Under Limit

2006	1ZVFT85H765	17-Oct-05	4-Nov-05	COOK-WHITEHEAD FOI011779C	5K01	*	1007	*	N24	D9	E84	9-Jul-07	21	30569	0	56.45	56.45	0.8	4910	30569 .5 RD TST, SLIGHT VIB FELT AT 60, INSP TIRES CHECK BALANCE , OK, DID NOTICE REAR TIRES HAVE UNEVEN WEAR INSIDE EDGE, NO OTHER SIGNS OF SUSP STEER WEAR, ROAD AT THIS TIME. 50	CUSTOM ER STATES FRONT END HAS VIBRATIO N FROM ABOUT 55 MPH UP. CAN FEEL IT IN STEERIN G WHEEL, TIRE WERE ROTATED LAST VISIT, BUT DID NOT CORREC T ISSUE.	Under Limit	
2004	2MEFM74W14X	16-Jun-04	4-Sep-04	TASCA FORD	441127A	5K02	3W3Z	1130	CA	B65	33	E84	27-Jun-07	35	30663	44.69	17.4	62.09	0.2	796	30663 INSTALLE D RIGHT FRT AND RIGHT REAR HUB CAPS	RIGHT REAR AND RIGHT FRONT HUB CAP FELL OFF CENTER CAPS ON THE WHEELS DISCORO RED	Under Limit
2005	1FAHP28115G	16-Mar-05	30-Mar-05	DON SEELYE FORD, IN	75324901	5K02	5G1Z	1130	BA	B65	14	E84	23-Jul-07	29	30780	60.2	14.9	75.1	0.2	9708	REPLACE D ALL 4 CENTER CAPS	Under Limit	



2006	1FMPU16566	13-Jun-05	23-Sep-05	LILLISTON FORD, INC.	197465B	5K01	*	1007	*	N24	42 E84	17-Jul-07	23	30813	0	56.4	56.4	0.7	1254	ROADTEST CHECK FOR VIBRATION COCNER CHECED TIRES TIRES CHOPPED ROTATED AND BALANCED TIRES VERIFIED NOISE FROM FRONT WHEELS TEST DROVE WITH CUSTEMER INSPECTED FRONT BRAKES TEST DROVE WITH FRONT WHEEL COVERS REMOVE D NOISE GONE APLIED BLACK TAPE TO EDGE AND CLIPS ON FRONT WHEEL COVERS	CUSTOMER STATES THEY FEEL A VIBRATION IN STEERING AT 45MPH AND UP	Under Limit	
2005	1FAFP34NX5W	7-May-04	26-Mar-05	RICART FORD	241816A	5K02	6S4Z	1130	A	N50	14 E84	12-Jun-07	27	30819	45.08	46.76	91.84	0.6	2185	COVERS ON	GONE FOR A FEW MILES REPLACE FRONT WHEEL COVERS .TEST DROVE NORMAL OPERATI ON	CUSTOMER STATES THERES A CLICKING NOISE IN THE FRT END TURNING , CAN HEAR IT ON BOTH SIDES	Under Limit

2005	1FAHP28195G	5-Feb-05	15-Aug-05	POWER FORD TUSTIN	176155C	5K01	*	1007	*	N58	42	E84	27-Jul-07	24	30963	0	64.56	64.56	0.7	5414	30963 1007D .6, M TIME .5 HOOK UP NVH TEST EQUIPME NT TO PINPOINT NOISE. NOISE COMING FROM POWER STEERIN G. BLEED AIR IN SYSTEM. M TIME FOR BLEEDIN G AIR. REPLACE ALL 4 CENTER CAPS APPROV AL CODE PAA7N 31231 REPLACE TWO LUG NUT COVER	N58 DIAG STEERIN G NOISY CUSTOM ER STATES WHEN TURNING VEHICLE THERE IS AN BAD SOUND LIKE HEAVY CREAKIN G AND WHINING WHEN TURNING TO LEFT SEEMS OK TO RIGHT. 336 2923 N58	Under Limit
2005	1FAFP28125G	17-Dec-04	12-Apr-06	KINGS FORD INC	2281804	5K02	5G1Z	1130	BA	B66	D4	E84	22-Jun-07	15	31189	60.2	15.06	75.26	0.2	1970	31276 A D TSB 06 95 .0.8 .F .RF T .	CENTER CAPS ARE STARTIN G TO PIT	Under Limit
2006	1FAFP34N76W	26-Jul-05	20-Aug-05	TEXAN FORD	400068F	5K02	6S4Z	1K01	A	B66	33	E84	22-Aug-07	25	31231	8.71	0	8.71	0	2488	LUG NUT COVER	Under Limit	
2005	1FAFP34N75W	20-Aug-04	22-Sep-04	NEMER FORD	016852A	5K02	*	1130	*	N59	42	E84	23-Jun-07	34	31274	0	53.81	53.81	0.8	3608	REPORT ON NOISE RF WHEEL AREA. SEE EB NOTE	Under Limit	
2004	1FTPW14534KD	16-Jun-04	13-Dec-04	AUSTIN FORD-LINC-ME	88301	5K02	4L3Z	1130	DD	B66	34	E84	6-Jul-07	32	31447	40.75	14.03	54.78	0.2	9300	IINSTALL HUB CAP	LEFT FRT WHEEL CAP HAS PAINT BUBBLIN G PE08-0606428	Under Limit

2005 4M2YU57165D	15-Dec-04	3-Jan-05	MATHEWS FORD LINCOLN	239981B	5K02	5E6Z	1130 AA	B65	D8 E84	12-Jul-07	31	31500	52.02	15.06	67.08	0.2	2265	31500 REMOVE THE FOUR WHEELS AND REMOVE EACH CENTER CAPS AND REPLACE, REINSTALLED THE FOUR WHEELS APPROVAL	INSTALL SOP CENTER HUB CAPS FOR CORRODED FINISH LEFT REAR HUB CAP EMBLEM IS DISCOLORED	Under Limit
2005 1FAFP24135G	5-Oct-04	28-Oct-04	ATCHLEY FORD INC	36685805	5K02	5G1Z	1130 CA	B65	42 E84	12-Jun-07	32	31620	15.05	7.9	22.95	0.1	7130	REPLACE LEFT REAR HUBCAP	REAR HUB CAP EMBLEM IS DISCOLORED	Under Limit
2006 1FTSW21PX6E	5-Dec-05	31-Dec-05	COOK-WHITEHEAD FORD	011920A	5K01	*	1007 *	N25	D9 E84	11-Jul-07	19	31650	0	56.45	56.45	0.8	4910	31650 .9 1.5 ROADFO RS AND BAL TIRE. NO MORE VIBRATION	BAL TIRE HAS VIBRATION 45 MPH AND UP	Under Limit
2005 1FAFP28115G	17-May-05	28-Jul-05	ULRICH MOTOR CO.	11483106	5K02	5G1Z	1130 BA	B65	30 E84	16-Jun-07	23	31746	60.2	13.83	74.03	0.2	3457			Under Limit
2005 1FAFP34N25W	17-Mar-05	13-Apr-05	SUNRISE FORD OF NORTH	291677A	5K02	5S4Z	1130 AA	B65	42 E84	29-Aug-07	29	31757	22.54	9.1	31.64	0.1	5453	REPLACE HUB CAP	FRONT HUB CAP FLEW OFF	Under Limit
2005 1FMRE11L35HB	23-Feb-05	11-Mar-05	TINCHER FORD-MERCURY	6568802	5K02	4C2Z	1130 CA	B66	42 E84	22-Aug-07	30	31757	26.64	7.46	34.1	0.1	1651	1 R&R HUB CAP ASSY	HUB CAP CAME LOOSE FELL OFF	Under Limit
2005 1FAFP25125G	6-Jun-05	12-Oct-05	FAIRLANE FORD SALES	225014B	5K02	5G1Z	1130 BA	B65	D4 E84	26-Jul-07	22	31970	60.2	17.18	77.38	0.2	3050	31970 REPLACE ALL 4 CENTER WHEEL CAPS DUE TO PEELING	B01 ALL 4 CENTER CAPS PEELING	Under Limit

2005 1FDAF57P15EA	20-Nov-04	24-Feb-05	GARY YEOMANS FORD	58319301	5K01	5C3Z	1012 AA	B65	42 E84	14-Aug-07	31	31989	1.43	8	9.43	0.1	4790	1 REPLACE D ROUNDE D LUG NUT, TORQUE D TO SPEC.	SOP LUG NUT BAD RO 579592 ADDED PER CERTIFIC ATION FOUND CENTER CAPS CORROD ED PEELING AND BUBBLIN G	Under Limit	
2005 4M2YU57165D	15-Nov-04	24-Feb-05	WALLACE LINCOLN-ME	088726F	5K02	5E6Z	1130 AA	B65	42 E84	29-Jun-07	29	32004	52.02	7.8	59.82	0.1	10781	INSPECT ORDER AND REPLACE CENTER CAPS	(B65)CUS TOMER STATES THAT ALL FOUR WHEEL CENTER CAPS ARE PEE LING AROUND THE EDGES REPLACE MENT COMPLET ED	(B65)CUS TOMER STATES THAT ALL FOUR WHEEL CENTER CAPS ARE PEE LING AROUND THE EDGES	Under Limit
2006 4M2EU47E86U	6-Mar-06	31-Mar-06	REGENCY LINCOLN-ME	9136401	5K02	5E6Z	1130 AA	B65	70 E84	12-Jun-07	15	32045	52.02	17.17	69.19	0.2	11441			Under Limit	

2005	1FAFP34N35W	7-Jun-05	28-Jul-05	EVERGREEN FORD	32557203	5K02	*	1130	*	N50	42	E84	31-Jul-07	25	32398	0	70.59	70.59	0.8	8305	ROAD TESTED WITH CHASSIS EARS AND FOUND WHEEL COVER SQUEAKING ON WHEEL. CLEANED ALL WHEEL COVER INSIDE LIPS AND REINSTALLED. ROAD TESTED AND HEARD NO CHIRPS.	CUSTOMER STATES HEAR CLICK WHIR NOISE AT RIGHT FRONT WHEEL AS DRIVING AT ALL SPEEDS	Under Limit
2003	5LMFU27R03L	18-Jul-03	5-Sep-03	CERRITOS FORD	40823003	5K02	5L7Z	1130	BA	B65	81	E84	3-Aug-07	48	32680	31.42	9.27	40.69	0.1	5401	1 REPLACE DRIVER REAR HUB CAP, FADING APPROVED	CUSTOMER STATES THAT DRIVER REAR CENTER HUB CAP IS FADING. APPROVAL CODE# PAAGS	Under Limit
2005	1FAFP25125G	3-Dec-04	17-Feb-05	ULRICH MOTOR CO.	11610206	5K02	5G1Z	1130	BA	F06	P4	E84	24-Jul-07	30	32911	60.2	13.83	74.03	0.2	3457	VERIFY CONCERN. REPLACE BOTH FRONT WHEEL COVERS. PAINT PEELING. OKAY NOW.	CUSTOMER STATES THAT DRIVER REAR CENTER HUB CAP IS FADING. APPROVAL CODE# PAAGS	Under Limit
2006	1FAFP34N16W	14-Sep-05	30-Sep-05	JIM O'NEAL FORD, INC.	20139001	5K02	6S4Z	1130	B	B65	81	E84	17-Jul-07	22	33162	48.3	14.1	62.4	0.2	5786	PAINT PEELING ON RT WHEEL COVER	PAINT PEELING ON RT WHEEL COVER	Under Limit

2005 3FAFP31NX5R	27-Jan-05	22-Apr-05	KIMNACH FORD INC	5497701	5K02	*	1130	*	N50	42	E84	21-Jul-07	28	33379	0	67.91	67.91	0.8	6716	ROAD TEST VEHICLE, VERIFIED CONCERN WHILE DRIVING REMOVE WHEEL COVERS, CONCERN NO LONGER PRESENT . FOUND TSB 06 9 5 PERFORMED MED TSB, CLEANED WHEEL COVERS, APPLIED TAPE TO BACKS OF WHEEL COVERS. RETESTE 33389 B65 1130 05 FOUND THE FINISH WAS PEELING OFF 3 HUB CAPS, REPLACED 3 HUBCAPS FOR	D SQUEEK VEHICLE, FROM CONCERN WHEELS WHEN PRESENT DRIVING	Under Limit
2005 1FMZK02125G	27-Jan-05	17-Feb-05	LINDQUIST FORD, INC.	237068C	5K02	5F9Z	1130	AA	B65	5	E84	26-Jul-07	30	33382	52.29	14.11	66.4	0.2	20238	REPAIR	CHROME COMING OFF CHROME CENTER CAPS LEFT REAR OK	Under Limit

Year	Plate	Reg Date	Exp Date	Owner	Plate	Class	Subclass	Weight	Color	Reg Date	Days	Fee	Weight	Color	Reg Date	Days	Fee	Weight	Color	Notes	Remarks	Limit	
2004	1FTNW21P64E	3-Dec-03	23-Dec-04	MCMAHON FORD	12113001	5K02	4C3Z	1130	AA	B65	33	E84	12-Jun-07	31	33382	30.88	9.5	40.38	0.1	4166	1 REPLACE HUB CAP AND LEFT FRONT WHEEL VERIFIED REPLACE 4 CENTER HUB CAPS	OWNER STATES THE LEFT FRONT HUB CAP RATTLES NEEDS DIGITAL IMAGING FIRST CUSTOMER STATES WHEELS HAVE PITTED FINISH	Under Limit
2005	4M2YU57195D	5-Jan-05	1-Aug-05	HAMMONASSET FORD,	597303	5K02	5E6Z	1130	AA	B65	5	E84	25-Jul-07	25	33505	52.02	19.17	71.19	0.2	3617	0 ORDERED AND REPLACED 3 HUB CAPS, BOTH LEFT SIDE AND THE RIGHT FRONT. ***** *THANK YOU*****	THE LEFT SIDE HUB CAPS ARE DISCOLORED RING	Under Limit
2005	1FAHP28135G	3-Feb-05	12-Jul-05	MONACO AND SONS M	268858A	5K02	5G1Z	1130	BA	B65	81	E84	4-Jun-07	24	33603	45.15	15.52	60.67	0.2	8896	*****		Under Limit

2005	1FTPX145X5N	21-Jan-05	31-Mar-05	LILLISTON FORD, INC.	198616A	5K01	*	1007	*	N50	42	E84	14-Aug-07	29	33742	0	56.4	56.4	0.7	1254	TRACED AND DIAG. TEST DROVE TRUCK COULD NOT DUPLICATE CONCERN, INSTALLED CHASSIS EARS. STILL DID NOT DUPLICATE ON ROAD	CUSTOMER STATES WHEN MAKING A RIGHT TURN FROM A STOP THEY HEAR A WHINNING TYPE NOISE FROM REAR AREA,2 OUT OF 10 TIMES	Under Limit
2006	1FAFP56U76A	6-Feb-06	21-Feb-06	MIDLAND FORD LINCOLN	24111901	5K02	YF4Z	1130	BA	B65	81	E84	17-Aug-07	19	33754	48.13	15.02	63.15	0.2	9801	TEST 1130 CC81 REPLACE BOTH LEFT WHEEL COVERS	WHEEL CENTERS FADED NOISE LEFT FRONT TURNING LEFT AT ABOUT 25 MPH	Under Limit
2006	1FAFP23146G	12-Oct-05	11-Nov-05	JOE SARTAIN FORD, IN	24271602	5K01	*	1007	*	N50	82	E84	23-Jul-07	21	33757	0	41.59	41.59	0.6	5732	CK FOR NOISE NPF.	Under Limit	
2005	1ZVFT84NX552	26-Jul-05	2-Oct-05	TOWN AND COUNTRY I	2509855	5K02	4R3Z	1130	FA	B65	81	E84	6-Jun-07	21	33846	25.93	7.37	33.3	0.1	5755	CAP DISCOLORED WHEEL RING HUB CAP WHEEL COVER REPLACE ALL 4 CENTER CAPS	CHECK VEHICLE DRIVER FRONT SPINNER IS DISCOLORED CENTER CAPS ON WHEELS ARE ALL PEELING	Under Limit
2005	4M2YU57155D	16-Sep-04	26-May-05	BOB GILLINGHAM FORD	155867F	5K02	5E6Z	1130	AA	B65	5	E84	7-Jun-07	25	33889	52.02	15.8	67.82	0.2	2199	PEELING	Under Limit	



2006 4M2YU56Z66K	15-Dec-05	17-Mar-06	ALBUQUERQUE LINCOLN	11934305	5K01	6L8Z	1012 AA	L69	42 E84	22-Jun-07	16	34000	8.82	47.05	55.87	0.5	10140	DEFECTIVE RIGHT REAR WHEEL STUD AND NUT VERIFIED CONCERN PINPOINT TESTED AND REPLACED RIGHT REAR WHEEL STUD AND NUT	WHEEL STUD CAME APART	Under Limit
2006 1FTPW12516K	11-Nov-05	10-Jun-06	EDDIE YAKLIN FORD LI	133212A	5K01	2L1Z	1012 AA	B65	7 E84	23-Jul-07	14	34118	3.14	14.28	17.42	0.2	4161	34118 TOOK ALL NUTS OFF OF STUDS INSPECTED ALL FOUND NO DAMAGE REPLACED ONE MISSING NUT RETORQUED NUTS TO 147 FOOT LBS	CUSTOMER STATES ALL LUGNUTS ARE OVER TIGHTEN AND HAD TO CUT SOME OFF PLEASE INSPECT	Under Limit

2005 1FAFP38Z65W	26-Aug-04	18-Jun-05	SOUTHWAY FORD, INC 647546B	5K02 *	1130 *	T53	33 E84	25-Jun-07	25	34118	0	15.25	15.25	0.2	4522	34118 THREE CENTER CAPS CAME LOOSE FP 1130 CC 33 RE INSTALLE D THREE CENTER CAPS	T53 CUSTOM ER STATETS CENTER HUB CAPS KEEP COMING LOOSE	Under Limit
------------------	-----------	-----------	----------------------------	--------	--------	-----	--------	-----------	----	-------	---	-------	-------	-----	------	---	--	-------------

2005 1MEFM50U15A	9-Nov-04	24-Nov-04	DOUG STANLEY FORD 284362A	5K02 *	1130 *	N12	42 E84	26-Jul-07	33	34182	0	14.83	14.83	0.2	2635	34185 PERFOR M SHORT ROAS TEST TO VERFIY NOISE WAS ABLE TO PINPOINT NOISE COMING FROM RIGHT HUB CAP RESUCU RED HUB AND RETEST TO VERFIY REPAIR.	CUSTOM ER STATES THERES A SCRAPIN G NOISE WHILE DRIVING THE VEHICLE.	Under Limit
------------------	----------	-----------	---------------------------	--------	--------	-----	--------	-----------	----	-------	---	-------	-------	-----	------	--	--	-------------

2005 1FAFP53U45A	7-Dec-04	15-Dec-04	BERGSTROM NEENAH- 10271302	5K02 *	1130 *	N50	42 E84	2-Jul-07	31	34296	0	24.35	24.35	0.3	6226	ROAD TEST AND VERIFY CONCER N,REMOV E WHEEL COVER AND LUBE TABS REINSTA LL AND ROAD TEST	GUEST STATES CAN HEARA TICK NOISE AT LOW SPEEDS FROM PASSAN GER SIDE FRONT.	Under Limit PE08-060 1436
------------------	----------	-----------	----------------------------	--------	--------	-----	--------	----------	----	-------	---	-------	-------	-----	------	--	--	------------------------------

2006 1ZVHT80NX65	10-Aug-05	1-Sep-05	STAR FORD	70448801	5K02	4R3Z	1130	FA	B65	42	E84	23-Jul-07	24	34406	25.93	9.21	35.14	0.1	5537	REPLACE D CENTER CAP	PASS FRONT WHEEL CAP HAS BECOME UNSECU RED, PARTS PREV SOPD REFER TO RO# 703416	Under Limit
2005 1FAFP34N15W	28-Jun-05	23-Jul-05	RAY SKILLMAN PERFOI	2494351	5K01	*	1012	*	H44	41	E84	18-Aug-07	26	34499	30.5	38.85	69.35	0.5	4728	SEIZED LUGNUTS BOLT(S) FRONT HUB REPLACE LUGNUT COVER CAME UNATTAC HED, INSTALL RIGHT FRONT LUG NUT COVER PART ONLY	CK LUGNUTS ARE SEIZED ON VEHICLE WILL NOT COME OFF	Under Limit
2005 1FAFP36N65W	13-Aug-04	26-Apr-05	HONOLULU FORD, INC.	3637053	5K01	6S4Z	1012	BA	B65	33	E84	12-Jul-07	27	34578	4.82	0	4.82	0	7705		CUSTOM ER STATES PASS SIDE LUG NUT COVE CAME UNATTAC HED	Under Limit

2005 2FAFP71WX5X	17-Feb-05	25-Aug-05	FUTURE FORD OF CON	101660A	5K01	5W7Z	1007 AA	B65	61 E84	6-Aug-07	24	34734	68.21	35.86	104.07	0.3	4058	INSPECT ED AND VERIFIED RIM IS NOT HOLDING AIR REMOVE D TIRE FROM WHEEL FOUND RIM CRACKE D REPLACE D RIM,MOU NTED TIRE,AND BALANCE D WHEEL.	CUST STATES R REAR RIM LEAKS AIR	Under Limit
2005 1FAHP28125G	15-Sep-04	18-Nov-04	HELLER FORD SALES I	18011201	5K02	5G1Z	1130 BA	F06	5 E84	12-Jul-07	33	34825	64.5	15.17	79.67	0.2	20054	TECH 676 REMOVE D AND INSTALLE D 4 CENTER CAPS	SOME OF THE CENTER CAPS ARE LOSING THEIR FINISH WILL REQUIRE DIGITAL IMAGING ADVISE	Under Limit
2005 1FAFP34N35W	23-Jun-05	9-Jul-05	BRONDES FORD INC.	15909101	5K02	*	1130 *	N50	42 E84	16-Jul-07	25	34861	0	60.65	60.65	0.8	3010	TEST DRIVE REMOVE WHEEL COVERS, INSTALLE D FOAM TAPE PER TSB 6 9 5 REINSTA LLED COVERS REDRIVE OK	CHIRP NOISE FROM FROM FRONT PASSEN GER SIDE WHEEL AREA	Under Limit PE08-060 1438

2005 1FAFP25105G	15-Apr-05	30-Jul-05	RAY SKILLMAN PERFOI	2320051	5K02	5G1Z	1130 BA	B66	D4 E84	16-Jul-07	24	34942	64.5	15.54	80.04	0.2	4728	FLAW IN CENTER CAPS WHEEL RING HUB CAP WHEEL COVER REPLACE	CHECK ALL FOUR CENTER CAPS PITTED	Under Limit
2006 1FMFU19526L	31-May-06	15-Jul-06	COURTESY FORD	308530B	5K02	6L1Z	1130 BA	B65	14 E84	27-Jun-07	12	34988	31.35	7.72	39.07	0.1	1625	REPLACE RIGHT REAR CENTER CAP FOR PEELING. ORDERE DWHILE IN WARRANTY. INSTALLE D ON RO 310528, 7 27 0736866 MILES.	RIGHT REAR CENTER CAP PEELING CUSTOMER STATES THAT PAINT IS PEELING ON HUB CAPS	Under Limit
2007 1FAFP36NX7W	28-Nov-06	2-Jan-07	DEWEY FORD, INC.	43332601	5K02	6S4Z	1130 B	B65	D4 E84	10-Jul-07	7	35127	67.62	15.85	83.47	0.2	3540	1 HUBCAPS REPLACE D CENTER CAPS DUE TO OXIDATIO N	CK FOR CENTER CAPS OXIDIZIN G	Under Limit
2005 4M2YU57105D	23-Nov-04	12-Mar-05	WOODHOUSE LINCOLN	7972301	5K02	5E6Z	1130 AA	B65	D4 E84	10-Aug-07	30	35127	52.02	15.78	67.8	0.2	10670	35159 REPL EMBLEM ON RT FRT CENTER CAP CY FAIR UPHOLS TERY	QCP C S EMBLEM ON RIGHT FRONT CENTER CAP IS FALLING OFF	Under Limit
2005 1FTPX145X5NA	16-Sep-04	19-Aug-05	JOE MYERS FORD	561586C	5K02	5L3Z	1130 EA	B66	33 E84	7-Aug-07	24	35159	57.34	0	57.34	0	4402		PEELING	Under Limit

2005 1FAFP25165G	18-Jan-05	14-Sep-05	EWALD'S VENUS FOR	51696904	5K02	5G1Z	1130 BA	B65	D4 E84	3-Aug-07	23	35201	60.2	16.51	76.71	0.2	3774	PEELING REPLACE 4 CENTER CAPS APPROV AL CODE PAAUZ ED VEHICLE AND TEST DRIVE FOR NOISE AND CHECKE D STEERIN G AND SUSPENS ION OVER OK. VEHICLE NEEDS FURTHER REPAIRS AND CUSTOM ER DECLINE D WORK AT THIS TIME. VEHCILE NEEDS TIRE							C S THAT THE CENTER CAPS ARE PEALING	Under Limit
2005 1FMYU02ZX5K	14-Mar-05	20-Jul-05	GRIFFIN FORD LINCOLN	013901A	5K01	*	1007 *	N58	42 E84	21-Aug-07	26	35305	0	57.02	57.02	0.7	6360	ROTATIO D ALIGNME NT. CUSTOM ER ADVISED & DECLINE							C S THAT THERE IS NOISE FROM FRONT OF VEHICLE GROWLI NG TYPE NOISE HEARD ALL SPEEDS	Under Limit
2005 5LMEU88H25Z	15-Dec-04	30-Dec-04	MCCOTTER FORD - ME	208506A	5K02	2C5Z	1130 AA	B65	42 E84	21-Jun-07	31	35382	53.21	7.43	60.64	0.1	4944	REPLACE WHEEL COVER REPLACE D TWO LUG NUTS.							C S THAT CAP IS DISCOLO RING	Under Limit
2005 1FAFP36N65W	30-Aug-04	14-Jul-05	WILLIAMS MOTOR CO.,	291102	5K01	6S4Z	1012 BA	B65	1 E84	30-Jul-07	25	35613	9.63	16.82	26.45	0.2	2173								LUGNUT CAPS MISSING.	Under Limit

Year	Model	Start	End	Company	Year	Code	Color	Trim	Engine	Transmission	Drive	MPG	MSRP	Actual	Residual	Warranty	Notes	Condition	Limit		
2006	1FAFP251X6G	2-Nov-05	30-Nov-05	BRONDES FORD INC.	16051801	5K02	5G1Z	1130 BA	B65	81 E84	16-Aug-07	21	35784	60.2	15.16	75.36	0.2	3010	REPLACED 4 WHEEL COVERS	CUSTOMER STATES ALL FOUR HUB CAPS ARE PEELING, SOP	Under Limit
2005	1ZVFT82H655	11-Feb-05	19-May-05	KRUG HILLTOP FORD-L	1973801	5K01	6W7Z	1012 BA	B65	D4 E84	15-Aug-07	28	35802	4.31	8.32	12.63	0.1	1758	VERIFIED SILVER CAP CAME UNATTACHED FROM LUG NUT, REPLACED LUG NUT, RETESTS OK. 7921	SILVER CAP CAME UNBOUND FROM LUG NUT PORTION	Under Limit
2006	4M2YU57186K	17-Oct-05	1-Feb-06	ELMHURST LINCOLN-M	6481751	5K02	5E6Z	1130 AA	B65	D7 E84	24-Jul-07	18	35848	55.74	19.95	75.69	0.2	13660	REMOVE ALL 4WHEELS TO REPLACE CENTER CAPS	ALL 4 CENTER CAPS CORRODING	Under Limit

2005	1FAFP34N55W	28-May-04	8-Oct-04	LITHIA FORD LINCOLN	357232A	5K02 *	1130 *	B65	42 E84	16-Jul-07	34	35901	0	66.11	66.11	0.8	3897	FR	35908 5MM WHEEL COVERS NOISY 80 VERIFIED SQUEAK NOISE COMING FROM WHEELS, IT SQUEAK NOISE IS PRESENT WITH OR WITHOUT BRAKE APPLICA TION. RAISED VEHICLE AND INSPECT ED, NOTHING FOUND. BRAKES OK AT 10MM IN	ONT AND REAR DRUM. FOUND WHEN PRESSIN G ON WHEEL COVERS IT WOULD MAKE THE HEAR A RUBBING NOISE. REMOVE ALL FROM THE FRONT WHEELS, RIGHT SIDE HIGH PITCH WHEN WARMED UP OR TSB 06 09	Under Limit
2005	2MEFM74W25X	26-Jan-05	24-Feb-05	FIESTA LINCOLN MERC	11449704	5K02 5W3Z	1130 AA	B65	33 E84	15-Aug-07	31	35996	37.3	9.04	46.34	0.1	11896	REWPLA CED RF CENTER CAP	OUTSIDE FRONT RIGHT WHEEL CENTER CAP CAME OFF, SEND PARTS REQ TO MATT	Under Limit	
2004	5LMFU28R24L	10-Jun-04	12-Aug-04	NORTH SHORE L-M INC	181781A	5K02 *	1130 *	N51	33 E84	12-Jun-07	35	48875	0	16.79	16.79	0.2	10004	TIRE SHIELD LOOSE W/O 8/2/07	AT SLOW SPEEDS A RATTLE IS HEARD COMING FROM THE RIGHT SIDE	Under Limit	



2005	5LMFU28515L	14-Jan-05	30-Apr-05	DONLEY FORD-LINCOLN	50850401	5K02	5L7Z	1130 BA	B65	81 E84	17-Jul-07	27	49125	31.42	7.08	38.5	0.1	8287	C K AAND FOUND FINISH COMING OFF CENTER CAP REPLACE CAP	CUST STATES FINSH COMING OFF CENTER CAP LEFT FRONT	Under Limit
2004	5LMFU28R34L	7-Apr-04	21-Apr-04	LANDMARK LINCOLN M	4372001	5K02	5L7Z	1130 A	B65	39 E84	20-Jul-07	40	49876	25.86	8.74	34.6	0.1	11056	REPLACE D HUB CAP	RIGHT REAR HUB CAP FELL OFF	Under Limit
2003	5LMFU27R43L	31-Jul-03	2-Sep-03	AUTOWAY LINCOLN ME	319615A	5K02	5L7Z	1130 A	B65	33 E84	6-Jun-07	46	49930	25.86	8.35	34.21	0.1	11605	49930 39 1130 WARR REPLACE CENTER CAP LOOSE, CAME OFF AND LOST	B65 OWNER REPORT S L F CTR CAP CAME OFF AND LOST SERVICE PART	Under Limit
2007	1FAFP34N87W	28-Sep-06	30-Oct-06	BROADWAY FORD	16846106	5K02	6S4Z	1130 A	B65	25 E90	8-Jun-07	8	20942	22.54	8.42	30.96	0.1	3850	1 R&R 1 WHEEL CENTER CAP	WARRAN TY..WHE EL COVER	Under Limit
2007	1FAFP31N57W	16-Aug-06	9-May-07	GREENVILLE FORD LIN	1657551	5K02	6S4Z	1K01 A	L15	39 E93	11-Jun-07	2	4209	4.35	0	4.35	0	2484	LUG NUT FELL OFF MISSING RPL ONE LUG NUT MISSING LUG NUT COVERS ADDITION AL MISC. REPAIRS RPL MISSING LUG NUT	LUG NUT COVER KEEPS FALLING OFF	Under Limit
2007	1FAFP31N57W	16-Aug-06	9-May-07	GREENVILLE FORD LIN	1805351	5K02	6S4Z	1K01 A	B65	25 E93	16-Aug-07	4	6020	8.71	14.21	22.92	0.2	2484	COV ERS	CUSTOM ER STATES LUG NUT COVERS KEEP FALLING OFF OF WHEELS	Under Limit

MDL_YR	VIN_CD	PRODN_DT	WRTY_ART_DT	ST_NAME	DOC_NUM	WCC_M_CD	PART_NUM	PART_PA_CAU	CU_CAUS_N	CO_C	TX_C	ST_ND_C	N_C	RPR_DT	TI_W	S_MILGE	MTRL_COST	LBR_C_OST	TOT_G_HR	LBR_S	DLR_CD	TECH_TXT1	TECH_TXT2	CUST_TXT
2007	1FAHP34N57W2	16-Nov-06	28-Nov-06	WOODY AND	4967551	5K01	6S4Z	1012	BA	B65	30	1	7-Jun-07	7	9775	4.82	0	4.82	0	5892	WORN WHEEL NUT	REPLACED	CUSTOMER STATES WHEEL NUT TREAD HAS WORN AND WHEEL NUT WILL NOT TIGHTEN, ADVISE FOR WARRANTY. CUSTOMER STATES LUG NUT COVERS FELL OFF WHILE DRIVING LEFT REAR WHEEL	
2007	1FAHP36N47W	1-Nov-06	17-Nov-06	GRAND FORI	061758A	5K01	6S4Z	1012	BA	B65	42	1	20-Jul-07	9	7156	4.82	6.21	11.03	0.1	7417	TECH REPLACED CHROME LUG NUT		C S RT FRT WHEEL LUG NUT COVER FELL OFF	
2007	1FAHP34N87W	20-Mar-07	12-Apr-07	ELYRIA FORI	086964B	5K02	6S4Z	1K011	A	B65	33	1	12-Jul-07	4	2450	4.35	7.86	12.21	0.1	4163	REPLACE LUG NUT COVER		C,S THAT COVER CAME OFF CENTER CAP	
2007	1FAHP34N37W	6-Nov-06	22-Nov-06	ELYRIA FORI	086536A	5K02	6S4Z	1K011	A	B65	33	1	29-Jun-07	8	7520	4.35	7.86	12.21	0.1	4163	REPLACE CENTER CAP		CHECK PANEL UNDERNEATH STEERING COLUMN LOOSE.	
2007	3FAHP02107R	24-Nov-06	14-Dec-06	DAVIDSON M	095788D	5K01	*	1007	*	N58	63	1	13-Aug-07	9	4428	0	13.8	13.8	0.2	7509	CHECKED FOR NOISE UNABLE TO DUPLICATE AT THIS TIME		MISSING LUG NUT LEFT REAR WHEEL	
2007	1FAHP31N67W	30-May-07	30-Jun-07	LANDMARK F	673248A	5K02	6S4Z	1K011	A	B66	33	1	13-Aug-07	2	1540	4.35	9.64	13.99	0.1	8559	1540 WARR FOUND LUG NUT COVER MISSING. INSTALLED LUG NUT COVER.		CUSTOMER STATES THAT L R LUG NUT COVER COMES OFF. CHK & VERIFIED CUST CONCERN. L R LUG NUT LOOSE. INSTALL NEW LUG NUT COVER VERIFIED ALL REPAIRS PERFORMED QUALITY	
2007	1FAFP34N27W	26-Jul-06	22-Nov-06	CUTTER FOF	405805A	5K02	6S4Z	1K011	A	B65	33	1	20-Jul-07	9	5355	4.35	9.99	14.34	0.1	7908	CHECK		NUMBER FOR REPAIRS	
2007	1FMFU18597L	15-Sep-06	24-Nov-06	CHAPMAN FC	15627501	5K02	*	1130	*	B65	33	1	14-Aug-07	9	9651	0	14.91	14.91	0.2	3955	VERIFIED NOISE IN RIGHT FRONT COMING FROM RIGHT FRONT WHEEL COVER REMOVE WHEEL TIGHTEN WHEEL COVER REINSTALL WHEEL TEST		THERE IS RUBBING NOISE WHILE DRIVING & ON RIGHT HAND TURNS COMING FROM FRONT OF VEHICLE ROTATIONAL NOISE SLOW YOU GO	
2007	1FAFP31N97W	14-May-07	31-Jul-07	PARR FORD,	18647801	5K02	6S4Z	1K011	A	B65	33	1	8-Aug-07	1	129	8.71	8.53	17.24	0.1	8606	VERIFIED, ORDERED PARTS. GAVE PARTS TO CUSTOMER TO INSTALL		SLOWER THE NOISE TO RIGHT REAR LUG COVERS POPPED OFF	
2006	1FTZR45E76P	9-Jan-06	18-Apr-07	GRAND FORI	062455A	5K02	5L2Z	1130	BA	B65	42	1	27-Aug-07	5	7226	11.09	6.21	17.3	0.1	7417	TECH VERIFIED AND ORDERED AND REPLACED CAP		FORD EMBLEM CAME OFF RIGHT FRONT HUB CAP	
2007	1FTPW12V77K	27-Feb-07	8-Jun-07	CHAMPION F	526520C	5K02	5F9Z	1700	AB	B65	1	1	1-Aug-07	2	4247	1.64	15.75	17.39	0.2	4617	4247 INSPECTED TIRES FOR LEAK FOUND VALVE STEM CORE TO BE LEAKING BROKE DOWN TIRE REPLACED VALVE STEM CORE REMOUNTED & BALANCED TIRE RETESTED, NO LEAKS FOUND		C S THAT FRONT DRIVERSIDE TIRE HAS SLOW LEAK	

2007 2FMDK48C77E	15-May-07	28-May-07	OASIS FORD	1495151 5K02 *	1130 *	N59	42	1	31-Jul-07	3	2011	0	19.29	19.29	0.2	3604	CLICKING NOISE ADDITIONAL MISC. REPAIRS	CUST ST FRONT WHEEL WELLS MAKES NOISE W TURNS & SOMETIMES GOING STRAIGHT
2007 1FTZR45E47P	8-May-06	19-Feb-07	FINISH LINE I	21420304 5K02 5L2Z	1130 BA	B65 D4	1	1	8-Aug-07	6	6644	11.88	7.62	19.5	0.1	20192	NEEDS NEW ONE 1 3284 CHECK FOR ONE LUG NUT HAS NO COVER INSTALL NEW LUG NUT ON RIGHT FRONT	CUSTOMER STATES THAT WHEEL COVER IS LOOSE DAMAGED CHECK FOR ONE OF THE LUG NUTS HAS NO COVER CAP CHECK RF WHEEL, HAS LUG NUT MISSING.
2007 1FAFP34N97W	27-Mar-07	10-May-07	BEECHMONT	360301D 5K01 6S4Z	1012 BA	B65 33	1	1	9-Jul-07	3	3279	4.82	14.93	19.75	0.2	2058	LUG NUT MISSING, REPLACE.	CUSTOMER STATES THAT THERE IS A RATTLING TYPE OF NOISE WHEN DRIVING OR OVER BUMPS FROM RIGHT SIDE OF VEHICLE.
2007 1FAHP34N67W	11-Sep-06	28-Nov-06	DONLEY FOF	11104702 5K01 6S4Z	1012 BA	B65 33	1	1	6-Jun-07	7	8442	4.82	15.06	19.88	0.2	2263	LUG NUT MISSING, REPLACE.	CUSTOMER STATES THAT THERE IS A RATTLING TYPE OF NOISE WHEN DRIVING OR OVER BUMPS FROM RIGHT SIDE OF VEHICLE.
2006 2MEFM74VX6	4-May-06	11-Nov-06	ELMHURST L	6410951 5K02 *	1130 *	N50	33	1	28-Jun-07	8	7418	0	19.95	19.95	0.2	13660	99A VERIFY CONCERN,LUBE AND TIGHTEN ALL WHEEL CAPS AS NEEDED.RETEST OK ROAD TEST CHECKED FOR NOISE UNABLE TO DUPLCIATE AT THIS TIME	W BUG SHIELD LOOSE CUSTOMER STATES RIGHT REAR TIRE LEAKING AT VALVE STEM
2007 1FMDK02167G	28-Jun-06	20-Nov-06	DAVIDSON M	094672D 5K01 *	1007 *	N58	63	1	13-Jul-07	8	9615	0	20.7	20.7	0.3	7509	VERIFY CONCERN REMOVED WHEEL REMOVED TIRE R&R VALVE STEM BALANCE TIRE AND REINSTALL RE CHECK OK	CUSTOMER STATES RIGHT REAR TIRE LEAKING AT VALVE STEM
2007 3FAHP06ZX7F	2-Jun-07	9-Jul-07	JONES FORC	7156701 5K02 F42Z	1700 A	B65 42	1	1	20-Jun-07	0	3	1.68	19.76	21.44	0.3	6721	REINSTALL RE CHECK OK	CUSTOMER STATES THE CENTER CAP FELL OFF WHEEL CENTER CHROME PEELING CUSTOEMR STATES CENTER CAP ON RIGHT REAR HAS COME OFF WHILE DRIVING
2007 2FMDK49C97B	8-May-07	9-Jun-07	PARK FORD	25315601 5K02 6L2Z	1130 AA	B65 33	1	1	10-Jul-07	2	5	5.75	15.7	21.45	0.2	3853	INSTALLED CENTER CAP ON LEFT FRONT WHEEL	CUSTOMER STATES THE LEFT FRONT HUBCAP IS FLAKING. SUBMIT TO DIGITAL IMAGE AND ADVISE.B65
2006 1FAHP28106G	13-Jan-06	23-Feb-07	B & B FORD	7689701 5K02 5G1Z	1130 BA	B65 5	1	1	3-Jul-07	5	5931	15.05	6.93	21.98	0.1	6329	REPLACE WHEEL CENTER CAP	CUSTOMER STATES: THE LEFT FRONT HUBCAP IS FLAKING. SUBMIT TO DIGITAL IMAGE AND ADVISE.B65
2007 2MEFM74V77X	11-Dec-06	16-Jun-07	CARL GREGG	9415501 5K02 3W3Z	1130 CA	B65 33	1	1	6-Jul-07	1	742	22.34	0	22.34	0	2684	INSTALLED CENTER CAP	CUSTOMER STATES: THE LEFT FRONT HUBCAP IS FLAKING. SUBMIT TO DIGITAL IMAGE AND ADVISE.B65
2007 1FAHP24187G	3-Oct-06	9-Apr-07	HUB CITY FC	11277301 5K02 5G1Z	1130 CA	B66 82	1	1	26-Jul-07	4	5328	15.05	7.3	22.35	0.1	6481	FELL OFF CC82 REINSTALL CAP	CUSTOMER STATES: THE LEFT FRONT HUBCAP IS FLAKING. SUBMIT TO DIGITAL IMAGE AND ADVISE.B65
2007 1FAHP37N07W	21-Sep-06	16-Oct-06	SUNSET AUT	3666104 5K02 6S4Z	1130 B	B65 42	1	1	11-Jul-07	9	10278	22.54	0	22.54	0	8198	REPLACED HUBCAP WHILE PERFORMING PDI WENT TO INSTALL HUBCAPS AND FOUND 1 DAMAGED INSIDE OF WRAP ORDERED AND REPLACED TO CORRECT CONCERN.	HUBCAP BROKEN UPPON ARIVAL REPLACED RF CENTER CAP FELL OFF. COULD NOT FIND.
2007 1FAHP34N77W	30-Jul-07		BERGLUND F	350767E 5K02 6S4Z	1130 B	B65 1	1	1	9-Aug-07	-1	2	22.54	0	22.54	0	6717	REPLACED CENTER CAP ON RF WHEEL.	HUBCAP BROKEN UPPON ARIVAL REPLACED RF CENTER CAP FELL OFF. COULD NOT FIND.
2007 1FAHP24197G	12-Oct-06	30-Apr-07	DONLEY FOF	11148301 5K02 5G1Z	1130 CA	B65 33	1	1	28-Jun-07	2	350	15.05	7.53	22.58	0.1	2263	REPLACED CENTER CAP ON RF WHEEL.	HUBCAP BROKEN UPPON ARIVAL REPLACED RF CENTER CAP FELL OFF. COULD NOT FIND.

2007	1FAHP34N17W	5	19-Feb-07	9-May-07	DONLEY FOF	50839101	5K02	6S4Z	1K011	A	B65	33	1	11-Jul-07	3	3476	8.71	14.17	22.88	0.2	8287	LUG NUT COVERS FELL OFF LEFT FRONT REPLACE 2 LUG NUT COVERS	REPLACE LUG NUT COVERS		
2007	1FAFP34N57W		2-Apr-07	22-May-07	FAMILY FORI	21872601	5K02	6S4Z	1K011	A	B02	1	1	7-Jul-07	2	5930	8.71	14.71	23.42	0.2	3372	INSTALL 2 LEFT REAR LUG NUT COVERS	INSTALL SOP 2 LUG NUT COVERS		
2007	1FMEU64E67UB		6-Jun-07	22-Aug-07	MIKE SHAD F	370658A	5K02	*			1700	*	A40	D8	1	19-Jun-07	0	5	0.49	24.26	24.75	0.3	4867	REPLACE LEFT FRONT WHEEL VALVE STEM LEAKING	REPLACE LEFT FRONT WHEEL VALVE STEM LEAKING
2007	1FAFP28187G		16-Aug-06	20-Jun-07	BUSS FORD	1346291	5K02	5G1Z	1130	BA	B65	81	1	3-Jul-07	1	60	16.13	8.89	25.02	0.1	1857	REPLACE DRIVERS SIDE FRONT CENTER CAP	REPLACE DRIVERS SIDE FRONT CENTER CAP		
2007	1FMFK19597L		24-May-07	14-Jul-07	BLUEBONNE	47496202	5K01	*			1015	*	A85	42	1	16-Jul-07	1	185	0	25.16	25.16	0.3	4570	REPL VALVE STEM IN L R OUTSIDE WHEEL	REPL VALVE STEM IN L R OUTSIDE WHEEL
2008	1FDAW57R58E		23-Feb-07	9-Apr-07	COMMERCIA	056090C	5K02	2C3Z	1700	CA	N50	D4	1	25-Jul-07	4	6494	25.19	0	25.19	0	4405	R R R REAR TIRE TO SECURE VALVE STEM.	R R R REAR TIRE TO SECURE VALVE STEM.		
2007	3FRML55Z87V		16-Nov-06		KIMNACH FO	5277201	5K02	*			1700	*	H62	7	1	19-Jun-07	-1	820	0	25.47	25.47	0.3	6716	INSPECTED FOUND BAD THREADS ON TWO LUG NUTS REPLACED TWO LUG NUTS CHECK ALL OTHERS OK	INSPECTED FOUND BAD THREADS ON TWO LUG NUTS REPLACED TWO LUG NUTS CHECK ALL OTHERS OK
2007	1FAHP31N57W		14-Dec-06	17-Apr-07	SAWGRASS	64815701	5K01	6S4Z	1012	BA	B65	42	1	13-Jun-07	2	5261	9.63	16.26	25.89	0.2	4908	REPALCED HUP CAP THAT FELL OFFNO CHARGE LABOR	REPALCED HUP CAP THAT FELL OFFNO CHARGE LABOR		
2008	1FTSW20Y88E		28-Mar-07	12-Apr-07	CITRUS FORI	61156701	5K02	7C3Z	1130	A	B65	33	1	12-Jun-07	3	3547	26.03	0	26.03	0	5513	11 REPLACED LEFT FRONT CENTER CAP	11 REPLACED LEFT FRONT CENTER CAP		
2008	1FAHP24W88G		7-Jun-07	25-Aug-07	CRESTMONT	153742A	5K02	8G1Z	1130	D	B65	33	1	15-Jun-07	0	11	18.37	8.05	26.42	0.1	4369	TIRE PRESSURE LIGHT ON, RESET TIRE PRESSURES, WAKE AND RESET ALL 4 SENSORS	TIRE PRESSURE LIGHT ON, RESET TIRE PRESSURES, WAKE AND RESET ALL 4 SENSORS		
2008	1FTNE24L88D		7-Aug-07	5-Sep-07	MILLER FORI	1031442	5K01	*			1007	*	G29	42	1	31-Aug-07	0	5	0	26.73	26.73	0.3	1336	9833 REMOVED AND INSTALLED 4 WHEEL NUTS.THE COVERS ON THEM CAME OFF.	9833 REMOVED AND INSTALLED 4 WHEEL NUTS.THE COVERS ON THEM CAME OFF.
2007	1FAFP34N87W		16-Oct-06	12-Feb-07	GRAND LEDC	066152C	5K01	6S4Z	1012	BA	B65	33	1	24-Jul-07	6	9833	19.26	7.66	26.92	0.1	9099	6015 REPLACE 2 LUG NUTS ON LEFT FRT WHEEL	6015 REPLACE 2 LUG NUTS ON LEFT FRT WHEEL		
2007	1FAHP34N37W	2	13-Dec-06	2-Jan-07	JOHN LANCE	143798B	5K01	6S4Z	1012	BA	B65	7	1	18-Jun-07	6	6015	9.63	17.32	26.95	0.2	2284	REPLACE MISSING CAPS	REPLACE MISSING CAPS		
2007	1FAHP34N37W	0	12-Mar-07	30-Apr-07	JACK BYRNE	353934B	5K02	6S4Z	1K011	A	B65	33	1	23-Jul-07	3	3135	13.06	14.88	27.94	0.2	20700				
2007	3MEHM07Z77R		19-Jun-07		NORTH SHOI	182496B	5K02	7N7Z	1130	A	B02	33	1	12-Jul-07	-1	10	28.48	0	28.48	0	10004	REPLACE HUB CAP	REPLACE HUB CAP		
2007	1FMDK02147G		28-Jun-06	6-Apr-07	BERGSTROM	10166303	5K01	6L2Z	1012	BA	B65	5	1	7-Jun-07	3	2704	12.94	16.23	29.17	0.2	6226	REPLACED 3 RUSTED LUG NUTS 3127 CHECK AT SET TIRES PSI TO 35 RESET TIRES WITH OTC TOOL CLEAR LIGHT TEST DROVE A40 36 WARR	REPLACED 3 RUSTED LUG NUTS 3127 CHECK AT SET TIRES PSI TO 35 RESET TIRES WITH OTC TOOL CLEAR LIGHT TEST DROVE A40 36 WARR		
2007	1ZVFT82HX75		18-Aug-06	19-Mar-07	CASA FORD	670815B	5K01	*			1007	*	A40	42	1	22-Jun-07	4	3127	0	29.8	29.8	0.4	20455	1060 VERIFIED L.R HUB CAP HAS PEELING CROME REPLACED HUB CAP REPAIRED	1060 VERIFIED L.R HUB CAP HAS PEELING CROME REPLACED HUB CAP REPAIRED
2007	2MEFM74V67X6		22-Mar-07	18-Jul-07	BAY LINCOLN	220454A	5K02	5W3Z	1130	DA	B65	P3	1	24-Jul-07	1	1060	23.06	6.91	29.97	0.1	10248				

2007 1FAHP34N27W	13-Feb-07	1-Mar-07	DEMPEWOLF	1525351	5K01	6S4Z	1012 BA	B65	7	1	26-Jul-07	5	11645	14.45	16.37	30.82	0.2	5668	INSTALLED TWO LUG NUTS WPI	C S RR LUG NUT CAPS KEEP LOOSING OFF
2007 1FAFP34N17W	29-Jun-07		JOE MACHEI	51273702	5K02	6S4Z	1130 A	B65	25	1	27-Jul-07	-1	10	22.54	8.59	31.13	0.1	8006	1 REPLACE RIGHT FRONT HUIB CAP THAT WAS MISSING RING ...	CUSTOMER STATES PASS. FRONT HUB CAP WILL NOT STAY RIGHT FRONT WHEEL CLOVER HAS LOST THE PLASTIC CAP THAT COVER S THE LUG NUT.FULL COVER , 6 SPOKE
2007 1FAFP31N57W	10-Nov-06	30-Jan-07	RUSTY ECKI	32603701	5K02	6S4Z	1130 B	B65	33	1	26-Jul-07	6	6985	22.54	8.77	31.31	0.1	5319	INSTALL LUG NUT CAP FOR WHEEL COVER ON RIGHT FRONT WHEEL	CUST STATES ONE REAR HUBCAP FLEW OFF DRIVING FRONT RIGHT WHEEL CENTER CAP CAME OFF, NO PART TO RETURN
2007 1FAFP34N47W	5-Mar-07	1-May-07	SOUND FORI	16094003	5K02	6S4Z	1130 A	B65	33	1	31-Jul-07	4	2032	22.54	8.81	31.35	0.1	8511	HUB CAP FELL OFF TORQUED RIM TO SPECS & INSTALLED NEW HUB CAP, CHECK OPPERATION IS NORMAL AT THIS TIME.	
2007 2MEFM74VX7X	22-Mar-07	3-May-07	FIESTA LINC	11292902	5K02	3W3Z	1130 CA	B65	33	1	26-Jun-07	2	5892	22.34	9.04	31.38	0.1	11896	TECH VERIFIED CENTER CAP CAME OFF, INSTALLED NEW CENTER CAP ON RIGHT SIDE WHEEL	
2007 1FAFP34N97W	16-Feb-07	1-May-07	HERB CHAMI	7889902	5K02	6S4Z	1130 B	B65	33	1	24-Jul-07	3	3067	22.54	9.38	31.92	0.1	8828	NUT MISSING ON HUBCAP HAD TO REMOVE WHEEL TO REMOVE CAP REPLACE W NEW OK	PASS FRONT VALVE STEM CAP MISSING R FRONT WHEEL COVER FALLS OFF B65 CUST SAYS L F HUB CAP IS LOOSE AND RATTLES, WONT TIGHTEN, VERIFIED IN SERVICE ISLE CENTER TRIM ON RIGHT REAR WHEEL FELL OFF
2007 3FAHP07Z27F	26-Aug-06	13-May-07	PASADENA F	3076952	5K02	6E5Z	1130 AA	B65	7	1	13-Aug-07	4	3548	23.81	8.82	32.63	0.1	4223	WHEEL RING HUB CAP WHEEL COVER REPLACE	
2007 2MEFM74V37X	13-Dec-06	21-May-07	PAUL CERAM	292961A	5K02	5W3Z	1130 DA	B65	42	1	30-Jul-07	3	766	23.06	10.25	33.31	0.1	12825	REPLACED DRIVERS FRONT WHEEL COVER ASSY IS LOOSE AND WOBBLES AFTER ATTACHING NUTS ARE TIGHTENED.	
2006 1ZVHT80N565	17-May-06	19-Jun-06	EWALD'S VEI	51524201	5K02	4R3Z	1130 FA	B65	33	1	19-Jun-07	13	9679	25.93	8.25	34.18	0.1	3774	LOOSE REPLACE CENTER CAP	RT FRONT CENTER CAP IS MISSING FOUND AT DELIVERY DROP OFF CAN NOT REOVE ONE LUG NUT TOWED IN LUG NUT WILL NOT COME OFF
2007 5LTPW18527F	30-May-07	20-Jul-07	ALBUQUERQ	11900305	5K02	7L7Z	1130 B	L69	42	1	15-Jun-07	0	62	24.77	9.41	34.18	0.1	10140	MISSING AT RT FRONT WHEEL ORDERED AND REPLACED MISSING CENTER CAP	
2007 1FAHP34N97W	24-May-06	5-Jul-06	DEWEY FORI	43009401	5K01	6S4Z	1012 BA	B65	69	1	4-Jun-07	12	10443	4.82	31.7	36.52	0.4	3540	1 REPLACE ONE LUG NUT ON LEFT REAR	
2007 2MEFM74V47X6	2-Mar-07	30-Apr-07	MONTGOMEI	3692903	5K02	*	1130 *	N50	33	1	11-Jul-07	3	7507	0	37.51	37.51	0.5	6309	CP:1130 ROAD TEST, CK STEERING AND SUSPENSION TIGHTEN HUB CAPS ROAD	SUSPENSION/BRAKE S C/S THAT THERE IS A CLICKING NOISE FROM THE RIGHT FRONT WHEEL WHEN GOING 30 40 MPH. MIS BUILT UNIT. WRONG LUG NUTS ON RIGHT FRONT WHEEL.
2007 2FMDK46C37B	13-Apr-07	16-Jul-07	ISLAND FORI	276698A	5K01	6L2Z	1012 BA	B62	38	1	16-Jul-07	0	10	17.25	21.84	39.09	0.2	3650	REPLACED ALL LUG NUTS	

2007	1FMFK20537L	24-Oct-06	20-Jan-07	ATCHLEY FO	36762003	5K01 *	1007 *	B65	12	1	22-Jun-07	6	9059	0	39.5	39.5	0.5	7130	1 ROAD TEST, CHECK FOR NOISE, REMOVE LEFT FRONT TIRE, NOISE IN TIRE, DISMOUNT TIRE, FOUND FORIEGN DEBRIS INSIDE OF TIRE REMOVE AND SAVE DEBRIS, ROAD TEST, OK	CUSTOMER SAID HAS A RATTLE NOISE CK FOR A FRONT END SHIMMY WHEN DRIVING
2007	1FAHP37N57W	29-May-07		GRIFFIN FOF	012173A	5K01 *	1007 *	N24	33	1	16-Jul-07	-1	15	0	40.73	40.73	0.5	6360	INSPECTED AND REBALANCED FRONT TIRES. RETESTED ALLOK 6162 TIRES OUT OF BALANCE RAISED VEHICLE AND REMOVED WHEELS, CHECKED WHEEL BALANCE ON ALL FOUR WHEELS. LR OUT OF BALANCE BY 1.25 OZ, LF 1.75 OZ, RF 1.5 OZ, RR OK. REBALANCED WHEELS AS NEEDED, TEST D	ROVE VEHICLE IN HIGHWAY WITH SPEEDS RANGING 55 75 MPH, NO VIBRATIONS FELT. CUSTOMER STATES VIBRATION CAN BE FELT IN VEHICLE AT HIGHER FWY SPEEDS
2007	1FTPW14V37K	14-Feb-07	14-May-07	LITHIA FORD	361533A	5K01 *	1015 *	N25	42	1	23-Aug-07	4	6152	0	41.32	41.32	0.5	3897	110 SENSORS UNTRAINED TPMS DIAG,PINPOINT TEST,MONITOR PIDS,ONE OF THE SENSORS NOT READING PROPERLY,RE TRAIN SENSORS,ROAD TEST OK LIGHT OFF BEFORE	DOD834)LR(BC9 126)RF(DOD827) C S TIRE LIGHT ON AFTER IT WAS IN HERE YESTERDAY B65 LEFT FRT CENTER CAP ON WHEEL LOOSE AND RA
2007	1FTPW14547F	13-Feb-07	4-Jun-07	MAXWELL FC	789278A	5K01 *	1007 *	G29	42	1	9-Jun-07	1	104	0	41.75	41.75	0.5	2923	LF(OD5801)LR(OD5841)RF(OD597B) RR(OB8C05) AFTER LF(	RR(BEAA95) T1340
2006	3LNHM26116R6	20-May-06	20-Jul-06	MORROW FC	2270105	5K02 4W1Z	1130 BA	B65	33	1	28-Jun-07	12	8472	35.91	6.77	42.68	0.1	7327	TTLES FOUND CENTER CAP LOOSE REPLACE CENTER CAP	
2007	3FAHP06Z87F	1-Sep-06	3-Oct-06	FORD OF CLI	1152651	5K02 *	1130 *	N59	33	1	9-Aug-07	11	9546	0	15.37	43.37	0.2	8951	CUSTOMER STATES CLICKINK NOISE FROM DRIVER FRONT WHEN DRIVING ROADTEST VEHICLE FOR NVR. VERIFIED CUSTOMER CONCER 4625 LOOSE SPARE TIRE CC33 17081 TEST DROVE VEH TO VERFIY CONCERN TRACED CONCERN TO LOOSE SPARE TIRE THIGHEN LOOSE SPARE TIRE RE TEST DROVE WITH SERVICE ADVISOR OK AT THIS TIME REPLACED HUBCAP ON RIGHT REAR WHEEL	N, PLACED VEHICLE ON 4 POST LIFT AND VERIFIED NOISE COMING FROM FRONT WHEELS. FOUND LOOSE HUB CAP, REMOVED HUB CAPS AND FOUND NOISE NOT PRESENT ANYMORE. REINSTALLED HUB CAPS AND REROADTEST, FOUND SYST CUSTOMER STATES CLICKINK NOISE FROM DRIVER FRONT EHEN DRIVING
2007	1FMEU64E17U	30-Aug-06	27-Mar-07	PAYTON-WR	487416B	5K02 *	1708	1 N59	33	1	25-Jun-07	4	4625	0	16.2	44.2	0.2	2413		
2008	1FTWX31R78	15-Mar-07		TRI FORD-ME	323668B	5K02 7C3Z	1130 AA	B65	7	1	8-Aug-07	-1	7	27.89	17.45	45.34	0.2	8294		N59 RATTLE FROM REAR OF VEH RT SIDE ON BUMPS CANNOT TELL IF ITS INSIDE OR OUTSIDE HUBCAP FLEW OFF WHEN DRIVING

2007 1FAHP31N07W	21-Dec-06	9-Aug-07	KOONS COLI	1603851	5K02 *	1700 *	B65	D1	1	18-Jul-07	0	5	0	45.35	45.35	0.5	10	VALVE STEM IS LEAKING TIRE REINDEX TEST DROVE DID NOT PULL CHECKED ALIGN AND SET FRONT TOE TO LEVEL STEERING WHEEL	FLAT TIRE
2007 1FMFU15577L	22-Mar-07	28-May-07	THORNHILL F	083501A	5K01 *	1007 *	B43	42	1	9-Jun-07	1	1095	0	45.55	45.55	0.6	6844	FLAW IN MATERIAL COATING OVER THE WHEEL COVER REPLACE WHEEL COVERS 1 TEST DROVE VIBRATION NONE THERE TEST DROVE VECH FOR 5 MILES FROM 15 TO 65 MPH DID NOT FEEL ANY ABNORMAL VIBRATION NOISE WAS COMING FROM A CAN IN BED OF TRUCK TEST DROVE VECH WITH CHASSIC EARS CHECKED ROAD TEST UNABLE TO DUPLICATE AT THIS TIEM	TRK PULLS TO THE RIGHT HARD CUSTOMER STATES RIGHT FRONT AND RIGHT REAR CENTER CAPS ARE P EELING
2007 1FAHP28197G	18-Aug-06	29-May-07	DEWEY FORI	43102102	5K02 5G1Z	1130 BA	F41	34	1	14-Jun-07	1	914	30.1	15.85	45.95	0.2	3540	VERIFIED CONCERN INSTALLED CENTER CAPS IN DRIVEWAY 10967 8055 PASS. FRONT CENTER CAP CHROME PEELING OFF. WARR. INSPECTED PASS. FRONT CENTER CAP. FOUND CHROME PAINT PEELING OFF. NEC. TO REMOVE OLD CHROME CAP AND INSTALL NEW ONE. INSTALLED. OK AT THI	CUST STATES VIBRATION AT VARIOUS SPEEDS CHECK STEERING COMING APART. C S PASS FT AND RR WHEEL CENTER CAPS ARE PEELING
2007 1FTPX12V57K	15-Nov-06	14-Jul-07	CARL GREGC	9432201	5K01 *	1007 *	N25	42	1	12-Jul-07	0	46	0	46.58	46.58	0.7	2684		CUST STATES THE PASS SIDE FRT CENTER CAP CHROME IS PEELING INSTALL SOP CUST STATES RF HUB CAP CHROME PEALING
2007 3LNHM26TX7R6	30-Nov-06	2-Apr-07	DAVIDSON M	093981C	5K01 *	1007 *	N58	33	1	25-Jun-07	3	4659	0	48.29	48.29	0.7	7509		
2007 1FTPW12V87F	1-Jun-07	18-Jul-07	TAMIAMI FOF	24319401	5K02 6L3Z	1130 D	B65	D4	1	1-Aug-07	1	125	50.43	0	50.43	0	1286		
2008 1FTXW43RX8E	7-Feb-07	18-Mar-07	RICART FORI	244183G	5K02 5C3Z	1130 NA	B65	14	1	28-Jun-07	4	10960	42.8	7.79	50.59	0.1	2185		S TIME. 8055
2008 1FTXW43RX8E	20-Jun-07		CITRUS FORI	61451202	5K02 5C3Z	1130 NA	B65	1	1	11-Jul-07	-1	5	42.8	8.84	51.64	0.1	5513	INSTALLED CAPDI CODE PAAIU ATTEMPT TO ADJUST TIRE PRESSURE DURING PDI, FOUND TIRE OFF BEAD,WILL NOT INFLATE.RAISE VEHICLE AND REMOVE RIGHT SIDE WHEELS AND TIRES. RESEAT BEAD AND INFLATE TO SPEC IN TIRE CAGE. CHECK RIM AND 8635 L F WHEEL SLIGHTLY LOOSE 1007 CC 33 PERFORMED NVH DIAGNOSIS, FOUND L F WHEEL TWO LUGNUTS SLIGHTLY LOOSE CAUSING WHEEL TO MAKE NOISE. TIGHTENED LUGNUTS AND ROAD TESTED.	TIRE FOR LEAKS,NONE FOUND AT THIS TIME.REINSTAL L ON VEHICLE.55
2008 1FTXW43R38E	13-Apr-07		MIDWAY FOF	292277B	5K01 *	1007 *	B65	12	1	19-Jun-07	-1	6	0	53.24	53.24	0.6	5009		CORRECT FOR RIGHT INNER TIRE FLAT
2006 1FAHP25116G	8-Dec-05	2-Sep-06	POWER FOR	177109B	5K01 *	1007 *	N17	42	1	15-Aug-07	12	8635	0	55.34	55.34	0.6	5414		CUST STATES CLICK NOISE ON TURNS CHECK AND ADVISE CUSTOMER STATES SOUNDS LIKE AIR NOISE IN L DOOR AREA
2006 2FMZA52226E	7-Sep-05	25-Aug-06	LILLISTON FC	197277B	5K01 *	1007 *	R30	42	1	11-Jul-07	11	6821	0	56.4	56.4	0.7	1254	ROAD TEST VERIFY NOISE INSTALL CHASSIS EARS TIGHTEN HCU COVER TRACED AND DIAG. INSTALLED CHASSIS EAR. COULD NOT DUPLICATE CUSTOMERS CONCERNS AT THIS TIME	CUSTOMER STATES RATTLE NOISE FROM REAR
2008 1FTXW43R88E	12-May-07	22-May-07	LILLISTON FC	196490D	5K01 *	1007 *	N59	42	1	19-Jun-07	1	809	0	56.4	56.4	0.7	1254		EXPOSURE 1449

2007	2FMDK49C97E	1-May-07	15-May-07	CAMPBELL F	028762A 5K01 *	1007 *	H26	42	1	20-Jun-07	2	654	0	57.31	57.31	0.8	2744	654 ALIGNMENT TEST DRIVE VERIFY DRIFT RIGHT & STEERING WHEEL HIGH LEFT. ROTATE TIRES, TEST DRIVE, FIXED DRIFT BUT STEERING WHEEL SILL HIGH LEFT. CK FRT CASTER CMBRT AND TOE. TOE INCORRECT. ADJUST CP 1007 OSL TO ROAD FORCE BALANCE TIRES INVOICE 14117736 CP:1007 NEEDS GRD FORCE BALANCE	TOE IN. TEST DRIVE, VERIFY REPAIR.	CHECK PULLS RIGHT WHEN YOU GO OVER 30 MPH THE LEFT SIDE OF THE TRUCK SHAKES CUSTOMER STATES RIGHT REAR HUBCAP FELL OFF ON HIGHWAY AND WAS RUN OVER BY BIG TRUCK SOP PART REORDERED AND IS IN LOCKING NUTS TO SMALL AND BROKE OFF CUSTOMER STATES THAT THE WHEEL LOCK LUG NUTS HAVE BROKEN OFF. PLEASE REPLACE WITH NEW LOCKING LUGS. WHEEL LOCK BROKE IN HALF
2006	1FTRX14W96N	17-Feb-06	17-Nov-06	BARTON FOF	3404703 5K01 *	1007 *	N25	D9	1	6-Jun-07	7	10644	0	59.56	59.56	0	6747			
2008	1FTWW33R38EB	25-Jun-07	13-Jul-07	DON CHALMI	4513151 5K02 5C3Z	1130 XA	C50	42	1	21-Aug-07	2	1485	61.77	0	61.77	0	1487	PART ONLY		
2007	2FMDK49C77E	8-Mar-07	28-Apr-07	PHIL LONG F	78292301 5K01 7T4Z	1A043 A	B65	1	1	2-Aug-07	4	6200	44.1	17.98	62.08	0.2	3140	999A TIME TO REPLACE LOCKING LUG NUTS TOO SMALL BROKE OFF		
2007	2FMDK46C47E	29-Mar-07	8-Aug-07	PHIL LONG F	78348201 5K01 7T4Z	1A043 A	B65	1	1	9-Aug-07	1	262	44.1	17.98	62.08	0.2	3140	999A TIME TO REPLACE LOCKING LUG NUTS BROKEN TOO SHORT REPLACED ALL WITH NEW LUGS. 999A TIME TO REPLACE LOCKING LUG NUTS		
2007	2FMDK46C37E	28-Mar-07	5-May-07	PHIL LONG F	78422601 5K01 7T4Z	1A043 A	B65	1	1	17-Aug-07	4	1580	44.1	17.98	62.08	0.2	3140	VERIFIED CONCERN IDENTIFIED BOLTS TO SPARE TIRE HANGER LOOSE TIGHTEN BOLTS AND RECHECK OPERATI ON OK. MTIME FOR ABNORMAL DIAGNOSIS. INSPECT VERIFY CONCERN, REMOVE RIGHT FRONT AND LEFT REAR TIRE ASSY., REMOVE CENTER PIECES RE INSTALL VERIFY REPAIRS TIME RAN ON PREVIOUS LINES		
2007	2FMDK49C17E	11-Apr-07	3-May-07	MIDWAY FOF	293378C 5K01 *	1007 *	N51	33	1	10-Jul-07	3	4400	0	62.11	62.11	0.7	5009		CORRECT FOR RATTLE TYPE NOISE IN REAR OF VEHICLE	
2007	3MEHM07147R6	30-Aug-06	15-Jan-07	SOUTHGATE	9836252 5K02 6N7Z	1130 AA	B65	5	1	15-Jun-07	6	4121	45.36	17.32	62.68	0.2	10671		CUSTOMER STATES TWO CENTER CAPS ARE OXIDIZING CUSTOMER STATES LUGNUT IS MISSING FROM THE HUB CAP HUB CAPS ARE PEELING C S THAT THE LEFT REAR HUB CAP IS MISSING FORD EMBLEM.	
2007	1FTRX14W27N	28-Aug-06	30-Apr-07	CHAPMAN FC	15478901 5K02 5L3Z	1130 EA	B65	42	1	6-Jul-07	3	3815	57.34	7.46	64.8	0.1	3955	INSTALL BROKEN CENTER CAP		
2006	4M2EU47E76U	4-Apr-06	28-Oct-06	H & L FORD,	11496301 5K02 5E6Z	1130 AA	B65	5	1	26-Jun-07	9	7200	52.02	13.36	65.38	0.2	677	REPLACE ALL 4 HUB CAPS		
2007	1FTPW14517F	9-Jan-07	27-Feb-07	TASCA FORC	446618D 5K02 5L3Z	1130 EA	B65	33	1	7-Aug-07	6	5270	57.34	8.7	66.04	0.1	796	REPLACE HUB CAP		



2007 1FTRF12267K	25-Apr-07	14-Jun-07	JIM CLICK FC	48429301	5K01 *	1007 *	H44 D9	1	23-Jun-07	1	225	0	66.55	66.55	0.8	20402	TIRE BALANCE FOUND TIRES OVER INFLATED, SERVICE TO STICKER SPECS. CHECK TIRE BALANCE AND ROAD FORCE. REBALANCED, ROAD FORCE WITHIN SPECS. A SMALL AMOUNT OF ROAD FEEL WILL BE NORMAL THRU THE RACK AN	D PINION STEERING.	C S FRONT END SHAKES AT 75 PLUS MPH(H44)
2007 1ZVHT80N475	15-Nov-06	23-Feb-07	JIM CLICK FC	49750902	5K01 *	1007 *	G32 42	1	13-Jul-07	5	5524	0	66.56	66.56	0.8	20402	1 UPON INSPECTION L F 31 PSI, R F 32 PSI, R R 30 PSI, L R 33 PSI. INFLATED TO 35 PSI, AS PER FACTORY SPEC. TEST DROVE, AND FAULT STILL PRESENT. RE TRAINED TIRE MONITORS. ROAD TESTED GOOD. INDICATOR	S REMAINED OFF.	CUSTOMER STATES TIRE PRESSURE MONITOR FUALT INDICATORS STAYS ON AT ALL TIMES. CHECK AND ADVISE. G32
2006 4M2EU36E76U	25-Jul-06	30-Sep-06	ISLAND LINC	8000151	5K02 5E6Z	1130 AA	B65 81	1	11-Jul-07	10	9229	52.02	14.86	66.88	0.2	11643	CENTER CAPS CORRODING PULLED EACH WHEEL OFF AND REPLACED CENTER CAPS 3192 C 1007 CC30 1007D3T 0.7 FLAG TECH 449 070 TEST DROVE VEHICLE VERIFIED VIBRATION CONCERN. INSPECTED FRONT AND REAR TIRES FOR BALANCE. TIRES OUT OF VALANCED CAUSED VEBRATION. SPIN BALANCE	SET TIRE PRESURRE. REROAD TEST TO VERIFY REPAIRS FLAG TECH 449	CORRODING..ODERE 4 CENTER CAPS USE SPO 07187005
2007 1FAFP34N77W	27-Mar-07	6-Apr-07	SANTA MARC	361541A	5K01 *	1007 *	H21 33	1	10-Aug-07	5	3189	0	67.25	67.25	0.7	1597	OUT OF BALANCE		C S VIBRATION AT HWY SPEEDS
2007 1FMFK17517L	9-Nov-06	3-Aug-07	BILLY HOWE	1606851	5K01 *	1007 *	N25 D9	1	8-Aug-07	1	744	0	67.62	67.62	0.8	341	TIRE AND WHEEL BALANCE		CUSTOMER STATES WHEEL CENTER CAPS ARE CLOUDING UP
2006 4M2EU48866U	2-Mar-06	10-Oct-06	LAZARE LINC	35161902	5K02 5E6Z	1130 AA	B65 81	1	23-Aug-07	11	11414	52.02	15.85	67.87	0.2	10243	VERIFIED.REPLACED CENTER CAPS		
2007 1ZVFT80N175	11-Jun-07		HELFMAN FC	5710951	5K01 6W7Z	1012 BA	B65 42	1	29-Jun-07	-1	10	28.25	39.82	68.07	0.5	4587	WHEEL STUD STRIPPED. REPLACED STRIPED WHEEL STUD ON RT.REAR WHEEL 9851 ROAD TEST AND VERIFIED CUSTOMERS CONCERN INSPECTED BRAKES AND FOUND NO PROBLEM. NOTICED WHEEL COVERS HAD MARKS WHERE HITTING THE WHEEL RAN OASIS AND FOUND TSB # 06 9 5 COMPLETED TSB AND MATT		RIGHT REAR WHEEL HAS DAMAGE TO STUD NUT IS MISSING
2006 1FAFP34N86W	3-Mar-06	12-Aug-06	ED MULLINA	266543B	5K02 *	1130 *	N50 42	1	10-Jul-07	12	9851	0	68.22	68.22	0.8	2283		ROAD TEST TO VERIFY REPAIR PASS .	CS, TICKING NOISE IN LFT FRT SLOWER SPEEDS B65 OWNER REPORTS FINISH PEELING FROM CENTER CAPS
2007 4M2EU38837U	5-Jun-07	16-Aug-07	AUTOWAY LI	321173A	5K02 5E6Z	1130 AA	B65 81	1	29-Jun-07	0	5	52.02	16.7	68.72	0.2	11605	5 34 1130 WARR REPLACE 4 CENTER CAPS		

2008	1FMCU03Z58K	23-Apr-07	19-May-07	CAVALIER FC	936888A 5K02 *	1708	1	N59	33	1	18-Jul-07	3	1425	0	69.6	69.6	0.8	6633	1438 WAR ROADTEST VERIFIED 2 DIFFERENT RATTLES,FOUND A PORTABLE VACCUM CLEANER IN RIGHT STOWAGE,REMOVE & DROVE AGAIN,1 RATTLE PULL OFF SIDE OF ROAD 7 FOUND JACK NOT SECURED AND HANDLE	ROPERLY AND TIGHT ,ROADTEST WITH CUSTOMER AND VERIFIED CONCERN FIXED. (SAM WILL NEED M TIME)	STATES HEARS DAILY JUST DRIVING FROM REAR OF VEH A RATTLE NOISE,SAID POSSIBLE REAR HATCH AREA.NOT NOTICING DOME LITE FLICKER
2006	1FTPX14576N	7-Feb-06	29-Dec-06	FAIRLANE FC	223158D 5K02 4L3Z	1130	AB	B65	D4	1	11-Jun-07	6	8695	52.75	17.18	69.93	0.2	3050	8695 42 1130 REPLAC 3 HUB CAPS WERE PEELING		B43 EMBLEMS ON 3 OF THE WHEEL CENTER CAPS ARE PEALING
2007	1FAFP34N47W	1-Nov-06	20-Jan-07	HARRELSON	7603351 5K01 6S4Z	1012	BA	B65	1	1	29-Aug-07	8	12014	22.82	47.29	70.11	0.6	1071	BROKEN BOLT(S) REAR HUB REPLACE		C S THAT DRIVERS SID REAR LUG NUT HARD TO GET OFF AND PASS SIDE REAR MISSING CK AND ADV
2008	1FMCU03148K	10-Aug-07	24-Aug-07	MCCOTTER F	210381A 5K02 *	1130	*	B65	42	1	21-Aug-07	0	1	70.34	0	70.34	0	4944	1 W PDI ROAD TEST		
2007	1FBSS31L57	2-Apr-07	17-Apr-07	DEWEY FORI	43661803 5K02 F5TZ	1130	J	B65	7	1	14-Aug-07	4	9684	63.36	7.93	71.29	0.1	3540	1 REPLACED COVER VERIFIED CONCERN. REPLACED RIGHT REAR WHEEL AIR STEM. RECHECKED. ALL GOOD.		HUB CAP FELL OF DRIVING INSPECT AND ADVISE. TIRE LIGHT STAYS ON
2006	1FMPU15586L	20-Jun-06	14-Sep-06	VALLEY ISLE	371016C 5K02 F42Z	1700	A	G29	D1	1	16-Jul-07	11	10328	1.68	70.74	72.42	0.7	7839	CORROSION DIGITAL IMAGES SENT TO FORD, FORD APPROVED REPLACEMENT OF ALL 4 CENTER CAPS.		CENTER CAPS
2007	4M2CU97117K	30-Aug-06	14-Oct-06	HEMPSTEAD	74612501 5K02 5E6Z	1130	AA	B65	D4	1	2-Jul-07	9	3551	52.02	21.05	73.07	0.2	11208	BALANCE OFF ROAD FORCE HIGH CHECK BALANCE AND ROAD FORCE, REINDEX THREE TIRES TO LOWER ROAD FORCE AND REBALANCE FOUR. R T OK. NOTE THAT SOME ROAD FEEL WILL BE NORMAL WITH RACK AND PINION STEERING.		FACTORY WARRANTY FRONT END CUSTOMER STATES VEHICLE SHAKES AT HWY SPEEDS N27
2007	1FTYR10D67F	21-Aug-06	7-Oct-06	JIM CLICK FC	47100604 5K01 *	1007	*	N27	D9	1	4-Jun-07	9	5401	0	74.87	74.87	0.9	20402	VERIFY CONCERN ORDERED 4 HUB CAPS REPLACE PEELING HUB CAPS		CUST STATES HUB CAPS ARE PEELING CUST STATES THE DR SIDE DOOR RATTLES WHEN YOU HIT A BUMP, INTERMITTANTLY LIKE THE DOOR IS NOT SHUT ALL THE WAY , GOING OVER RAIL ROAD BUMPS
2006	1FAHP28136G	9-Nov-05	27-Feb-07	ENFIELD FOF	15422702 5K02 5G1Z	1130	BA	B65	D4	1	27-Jul-07	6	7636	60.2	15.76	75.96	0.2	8821	3197 RATTLE TEST DROVE VERIFY CONCERN .NOISE ON RT SIDE ADJUSTED AND LUBE RIGHT SIDE DOOR LATCHES TEST DROVE NOISE STILL THERE REMOVED JACK AND TOOLS.TEST DROVE PUT FOAM TAPE BEHIND BRACKET FOR JACK	PUT FOAM TAPE UNDER JACK AND TOOLS TEST DROVE NOISE GONE	DR SIDE DOOR RATTLES WHEN YOU HIT A BUMP, INTERMITTANTLY LIKE THE DOOR IS NOT SHUT ALL THE WAY , GOING OVER RAIL ROAD BUMPS
2007	1FTRF12217K	29-Aug-06	20-Feb-07	RICART FORI	240919A 5K02 *	1708	1	N40	41	1	6-Jun-07	4	3197	0	77.93	77.93	1	2185			
2008	1FTXW43R08E	30-May-07	30-Jun-07	NICK NICHOL	4989853 5K02 8C3Z	1130	C	B65	7	1	12-Jul-07	1	1348	64.81	13.64	78.45	0.2	1200	REPLACE REAR HUB CAP FELL OFF REPLACE MISSING REAR HUB CAP		CUSTOMER STATES LEFT REAR HUBCAP CAME OFF

2007 1FTYR14D17	1-May-07	19-May-07	COURTESY F	7240301 5K01 *	1007 *	N24 42 1	6-Aug-07	3	8811	0	78.91	78.91	0.9	6743	VERIFIED THE CONCERN, CHECKED OASIS. PERFORMED NVH DIAG. PERFORMED A ROAD FORCE BALLANCE. FOUND THAT ALL TIRES HAD GOOD ROADFORCE VARIATIONS, FOUND THAT THE LEFT REAR TIRE WAS OUT OF BALLANCE. RETESTE ROAD TEST, VERIFY PULL. SET AIR PRESSURES LOW ROTATE TIRES. FOUND TIRE SHAKE. PULL AND BALANCE ALL 4 TIRES ALSO FOUND HUB CAPS TO SIT OFF CENTER	D OK. CC# D9	CUSTOMER STATES VEHICLE BEGAN TO HAVE A VIBRATION TWO DAYS AGO. HE STATED IT WAS MILD AT FIRST, BUT THEN BECAME PROGRESSIVELY WORSE. NOW THE VIBRATION IS VERY BAD, ESPECIALLY AT A STEADY S
2007 1FAFP34N77W1	11-Aug-06	15-Dec-06	CLAIR FORD	256927A 5K01 *	1007 *	H25 D9 1	16-Jun-07	7	7057	0	79.78	79.78	1.1	8814	CK ALL WHEELS REINDEX LR TIRE BALANCE ALL WHEELS REINDEX LR TIRE CK RUNOUT REBAL ALL WHEELS		CONCERN. VEHICLE PULLS TO THE LEFT WHEN DRIVING
2007 1FMEU63E47UE	21-Feb-07	11-Jun-07	CARL GREGC	9354501 5K01 *	1007 *	N23 D9 1	13-Jun-07	1	337	0	79.85	79.85	1.2	2684			CUST STATES VEH HAS VIB AT 75 80 MPH CHECK CENTER CAPS. CUSTOMER STATES THEY ARE DISCOLORED.
2007 1FTPX14V07F	13-Apr-07	9-Jul-07	GRAND LEDC	066126A 5K02 4L3Z	1130 AB	B65 34 1	23-Jul-07	1	1079	70.34	15.32	85.66	0.2	9099	1079 REMOVED OLD CENTER CAPS INSTALLED NEW ONES		CUSTOMER STATES HE HEARS A CHURPING NOISE COMING FRONT FRONT OF VEHICLE WHEN WHEELS ARE TURNING SEEMS TO COME FROM PASS SIDE FRONT CHECK AND ADVISE MISS BUILT UNIT WRONG LUG NUTS ON RIGHT REAR WHEEL
2007 3FAHP06Z87F	1-Feb-07	16-Mar-07	PHIL LONG F	78210101 5K02 *	1130 *	N50 7 1	25-Jul-07	5	6116	0	98.88	98.88	1.1	3140	TEST DROVE VERIFIED SQUEAK HUBCAPS SQUEAKING WHEN FLEXING MT TIME TO REMOVE ALL HUBCAPS INSULATED CLIPS RETEST DROVE NOISE GONE 5 MISS BUILT UNIT VEH HAD NON CHROME LUG NUTS REMOVE ALL 5 AND INSTALL NEW CHROME LUG NUTS BASIC# 1012		CUSTOMER STATES HE HEARS A CHURPING NOISE COMING FRONT FRONT OF VEHICLE WHEN WHEELS ARE TURNING SEEMS TO COME FROM PASS SIDE FRONT CHECK AND ADVISE MISS BUILT UNIT WRONG LUG NUTS ON RIGHT REAR WHEEL
2008 1FMDK06W58G	24-Jul-07	6-Sep-07	NORTH BRO!	204739A 5K01 6L2Z	1012 BA	B53 38 1	30-Jul-07	0	5	21.56	78.3	99.86	0.9	2975			C S ALL FOUR HUB CAPS ARE BENT
2007 1FAFP31N17W	21-Aug-06	1-Apr-07	COURTESY F	307514C 5K02 6S4Z	1130 A	B65 2 1	9-Jun-07	3	3453	90.16	15.43	105.59	0.2	1625	3453 ROAD TEST VEHICLE TO VERIFY CONCERN,REMOVE HUB CAPS ROAD TEST AGAIN VIBRATION GONE,REPLACE HUB CAPS WITH NEW ONES AND ROAD TEST AGAIN,VIBRATIO N GONE 4705 HUB CAPS SQUEEKING C S SQUEEKING NOISE FROM WHEELS VERIYF ON ROADTEST REMOVE HUBCAPS AND ROADTEST NO NOISE FOUND TSB 6 21 13 REPLACE ALL FOUR HUB CAPS		CUSTOMER STATES VEHICLE MAKING A SQUEEKING NOISE FROM WHEEL AREA CHECK HUB CAPS MAY BE LOOSEE
2007 3FAHP06Z67F	4-Sep-06	15-Jan-07	LITHIA FORD	355746C 5K02 7E5Z	1130 A	B65 42 1	2-Jul-07	6	4705	91	16.53	107.53	0.2	3897			

2007	3FAHP06Z37F	14-Feb-07	28-Mar-07	DON CHALMI	4337251 5K02 7E5Z	1130 A	N51	42	1	3-Aug-07	5	6201	91	17.59	108.59	0.2	1487	1	HUB INSTOCK ORDER 3 MORE	CUSTOMER STATES HUB CAPS STILL MAKING NOISE. REPLACE HUBCAPS CUSTOMER STATES ALL FOUR CENTER CAPS ARE DISTORTED PART WERE ORDERED AND PARTS ARE HERE
2006	3MEFM07166R6	17-May-06	30-Oct-06	ELMHURST L	6331351 5K02 6N7Z	1130 AA	B65	2	1	5-Jun-07	8	11447	97.2	19.95	117.15	0.2	13660		CENTER CAPS WHEEL RING HUB CAP WHEEL COVER REPLACE ROAD TESTED, VERIFIED VIBRATION AT HWY SPEEDS, SUBLET REPAIR TO BALANCE ALL FOUR TIRES, RETESTED OK. LOOSE SUSPENSION ROAD TESTED.PERFORMED NVH DIAG USING ELECTRONIC CHASSIS EARS RETORQUED SUSPENSION COMPONENTS.MULTIPLE ROAD TEST.ROAD TESTED OTHER SAME TYPE VEHICLES AND NOTED THAT SOME NOISE IS CH	REPAIR VIBRATION AT HWY SPEEDS
2007	1FTPW14V87K	16-Mar-07		GRANDE TRU	090405A 5K01 *	1007 *	N25 D9	1		26-Jun-07	-1	157	8.96	120	128.96	0	4569			FACTORY WARRANTY FRONT END SLOW SPEEDS RIGHT REAR SUSPENSION MAKES NOISE OVER BUMPS CUSTOMER STATES ALL 4 HUB CAPS CENTER S ARE FADING CUSTOMER STATES THE BLACK PAINT IS PEELING OFF OF THE CENTER CAPS B65 CUSTOMER STATES THE LEFT FRONT RIM IS
2007	1ZVFT80N275	12-Dec-06	16-Jan-07	JIM CLICK FC	48173602 5K01 *	1007 *	N58	33	1	20-Jun-07	6	2540	0	141.42	141.42	1.7	20402		REPLACE BOTH LEFT SIDE AND R F HUBCAPS	ARACTERISTIC OF VEHICLE MODEL.NORMA L ROAD NOISE
2007	2MEFM74V87X	22-Jan-07	17-Mar-07	TOMS RIVER	3438751 5K02 5W3Z	1130 DA	B65 D4	1		30-Jul-07	5	8027	151.87	18.34	170.21	0.2	10489		REPLACE BOTH LEFT SIDE AND R F HUBCAPS	OPPERATION NORMAL
2007	1LNHM82V27Y	20-Dec-06	27-Jul-07	GREENVILLE	1784551 5K02 6W1Z	1130 BA	B65 D4	1		8-Aug-07	1	272	166.6	14.21	180.81	0.2	2484		CENTER CAPS PEELING WHEEL RING HUB CAP WHEEL COVER REPLACE	
2006	1FTPX145X6F	30-Nov-05	30-Sep-06	MORROW FC	2348601 5K01 7L3Z	1015 B	B65 D4	1		27-Jul-07	11	2005	162.02	20.3	182.32	0.3	7327		PEELING ON THE EDGE S/O/P REPLACED RIM TP AT 30PSI, PEROFMRED NVH TEST DRIVE WITH EVA HAD 14 HZ VIB AT 60MPH, BALANCED ALL 4 WHEELS ON GSP9700, FOUND RIGHT FRONT WHEEL .026 INCH RUNOUT, REPLACED RF WHEEL AND BALANCED, RECHECKED	CUSTOMER STATES ABOVE 40 MPH THEIR IS A VIBRATION POSSIBLY IN TIRES CUSTOMER STATES BLACK IS COMMING OFF ALL 4 HUB CAPS STATES THERE IS A VIBRATION AND LEFT REAR WHEEL IS WOBBLING
2007	1FAFP31N17W	17-Nov-06	4-Feb-07	DON CHALMI	4048051 5K01 4S4Z	1007 AA	C50	42	1	3-Jul-07	5	2744	60.43	123.14	183.57	1.4	1487		FOUND BLACK COMING OFF HUB CAPS. AUTH PAACN REPLACED ALL 4 HUB CAPS. WHEEL NOT SEATING ON HUB DUE TO WHEEL NOT MACHINED PROPERLY TECH 9907	
2006	1LNHM82V26Y6	16-Sep-05	26-Sep-06	CREST LINC	20681201 5K02 6W1Z	1130 BA	B65	5	1	20-Jul-07	10	8026	166.6	17.79	184.39	0.2	13304		REPLACED RIGHT REAR WHEEL STAINED	
2007	1FMEU63E27U	15-Jun-07	16-Aug-07	LONG-LEWIS	41133501 5K01 7L2Z	1007 A	B65	17	1	26-Jul-07	0	14	224.61	23.85	248.46	0.3	225		TIRE(S) OR WHEEL(S) REPLACE	CHECK FRT RIM

2007	2FMDK39C97E	1-Mar-07	30-Apr-07	BANKSTON F	498277A	5K01	7T4Z	1007 F	N58	17	1	3-Jul-07	3	2550	279.17	67.71	346.88	0.8	2441	2560 17 ROADTEST AND VERIFY CONCERN COULD HEAR NOISE COMING FROM LEFT FRONT WHEEL AREA REMOVE LF WHEEL AND INSPECT BRAKES SUSPENSION AND HUB ASSEMBLIES REMOUNT WHEEL FOUND WHEEL NOT FITTING HUB AND	WHEEL STUDS PROPERLY INSPECT WHEEL FOUND BOLT PATTERN MISSDRILLED AND NOT CENTERED CAUSING WHEEL TO SEAT IMPROPERLY ON HUB REMOVE AND REPLACE WHEEL MOUNT AND BALANCE TIRE TO NEW WHEEL	CUST STATES HEARING A CHERPING SOUND WHEN SLIGHTLY TURNING TO THE RIGHT
2008	1FTWW31R78E	12-Jun-07	21-Aug-07	KORUM FOR	54430801	5K01	7C3Z	1015 E	B65	D4	1	3-Jul-07	0	27	322.01	36.7	358.71	0.4	8651	LEFT FRONT WHEEL	WHEEL DISCOLORED CUSTOMER STATES THE RH REAR WHEEL PLASTIC CENTERING HUB IS FRACTURED...ORDER AS REQUIRED.	
2007	1FMFU17597L	11-May-07	31-Aug-07	GARY YEOM	57860001	5K01	7L1Z	1007 D	B65	34	1	5-Jul-07	0	11	303.32	72	375.32	0.9	4790	RIGHT REAR WHEEL HUB TOO BIG IN DIAMETER FOR HUB CAP. REPLACED RIGHT REAR WHEEL AND REMOVED INSTALLED TIRE PRESSUR MONITOR SENSOR. REPLACED DAMAGED RIM APPROVED BY DI PAAWT UNDER RO 167495 03 THATS WERE THE RIM WAS ORDERED CLEAR PEELING REPLACED L R RIM FOR HIDDEN DAMAGE FOUND DURING PDI. NECC TO INSTALLED TPMS SENSOR BAND AND	INSTALL SOP DR SIDE FR RIM DI APPROVED FOR PEELING ISSUE	
2007	1ZVFT85HX75	22-Aug-06	12-Apr-07	PHIL SMITH F	16818102	5K01	6R3Z	1007 A	B65	81	1	16-Aug-07	5	1718	367.5	24.05	391.55	0.3	4351	33 LOOSE 1012 CHECKED LEFT REAR LUG NUTS VERIFIED CONCERN REMOVED AND REPLACED LEFT REAR STUDS,LUGS AND WHEEL.	LEFT REAR RIM DAMAGED UNDER PROTECTIVE COVER CUST STATES CK LUGS ON ALL RIMS LFT REAR WHEEL LOOSE CK FOR DAMAGE ALL FOUR WHEELS HAVE CORROSION STARTING UNDER CLEAR COAT FINISH	
2008	1FAHP25W78G	29-May-07		KELLY FORD	12294001	5K01	8G1Z	1007 C	B65	81	1	10-Jul-07	-1	12	345.7	52.08	397.78	0.7	4808	APPROVED PAAWV TO REPLACE BOTH FRT WHEELS VERIFIED CONCERN. CHECKED BALANCE, ROAD FORCE, RIM RUN OUT ON 4 TIRES. WHEEL THAT WAS ON RIGHT FRONT HAS EXCESSIVE RIM RUNOUT. CURRENTLY ON RIGHT REAR. ORDERED WHEEL. NO DAMAGE TO RIGHT REAR	FRT VIBRATES AT 60 +	
2008	1FTSW21R38E	26-Apr-07	31-May-07	HUB CITY FC	10947601	5K01	5C3Z	1015 JA	B65	33	1	7-Jun-07	1	293	356.18	80.28	436.46	1.1	6481			
2006	1FTRW12W26F	17-May-06	24-Aug-06	COMMERCIA	055252A	5K01	4L3Z	1007 AB	F11	5	1	21-Jun-07	11	8111	413.28	34.05	447.33	0.5	4405			
2006	1FTYR11U76F	13-Apr-06	25-Apr-07	CAL WORTH	34850101	5K01	YL5Z	1015 BA	N25	30	1	13-Jun-07	2	1329	320.24	134.29	454.53	1.4	8619			

2007 1ZVHT88S075	6-Jun-07	23-Jun-07	CARL GREGG	9381801	5K01	7R3Z	1007 A	B65	D4	1	22-Jun-07	0	2992	410.81	46.58	457.39	0.7	2684	RIGHT FRONT RIM HAS A DEFECT REPLACED RIGHT FRONT RIM NVH DIAG.ISOLATE NOISE TO LEFT REAR WHEEL CHROME CLADDING.REPLACED WHEEL & TIRE PRESSURE MONITOR BAND AND MOUNT.RETEST AND VERIFY. VERIFIED CONCERN WITH CLICKING, FOUND LEFT REAR RIM FLEXING. INSTALLED NEW RIM.	DURING CLEAN UP FOUND RIGHT FRONT WHEEL HAS UNEVEN AREA DI APPROVAL PAAMV ROTATIONAL NOISE WHEN DRIVING AND CRUNCHING NOISE FORWARD AND REVERSE CUST STATES THERE IS A CLICKING IN REAR WHEEL. CUST ST TIRE PRESSURE LIGHT KEEPS COMING ON SOP RIGHT REAR RIM HOLE IN RIM SEE JAMES	
2007 1FMEU74E07U	23-Apr-07	27-Apr-07	ROY O'BRIEN	42164301	5K01	7L2Z	1007 E	N59	42	1	2-Aug-07	4	4957	348.9	85.22	462.12	1	2934			
2007 4M2EU48847U	15-May-07	30-May-07	LAZARE LINC	35032001	5K01	6L9Z	1007 A	B65	42	1	16-Jul-07	2	7023	407.73	55.46	463.19	0.7	10243			
2007 2FMDK49C97E	10-May-07	16-May-07	OASIS FORD	1530551	5K01	7T4Z	1007 F	A40	42	1	3-Aug-07	3	3257	410.55	67.53	478.08	0.7	3604	REPLACED RIGHT REAR WHEEL TIRE(S) OR WHEEL(S) REPLACE INSPECT RIM, FOUND PAINT FROM INSIDE OF RIM ON OUTSIDE REPLACED RIM, MOUNTED & BALANCED TIRE		
2007 1ZVHT88S775	17-Apr-07	9-Jun-07	BRONDES FC	15872301	5K01	7R3Z	1007 A	B65	D4	1	6-Jul-07	1	715	410.81	22.74	483.55	0.3	3010	6075 LF & BOTH REAR WHEELS CHROME PEELING 3 MOUNT & BALANCE LF & BOTH REAR WHEELS REPLACE	CUST STATES IMPERFECTION IN PSNGR FRONT RIM CUST STATES DRV FRONT WHEEL, BOTH REAR WHEELS CHROME IS PEELING	
2006 1FTPW14506F	12-Oct-05	16-Nov-06	ROBERTS FC	149814A	5K01	7L3Z	1015 B	B65	D4	1	10-Jul-07	8	6075	520.79	18.29	539.08	0.2	9883	331 MOUNT RIGHT REAR OUTSIDE TIRE ON NEW RIM BY HAND TRIED TO BALANCE AND THE MACHINE WE HAVE WILL NOT BALANCE IT TOOK IT TO GOODYEAR THEY COULDNT DO IT, TOOK IT TO FREDS AND THEY COULDNT DO IT		
2008 1FTXW43R98E	14-May-07	20-Jun-07	DAHL FORD I	149138A	5K01	5C3Z	1007 KA	B65	D4	1	27-Jun-07	1	785	670.1	47.99	718.09	0.6	6209	FI	NALLY HAD IT DONE AT POMPS TIRE	CUST STATES THERE IS AN IMPERFECTION IN THE RIGHT REAR RIM CHECK RIGHT REAR RIM HAS CORROSION ON RIM THROUGHT ALL CENTER AREAS B65
2007 5LTPW18507F	18-Oct-06	2-Jul-07	LYONS-RYAN	106744A	5K01	7L7Z	1007 K	B65	5	1	31-Jul-07	1	623	676.52	66.36	742.88	0.7	1505	RR RIM HAS CORROSION,PRIOR APPROVAL PAA7S,RPL RIM ASSY AND RPL SENSOR IN RIM 42 1007 VERIFIED CLICKING SOUND WHILE DRIVING. DIAG., FOUND LF WHEEL AND LR WHEEL NOISY. REPLACED LF AND LR WHEELS AND SENSOR RINGS. ROAD TESTED, VERIFIED REPAIR. REQUEST DIAG TIME TO PINPOINT		
2007 1FMEU53817U	22-May-07	23-May-07	KRUG HILLTC	1877801	5K01	7L2Z	1007 E	N50	42	1	25-Jul-07	3	4075	697.8	49.92	747.72	0.6	1758	SOUR	GE OF NOISE. 5562	CHECK FOR CLICKING TYPE SOUND, WHILE MOVING, CAN HEAR MORE WHEN SLOWING DOWN, CLICKING TYPE NOISE COMING FROM THE WHEELS, HAPPENS WHEN TURNING OR TORQUING THE VEHICLE
2007 1FMFK20567	19-Sep-06	17-Nov-06	APPLE FORD	48047301	5K01	7L1Z	1007 D	B65	42	1	13-Jun-07	7	9480	1330.1	170.24	750.15	2.1	84	B65 42 1007 PAAWR MARK SAMPLES REPLACED 4 RIMS AND WHEEL SENSORS, REMOUNTED AND BALLENCED TIRES	PE08-060 1456	

2007 2FMDK49C37E	30-Apr-07	19-May-07	CAMPBELL F	030458A 5K01 7L2Z	1007 E	N50 33	1	31-Jul-07	3	4020	697.82	107.46	805.28	1.5	2744	4020 ROAD TEST FOR NOISE.CREAKING NOISE IN FRONT WHEELS.REPLACE BOTH FRONT WHEELS, TRANSFER TIRE PRESSURE MONITOR SENSORS ONTO NEW WHEELS.INSTALL NEW VALVE STEMS AND BALANCE BOTH FRONT TIRES.	CUSTOMER STATES HEARING NOISE IN FRONT PASSANGER SIDE WHEEL WHEN DRIVING 40 50 MPH
2007 2FMDK49C47E	16-Apr-07	27-Apr-07	FULLERTON	6083651 5K01 7L2Z	1007 E	N50 42	1	11-Jul-07	3	1329	866.35	108.41	974.76	1.1	20651	SOUND FROM WHEELS WHEN TURNING DDDDR4 DIFF WHEELS TESTED AND REPALCED WHEELS WEBBING. DI AUTH PAAWX. REPLACE WHEELS. INSTALL STRAPS FOR TPM SENSORS. ACTIVATE SENSORS. VERIFIED REPAIRS.	CLICKING SOUND FROM WHEELS WHEN TURNING. VERIFIED BY RON. PARTS ORDERED. CONFIRM WHICH WHEELS ARE CAUSING THE NOISE. CUST THINKS THE R F IS NOISEY AGAIN(BEEN REPLACED)
2006 1FMEU62E96Z	26-Sep-05	6-Aug-07	MIDPAC AUT	19399201 5K01 6L2Z	1007 AA	B65 D4	1	6-Aug-07	0	54	905.19	150.26	1055.5	1.7	1804	VERIFIED CUSTOMER CONCERN. RECEIVED PRIOR APPROVALFROM DIGITAL IMAGING PAAAR TO REPLACE MOUNT AND BALANCE FOUR NEW WHEELS.	WHEELS ARE WEBBING
2007 1MEHM43187G	25-Sep-06	30-Jun-07	CAMPBELL F	030670A 5K01 7G1Z	1007 A	B65 D1	1	6-Aug-07	2	5944	1141.8	114.62	1256.4	1.6	2744	INSTALLED NEW WHEELS AND SENSORS APPROVED BY PAAMU ACES CODE PAALX REPLACED FOUR WHEELS MOUNT AND BALANCED SWAPPED OVER AND PROGRAMED FOUR TIRE PRESSURE MONITORS REPLACE 4 TIRE PRESSURES MONITORS PLATING PITTING PEELING PITTING TIRE(S) OR WHEEL(S) REPLACE WPI	CHECK ALL WHEELS PITTED ALL 4 WHEELS HAVE CORROSION UNDER CLEAR COAT FINISH
2007 4M2CU87187K	12-Jun-06	14-Aug-07	COMMERCIA	056626A 5K01 6E6Z	1007 C	F11 D7	1	14-Aug-07	0	44	1157.6	115.75	1273.3	1.7	4405	REPLACED ALL 4 WHEELS,MOUNT,BALANCE AND REPLACE ALL 4 TIRE PRESSURE SENSOR STRAPS PRIOR AUTH#PAA2S	WHEELS OXIDIZING BOTH RH FRT & REAR RIMS PLATING PEELING
2007 2FMDK49CX7E	19-Jun-07		FAMILY FORI	22005801 5K01 7T4Z	1007 F	B65 55	1	27-Aug-07	-1	49	1306.3	58.86	1365.2	0.8	3372	REPLACED 4 WHEELS AND BALANCE AND REPLACE ALL 4 TIRE PRESSURE SENSOR STRAPS PRIOR AUTH#PAA2S	CUSTOMER STATES ALL WHEELS ARE CORRODING ALONG EDGES
2007 5LMFU28527L	21-Feb-07	3-Apr-07	ORCHID ISLE	4010851 5K01 7L7Z	1007 K	B65 D4	1	20-Jun-07	3	1500	1260.8	145.6	1406.4	1.6	7761	PLASTIC FRTS ON WHEELS REPLACED 4 WHEELS AND SENSOR BRACKETS, PROGRAMED WHEEL SENSORS	CUSTOMER STATES A CLICKING NOISE ON ACCERLERATION AND TURNIN
2007 2FMDK49C77E	19-Dec-06	5-Jan-07	DON SEELYE	75586601 5K01 7T4Z	1007 F	B65 14	1	10-Aug-07	8	9643	1306.3	126.67	1433	1.7	9708		
2007 1FMEU74E37U	12-Feb-07	7-Apr-07	EWALD'S VEI	51486601 5K01 7L2Z	1007 E	N58 42	1	11-Jun-07	3	3204	1395.6	140.32	1536	1.7	3774		

2007 2LMDU88C47B	30-May-07	9-Sep-07	PALM SPRING	160358A 5K01 7A1Z	1007 B	N50	42	1	19-Jun-07	0	10	1447.8	133.05	1580.9	1.5	5574	ROAD TEST, FOUND RIMS MAKING CRUNCHING NOISE, REMOVED ONE TIRE AT A TIME WITH STOCK UNIT ((7MX83)) FOUND FOUR WHEEL NOISY, CHECK OASIS (TSB 7 11 14) O,K, S,O,P, DISMOUNT TIRES AND INSTALLED NEW BANDS F	OR TPS SENSORS MOUNTED AND BALANCED, POS T ROAD TEST OK	THERE IS A CRUNCHING RUBBING TYPE NOISE WHILE DRIVING SLOW OR HIGH SPEEDS
2007 1FTPW14V37K	18-Dec-06	29-Dec-06	BOB ALLEN F	734185D 5K01 7L3Z	1007 J	B65	34	1	6-Jun-07	6	10216	1699.6	67.96	1767.6	0.8	5167	REPLACED MOUNTED AND BALANCE ALL 4 TIRES FINISH IMPERFECTIONS CLAIM SUBMISSION DELAY TO PART ON ORDER, REPLACE WHEEL, RIM, TIRES ROAD TEST VERIFY NOISE REMOVE WHEEL CK OASIS REMOVE ALL WHEELS REBAL WITH NEW WEIGHTS STILL THERE REROAD TEST CALLED HOTLINE REPLACE ALL 4 WHEELS AND SWAP TIRE SENSORS RETRAIN WHEEL SENSORS ROAD TEST N		CUST STATE THAT ONE OR MORE WHEELS ARE LOSING AIR AND FINISH ALSO
2006 1FTSW21566E	3-Mar-06	18-Nov-06	MULLINAX FC	455750BB 5K01 5C3Z	1007 DA	N25	42	1	16-Jul-07	9	11087	1838.1	184.39	2022.5	2.4	3073	ROAD TEST VERIFY NOISE REMOVE WHEEL CK OASIS REMOVE ALL WHEELS REBAL WITH NEW WEIGHTS STILL THERE REROAD TEST CALLED HOTLINE REPLACE ALL 4 WHEELS AND SWAP TIRE SENSORS RETRAIN WHEEL SENSORS ROAD TEST N		CK VIB AT 45MPH INSTALL SOP RIM
2007 4M2EU48847L	16-May-07	6-Jun-07	JACK BYRNE	353885A 5K01 6L9Z	1007 A	N50	42	1	20-Jul-07	2	2284	1991.3	394.43	2385.7	5.3	20700	WHEEL SENSORS ROAD TEST N	O NOISE	CUSTOMER STATES LOUD NOISE IN WHEEL AREA CLICKING NOISE WHEN TURNING TO LEFT LUG NUT COVER MISSING
2007 1FAFP34N77W	22-Nov-06	8-Aug-07	ULRICH MOT	11692301 5K02 6S4Z	1K011 A	B65	39	2	16-Aug-07	1	3	4.35	6.91	11.26	0.1	3457	REPLACE LUG NUT COVER		C S LEFT FT CENTER CAP IS BROKEN? CUSTOMER STATES THERE IS A VIBRATION YOU FEEL IN THE STEERING WHEEL, BRAKE PEDAL AND SEAT, FEELS IT AT ALL TIMES. IS A LITTLE WORSE WHEN AC IS ON. CHECK AND ADVISE. FINAL REPAIR ATTEMPT TC8 DRIVERS REARS TIRE SLOW LEAK ADVISE TC8 2659 336 CUST STATES ONE OF THE CAPS HAS COME OFF THE LUG NUTS
2007 1FAHP24137G	29-Jan-07	22-Feb-07	BYERLY FOR	378009A 5K02 5G1Z	1130 CA	B65	1	2	9-Aug-07	6	5530	15.05	0	15.05	0	5702	5530 REPL CENTER CAP		CUSTOMER STATES THERE IS A VIBRATION YOU FEEL IN THE STEERING WHEEL, BRAKE PEDAL AND SEAT, FEELS IT AT ALL TIMES. IS A LITTLE WORSE WHEN AC IS ON. CHECK AND ADVISE. FINAL REPAIR ATTEMPT TC8 DRIVERS REARS TIRE SLOW LEAK ADVISE TC8 2659 336 CUST STATES ONE OF THE CAPS HAS COME OFF THE LUG NUTS
2007 3MEHM08137F	3-Aug-06	21-Nov-06	DAYTONA LI	11054001 5K01 *	1007 *	D50	7	2	8-Aug-07	9	6376	0	15.13	15.13	0.2	10378	TEST VEHICLE, NO ABNORMAL CONDITION FOUND. ROAD TEST 7 MILES STILL NO ABNORMAL CONDITION FOUND. RUN OASIS. COMPARED TO 2 OTHER VEHICLES ALL OPERATE THE SAME. NO PROBLEM FOUND AT THIS TIME. VERIFIED HE	AT SHIELD WAS NOT CONTACTING FLOOR PAN PER TSB 07 11 7, VERIFIED BRAKE, FUEL, AND VAPOR LINES WERE IN THEIR	VIBRATION YOU FEEL IN THE STEERING WHEEL, BRAKE PEDAL AND SEAT, FEELS IT AT ALL TIMES. IS A LITTLE WORSE WHEN AC IS ON. CHECK AND ADVISE. FINAL REPAIR ATTEMPT TC8 DRIVERS REARS TIRE SLOW LEAK ADVISE TC8 2659 336 CUST STATES ONE OF THE CAPS HAS COME OFF THE LUG NUTS
2006 1FAHP31N96W	4-Jan-06	23-Aug-06	POWER FOR	175991D 5K02 *	1705 *	B65	42	2	24-Jul-07	12	11856	0.83	18.45	19.28	0.2	5414	11856 DAMAGE VALVE STEM 999A .2 VALVE STEM REPLACED		ADVISE TC8 2659 336 CUST STATES ONE OF THE CAPS HAS COME OFF THE LUG NUTS
2007 1FAHP34N37W	15-Aug-06	11-Oct-06	BRONDES FC	15896004 5K01 6S4Z	1012 BA	B65	33	2	12-Jul-07	10	11941	4.82	15.16	19.98	0.2	3010	REPLACED 1 LUG NUT CHECKED FOR NOISE OVER BUMPS COVERS ON STEERING STOPS LOOSE TIGHTENED		RATTLE OVER BUMPS. ADD ON WARRANTY REPAIR. CUST STATES THE LUG NUT LOST A CAP PASSENGER REAR TIRE LUG NUT CAP FELL OFF
2007 1FTWX31P07E	22-Jun-06	3-Mar-07	DAVIDSON M	094373A 5K01 *	1007 *	N58	63	2	5-Jul-07	5	7534	0	20.7	20.7	0.3	7509	9847 REPLACED LUG NUT ON DRIVERS FRT WHEEL. 10329 REPLACED 1 RIGHT REAR LUG NUT DUE TO CAP SEPERATING FROM NUT. CC. 01		RATTLE OVER BUMPS. ADD ON WARRANTY REPAIR. CUST STATES THE LUG NUT LOST A CAP PASSENGER REAR TIRE LUG NUT CAP FELL OFF
2007 1FAFP37N07W	8-Aug-06	18-Nov-06	CRESTMONT	154446B 5K01 6S4Z	1012 BA	B65	33	2	9-Jul-07	8	9847	4.82	16.11	20.93	0.2	4369	9847 REPLACED LUG NUT ON DRIVERS FRT WHEEL. 10329 REPLACED 1 RIGHT REAR LUG NUT DUE TO CAP SEPERATING FROM NUT. CC. 01		RATTLE OVER BUMPS. ADD ON WARRANTY REPAIR. CUST STATES THE LUG NUT LOST A CAP PASSENGER REAR TIRE LUG NUT CAP FELL OFF
2007 1FAFP37N07W	8-Aug-06	18-Nov-06	CRESTMONT	154658A 5K01 6S4Z	1012 BA	B65	1	2	16-Jul-07	9	10329	4.82	16.11	20.93	0.2	4369	9847 REPLACED LUG NUT ON DRIVERS FRT WHEEL. 10329 REPLACED 1 RIGHT REAR LUG NUT DUE TO CAP SEPERATING FROM NUT. CC. 01		RATTLE OVER BUMPS. ADD ON WARRANTY REPAIR. CUST STATES THE LUG NUT LOST A CAP PASSENGER REAR TIRE LUG NUT CAP FELL OFF



2007 1FAHP34N77W	2-Aug-06	24-Jul-07	PORCARO FC	81101 5K01 YS4Z	1012 BA B65 33 2	29-Aug-07	2	1776	4.61	17	21.61	0.2	6190	REPLACED LUG NUT. WPI THE RIGHT REAR WHEEL COVER WILL NOT STAY SECURED,	RIGHT REAR TIRE HAS LUG NUT CAP MISSING THE RIGHT REAR CENTER CAP WILL NOT STAY SECURED	
2007 1FAHP34N37W	3-Oct-06	25-May-07	MONACO AN	271615A 5K02 2M5Z	1130 AB B65 24 2	3-Aug-07	3	2659	14.78	7.76	22.54	0.1	8896	REPLACED, OK.	C S CENTER CAP ON LEFT REAR WHEEL FELL OUT WHILE DRIVING	
2007 1FAHP24117G	5-Jan-07	18-Jun-07	PALM COAST	4915003 5K02 5G1Z	1130 CA B65 33 2	13-Jul-07	1	3926	15.05	7.56	22.61	0.1	3326	1	REPLACED CENTER CAP	C S LEFT REAR CENTER CAP IS BROKEN ?
2007 1FAHP24117G	5-Feb-07	8-Jun-07	BYERLY FOR	379459A 5K02 5G1Z	1130 CA B65 1 2	30-Aug-07	3	1227	15.05	7.68	22.73	0.1	5702	1227 WARR REPLACED CENTER CAP VERIFIED CONCERN. LEFT REAR CENTER CAP FLEW OFF. REPLACED CENTER CAP. CAUSE:	USE SPO 07212016 CHECK CENTER CAP FLEW OFF RT REAR VALVE STEM IS SPLIT CK ALL VALVE STEMS RIGHT REAR CENTER CAP IS PEELING PART ORDERED SEE HISTORY	
2007 1FAHP24177G	6-Feb-07	28-Feb-07	LAFAYETTE I	4383351 5K02 5G1Z	1130 CA B66 33 2	7-Aug-07	6	10481	15.05	8	23.05	0.1	960	LOOSE PART. REPLACE ALL 4 VALVE STEMS SPLIT	REPLACED 4 VALVE STEMS	
2007 1FMFU17517L	21-Dec-06	8-Jan-07	PARADISE FC	1655551 5K02 *	1705 * B65 1 2	16-Jul-07	7	6561	23.52	0	23.52	0	3942	REPLACED 4 VALVE STEMS	ALL VALVE STEMS RIGHT REAR CENTER CAP IS PEELING PART ORDERED SEE HISTORY	
2007 1FAHP25137G	15-May-06	21-Jun-07	VARSITY FOI	30620401 5K02 5G1Z	1130 BA B65 D4 2	24-Aug-07	3	3637	15.05	8.51	23.56	0.1	2736	REPLACE R R CENTER CAP ASSY.	C S LF CENTER CAP CAME OFF WHILE DRIVING AND CUST COULD NOT STOP TO GET	
2007 1FAHP24197G	5-Feb-07	12-Mar-07	FRIENDLY FC	151858A 5K02 5G1Z	1130 CA B65 42 2	29-Aug-07	6	3822	15.05	8.56	23.61	0.1	2662	3822 INSTALL NEW CENTER CAP CONCERN RESOLVED NO DAMGAGE NOTED	2214 WARRANTY VERIFIED CONCERN OF MISSING LUGNUT COVER ON RIGHT WHEEL. INSTALLED NEW LUGNUT COVER CHECKED OTHER LUGNUT COVERS. ALL OK AT THIS TIME	
2007 1FAHP31N77W	30-Apr-07	13-Jun-07	LANDMARK F	670666C 5K02 6S4Z	1K011 A B65 42 2	19-Jul-07	2	2214	4.35	19.28	23.63	0.2	8559	REPLACED TWO LUG NUTS AND REPAIRED STUDS.	MISSING LUG COVER RIGHT FRONT WHEEL CUSTOMER STATES:LUG NUTS NOT TIGHTENING CORRECTLY CUSTOMER STATES DRIVERS SIDE REAR TIRE LOSES AIR	
2007 2FMDK49C87B	13-Dec-06	21-Feb-07	SARAT FORC	26686201 5K01 6L2Z	1012 BA B65 1 2	27-Jul-07	6	6495	8.62	15.13	23.75	0.2	9137	1630 REPLACED FAULTY VALVE STEM		
2006 1FTWX31566E	14-Feb-06	31-Jan-07	MATHEWS FI	238650A 5K02 5F9Z	1700 AB B65 42 2	19-Jun-07	5	1630	1.64	22.59	24.23	0.3	2265			

2006	5LMFU285X6L	2-Jun-06	28-Aug-06	LITHIA FORD	356738A 5K01 *	1007 *	A40	42	2	11-Jul-07	11	10578	0	24.79	24.79	0.3	3897	10578 TPM SENSORS NEEDED TRAINING VERIFIED TPM MESSAGE DISPLAYED IN MESSAGE CENTER. EEC DIAG. DTC B2872 (TIRE PRESSURE SENSOR FAULT) RECOVERED. SET TIRE PRESSURES TO 35PSI. MONITORED PID DATA. TIRE	PSI PIDS DISPALY 0 PSI FOR ALL 4 TIRES AND TIRE LEARN STATUS FOR ALL 4 WHEELS IS INACTIVE. PERFORMED TIRE PRESSURE SENSOR TRAINING MODE. VERIFIED TIRES READ CUSTOMER STATES WHEEL SENSOR LIGHT COMING ON ADVISE NEEDS CUSTOMER STATES THAT DRIVER FRONT TIRE IS LEAKING.
2007	1ZVFT84N775	7-Mar-07	3-Apr-07	LONG-LEWIS	40842401 5K02 *	1705 *	B65	D1	2	18-Jun-07	3	3199	1.4	23.85	25.25	0.3	225	REPLACED RIGHT FRONT VALVE STEM 1048 ALIGNMENT IN SPECS. CROSS ROTATED FRONT TIRES, VERIFIED TIRE PRESSURS, AND ROAD TESTED. UNABLE TO VERIFY ANT PULL AT THIS TIME. FOREMAN ROAD TESTED VEHICLE WITH NO OCCURANCE OF CONCERN PRESE	NT. NOTED TYPICAL TORQUE STEER ON ACCELL, NO REPAIR FOR THIS CHARACTERIST IC.
2007	1FAFP34N67W	30-Apr-07	1-Jul-07	BOWEN SCA	260246C 5K01 *	1015 *	H26	W6	2	23-Jul-07	1	1403	0	25.61	25.61	0.3	8588	COND CODE 42 (1A108) CHECK OUT CONCERN ROAD TEST HEARD NOISE IN FRONT CENTER CAP LOOSE ON WHEELS RE MOVED RIGHT FRONT TAPE FOAM FROM SQUEAK AND RATTLE KIT, RE ASSEMBLE ROAD TEST RE CHECK OK NOW.	CUSTOMER STATES THE VEHICLE STILL PULLS RIGHT WORSE UNDER LOAD
2007	1FAHP37N07W	21-Nov-06	10-Apr-07	MULLAHEY F	17945101 5K01 *	1A108 *	N50	42	2	21-Jun-07	3	3082	0	25.73	25.73	0.3	7944	10187 HUBCAP FELL OFF MISSING REPLACED MISSING HUBCAP 4619 N C REPLACED R FR. CANERCAP THAT WAS FLAKING DURING ABOVE REPAIR. TECH	CUSTOMER STATES THERE IS A CLICKING TYPE NOISE FROM WHEELS POSSIBLY FRONT. (B65)
2006	1FMZK01196G	28-Nov-05	9-Aug-06	NORTHGATE	138482A 5K02 4F9Z	1130 AA	B65	33	2	4-Jun-07	10	10187	17.51	8.41	25.92	0.1	2663	2409	F06 RT FT WHEEL COVER CHROME PEELING CHROME PEELING ON RIGHT REAR CENTER CAP
2008	1FTSW21R18E	27-Feb-07	31-Mar-07	PAYTON-WR	487421F 5K02 7C3Z	1130 B	F06	70	2	25-Jun-07	3	4602	26.03	0	26.03	0	2413	2409	CUSTOMER STATES THE LEFT FRONT TIRE LEAKS FROM THE STEM, TIRE IS IN THE BED NOW
2007	1ZVFT80N275	8-Aug-06	19-May-07	BOB GILLING	155947A 5K02 5R3Z	1130 B	B65	5	2	8-Jun-07	1	1405	18.56	7.9	26.46	0.1	2199	VERIFIED REPLACE RIGHT REAR CENTER CAP	
2007	1FTPX14557F	28-Aug-06	21-Dec-06	PALM SPRING	167191B 5K02 *	1700 *	B65	D8	2	21-Aug-07	9	11979	0.62	26.61	27.23	0.3	5574	R & I LEFT REAR TIRE FOR ACCESS TO REPLACE LEAKINGVALVE STEM,RETEST OK	

2007	1FMYU02Z87K	11-Dec-06	29-Mar-07	BEECHMONT	360122D 5K01 *	1015 *	N51	33	2	5-Jul-07	4	3324	0	29.86	29.86	0.4	2058	3338 LOOSE JACK IN COMPARTMENT I VERIFIED THE NOISE AND FOUND THAT THE JACK IN THE COMPARTMENT IS LOOSE AND NEEDED TIGHTENED UP I DID AND DROVE ALL OK NOW NO MORE CONNCER S PRESENT	CUSTOMER STATES WITH SOMEONE SITTING IN THE BACK RIGHT HAND SIDE OF SEAT , CNA HEAR A SHOCK TYPE NOISE GOING ABOUT 40 MPH.DOES NOT KNOW IF NORMAL OR NOT
2007	1FAHP24137G	22-Sep-06	31-May-07	BYERLY FOR	378259A 5K02 5G1Z	1130 CA	B65	1	2	14-Aug-07	3	324	30.1	0	30.1	0	5702	324 REPL 2 CENTER CAPS	C S LEFT FT AND RT REAR CENTER CAPS ARE BROKEN? CUSTOMER REPORTS CENTER CAP AT RF WHEEL HAS FALLEN OFF
2007	1ZVHT85H375	1-Aug-06	4-Feb-07	FUTURE FOF	101738A 5K02 5R3Z	1130 B	B65	33	2	7-Aug-07	7	5669	18.56	11.95	30.51	0.1	4058	REPLACED CAP; RECHECK NORMAL. VERIFIED CUSTOMER CONCERN PERFORMED DIGITAL IMAGING AND RETRIEVED AUTHORIZATION TO REPLACED WHEEL CENTER COVER AUTHORIZATION CODE PAAUT REMOVED AND REPLACED CENTER WHEEL COVER AND VERIFIED REPAIR	CUSTOMER STATES THE RIGHT FRONT WHEEL COVER CENTER PIECE FELL OFF
2006	1ZVFT82H165	18-May-06	27-Nov-06	CHAPMAN FC	15349201 5K02 6R3Z	1130 E	B65	42	2	4-Jun-07	7	6122	23.7	7.46	31.16	0.1	3955	REPLACED CAP; RECHECK NORMAL. VERIFIED CUSTOMER CONCERN PERFORMED DIGITAL IMAGING AND RETRIEVED AUTHORIZATION TO REPLACED WHEEL CENTER COVER AUTHORIZATION CODE PAAUT REMOVED AND REPLACED CENTER WHEEL COVER AND VERIFIED REPAIR	LEFT FRONT HUB CAP FLEW OFF WHILE DRIVING
2007	1FAFP34N97W	18-Dec-06	24-Mar-07	BEAVERTON	044691A 5K02 6S4Z	1130 A	B65	33	2	15-Jun-07	3	2760	22.54	9.21	31.75	0.1	8729	INSTALL RIGHT FRONT HUBCAP	CUSTOMER STATES CENTER CAP WILL NOT STAY ON
2006	1ZVFT80N465	16-May-06	13-Nov-06	HARBIN MOT	155199A 5K02 4R3Z	1130 FA	B65	7	2	18-Jul-07	9	6041	25.93	6.64	32.57	0.1	378	R*R CENTER CAP	CUSTOMER STATES HEAR NOISE FROM L REAR WHILE DRIVING
2007	1ZVHT85H775	10-Apr-07	17-Jul-07	VISTA FORD	017416B 5K02 6R3Z	1130 E	N51	D4	2	28-Jul-07	1	506	23.7	9.08	32.78	0.1	7923	506 INSTALLED LR HUB CAP DIAGNOSE NOISE CONCERN. TEST DRIVE. BRING IN ON HOIST AND INSPECT. FOUND HUB CAP OUT OF ALIGNMENT. REPOSITION HUB CAB. TEST DRIVE OK	INSTALL SOP
2007	1FTSW21P67EA	10-Aug-06	16-Apr-07	ULRICH MOT	11664301 5K02 *	1130 *	B65	7	2	8-Aug-07	4	2749	0	34.57	34.57	0.5	3457	CC: D9 OUT OF BALANCE ROAD TESTED NVH DIAGNOSIS BALANCED ALL FOUR TIRES ROAD T TESTED OK	INTERMITTENT NOISE LEFT FRONT WHEEL
2007	1FMCU04167K	29-Jun-06	25-Sep-06	HUB CITY FC	11387701 5K01 *	1015 *	C50	D9	2	13-Aug-07	11	10895	0	36.49	36.49	0.5	6481	CHECK TIRES FOR LEAKS FOUND BOTH FRONT TIRES LEAKING AROUND RIM BROKE DOWN TIRES RESEALED AND REBALANCE	CUSTOMER STATES AT HIGHWAY SPEEDS YOU CAN FEEL VIBRATION IN THE STEERING WHEEL
2007	1FAHP24137G	26-Sep-06	5-Apr-07	BOB GILLING	157894C 5K01 *	1007 *	B65	42	2	7-Aug-07	5	7577	0	39.5	39.5	0.5	2199	ROAD TESTED AND VERIFIED CONCERN. PINPOINTED NOISE TO BE COMING FROM THE RIGHT FRONT. REMOVED WHEEL COVER AND INSPECTED. FOUND 1 PIECE OF HARD RUBBER TAPE WAS MISSING. CHECKED OASIS AND FO	CK TIRE PRESSURES FRONT LOOK LOW
2006	3FAFP07Z26R	13-Jun-06	30-Aug-06	PARR FORD,	18596001 5K02 7E5Z	1130 A	B65	42	2	30-Jul-07	12	9940	22.75	17.05	39.8	0.2	8606	MISSING. CHECKED OASIS AND FO	CUSTOMER STATES FRONT RIGHT WHEEL SQUEAKS WHILE DRIVING AT LOWER SPEEDS



2007	2MEFM74V37X6	30-Mar-07	4-May-07	TASCA FORC	444960E 5K02 3W3Z	1130 CA B65 33	2	26-Jul-07	3	2561	45.4	8.7	54.1	0.1	796	2561 HUB CAP NG CAP NG CENTE CAP TO FALL OUT .1 VERIFIED CONCERN REPLACED CENTER CAP AND FOUND THAT NEW CAP FELL OUT ALSO INSP HUB CAP FOUND TO BE NG REPLACED HUB CAP AND RECHECK WAS OK	CUST, STATES THE RT FRONT CENTER CAP KEEPS FALLING OFF AND CUST REPLACED IT ALREADY WITH 1 AND THA . CUSTOMER STATES THERES A VIBRATION AT OR ABOVE 60 MPH PLEASE CK AND ADVISE CHECK FOR A NOISE WHEN SLOWING DOWN FOR A STOP LIGHT OR STOP SIGN AND THEN AT IDLING,USUALLY WITH FOOT ON BRAKE BUT NOT ALWAYS
2007	3FAHP08Z87F	25-Sep-06	22-May-07	AUSTIN FORI	146501 5K01 6E5Z	1007 BA N25 D9	2	21-Aug-07	4	4890	0	56.11	56.11	0.8	9300	TEST DROVE BALANCED ALL 4 TIRES	C S RT REAR CENTER CAP FELL OFF
2006	1FTRE14W06D	8-Sep-06	28-Oct-06	GRIFFIN FOF	012807B 5K01 *	1007 * N12 42	2	30-Jul-07	10	8443	0	57.02	57.02	0.7	6360	TEST DRIVE AND DIAGNOSIS FOR NOISE AND NEUTRALIZE MOTOR AND RETEST NOISE GONE	CUSTOMER STATES VIBRATION AT ABOUT 55MPH THAT YOU CAN FEEL IN THE STEERING WHEEL
2007	2FAHP71W37X	27-Apr-07	23-Jul-07	BLUEBONNE	48107002 5K02 3W7Z	1130 BA B65 42	2	20-Aug-07	1	2899	56.08	8.39	64.47	0.1	4570	8134 WHEELS OUT OF BALANCE VERIFIED CONCERN NOT BRAKE RELATED, RAISED VEHICLE AND REMOVED WHEELS FOUND WHEELS OUT OF BALANCE, LF 1.50, RF 1.00, LR 2.00, RR .75. REBALANCED WHEELS AS NEEDED, RETESTE D, PASS.	CUST STATES ALL 4 CENTER CAPS ARE FLAKING & PEELING CUSTOMER STATES BOTH REAR WHEEL COVERS CHROME FINISH IS CRACKING AND PEELING
2006	1FTPW14566K	28-Nov-05	28-Oct-06	LITHIA FORD	361075A 5K01 *	1007 * N24 42	2	20-Aug-07	10	8131	0	66.11	66.11	0.8	3897	TECH INSPECTED FOR WHEEL CENTER CAPS CONCERN & VERIFIED & WENT THROUGH DIGITAL IMAGE SYSTEM & WAS APPROVED #PAAKR TECH REPLACED ALL 4 CENTER CAPS AS NEEDED	EST TO VERIFY REPAIRS. STEERING WHEEL NIBBLE GONE SUPPLIED CUSTOMER WITH ROADFORCE BALANCE DATA SHEETS FOR VEHICLE.
2007	4M2CU97147K	1-Sep-06	10-Jan-07	NICK MAYER	15429704 5K02 5E6Z	1130 AA B65 42	2	16-Jul-07	7	5304	52.02	17.04	69.06	0.2	10705	WHEEL COVERS WHEEL RING HUB CAP WHEEL COVER REPLACE	CUST STATES GETTING VIBRATION FROM FRONT TIRES WHILE DRIVING WAS TOLD FRONT TIRES HAVE FLAT SPOTS
2006	2MEFM74V96X	1-Feb-06	19-Apr-07	ELMHURST L	6330151 5K02 5W3Z	1130 DA B65 1	2	5-Jun-07	2	1527	49.41	19.95	69.36	0.2	13660	TIRES ROAD FORCE BALANCED FOUND EXCESSIVE WEIGHT REQUIRED TO REBALANCE R F TIRE. BALANCED ALL 4. ROADFORCE MACHINE SHOWS NO INDICATION OF FLAT SPOTS, CUPPING OR CHOPPINESS CHECKED RUNOUT OF DR ROAD T	VEHICLE.
2007	1FTPX14577F	8-Jan-07	19-Jun-07	LEGACY FOF	10349302 5K01 *	1007 * N24 D9	2	21-Aug-07	3	3541	0	72.53	72.53	1	585		

2007	1FMYU59HX7K	3-Nov-06	30-Jan-07	SUNRISE FO	290306A 5K01 *	1007 *	B65	42	2	8-Aug-07	7	4768	0	72.81	72.81	0.8	5453	ROTATE TIRES CHECK BRAKES	ROTATE TIRES AND CHECK BRAKES C S THAT THE VEHICLE STARTED AND DIED AND WOULD NOT RESTART NO CRANK
2008	1FMCU49H88K	5-Apr-07	24-Apr-07	GRIFFIN FOF	011867A 5K01 *	1100 *	D02	42	2	9-Jul-07	3	2000	0	73.32	73.32	0.9	6360	CHARGED AND LOAD TEST BATTERY WITH ROTUNDR CHARGER PASS CHECKED CHARGING SYSTEM OK	CUSTOMER STATES THE TIRE PRESSURE LOW LIGHT IS ON AGAIN WHEN YOU APPLY BRAKES THE STEERING WHEEL SQUEAKS 3 OF THE CENTER CAPS HAVE FALLEN OFF AT DIFF TIME AND NOW THE 4TH ONE IS CRACKED, DZ INSPECTED
2006	4M2CU56196K	17-Oct-05	24-Aug-06	MCCOTTER F	208593A 5K01 *	1007 *	L29	42	2	25-Jun-07	11	5124	0	74.33	74.33	1	4944	5139 42 TIRE LIGHT ON W SELF TEST SYSTEM PASS INSTALL WDS AND MONITOR PIDS. REPROGRAM WHEEL SENSORS. RUN OASIS FOUND VIBES IN WHEEL AT 50MPH CHECKED AND BALANCED TIRES AND PUT BEST ON FRONT	
2007	1ZVFT80N475	2-Feb-07	19-May-07	THORNHILL F	083510B 5K01 *	1007 *	B43	42	2	9-Jun-07	1	1176	0	75.92	75.92	1	6844	RETESTED ALL OK	
2007	1FAHP27177G	4-Jan-07	24-Feb-07	ATCHLEY FO	36765401 5K02 5G1Z	1130 CA	B65	42	2	23-Jun-07	4	6511	60.2	15.8	76	0.2	7130	6 26 07, AT 6602 MILES INSTALLED ALL 4 CENTER CAPS	
2007	1FTNE14W47D	1-Dec-06	17-Jul-07	SANTA MARC	360499A 5K01 *	1007 *	N27	30	2	21-Jul-07	1	145	0	76.86	76.86	0.8	1597	148 C 1007 CC 30 1007D3T .8 TECH 449 080 TEST DROVE VEHICLE VERIFY VIBRATION CONCERN.SPIN BALANCED FRONT AND REAR TIRES OUT OF BALANCED CAUSE VIBRATION, SET TIRE PRESSURE. REROAD TEST VEHICLE OPER 6337 ROTATED AND BALANCED TIRES DUE TO TIRES BEING OUT OF BALANCE WHEN SENT FROM FACTORY TIRES WERE OFF BALANCE IN EXCESS OF 1 OZ ON ALL 4 TIRES	ATING AS DESIGNED AT THIS TIME FLAG OF SHIMMY IN FRONT WHEELS
2007	1FTPW14V77F	16-Jan-07	29-Mar-07	COOK-WHITE	013594B 5K01 *	1007 *	N25	D9	2	14-Aug-07	5	6337	0	77.62	77.62	1.1	4910		WHILE DRIVING HWY SPEEDS HAS A VIBRATION,MAY NEED BALANCE CUSTOMER STATES: THE CENTER CAPS WILL NOT STAY ON CLIPS KEEP BREAKING OFF THE BACK. SEEMS LIKE THE CENTER CABS ARE HEATING UP AND MELTING THE TABS AND BREAKING. ADVISE.
2007	1FAHP24177G	31-Jan-07	15-Feb-07	SUNSET AUT	3812603 5K02 5G1Z	1130 CA	B65	1	2	8-Aug-07	6	11926	60.2	19.32	79.52	0.2	8198	1130 CC 01 INSPECTED & REPLACED CENTER CAPS CONFIRMED CONCERN.ADJSUTED TIRE PRESSURE AND CH ECKED FRONT END,WAS TIGHT.PERFORMED ALIGNMENT O N FRONT END,ROTATED TIRES.RETESTED OK.	CUSTOMER STATES THE TIRES ARE WEARING ON THE INSDIE EDGE PULLS HARD TO THE LEFT
2007	1FTRF12W37N	20-Feb-07	18-Apr-07	CLAIR FORD	256788A 5K01 *	1007 *	TB7	7	2	12-Jun-07	2	6049	0	79.78	79.78	1.1	8814	CROSS SWITCH TIRES AND ROAD TEST 10 MILES	
2008	1FTSW21R68E	2-Apr-07	7-Jul-07	KINDLE FORI	32149701 5K01 *	1007 *	H25	7	2	24-Jul-07	1	1078	0	84.69	84.69	1	1237		

2007 1FTPW14VX7	6-Sep-06	6-Jan-07	MAXWELL FC	789297A 5K01 *	1007 *	G29	42	2	9-Jun-07	6	1915	0	91.85	91.85	1.1	2923	1915 EEC TEST HAD CODE FOR RIGHT FRONT TIRE CHECK TIRE PRESSURES RF LOW FOUND VALVE STEM CRACKED REMOVED TIRE AND INSTALLED NEW STEM MOUNT AND BALANCE TIRE RETEST OK DONE	C S TIRE PRESSURE LIGHT ON & PASSENGERSIDE TIRE LEAKING
2007 1FAHP24157	29-Nov-06	3-Aug-07	JACK SCHMI	090023A 5K01 *	1007 *	N24	82	2	8-Aug-07	1	301	0	97.54	97.54	1.1	8193	CHECK VIBRATION AT HIGHWAY SPEEDS.4 TIRES.ADDED 1 2 OZ OF STATIC WEIGHT TO RIGHT FRT TIRE AND 1 2 OF DYNAMIC WEIGHT TO LEFT REAR.ROAD TEST AGAIN. ROAD TESTED, VERIFIED VIBRATION AT HWY SPEEDS, SUBLET REPAIR TO BALANCE ALL TIRES.	CHECK VIB HWY SPEEDS
2007 1FTPW14V97K	23-Mar-07	22-Jun-07	GRANDE TRI	090464A 5K01 *	1007 *	N25 D9	2	28-Jun-07	1	553	5.6	100	105.6	0	4569	6762 INSPECTION REPLACE ALL 16 LUG NUTS ALL CAPS FELL OFF	CHECK VIB IN TRUCK 50 MPH CUSTOMER STATES MISSING LUG NUT COVERS CUST STS THE PAINT ON LEFT REAR AND RIGHT FRONT CENTER CAPS ARE PEELING XX SOP C S STEERING WHEEL VIBRATES WHILE DRIVING CUSTOMER STATES THAT ALL HUBCAPS ARE YELLOW TINGED POSSIBLE TO SUN DAMAGE, WOULD LIKE REPLACED, CK & ADV	
2007 1FAHP34N97W	9-Aug-06	10-Mar-07	JOHN LANCE	148222B 5K01 6S4Z	1012 BA	B65	42	2	20-Aug-07	6	6762	67.42	43.3	110.72	0.5	2284	3973 PAINT PEELING OFF CENTER CAPS INSTALL SOP VERIFIED CONCERN R&R CENTER CAPS X INSTALLED SOP CAPS VERIFY COMPLAINT.RAN DIAG.CK RUN OUT. BALANCE ALL TIRES & TEST DROVE OK.	CUSTOMER STATES MISSING LUG NUT COVERS CUST STS THE PAINT ON LEFT REAR AND RIGHT FRONT CENTER CAPS ARE PEELING XX SOP C S STEERING WHEEL VIBRATES WHILE DRIVING
2006 2MEHM75V16X	10-Feb-06	6-Sep-06	HOLMAN FOI	217074A 5K02 3W3Z	1130 AA	B65	30	2	13-Jun-07	10	3973	97.84	17.07	114.91	0.2	2848	MT TIME TO REMOVE 4 TIRES & WHEELS TO REPLACE 4 HUBCAPS AND PLASTIC TRIM NUTS DISCOLORED APPROVAL #PAAKN	TO WHEEL MATCHING PROCEDURE VEHICLE HAS TO HAVE A 10 MILE WARM UP PERIOD FOR THE TIRES TO PERFORM TO SPEC.
2007 1FTPX12507K	6-Nov-06	31-Jan-07	LA PLACE FC	7113602 5K01 *	1007 *	N23 D9	2	19-Jun-07	5	3859	0	126.41	126.41	1.7	4127	CP:1007 CODE D1 ROAD TSET TO VERIFY TIRE VIBRATION MEASURED TIRE & WHEEL RUNOUT & ROAD FORCE VARIATION ALL TIRES WITHIN SPECS BALANCED WHEELS & PERFORMED HUB	SUSPENSION/BRAKE S C/S VEHICLE SHAKES BAD WHILE DRIVING 68 73 MPH STATES TIRES HAVE BEEN BALANCED AT ANOTHER DEALER ADVISE C50 OVER BUMPS OR DIPS FRONT END SQUEAKING NOISE ALSO WHEN TURNING AT TIMES CLUNKS ADVISE C50 CAR SHAKES AT HIGHWAY SPEEDS ADVISE	
2007 1FAHP34NX7W	23-Oct-06	18-Jul-07	PHIL LONG F	78177901 5K02 6S4Z	1130 B	B65	81	2	20-Jul-07	1	225	90.16	44.95	135.11	0.5	3140	11236 NVH DIAG FOUND RT LOWER CONTROL ARM LOOSE 1007D 0.7 3078A 0.6 3001A 0.4 1.7 RETORQUE RT LOWER ARM CHECK ALIGNMENT TEST DROV 8925 W CK SHAKES NVH TIME TO DIAG CK ROADFORCE BALANCE REROADFIRCE BALANCE 4 TIRES	CUSTOMER STATES CHECK ALL WHEEL COVERS ARE PEELING P I
2007 1FTPW14V87K	6-Sep-06	31-Jan-07	MONTGOMEI	3558101 5K01 *	1007 *	N24	13	2	18-Jun-07	5	5562	0	142.52	142.52	1.9	6309	REPLACED ALL 4 CENTER CAPS FOR PEELING	
2006 1FMDK02116G	2-Mar-06	5-Sep-06	POWER FOR	176682F 5K01 *	1007 *	C50	33	2	7-Aug-07	12	11236	0	147.58	147.58	1.6	5414		
2007 3FAHP07Z17F	18-Nov-06	10-Feb-07	NORTH BRO	205528B 5K01 *	1007 *	C50	7	2	13-Aug-07	7	8925	0	147.9	147.9	1.7	2975		
2007 1LNHM82V27Y	8-Nov-06	11-Apr-07	DICK BARKEI	121094A 5K02 6W1Z	1130 BA	B65 D4	2	7-Aug-07	4	2381	166.6	7.57	174.17	0.1	12210			

2007 1FTRF12207N	1-Mar-07	20-Apr-07	MAXWELL FC	789425A 5K01 *	1007 *	N24 42 2	11-Jun-07 2	6320	0	183.7	183.7	2.2	2923	6336 REINDEX TIRES, DISMOUNTED 3 TIRES REMOUNTED, REBALANCED TIRE ROADFORCED, TEST DROVE T1021	C S TRUCK VIBRATES WHILE DRIVING AT HWY SPEEDS CUSTOMER STATES NOISE IN WHEEL AREA	
2007 1FTWW31P57E	21-Nov-06	17-Feb-07	JACK BYRNE	354540A 5K02 5C3Z	1130 PA	B65 33 2	3-Aug-07 6	7867	171.2	14.88	186.08	0.2	20700	SSM 19673 PAAFT CHECK AND REPLACE HUBCAPS 42705 CONDITION D1 PERFORMED LEAK CHECK FOUND AIR LEAKING THROUGH RIM. REPLACED RIM AND RECHECKED.	C S LEFT FRONT RIM IS DEFECTIVE WILL NOT SEAL PROPERLY.....B65	
2006 3FRNF65F86V	21-Mar-06	16-Jun-06	GATOR FORI	091460A 5K01 4C4Z	1007 BB	B65 D1 2	24-Jul-07 14	42705	131.82	55.74	187.56	0.7	4917	4813 TIRES OUT OF BALANCE 42 NVH DIAG,CHECK RUN OUT OF TIRES,ROAD FORCE BALANCE,RE INDEX ALL,RE BALANCE ALL,INDEX ON VEHICLE,ROAD TEST OK VEHICLE RIDES FINE	VEHICLE VIBRATES WHEN DRIVING OVER 45 MPH	
2007 1FTPW14V57K	12-Mar-07	25-May-07	MAXWELL FC	793180A 5K01 *	1007 *	N25 42 2	26-Jul-07 3	4798	0	200.4	200.4	2.4	2923	T1340 VERIFIED CUSTOMER CONCERN. CLEAR COAT HAD PEELED OFF RIM RECEIVED PRIOR APPROVAL FROM DIGITAL IMAGING AND REPLACED THE RIM	CUSTOMER STATES TO REPLACE RIM C S THAT THE RIGHT REAR WHEEL HAS DENT IN IT.	
2008 2MEHM75V68X6	31-May-07	30-Jun-07	CAMPBELL F	029634A 5K01 7W3Z	1007 A	F38 81 2	12-Jul-07 1	1140	202.6	21.49	224.09	0.3	2744	REPLACED WITH NEW WHEEL CHECK FOR NOISE, VERIFY CONCERN CONNECT CHASSIS EARS. NOISE COMING FROM LEFT FRONT WHEEL REMOVE BRAKE ASSY, REMOVE KNUCLE, REMOVE STRUT FOR ACCESS REPOSITION BACKING PLATE, SECURE , RE ASSEMBLE ST	CUST STATES FT END OF VEHICLE MAKING A GRINDING NOISE WHILE DRIVING AND GETS LOUDER WHEN BRAKING. CHECK AND ADVISE	
2008 1FTNX20508EB	30-May-07	13-Jun-07	JOE SARTAIN	24185301 5K01 5C3Z	1015 MA	B65 34 2	18-Jun-07 1	462	222.67	13.86	236.53	0.2	5732	1	RUT KNUCLE AND ROTOR, RE TEST NO MORE NOISE HERD AFTER REPAIR STEM. SET AT 32 PSI. ONE LUG NUT LOOKS LIKE IT MIGHT HAVE BEEN DROPPED DURING ASSEMBLY. LUG NUT NOT IN STOCK.	CUST SAYS CHROME FINISH FLAKING ON LEFT REAR WHEEL PART IS HERE
2008 1FMCU03158K	26-Apr-07	2-Jun-07	FRITTS FORI	9653451 5K01 *	1007 *	N50 33 2	7-Jun-07 1	358	0	268.12	268.12	3.1	5557	4081 PAAZV CP#1007, CC#34 CONFIRMED CONCERN. FOUND RIM NEAR LUG NUT OPENING PEELING FLAKING. RAN OASIS. DISMOUNTED TIRE FROM OLD RIM. MOUNTED AND BALANCED OLD TIRE ON NEW RIM, INSTALLING NEW VALVE		
2007 2FMDK39C07E	20-Oct-06	24-Mar-07	WALNUT CRI	535019A 5K01 7T4Z	1007 F	B65 D4 2	6-Jun-07 3	4081	283.48	34.76	318.24	0.3	7820	LOAD FORCE TIRES FOUND RIGHT REAR RIM OUT OF ROUND REPLACE RIGHT REAR RIM INSTALL NEW LOW TIRE PRESSURE STRAP APP CODE PAAAX	VEHICLE HAS A VIBRATION AROUND 60 MPH	
2007 1FTYR11U27	29-Nov-06	14-Dec-06	JARRETT-GC	10856102 5K01 YL5Z	1015 BA	N25 13 2	11-Jun-07 6	1482	272.13	50.91	323.04	0.7	3781	733 DID ROAD FORC WHEELS TIRES RT FRT BAD WHEEL HAD TO ORDER 1 RT FRT 56 RT REAR 11 LEFT FRT 5 LEFT REAR 12	N25 VIBRATION ABOVE 45 MPH PE08-060 1466	
2007 1FMFU20547L	4-May-07	24-Jul-07	GOLDEN CIR	224679A 5K01 7L1Z	1007 D	N25 D9 2	16-Aug-07 1	733	248.71	77.62	326.33	1.1	5885			



2007 2FMDK38C57E	██████████	11-Jun-07	27-Jul-07	VARSITY FOF	30436601	5K01	7T4Z	1007	F	B65	D4	2	30-Jul-07	1	316	326.57	59.6	386.17	0.7	2736	RIGHT REAR WHEEL CROME BUBBLING UP CODE 42 REPLACED RIGHT REAR WHEEL AND TIRE PRESSURE SENCER BAND ENDING MILES 316 8634 MOUNTED NEW RIM ON RIGHT FRONT. SWAPPED SENSOR FROM OLD RIM TO NEW RIM	THE PASSENGER SIDE REAR RIM IS STARTING TO BUBBLE DI AUTH CODE PAAJW	
2007 1FTRW12567F	██████████	21-Sep-06	24-Nov-06	DAHL FORD I	150464A	5K01	7L3Z	1007	H	B65	D4	2	20-Jul-07	8	8634	355.52	56	411.52	0.7	6209	DIFFERENT CASUAL PART BAD WHEEL L REAR PART 1007 CODE 42 R TESTED PINPOINTED NOISE TO LEFT REAR WHEEL AREA. WHEEL IS MAKING NOISE. ORDERED WHEEL AND BAND..... REPL LEFT REAR WHEEL, SENSOR BAND AND VALVE STEM, LANCED	CUSTOMER STATES THE RIGHT FRONT WHEEL PEELING	
2007 1FMEU75E57U	██████████	21-Feb-07	18-May-07	SUNSET AUT	3702501	5K01	7L2Z	1007	E	C50	42	2	18-Jul-07	3	3202	348.9	67.62	416.52	0.7	8198	MOUNTED BA	.....NOISE CORRECTED. E	CUSTOMER STATES THAT THERE IS A NOISE COMING FROM THE LEFT REAR ON RIGHT TURNS C50 CUSTOMER STATED RT FRONT WHEEL HAS CHROME DEFECT
2007 1FTPX14V77F	██████████	30-Jan-07	21-Feb-07	BROADWAY	17249001	5K01	7L3Z	1007	J	B65	5	2	17-Jul-07	5	9101	427.84	25.25	453.09	0.3	3850	REPLACE RF RIM MOUNT AND BALANCE TIRE 776 CC 42 REMOVED TIRE REMOVED RIM, INSTALLED NEW TIRE, ON NEW RIMT BALANCED	LEFT REAR RIM CROME PLATING IS FLAKING OFF DRIVERS SIDE FRT AND DRIVERS SIDE REAR WHEEL HAS MARKS IN IT SOME CLEARCOAT COMING OFF.	
2007 1FTPW14V37F	██████████	8-May-07	27-Jul-07	NORTH BRO:	205871A	5K01	7L3Z	1007	J	B65	D4	2	17-Aug-07	1	776	425.47	43.5	468.97	0.5	2975	TIRE	CHECK SPARE TIRE UOTSIDE EDGE IS PEELING BOTH REAR WHEELS ARE CORRODED AROUND CENTER CAP	
2007 1FAFP38Z47W	██████████	17-Oct-06	15-Aug-07	DONLEY FOF	50913701	5K01	5S4Z	1007	BA	B65	81	2	14-Aug-07	0	358	442.76	35.42	478.18	0.5	8287	DI AUTH NUMBER PAAHZ REPLACED BOTH DRIVERS SIDE FRT AND REAR WHEELS.		
2007 1FTWF31P07E	██████████	14-May-06	31-May-07	TASCA FORC	438815D	5K01	5C3Z	1007	LA	B65	D4	2	11-Jun-07	1	502	473.54	34.8	508.34	0.4	796	502 REPLACE SPARE TIRE RIM APPRV PAAHX		
2007 1ZVFT80N0752	██████████	28-Sep-06	28-Feb-07	BOB GILLING	157209A	5K01	7R3Z	1007	E	B66	42	2	17-Jul-07	5	6424	470.68	86.9	557.58	1.1	2199	REPLACE BOTH REAR WHEELS AND TRANSFERED TPM SENSORS TO NEW WHEELS		
2006 3FRWX65EX6V2	██████████	16-May-05	12-Sep-05	RUSTY ECK I	32460004	5K01	4C4Z	1007	DA	N25	42	2	5-Jul-07	23	90283	338.38	225.28	563.66	1.4	5319	CHECKED FRONT WHEEL BEARINGS AND FOUND THEY ARE A LITTLE LOOSE. ADJUSTED FRONT WHEEL BEARINGS. SPUN THE WHEELS AND CHECKED FOR WHEELS WOBBLING. ABOUT 1 8 OF WOBBLE. JACKED UP THE REAR AND CHECKED WH	EEL BEARINGS AND THEY WERE OK. THE WHEELS WOBBLLED ON THE REAR ALSO. RAN THE TRUCK ON JACK STANDS AND WITH THE WHEELS AND DRUMS OFF TO CHECK THE	
2007 5LTPW18567F	██████████	5-Sep-06	3-Apr-07	NORTH SHOI	181788A	5K01	7L7Z	1007	K	B65	55	2	12-Jun-07	3	3500	582.61	25.19	607.8	0.3	10004	REPLACED WHEEL RETSTED OK	REPAIR FOR THE TRUCK SHIMMING AT 65 70 MPH TIRES HAVE BEEN BALANCED AND THE FRONT ALIGNED C S CHROME IS PEELING FROM DRIVERS REAR WHEEL	
2007 1FAHP24177G	██████████	20-Nov-06	25-Apr-07	IMLAY CITY F	2083025	5K01	7G1Z	1007	A	B65	D4	2	31-Jul-07	4	3037	570.89	42.53	613.42	0.5	2672	REPLACED WHEELS FOR PITTING APPROVAL PAAVU	CUSTOMER STATES SPOTS ON WHEELS	

2008	1FTWW31R78E	25-May-07	HENRY DAY	81242601	5K01	7C3Z	1015	E	B65	12	2	12-Jun-07	-1	4	644.03	51.28	695.31	0.6	3030	VERIFIED CONCERN RIMS HAVE A LIP THAT PREVENT CENTER CAPS FROM ATTACHING TO LUG NUTS 1758 R AND R REAR TWO TIRES REPLACED RIMS MOUNT AND BALANCED TWO REAR TIRES QUALITY CHECKED	VEHICLE CAME FROM FACTORY WITH TWO REAR RIMS THAT HAVE A LIP WHICH ARE PREVENTING CENTER CAPS FROM INSTALLING	
																				STOPS IN HE FRONT BUT SITLL HEAR ON HE RIGHT REAR WHEEL REMOVE BOTH RIGHT SIDE WHEELS AND TRANFERR WHELL AIR		
																				MING FROM THE L/F WHEEL AREA PLATIC WHEEL CAPS MAKING NOISED WHEN WH EEL IS ROTATING TEST DROVE VEHIC;E VISUALLY INSPECT HUB AND ROTIONAL WHEEL PARTS PUT SPARE TIRE ON FRON WHEEL AND THE NOISE	PRESSUR ESNSOR USING NEW SRAPS INSTALL NEW VALVE STEM ON BOTH RIMS AND SWITHC OVER TIRE BA	CLIENT STATES WHEN MAKING A RIGHT TURN THERE IS A CLICKING NOSIE CO
2007	1FMEU75817U	28-Mar-07	29-Apr-07	MOSSY FORI	16021401	5K01	7L2Z	1007	E	N50	42	2	4-Aug-07	4	3604	702.72	254.79	957.51	2.9	5428		CUSTOMER STATES ON ROAD TEST THERE WAS A VEBRATION AT 45 MPH
																						C S ALL FOUR WHEELS ARE PEELING THE CLEAR COAT SOP IN C S THE TOPCOAT ON THE WHEELS IS PEELING C STS CK FOR CORROSION ON CENTER CAPS
2007	1FTRX14W97F	8-Aug-06	19-Jun-07	EMERLING F	6616151	5K01	7L3Z	1015	B	N25	2	2	8-Jun-07	0	31	844.26	122.33	966.59	1.7	572	VERIFIED CONCERN AND PERFORMED DIAGNOSIS, REPLACED ALL WHEELS AND AIR MONITORING BANDS	
																						PEELING CONFIRMED CONCERN, FOUND ALL 4 WHEELS PITTING. REPLACED ALL WHEELS & BALANCED. 4881800
2007	1FMEU31K37U	12-Apr-06	16-Jun-07	KELLY FORD	12365301	5K01	6L2Z	1007	BA	B65	D4	2	21-Jul-07	2	5987	1001.1	59.53	1060.6	0.8	4808		
2006	1LNHM82VX6Y6	14-Sep-05	30-Nov-06	GRIFFIN FOF	010462A	5K01	6W1Z	1007	DA	B65	42	2	8-Jun-07	7	1601	1144.4	65.17	1209.5	0.8	6360	REPLACED 3 RIM AND ALSO REPLACED 3 VALVE STEMS	
2007	1ZVHT80N775	27-Sep-06	21-Feb-07	TOMS FORD,	398855A	5K01	7R3Z	1007	E	B65	D4	2	17-Aug-07	6	4475	1314.5	157.47	1472	1.7	20639	4475 REPLACE 4 RIMS AND BANDS WPI	



2005	2FAFP71W55X	15-Oct-04	6-Jan-05	CASA FORD	676749A 5K01 *	**	*	*	04N	16-Aug-07	32	62321	341.04	126.67	467.71	1.7	20455	62321 WHEELS HAVE PREFIX 4W73 THEY DO FALL UNDER RECALL, SOP PERFORMED RECALL 58B01 REPLACED ALL FRIVE STEEL WHEELS DISABLED ALL FIVE WHEELA	RECALL # 58B01 INSPECTION ON STEEL WHEELS
2005	2FAFP71W35X	15-Oct-04	6-Jan-05	CASA FORD	677302A 5K01 *	**	*	*	04N	21-Aug-07	32	37275	341.04	126.67	467.71	1.7	20455	37275 INSPECTED WHEELS WHEELS MEET REQUIREMENT FOR RECALL SIMOUNTED TIRES FROM WHEELS MOUNTED TIRES TO NEW WHEELS ROAD TEST OK FORD RECALL	04M05 STEEL WHEEL INSPECTION AND REPLACEMENT
2005	2FAFP71W15X	15-Oct-04	6-Jan-05	CASA FORD	677295A 5K01 *	**	*	*	04N	21-Aug-07	32	45824	341.04	126.67	467.71	1.7	20455	WHEELS MEET CRITERIA FOR RECALL DISMOUNTED TIRES FROM OLD WHEELS MOUNTED TIRES TO NEW WHEELS ROAD TEST OK	RECALL 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS
2004	2FAFP71W84X	11-Feb-04	22-Jul-04	AUTOWAY FC	351864A 5K01 *	**	*	*	04N	3-Aug-07	37	52111	348.88	132.94	481.82	1.7	4860	52111 58B01 STEERING NIBBLE VERIFIED. CHECKED DATE CODE AND PART NUMBER STAMPING PER RECALL AND REPLACED ALL FIVE WHEELS.	RECALL 58B01 STEEL WHEEL INSPECTION
2004	2FAFP71W24X	11-May-04	27-Jul-04	AUTOWAY FC	351861A 5K01 *	**	*	*	04N	3-Aug-07	37	47211	348.88	132.94	481.82	1.7	4860	47211 58B01 VERIFIED CONCERN OF AIR LOSS IN RIGHT FRONT WHEEL. CHECKED DATE AND PART # STAMPING AND REPLACED ALL FIVE WHEELS PER RECALL.	58B01 INSPECTION OF STEEL WHEEL 58B01 ONE TIME INSPECTION FOR STEERL WHEEL RECALL
2003	2FAFP71W43X	19-Aug-02	23-Oct-02	HELFMAN FC	6232252 5K01 *	**	*	*	04N	28-Aug-07	60	74427	349.23	135.39	484.62	1.7	4587	58B01 REFER TO 04M05 NEC TO REPLACE 5 WHEELS 27642 RECALL 04M05 04M05G (1.7) INSPECTED RIMS WERE BAD DISMOUNTED 5 TIRES FROM RIMS AND MOUNTED TIRES TO NEW RIMS, BAL. ALL 5 TIRES ONP 04M05	58B01 INSPECTION OF STEEL WHEEL 58B01 ONE TIME INSPECTION FOR STEERL WHEEL RECALL
2004	2FAHP71W04X	27-Apr-04	30-Jun-04	CAVALIER FC	934645A 5K01 *	**	*	*	04N	22-Jun-07	37	27642	341.04	147.9	488.94	1.7	6633	ONP 04M05 STEEL WHEEL INSPECTION & REPLACEMENT	RECALL 04S28
2004	2FAFP71W24X	20-Aug-03	25-Aug-03	BILLY HOWE	1473453 5K01 *	**	*	*	04N	10-Jul-07	48	19311	365.4	126.78	492.18	1.5	341	31970 WHEEL RECALL 04M05 PERFORMED WHEEL REPLACEMENT RECALL 04M05. INSPECTED WHEELS AND DETERMINED THAT THEY WERE A PART OF THE RECALL. REPLACED ALL FIVE WHEELS AS STATED TO DUE IN THE RECALL. THE	ONP 04M05
2003	2FAFP71WX3X	4-Dec-02	31-Dec-02	EXPRESSWA	076589A 5K01 *	**	*	*	04N	24-Jul-07	56	31970	374.18	124.12	498.3	1.7	5142	INSPECTED WHEELS AND DETERMINED THAT THEY WERE A PART OF THE RECALL. REPLACED ALL FIVE WHEELS AS STATED TO DUE IN THE RECALL. THE	N DAMAGED THE ORIGINAL WHEELS SO THAT THEY COULD NOT BE USED AGAIN.
2005	2FAHP71W75X	16-Aug-04	30-Sep-05	TED BRITT FC	61479801 5K01 *	**	*	*	04N	27-Aug-07	24	51628	342.68	164.49	507.17	1.7	48	PERFORMED RECALL 07S48G.	WHEEL REPLACEMENT RECALL 07S48 WHEEL INSPECTION REPLACE TIRES AS MARKED WITH X NOT IN OASIS VERIFY RIM REPLACEMENT ADVISE ME



2004	1FAHP60AX4Y	17-Dec-03	14-May-04	LANDMARK F	671498D 5K01 4W6Z	1007 AA B65 42 07	27-Jul-07 39	2567	499.86	28.91	528.77	0.3	8559	2567 ESP WARR FOUND TIRE GOING FLAT, DISMOUNTED TIRE AND FOUND CHROME FLAKING OFF OF WHEEL AND CAUSING AIR LEAK, REPLACED WHEEL WITH UPDATED PART, REMOUNTED TIRE, BALANCED ASSY, REMOUNTED ON VEHICLE	E, CHECKED OK	LT REAR TIRE GOING FLAT CUSTOMER STATES HEARS SCRAPING NOISE WHEN ROLLING SOP WHEELS CHROME LIFTING AND HITTING BRAKE CALIPERS... CUSTOMER STATES PS REAR TIRE SLOW LEAK PLEASE PERFORM TIRE ROTATION.(PLEASE ONLY ROTATE REAR TIRES.)SEE ME FOR MORE INFO.
2003	5LMFU27R73L	2-Jan-03	8-Feb-03	ISLAND LINC	7929951 5K01 2L7Z	1007 AB B65 81 07	20-Jun-07 54	69686	1384.5	89.14	1473.6	1.2	11643	CHROME ON WHEELS LIFTING UP DISMOUNTED 4 TIRES REMOVED 4 SENSORS FROM OLD RIMS	RIMS MOUNT AND BALANCED 4 TIRES	WHEELS CHROME LIFTING AND HITTING BRAKE CALIPERS... CUSTOMER STATES PS REAR TIRE SLOW LEAK PLEASE PERFORM TIRE ROTATION.(PLEASE ONLY ROTATE REAR TIRES.)SEE ME FOR MORE INFO.
2003	2FMZA524X3E	26-Feb-03	28-Feb-03	IMLAY CITY F	1951424 5K01 *	1015 * A99 82 07	11-Jun-07 53	36108	0.59	16.47	18.1	0	2672	PLUGGED TIRE		ROTATION.(PLEASE ONLY ROTATE REAR TIRES.)SEE ME FOR MORE INFO.
2004	1FAFP33Z84W	16-Feb-04	27-Mar-04	FRITTS FORL	9719852 5K01 *	1007 * A85 82 07	13-Jun-07 40	64502	0	10.21	10.21	0	5557	TIRE ROTATION.		ROTATION.(PLEASE ONLY ROTATE REAR TIRES.)SEE ME FOR MORE INFO.
2003	1FBSS31L53H	6-Dec-02	18-Dec-02	COOK-WHITE	013651B 5K01 *	1007 * H62 30 07	15-Aug-07 57	451079	0	14.11	14.96	0	4910	451079 .5 ROTATE TIRES		ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR
2003	1FTRF172X3NB	20-Dec-02	6-Jan-03	TEXAN FORC	398278C 5K01 *	1007 * A99 42 07	30-Jul-07 56	116314	0	15	15	0	2488	CK DRIVERS TIRE LOOSING AIR		CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD
2003	1FTNX20F23E	11-Sep-02	22-Feb-03	DON CHALMI	3869924 5K01 *	1015 * A99 82 07	13-Jun-07 53	91198	0	15	15	0	1487	REPAIRED TIRE AND REMOUNTED		QUALITY CARE REPORT CARD
2003	1FTNE24L33HB	29-Aug-03	19-Apr-04	RANCHO FOI	47734603 5K01 *	1007 * A99 82 07	10-Aug-07 41	71206	0	15	15	0	5432	QUALITY CARE REPORT CARD		QUALITY CARE REPORT CARD
2005	1FTSW21P55EC	3-Mar-05	28-Jul-05	TEXAN FORC	399662F 5K01 *	1007 * A99 42 07	17-Aug-07 26	47549	0	15	15	0	2488	47549 A.5 REPAIED TIRE		* TIRE REPAIR
2005	1FTRF12W05NE	3-Mar-05	23-Mar-05	MAC HAIK FC	222119D 5K01 *	1007 * A99 82 07	23-Jul-07 29	80417	0	15	15	0	9936	80417 ROTATED TIRES		(230P) ROTATE TIRES
2006	1FTRF12246N	23-Jan-06	1-Feb-06	TEXAN FORC	398503B 5K01 *	1007 * A99 42 07	2-Aug-07 19	33667	0	15	15	0	2488	PATCHED THE RR TIRE(A.5LABOR) FRONT TIRES AT 12 32 AND REAR TIRES AT 9 32 TREAD DEPTH TECHNICIAN REMOVED ALL TIRES, INSPECTED FOR WEAR, ROTATED TIRES, AND REINSTALLED TO PROPER TORQUE		P REAR HAS NAIL IN TIRE
2005	1FTPW14575KC	6-Jan-05	15-Apr-05	ROSEMURGY	20887605 5K01 *	1007 * A99 82 07	10-Jul-07 28	23527	0	15.95	15.95	0	6366	SPECIFICATIONS.		
2005	1FAHP53235A	10-Nov-04	25-Nov-04	HOLMAN FOI	381455F 5K01 *	1007 * A99 82 07	17-Jul-07 33	47251	4.99	11	17.1	0	1325	TIRE XX		NAIL IN RIGHT REAR TIRE
2005	1FTRF12W95N	7-Jan-05	19-Jan-05	GRANDE TRI	091277C 5K01 *	1007 * H62 42 07	9-Aug-07 32	114138	0	18	18	0	4569	ROTATED TIRES		ROTATE TIRES C S RF TIRE WAS DOWN TO 65LBS ALL OTHERS READING 75LBS C S FT END FEELS LIKE HAS A FLAT TIRE FT END DARTS AND WANDERS??
2004	1FTSS34LX4H	22-Mar-04	29-Apr-04	DEMPEWOLF	1611151 5K02 6C3Z	1700 A A99 82 07	23-Aug-07 41	178867	4.41	15	19.67	0	5668	REPLACE VALVE STEM WPI		01566800 1472

2003	1FTRE14293H	13-Sep-02	21-Jan-04	RUSTY ECK I	8929004 5K01 *	1007 *	A99	42 07	3-Aug-07	44	122885	0	19.95	19.95	0	5319	ROTATED TIRES	CUSTOMER REQUESTS TIRE ROTATION
2005	1FDWE35L45	24-Mar-05	29-Apr-05	RUSTY ECK I	32510701 5K01 *	1007 *	A99	42 07	12-Jul-07	27	114614	0	19.95	19.95	0	5319	ROTATE TIRES WARRANTY	CUSTOMER REQUESTS TIRE ROTATION
2006	1FTRF12226N	23-Jan-06	1-Feb-06	TEXAN FORC	399770B 5K01 *	1007 *	A99	42 07	18-Aug-07	19	47617	0	19.95	19.95	0	2488	47617 REFER TO LINE G	* TIRE ROTATION
2004	1FAHP53254	10-Feb-04	27-Feb-04	SAWGRASS	65036202 5K01 *	1007 *	H62	42 07	3-Jul-07	41	68300	0	20	20	0	4908	TECH 67680 .5 HRS QUALITY FLEET CARE ROTATED TIRES AND ADJUSTED TIRE PRESSURE AS PER MANUFACTURER SPECIFICATIONS	CUSTOMER REQUESTS TIRE ROTATION AND TIRE PRESSURE ADJUSTED AS PER MENU SEE ERIC FOR KEY
2006	1FMEU74E26U	22-Sep-05	4-Oct-05	CRESTMONT	155943B 5K01 *	1007 *	A99	82 07	24-Aug-07	23	52262	0	18.95	20.09	0	4369	52262 ROTATED TIRES AND SET TIRE PRESSURES.	FOUR TIRE ROTATION \$18.95 FIVE TIRES \$23.69
2004	1FAHP55U14A	7-Oct-03	22-Oct-03	PHIL SMITH F	16684604 5K01 *	1007 *	A99	82 07	11-Jul-07	46	51963	0	19.95	21.14	0	4351	ROTATED TIRES TECH 623 SERVICE COMPLETED	INSPECT FOR UNEVEN WEAR.
2007	1FAHP241X7G	5-Dec-06	20-Dec-06	WORLD FOR	080888C 5K01 *	1007 *	A99	82 07	22-Aug-07	9	26961	0	21.42	21.42	0	4962	PERFORMED TIRE ROTATION. 40605 FOUND NAIL IN TIRE.	ROTATE TIRES
2005	1FAHP53255A	10-Nov-04	1-Dec-04	HOLMAN FOI	218679B 5K01 *	1007 *	A99	82 07	23-Jul-07	33	40605	0	33	35.31	0	2848	PATCHED TIRE. MOUNTED AND BALANCED TIRE. RETESTED	PATCH TIRE (INC MOUNT & BALANCE)
2003	1FDXF46P13E	2-Apr-03	30-Apr-03	GATOR FORI	089626A 5K01 *	1007 *	A99	82 07	12-Jun-07	51	204034	0	36	36	0	4917	204034 MOUNTED AND BALACED TIRE ON 19.5 RIM	INSTALL LEFT FRONT TIRE ....USE TIRE IN BACK OF VEHICILE TIRE REPAIR PATCH KIT
2006	1FMYU93196K	5-Aug-05	19-Aug-05	APPLE VALLI	64522406 5K01 *	1007 *	A99	82 07	7-Aug-07	24	47677	0	37.5	37.5	0	9217	REPAIRED TIRE PATCH KIT	CK STATES HAS SHAKE IN CAR AT 60 MPH, STATES VERY BAD AT 80 MPH
2005	1FAFP53U75A	18-Nov-04	1-Dec-04	FORT MILL F	118425A 5K01 *	1007 *	A99	82 07	9-Aug-07	33	37710	0	39.24	39.24	0	1015	37710 .7 BALANCED TIRES, RR HAS HIGH ROAD FORCE	ADVISE
2004	2FTRF17204C	17-Feb-04	30-Aug-04	TEXAN FORC	396833A 5K02 YL3Z	1130 AA	A99	42 07	11-Jul-07	35	72899	22.55	15.4	39.75	0	2488	72899 REPLACED CAP .1 ATUH HQ478147 TEST DROVE VEHICLE CONFIRMED VIBRATION, COULD NOT CONFIRM EXCESSIVE PLAY IN STEERING, BALANCED ALL FOUR TIRES ALL TIRES WAY OUT OF BALANCE AND SET TIRE PSI AT 60 FRONT 80 REAR ALL TIR	ES WERE LOW ON AIR AT 40 PSI
2003	1FTSS34L83H	12-Mar-03	4-Jun-03	KELLY FORD	12486603 5K01 *	1007 *	A99	82 07	9-Aug-07	51	38868	0	39.95	39.95	0	4808	77964 TK3127 A 5 CHECKED FOR EXHAUST LEAK FOUND MANIFOLD BOLTS LOOSE READJUSTED AND TIGHTENED BOLTS NO FURTHER LEAKS AFTER REPAIR	C S FRT END SHIMMYS AT HWY SPEEDS AND OR EXCESSIVE PLAY IN STEERING
2005	1FTRE14W35H	2-Sep-04	13-Jul-05	TEXAN FORC	396040B 5K01 *	1007 *	A99	42 07	29-Jun-07	24	77964	0	40.4	40.4	0	2488	1 ROTATED TIRES FRONT TO BACK.	CUSTOMER STATES...VEHICLE HAS AN EXHAUST LEAK
2006	1FTSW21P56E	23-Feb-06	31-Mar-06	KRUG HILLT	1878301 5K01 *	1007 *	A99	82 07	25-Jul-07	17	29811	0	41.6	41.6	0	1758	BALANCED ALL 4 WHEELS TEST DROVE RECHECKED OK QUALITY FLEET CARE	CUSTOMER REQUEST ROTATE TIRES
2005	1FAFP53205A	23-Mar-05	21-Apr-05	PHIL LONG F	77975505 5K01 *	1007 *	A99	82 07	27-Jun-07	27	29398	0	43.8	43.8	0	3140		CUSTOMER STATES THE VEHICLE VIBRATES ABOVE 65 MPH.

2004	1FMFU18L94L	2-Mar-04	31-Mar-04	BEACH FORC	9589704	5K01	*	1007	*	H62	42	07	24-Jul-07	41	76105	0	47.8	47.8	0	6727	CP:1007 TECH29 MENU ROTATE AND BALANCE COMPLETE	ROTATE AND BALANCE TIRES PASSENGER CARS AND LIGHTTRUCKS
2003	1FAFP38393W	23-Apr-03	5-May-03	DON TESTEF	2349905	5K01	6S4Z	1012	BA	B65	42	07	11-Jul-07	51	85421	24.08	22.23	49.55	0.3	2335	VERFIED AND REPLACED LUG NUTS	LUG NUTS ROUNDED OFF
2006	1FTSW21P26E	23-Jun-05	9-May-06	TEXAN FORC	394860C	5K01	*	1007	*	A99	42	07	14-Jun-07	14	32450	0	49.95	49.95	0	2488	32450 I REPLACED THE DIESEL AIR FILTER A.5	*REPLACE AIR FILTER 6.0 DIESEL
2006	1FAHP53206A	21-Dec-05	6-Jan-06	COOK-WHITE	014350E	5K01	*	1007	*	H62	42	07	27-Aug-07	20	33266	0	56.45	57.4	0	4910	33266 .8 PERFORMED BALANCE ON ALL 4 TIRES 80	ROTATE AND BAL 4 TIRES
2003	1FBSS31L53H	6-Dec-02	18-Dec-02	COOK-WHITE	012072B	5K01	*	1007	*	H62	30	07	14-Jul-07	56	439384	0	56.45	59.84	0	4910	439384 PERF MAINT PER OWNER MANUAL	ROTATE AND BALANCE TIRES
2005	1FDWE35S05H	12-Aug-04	21-Jan-05	PAYTON-WR	486073C	5K02	*	1130	*	N22	30	07	6-Jun-07	29	151363	69.95	0	75.72	0	2413	151363 NC REPLACED RIGHT FRONT WHEEL COVER	REPLACE RT FRT WHEEL COVERS
2005	1FAFP53U75A	4-May-04	21-May-04	BEAVERTON	047387A	5K02	*	1130	*	B65	82	07	21-Aug-07	40	30916	0	92.08	92.08	1	8729	30916 1.0 HR INSPECT FOR SQUEEKING NOISE WHEN DRIVING, VERIFY CONCERN, ISOLATE NOISE TO HUBCAPS, REMOVED HUBCAPS, CLEANED MOUNTING SURFACES, APPLIED SOUND DEADENING GREASE, REASSEMBLE ROAD TEST, A	LL OK NOW
2005	2FAHP71W25X1	19-Jan-05	22-Feb-05	EVERGREEN	32719202	5K01	5W7Z	1007	AA	A99	82	07	27-Aug-07	31	53408	68.21	17.65	93.5	0	8305	INSTALLED SOP SPARE WHEEL.	CUSTOMER STATES WHILE DRIVING, WORSE COLD, THERE IS A SQUEAK TYPE NOISE, NOT ROTATION, GETS SOFTER WHEN REPLACE SPARE TIRE WHEEL
2005	2FAHP71W25X	19-Jan-05	22-Feb-05	EVERGREEN	32712101	5K01	*	1007	*	A99	82	07	25-Aug-07	31	53229	0	97.05	105.69	0	8305	ORDERD 1 WHEELS. TRANSFERED SPARE WHEEL ONTO VEHICLE BALLANCED ALL TIRES. ROAD TEST. ALL OK	NEED ONE WHEEL AT R R REPLACED BALANCE TIRES AND SWAP SPAIR RIM TO R R
2005	1FAFP53UX5A	27-Jan-05	11-Feb-05	BOWEN SCA	259878C	5K01	YF1Z	1007	FA	A99	82	07	12-Jul-07	30	53425	90.44	0	116.08	0	8588	53426 SENT TO QUICKLANE FOR WHEEL REPLACEMENT.	REPLACE WHEEL PASS OUTSIDE REAR TIRE WHEEL COVER
2005	1FDWE35S25H	21-Aug-04	21-Jan-05	PAYTON-WR	485969B	5K02	*	1130	*	B65	42	07	5-Jun-07	29	143167	69.95	40.51	116.23	0	2413	143167 WHEL COVER MISING CP .5 HRS6583 INSTALL RIGHT REAR WHEL COVER.	IS MISSING CUSTOMER STATES THERE IS A SLOW LEAK IN THE RIGHT FRONT TIRE AND FASTER LEAK IN THE RIGHT REAR TIRE.
2006	1FAFP532X6A	16-Mar-06	6-Apr-06	PHIL LONG F	78109202	5K01	*	1007	*	A99	82	07	12-Jul-07	16	11934	95.2	27	122.2	0	3140	REPLACED RIGHT FRONT TIRE HAD NAIL IN SIDE WALL QUALITY FLEET CARE	CHK + ADV *MOUNT AND BALANCE ONE TIRE
2003	1FTRF17233N	20-Dec-02	6-Jan-03	TEXAN FORC	399619A	5K01	*	1007	*	A99	42	07	16-Aug-07	57	111715	108.3	15	132.2	0	2488	111715 MOUNT AND BALANCE ONE TIRE A.5	BALANCE ONE TIRE CUST STATES
2004	1FDWF36PX4E	29-Jan-04	1-Mar-04	FORT MILL F	116317A	5K01	*	1007	*	H62	D1	07	9-Jun-07	40	83802	107.6	28.03	146.18	0	1015	83802 50 CHECK TIRE FOR LEAK REPLACE TIRE MOUNT + BALANCE	DRIVERS SIDE REAR TIRE LEAKING FLAT REPAIR LEFT REAR AND PUT SPARE BACK
2006	1FTPW14596K	7-Oct-05	15-Feb-06	AUTOMAX FC	229768A	5K01	*	1007	*	H62	42	07	6-Jun-07	16	11914	141.85	23.82	165.67	0.3	9976	11914 30 MOUNT AND BAL X 1	CUST REQ REPL RT FRT WHEEL
2004	1FTPX145X4N	27-Jan-04	12-Feb-04	JOE COOPEF	423136A	5K01	4L3Z	1015	CA	A99	82	07	12-Jun-07	41	70878	131.13	34	176.74	0	3036	REPL RT FRT WHEEL RIM ROAD TEST DIAG. MOUNT AND BALANCE TWO TIRES ROTATE TO FRONT.	SHIMMY IN FRONT END AT APPROX 65 MPH



2005	1FTRF12255K	5-Aug-05	23-Aug-05	JORDAN FOF	4839851	5K01	*	1007	*	A99	82	07	6-Aug-07	24	91630	141.04	53.95	207.29	0	4546	COMPLETED BALANCE & ROTATE REPLACED 1 TIRE	BALANCE 4 WHEELS AND ROTATE/MOUNT AND BALANCE ONE TIRE
2003	1FTRF172X3N	20-Dec-02	6-Jan-03	TEXAN FORC	398278F	5K01	*	1007	*	A99	42	07	30-Jul-07	56	116314	196.88	30	243.11	0	2488	116314 MOUNT AND BALANCE TWO NEW TIRES B.O	*MOUNT AND BALANCE TWO TIRES
2003	1FAFP55U93G	22-Jan-03	30-Jan-03	SANTA MARC	358756B	5K02	F42Z	1700	A	A99	82	07	19-Jun-07	54	65937	198.22	63.6	277.18	0	1597	65937 060 REPLACED TWO TIRE,STEMS,SEALS,AND SPIN BALANCED AND MOUNTED TIRES.NEW DOT CODE:LLX8 3RJ	TIRE2 REPLACE TWO TIRES TO INCLUDE NEW STEM SEALS AND MOUNT AND BALANCE PO#ME171
2005	1FTPX12575N	4-Jan-05	8-Apr-05	BEV SMITH F	47606906	5K02	*	1705	*	A99	82	07	6-Aug-07	29	32189	252.78	23.4	298.92	0	4909	0707X2 FLAG TECH 415 1 COMPLETED REPLACED FRONT 2 TIRES	REPLACE TWO TIRES
2003	1FTRF17213N	20-Dec-02	15-Jan-03	TEXAN FORC	397388A	5K01	*	1007	*	A99	42	07	18-Jul-07	55	100248	246.5	30	302.7	0	2488	84000 I MOUNTED AND BALANCE TWO NEW TIRES B.O DOT	*MOUNT AND BALANCE TWO TIRES
2006	1LNFM87AX6Y	9-Nov-05	12-Dec-05	TED BRITT F	61196301	5K01	*	1007	*	A99	82	07	6-Aug-07	21	21142	282.05	29.03	325.18	0	48	T79CP JNH 0607 INSTALLED NEW TIRE AND BALANCED	CHECK FOR SLASH IN TIRE CUSTOMER REQUESTS TIRES CHECKED MOUNT AND
2003	1FMFU18L33L	11-Nov-02	18-Nov-02	L F DONNELL	418666A	5K01	*	1007	*	B65	82	07	25-Jun-07	57	172675	303.46	45.19	371.31	0	2220	REPLACED 2 REAR TIRES	BALANCE TWO TIRES REPLACE FRONT TIRES
2004	1FTRF12W44N	21-Aug-03	5-Sep-03	JOE MYERS I	560083B	5K01	*	1007	*	A99	82	07	23-Jul-07	48	57788	327.9	20	374.96	0	4402	57788 , MOUNT BALANCED 2 TIRES . COMPLETED INSTALLATION OF	BALANCE TWO TIRES REPLACE FRONT TIRES
2006	1FTWW33PX6E	29-Nov-05	12-Jul-06	BLUEBONNE	47642206	5K01	*	1007	*	B65	42	07	24-Jul-07	13	25902	270.28	20	429.61	0	4570	TWO FRONT TIRES 47617 I MOUNT AND BALANCED 3 TIRES(B.5LABOR) DOT T79C PJNH	*MOUNT AND BALANCE THREE TIRES
2006	1FTRF12226N	23-Jan-06	1-Feb-06	TEXAN FORC	399770G	5K01	*	1015	*	A99	42	07	18-Aug-07	19	47617	369.75	45	445.05	0	2488	1807;3 TIRES	BALANCE THREE TIRES
2006	1FAHP53226A	11-Jan-06	26-Jan-06	TEXAN FORC	396085C	5K01	*	1007	*	A99	42	07	30-Jun-07	18	36345	340	60	445.34	0	2488	36345 I MOUNTYED AND BALANCE FOUR NEW TIRES C.O DOT	*MOUNT AND BALANCE FOUR TIRES
2005	1FTRF12W15N	25-Feb-05	8-Mar-05	SAWGRASS I	65022805	5K01	*	1007	*	H62	42	07	2-Jul-07	29	56989	379.84	50	455.63	0	4908	A3X8 3PE 1807 TWO 1707 TWO TECH 48544 1.0 HR MOUNTED	REPLACE 2 TIRES
2003	1FTRF17233N	20-Dec-02	6-Jan-03	TEXAN FORC	397948A	5K01	*	1007	*	A99	42	07	26-Jul-07	56	108173	389.04	60	493.12	0	2488	INDEX AND BALANCED 2 TIRES 108173 I MOUNT AND BALANCED 4 TIRES(C.O.LABOR) DOT AN08 B4UU	BALANCE FOUR TIRES
2006	1FTRE14W66D	24-Mar-06	17-Aug-06	TEXAN FORC	398747A	5K01	*	1007	*	A99	42	07	6-Aug-07	12	49097	425	60	519.96	0	2488	2107;ALL TIRES	*MOUNT AND BALANCE FOUR TIRES
2003	1FDWE35L93H	19-Feb-03	31-Mar-03	TOWN & COL	361525A	5K01	*	1007	*	A99	82	07	28-Jun-07	52	22427	442.42	79.49	561.73	1	3365	MOUNT AND BALANCE FOUR TIRES	BALANCE FOUR TIRES
2006	1FTRX12W46F	14-Sep-05	21-Feb-06	TEXAN FORC	394276D	5K01	*	1007	*	A99	42	07	5-Jun-07	16	48538	493	60	593.78	0	2488	22427 MOUNTED AND BALANCED 2 TIRES AND PUT ON THE OUTSIDE REAR	MOUNT AND BALANCE TWO TIRES 225 75 R 16 MICH..LTX MIS ..PLEASE ORDER *MOUNT AND BALANCE FOUR TIRES
2004	2FAFP73W84X	18-Sep-03	14-Oct-03	JOE MYERS I	557697H	5K01	*	1007	*	A99	82	07	26-Jun-07	46	85925	523.8	40	607.02	0	4402	MOUNT AND BALANCE FOUR TIRES	BALANCE FOUR TIRES
2005	1FTRF12W25N	7-Jan-05	19-Jan-05	JORDAN FOF	4381252	5K01	*	1007	*	A99	82	07	27-Jun-07	30	121836	599.96	48	697.46	0	4546	85925 CP 20.00 MOUNTED AND BALANCENED FOUR TIRES.	TIRES PO FRANKGRAMEZ MOUNT AND BALANCE 4 TIRES
2005	1FTVX125X5N	10-Feb-05	15-Mar-05	HOLMAN FOF	381608A	5K01	*	1007	*	A99	82	07	19-Jul-07	29	69262	588.4	82	717.32	0	1325	MOUNTED AND BALANCED 4 TIRES 69262 MOUNTED AND BALANCED 4 NEW TIRES XX GENERAL GRABBER TR LT 245 70 R17 XX DOT#ADP846LB3904	MOUNT AND BALANCE (4 WHEELS)

2006	1FTWF31P56E	21-Mar-06	21-Apr-06	DAVE SINCLAIR	43214701	5K01	5C3Z	1015	JA	B65	42	07	25-Jun-07	15	63345	388.78	412.86	834.71	0	8199	REPLACE RIGHT REAR HUB AND SEAL, ROTOR AND WHEEL REPLACE ALL LUG NUTS ON RIGHT REAR ALSO MISSING NUTS ON R FRT&L REAR	CUST SAYS CHECK FOR CRACK IN REAR WHEEL AND ADVISE CUSTOMER REQUESTS TIRE ROTATION
2006	1FMEU73E86U	1-Dec-05	17-Dec-05	BILL ESTES	10618402	5K01	*	1007	*	A99	82	07	18-Jun-07	19	45408	0	0	0	0	3362	ROTATED TIRES.	REQUESTS TIRE ROTATION
2006	2FMZA51686E	14-Dec-05	29-Dec-05	BEACH FOR	9629802	5K01	*	1007	*	D50	42	07	27-Jul-07	20	71878	0	2	2	0	6727	CP:1007	TIRE TAX 2 TIRES
2006	2FMZA51686E	14-Dec-05	29-Dec-05	BEACH FOR	9629806	5K01	*	1007	*	H62	42	07	27-Jul-07	20	71878	0	2	2	0	6727	CP:1007	TIRE TAX 2 TIRES
2006	1FMEU73E66Z	20-Dec-05	9-Jan-06	JOE MYERS	558624B	5K01	*	1007	*	A99	82	07	6-Jul-07	19	37557	0	10	10	0	4402	REPAIR RT FRT TIRE FOR LEAK	CK RT FRT TIRE FOR LEAK
2007	3FAHP07Z97F	13-Feb-07	13-Mar-07	DEWEY FOR	43721901	5K01	*	1007	*	A99	82	07	21-Aug-07	6	12509	0	10	10.6	0	3540	1 TIRES HAS NAIL. INSIDE EDGE AT SIDEWALL. RECOMMEND TIRE REPLACEMENT INSTALLED SPARE TIRE PER CUSTOMER REQUEST	CUSTOMER STATES THAT TIRE IS LOOSING AIR GOING FLAT LEFT FRONT
2007	5LMFU27537L	13-Dec-06	23-Dec-06	NORTHGATE	139056B	5K01	*	1007	*	A99	82	07	28-Jun-07	7	3919	0	11	11	0	2663	3919 ROTATED THE TIRES	TIRE ROTATION
2006	1FMEU73E46U	9-Feb-06	25-Feb-06	BLUEBONNE	47025202	5K01	*	1015	*	B65	42	07	16-Jun-07	16	42570	1.8	10	12.01	0	4570	COMPLETED REPAIR OF TIRE 15310 NAIL IN TIRE VERIFIED CONCERN XX NAIL IN MIDDLE OF TIRE TREAD XX REMOVED NAIL AND PLUGGED TIRE XX TIRE IS GOOD NO LEAKS AFTER PLUG XX REINSTALLED SPARE TIRE UNDER CARGO AREA	PERFORM R FRONT FLAT REPAIR IN BACK CARGO AREA REINSTALL SPARE AND TIRE JACK
2007	1FMJU93Z97K	17-Nov-06	21-Nov-06	HOLMAN FOR	380628B	5K01	*	1007	*	B65	82	07	30-Jun-07	8	15310	0.95	11	12.78	0	1325	VEHICLE AND PLACED JACK IN CARGO AREA OF VEHICLE XX	AND TIRE JACK
2007	1FTPW14V57K	10-Jan-07	19-Jan-07	BUTCH OUS	158005B	5K01	*	1007	*	D50	82	07	22-Jun-07	6	6426	0	12.95	13.86	0	6422	6426 ROTATED TIRES	TIRE ROTATION
2006	1FMEU73E86Z	21-Dec-05	23-Jan-06	JOE MYERS	555670B	5K01	*	1007	*	A99	82	07	4-Jun-07	17	31934	0	14.84	14.84	0	4402	REPAIR TIRE	CK LEFT REAR TIRE
2006	2FMZA51656E	12-Dec-05	27-Dec-05	TEXAN FOR	396835B	5K01	*	1007	*	A99	42	07	11-Jul-07	19	83706	0	15	15	0	2488	83706 D FRONT TIRE REPAIR A.5 TCARE CC82 DIRT BETWEEN WHEEL AND TIRE, REMOVE TIRE AND CLEAN BEAD RETEST OK.	KEEPS ADDING AIR D FRONT HAS SCREW IN TIRE
2006	2FMZA51616E	13-Dec-05	29-Dec-05	MIDLAND FO	23973304	5K01	*	1007	*	A99	82	07	2-Jul-07	19	36560	0	15	15	0	9801	PASSENGER FRONT TIRE LOOSES AIR CUSTOMER REQUESTS TIRE ROTATION	QUALITY FLEET CARE SERVICE
2006	1FMEU73E26U	8-Dec-05	24-Dec-05	COLE-WHITN	6621702	5K01	*	1007	*	A99	82	07	24-Aug-07	21	108772	0	15	15	0	8980	COMPLETED ROTATION. 1 ROTATED TIRES INSPECTED	QUALITY FLEET CARE SERVICE
2007	1FTSW21P57E	22-Nov-06	6-Dec-06	PHIL LONG F	78113402	5K01	*	1007	*	A99	82	07	12-Jul-07	8	24941	0	15	15	0	3140	BRAKES QUALITY FLEET CARE ROTATED TIRES QUALITY FLEET CARE	QUALITY FLEET CARE SERVICE
2007	1FMFK16557L	20-Mar-07	6-Apr-07	PHIL LONG F	78225002	5K01	*	1007	*	A99	82	07	26-Jul-07	4	5318	0	15	15	0	3140	ROTATED TIRES INSPECTED	QUALITY FLEET CARE SERVICE
2007	1FAHP24117	4-Dec-06	19-Dec-06	PHIL LONG F	78193103	5K01	*	1007	*	A99	82	07	23-Jul-07	8	9830	0	15	15	0	3140	BRAKES QUALITY FLEET CARE	QUALITY FLEET CARE SERVICE
2006	1FMEU73E26U	8-Dec-05	23-Dec-05	RUSS MILNE	326026	5K01	*	1007	*	A99	82	07	27-Jun-07	19	52433	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	3FAHP08Z17F	11-Oct-06	19-Oct-06	RUSS MILNE	527927	5K01	*	1007	*	A99	82	07	8-Aug-07	10	10165	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMFK49C57E	10-Jan-07	19-Jan-07	RUSS MILNE	638926	5K01	*	1007	*	A99	82	07	29-Aug-07	8	12386	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMFK49C17E	12-Oct-06	13-Feb-07	RUSS MILNE	551026	5K01	*	1007	*	A99	82	07	13-Aug-07	7	14186	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMFK48C67E	16-Jan-07	19-Jan-07	RUSS MILNE	424526	5K01	*	1007	*	A99	82	07	17-Jul-07	6	13629	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMJU04187K	7-Dec-06	12-Dec-06	RUSS MILNE	298826	5K01	*	1007	*	A99	82	07	21-Jun-07	7	10224	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMJU03137K	11-Dec-06	18-Dec-06	RUSS MILNE	613226	5K01	*	1007	*	A99	82	07	24-Aug-07	9	20974	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMJU03137K	11-Dec-06	18-Dec-06	RUSS MILNE	444626	5K01	*	1007	*	A99	82	07	23-Jul-07	8	9156	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMFU16537L	8-Dec-06	12-Dec-06	RUSS MILNE	501126	5K01	*	1007	*	A99	82	07	2-Aug-07	8	5136	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES CK
2007	1FMFK20547L	22-Dec-06	4-Jan-07	RUSS MILNE	353125	5K01	*	1007	*	A99	82	07	2-Jul-07	6	10292	0	16	16	0	2890	ROTATE TIRES CK AND SET AIR PRESSURES	AND SET AIR PRESSURES
2007	1FMEU33857U	19-Jan-06	3-Mar-06	RUSS MILNE	317726	5K01	*	1007	*	A99	82	07	25-Jun-07	16	17429	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMCU04107K	7-Aug-06	14-Aug-06	RUSS MILNE	221726	5K01	*	1007	*	A99	82	07	6-Jun-07	10	15011	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES

2007 2FMDK36CX7E	15-Jan-07	22-Jan-07	CRESTMONT	154221C	5K01 *	1007 *	A99	82 07	30-Jun-07	6	11008	0	15.95	16.91	0	4369	11008 REMOVE NAIL FROM TIRE AND INSTALL PLUG	LEFT REAR TIRE LOOSING AIR LEFT REAR TIRE LOSS OF AIR CUSTOMER REQUESTS TIRE ROTATION CHECK RIGHT REAR TIRE CUSTOMER REQUESTS TIRE ROTATION FOUR TIRE ROTATION \$18.95 FIVE TIRES \$23.69
2007 2FMDK49C07E	10-Jan-07	12-Feb-07	IMLAY CITY F	2175252	5K01 *	1015 *	A99	82 07	30-Aug-07	7	14628	0.59	17.01	18.67	0	2672	PLUGGED THE TIRE	
2005 2FMZA576X5E	5-Nov-04	29-Nov-04	BILL ESTES F	10775505	5K01 *	1007 *	A99	82 07	13-Aug-07	33	116705	0	19.95	19.95	0	3362	COMPLETE TIRE ROTATION REPAIRED NAIL IN RIGHT REAR	ROTATION CHECK RIGHT REAR TIRE
2007 3FAHP07Z97F	22-Feb-07	10-Mar-07	VAN DRISSE	022806A	5K01 *	1007 *	A99	82 07	11-Jul-07	5	14594	0	19.95	19.95	0	12505	TIRE. WPI	TIRE CUSTOMER REQUESTS TIRE ROTATION
2007 1FBNE31L17D	19-Mar-07	3-Apr-07	BILL ESTES F	10747402	5K01 *	1007 *	A99	82 07	2-Aug-07	5	12853	0	19.95	19.95	0	3362	ROTATION COMPLETE	ROTATION
2007 2FMDK36CX7E	15-Jan-07	22-Jan-07	CRESTMONT	154221B	5K01 *	1007 *	A99	82 07	30-Jun-07	6	11008	0	18.95	20.09	0	4369	11008 ROTATE TIRES VERIFIED CONCERN. FOUND NAIL IN DRIVERS REAR TIRE. REPAIRED TIRE AND REINSTALLED SPARE	
2006 1FAFP53UX6A	18-Nov-05	5-Dec-05	BUSS FORD	1336041	5K01 *	1007 *	H62	82 07	5-Jun-07	19	31152	2.25	17.77	20.17	0	1857	TIRE.	
2006 2FMZA516X6E	28-Nov-05	21-Dec-05	DIFFEE FORI	182906A	5K01 *	1007 *	A99	82 07	20-Jun-07	19	42286	0	21.79	21.79	0	6835	42286 REPAIRED RIGTH REAR TIRE. QC9623	SLOW LEAK IN RIGHT REAR TIRE CUST STATES CHECK LEFT REAR TIRE LEAKING, CHECK BOTH REAR ADV ROTATE TIRES 17
2006 1FAHP34N06W	7-Dec-05	22-Dec-05	FORT MILL F	117501B	5K01 *	1007 *	A99	82 07	13-Jul-07	19	38531	0	21.99	21.99	0	1015	38531 .3 TIRE REPAIR	
2007 2FMDK49C07E	13-Dec-06	28-Dec-06	FORT MILL F	118673B	5K01 *	1007 *	A99	82 07	16-Aug-07	8	9092	0	21.99	21.99	0	1015	9092 30 ROT TIRES	
2007 1FTZR15E47P	6-Dec-06	18-Dec-06	MATHEWS F	240415A	5K01 *	1007 *	B65	30 07	20-Jul-07	8	11084	0	22.59	22.59	0.3	2265	11084 R.S.FRONT HAD A HOLE IN IT PLUGGED PATCH & BAL. & HAND TORQUED LUG NUTS TO 100 FT.LBS.	REPAIR RIGHT FRONT TIRE FOR NAIL PUNCTURE ROTATE TIRES
2007 2FMDA51677E	6-Sep-06	23-Sep-06	WORLD FOR	079490B	5K01 *	1007 *	A99	82 07	30-Jul-07	11	37889	0	21.41	22.75	0	4962	PEFORMED TIRE ROTATION. A99 82 1007 COMPLETED TIRE	
2006 1FMEU73E66U	9-Dec-05	28-Dec-05	APPLE FORD	48568104	5K01 *	1007 *	A99	82 07	13-Aug-07	20	32934	0	24.32	24.32	0	84	REPAIR A99 82 1007 PLUGGED HOLE IN PASSENGER S REAR TIRE	REPAIR FLAT TIRE
2007 3FAHP07177R	4-Oct-06	3-Dec-06	APPLE FORD	48487401	5K01 *	1007 *	A99	82 07	3-Aug-07	9	8184	0	24.32	24.32	0	84	COMPLETE	C S RIGHT REAR TIRE HAS A SLOW LEAK TIRE LIGHT ON AND LEFT REAR TIRE NEEDS REPAIR CUSTOMER ADVISE ME TIRE LIGHT HAS BEEN COMMING ON BEFORE TIRE REPAIR WAS NEEDED ESP FLEET CARE
2005 2FMZA57615E	2-Feb-05	17-Feb-05	SAWGRASS	64995103	5K01 *	1007 *	B65	42 07	29-Jun-07	29	45339	0	25	25	0	4908	0.5 6319 060 FLAG 125 .6 REPAIRED RIGHT REAR TIRE REINSTALLED SPARE TIRE BACK IN TRUNK SET	
2007 1FAHP24147G	9-Feb-07	7-Mar-07	SANTA MARC	361090A	5K01 *	1007 *	A99	82 07	2-Aug-07	5	6319	1.5	24.95	26.57	0	1597	PSI	REPAIR FLAT TIRE
2006 1FTRF12286N	23-Jan-06	2-Feb-06	BOB TOMES	63465102	5K02 4L3Z	1130 EA	A99	82 07	12-Jul-07	18	33122	26.67	0	26.67	0	2531	N/C	
2006 1FMEU73E86U	1-Dec-05	17-Dec-05	BILL ESTES F	10618405	5K01 *	1007 *	A99	82 07	18-Jun-07	19	45408	4.49	22.5	26.99	0	3362	FOUND HAD 2 NAILS IN LEFT PLUGED NAIL HOLES WHEN TIRE WAS REMOVED HIT PRESSURE SENSOR AND BROKE BAND LOOSE HAD TO REPLACE BAND	CUSTOMER STATES THAT THE LOW TIRE LIGHT IS ON. POSSIBLE DRIVER FRONT TIRE HAS A SLOW LEAK.

2007 2FMDK36C17B	17-Nov-06	24-Jan-07	IMLAY CITY F	2024024 5K01 *	1015 *	A99	82 07	9-Jul-07	6	8543	0	25.52	27.05	0	2672	REPAIRED AND MOUNTED TIRE VERIFIEDS CUSTOMERS CONCERN,FOUND NAIL IN TIRE,REMOVED, PLUG PATCHED,RE MOUNT EWD,RE CK	REPAIR AND MOUNT TIRE
2007 3FAHP07Z77R	5-Jan-07	20-Jan-07	KRUG HILLT	1999402 5K01 *	1007 *	A99	82 07	21-Aug-07	8	19416	1.99	24.96	27.07	0	1758	OK.	REPAIR RT FRONT TIRE, CHECK RT SIDE TIRES THEY HAVE AIR LOSS PRETTY OFTEN TIRE PRESSURE LIGHT COMES ON PRETTY OFTEN
2006 1FMEU75E26U	30-Jan-06	21-Feb-06	ALBUQUERQ	12130303 5K01 *	1007 *	A99	82 07	1-Aug-07	18	43232	0	32	33.92	0	10140	REPAIRED TIRES SET TO 35 PSI	REPORT ROTATE AND BALANCE 16
2007 1FTSW21P17E	5-Jun-06	14-Jun-06	FORT MILL F	117395C 5K01 *	1007 *	A99	82 07	10-Jul-07	14	50136	0	39.24	39.24	0	1015	ROAD FORCE BALANCED 4 TIRES	BALANCE ALL FOUR TIRES
2004 1FMDU62K24U	15-Apr-04	18-May-04	BLOOMINGT	96243 5K01 *	1015 *	B65	42 07	18-Jun-07	38	56928	0	40	40	0	4691	ROTATED, BALANCED TIRES	CUSTOMER STATES TIRE ROTATION SERVICE ORDERED LF HUBCAP AND 5 ANCHOR BOLTS PER FORD COMM LENDING SERVICES AUTH HC4840
2007 1FMDK06187G	4-Dec-06	18-Dec-06	FORD OF CLI	1113252 5K01 *	1007 *	A99	82 07	1-Aug-07	8	10164	0	38.42	41.11	0	8951	ROTATED TIRES	CUSTOMER STATES VIBRATION HWY SPEEDS 50 MPH ELECTRONIC BALANCE AND ROTATE 4 WHEELS VIBRATION AT HIGHWAY SPEEDS
2007 1FAFP53U67A	17-Jul-06	3-Aug-06	DIFFEE FORI	185755A 5K02 5F1Z	1130 AA	B66	33 07	16-Aug-07	13	43302	41.12	7.26	51.92	0.1	6835	43302 LEFT FRONT HUB CAP FELL OFF. REPLACE HUB CAP AND BEAUTY BOLTS. RETEST OK. 37454 ROAD TEST. VERIFY SLIGHT VIBRATION. FOUND TIRES WERE OUT OF BALANCE. BALANCE ALL 4 TIRES. ROAD TEST OK. ALSO NOTED SOME CUPPING ON TIRES CAUSING ROAD NOISE	CUSTOMER STATES VIBRATION HWY SPEEDS 50 MPH ELECTRONIC BALANCE AND ROTATE 4 WHEELS VIBRATION AT HIGHWAY SPEEDS
2006 1FMYU93166K	7-Nov-05	22-Nov-05	CRESTMONT	154280C 5K01 *	1007 *	A99	82 07	3-Jul-07	20	37442	0	49.95	52.95	0	4369	CAUSING ROAD NOISE	CUSTOMER STATES VIBRATION HWY SPEEDS 50 MPH ELECTRONIC BALANCE AND ROTATE 4 WHEELS VIBRATION AT HIGHWAY SPEEDS
2006 1FAFP53U26A	7-Mar-06	21-Mar-06	NORTH POIN	42973902 5K01 *	1007 *	A99	82 07	3-Jul-07	16	44829	0	54.95	65.89	0	6033	C P 24D .8 ROTATE AND BALANCE FOUR TIRES AND WHEELS NVH DIAG AND BALANCE ALL FOUR TIRES	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2006 1FAFP53UX6A	29-Nov-05	14-Dec-05	NORTHLAND	4047803 5K01 *	1007 *	A99	82 07	24-Aug-07	21	49570	0	74.57	79.04	0	10638	VERIFIED, THERE IS A SLASH IN THE INSIDE SIDE WALL NEED TO REPLACE THE THE TIRE...	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2006 1FAFP53U76A	18-Nov-05	3-Dec-05	THE FORD S'	214721 5K01 *	1007 *	A99	82 07	25-Jun-07	19	30406	81.38	0	88.07	0	4240	REPLACED AND BALCENCED TIRE.	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2006 2FMZA51656E	23-Dec-05	13-Jan-06	FUTURE FOF	100941D 5K01 *	1007 *	A99	82 07	23-Jul-07	19	35506	0	99.95	99.95	0	4058	COMPLETED 4 WHEEL ALIGNMENT 33238 MOUNT AND BALANCE 1 TIRE LEFT FRONT TIRE SEPARATED. OTHER IS DISPOSAL FEE ON TIRE.	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2006 1FAFP53U56A	23-Nov-05	8-Dec-05	COURTESY F	308460D 5K01 *	1007 *	A99	82 07	26-Jun-07	19	33238	79.95	15	104.22	0	1625	REPLACED TIRE BALANCED AND MOUNTED	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2006 1FAFP53U56A	2-Dec-05	23-Dec-05	DON CHALMI	3805524 5K01 *	1015 *	A99	82 07	6-Jun-07	18	13977	92.4	26.39	118.79	0	1487	REPLACED TIRE BALANCED AND MOUNTED	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT MOUNT BALANCE ONE TIRE CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2005 1FAFP53U35A	21-Mar-05	6-Apr-05	WORLD FOR	0794071 5K01 *	1007 *	A99	82 07	27-Jul-07	29	33850	96.2	14.28	118.84	0	4962	MOUNT AND BALANCE ONE TIRE	LEFT REAR HAS A FLAT TIRE SPARE ON DRIVERS REAR
2006 1FAFP53U66A	1-Dec-05	16-Dec-05	TED BRITT F	61233902 5K01 *	1007 *	A99	82 07	8-Aug-07	21	27623	92	29.03	121.03	0	48	REPLACED TIRE MOUNT AND BALANCED.	LEFT REAR HAS A FLAT TIRE SPARE ON DRIVERS REAR

2007 1FMYU03137K	██████████	11-Dec-06	18-Dec-06	RUSS MILNE	444651 5K01 *	1007 *	A99	82 07	23-Jul-07	8	9156	0	116.95	123.24	0	2890	MOUNT AND BALANCE ONE NEW TIRE RT FRT HAD NAIL IN IT 1.5 PERFORMED ROAD FORCE DIAG AND TIRE BALANCE. SPECS; LF 2 LBS, RF 6, LR 13, RR 6, MAX SPEC 26 LBS. ROAD FORCE OK, TIRES OUT OF BALANCE.	TIRES ARE LOW
2007 2LMDU88CX7E	██████████	8-Feb-07	9-Feb-07	KRUG HILLT	1853902 5K01 *	1007 *	A99	82 07	18-Jul-07	6	24035	0	124.81	124.81	0	1758	BALANCED ALL 4 TIRES. 5562	VIBRATION AT 60 MPH
2006 1FAFP53U06A	██████████	2-Dec-05	6-Jan-06	SANTA MARC	359956A 5K02 F42Z	1700 A	A99	82 07	11-Jul-07	19	25546	97.18	31.8	136.72	0	1597	25546 030 INSPECT TIRE VERIFY CONCERN UNABLE TO REPAIR TIRE REC. 1 TIRE REPLACED 1 TIRE MOUNTED & BALANCED TIRE SET TIRE PRESSURE REPLACED VALVE STEM SEAL OLD DOT CODE # ACX8 44P 4605 X 1 NEW DOT C 12742 MOUNTED AND BALANCED ONE TIRE OLD DOT CODE A3VD 46PD 4006 NEW DOT CODE A3VD	REPAIR FLAT TIRE
2007 2FMDK49C57E	██████████	12-Dec-06	16-Dec-06	CRESTMONT	154284A 5K01 *	1007 *	A99	82 07	3-Jul-07	7	12742	120.4	15.95	144.53	0	4369	46PD 4506	MOUNT AND BALANCE 1 TIRE \$15.95
2006 1FMEU75E26U	██████████	30-Jan-06	21-Feb-06	ALBUQUERQ	12203701 5K01 *	1007 *	A99	82 07	17-Aug-07	19	46041	121.46	28.23	158.67	0	10140	HOLE IN TIRE NON REPAIRABLE REPLACED RR TIRE AND BALANCED ALL TIRES SET TO 35 PSI FLEET REQUESTS CARE PERFORM REPAIRS PER FLEET CARE	CHECK AND REPLACE RT REAR TIRE IT CONTINUES TO LEAK AIR SEE JESSIE FOR NEW TIRE CHECK AIR PRESSURE I
2006 2FMZA51666E	██████████	23-Nov-05	9-Dec-05	HEALEY FOR	17142901 5K01 *	1007 *	A99	82 07	11-Jul-07	20	27823	0	159.36	168.92	0	3615	CARE 32494 CP () R&R SPARE TIRE.BREAK DOWN SPARE & MOUNT ON RR WHEEL.BALANCE RR WHEEL.MOUNT NEW TIRE ON SPARE WHEEL & REPLACE UNDER VEHICLE.	FLEET CARE REQUIRED
2006 1FTPW12V66F	██████████	3-May-06	19-May-06	JOE MYERS I	559193B 5K01 *	1007 *	A99	82 07	13-Jul-07	15	32494	133.95	27.5	172.5	0	4402	TIRE SHAKE RETURN TO SHOP 3 CHECK TIRE RUNOUT OK REBALANCE ALL TIRES THANK YOU TODD	MOUNT AND BALANCE ONE TIRE
2006 1FAHP34N06W	██████████	5-Dec-05	21-Dec-05	EVERGREEN	32694702 5K01 *	1007 *	A99	82 07	23-Aug-07	21	30493	0	149.99	191.34	1.7	8305	THE PUNCHER IS TO CLOSE TO THE EDGE NEED NEW TIRE. REPLACED THE TIRE PER CUSTOMERS REQUEST.	VEHICLE VIBRATES AS DRIVE 60 70 MPH
2006 2FMZA51666E	██████████	24-Nov-05	16-Dec-05	THE FORD S	2227303 5K01 *	1007 *	A99	82 07	27-Jul-07	20	37095	131.72	56.16	198.75	0	4240	1018 REPLACE AND BALANCE R R TIRES, HAS NAIL IN OUTER SIDE WALL.	THE REAR RIGHT TIRE HAS A FLAT. CHECK NAIL IN SIDEWALL OF R R TIRE.
2007 4M2EU488X7U	██████████	22-Jun-07	29-Jun-07	ED MULLINA	267830A 5K01 *	1007 *	A99	82 07	9-Aug-07	2	1018	195.95	12.95	208.9	0	2283	1 MOUNTED AND BALANCED NEW LEFT FRONT AND LEFT REAR TIRES QUALITY FLEET CARE	QUALITY FLEET CARE SERVICE BOTH LEFT SIDE TIRES NEED TO BE REPLACED PER CUSTOMER REQUEST
2007 1FAFP53U57A	██████████	17-Aug-06	18-Sep-06	PHIL LONG F	78350201 5K01 *	1007 *	A99	82 07	9-Aug-07	11	27000	170.86	42.28	213.14	0	3140	REPLACE TWO TIRES CUPPED INSPECT UNABLE TO REPAIR REPLACED NEW RIM QUALITY FLEET CARE	NEED RIM TO REPLACE DAMAGE ONE IN THE TRUNK
2006 1FAFP53UX6A	██████████	29-Nov-05	14-Dec-05	NORTHLAND	3928201 5K01 *	1007 *	A99	82 07	13-Jul-07	20	43929	167.9	37.28	216.18	0	10638		
2006 2FMZA516X6E	██████████	6-Dec-05	28-Dec-05	PHIL LONG F	78445701 5K01 *	1007 *	B65	1 07	20-Aug-07	21	39089	209.64	12	221.64	0	3140		

2007 1FAHP24177G	1-Dec-06	19-Dec-06	JOE MYERS	561191A 5K01 *	1007 *	A99	82 07	3-Aug-07	8	40022	216.9	10	244.8	0	4402	40022 CP \$5 REPLACE LR TIRE TECH 48544 2.0 HR VERIFY CONCERN ROAD FORCED ALL TIRES INDEX TIRES 1 TIRE UNABLE TO INDEX MOUNTED 1 NEW TIRE MOUNTED INDEX BALANCED	CK CUSTOMER STATES THAT LEFT REAR TIRE BLOW OUT WHEN DRIVING
2006 1FAFP53U86A	21-Nov-05	7-Dec-05	SAWGRASS	64753202 5K01 *	1007 *	N22	42 07	8-Jun-07	19	22024	79.08	162.62	257.28	0	4908	ALL TIRES VERIFY REPAIR	CUSTOMER STATES VEHICLE VIBRATES AT SPEEDS OVER 50MPH ESP QUALITY FLEET
2006 1FAFP53U96A	23-Nov-05	8-Dec-05	TED BRITT F	60640801 5K01 YF1Z	1007 FA	A99	82 07	25-Jun-07	19	59050	201.31	48.38	259.76	0	48	REPLACE L FRONT TIRE,WHEEL & HUB CAP & REMOUNT SPAIR .5 HR.	REPLACE RIM, TIRE AND HUBCAP IN TRUNK MOUNT AND BALANCE ONE NEW TIRE
2007 1FDXE45S37D	23-Jan-07	5-Jun-07	MCNELLY-WI	181700A 5K01 *	1007 *	C50	30 07	10-Jul-07	2	4776	204.4	33.82	261.45	0	5733	REPLACED LR TIRE CP: 1015	RIGHT REAR TIRE BLOWN
2007 1FMEU74857U	13-Feb-07	19-Feb-07	KINGS FORD	2486803 5K01 *	1015 *	A99	82 07	8-Aug-07	6	14160	232.89	22.59	270.81	0	1970	0.4 REPLACED TIRE AND TRAINED TIRES	REV VIB LATERAL 1ST HARMONIC .060 .064,MACHINES RECOMENDATI ON IS TO REPLACE RIM,REPLACED RIM HAD TO INSTALL NEW TPMS STRAP AND SWAP TPMS ASSY TO
2007 1FMYU02Z57K	5-Jun-06	19-Jun-06	GULF BREEZ	033761A 5K01 6L8Z	1015 C	N24	13 07	11-Jun-07	12	11710	129.21	128.5	274.46	0	9555	OUT OF ROUND RIM ROAD TEST VEHICLE PERFORM NVH DIAG ROAD FORCE TIRES AND WHEELS,FOUND L F RIM TO HAVE 39PDS OF ROAD FORCE,ONCE PER REV RAD 1ST HARMONIC .070 0.019,TOTAL IND READING .072 .040,ONCE PER	STEERING WHEEL VIBRATION MOUNT AND BALANCE TIRE(S) CAR AND LIGHT TRUCK. ADD TIRE TAX FOR EACH TIRE MOUNT AND BALANCE TIRE(S) CAR AND LIGHT TRUCK. ADD TIRE TAX FOR EACH TIRE
2006 2FMZA51686E	14-Dec-05	29-Dec-05	BEACH FORL	9629801 5K01 *	1007 *	H62	42 07	27-Jul-07	20	71878	259.82	30.55	290.37	0	6727	CP:1007 0.5 AND B 2 FRONT TIRES	
2006 2FMZA51686E	14-Dec-05	29-Dec-05	BEACH FORL	9629805 5K01 *	1007 *	H62	42 07	27-Jul-07	20	71878	259.82	30.55	290.37	0	6727	CP:1007 0.5 AND B 2 REAR TIRES	
2006 1FAFP53U96A	21-Nov-05	9-Dec-05	COUNTY LINI	238862C 5K01 *	1007 *	A99	42 07	13-Aug-07	21	19949	170	111.9	295.5	1.4	6902	19949 TWC01 1007D3T .8 1007AF .3 1007AB .3 W14 ROAD TEST & VERIFY, BALANCE ALL 4 TIRES & CHECK ROAD FORCE 42 & 44 OF ROAD FORCE R FRONT & L REAR TIRE. REPLACE BOTH TIRES REBALANCE. RETEST OK.	C S THAT THERE IS A SHIMY IN THE FT AT HIGHWAY SPEEDS REPLACING PASSENGER SIDE WHEEL C/S FRONT END SHAKES ALOT WHILE DRIVING
2007 1FMCU941X7K	27-Jun-06	13-Jul-06	OURISMAN F	33781405 5K01 *	1007 *	A99	82 07	4-Jun-07	11	16237	0	283.08	297.23	0	129	WORK COMPLETED REPLACE, MOUNT AND BALANCE TWO TIRES AND PERFORM FRONT END ALIGNMENT	PE08-060 1480
2006 1FAFP53U46	17-Jan-06	1-Feb-06	OASIS FORD	1625851 5K01 *	1007 *	A99	82 07	15-Aug-07	19	28245	167	137.85	304.85	0	3604		

2005	1FTRF12245N	16-Mar-05	31-Mar-05	DICK EDWAF	359612A 5K01 4L3Z	1015 CA	A99	82 07	30-Jul-07	29	54303	180.27	74	352.14	0	5205	RR WHEEL SLOOSE. INSPECT AND FOUND RR WHEEL HAS COME LOOSE RUINING ALL THE LUG NUTS,LUG STUDS AND WHEEL. MOUNT AND BALANCE 1 WHEEL.REPLACE LUG NUT	CUSTOMER STATES RIGHT REAR IS LOOSE. MOUNT AND BALANCE TIRE(S) SUPERDUTY E/F STANDARDADD TIRE TAX FOR EACH TIRE
2006	1FMEU75816U	2-Mar-06	7-Mar-06	BEACH FORI	9574209 5K01 *	1007 *	H62	42 07	23-Jul-07	17	35355	340.08	37.2	377.28	0	6727	CP:1007 MENU MOUNTED AND BALANCED 2 TIRES DOT AP8T TY81 1007 (2806)	REPLACE 2 FRONT TIRES WITH MICHELIN CROSS TERRAIN 235 70R16, PER QFC BILLING C S REPAIR FLAT TIRE IN TRUNK OF VEH GOES TO FRONT RIGHT SIDE CK ANDADVISE TIRES ON FRONT ARE BALD ON EDGE MOUNT AND BALANCE 4 TIRES BFG LONGTRAIL T A \$105.95 EACH P235 70 R16
2006	1FMEU73E46UA	5-Dec-05	6-Jan-06	SANTA MARC	359244C 5K02 F42Z	1700 A	A99	82 07	28-Jun-07	18	35449	339.92	30	396.5	0	1597	35449 060 REPLACED 2 TIRES MOUNTED & BALANCED TIRES SET TIRE PRESSURE REPLACED VALVE STEM SEALS OLD DOT CODES # B37P JE7X 4505 X 2 NEW DOT CODES # B37P PA7X 1307 X 1 # B37P PA7X 3706 X 1 FLAG 428	REPLACE 2 FRONT TIRES WITH MICHELIN CROSS TERRAIN 235 70R16, PER QFC BILLING C S REPAIR FLAT TIRE IN TRUNK OF VEH GOES TO FRONT RIGHT SIDE CK
2007	1FAFP53U87A	5-Sep-06	28-Dec-06	HARRELSON	7408151 5K01 YF1Z	1007 FA	A99	82 07	25-Jul-07	7	7732	146.08	260.07	415.52	0	1071	MOUNT & BALANCE 1 TIRE & WHEEL	ANDADVISE TIRES ON FRONT ARE BALD ON EDGE MOUNT AND BALANCE 4 TIRES BFG LONGTRAIL T A \$105.95 EACH P235 70 R16
2006	1FAFP36NX6W	9-Dec-05	28-Dec-05	FORT MILL F	117336A 5K01 *	1007 *	A99	82 07	9-Jul-07	19	36806	343.8	56.05	420.48	0	1015	36806 1.0 REPALCED FOUR TIRES	REPLACE ALL FOUR TIRES HOWLING TYPE NOISE AT FREEWAY SPEEDS SEE ADVISOR 1ST \$439.80 TIRES IN NEED OF REPLACEMENT 235 70R 16
2006	1FMEU73E26U	7-Dec-05	28-Dec-05	RANCHO FOI	47792604 5K01 *	1007 *	A99	82 07	18-Aug-07	20	60481	374.2	60	434.2	0	5432	MOUNT AND BALANCE TIRES . COMPLETED ALL FOUR TIRES	REPLACE ALL FOUR TIRES
2006	1FMEU73E76Z	20-Dec-05	4-Jan-06	BLUEBONNE	47184205 5K01 *	1007 *	B65	42 07	26-Jun-07	18	64121	361.86	40	438.76	0	4570	MOUNT AND BALANCED	HOWLING TYPE NOISE AT FREEWAY SPEEDS SEE ADVISOR 1ST \$439.80 TIRES IN NEED OF REPLACEMENT 235 70R 16
2006	1FMYU93116K	3-Nov-05	12-Dec-05	FOLSOM LAK	51934403 5K01 *	1007 *	A99	82 07	30-Jul-07	20	28640	0	439.81	439.81	0	7727	REPLACED TIRES	CONTINENTALS MOUNT & BALANCE ONE TIRE & WHEEL (DAMAGED)
2006	1FMEU73E66Z	20-Dec-05	10-Jan-06	FOLSOM LAK	51948203 5K01 *	1007 *	A99	82 07	31-Jul-07	19	40856	0	440	440	0	7727	WORN OR DAMAGED REPLACED 4 TIRES 440.00	CONTINENTALS MOUNT & BALANCE ONE TIRE & WHEEL (DAMAGED)
2007	2FMDK49C57E	12-Mar-07	10-Apr-07	MULLAHEY F	18032907 5K01 7L2Z	1007 E	B65	42 07	23-Jul-07	4	10569	421.9	25.73	480.33	0	7944	MOUNT & BALANCED ONE TIRE.	CONTINENTALS MOUNT & BALANCE ONE TIRE & WHEEL (DAMAGED)
2003	1FMZU63K83Z	18-Feb-03	5-Mar-03	SANTA MARC	358122D 5K02 F42Z	1700 A	A99	30 07	7-Jun-07	52	104524	441.68	127.2	488.68	0	1597	104524 120 REPLACED ALL 4 TIRES MOUNTED & BALANCED TIRES SET TIRE PRESSURE REPLACED VALVE STEM SEALS OLD DOT CODES # B37P DH8X 0503 X 3 # B37P DH8X 3403 X 1 NEW DOT CODES # A308 46KW 4706 X 2 # A30 428	TIRE1 REPLACE ONE TIRE TO INCLUDE NEW STEM SEAL AND MOUNT AND BALANCE
2006	1FMEU73E26U	6-Dec-05	22-Dec-05	APPLE FORD	48745302 5K01 *	1007 *	A99	82 07	31-Aug-07	21	26598	405.87	97.28	509.91	0	84	A99 82 1007 COMPLETED	REPLACE THREE (3) TIRES MOUNT AND BALANCE

2007	1ZVHT85H175	31-Jan-07	8-Feb-07	LIBERTY FOF	197175A 5K01 6R3Z	1007 H	A99	82 07	31-Jul-07	6	5133	495.45	42.64	538.09	0.5	2222	5133 REPLACED TIRE, WHEEL, PRESSURE SENSOR AND WHEEL STRAP. TRAINED TIRE PRESSURE SENSORS.	CUST STATES RT REAR TIRE HAS BUBBLE IN SIDEWALL HIT POTHOLE CUST STATES MOUNT AND BALANCE 4 TIRES
2006	1FMEU73E06U	7-Dec-05	22-Dec-05	DONLEY FOF	30333701 5K01 *	1015 *	A99	82 07	27-Jun-07	19	50593	541.16	32	573.16	0	3383	DONE AUTH# RMSA	C R ESTIMATE TO REPLACE 2 FRONT TIRES APPROVAL HENCUR07232014
2006	1FAFP27116G	24-Apr-06	10-May-06	SAWGRASS	65564202 5K01 *	1007 *	H62	42 07	20-Aug-07	16	33699	487.2	81.31	597.75	0	4908	1 QUALITY FLEET CARE MOUNT AND BALANCE 4 TIRES 1.0	MOUNT AND BAL 4 TIRES P22560R16 97S MICH. SYM BLACK DF 6 DR 5 1 2 PF 3 PR 4 4 NEW TIRES MICHELIN CROSS TERRAIN 235 70R16 ROTATE AND BALANCE 4 WHEELS C S GET PRICES FOR NEW TIRES AND GET TREAD MEASUREMENTS. HEWLETT PACKARD. TIRE4 REPLACE ALL FOUR TIRES TO INCLUDE NEW STEM SEALS AND MOUNT AND BALANCE
2006	2FMZA51656E	12-Dec-05	28-Dec-05	COURTESY F	7045301 5K01 *	1007 *	A99	82 07	19-Jun-07	18	63330	528.56	87.68	616.24	0	6743	REF NUMBER TRPC MOUNTED AND BALANCED 4 TIRES	
2006	1FMEU73E96U	7-Dec-05	31-Dec-05	PHIL LONG F	77939901 5K01 *	1007 *	A99	82 07	22-Jun-07	18	20799	607.8	48	655.8	0	3140	REPLACED 4 TIRES QUALITY FLEET CARE	
2006	1FMEU73E76U	1-Dec-05	16-Dec-05	APPLE FORD	48577102 5K01 *	1007 *	A99	82 07	14-Aug-07	21	21924	541.16	121.61	669.53	0	84	A99 82 1007 REPLACED ALL 4 TIRES.	
2006	1FMEU73E06U	7-Dec-05	23-Dec-05	APPLE FORD	48732702 5K01 *	1007 *	A99	82 07	30-Aug-07	21	43184	645.61	162.14	818.04	0	84	A99 82 1007 REPLACED ALL 4 TIRES AND PUT NEW BAND SENSOR ON	
2006	1FMEU73E16Z	12-Dec-05	29-Dec-05	SANTA MARC	361152C 5K02 F42Z	1700 A	A99	82 07	3-Aug-07	20	34997	735.85	127.2	920.91	0	1597	34997 120 FLAG 125 1.2 REPLACED 4 TIRES MOUNT AND BALANCE	
2003	2FAFP71W83X	17-Jul-02	15-Aug-02	WALNUT CRI	538416A 5K01 5W7Z	1007 AA	B66	D9 07	12-Jul-07	60	17538	70.9	0	70.9	0	7820	OVER THE COUNTER PART INV#537802 07 05 07 1	OVER THE COUNTER PART INV537802 DATE 07 05 07 MILES 1
2004	2FAFP71W34X	2-Sep-03	16-Feb-04	WALNUT CRI	538415A 5K01 5W7Z	1007 AA	B66	D9 07	12-Jul-07	42	59692	70.9	0	70.9	0	7820	OVER THE COUNTER PART 537926 07 09 07 1	OVER THE COUNTER PART 537926 DATE 07 09 07 MILES 1
2003	2FAFP71W03X	6-May-02	8-Aug-02	WALNUT CRI	542656A 5K01 5W7Z	1007 AA	B66	D8 07	30-Aug-07	62	92073	69.85	34.76	104.61	0.3	7820	92073 INSPECTED AND VERIFY CONCERN W94 FOUND RIM LEAKING INSIDE AT SEAM OF RIM REMOVED AND REPLACED RIM RECHECK FOR LEAKS ALL OK	CUST STATES TIRE IS LEAKING POSSIBLE BAD RIM CHECK SHIMMY AT INTERSTATE SPEEDS,CUSTOMER WAS TOLD BY OTHER REPAIR FACILITY RIMS LOOK TO BE WARPED PERFORM RECALL PER INSTRUCTIONS 29B01B
2003	2FAFP71W53X	3-Feb-03	13-Feb-03	BUTCH OUST	157812A 5K01 5W7Z	1007 AA	N23	13 07	19-Jun-07	53	66043	139.7	37.57	177.27	0.5	6422	66622 INPSECTED ALL RIMS AND FOUND FRONT RIMS TO BE WARPED. ORDERED AND REPLACED FRONT RIMS APP CODE WBBHS INSPEC FIVE WHEEL RIMS, FOUND NO DEFECTIVE WHEELS RIMS	PERFORM RECALL PER INSTRUCTIONS 29B01B
2005	2FAFP71W85X	26-May-05	28-Sep-05	JORGENSEN	951102 5K01 *	** *	*	29E	29-Aug-07	24	20456	0	34.25	34.25	0.4	3523	29B01B APP CODE WBBKZ INSPEC FIVE WHEEL RIMS INSPEC OK	PERFORM RECALL PER INSTRUCTIONS 29B01B
2005	2FAFP71W65X	26-May-05	12-Oct-05	JORGENSEN	928602 5K01 *	** *	*	29E	22-Aug-07	23	15993	0	34.25	34.25	0.4	3523	OK	PERFORM RECALL PER INSTRUCTIONS 29B01B



2005	2FAFP71W35X168019	26-May-05	12-Oct-05	JORGENSEN	877801	5K01	*	**	*	*	29E	8-Aug-07	23	18055	0	34.25	34.25	0.4	3523	29B04B APP CODE WBBJX RECALL PERFORMED 0 WHEELS AFFECTED	PERFORM WHEEL RECALL RECALL 07S28 POLICE INTERCEPTER WHEEL INSPECTION ***APPR CODE (WBSX)*** PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAHP71W05X	23-Jun-05	25-Apr-06	FIESTA FORI	3948951	5K01	*	**	*	*	29E	7-Aug-07	16	31833	68.21	56.92	125.13	0.7	5439	0 CHECK WHEELS REPLACE 1 WHEEL PER RECALL AND ROD TE ST	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	26-May-05	31-Aug-05	JORGENSEN	926702	5K01	*	**	*	*	29E	22-Aug-07	25	54558	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBBGN INSP & REPLACE 1 WHEEL 29B01C OK CODE WBBVS INSPECT ALL WHEELS NECESSARY TO REPLACE 1 FOR PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	27-May-05	11-Aug-05	JORGENSEN	879001	5K01	*	**	*	*	29E	8-Aug-07	25	45700	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBBPN INSPECT 5 WHEELS NECESSARY TO REPLACE 1 WHEEL	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X	26-May-05	12-Oct-05	JORGENSEN	928502	5K01	*	**	*	*	29E	22-Aug-07	23	13064	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBB3U INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE ONE WHEEL RIM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	26-May-05	6-Oct-05	JORGENSEN	935702	5K01	*	**	*	*	29E	24-Aug-07	23	48501	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBBJZ RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	25-May-05	15-Aug-05	JORGENSEN	937502	5K01	*	**	*	*	29E	24-Aug-07	25	64214	69.85	59.93	129.78	0.7	3523	29B01 INSPECT FIVE WHEEL RIM, REPLACE ,BALANCE ONE WHEEL RIM	PERFORM WHEEL INSPECTION RECALL 29B01 FORD RECALL 29B01 RECALL WHEELS
2005	2FAFP71W25X	26-May-05	9-Sep-05	JORGENSEN	851201	5K01	*	**	*	*	29E	1-Aug-07	24	80030	69.85	59.93	129.78	0.7	3523		
2005	2FAFP71W35X	28-Feb-05	5-Apr-05	CLINTON FAI	3680501	5K01	*	**	*	*	29E	13-Jun-07	27	27523	136.42	75.41	211.83	1	1142	MOUNT AND BALANCED 2 WHEELS AUTH #WBB1U REPLACED 2 WHEELS. MOUNT & BALANCED 2 R S TIRES	
2005	2FAHP71W85X	2-May-05	6-Jul-05	NEW HOLLAI	43939001	5K01	*	**	*	*	29E	14-Jun-07	24	98790	139.7	75.11	214.81	1	1360		RECALL 07S48 29B01 RIMS RECALL 07S48 CHUCK MUST CALL FORD BEFORE PUTTING ON RIMS S R 07S48:S#1 C 2003 2005 M Y C V P INTERCEPTOR CVPI VEHICLES 16 INCH WHEEL REPLACEMENT RECALL RIMS, CB MUST CALL FORD BEFORE INSTALLING RIMS NEED TO KNOW HOW MANY
2005	2FAFP71W05X	2-May-05	25-May-05	NORRIS FOR	9122850	5K01	*	**	*	*	29E	10-Jul-07	26	63960	136.42	79.74	216.16	1	34	RECALL STEEL WHEEL	
2005	2FAFP71W75X	27-Jan-05	24-Feb-05	NEW COUNT	234961C	5K01	*	**	*	*	29E	7-Jun-07	28	53660	139.7	78	217.7	1	20551	INSPECTED AND REPLACED 2 WHEELS PER 29B01 PRIOR AUTH WBBWW	
2005	2FAFP71W25X	3-May-05	1-Jun-05	NORRIS FOR	9117650	5K01	*	**	*	*	29E	9-Jul-07	26	68859	139.7	79.74	219.44	1	34	RECALL STEEL WHEEL	
2005	2FAFP71WX5X	26-May-05	12-Oct-05	JORGENSEN	911401	5K01	*	**	*	*	29E	17-Aug-07	23	36731	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBYV INSPECT 5 WHEELS NECESSARY TO REPLACE 2 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71WX5X	26-May-05	29-Jul-05	JORGENSEN	955702	5K01	*	**	*	*	29E	30-Aug-07	26	34613	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBLZ INSP & REPLACE 2 WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS

2005	2FAFP71W65X	26-May-05	31-Aug-05	JORGENSEN	916702	5K01	*	**	*	*	29E	20-Aug-07	24	49088	139.7	85.62	225.32	1	3523	29B01D APP CODE WBB9N INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X	27-May-05	1-Sep-05	JORGENSEN	921002	5K01	*	**	*	*	29E	21-Aug-07	24	51108	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBQT INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	27-May-05	31-Aug-05	JORGENSEN	916902	5K01	*	**	*	*	29E	20-Aug-07	24	55921	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBFR INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS
2005	2FAFP71W35X	26-May-05	19-Aug-05	JORGENSEN	931502	5K01	*	**	*	*	29E	23-Aug-07	25	57190	139.7	85.62	225.32	1	3523	29B01D APP CODE WBB8T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	26-May-05	31-Aug-05	JORGENSEN	907201	5K01	*	**	*	*	29E	16-Aug-07	24	54386	139.7	85.62	225.32	1	3523	29B01D APP CODE WBB9T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W25X	26-May-05	5-Oct-05	JORGENSEN	850801	5K01	*	**	*	*	29E	1-Aug-07	23	27274	139.7	85.62	225.32	1	3523	1 INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005	2FAFP71W15X	27-May-05	31-Aug-05	JORGENSEN	959701	5K01	*	**	*	*	29E	31-Aug-07	25	67521	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBWS INSPECT 5 WHEELS NECESSARY TO REPLACE MOUNT AND BALANCE 2 AFFECTED WHEELS PER PROGRAM 29B01	WHEEL RECALL.
2005	2FAFP71W05X	27-May-05	23-Aug-05	JORGENSEN	923502	5K01	*	**	*	*	29E	21-Aug-07	25	45434	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBBU INSPEC FIVE WHEEL RIMS,REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	26-May-05	11-Aug-05	JORGENSEN	850601	5K01	*	**	*	*	29E	1-Aug-07	25	42271	139.7	85.62	225.32	1	3523	1 INSPECTED ALL WHEELS.REPLACED 2 WHEELS PER RECALL.	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48 WHEEL INSPECTION PERFORM RECALL
2005	2FAFP71W05X	25-May-05	17-Aug-05	JORGENSEN	882701	5K01	*	**	*	*	29E	9-Aug-07	25	40729	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBZN RECALL PERFORMED REPLACE TWO WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAHP71WX5X	19-Apr-05	6-Oct-05	JOE MACHEN	51146401	5K01	*	**	*	*	29E	17-Jul-07	22	54007	139.7	85.86	225.56	1	8006	APPROVAL CODE WBBRU REPLACE TWO WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W75X	31-Jan-05	28-Feb-05	JOE MACHEN	50785401	5K01	*	**	*	*	29E	14-Jun-07	28	54694	139.7	85.86	225.56	1	8006	APPROVAL CODE WBBYU ...	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAFP71W15X	16-Feb-05	9-Mar-05	CLINTON FAI	3686001	5K01	*	**	*	*	29E	15-Jun-07	28	26200	204.62	90.49	295.11	1.2	1142	RECALL COMPLETED	RECALL 07S48/29B01 WHEELS

2005 2FAHP71WX5X	29-Apr-05	9-Aug-05	FIESTA FORI	3835751	5K01	*	**	*	*	29E	25-Jul-07	24	91586	204.62	97.57	302.19	1.2	5439	LEFT FRONT TIRE HAS EXECIVE ROAD FORCENEED TIRES REMOVE AND REPLACE 3 WHEELS	STEEL WHEEL RECALL CHECK ONE IN TRUNK DONT PUT NEW VALVE STEM PER CUSTOMER NEED TO CALL IN FOR AUTH REF TO 29B07 AUTH #WBBGW FOR 302.20 1.2 LABOR HOURS CUST REQUESTS
2005 2FAFP71W45X	26-Apr-05	18-May-05	NORRIS FOR	8978450	5K01	*	**	*	*	29E	5-Jun-07	25	73465	209.53	95.69	305.22	1.2	34	STEEL WHEEL 29B01E APP CODE WBBWU INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W95X	26-May-05	12-Oct-05	JORGENSEN	906602	5K01	*	**	*	*	29E	16-Aug-07	23	56466	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBWU INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W85X	26-May-05	23-Aug-05	JORGENSEN	941202	5K01	*	**	*	*	29E	27-Aug-07	25	65218	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBSX RECALL PERFORMED 29B01E APP CODE WBBBS INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W85X	25-May-05	29-Jul-05	JORGENSEN	920802	5K01	*	**	*	*	29E	21-Aug-07	26	44261	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBBS INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W85X	26-May-05	17-Aug-05	JORGENSEN	907502	5K01	*	**	*	*	29E	16-Aug-07	25	62956	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBBZ INSP & REPLACE 3 WHEELS. DISMOUNT & REMOUNT & BALANCE.	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W75X	27-May-05	31-Aug-05	JORGENSEN	917302	5K01	*	**	*	*	29E	20-Aug-07	24	67130	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBSR INSPECT 5 WHEELS PER PROGRAM NECESSARY TO REPLACE 3 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W75X	26-May-05	23-Sep-05	JORGENSEN	900201	5K01	*	**	*	*	29E	14-Aug-07	24	34369	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB8S INSPECT 5 WHEELS NECESSAY TO REPLACE MOUNT AND BALANCE 3	PERFORM RECALL PER INSTRUCTIONS WHEEL RECALL
2005 2FAFP71W65X	26-May-05	19-Aug-05	JORGENSEN	932901	5K01	*	**	*	*	29E	23-Aug-07	25	25000	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBGN INSPECT NECESSARY TO REPLACE 3 AFFECTED WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W65X	26-May-05	5-Oct-05	JORGENSEN	954301	5K01	*	**	*	*	29E	30-Aug-07	24	11815	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBMV INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W55X	25-May-05	15-Aug-05	JORGENSEN	894802	5K01	*	**	*	*	29E	13-Aug-07	25	47085	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBPV INSPEC FIVE WHEEL RIMS REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W45X	26-May-05	3-Aug-05	JORGENSEN	902302	5K01	*	**	*	*	29E	15-Aug-07	25	52126	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBEU INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W45X	25-May-05	3-Aug-05	JORGENSEN	926101	5K01	*	**	*	*	29E	22-Aug-07	25	54779	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB1W INSPECT FIVE WHEEL RIMS, REPLACE BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM WHEEL RECALL PER INSTRUCTIONS WHEELS
2005 2FAFP71W35X	26-May-05	18-Aug-05	JORGENSEN	883501	5K01	*	**	*	*	29E	9-Aug-07	25	69734	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB1W INSPECT FIVE WHEEL RIMS, REPLACE BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM WHEEL RECALL PER INSTRUCTIONS WHEELS

2005	2FAFP71W35X	██████████	27-May-05	1-Sep-05	JORGENSEN	916002	5K01	*	**	*	*	29E	20-Aug-07	24	65778	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBRU INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	██████████	26-May-05	29-Sep-05	JORGENSEN	946202	5K01	*	**	*	*	29E	28-Aug-07	24	18095	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBRU RECALL PERFORMED 29B01E APP CODE WBBXX INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W15X	██████████	25-May-05	17-Aug-05	JORGENSEN	915202	5K01	*	**	*	*	29E	20-Aug-07	25	60319	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB8R INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	██████████	26-May-05	23-Aug-05	JORGENSEN	903702	5K01	*	**	*	*	29E	15-Aug-07	25	36097	209.53	102.74	312.27	1.2	3523	29B01 REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS CUSTOMER STATES PERFORM RECALL 29B01
2004	2FAFP71W14X	██████████	11-Feb-04	11-Jan-05	JOE MACHEN	51090001	5K01	*	**	*	*	29E	12-Jul-07	31	54134	209.53	103.03	312.56	1.2	8006	APPROVAL CODE WBBZS ... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71WX5X	██████████	16-Dec-04	28-Mar-05	JOE MACHEN	51312001	5K01	*	**	*	*	29E	31-Jul-07	29	54504	209.53	103.03	312.56	1.2	8006	APPROVAL CODE WBBKZ ... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W75X	██████████	18-Apr-05	6-May-05	JOE MACHEN	51144201	5K01	*	**	*	*	29E	17-Jul-07	27	54599	209.53	103.03	312.56	1.2	8006	APPROVAL CODE WBBPW ... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W25X	██████████	26-Apr-05	4-Oct-05	JOE MACHEN	51674001	5K01	*	**	*	*	29E	29-Aug-07	24	53809	209.53	103.03	312.56	1.2	8006	APPROVAL CODE WBBDF ... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FOR DPROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W05X	██████████7	19-Apr-05	3-Jun-05	JOE MACHEN	51394001	5K01	*	**	*	*	29E	7-Aug-07	27	54545	209.53	103.03	312.56	1.2	8006	APPROVAL CODE WBBYZ ...	RECALL 07S48 FORD PROGRAM 29B01 PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	██████████	26-May-05	28-Sep-05	JORGENSEN	878901	5K01	*	**	*	*	29E	8-Aug-07	23	55084	209.53	119.87	329.4	1.4	3523	29B01F CODE WBBEX REPLACE 3 WHEELS PER PROGRAM 29B01 29B01F APP CODE WBBKT INSPECT NECESSARY TO REPLACE 4 WHEELS PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS WHEEL RECALL 29B01
2005	2FAFP71W05X	██████████	27-May-05	5-Oct-05	JORGENSEN	945902	5K01	*	**	*	*	29E	28-Aug-07	24	3169	279.38	102.74	382.12	1.2	3523	29B01F APP CODE WBBTN INSPECT 5 WHEELS NECESSARY TO REPLACE MOUNT AND BALANCE 4 AFFECTED WHEELS PER PROGRAM 05S28	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71WX5X	██████████	16-Feb-05	9-Mar-05	CLINTON FAI	30562001	5K01	*	**	*	*	29E	18-Jun-07	28	35483	279.38	105.57	384.95	1.4	1142	COMPLETED RECALL 29B01F APP CODE WBBTX INSPECT ALL 5 WHEELS NECESSARY TO REPLACE 4 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS PE08-060 1486
2005	2FAFP71W65X	██████████	27-May-05	27-Sep-05	JORGENSEN	955302	5K01	*	**	*	*	29E	30-Aug-07	24	17959	279.38	119.87	399.25	1.4	3523	29B01F APPROVAL CODE WBBRX 4 WHEELS 29B01F APP CODE WBB9X INSPECT ALL 5 WHEELS NECESSARY TO REPLACE 4 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W25X	██████████	26-May-05	28-Sep-05	JORGENSEN	911102	5K01	*	**	*	*	29E	17-Aug-07	23	52009	279.38	119.87	399.25	1.4	3523	29B01F APPROVAL CODE WBBRX 4 WHEELS 29B01F APP CODE WBB9X INSPECT ALL 5 WHEELS NECESSARY TO REPLACE 4 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS PE08-060 1486

2005 2FAHP71W65X	19-Apr-05	6-Dec-05	JOE MACHEN	51254301	5K01	*	**	*	*	29E	26-Jul-07	20	35566	279.38	120.2	399.58	1.4	8006	REPLACE FOUR WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBJN ...	RECALL 07S48 FORD PROGRAM 29B01 ...
2005 2FAHP71W65X	23-Mar-05	13-Apr-05	TAMIAMI FOF	24191101	5K01	*	**	*	*	29E	17-Jul-07	28	39374	349.23	123.25	472.48	1.6	1286	DISMOUNT TIRES ISALL ON NEW WHEELS WITH VALVE STEAMS AND REBALANCE TIRES OLD WHEEL #S R F 5W73 AA BA R R 4W73 1007 BA L F 5W73 AA BA L R 5W73 AA BA SPARE 3W73 1007 CD	29B01 RECALL CALL S.S.C. GAVE CODES ON WHEELS TOLD TO REPLACE ALL 5 WHEEL
2005 2FAHP71W05X	23-Mar-05	11-Apr-05	TAMIAMI FOF	24107801	5K01	*	**	*	*	29E	6-Jul-07	28	49481	349.23	123.25	472.48	1.6	1286	CALL SPECIAL SUPPORT HAS FOUR 12 HOLE WHEELS ANS 1 SEVEN HOLE 2 OF THE 12 HOLE HAD STAMPS OTHER 2 DID NOT PER SPECIAL SUPPORT REPLACE ALL 5 WHEELS AUTH#WBBDU MOUNT AND BALANCE 5 WHEELS AND REPLACE V ALVE STEAMS	29B01 RECALL
2005 2FAHP71W95X	1-Apr-05	20-Apr-05	NORTHSIDE	133920A	5K01	*	**	*	*	29E	21-Aug-07	29	77012	341.04	135.68	476.72	1.6	8622	AND INSTALLE D ON VEHICLE.	RECALL 29B01 PERFORM RECALL PER INSTRUCTIONS
2005 2FAFP71W95X	26-May-05	5-Oct-05	JORGENSEN	899101	5K01	*	**	*	*	29E	14-Aug-07	23	17275	349.23	136.99	486.22	1.6	3523	INSPECT NECESSARY TO REPLACE 5 WHEELS	RECALL 07S48 PERFORM RECALL PER INSTRUCTIONS
2005 2FAFP71W95X	26-May-05	29-Jul-05	JORGENSEN	921401	5K01	*	**	*	*	29E	21-Aug-07	26	37987	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBFT INSPECT 5 WHEELS NECESSARY TO REPLACE ALL FIVE WHEELS PER PROGRAM 29B01	RECALL 07S48 WHEELS REPLACEMENT PERFORM WHEEL INSPECTION RECALL
2005 2FAFP71W85X	27-May-05	28-Sep-05	JORGENSEN	882201	5K01	*	**	*	*	29E	9-Aug-07	23	34384	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKV INSPECT NECESSARY TO REPLACE 5 WHEELS PER PROGRAM 29B01	07S48
2005 2FAFP71W85X	26-May-05	29-Jul-05	JORGENSEN	889701	5K01	*	**	*	*	29E	10-Aug-07	25	45821	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBFT INSPECT NECESSARY TO REPLACE 5 AFFECTED WHEELS PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W75X	27-May-05	1-Sep-05	JORGENSEN	955801	5K01	*	**	*	*	29E	30-Aug-07	25	49107	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKS INSPECT NECESSARY TO REPLACE 5 WHEELS	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W75X	26-May-05	14-Sep-05	JORGENSEN	899201	5K01	*	**	*	*	29E	14-Aug-07	24	18513	349.23	136.99	486.22	1.6	3523	07S48G INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE FIVE WHEEL RIMS 29B01G APP CODE WBBYT INSPECT REPALCE 5 WHEELS PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS PERFORM WHEEL INSPECTION RECALL 07S48
2005 2FAFP71W65X	27-May-05	31-Aug-05	JORGENSEN	882301	5K01	*	**	*	*	29E	9-Aug-07	24	12914	349.23	136.99	486.22	1.6	3523	PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS PERFORM WHEEL INSPECTION RECALL 07S48

2005	2FAFP71W55X	██████	26-May-05	1-Sep-05	JORGENSEN	921501	5K01	*	**	*	*	29E	21-Aug-07	24	23991	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKV RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48 WHEEL REPLACEMENT
2005	2FAFP71W55X	██████	25-May-05	15-Aug-05	JORGENSEN	845901	5K01	*	**	*	*	29E	31-Jul-07	24	57900	349.23	136.99	486.22	1.6	3523	1 INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE FIVE WHEELS FIVE WHEEL RIMS 1 INSPECT FIVE WHEELS REPLACE FIVE WHEELS AND BALANCE DISABLE 5 WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEEL PERFORM RECALL PER INSTRUCTIONS WHEEL PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAFP71W45X	██████	26-May-05	12-Oct-05	JORGENSEN	847801	5K01	*	**	*	*	29E	31-Jul-07	22	59476	349.23	136.99	486.22	1.6	3523	29B01G APP#WBB2X RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAFP71W45X	██████	26-May-05	5-Oct-05	JORGENSEN	840301	5K01	*	**	*	*	29E	30-Jul-07	23	27203	349.23	136.99	486.22	1.6	3523	29B01G APP#WBBFU RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEEL PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAFP71W05X	██████	26-May-05	5-Oct-05	JORGENSEN	840601	5K01	*	**	*	*	29E	30-Jul-07	23	50060	349.23	136.99	486.22	1.6	3523	29B01G APP#WBB7V RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAFP71W05X	67989	26-May-05	5-Oct-05	JORGENSEN	840401	5K01	*	**	*	*	29E	30-Jul-07	23	29757	349.23	136.99	486.22	1.6	3523	REPLACE FIVE WHEELS AND DISABLE ODL WHEELS AS PER FOR DPROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAHP71WX5X	██████	12-Jan-05	29-Jul-05	JOE MACHEN	51071001	5K01	*	**	*	*	29E	10-Jul-07	24	54485	349.23	137.38	486.61	1.6	8006	APPROVAL CODE WBBUV ... REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD RPROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W65X	██████	29-Mar-05	14-Apr-05	JOE MACHEN	51391401	5K01	*	**	*	*	29E	7-Aug-07	29	54538	349.23	137.38	486.61	1.6	8006	APPROVAL CODE WBBRS ... REPLACE FIVE WHEELS AND DISABLE ODL WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W65X	██████	14-Dec-04	29-Mar-05	JOE MACHEN	51349301	5K01	*	**	*	*	29E	3-Aug-07	29	54601	349.23	137.38	486.61	1.6	8006	APPROVAL CODE WBBKU ... REPLACE SIX WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W45X	██████	31-Jan-05	17-Feb-05	JOE MACHEN	51048101	5K01	*	**	*	*	29E	9-Jul-07	30	54250	349.23	137.38	486.61	1.6	8006	APPROVAL CODES IS WBB9X REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FOR DPROGRAM 29B01	FORD RECALL 07S48 PROGRAM 29B01 ...
2005	2FAHP71W15X	██████	16-Dec-04	10-Mar-05	JOE MACHEN	50855702	5K01	*	**	*	*	29E	20-Jun-07	28	54356	349.23	137.38	486.61	1.6	8006	APPROVAL CODE WBBFU ... REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W05X	██████	30-Mar-05	14-Apr-05	JOE MACHEN	50822301	5K01	*	**	*	*	29E	18-Jun-07	27	54532	349.23	137.38	486.61	1.6	8006	APPROVAL CODE WBBNN ... PERFORM RECALL 07S48 INSPECT FIVE WHEELS REPL FIVE WHEELS MOUNT AND BALANCE FIVE TIRES	RECALL 07S48 FORD PROGRAM 29B01 07S48 WHEEL INSPECTION ADDED BY GARY
2005	2FAFP71W05X	██████	28-Sep-04	18-Mar-05	HUB CITY FC	124821B	5K01	*	**	*	*	58E	29-Aug-07	30	65045	0	32.21	32.21	0.5	4918	RECALL 58B01 COMPLETED	RECALL 58B01
2005	2FAFP71W35X	██████	26-Oct-04	29-Nov-04	JONES FORC	7271802	5K01	*	**	*	*	58E	2-Aug-07	33	43956	0	32.93	32.93	0.5	6721	1 ONE TIME INSPECTION OF STEEL WHEELS OK	RECALL 58B01
2005	2FAFP71W85X	██████	8-Dec-04	5-Jan-05	COMMERCIA	055451B	5K01	*	**	*	*	58E	29-Jun-07	31	26144	0	34.05	34.05	0.5	4405	INSPECT THE ENGINEERING PART NUMBER SUFFIX ON A LL WHEELS INCLUDING SPARE, ALL OK	59B01 INSPECTION OF STEEL WHEELS

2004	2FAFP71W84X	19-Jan-04	4-Feb-04	GOLDEN CIR	222549D	5K01	*	**	*	*	58E	25-Jun-07	42	73764	0	35.28	35.28	0.5	5885	INSPECTED WHEELS NO REPLACEMENT NECESSARY			A99 RECALL 58B01,INSPECTION OF RIMS RECALL 07S48 WHEEL INSPECTION REPLACEMENT PER DINO USE REF 58B01 RECALL 58B01 ONE TIME INSPECTION
2003	2FAFP71W83X	18-Nov-02	21-Mar-03	PARADISE FC	1588251	5K01	*	**	*	*	58E	2-Jul-07	53	92936	0	36.93	36.93	0.5	3942	RECALL 07S48 INSPECT ONLY RECALL 07S48			
2003	2FAFP71W63X	3-Oct-02	29-Nov-02	RANDALL NC	322028B	5K01	*	**	*	*	58E	7-Jun-07	56	132153	0	37.43	37.43	0.5	2524	PERFORMED RECALL 58B01 PERFORM 58 B01 INSPECTION .WHEELS ARE OF THE LATEST RELEASE.			58B01 WHEEL INSPECTION
2004	2FAHP71W54X	13-Jan-04	2-Feb-04	DAYTONA LI	11071202	5K01	*	**	*	*	58E	15-Aug-07	44	58074	0	37.84	37.84	0.5	10378	RECALL 04M05 VEHICLE DOES NOT APPLY BECAUSE IT SHOWS NONE OF THE SYMPTOMS LISTED IN THE CUSTOMER SATISFACTION PORTION OF THE RECALL, (INSPECTED ALL5 WHEELS FOR ENGINEERING PART			
2004	2FAFP71W04X	12-Feb-04	27-Feb-04	HELLER FOR	17970403	5K01	*	**	*	*	58E	27-Jun-07	41	137084	0	37.94	37.94	0.5	20054	AND BUILD CODE) 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B			RECALL 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2003	2FAFP71WX3X	3-Apr-03	30-May-03	FORD OF CLI	1061341	5K01	*	**	*	*	58E	19-Jul-07	51	106919	0	38.42	38.42	0.5	8951	INSPECTION OF STEEL WH	EELS WHEN REQUESTED B		CUSTOMER STATES PERFORM RECALL 58
2003	2FAHP71W43X	25-Mar-03	16-Apr-03	ENFIELD FOF	15422105	5K01	*	**	*	*	58E	27-Jul-07	53	85514	0	39.41	39.41	0.5	8821	INSPECTED WHEELS AND FOUND WHEELS TO BE OK AA CODES . OK			INSPECTION OF STEEL WHEELS CUST STATES PERFORM RECALL 58
2005	2FAHP71W45X	29-Jul-04	26-Oct-04	ENFIELD FOF	15414203	5K01	*	**	*	*	58E	25-Jul-07	34	71930	0	39.41	39.41	0.5	8821	CHECK RIMS PER TSBS . CODE AA NO FURTHER INSPECTION NEEDED			INSPECTION OF STEEL WHEELS PERFORM RECALL
2003	2FAHP71W93X	20-Jan-03	19-Feb-03	TOWN & COL	364816B	5K01	*	**	*	*	58E	22-Aug-07	55	120341	0	39.75	39.75	0.5	3365	120341 WHEELS HAVE TO BE REPLACED			07S248, INSPECTION OF STEEL WHEELS 58B01: STEEL WHEEL INSPECTION
2003	2FAHP71W03X	20-Jan-03	19-Feb-03	TOWN & COL	360486C	5K01	*	**	*	*	58E	11-Jun-07	53	117029	0	39.75	39.75	0.5	3365	117029 COMPLETE			58B01: ONE TIME STEEL WHEEL INSPECTION
2003	2FAFP71W03X	1-May-02	14-May-02	TOWN & COL	361367D	5K01	*	**	*	*	58E	26-Jun-07	63	131885	0	39.75	39.75	0.5	3365	131885 COMPLETED INSPECTION			RECALL58B01 ELIGLIBLE ONE TIME INSPECTION OF STEEL WHEELS , REQUESTED BY FLEET CO CUSTOMER REQUESTS RECALL
2003	2FAFP72W03X	30-May-02	26-Jul-02	JORDAN FOF	4153352	5K01	*	**	*	*	58E	8-Jun-07	60	184626	0	40.29	40.29	0.5	4546	RECALL STEEL WHEEL REPLACE			59B01 TO BE PERFORMED.STEEL WHEEL INSPECTION
2003	2FAFP71WX3X	28-Jun-02	18-Jul-02	SAWGRASS	64694701	5K01	*	**	*	*	58E	4-Jun-07	60	64932	0	40.66	40.66	0.5	4908	TECH 48544 2 PREFORMED RECALL INSPECTED ALL WHEELS FAILED			

2003	2FAFP71W43X	30-May-02	17-Jun-02	DEMPEWOLF	1576440	5K01	*	**	*	*	58E	14-Aug-07	63	44314	0	40.92	40.92	0.5	5668	ONE TIME INSPECTION OF ALL FIVE (5) WHEELS FOR ENGINEERING PART # AND BUILD CODE NONE AFFECTED	58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2004	2FAFP71W34X	5-Apr-04	16-Apr-04	DEMPEWOLF	1583740	5K01	*	**	*	*	58E	16-Aug-07	41	24074	0	40.92	40.92	0.5	5668	ONE TIME INSPECTION, OF ALL FIVE (5) WHEELS FOR ENGINEERING PART # AND BUILD CODE NONE AFFECTED WPI	ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2003	2FAFP71WX3X	23-Apr-02	9-May-02	MAXWELL FC	789189F	5K01	*	**	*	*	58E	7-Jun-07	62	112823	0	41.75	41.75	0.5	2923	112823 INSPECTED 58B01A	58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEEL
2003	2FAFP71W33X	25-Oct-02	21-Mar-03	MAXWELL FC	791263A	5K01	*	**	*	*	58E	2-Jul-07	53	102683	0	41.75	41.75	0.5	2923	102683 58B01A .5HRS PERFORM RECALL FSA 58B01 INSPECT STEEL RIMS CLOSED AT WPI	RECALL FSA 58B01 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2003	2FAHP71W73X	2-Apr-03	21-Apr-03	PORCARO FC	65034202	5K01	*	**	*	*	58E	24-Jul-07	52	82666	0	42.5	42.5	0.5	6190	CHECKED RIMS FOR CRACKS ALL WHEELS GOOD . 93130 DID RECALL ON RIMS INSPECT 1769 1007 58B01A 0.5 INSP OK AT THIS TIME	RECALL 58B01 STEEL WHEELS 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2003	2FAFP71W73X	19-Jun-03	7-Jul-03	FRITTS FORI	431340	5K01	*	**	*	*	58E	24-Aug-07	51	38788	0	43.25	43.25	0.5	5557	ALL WHEELS HAVE CF STAMPED INTO WHEELS TECH INSPECTED ALL FIVE WHEELS AND MEET 04MO05 STELL WHEEL PROGRAM NO WHEELS EFFETCED	STEEL WHEEL RECALL 07S48
2003	2FAHP71W93X	22-Apr-03	30-Apr-03	JOHN LANCE	144960A	5K01	*	**	*	*	58E	3-Jul-07	51	93130	0	43.3	43.3	0.5	2284	PERFORM RECALL 58B01 STEEL WHEELS INSPECTION TECH. PERFORM STEEL WHEELS INSPECTION FOUND ALL STEEL WHEELS INCLUDING SPARE ENGINEERING PART NUMBER SUFFIXES END WITH CG. PROCEED TO INSPECT FOR LEAKS 10 CC 42 AIRED ALL 4 TIRES, TPM DIAG FOUND 0PSI AT ALL 4 WHEELS NECESSARY TO REPROGRAM TIRE SENSORS LUGNUT COVER CAME UNATTACHED, INSTALL RIGHT FRONT LUG NUT COVER PART ONLY	CUSTOMER STATES RECALL 58B01 INSPECTION OF STEEL WHEELS AIR TIRES AND RESET TIRE LIGHT.NO CHARGE LINE. CUSTOMER STATES PASS SIDE LUG NUT COVE CAME UNATTACHED CUSTOMER REQUESTS REPLACE LUG NUT COVER
2003	2FAFP71WX3X	23-Jul-02	29-Jul-02	NORTH BRO	204990D	5K01	*	**	*	*	58E	2-Aug-07	62	1769	0	43.5	43.5	0.5	2975	PERFORM RECALL 58B01 STEEL WHEELS INSPECTION TECH. PERFORM STEEL WHEELS INSPECTION FOUND ALL STEEL WHEELS INCLUDING SPARE ENGINEERING PART NUMBER SUFFIXES END WITH CG. PROCEED TO INSPECT FOR LEAKS 10 CC 42 AIRED ALL 4 TIRES, TPM DIAG FOUND 0PSI AT ALL 4 WHEELS NECESSARY TO REPROGRAM TIRE SENSORS LUGNUT COVER CAME UNATTACHED, INSTALL RIGHT FRONT LUG NUT COVER PART ONLY	RECALL 58B01 STEEL WHEELS 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2004	2FAFP71W04X	24-Sep-03	13-Aug-04	DON CHALMI	3921041	5K01	*	**	*	*	58E	19-Jun-07	35	85032	0	43.98	43.98	0.5	1487	PERFORM RECALL 58B01 STEEL WHEELS INSPECTION TECH. PERFORM STEEL WHEELS INSPECTION FOUND ALL STEEL WHEELS INCLUDING SPARE ENGINEERING PART NUMBER SUFFIXES END WITH CG. PROCEED TO INSPECT FOR LEAKS 10 CC 42 AIRED ALL 4 TIRES, TPM DIAG FOUND 0PSI AT ALL 4 WHEELS NECESSARY TO REPROGRAM TIRE SENSORS LUGNUT COVER CAME UNATTACHED, INSTALL RIGHT FRONT LUG NUT COVER PART ONLY	STEEL WHEEL RECALL 07S48
2003	2FAHP71W83X	5-Jun-03	23-Oct-03	FIESTA LINC	11385006	5K01	*	**	*	*	58E	24-Jul-07	46	79382	0	45.18	45.18	0.5	11896	PERFORM RECALL 58B01 STEEL WHEELS INSPECTION TECH. PERFORM STEEL WHEELS INSPECTION FOUND ALL STEEL WHEELS INCLUDING SPARE ENGINEERING PART NUMBER SUFFIXES END WITH CG. PROCEED TO INSPECT FOR LEAKS 10 CC 42 AIRED ALL 4 TIRES, TPM DIAG FOUND 0PSI AT ALL 4 WHEELS NECESSARY TO REPROGRAM TIRE SENSORS LUGNUT COVER CAME UNATTACHED, INSTALL RIGHT FRONT LUG NUT COVER PART ONLY	OKAY NO LEAK. ALL TIRES PRESSURE AT 35 PSI SPECS..VEHICLE PASS INSPECTION.
2003	2FAHP70WX3X	1-May-02	3-Jun-02	FOLSOM LAK	51924203	5K01	*	**	*	*	58E	28-Jul-07	63	21286	0	53.14	53.14	0.5	7727	REPLACED LUGNUT WITH MISSING CAP	CUSTOMER STATES RECALL 58B01 INSPECTION OF STEEL WHEELS AIR TIRES AND RESET TIRE LIGHT.NO CHARGE LINE. CUSTOMER STATES PASS SIDE LUG NUT COVE CAME UNATTACHED CUSTOMER REQUESTS REPLACE LUG NUT COVER
2007	1FMEU31K47U	16-Mar-06		NORTH BRO	203975D	5K01	*	1007	*	G29	42 E8	17-Jul-07	-1	10	0	0	0	0	2975	REPLACED LUGNUT WITH MISSING CAP	PE08-060 1490
2005	1FAFP36N65W	13-Aug-04	26-Apr-05	HONOLULU F	3637053	5K01	6S4Z	1012	BA	B65	33 E8	12-Jul-07	27	34578	4.82	0	4.82	0	7705	REPLACED LUGNUT WITH MISSING CAP	CUSTOMER REQUESTS REPLACE LUG NUT COVER
2007	1FAHP34N47W	29-Sep-06	23-Feb-07	SUNSET AUT	3693906	5K01	6S4Z	1012	BA	B65	33 E8	17-Jul-07	5	14782	4.82	0	4.82	0	8198	REPLACED LUGNUT WITH MISSING CAP	CUSTOMER REQUESTS REPLACE LUG NUT COVER



2006	1FTPX12596F	17-Jan-06	26-Aug-06	CAMPBELL F	030900E 5K02 *	1130 *	B66	39 E8	10-Aug-07 12	21854	0	7.16	7.16	0.1	2744	CONCERN REPLACED CENTER CAP AFTER RECEIVING PRIOR APPROVAL FROM DIGITAL IMAGING PAAMU. SOP CENTER CAP TESTED HEARD NOISE COMING FROM DRIVERS TIRE WHEEL AREA REMOVED WHEEL COVER ROAD TESTED NOISE GONE INSTALLED ANTI SEIZE ON CONTACT POINTS OF WHEEL COVER ROAD TESTED NOISE	CUSTOMER STATES CENTER CAP ON DRIVERS REAR MISSING FORD EMBLEM CUSTOMER STATES THERES STILL A NOISE PRESENT IN FRONT END THAT CAN BE HEARD WHEN SLOWING DOWN WITH THE WINDOWS DOWN.
2005	1FAFP34N15W	17-Dec-04	22-Apr-05	SARAT FORC	26545402 5K02 *	1130 *	N50	41 E8	3-Jul-07 27	24501	0	7.56	7.56	0.1	9137	GONE	
2006	1FAFP34N76W	26-Jul-05	20-Aug-05	TEXAN FORC	400068F 5K02 6S4Z	1K011 A	B66	33 E8	22-Aug-07 25	31231	8.71	0	8.71	0	2488	31231 REPLACE TWO LUG NUT COVER	LUG NUT COVER
2005	1FAFP34N35W	22-Jun-04	11-Jul-05	ROBERTS FC	150062A 5K02 *	1130 *	N50	42 E8	23-Jul-07 25	19082	0	9.15	9.15	0.1	9883	19082 TEST DROVE WITH CUSTOMER AND HEARD SQUEAKING NOISE FROM RT FRONT WHEEL AREA. CHECKED AND FOUND COMING FROM HUB CAP. REPOSITION AND NOISE IS	ROARING SOUND LEFT REAR
2005	1FDAF57P15E	20-Nov-04	24-Feb-05	GARY YEOM	58319301 5K01 5C3Z	1012 AA	B65	42 E8	14-Aug-07 31	31989	1.43	8	9.43	0.1	4790	1 REPLACED ROUNDED LUG NUT, TORQUED TO SPEC.	SOP LUG NUT BAD RO 579592
2006	1FAFP34N36W	28-Mar-06	12-Apr-06	BARBER FOF	6704902 5K01 6S4Z	1012 BA	B65	5 E8	4-Aug-07 16	25066	4.82	6.8	11.62	0.1	3982	REPLACE RIGHT FRONT LUG NUT VERIFIED SILVER CAP CAME UNATTACHED FROM LUG NUT, REPLACED LUG NUT, RETESTS OK.	RIGHT FRONT LUG NUT CHROME CAME OFF
2005	1ZVFT82H655	11-Feb-05	19-May-05	KRUG HILLT	1973801 5K01 6W7Z	1012 BA	B65 D4	E8	15-Aug-07 28	35802	4.31	8.32	12.63	0.1	1758	7921	SILVER CAP CAME UNBOUND FROM LUG NUT PORTION
2006	1FAHP34N26W	30-Aug-05	17-Jun-06	KOETTING F	15877702 5K02 6S4Z	1K011 A	B65	33 E8	13-Aug-07 15	9058	4.67	8.86	13.53	0.1	8205	1K011 33 B65 REPLACE WHEEL LUG CAP CAME OFF	CUST STATES LEFT WHEEL LUG MISSING COVER CHECK AND ADVISE
2006	1FMEU65E96U	10-May-06	15-Aug-06	CHAMPION F	526666B 5K02 6L2Z	1130 AA	B65	81 E8	2-Aug-07 12	18551	5.75	7.88	13.63	0.1	4617	18551 REMOVED THE TIRE OF THE VEHICLE AND REMOVED THE WHEEL CENTER CAP AND REPLACED IT, REAR WHEEL CENTER CAP CHROME WAS	C S THE CHROME IS PEELING OFF THE PASSENGER REAR WHEEL CENTER CAP
2007	1FAFP53U07A	5-Sep-06	29-Dec-06	DAVIDSON M	093452A 5K01 *	1007 *	H62	42 E8	11-Jun-07 6	14124	0	13.8	13.8	0	7509	CHECKED AND REPAIRED RIGHT REAR TIRE	REPAIR RIGHT REAR TIRE
2006	1FAHP36N36W	31-Oct-05	12-Feb-06	LANDMARK F	672968D 5K02 6S4Z	1K011 A	B65	33 E8	9-Aug-07 19	9833	4.35	9.64	13.99	0.1	8559	9833 REPLACE MISSING LUG NUT COVER ON L R WHEEL.	MISSING WHEEL LIGNUT COVER
2005	1MEFM50U15A	9-Nov-04	24-Nov-04	DOUG STANI	284362A 5K02 *	1130 *	N12	42 E8	26-Jul-07 33	34182	0	14.83	14.83	0.2	2635	34185 PERFORM SHORT ROAS TEST TO VERFIY NOISE WAS ABLE TO PINPOINT NOISE COMING FROM RIGHT HUB CAP RESUCURED HUB AND RETEST TO VERFIY REPAIR.	CUSTOMER STATES THERES A SCRAPING NOISE WHILE DRIVING THE VEHICLE.
2005	1FAFP38Z65W	26-Aug-04	18-Jun-05	SOUTHWAY	647546B 5K02 *	1130 *	T53	33 E8	25-Jun-07 25	34118	0	15.25	15.25	0.2	4522	34118 THREE CENTER CAPS CAME LOOSE FP 1130 CC 33 RE INSTALLED THREE CENTER CAPS	T53 CUSTOMER STATETS CENTER HUB CAPS KEEP COMING LOOSE

2006	3MEFM07Z96F	2-Dec-05	6-May-06	PEARSON LII	20720501	5K02 *	1130 *	N50	33 E8	6-Jun-07	14	24138	0	15.66	15.66	0.2	12311	COVERS	VERIFY CONCERN. DETERMINED WHEEL COVERS CAUSING NOISE INSULATED FRONT WHEEL	CUSTOMER STATES CLICKING NOISE COMING FROM WHEELS AT SLOW SPEEDS A RATTLE IS HEARD COMING FROM THE RIGHT SIDE
2004	5LMFU28R24L	10-Jun-04	12-Aug-04	NORTH SHOI	181781A	5K02 *	1130 *	N51	33 E8	12-Jun-07	35	48875	0	16.79	16.79	0.2	10004	TIRE SHIELD LOOSE W/O 8/2/07		
2006	1FTPW12516K	11-Nov-05	10-Jun-06	EDDIE YAKLI	133212A	5K01 2L1Z	1012 AA	B65	7 E8	23-Jul-07	14	34118	3.14	14.28	17.42	0.2	4161	34118 TOOK ALL NUTS OFF OF STUDS INSPECTED ALL FOUND NO DAMAGE REPLACED ONE MISSING NUT RETORQED NUTS TO 147 FOOT LBS	CUSTOMER STATES ALL LUGNUTS ARE OVER TIGHTEN AND HAD TO CUT SOME OFF PLEASE INSPECT CUSTOMER STATES ALL OF THE CENTER CAPS COATING IS PEELING OR HAS CORROSION DI AUTH PAAUM	
2005	1FAHP281X5G	11-Mar-05	24-Mar-05	DON CHALMI	4496854	5K02 5G1Z	1130 A	B02	34 E8	20-Aug-07	30	28113	0	17.59	17.59	0.2	1487	ALL FOUR HUB CAPS WERE PEELING. REPLACE THE HUB CAPS.	SOP PART FOR LUG NUTS	
2005	1FDXE45S25H	25-Feb-05	29-Dec-05	CAMPBELL F	028913A	5K01 F2UZ	1012 B	B66	39 E8	25-Jun-07	19	10028	17.75	0	17.75	0	2744	CUSTOMER TOOK PARTS WITH THEM TO INSTALL ON THEIR OWN	CUSTOMER STATES THERE IS A CLICKING FROM WHEELS WHILE DRIVING SEE BOB MAXEY FPR TSB	
2005	3FAFP37NX5F	2-Dec-04	27-Dec-04	VISTA FORD	016669C	5K02 *	1130 *	N50 D4	E8	18-Jul-07	32	27555	0	18.15	18.15	0.2	7923	27555 181 LUBED NOISEY HUB CAPS	CUSTOMER STATES HUB COVER EMBLEM PEALING	
2006	1ZVHT82H86S	29-Mar-06	11-Apr-06	LIBERTY FOF	195274A	5K02 4R3Z	1130 BA	B65	81 E8	7-Jun-07	15	15348	9.97	8.53	18.5	0.1	2222	15348 REPLACE PEALING WHEEL COVER	CUSTOMER STATES THAT THE RIGHT FRONT CENTER CAP IS MISSING	
2006	1FTZR45E36P	1-May-06	22-Aug-06	DEWEY FORI	43298102	5K02 5L2Z	1130 BA	B65	7 E8	6-Jul-07	11	15398	11.09	7.93	19.02	0.1	3540	1 REPLACED CAP RF	FORD EMBLEM ON LEFT FRONT WHEEL PEELING, CENTER CAP	
2005	1FTZR45E25P	20-Sep-04	24-Mar-06	BERGSTROM	10219301	5K02 5L2Z	1130 BA	B65	81 E8	19-Jun-07	16	9020	11.09	8.12	19.21	0.1	6226	REPLACED LF CENTER CAP		
2007	1FAFP34N07W	21-Aug-06	25-Aug-06	MULLINAX FC	168462A	5K01 6S4Z	1012 BA	B65	42 E8	10-Aug-07	12	20150	19.26	0	19.26	0	2157	20150 20150 INSTALLED NEW LUG NUTS ON 3 WHEELS ,STAINLESS COVERS CAME OFF MISSING	CUSTOMER STATES CAPS CAME OFF LUG NUTS CK FOR A SQUEAKING AND CLICKING NOISE FROM LEFT FRONT WHEEL WHILE DRIVING	
2006	1FAFP53U86A	2-Dec-05	17-Dec-05	TED BRITT F	60745301	5K02 *	1130 *	N50	7 E8	2-Jul-07	19	25652	0	19.35	19.35	0.2	48	RESECURED LOOSE WHEEL COVER	CUSTOMER STATES R F AREA HAS A SQUEAK GOING OVER BUMPS	
2005	2MEFM74WX5X	18-Oct-04	29-Apr-05	ELMHURST L	6416851	5K02 *	1130 *	N50	33 E8	2-Jul-07	27	12924	0	19.95	19.95	0.2	13660	WHEEL COVER CONTACT POINTS IN NEED OF LUBE LUBED ALL CONTACT POINTS RECHECKED OK		

2005	1FMZU73K45U	1	2-Dec-04	20-Oct-05	LANDMARK F	667349C	5K02	5L2Z	1130	BA	B65	42	E8	19-Jun-07	21	18573	11.09	9.64	20.73	0.1	8559	18573 WARRANTY ROAD TESTED, HEARD NOISE IN LEFT FRONT, INSPECT ED WHEEL, CHECKED LUGNUTS, OK. R&I CENTER CAP, ROAD TESTED, OK. R&R LEFT FRONT CENTER CAP, RET ESTED, OK.	CHECK FOR CLICK NOISE IN LT FRT WHEEL AREA C S THAT AT 65 MPH THERE IS A VIBRATION COMING FROM THE VEHICLE. PLEASE ADVISE CUSTOMER STATES CLEAR COAT PEELING OFF RIGHT REAR CENTER CAP USE SPO 07204033 RT REAR CENTER CAP LOOSE REAR WHEEL CENTER CAP IS PEELING BOTH FRONT TIRES HAVE SLOW LEAKS, THEY GO DOWN ABOUT 5 PSI IN A WEEK CUSTOMER STATES COVER FOR R/R WHEEL LUG NUT COME OFF
2005	1FMZU77K55U		2-Aug-04	20-Jul-05	COOK-WHITE	012262D	5K01	*	1007	*	N25	D9	E8	18-Jul-07	25	29417	0	21.17	21.17	0.3	4910	28599 OUT OF ROUND NVH DIAG, FT TIRES FEATHERED, ROTATED AND BAL ANCED TIRES, NEEDS TIRES.	
2006	1FAFP28166G		23-Sep-05	16-Sep-06	FERRARIO F	029479D	5K02	5G1Z	1130	BA	B65	81	E8	21-Aug-07	12	12957	15.05	6.48	21.53	0.1	3366	REPLACE WHEEL CENTER WHEEL CAP FELL OFF AND IS NOW GONE	
2007	1FAHP24107G		12-Dec-06	13-Apr-07	NICK NICHOL	5105551	5K02	5G1Z	1130	CA	B65	7	E8	7-Aug-07	4	13272	15.05	6.82	21.87	0.1	1200	REPLACE WHEEL CAP COVER	
2005	1FMDK021X5G	1	31-Mar-05	14-Apr-05	B & B FORD	7750802	5K02	5G1Z	1130	BA	B65	5	E8	16-Aug-07	29	16978	15.05	6.93	21.98	0.1	6329	REPLACE CENTER CAP	
2005	1FMCU96H05K		31-Mar-05	14-Sep-05	DON SEELYE	74693902	5K02	*	1700	*	H62	1	E8	4-Jun-07	21	30218	0	22.35	22.35	0.3	9708	RIGHT FRONT TIRE HAS BAD VALVE STEM,LEFT FRONT TIRE HAS BAD NAIL IN TREAD. REPAIRED BOTH FRONT TIRES.	
2007	1FAHP31N77W		31-Jul-06	6-Sep-06	MOSSY FORI	16092403	5K01	6S4Z	1012	BA	B65	33	E8	16-Aug-07	12	20184	4.82	17.57	22.39	0.2	5428	LUG NUTS COVER COME OFF REPLCE COVER	
2006	1FMEU72E26U		26-May-06	1-Jun-06	KINGS FORD	2210403	5K01	*	1015	*	B65	42	E8	7-Jun-07	13	28096	0	22.59	22.59	0.3	1970	CP: 1015 0.3 VERIFY CONCERN. CHECK TIRE PRESSURE FOUND LEFT FRONT TIRE HAS LOW TIRE PRESSURE. RAISE VEHICLE ON HO	IST AND FOUND NAIL IN LEFT FRONT TIRE. PLUG TIRE AND SET TIRE PRESSURE TO SPEC. ROAD TEST TO VERIFY REPAIR OK.
2006	1ZVFT80N865		22-Dec-05	11-Feb-06	STAR FORD	70377207	5K01	6W7Z	1012	BA	B65	42	E8	9-Jul-07	18	20366	4.31	18.42	22.73	0.2	5537	REPLACED FAULTY LUG NUT .	LOW PRESSURE LIGHT IS ON LUG NUT CHROME LOOSE .
2005	1FAFP24135G		5-Oct-04	28-Oct-04	ATCHLEY FO	36685805	5K02	5G1Z	1130	CA	B65	42	E8	12-Jun-07	32	31620	15.05	7.9	22.95	0.1	7130	REPLACED LEFT REAR HUBCAP REPLACED LEFT REAR CENTER	LEFT REAR HUB CAP EMBLEM IS DISCOLORED CENTER CAP WILL NOT STAY IN PLACE INSTALL SOP COSMETIC COVERS TO WHEEL LUGS
2005	1FAHP28165G		16-Jun-05	17-Aug-05	LAFAYETTE I	4028551	5K02	5G1Z	1130	BA	B65	34	E8	12-Jun-07	23	10533	15.05	7.93	22.98	0.1	960	CAP	CUSTOMER STATES: LEFT REAR CENTER CAP OXIDIZING SOP ORDERED 5074866
2006	1FAFP34N56W		15-Aug-05	9-Sep-05	POWER FOR	228352E	5K02	6S4Z	1K011	A	B65	33	E8	6-Jul-07	23	28585	4.35	19.18	23.53	0.2	5524	REPL MIISING CAP	LEFT FRONT WHEEL CUSTOMER STATES: LEFT REAR CENTER CAP OXIDIZING SOP ORDERED 5074866
2005	1FAFP25105G		27-Jun-05	14-Jul-05	JOE MACHEM	51128701	5K02	5G1Z	1130	BA	B65	D4	E8	16-Jul-07	25	15324	15.05	8.59	23.64	0.1	8006	VERIFIED HUB CAP CONCERN REPLACE LEFT REAR HUB CAP ...	PE08-060-1493 07 13,926

2005	1FAFP25105G	2-May-05	22-Aug-05	MANGOLD FC	9330103 5K02 5G1Z	1130 BA B65 D4 E8	24-Jul-07 24	17362	16.13	7.59	23.72	0.1	20249	TECH REPLACED THE CENTER CAP AUTH#PAA3X	CUST STATES THE CENTER CAP IS PEELING. RIGHT FRONT CENTER CAP PEELING
2005	1FAHP28165G	23-Nov-04	9-Mar-05	SKYLINE SAL	9458203 5K02 5G1Z	1130 BA B65 D4 E8	11-Jun-07 28	19799	15.05	8.8	23.85	0.1	8662 1	REPLACE RF HUB CAP	CUST STATES CENTER CAPS ON LEFT SIDE ARE MERCURY
2007	1FMEU63E17U	20-Sep-06		HOLMAN FOI	379821C 5K02 5L2Z	1130 BA B65 42 E8	16-Jun-07 -1	16055	15.02	8.84	23.86	0.1	1325	16055 CONFIRM COMPLAINT. ONLY 1 IN STOCK, REPLACED R.F. ORDERED 1 MORE.	INSTALL SOP WHEEL CENTER
2007	1FMEU63E17U	20-Sep-06		HOLMAN FOI	380196A 5K02 5L2Z	1130 BA B65 42 E8	22-Jun-07 -1	16365	15.02	8.84	23.86	0.1	1325	16365 R.R. WHEEL CENTER CAP SAYS MERCURY, REPLACED WITH FORD.	CUSTOMER STATES RIGHT FRONT HUB COVER EMBLEM FELL OFF
2005	1FTPW14505K	17-Mar-05	29-Mar-05	DONS FORD,	60500001 5K02 4L3Z	1130 AB B65 33 E8	26-Jul-07 29	17934	17.58	6.53	24.11	0.1	582	1 REMOVE AND REPLACED RIGHT HUB COVER	GUEST STATES CAN HEARA TICK NOISE AT LOW SPEEDS FROM PASSANGER SIDE FRONT.
2005	1FAFP53U45A	7-Dec-04	15-Dec-04	BERGSTROM	10271302 5K02 *	1130 * N50 42 E8	2-Jul-07 31	34296	0	24.35	24.35	0.3	6226	ROAD TEST AND VERIFY CONCERN,REMOVE WHEEL COVER AND LUBE TABS REINSTALL AND ROAD TEST	REPLACE HUB CAP DRVS REAR FORD EMBLEM FELL OFF
2006	1FTPX12596F	17-Jan-06	26-Aug-06	CAMPBELL F	031781A 5K02 4L3Z	1130 AB B65 81 E8	30-Aug-07 13	22787	17.58	7.16	24.74	0.1	2744	VERIFIED CUSTOMER CONCERN REPLACED EMBLEM	EMBLEM FELL OFF
2005	1FTRF14W85N	20-Aug-04	17-Sep-04	NEW HOLLAN	43808103 5K02 4L3Z	1130 AB B66 D4 E8	4-Jun-07 34	30456	17.58	7.51	25.09	0.1	1360		
2005	1FAFP23115G	15-Sep-04	24-Oct-04	GRAND LEDC	065228B 5K02 4F9Z	1130 AA B65 33 E8	26-Jun-07 33	16755	17.51	7.66	25.17	0.1	9099	16755 VERIFIED CONCERN. REPLACED HUB CAP. CHECK ALL OK NOW.	FORD EMBLEM FELL OFF DRIVERS REAR HUB CAP
2006	1ZVFT80N465	29-Apr-06	31-Aug-06	ELYRIA FORI	086861A 5K02 5R3Z	1130 B B65 42 E8	10-Jul-07 11	18383	18.56	7.86	26.42	0.1	4163	REPLACE GENETR CAP	C S CENTER CAPS PEELING
2005	1FAFP36N65W	30-Aug-04	14-Jul-05	WILLIAMS MC	291102 5K01 6S4Z	1012 BA B65 1 E8	30-Jul-07 25	35613	9.63	16.82	26.45	0.2	2173	REPLACED TWO LUG NUTS. REPLACED TWO LUG NUTS , MISSING CHROME CAPS.	LUGNUT CAPS MISSING. 2 CHROME CAPS ON LUGNUTS FELL OFF.
2007	1FAHP37N17W	31-Oct-06	20-Nov-06	WILLIAMS MC	320102 5K01 6S4Z	1012 BA B65 39 E8	6-Aug-07 9	15623	9.63	16.82	26.45	0.2	2173	CUSTOMER STATES THAT WHEEL COVER CAME OFF WHEN DRIVING. REPLACED WHEEL COVER.	CUSTOMOR STATES WHEEL COVER CAME OFF WHILE DRIVING
2006	1FAFP53U16A	15-Nov-05	22-Nov-05	MOSES FORI	153016A 5K02 5F1Z	1130 AA B65 42 E8	23-Aug-07 22	14397	18.87	7.65	26.52	0.1	1989		FORD EMBLEM PEELING OFF
2006	1FMCU95H26K	23-Aug-05	31-Aug-05	EWALD'S VEI	51510301 5K02 6L8Z	1130 F B65 34 E8	15-Jun-07 22	18022	18.75	8.25	27	0.1	3774	PEELING REPLACE CENTER CAP REPLACED TWO RIGHT REAR LUG NUT CAPS.	CENTER CAP PERFORM MULTI POINT INSPECTION
2006	1FAHP34N66W	13-Mar-06	30-Jun-06	STAR FORD	70346805 5K02 6S4Z	1K011 A H26 7 E8	3-Jul-07 13	25718	8.71	18.42	27.13	0.2	5537		C S CLUNK NOISE BRAKING AND BACKING UP AFTER SITTING
2007	1FAFP24197G	31-May-06	13-Sep-06	FRIENDLY FC	150333A 5K01 *	1007 * N59 42 E8	23-Jul-07 11	15027	10.19	17.13	27.32	0.2	2662	15027 CHECKED TSB AND FOLLOWED INSTRUCTIONS	CUSTOMER STATES TICKING NOISE IN RIGHT FRONT WHEEL AREA
2005	1FAFP53U15	13-Oct-04	28-Oct-04	BEAVERTON	047138A 5K02 *	1130 * N50 33 E8	16-Aug-07 35	24412	0.01	27.62	27.63	0.3	8729	24412 TECH 3311 ROAD TEST CAP IS NOISEY.REMOVED HUB CAP INSTAL LED RUBBER INSULATORS ON CAP .ROAD TEST .	
2005	1FTPX125X5N	7-Mar-05	30-Mar-05	BEUCKMAN F	186879D 5K02 4L3Z	1130 AB B65 33 E8	10-Jul-07 28	13901	17.58	10.31	27.89	0.1	8012	13901 ORDERED CENTER CAP REPLACE MISSING WHEEL COVER	CENTER HUB CAP MISSING PE08-060 1494

2006 1FDAF57P56E	18-Jun-05	31-Mar-06	MONACO AN	270543A 5K01 2C2Z	1012 AA B65 C2 E8	11-Jul-07 16	12356	12.54	15.52	28.06	0.2	8896	DURING CUSTOMERS FIRST TIRE ROTATION, TWO OF THE FRONT LUG NUTS CAME OFF HARD. STUDS CHECKED OK, REPLACED TWO WHEEL NUTS, WERE CROSSTHREADED FROM ASSEMBLY.	2 LUGS WONT GO ON STUDS TIGHT L F	
2006 1FDAW57P56E	4-Jan-06	20-Apr-06	MORRISTOW	2215204 5K02 *	1700 * H22 42 E8	23-Jul-07 16	22065	14.95	13.42	28.37	0.2	5684	CHECKED TIRE INFLATION GOES DOWN LOCATED LEAK AT VALVE STEM ORDERED ALUMINUM STEM AND INSTALLED RETESTED NO LEAK FOUND CP: 1700 INSPECTED AND FOUND VALVE STEM LEAKING	REPLACED VALVE STEM AND SET PRESSURE	TIRE CONCERNS CUSTOMER STATES THAT THE LEFT REAR OUTSIDE TIRE KEEPS LOOSING AIR
2006 1FMYU96H56K	5-Aug-05	26-Nov-05	LANDMARK F	673216C 5K02 6L8Z	1130 F B65 1 E8	11-Aug-07 21	24805	18.75	9.64	28.39	0.1	8559	24805 CENTER CAP WARRANTY FOUND CENTER CAP RETAINERS BROKEN WITH NO VISIBLE DAMAGE. REPLACED CAP.	CENTER CAP IS BROKEN CUST STATES 3 LUG NUT COVERS HAVE FALLEN OFF CK AND ADV	
2006 1FAFP31N06W	10-Nov-05	20-Dec-05	ENFIELD FOF	15254804 5K02 6S4Z	1K011 A B65 42 E8	14-Jun-07 19	26488	13.06	15.76	28.82	0.2	8821	1 REPLACED 3 LUG NUT COVERS, RECHECK ALL OK AT THIS TIME	OWNER STATES FRONT END MAKES CLICKING NOISE WHEN TURNING AFTER VEHICLE WARMED UP.	
2006 1LNHM82V86	17-Oct-05	1-Nov-05	JERRYS FOR	38455801 5K01 *	1012 * N58 33 E8	20-Jun-07 20	19152	0	29.38	29.38	0.3	135	CHECK TORQUE ON FRONT LUG NUTS. ALL WERE LOOSE. TIGHTENED TO SPECS. RETEST OK.	CUST STATES CHECK LEFT FRONT CENTER CAP FELL OFF WHILE DRIVING	
2006 2MEFM74V16X	27-Oct-05	27-Apr-06	DICK BARKEI	120720C 5K02 3W3Z	1130 CA B65 1 E8	25-Jul-07 16	3481	22.34	7.57	29.91	0.1	12210	INSTALLED NEW LF CENTER CAP CLIP FAILURE	CUSTOMER STATES THERE IS A TICKING WITH ROTATION OF WHEELS AT SLOW SPEED. LIKE SOMETHING IN THE TIRE.	
2006 3FAFP06Z56R	12-May-06	14-Jul-06	DARLING'S B	49410303 5K02 *	1130 * N50 24 E8	15-Jun-07 12	12594	0	30	30	0.4	9044	VERIFIED RATTLE IN REAR RT WHEEL REMOVED HUB CAP AND FOUND ISOLATERS MISSING ON HUB CAP INSTALLED NEW AND ROAD TESTED OK	RUBBING NOISE LEFT FT WHEEL AREA DRIVING SLOW SPEEDS	
2005 1FAFP34N35W	30-Jul-04	31-Dec-04	HARRELSON	7274051 5K02 6S4Z	1130 A N17 7 E8	26-Jun-07 31	24468	22.54	7.88	30.42	0.1	1071	WHEEL COVER CAUSING NOISE WHEEL RING HUB CAP WHEEL COVER REPLACE	CUST STS WHEEL NUT COVERS MISSING SPO PARTS IN PLEASE INSTALL	
2007 1FAHP37N27W	27-Sep-06	28-Oct-06	JORDAN FOF	4234652 5K01 6S4Z	1012 BA B65 39 E8	15-Jun-07 8	18407	14.45	16.11	30.56	0.2	4546	MISSING REPLACED 2 LUG NUTS 31263 INSTALLED CENTER CAP. NOTE RO 441127 WAS RT FRT AND RT REAR. THIS RO IS THE LEFT	LEFT FRONT CENTER CAP FELL OFF	
2004 2MEFM74W14X	16-Jun-04	4-Sep-04	TASCA FORC	444670A 5K02 3W3Z	1130 CA B65 33 E8	24-Jul-07 36	31263	22.34	8.7	31.04	0.1	796			

2005	1FAFP34N05W1	28-Jun-04	20-Aug-04	TASCA FORC	441589C	5K02	6S4Z	1130	A	B65	42	E8	30-Jun-07	35	28198	22.54	8.7	31.24	0.1	796	28198 .2 CUSTOMER STATES HEARS NOISE COMING FROM L FRONT WHEEL ROAD TEST CAR, FOUND NOISE COMING FROM LF WHEEL AT ANY SPEEDS, FOUND NOISE COMING FROM LF HUB CAP,REPLACE HUB CAP WENT ON TEST DRIVE NO VERF FOUND CAP LOOSE NOT STAYING ON REMOVED & REPLACED WITH SOP CAP	ISE GONE CAR OK.	CHECK NOISE COMING FROM LEFT FRONT OF VEHICLE, CUST STATES VEHICLE IS MAKING A ROTATING SWOOSHING TYPE NOISE, CHECK AND ADVISE.
2006	1ZVHT82H565	11-Sep-05	27-Sep-05	DESOTO FOF	9698051	5K02	6R3Z	1130	E	B65	33	E8	14-Aug-07	23	7590	23.7	7.56	31.26	0.1	4865	RETESTED OOK		USE SPO 07225019 RH CENTER CAP FALLS OFF CENTERCAPS WILL NOT STAY ON HAS LOST 2
2006	2MEFM74W76X6	5-Aug-05	8-Jun-06	FIESTA LINCI	11455701	5K02	3W3Z	1130	CA	B65	33	E8	16-Aug-07	15	10404	22.34	9.04	31.38	0.1	11896	REPLACE LEFT FRONT CENTER CAP RIGHT FRONT WHEEL COVER DEFORMED REPLACE RIGHT FRONT WHEEL COVER.		C S RIGHT FRONT HUBCAP KEEPS FALLING OFF CUSTOMER STATES LEFT REAR WHEEL LUG NUT CAPS FELL OFF THREE FRONT HUB CAP FLEW OFF
2006	3FAFP06Z26F	15-Mar-06	5-Apr-06	PALM COAST	4925601	5K02	6E5Z	1130	A	B65	33	E8	17-Jul-07	16	28206	23.88	7.56	31.44	0.1	3326			
2005	1FAFP34N45W	22-Sep-04	18-Nov-04	FRIENDLY FC	149531A	5K01	6S4Z	1012	BA	B65	42	E8	2-Jul-07	32	24820	14.45	17.13	31.58	0.2	2662	24820 REPLACED 3 LUG NUTS ON LR WHEEL		
2005	1FAFP34N25W	17-Mar-05	13-Apr-05	SUNRISE FO	291677A	5K02	5S4Z	1130	AA	B65	42	E8	29-Aug-07	29	31757	22.54	9.1	31.64	0.1	5453	REPLACE HUB CAP		
2006	2MEFM74W86X	21-Apr-06	21-May-06	GERVAIS LIN	12824601	5K02	5W3Z	1130	DA	N58	30	E8	8-Aug-07	15	5810	23.06	8.63	31.69	0.1	13100			
2006	3FAFP06Z96F	12-Jan-06	27-Jan-06	SUNRISE FO	286848A	5K02	7E5Z	1130	A	B65	42	E8	7-Jun-07	17	23658	22.75	9.1	31.85	0.1	5453	REPLACED BAD HUB CAP DISCOLORED CENTER CAP. REMOVE AND INSTALL CENTER CAP. .		CLICKING SOUND FROM FRONT CUSTOMER STATES CHECK CENTER CAP DISCOLORED. CHECK VEHICLE DRIVER FRONT SPINNER IS DISCOLOR CUSTOMER WAS DRIVING HEAD A CLUNKING NOISE FROM RIGHT FRONT UPON LOOKING AT RIGHT FRONT SHE FOUND SPINNER MISSING MISSING WHEEL COVER
2005	1ZVFT80N355	3-Dec-04	11-Jul-05	LEGACY FOF	10290901	5K02	4R3Z	1130	FA	B65	14	E8	13-Aug-07	26	13401	25.93	7.25	33.18	0.1	585			
2005	1ZVFT84NX552	26-Jul-05	2-Oct-05	TOWN AND C	2509855	5K02	4R3Z	1130	FA	B65	81	E8	6-Jun-07	21	33846	25.93	7.37	33.3	0.1	5755	CAP DISCOLORED WHEEL RING HUB CAP WHEEL COVER REPLACE		
2005	1ZVFT84N955	20-Jul-05	4-May-06	MIDLAND FO	23905001	5K02	4R3Z	1130	FA	B65	33	E8	7-Jun-07	14	18429	25.93	7.51	33.44	0.1	9801	1130 CC33 REPLACE SPINNER 21844 WARRANTY REPLACED		
2006	1FAFP38Z56W	13-Feb-06	24-Apr-06	LANDMARK F	668914B	5K02	97BZ	1130	AA	B65	7	E8	3-Jul-07	15	21844	23.94	9.64	33.58	0.1	8559	MISSING HUB CAP ON RF WHEEL 28491 CC 01 BROKEN RETAINING TABS ON INSIDE OF WHEEL CENTER CAP CAUSING CAP TO FALL OFF CK ORDER AND REPLACE WHEEL CENTER CAP		
2006	1ZVFT84N765	13-Dec-05	5-Jan-06	JOE COOPEF	423713G	5K02	4R3Z	1130	FA	B65	1	E8	27-Jun-07	18	28491	25.93	7.69	33.62	0.1	3036	DMC		L R WHEEL CENTER CAP LOOSE (PART INSIDE CAR) RIGHT FRONT TIRE LEAKING, CHECK TIRE IN TRUNK..CHECK VALVE STEM
2006	1FMEU73E16U	17-Nov-05	2-Dec-05	BANKSTON F	500167A	5K01	*	1007	*	G29	D1	E8	2-Aug-07	21	22645	0	33.85	33.85	0.4	2441	22645 REPLACED VALVE STEM .50 TEST,GOOD MOUNTED AND RE BAL TIRE		APR 28 2006 1496

2005	1FMRE11L35H	23-Feb-05	11-Mar-05	TINCHER FO	6568802	5K02	4C2Z	1130	CA	B66	42	E8	22-Aug-07	30	31757	26.64	7.46	34.1	0.1	1651	1	R&R HUB CAP ASSY	HUB CAP CAME LOOSE FELL OFF B65 OWNER
2003	5LMFU27R43L	31-Jul-03	2-Sep-03	AUTOWAY LI	319615A	5K02	5L7Z	1130	A	B65	33	E8	6-Jun-07	46	49930	25.86	8.35	34.21	0.1	11605	49930 39 1130 WARR REPLACE CENTER CAP LOOSE, CAME OFF AND LOST	REPORTS L F CTR CAP CAME OFF AND LOST CK CHROME LUGNUT COVERS ARE FALLING OFF OF LUGNUTS	
2005	1FAFP36N35W	6-Aug-04	26-Jan-05	WOODY AND	5509152	5K01	6S4Z	1012	BA	B65	33	E8	9-Aug-07	31	22642	19.26	15.3	34.56	0.2	5892	1	ON R F	RIGHT REAR HUB CAP FELL OFF SPINNER COVER ON THE FRONT
2004	5LMFU28R34L	7-Apr-04	21-Apr-04	LANDMARK L	4372001	5K02	5L7Z	1130	A	B65	39	E8	20-Jul-07	40	49876	25.86	8.74	34.6	0.1	11056	REPLACED HUB CAP	PASSENGER RIM FELL OFF	
2006	1ZVHT85H765	27-Feb-06	28-Mar-06	POWER FOR	047671C	5K02	4R3Z	1130	FA	B65	33	E8	7-Jul-07	16	16062	25.93	8.77	34.7	0.1	20323	16062 1130, CODE 02 REPLACED THE R F RIM SPINNER, FALLING OFF LOOSE	CUST STATES PASS REAR TIRE LOOSING AIR	
2005	1FDRE14L15H	12-Jan-05	3-Aug-05	RICART FORI	251676E	5K02	5F9Z	1700	A	B65	D8	E8	22-Aug-07	25	15747	3.95	31.17	35.12	0.4	2185	15747	PASS FRONT WHEEL CAP HAS BECOME UNSECURED, PARTS PREV SOPD REFER TO RO# 703416	
2006	1ZVHT80NX65	10-Aug-05	1-Sep-05	STAR FORD	70448801	5K02	4R3Z	1130	FA	B65	42	E8	23-Jul-07	24	34406	25.93	9.21	35.14	0.1	5537	REPLACED CENTER CAP	IRE AIR LEAK IN RIGHT FRONT AND FRONT TIRE WEAR TOGETHER MAY CAUSE THE LOW TIRE WARNING LIGHT TO STAY ON...AARON..	
2004	2MRDA20204E	28-Jan-04	28-Jun-04	CAMPBELL F	028363A	5K01	*	1007	*	G29	42	E8	11-Jun-07	36	17392	0	35.82	35.82	0.5	2744	17392 ROAD TEST, VERIFY LOW TIRE WARNING LIGHT STAYS ON.CHECKED TIRE P.S.I. RIGHT FRONT DOWN 8LBS. ALSO CHECKED TIRE OUTER DIA. BOTH FRONT TIRES WORN 5.50MM MORE THAN THE TWO REAR TIRES. SUSPECT T	CHECK TIRE LIGHT ON AGAIN CUSTOMER STATES LEFT FRT TIRE WOBBLES AND SHAKES	
2005	1FTWF31575E	25-Oct-04	24-Aug-05	CAMPBELL F	028954B	5K01	*	1007	*	N50	D9	E8	26-Jun-07	23	17688	0	35.82	35.82	0.5	2744	117668 LEFT FRONT TIRE CHECK FRONT END AND WHEEL BEARING AND BLANCED LEFT FRONT TIRE CHECKED TIRE FOR LEAK FOUND VALVE STEM LEAKING AND BEAD LEAKING RESEALED BEAD AND REPLACED VALVE STEM WPI		
2006	1FTSX21P86E	30-Jun-05	4-Aug-05	ROSEMURG\	20906801	5K02	6C3Z	1700	A	H62	D1	E8	13-Jul-07	24	29148	4.41	31.82	36.23	0.4	6366	17118 REPLACED L F CENTER CAP,OTHER CENTER CAP MISSING FORD LOGO.	CK LF CENTER CAP EMBLEM CUST STATES THE PASS REAR CENTER CAP IS PEELING RT FRT CENTER CAP EMBLEM FELL OFF	
2006	1FTPW14556F	13-Feb-06	28-Feb-06	NORTHGATE	139742A	5K02	4L3Z	1130	JA	B65	42	E8	4-Aug-07	18	17118	27.87	8.41	36.28	0.1	2663	REMOVED AND REPLACED CENTER CAP FAULTY PART REPLACE WHEEL CENTER CAP	CUSTOMER STATES CHROME CAPS FELL OFF LUG NUTS	
2006	3LNHM26186F	17-Jan-06	25-Jan-06	MANGOLD FC	9220001	5K02	4W1Z	1130	A	B65	D4	E8	23-Jun-07	18	20794	28.7	7.59	36.29	0.1	20249	REPLACED FOUR LUG NUTS CLOSED BY WPI		
2006	1FTPX14536N	1-Mar-06	27-Jul-06	SKALNEK FO	10298402	5K02	4L3Z	1130	JA	B65	D4	E8	14-Aug-07	13	8521	27.87	8.53	36.4	0.1	2700			
2007	1FAHP34N57W	25-Sep-06	2-Oct-06	FAIRWAY FO	102816A	5K01	6S4Z	1012	BA	B65	33	E8	5-Jul-07	10	17385	20.64	16.01	36.65	0.2	20050			

2005	3FAFP37N25F	3-Sep-04	23-Feb-05	EVERGREEN	32525602	5K01	6S4Z	1012	BA	B65	33	E8	25-Jul-07	30	21378	19.26	17.65	36.91	0.2	8305	REPLACED ALL LUGNUTS ON R F WHEEL.	LUGNUT CAPS ARE LOOSE.	
2006	3MEFM07Z76F	21-Jun-06	16-Nov-06	GERVAIS LIN	12731401	5K02	7N7Z	1130	A	N58	7	E8	6-Jul-07	8	12781	28.48	8.63	37.11	0.1	13100	ROADTESTED FOR NOISE AND REPLACED CENTER CAP	CHECK NOISE FROM LEFT FRONT WHEEL CUSTOMER STATES SPARE TIRE WONT COME DOWN	
2006	1FTWX31Y46E	25-Jan-06	15-Feb-06	BAY HARBOF	087119A	5K02	*	1130	*	B75	91	E8	8-Aug-07	18	15020	22.36	14.92	37.28	0.2	4965	VERIFY SPARE TIRE LOCK STRIPPED REPLACE OK	CUSTOMER STATES LEFT REAR HUB CAP WONT STAY ON	
2004	2MEFM74W74X	13-Feb-04	30-Jul-04	JIM CLICK FC	50060403	5K02	5W3Z	1130	AA	B65	33	E8	18-Jul-07	37	13183	37.3	0	37.3	0	20402	1	INSTALLED NEW CENTER CAP	ADVISE B65 REPLACE CENTER INSERTS ON WHEELS.2
2005	1FAHP28135G	27-Jan-05	9-Apr-05	DONLEY FOF	40426301	5K02	5G1Z	1130	BA	B65	81	E8	1-Aug-07	29	15000	30.1	7.53	37.63	0.1	2201	REPLACED CENTER CAPS.	CUSTOMER STATES, THAT THE FORD EMBLEMS ON THE DRIVER FRT TIRE IS PEALING UP AND THE REAR TIRE IS BROKEN OFF.	
2005	1ZVFT82H955	1-Mar-05	7-Apr-05	PHIL LONG F	78104102	5K02	4R3Z	1130	BA	B65	7	E8	11-Jul-07	28	27144	19.94	17.98	37.92	0.2	3140	1	INSPECT REPLACED LEFT FRONT & LEFT REAR CENTER WHEEL CAPS ADHESIVE FAILURE ON EMBLEMS APPROVAL #PAAFZ	PLEASE CHECK AND ADVISE. CUST STATES FINSH COMING OFF CENTER CAP LEFT FRONT
2005	5LMFU28515L	14-Jan-05	30-Apr-05	DONLEY FOF	50850401	5K02	5L7Z	1130	BA	B65	81	E8	17-Jul-07	27	49125	31.42	7.08	38.5	0.1	8287	C K AAND FOUND FINISH COMING OFF CENTER CAP REPLACE CAP REPLACE RIGHT REAR CENTER CAP FOR PEELING. ORDEREDWHILE IN WARRANTY. INSTALLED ON RO 310528, 7 27	RIGHT REAR CENTER CAP PEELING	
2006	1FMFU19526L	31-May-06	15-Jul-06	COURTESY F	308530B	5K02	6L1Z	1130	BA	B65	14	E8	27-Jun-07	12	34988	31.35	7.72	39.07	0.1	1625	0736866	MILES.	CUSTOMER STATES PASSENGER FRONT CENTER CAP EMBLEM PEELING
2005	1FMZU73K75Z	5-Oct-04	31-Mar-05	FRIENDLY FC	150287C	5K02	4L2Z	1130	CA	B65	81	E8	21-Jul-07	29	28560	31.12	8.56	39.68	0.1	2662	28560	REPLACED THE RIGHT FRONT WHEEL CENTER CAP FINISH COMING OFF BOTH FRONT WHEEL CENTERS SOP PARTS INSTALL BOTH FRONT WHEEL CENTERS	CUST STATES BOTH FRONT WHEEL CENTER FINISH COMEING OFF
2006	4M2EU48826L	6-Mar-06	19-Oct-06	DONLEY FOF	50946302	5K02	5E6Z	1130	AA	B65	81	E8	27-Aug-07	11	14145	26.01	14.17	40.18	0.2	8287		OWNER STATES THE LEFT FRONT HUB CAP RATTLES NEEDS DIGITAL IMAGING	
2004	1FTNW21P64E	3-Dec-03	23-Dec-04	MCMAHON F	12113001	5K02	4C3Z	1130	AA	B65	33	E8	12-Jun-07	31	33382	30.88	9.5	40.38	0.1	4166	1	REPLACE HUB CAP AND LEFT FRONT WHEEL	FIRST CUSTOMER STATES THAT DRIVER REAR CENTER HUB CAP IS FADDING. APROVAL CODE# PAAGS
2003	5LMFU27R03L	18-Jul-03	5-Sep-03	CERRITOS F	40823003	5K02	5L7Z	1130	BA	B65	81	E8	3-Aug-07	48	32680	31.42	9.27	40.69	0.1	5401	1	REPLACE DRIVER REAR HUB CAP,FADDING APPROVED #PAAGS INSPECTED FOR NOISE ON HARD TURNS PINPOINT TO STEERING STOPS. LUBED PER SSM AND RETEST OK	C S ON HARD TURNS THERE IS A CLUNKING NOISE CHECK FOR RATTLE IN REAR OVER BUMPS
2006	1FMZK04126G	15-Sep-05	30-Sep-05	GRIFFIN FOF	011124A	5K01	*	1007	*	N58	42	E8	21-Jun-07	21	25598	0	40.73	40.73	0.5	6360		INSPECTED AND FOUND NOISE FROM TRAILER HITCH	REF08-060 1498
2007	1FTSW21P77E	2-Aug-06	21-Nov-06	GRIFFIN FOF	012185A	5K01	*	1007	*	N59	33	E8	16-Jul-07	8	18720	0	40.73	40.73	0.5	6360			



2005	1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CRI	536329A 5K02 5C3Z	1130 AC B66 33 E8	20-Jun-07 26	26724	40.81	0	40.81	0	7820	26724 INSTALLED NEW HUBCAP NO PART TO RETURN	CUST SAYS LEFT FRONT HUBCAP CAME OFF WHILE DRIVING
2005	1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CRI	536329B 5K02 5C3Z	1130 AC B66 33 E8	20-Jun-07 26	26724	40.81	0	40.81	0	7820	26724 INSTALLED HUBCAP NO PART TO RETURN	CUST SAYS RIGHT FRONT HUBCAP CAME OFF WHILE DRIVING
2005	1FTSW21P95ED	11-Apr-05	9-May-05	WALNUT CRI	536329C 5K02 5C3Z	1130 AC B66 33 E8	20-Jun-07 26	26724	40.81	0	40.81	0	7820	26724 INSTALLED HUBCAP NO PART TO RETURN	CUST LEFT REAR HUBCAP CAME OFF WHILE DRIVING
2005	1FTSW21P95E	11-Apr-05	9-May-05	WALNUT CRI	536329D 5K02 5C3Z	1130 AC B66 33 E8	20-Jun-07 26	26724	40.81	0	40.81	0	7820	26724 INSTALLED HUBCAP NO PART TO RETURN	CUST SAYS RIGHT REAR HUBCAP CAME OFF WHILE DRIVING
2007	1FAHP34N97W	12-Sep-06	18-Sep-06	VARSITY FOI	30634301 5K01 6S4Z	1012 BA B65 1 E8	27-Aug-07 12	21229	24.08	17.03	41.11	0.2	2736	01 BROKEN REPLACED ONE LF TWO LR AND TWO RR LUG NUTS DUE TO CHROME CAP MISSING TORQUED TO SPEC AND SET TIRE PRESSURES 35 PSI LUG NUT CAME APART DUE TO FACTORY DEFECT	5 LUG NUTS MISSING CAPS
2004	1FTPX12534N	23-Jun-04	18-Aug-04	BYERLY FOR	375129B 5K02 4L1Z	1130 BA B65 D4 E8	19-Jun-07 35	19005	33.5	7.68	41.18	0.1	5702	19012 WARRANTY REPLACE LEFT FRONT WHEEL CENTER CAP,APPOVEL CODE PAAHX	C S LEFT FRONT CENTER CAR HAS GLUE COMING OUT AROUND EMBLEM
2005	1FMNU45S35E	3-Dec-04	16-Dec-04	KENNY ROS	683716C 5K02 1C3Z	1130 AA B65 D4 E8	30-Aug-07 33	30112	33.54	7.64	41.18	0.1	7350	30112 REPLACE RIGHT FRONT WHEEL CENTER PEELING	CUSTOMER STATES RT.FRT WHEEL CENTRER PEELING
2006	1FTPW14596F	1-Nov-05	15-Jun-06	LITHIA FORD	354534A 5K01 *	1015 * N22 42 E8	21-Jun-07 13	15433	0	41.32	41.32	0.5	3897	15433 UNBALANCED TIRES 100 TEST DROVE VEHICLE AND FELT SHIMMY A 70 MPH. BALANCED AND ROTATED TIRES. TEST DROVE AGAIN. SHIMMY IS NO LONGER FELT AND HIGH SPEEDS. ROAD TEST VEHICLE CHECKED FRONT SUSPENSION TIGHT	CUSTOMER STATES SHIMMY 66 76 MPH
2006	1FAHP34N36W	9-Sep-05	25-Jan-06	DAVIDSON M	093217A 5K01 *	1007 * N58 63 E8	4-Jun-07 17	26034	0	41.39	41.39	0.6	7509	FRONT SUBFRAME BOLTS	CHECK NOISE IN FRONT END.
2006	1FMZK02176G	15-Nov-05	30-Nov-05	JOE SARTAIN	24292002 5K01 *	1007 * N50 82 E8	30-Jul-07 21	20362	0	41.59	41.59	0.6	5732	TEST DROVE CAR AND CK FOR NOISE TURNING LEFT NPF. CK FOR LOOSE PARTS NPF.	C S THAT WHEN YOU TURN TO THE LEFT IT MAKES A LOUD NOISE
2006	1FAFP53U16A	17-Oct-05	1-Nov-05	JOE SARTAIN	24249002 5K01 *	1007 * N51 82 E8	12-Jul-07 21	26887	0	41.59	41.59	0.6	5732	TEST DRV VEH AND PUT UP ON LIFT, FOUND NO PROBLEMS.	RIGHT REAR NOISE LIKE SOMETHING IS LOSE
2006	1FAFP23146G	12-Oct-05	11-Nov-05	JOE SARTAIN	24271602 5K01 *	1007 * N50 82 E8	23-Jul-07 21	33757	0	41.59	41.59	0.6	5732	CK FOR NOISE NPF.	NOISE LEFT FRONT TURNING LEFT AT ABOUT 25 MPH
2005	5LMFU28545L	25-Feb-05	11-Oct-05	GERVAIS LIN	12810002 5K02 5L7Z	1130 AA B43 D4 E8	3-Aug-07 23	24100	33.03	8.63	41.66	0.1	13100		
2005	3FAFP31N05F	30-Aug-04	10-Jan-05	PALM SPRIN	163281B 5K01 6S4Z	1012 BA B65 33 E8	16-Jul-07 31	19956	24.08	17.74	41.82	0.2	5574	INSTALL A SOCKET ONTO EACH LUG NUT TO TEST THE COVERS, FOUND 5 NUTS WITH THE COVERS DETACHED REPLACED 5 LUG NUTS.	CUST STATES LUG NUT COVER CAME LOOSE
2007	1FAFP34N07W	23-Jun-06	8-Jul-06	AUFFENBER	141572D 5K01 6S4Z	1012 BA B65 33 E8	26-Jun-07 12	26625	15.48	27.11	42.59	0.3	8017	26625 VERIFIED CUSTOMER CONCERNS FOUND LUGGE NUTS WHERE HARD TO REMOVE VERIFIED REPAIR	PE08-060-1498 99 3 LUG NUTS HARD TO REMOVE

GENERAL QUICK  
LANE REPAIRS  
CK WHEEL STUD BAD  
ON DRIVERS FRONT  
WHEEL H26

2004	1FAFP33P44W	11-Dec-03	30-Jun-04	BOB TOMES	63296203	5K01	E83Z	1012	A	B65	1	E8	22-Jun-07	37	16738	0.97	42.05	43.02	0.5	2531	REPL. WHEEL STUD & NUT	
2005	1FAFP25115G	26-May-05	16-Jun-05	ULRICH MOT	11673907	5K02	5G1Z	1130	BA	B65	30	E8	10-Aug-07	27	23618	30.1	13.83	43.93	0.2	3457		
2005	1FAFP36N15W	28-Apr-05	14-Jul-05	ROSEMURG\	20688504	5K01	6S4Z	1012	BA	B65	1	E8	4-Jun-07	24	25134	12.25	31.82	44.07	0.4	6366	REPLACED ONE LUG NUT AND STUD ON RIGHT REAR TIRE TO COMPLETE REPAIRS ADD ON BY PAUL. WPI	
2005	2MEFM74W25X	25-Apr-05	20-Jul-05	RANDALL NC	322250A	5K01	*	1007	*	N59	33	E8	11-Jun-07	24	12070	0	44.91	44.91	0.6	2524	12070 1007D 0.7 VERIFIED CONCERN, NOISE IN FRONT AND REAR OF CAR. LUBRICATED ALL FRONT AND REAR BUSHINGS. VERIFIED REPAIR	CUSTOMER STATES FRONT END MAKING SQUEAK NOISE WHEN TURNING. CUSTOMER STATES THERE IS A CLUNKING NOISE FROM REAR WHEN GO TO ACCELERATE FROM A STOP. CHECK AND ADVISE.
2004	1FMZU73K74Z	5-Nov-03	6-Dec-04	FERRARIO F	029418A	5K01	*	1007	*	N51	42	E8	20-Aug-07	33	29522	0	45.33	45.33	0.7	3366	PERFORMED ROAD TEST FOR CLUNK NOISECHECKED DRIVE SHAFT REAR ARMS REAR DIFFERENTIAL TRANSFER CASE ALLOK FOUND NOISE TO BE NORMAL DRIVELINE NOISES	
2004	1FMZU73E34U	17-Jun-04	31-Jul-04	FERRARIO F	028927B	5K01	*	1007	*	N50	42	E8	31-Jul-07	37	34265	0	45.33	45.33	0.7	3366	TEST DRIVE...COULD NOT VERIFY CUSTOMER CONCERN AT THIS TIME	CUSTOMER STATES THERE IS A SQUEAK NOISE OVER BUMPS. CHECK AND ADVISE
2006	1FDNF21526E	25-Jul-05	8-Aug-05	FERRARIO F	029624G	5K01	*	1007	*	N27	42	E8	27-Aug-07	25	17204	0	45.33	45.33	0.7	3366	ROAD TESTED VEHICLE FOR VEHICLE PULLING WHILE BRAKING DID NOT EXPERIENCE CHECKED ALL BRAKES FRONT AND REAR ALL GOOD RECOMMEND TO CUSTOMER TO PERFORM BRAKE SERVICE ON FRONT BRAKES	CUSTOMER STATES WHILE BRAKING THE VEHICLE IS PULLING TO THE LEFT. CHECK AND ADVISE CUST STATES HEARS CLICKING TYPE NOISE AT SLOW SPEEDS ESPECIALLY WHEN DRIVING NEXT TO WALLS CHECK PAINT PEELING ON LEFT FRONT HUB CAP COVER
2006	1FAFP53U76A	12-May-05	28-May-05	VISTA FORD	018271A	5K02	*	1130	*	N50	41	E8	9-Aug-07	27	21770	0	45.38	45.38	0.5	7923	21770 181 DIAGNOSE AS HUB CAP SQUEEK LUBED ALL 4 CAPS MT 5	
2005	1MEFM55SX5A	2-Jun-04	10-Feb-05	VAN DRISSE	022427A	5K02	3W3Z	1130	AA	B65	D4	E8	18-Jun-07	29	15725	37.67	8.02	45.69	0.1	12505	R AND R LEFT FRONT HUB CAP COVER. WPI	GUEST STATES THE DRIVERS REAR LUG COVER CAP IS MISSING OR FADING
2005	1FTPW14595K	11-May-05	15-Jul-05	BERGSTROM	10198002	5K02	5L3Z	1130	BA	B65	81	E8	14-Jun-07	24	17037	37.95	8.12	46.07	0.1	6226	VERIFY CONCERN AND REPLACE LEFT REAR CENTER CAP	THE F 150 SYMBOL FRONT RIGHT WHEEL CENTER CAP CAME OFF, SEND PARTS REQ TO MATT
2005	2MEFM74W25X	26-Jan-05	24-Feb-05	FIESTA LINC	11449704	5K02	5W3Z	1130	AA	B65	33	E8	15-Aug-07	31	35996	37.3	9.04	46.34	0.1	11896	REWPLACED RF CENTER CAP	

PE08-060 1500

2006	3MEFM07Z86F	21-Jun-06	24-Aug-06	CERRITOS FI	41014001	5K02 *	1130 *	N50	42 E8	28-Aug-07	13	14945	0	18.55	46.55	0.2	5401	WF 1130 CC42 ROAD TESTED VEHICLE HEARD TWO DIFFRENT NOISES FOUND ONE NOISE TO BE THE WHEEL COVERS. R&R ALL WHEEL COVERS CLEANED MOUNT AREA AND APPLI REROAD TESTED AND NO ABNORMAL NOISE HEARD AFTER REP	AIRS.	CUSTOMER STATES CK FOR CLICKING NOISE AT LOW SPEED AND THUMB NOISE AT FWY SPEEDS FROM RIGHT FRT C S THAT SHE HEARS A NOISE ON PASSENGER SIDE FRONT WHEN TURNING MORE TO LEFT AND ACCEL MAKES A CLICKING TYPE NOISE CK AND ADV
2005	1FTPX12585N	22-Nov-04	30-Jul-05	HARRELSON	7215051	5K01 *	1007 *	N58	7 E8	13-Jun-07	23	16104	0	47.29	47.29	0.6	1071	WHEEL OUT OF POSITION BRAKE SHOES PAD ASSEMBLIES HYDRAULIC INSPECT B65 VERIFIED, SENT PHOTOS TO DIGITAL IMAGING. THEYAPPROVED THE REPLACEMENT OF THE CENTER CAP ON LEF T REAR. REPLACED CENTER CAP.		
2004	1FTPW14544K	18-May-04	30-Sep-04	MORROW FC	2373302	5K02 4L3Z	1130 DD	B65 D4 E8	6-Aug-07	35	23762	40.75	6.77	47.52	0.1	7327			LEFT REAR CENTER CAP IS PEELING NEED 1 WHEEL CENTER COVER ORDERED	
2005	1FTSW21P75E	10-Feb-05	22-Feb-05	GOLDEN CIR	222767A	5K02 5C3Z	1130 AC	B65 33 E8	28-Jun-07	29	23196	40.81	7.06	47.87	0.1	5885	23196	WHEEL COVER INSTALLED	LEFT REAR WHEEL CENTER CAP FELL OFF	
2007	1FDNF20507E	31-Aug-06	20-Dec-06	BLUEBONNE	47175901	5K02 5C3Z	1130 CB	T55 25 E8	26-Jun-07	7	24715	39.62	8.39	48.01	0.1	4570		INSTALLED NEW HUBCAP	C S THAT THERE IS A POPPING NOISE IN THE RIGHT FRONT WHEN U ARE MOVING A LITTLE ACROSS THE DRIVE WAY	
2006	1FTPW14VX6F	21-Mar-06	31-May-06	JOE SARTAIN	24179301	5K01 *	1007 *	N50	82 E8	14-Jun-07	13	14826	0	48.52	48.52	0.7	5732	CK FOR POPPING NOISE OVER BUMPS ON DRIVE WAY.NPF.CK FOR LOOSE FRONT END PARTS NPF.		CUSTOMER REQUESTS GENERAL REPAIRS CUST STS CENTER CAP CLIPS BROKE OFF PLEASE CHECK AND ADVISE C S THAT THERE IS A CREAKING NOISE
2005	1FTSW21P85E	1-Apr-05	16-May-05	GARY YEOM	57932203	5K02 5C3Z	1130 AC	B65 1 E8	11-Jul-07	27	26003	40.81	8	48.81	0.1	4790	CLIPS BROKE REPLACE RETEST OK			
2006	2MEFM74VX6X	24-Oct-05	13-Nov-06	GRIFFIN FOF	013496B	5K01 *	1007 *	C50	42 E8	13-Aug-07	10	19004	0	48.88	48.88	0.6	6360	TEST DRIVE AND CHECKED STEERING & SUSPENSION ALL OK AND NO PROBLEM FOUND AND NORMAL BUSHING TORQUE		HEARD FROM FRONT OF VEHICLE OVER BUMPS AND IPS AND DRIVEWAYS
2004	1FTPW14554F	17-May-04	3-Sep-04	WILLEY FORI	60289202	5K02 4L3Z	1130 DD	B66 81 E8	16-Aug-07	36	25187	40.75	8.63	49.38	0.1	3028	1 INSTALLED NEW CENTER CAP JP1626 EMBLEM PEELED		GUEST STATES:LUG CAP ON DRIVERS SIDE FRONT IS FADING CHECK AND ADVISE	
2005	1FTSW21P65E	24-Feb-05	24-Aug-05	COPPER COI	6658852	5K02 5C3Z	1130 KA	B65 D4 E8	23-Aug-07	25	20537	42.8	6.65	49.45	0.1	6267	WHEEL RING HUB CAP WHEEL COVER REPLACE		RT REAR HUBCAP FORD PEELING CHECK DR SIDE FRT CENTER CAP LOOSE	
2006	1LNHM81VX6Y	4-May-06	6-Jul-06	GANLEY LIN	101014A	5K02 6W1Z	1130 AA	B65 33 E8	20-Jun-07	12	14979	41.65	7.9	49.55	0.1	10736	14979 REPLACE DR SIDE FRT CENTER CAP		FRONT CAP LOOSE MAKES NOISE	

2005	1FAFP34N65W	30-Jul-04	28-Jan-05	GRAND FORI	061842A 5K02 *	1130 *	N50	42 E8	26-Jul-07 31	18768	0	49.64	49.64	0.8	7417	TECH TEST WITH CUSTOMER AND VERIFIED CONCERN RAISED ON HOIST USING CHASSIS EARS DETERMINED NOISE COMING FROM WHEEL COVERS RAN OASIS CK TSBS FOLLOW TSB06 09 05 APPLY URETHANE TAPE TO WHEEL COVERS TO QU	IET NOISE TEST DROVE AFTER CONCERN NO LONGER PRESENT	CUSTOMER STATES NOISE FRONT END WHILE DRIVING CUST STATES THE REAR WHEEL CENTER CAPS PAINT PEELING AND COOROSION STARTING. PLEASE INSPECT.
2005	1FAFP25145G	16-Mar-05	31-Mar-05	APPLE VALLI	64796001 5K02 5G1Z	1130 BA	B65	5 E8	17-Aug-07 29	22867	30.1	19.93	50.03	0.2	9217	VERRIFIED REAR CENTER CAP PROBLEM AND SENT PICS TO FORD RECIEVED ACES CODE PAARF TO HAVE PARTS INSTALLED. PARTS ORDERED AND INSTALLED 8 22 07		CUST STATES CHECK LUGG NUTS MAKING NOISE
2006	1FAFP34N46W	10-Apr-06	8-May-06	MULLINAX FC	165201E 5K01 6S4Z	1012 BA	B65	33 E8	15-Jun-07 14	21721	33.71	17.15	50.86	0.2	2157	21721 REPLACED 7 LUG NUTS FOR LOOSE CAPS 8554 VERIFIED CONCERN XX FORD ON CENTER OF CENTER CAP IS PEELING XX REPLACED CENTER CAP ON D S REAR WHEEL XX		CUST STS THE D S REAR CENTER CAP IS DELAMINATING WHERE THE FORD EMBLEM IS LOCATED LOUD RATTLE FROM PASS DOOR AREA
2006	1FMPU16576L	22-Nov-05	9-Feb-06	HOLMAN FOF	379914A 5K02 6L1Z	1130 CA	B65	81 E8	19-Jun-07 17	8554	42.47	8.84	51.31	0.1	1325	RECHECK XX ALL OK		WQHEN OVER BUNMPS ADVISE HUM NOISE PAAS SIDEDASH 30 MPH 15RPM ADVISE
2006	1ZVHT84N165	3-Feb-06	24-Apr-06	GRESHAM FC	479601 5K01 *	1007 *	B09	42 E8	23-Jun-07 15	10214	1.23	50.51	51.74	0.6	8572	.6 HRS T09 PERFORMED NVH DIAGNOSIS. TEST DROVE VEHICLE. LIFTED VEHICLE. TIGHTENED MOUNT BOLTS. NOISE NOW GONE AT THIS TIME.		C S FROM LAST SERVICE CENTER CAPS HAVE SCRATCHES AROUND THE RIDGES,PLEASE CHECK AND ADVISE
2006	1LNHM81V86Y6	1-Dec-05	31-Mar-06	HEMPSTEAD	74574102 5K02 6W1Z	1130 AA	B65	D4 E8	22-Jun-07 15	9610	41.65	10.53	52.18	0.1	11208	SUBMITTED TO DIGITAL IMAGING. AS PER FORD AT THIS TIME CAN ONLY COVER ONE CENTER CAP FOR PEELING CONDITION. SURFACE CRACKS ON CLEAR COAT CONCERN.		PASSENGER SIDE REAR TIRE HAS 3 LUG NUTS ON IT THAT WILL NOT MOVE
2005	1FTPX04585K	23-Jun-05	5-Aug-05	FRIENDLY FC	148644B 5K01 2L1Z	1012 AA	B65	69 E8	11-Jun-07 23	23753	9.41	42.82	52.23	0.5	2662	23753 USING BREAKER BAR AND TORCHES REMOVED 3 FROZEN LUG NUTS. APPLIED ANTI SEEZE TO THREAD SURFACE AND NUT SURFACE.		CUSTOMER STATES DRIVERS FRONT CENTER CAP IS PEELING
2006	1FTPW14516K	10-Feb-06	3-Jul-06	MULLINAX FC	166497E 5K02 4L3Z	1130 AB	B65	D4 E8	9-Jul-07 13	20675	35.17	17.15	52.32	0.2	2157	20675 REPLACED FRT CENTER CAPS BOTH PEELING WHEEL CENTER CAP CLEAR PEELING OFF.REPLACED RIGHT REAR CENTER CAP.		WHEEL CENTER CAP CLEAR PEELING OFF CK FOR THE RIGHT REAR WHEEL IS MISSING LUG NUT COVERS ALSO THE LEFT FRONT LUG NUT COVERS ARE MISSING
2004	1FTPX12554F	13-May-04	9-Sep-04	JACK SCHMI	089961B 5K02 4L3Z	1130 DD	B65	81 E8	7-Aug-07 36	32080	43.67	8.87	52.54	0.1	8193			RIGHT REAR WHEEL IS MISSING LUG NUT COVERS ALSO THE LEFT FRONT LUG NUT COVERS ARE MISSING REPLACE
2007	1FAHP34NX7W	18-Jul-06	3-Aug-06	PURVIS FORI	080648A 5K01 6S4Z	1012 BA	B65	42 E8	27-Aug-07 13	17104	28.89	24.47	53.36	0.3	61			REAR CENTER CAP IS MISSING

2006	2FAHP71W76X	11-Apr-06	13-Jun-06	ROBERTS FC	150432A 5K02 7W7Z	1130 A	B66	33 E8	8-Aug-07	15	12810	44.63	9.15	53.78	0.1	9883	12810 LR WHEEL COVER EMBLEM FELL OFF REPLACE WHEEL COVER	REAR DRV SIDE FORD EMBLEM FELL OFF HUB CAP REPORT ON NOISE RF WHEEL AREA. SEE EB NOTE
2005	1FAFP34N75W	20-Aug-04	22-Sep-04	NEMER FORI	016852A 5K02 *	1130 *	N59	42 E8	23-Jun-07	34	31274	0	53.81	53.81	0.8	3608	31276 A D TSB 06 9 5 . 0.8 . F . REPLACED FRONT WHEEL COVERS. OTHER METHODS OF REPAIR HAVE NOT CORRECTED NOISE.	INSTALL SOP HUB CAPS CLICKING NOISE FROM FRT HUB CAPS.
2005	1FAFP34N45W	31-May-05	25-Jun-05	EVERGREEN	32688801 5K02 5S4Z	1130 AA	B65	42 E8	22-Aug-07	27	16908	45.08	8.82	53.9	0.1	8305		
2004	1FTPW14534K	16-Jun-04	13-Dec-04	AUSTIN FORI	88301 5K02 4L3Z	1130 DD	B66	34 E8	6-Jul-07	32	31447	40.75	14.03	54.78	0.2	9300	INSTALL HUB CAP 17412 .2 REPLACED L FRT HUB CAP	LEFT FRT WHEEL CAP HAS PAINT BUBBLING LEFT FRONT CENTER CAP FELL OFF
2006	2MEFM74W56X	9-Sep-05	6-Oct-05	TASCA FORC	442321A 5K02 5W3Z	1130 DA	B65	D4 E8	6-Jul-07	22	17412	46.12	8.7	54.82	0.1	796		EMBLEM COMING OFF
2005	1FTPW14565K	29-Apr-05	7-Jun-05	DAVE HOLT F	16446901 5K02 5L3Z	1130 BA	B65	42 E8	5-Jul-07	26	28110	37.95	16.94	54.89	0.2	9463	INSTALLED NEW CENTER CAP DEFECTIVE RIGHT REAR WHEEL STUD AND NUT VERIFIED CONCERN PINPOINT TESTED AND REPLACED RIGHT REAR WHEEL STUD AND NUT	
2006	4M2YU56Z66K	15-Dec-05	17-Mar-06	ALBUQUERQ	11934305 5K01 6L8Z	1012 AA	L69	42 E8	22-Jun-07	16	34000	8.82	47.05	55.87	0.5	10140		WHEEL STUD CAME APART CUSTOMER STATES WHEN MAKING A RIGHT TURN FROM A STOP THEY HEAR A WHINNING TYPE NOISE FROM REAR AREA,2 OUT OF 10 TIMES
2005	1FTPX145X5N	21-Jan-05	31-Mar-05	LILLISTON FC	198616A 5K01 *	1007 *	N50	42 E8	14-Aug-07	29	33742	0	56.4	56.4	0.7	1254	TRACED AND DIAG. TEST DROVE TRUCK COULD NOT DUPLICATE CONCERN,INSTALLED CHASSIS EARS. STILL DID NOT DUPLICATE ON ROAD TEST	CUSTOMER STATES THEY FEEL A VIBRATION IN STEERING AT 45MPH AND UP
2006	1FMPU16566L	13-Jun-05	23-Sep-05	LILLISTON FC	197465B 5K01 *	1007 *	N24	42 E8	17-Jul-07	23	30813	0	56.4	56.4	0.7	1254	ROADTEST CHECK FOR VIBRATION CONCERN CHECKED TIRES TIRES CHOPPED ROTATED AND BALANCED TIRES VERIFIED	FRONT END HAS VIBRATION FROM ABOUT 55 MPH UP. CAN FEEL IT IN STEERING WHEEL, TIRE WERE ROTATED LAST VISIT, BUT DID NOT CORRECT ISSUE.
2006	1ZVFT85H765	17-Oct-05	4-Nov-05	COOK-WHITE	011779C 5K01 *	1007 *	N24	D9 E8	9-Jul-07	21	30569	0	56.45	56.45	0.8	4910	30569 .5 RD TST, SLIGHT VIB FELT AT 60, INSP TIRES CHECK BALANCE, OK, DID NOTICE REAR TIRES HAVE UNEVEN WEAR INSIDE EDGE, NO OTHER SIGNS OF SUSP STEER WEAR, OAD AT THIS TIME. 50	BAL TIRE HAS VIBRATION 45 MPH AND UP
2006	1FTSW21PX6E	5-Dec-05	31-Dec-05	COOK-WHITE	011920A 5K01 *	1007 *	N25	D9 E8	11-Jul-07	19	31650	0	56.45	56.45	0.8	4910	31650 .9 1.5 ROADFORNS AND BAL TIRE. NO MORE VIBRATION 16576 OUT OF BALANCE 1.5 CHECK BALANCE AND RD FORCE ALL TIRES ALL TIRES GOOD RD FORCE, BALANCE OFF, BALANCED TIRES PUT LOW RD FORCE #S UP FT, SET TIRES PSI TO SPECS, TWO FT WERE 42 PSI, TST, OK 15	CUSTOMER STATES HAS VIBRATION ALL 0 SPEEDS
2006	1FTPW14516F	2-May-06	30-Jun-06	COOK-WHITE	011710B 5K01 *	1007 *	N22	D9 E8	6-Jul-07	13	16576	0	56.45	56.45	0.8	4910		

2005 1FAFP24195G	23-Aug-04	26-Mar-05	FULLERTON	5883952	5K02	5G1Z	1130	CA	B65	34	E8	4-Jun-07	27	10077	37.2	19.71	56.91	0.2	20651	CENTER CAPS THE FORD EMBLEMS ARE PEELING OFF REPLACED CENTER CAP EMBLEMS LEFT SIDE OF VEHICLE INSPECTED VEHICLE AND TEST DRIVE FOR NOISE AND CHECKED STEERING AND SUSPENSION OVER OK. VEHICLE NEEDS FURTHER REPAIRS AND CUSTOMER DECLINED WORK AT THIS TIME. VEHICLE NEEDS TIRE ROTATION AND FOURWHEEL ALIGNMENT. CUSTOMER ADVISED & DECLINED	CUSTOMER STATES ON CENTER CAPS THE FORD EMBLEMS ARE PEELING OFF  C S THAT THERE IS NOISE FROM FRONT OF VEHICLE GROWLING TYPE NOISE HEARD ALL SPEEDS CHECK FOR VEHICLE LURCHING WHILE BRAKING CUSTOMER STATES BOTH DRIVERS SIDE WHEEL CENTER CAPS PEELING CUSTOMER STATE THE RIGHT SIDE WHEEL CENTER CAPS ARE PEELING SOP CENTER CAPS ARE IN BROKEN STUD ON RIGHT REAR WHEEL QCP C S EMBLEM ON RIGHT FRONT CENTER CAP IS FALLING OFF ADDED PER CERTIFICATION FOUND CENTER CAPS CORRODED PEELING AND BUBBLING CUST STATES ALL 4 WHEEL COVERS HAVE COME OFF OF THIS VEHICLE AND COMPANY HAS 300 AND THEY ARE HAVING THE TROUBLES CUSTOMER STATES HAS NOISE FROM DRIVERS FRONT WHEEL AREA C S THERE IS A ROTATIONAL CLICKING NOISE COMING FROM VEHICLE. REPLACE 2 HUB CAPS #3060 1504
2005 1FMYU02ZX5K	14-Mar-05	20-Jul-05	GRIFFIN FOF	013901A	5K01	*	1007	*	N58	42	E8	21-Aug-07	26	35305	0	57.02	57.02	0.7	6360	TEST DRIVE AND DIAGNOSIS. COULD NOT DUPLICATE CONCERN	
2006 1FMEU73866L	5-Oct-05	29-Dec-05	GRIFFIN FOF	011569A	5K01	*	1007	*	H20	42	E8	29-Jun-07	19	27708	0	57.02	57.02	0.7	6360	REPLACED BOTH LEFT CENTER CAPS	
2005 1FTPW14515K	20-Sep-04	1-Oct-04	DONS FORD,	61035101	5K02	5L3Z	1130	S	B65	5	E8	10-Aug-07	35	25553	44.02	13.06	57.08	0.2	582	VERIFIED CONCERN AT LAST VISIT REMOVED AND REPLACED BOTH RIGHT SIDE CENTER CAPS 2 STUDS BROKEN	
2005 1FTPW14515K	20-Sep-04	1-Oct-04	DONS FORD,	61254401	5K02	5L3Z	1130	S	B65	5	E8	17-Aug-07	36	26057	44.02	13.06	57.08	0.2	582	BOLT(S) REAR HUB REPLACE	
2005 1LNHM87A45Y	5-May-05	27-Jul-05	COPPER COI	6625051	5K01	3W4Z	1012	AA	B65	1	E8	3-Aug-07	25	11539	17.36	39.91	57.27	0.6	6267	35159 REPL EMBLEM ON RT FRT CENTER CAP CY FAIR UPHOLSTERY	
2005 1FTPX145X5N	16-Sep-04	19-Aug-05	JOE MYERS	561586C	5K02	5L3Z	1130	EA	B66	33	E8	7-Aug-07	24	35159	57.34	0	57.34	0	4402	INSPECT ORDER AND REPLACE CENTER CAPS	
2005 4M2YU57165D	15-Nov-04	24-Feb-05	WALLACE LI	088726F	5K02	5E6Z	1130	AA	B65	42	E8	29-Jun-07	29	32004	52.02	7.8	59.82	0.1	10781	INSTALLED ALL FOUR WHEEL COVERS TECH FOUND TSB 06 09 5 TAPED WHEEL COVER AND OUTSIDE EDGE COVER TO STOP SQUEAKING	
2007 1FAHP24117G	31-Jan-07	15-Feb-07	SUNSET AUT	3697101	5K02	5G1Z	1130	CA	B65	1	E8	17-Jul-07	6	16345	60.2	0	60.2	0	8198	ROTATIONAL CLICKING NOISE FROM VEH VERIFY REPLACE 2 CENTER CAPS	
2005 1FAFP34N75W	28-Jun-05	21-Jul-05	L F DONNELL	418383A	5K02	*	1130	*	N50	42	E8	14-Jun-07	24	27184	0	60.25	60.25	0.8	2220	12496 REPLACED BOTH LH CENTER CAPS FOR CORRODED	
2005 1FTPW14525K	25-May-05	23-Jul-05	PURVIS FORI	080239B	5K02	5L3Z	1130	S	N59	7	E8	22-Aug-07	26	30308	44.02	16.31	60.33	0.2	61		
2006 3MEFM07106F	12-Apr-06	7-Jun-06	MATHEWS FI	241347B	5K02	6N7Z	1130	AA	B65	14	E8	7-Aug-07	15	12496	45.36	15.06	60.42	0.2	2265		

2005	1FAFP36N65W	24-Aug-04	30-Apr-05	BILL ESTES F	10660101 5K02 *	1130 *	B65	42 E8	2-Jul-07 27	23448	0	60.54	60.54	0.8	3362	SQUEAK FROM WHEEL COVERS.PERFORM HUB REVISION TSB 06 9 5.REPL 6 PIECES OF TAPE ON HUB TABS.TEST DROVE TO VERIFY REPAIR	CK CLICKING IN WHEELS SINCE TIRES ROTATED CUSTOMER STATES THE CENTER CAP IS DISCOLORING CHIRP NOISE FROM FROM FRONT PASSENGER SIDE WHEEL AREA
2005	5LMEU88H25Z	15-Dec-04	30-Dec-04	MCCOTTER F	208506A 5K02 2C5Z	1130 AA	B65	42 E8	21-Jun-07 31	35382	53.21	7.43	60.64	0.1	4944	REPLACE WJEEL COVER TEST DRIVE REMOVE WHEEL COVERS, INSTALLED FOAM TAPE PER TSB 6 9 5 REINSTALLED COVERS REDRIVE OK	THE LEFT SIDE HUB CAPS ARE DISCOLORING N59 CUSTOMER STATES AN UNUSUAL RUBBING NOISE IS HEARD FROM THE DRIVER SIDE FRONT WHEEL AREA WHILE DRIVING SLOWLY,ALL TIMES. CHECK NOISE FROM FRT. SEE ERIC
2005	1FAFP34N35W	23-Jun-05	9-Jul-05	BRONDES FC	15909101 5K02 *	1130 *	N50	42 E8	16-Jul-07 25	34861	0	60.65	60.65	0.8	3010	0 ORDERED AND REPLACED 3 HUB CAPS, BOTH LEFT SIDE AND THE RIGHT FRONT. *****THANK YOU*****	
2005	1FAHP28135G	3-Feb-05	12-Jul-05	MONACO AN	268858A 5K02 5G1Z	1130 BA	B65	81 E8	4-Jun-07 24	33603	45.15	15.52	60.67	0.2	8896	30237 RUBBING NOISE FROM FRONT WHEELS AT SLOW SPEEDS W T1932 VERIFIED CONCERN PINPOINTED TO FRONT HUBC APS R&R 2 FRONT HUBCAPS ROAD TEST CKS OK AT TH IS TIME.QUALITY CK BY T1932	
2005	1FAFP34N55W	22-Nov-04	17-Feb-05	MAROONE FI	823304C 5K02 6S4Z	1130 A	N59	42 E8	6-Jul-07 29	30237	45.08	16.24	61.32	0.2	4820	23249 REPLACE R FRT. HUBCAP VERIFIED CONCERN , PERFORM ROADFORCE BALANCE NEC TO ROAD FORCE ALL TIRES OUT OF SPEC WILL NO T BALANCE BEFORE REPAIR	
2005	2MEFM74WX5	23-Jun-05	27-Dec-05	LIBERTY LINI	114815A 5K02 3W3Z	1130 CA	N50	42 E8	21-Jun-07 19	23249	45.4	16.35	61.75	0.2	11000	30663 INSTALLED RIGHT FRT AND RIGHT REAR HUB CAPS	
2006	1FTPW14V36K	15-Jun-06	23-Apr-07	VAN BURKLE	115623A 5K01 *	1007 *	N24	13 E8	20-Jun-07 2	22357	0	61.84	61.84	0.8	4241	29060 SQUEAKING FROM WHEEL COVERS WARR VERIFIED CONCERN PERFORMED TSB 06 9 5 RETEST DROVE VERIFIED REPAIR	FEELS A VIBEATION AT HWY SPEED RIGHT REAR AND RIGHT FRONT HUB CAP FELL OFF CUST STATES THERE IS A CREAKING NOISE FROM THE LF WHILE DRIVING. TEST DROVE WITH TECH7653.
2004	2MEFM74W14X	16-Jun-04	4-Sep-04	TASCA FORC	441127A 5K02 3W3Z	1130 CA	B65	33 E8	27-Jun-07 35	30663	44.69	17.4	62.09	0.2	796	7653 8721 VERIFY CONCERN. REPLACE BOTH FRONT WHEEL COVERS. PAINT PEELING. OKAY NOW.	
2005	1FAFP34NX5W	9-Sep-04	3-Mar-05	RICART FORI	246909A 5K02 *	1130 *	N50	42 E8	19-Jul-07 29	29056	0	62.34	62.34	0.8	2185	ROAD FORCE BALANCE WHEELS FOUND SLIGHT OUT OF VARIANCE IN TWO WHEELS REPLACE PER FORD MOTOR COMPANY 1130 CC81 REPLACE BOTH LEFT WHEEL COVERS	
2006	1FAFP34N16W	14-Sep-05	30-Sep-05	JIM O'NEAL F	20139001 5K02 6S4Z	1130 B	B65	81 E8	17-Jul-07 22	33162	48.3	14.1	62.4	0.2	5786		
2005	1FAFP38Z65W	13-Apr-04	14-May-05	ACTON LINC	241983A 5K01 *	1007 *	N22	82 E8	21-Jun-07 26	19523	0	62.58	62.58	0.7	13144		
2006	1FAFP56U76A	6-Feb-06	21-Feb-06	MIDLAND FO	24111901 5K02 YF4Z	1130 BA	B65	81 E8	17-Aug-07 19	33754	48.13	15.02	63.15	0.2	9801		

2006	3FAFP07Z96R	24-Nov-05	13-May-06	VACAVILLE F	14906601	5K02 *	1130 *	N51	42 E8	14-Jun-07	14	13014	0	63.16	63.16	0.6	398	UNABLE TO DUPLICATE CUSTOMER CONCERN ROAD TEST AT FWY AND STREET SPEEDS RACK AND INSPECT, ALL TIGHT AND GOOD. OASIS HAS MESSAGE FOR NORMAL FLUTTER NOISE WHEN REAR WINDOWS DOWN, SSM 19764.		CUSTOMER STATES CAN HEAR A TICKING NOISE OUTSIDE THE CAR WHEN DRIVING WITH WINDOWS DOWN, DESCRIBED AS CARD IN BICYCLE SPOKE SQUEAK RT REAR WHEEL WHEN DRIVING NOISE IS ROTATIONAL CUSTOMER STATES THERE IS A GRIND WHICH STARTS WHEN THE VEHICLE STARTS TO ROLL, WORSE SINCE TIRES WERE ROTATED. ALSO HAS A SQUISH, SQUISH NOISE AT OR AROUND 10 MPH ON ACCEL. OR DECEL.
2005	1FAFP53U85A	7-Apr-05	22-Apr-05	NORRIS FOR	9082851	5K02 *	1130 *	N51	42 E8	29-Jun-07	27	28471	0	63.79	63.79	0.8	34	NOISEY INSTALL FOAM PAD INCLUDES TIME TO REMOVE AND INSTA	LL WHEEL COVERS	
2004	1FAHP36314W	24-Mar-04	22-Aug-04	GARY YEOMI	57506302	5K02 *	1130 *	B65	42 E8	4-Jun-07	34	20585	0	63.99	63.99	0.8	4790	TEST DRIVE HEARING NOISE FROM WHEEL COVERS, RUN OASIS FOUND TSB 060905A INSULATE WHEEL COVERS WITH HARD FOAM TAPE CC42 M O 20589 PERFORMED TECHNICAL SERVICE BULLETIN TO QUIET SQUISH... TECH 721 FOUND LOOSE STUD, REMOVED BRAKE CALIPER, AND BRAKE ROTOR, REMOVED LOOSE STUD, AND REPLACED WITH NEW, REATTACHED ROTOR AND CALIPER, CONCERN CORRECTED, WORK M PAY .7 HRS		
2003	1LNHM87A03Y	17-Jun-03	12-Nov-03	FIESTA LINCOLN	11323406	5K01 3W4Z	1012 AA	B65	33 E8	6-Jul-07	45	40065	9.8	54.22	64.02	0.6	11896	VERIFIED CONCERN, REPLACED LUG NUT CAPS 19019 ROAD TEST FOR RUBBING NOISE FROM WHEELS VERIFIED CONCERN, FOUND HUB CAPS MAKING NOISE CHECK SERVICE MESSAGES, FOUND TSB 06 9 5 REMOVED ALL HUB CAPS, CLEANED ALL HUB CAPS, INSTALLED FOAM ON A		LEFT REAR WHEEL STUD LOOSE IN HUB CUSTOMER STATES CHECK LUG NUT CAPS MISSING
2005	1FAFP34N75W	13-Aug-04	25-Oct-04	MULLINAX FC	307151D	5K01 6S4Z	1012 BA	B65	39 E8	4-Jun-07	32	22913	48.16	16.11	64.27	0.2	2370			
2005	1FAFP34N75W	1-Sep-04	2-Apr-05	CRESTMONT	153863C	5K02 *	1130 *	N50	42 E8	20-Jun-07	27	18955	0	64.43	64.43	0.8	4369		LL HUB CAPS, REROAD TEST TO VERIFY REPAIR	CUSTOMER STATES RUBBING NOISE FROM WHEELS WHILE DRIVING N58 DIAG STEERING NOISY CUSTOMER STATES WHEN TURNING VEHICLE THERE IS AN BAD SOUND LIKE HEAVY CREAKING AND WHINING WHEN TURNING TO LEFT SEEMS OK TO RIGHT. 336 2923 N58 CUST STATES CHECKENGINE LITE IS ON
2005	1FAHP28195G	5-Feb-05	15-Aug-05	POWER FOR	176155C	5K01 *	1007 *	N58	42 E8	27-Jul-07	24	30963	0	64.56	64.56	0.7	5414	30963 1007D .6, M TIME .5 HOOK UP NVH TEST EQUIPMENT TO PINPOINT NOISE. NOISE COMING FROM POWER STEERING. BLEED AIR IN SYSTEM. M TIME FOR BLEEDING AIR.		
2007	1FTRW12W07K	1-Aug-06	18-Aug-06	BILL BRANDT	058537A	5K01 *	1007 *	B65	42 E8	23-Aug-07	13	17693	0	65.08	65.08	0.6	7873	RELEARN TIRE SENSORS		



2006	1FMYU02Z06K	5-Dec-05	9-Mar-06	GRIFFIN FOF	010616D 5K01 *	1007 *	G29	33	E8	12-Jun-07	16	20925	0	65.17	65.17	0.8	6360	TIRE SENSOR 1 REPLACED RIGHT FRONT HUB CAP NOTE: PRIOR CAP REPLACEMENT WAS ON A DIFFERENT WHEEL... R4 425737 01 WAS FOR A DIFFERENT	CHECK TIRE PRESSURE LIGHT IS ON	
2005	1FTPW14585F	28-Sep-04	23-Jul-05	DEWEY FORI	43337803 5K02 5L3Z	1130	EA	B65	D4	E8	10-Jul-07	24	26428	57.34	7.93	65.27	0.1	3540	HUBCAP	CUSTOMER STATES LOGO COMING OFF RIGHT FRONT HUB CAP
2005	1FAFP34N25W	14-Apr-05	27-May-05	VALLEY ISLE	369922A 5K02 6S4Z	1130	A	B65	34	E8	28-Jun-07	26	19747	45.08	20.21	65.29	0.2	7839	REPLACED 2 WARPED HUBCAPS	C S HL F HUBCAP DEFECT, NECESSARY TO REPLACE ALL 4
																			ONT AND 5MM REAR DRUM. FOUND WHEN PRESSING ON WHEEL COVERS IT WOULD MAKE THE SQUEAK SOUND. REMOVED ALL	
																		35908 WHEEL COVERS NOISY 80 VERIFIED SQUEAK NOISE COMING FROM WHEELS, SQUEAK NOISE IS PRESENT WITH OR WITHOUT BRAKE APPLICATION. RAISED VEHICLE AND INSPECTED, NOTHING FOUND. BRAKES OK AT 10MM IN FR	WHEEL COVERS AND TEST DROVE VEHICLE, NOISE GONE. FOUND IN OASIS TSB 06 09 05. TSB	CUSTOMER STATES HE CAN HEAR A RUBBING NOISE COMMING FROM THE FRONT WHEELS , RIGHT SIDE HIGH PITCH WHEN WARMED UP OR WARM OUTSIDE CHROME COMING OFF CHROME CENTER CAPS LEFT REAR OK
2005	1FAFP34N55W	28-May-04	8-Oct-04	LITHIA FORD	357232A 5K02 *	1130 *	B65	42	E8	16-Jul-07	34	35901	0	66.11	66.11	0.8	3897	33389 B65 1130 05 FOUND THE FINISH WAS PEELING OFF 3 HUB CAPS, REPLACED 3 HUBCAPS FOR REPAIR		CUSTOMER STATES CENTER CAPS ARE PITTED AND PEELING WHEEL CENTERS ARE PEELING WHEEL CENTERS ARE PEELING
2005	1FMZK02125G	27-Jan-05	17-Feb-05	LINDQUIST F	237068C 5K02 5F9Z	1130	AA	B65	5	E8	26-Jul-07	30	33382	52.29	14.11	66.4	0.2	20238	CENTER CAPS PITTED WHEEL RING HUB CAP WHEEL COVER REPLACE REPLACE CENTERS ALL FOUR WHEELS	
2006	4M2EU47E36U	1-Jun-06	16-Jun-06	EMERLING F	6789651 5K02 5E6Z	1130	AA	B65	5	E8	20-Jul-07	14	18314	52.02	14.39	66.41	0.2	572	DIAG REPLACE ALL WHEEL CENTERS	
2005	4M2YU57135D	2-Mar-05	18-Aug-05	NORTHLAND	3884301 5K02 5E6Z	1130	AA	B65	D4	E8	28-Jun-07	23	23539	52.02	14.91	66.93	0.2	10638	31500 REMOVED THE FOUR WHEELS AND REMOVED EACH CENTER CAPS AND REPLACED, REINSTALLED THE FOUR WHEELS	
2005	4M2YU57125D	15-Feb-05	14-May-05	NORTHLAND	4023601 5K02 5E6Z	1130	AA	B65	42	E8	16-Aug-07	28	14581	52.02	14.91	66.93	0.2	10638	APPROVAL #PAACN	INSTALL SOP CENTER HUB CAPS FOR CORRODED FINISH CUSTOMER STATES THYAT CENTER CAPS ARE CORRODED FOUND DURING CERTIFICATION CK FOR CENTER CAPS OXIDIZING CENTER CAPS ON WHEELS ARE ALL PEELING
2005	4M2YU57165D	15-Dec-04	3-Jan-05	MATHEWS F	239981B 5K02 5E6Z	1130	AA	B65	D8	E8	12-Jul-07	31	31500	52.02	15.06	67.08	0.2	2265		
2005	4M2YU57135D	5-Jan-05	14-Feb-05	WALLACE LI	089447D 5K02 5E6Z	1130	AA	B65	42	E8	14-Aug-07	31	16839	52.02	15.59	67.61	0.2	10781	REMOVE AND REPLACE WHEEL CENTER CAPS REPLACED CENTER CAPS DUE TO OXIDATION	
2005	4M2YU57105D	23-Nov-04	12-Mar-05	WOODHOUS	7972301 5K02 5E6Z	1130	AA	B65	D4	E8	10-Aug-07	30	35127	52.02	15.78	67.8	0.2	10670		
2005	4M2YU57155D	16-Sep-04	26-May-05	BOB GILLING	155867F 5K02 5E6Z	1130	AA	B65	5	E8	7-Jun-07	25	33889	52.02	15.8	67.82	0.2	2199	REPLACE ALL 4 CENTER CAPS PEELING	

2005	3FAFP31NX5F	27-Jan-05	22-Apr-05	KIMNACH FO	5497701	5K02 *	1130 *	N50	42 E8	21-Jul-07	28	33379	0	67.91	67.91	0.8	6716	ROAD TEST VEHICLE, VERIFIED CONCERN. WHILE DRIVING REMOVED WHEEL COVERS, CONCERN NO LONGER PRESENT. FOUND TSB 06 9 5 PERFORMED TSB, CLEANED WHEEL COVERS, APPLIED TAPE TO BACKS OF WHEEL COVERS. RETESTE	D VEHICLE, CONCERN NO LONGER PRESENT	SQUEEK FROM FRONT WHEELS WHEN DRIVING
																		30090 CUSTOMER STATES THERE IS A SQUEAKING TYPE NOISE FROM REAR OF VEHICLE..ROAD TEST VEHICLE USING CHASSIS EARS. VERIFIED INTERMITTEN TYPE NOISE FROM REAR LIFTGATE AREA. INSPECT..FOUND	UIDE WEDGE SQUEAKING IF YOU PUSH ON LIFTGATE CAN HEAR. REPOSITION AND LUBRICATE. ALSO VERIFIED SQUEAKING NOISE FROM 9 SPOKE WHEEL COVERS. PERFORM TSB 06 9 5 ISOLATE WHEEL COVERS	CUSTOMER STATES THAT THERE ISA A SQUEEKING NOISE FROM VEHICLE AT ALL SPEEDS,NOISE IS COMING FROM REAR OF VEHICLE. CHECK FOR ROTATIONAL CLICKING NOISE IN FRONT WHEN DRIVING GOES AWAY WHEN STOPPING VEHICLE VIBRATION BELOW
2004	1FAFP36374W	27-Jan-04	16-Jul-04	BOWEN SCA	258687F	5K02 *	1130 *	N50	42 E8	12-Jun-07	36	30089	0	68.3	68.3	0.8	8588	LIFTGATE G		
																		BASIC 1130 CC 42 CHECKED FRT END ITS TIGHT REMOVED ALL FOUR HUB CAPS NOISE WENT AWAY REINSTALLED HUB CAPS NOISE WAS GONE.		DRIVING GOES AWAY WHEN STOPPING VEHICLE VIBRATION BELOW
2006	3FAFP07196F	7-Oct-05	31-Mar-06	JORGENSEN	894704	5K02 *	1130 *	N50	42 E8	13-Aug-07	17	17882	0	68.49	68.49	0.8	3523			
2004	1FTVF14564N	6-Mar-04	11-Jan-06	HEALEY FOR	17090001	5K01 *	1007 *	N22	42 E8	18-Jun-07	18	14637	0	68.73	68.73	0.7	3615	PERFORM TSB 07 04 05		
																		15572 CONNECTED SCAN TOOL RETRIEVED AND CLEARED CODE B2872 PERFORMED PIN POINT TESTS RETRAINED ALL FOUR TPMS SENSORS L.F.		CUSTOMER STATES THAT THE TPMS LIGHT KEEPS COMING ON BUT THE PRESSURE IN TIRES IS FINE.CUSTOMER ADDES THAT TIRE SENSOR FAILIRE LITE
2007	1FMEU73E57U	8-Nov-06	27-Nov-06	DICK EDWAF	359958A	5K02 *	1A109 *	G29	42 E8	3-Aug-07	9	15567	0	68.87	68.87	0.9	5205	20F18781,L.R.20F1875F,R.F.20F1876 E R.R.20F1864E SELF TESTED SYSTEM OK ROAD CORRODED REPLACED ALL 4 CENTERCAPS B65 42 1130 DIG IMAGING AUTH PAADR	TESTED OK 4648	CAME ON. C STATES ALL CENTER CAPS CORRODING BADLY CENTER CAPS ON WHEELS TWO FELL OFF WHILE DRIVING (B65)CUSTOMER STATES THAT ALL
2005	4M2CU57115D	10-Feb-05	12-Mar-05	NICK MAYER	15423809	5K02 5E6Z	1130 AA	B65	42 E8	12-Jul-07	29	28603	52.02	17.04	69.06	0.2	10705			
																		REPLACED CENTER CAPS ON 2 WHEELS		FOUR WHEEL CENTER CAPS ARE PEE LING AROUND THE EDGES
2004	5LMEU68H54Z	15-Sep-03	28-Aug-04	CENTRAL FL	3306752	5K02 2C5Z	1130 AA	B65	42 E8	6-Jun-07	34	19610	53.21	15.95	69.16	0.2	10021			
																		(B65)CUSTOMER STATES THAT ALL FOUR WHEEL CENTER CAPS ARE PEE LING AROUND THE EDGES REPLACEMENT COMPLETED		THE EDGES
2006	4M2EU47E86U	6-Mar-06	31-Mar-06	REGENCY LII	9136401	5K02 5E6Z	1130 AA	B65	70 E8	12-Jun-07	15	32045	52.02	17.17	69.19	0.2	11441			

2005	1FAFP34NX5W	25-Apr-05	10-Jun-05	JOHN LANCE	147020B 5K02 *	1130 *	N59	42 E8	1-Aug-07	27	27027	0	69.28	69.28	0.8	2284	27027 VERIF CONCERN PERF TSB 06 09 5 ADDED FOAM TAPE TO WHEEL COVERS CONFIRMED CUSTOMERS CONCERN GOT APPROVAL FROM FORD PAASR TO REPLACE ALL 4 CENTER CAPS REPLACED 4 CENTER CAPS BASIC# 1130	CUSTOMER STATES CENTER CAPS ARE OXIDIZING PLEASE CK AND ADVISE. CK LUGNUTS ARE SEIZED ON VEHICLE WILL NOT COME OFF CHECK CENTER CAPS (PEELING)
2006	4M2EU48836U	23-Mar-06	16-Jun-06	SOUTHGATE	82451 5K02 5E6Z	1130 AA	F19	5 E8	21-Aug-07	15	24943	52.02	17.32	69.34	0.2	10671	SEIZED LUGNUTS BOLT(S) FRONT HUB REPLACE 27927 REPLACED ALL 4 CENTER CAPS FOR DELAMINATING 9604 ROAD TESTED AND VERIFIED CONCERN. REFFERED TO TEB #06 09 05 AND REMOVED ALL HUB CAPS AND APPL IED FOAM TAPE FOLLOWING TSB AND REINSTALLED, TH EN REROAD TESTED NOISE NOW GONE.	WHILE DRIVING CAN HEAR A DRAGGING TYPE NOISE AS DRIVING FASTER ROTATION OF NOISE INCREASES (ITHC) CUST STATES THAT 3 CENTER CAPS ARE PEELING
2005	1FAFP34N15W	28-Jun-05	23-Jul-05	RAY SKILLM/	2494351 5K01 *	1012 *	H44	41 E8	18-Aug-07	26	34499	30.5	38.85	69.35	0.5	4728	25771 REPLACE PEELING CENTER CAPS VERIFIED CONCERN INSPECTED TIRE OK PUT IN DUNK TANK FOUND VALVE STEM LEAKING REPLACED BALANCED TEST	CUST STATES R F TIRE LEAKING
2005	4M2CU57145D	16-Feb-05	14-Jun-05	TASCA FORC	448383A 5K02 5E6Z	1130 AA	B65 D4	E8	21-Aug-07	27	27927	52.02	17.4	69.42	0.2	796	NOISE HAPPENS WITH THE ROTATION OF THE WHEEL NOISY HUBCAPS TSB 06 9 5. NOT DUE TO BEARING. TEST DROVE VEHICLE, COULD NOT VERIFY ROTATIONAL NOISE. HOISTED VEHICLE AND CHECKED OPERATION OF REPLACED ROAD TESTED WITH CHASSIS EARS AND FOUND WHEEL COVER SQUEAKING ON WHEEL. CLEANED ALL WHEEL COVER INSIDE LIPS AND REINSTALLED. ROAD TESTED AND HEARD NO CHIRPS.	BEARING, FOUND OPERATING OK WITH NO NOISE. FOUND PREVIOUS REPAIR OK. RETEST DROVE, FOUND SQUEAK NOISE AT LOW SPEEDS MOST PROMINENT ON LEFT FRONT. INSPECTED LF WHEEL, FOUND TIRE
2005	3FAFP31N15F	25-Jan-05	10-Feb-05	TASCA FORC	448539A 5K02 *	1130 *	N50	42 E8	22-Aug-07	31	9604	0	69.6	69.6	0.8	796		
2005	1FAFP23105G	5-Nov-04	21-Jul-05	MULLINAX FC	164582A 5K02 4F9Z	1130 AA	B65 D4	E8	4-Jun-07	23	25771	52.54	17.15	69.69	0.2	2157		
2005	1FTWW33P25E	14-Dec-04	8-Jan-05	DITSCHMAN/	64461701 5K02 2C3Z	1700 CA	B65	42 E8	20-Jun-07	30	7452	32.24	37.64	69.88	0.4	4216		
2005	3FAFP31N15F	24-Feb-05	5-Apr-05	SOUND FORI	15810602 5K02 *	1130 *	N50	42 E8	11-Jun-07	27	29226	0	70.51	70.51	0.8	8511		
2005	1FAFP34N35W	7-Jun-05	28-Jul-05	EVERGREEN	32557203 5K02 *	1130 *	N50	42 E8	31-Jul-07	25	32398	0	70.59	70.59	0.8	8305		

CUSTOMER STATES THERE IS A ROTATING SWISHING SOUND COMING FROM WHEELS CANNOT TELL IF COMING FROM FRONT OR BACK

CUSTOMER STATES CENTER CAPS ARE OXIDIZING PLEASE CK AND ADVISE. CK LUGNUTS ARE SEIZED ON VEHICLE WILL NOT COME OFF CHECK CENTER CAPS (PEELING)

WHILE DRIVING CAN HEAR A DRAGGING TYPE NOISE AS DRIVING FASTER ROTATION OF NOISE INCREASES (ITHC) CUST STATES THAT 3 CENTER CAPS ARE PEELING

CUST STATES R F TIRE LEAKING

CUSTOMER STATES HEAR CLICK WHIR NOISE AT RIGHT FRONT WHEEL AS DRIVING AT ALL SPEEDS

PE08-060 1509

2006	1FTPW14596K	3-Nov-05	5-Sep-06	LUNDGREN M	032564A 5K02 4L3Z	1130 JA	B66	14 E8	25-Jul-07	11	27566	55.75	15.4	71.15	0.2	9304	REPLACED BOTH LEFT HUB CAPS	HUB CAPS ARE CORRODED AND PEELING
2005	4M2YU57195D	5-Jan-05	1-Aug-05	HAMMONAS	597303 5K02 5E6Z	1130 AA	B65	5 E8	25-Jul-07	25	33505	52.02	19.17	71.19	0.2	3617	VERIFIED REPLACE 4 CENTER HUB CAPS	CUSTOMER STATES WHEELS HAVE PITTED FINISH
2006	1FMEU74E46U	15-Nov-05	5-Dec-05	MILLER FORI	1027162 5K01 *	1007 *	C50	42 E8	22-Aug-07	21	26253	0	71.27	71.27	0.8	1336	ROTATE AND BALANCE TIRES, FOUND FRONT TIRES TO BE SLIGHTLY CHOPPED, INSTALL TO REAR	CHECK FOR VIBRATION IN STEERING WHEEL
2006	4M2YU571X6K	13-Jan-06	25-Mar-06	FAIRWAY FO	101935A 5K02 5E6Z	1130 AA	B65 D4 E8	6-Jun-07	15	11673	55.74	16.01	71.75	0.2	20050	REPL ALL WHEEL COVERS CLOSED BY WPI	CUSTOMER STATES CENTER CAPS ARE PEELING	
2006	1FTPX14536F	20-Dec-05	26-Dec-05	IMLAY CITY F	2105025 5K02 4L3Z	1130 JA	B65 D4 E8	7-Aug-07	20	20931	55.75	17.01	72.76	0.2	2672	REPLACED 2 CENTER CAPS CENTER CAPS ARE ALL CORRODED	CUSTOMER STATES CENTER CAPS FINISH COMING OFF, CK AND ADVISE	
2005	1FAHP281X5G	1-Jul-05	10-Aug-05	MOSINEE FO	6004801 5K02 5G1Z	1130 BA	F11	42 E8	15-Jun-07	23	24837	60.2	12.72	72.92	0.2	6145	WAITING FOR PARTS, THEN WAITING FOR CUST TO RETU	CUST STATES CENTER HUB CAPS ARE CORRODED
2006	1FAFP53U26A	6-Jan-06	21-Jan-06	GRIFFIN FOF	012903A 5K02 *	1130 *	N57	42 E8	31-Jul-07	19	24984	0	73.32	73.32	0.9	6360	DIAGNOSIS FOR NOISE AND R&R ALL HUB CAPS & APPLIEDANTI RATTLE TAPS TO ALL HUB CAPS PITTED CAPS	C S THAT THERE IS A SQUEELING NOISE FROM RIGHT FRONT TIRE WHILE DRIVING
2005	1FAFP28105G	3-Jan-05	27-May-05	COPPER COI	6531853 5K02 5G1Z	1130 BA	B65	81 E8	4-Jun-07	25	16825	60.2	13.3	73.5	0.2	6267	WHEEL RING HUB CAP WHEEL COVER REPLACE	WHEEL RING HUB CAP WHEEL COVER REPLACE
2006	4M2EU47E76U	26-Jul-06	4-Aug-06	AUFFENBERG	141317E 5K02 5E6Z	1130 AA	B65 D4 E8	14-Jun-07	11	17743	55.74	18.07	73.81	0.2	8017	17743 VERIFIED THE CONCERN: ALL FOUR CENTER CAPS ON THE WHEELS WERE FLAKING AND REQUIRED REPLACEMENT.	REMOVED THE CONCERN: ALL FOUR CENTER CAPS ON THE WHEELS WERE FLAKING AND REQUIRED REPLACEMENT.	
2005	1FAFP28115G	17-May-05	28-Jul-05	ULRICH MOT	11483106 5K02 5G1Z	1130 BA	B65	30 E8	16-Jun-07	23	31746	60.2	13.83	74.03	0.2	3457	REPLACED ALL FOUR CENTER CAPS AND VERIFIED THE REPAIR,	REMOVED THE CONCERN: ALL FOUR CENTER CAPS ON THE WHEELS WERE FLAKING AND REQUIRED REPLACEMENT.
2005	1FAFP25125G	3-Dec-04	17-Feb-05	ULRICH MOT	11610206 5K02 5G1Z	1130 BA	F06 P4 E8	24-Jul-07	30	32911	60.2	13.83	74.03	0.2	3457	NOTE: HAD TO REMOVE ALL FOUR WHEELS TO	REMOVED THE CONCERN: ALL FOUR CENTER CAPS ON THE WHEELS WERE FLAKING AND REQUIRED REPLACEMENT.	
2004	1FAFP52U24G	3-Nov-03	18-Aug-04	ABLE FORD,	271665B 5K02 *	1130 *	N11	42 E8	11-Jul-07	36	20858	0	74.25	74.25	0.7	9893	20858 ROAD TEST AND VERIFY CONCERN, NOISE COMING FROM HUB CAP, REMOVE HUB CAPS AND INSTALL DEADENING MATERIAL AS PER TSB 05 25 01 TIME 0.8 HOUR OP 052501A BASIC 1130 CD 42.	CUSTOMER STATES THAT THERE IS A SQUEEING NOISE FROM THE PASSENGER SIDE FRONT END MORE SO AT A SLOWER SPEED
2007	4M2CU39H47K	25-Jul-06	18-Sep-06	COPPER COI	6539751 5K02 6M6Z	1130 A	B65 D4 E8	8-Jun-07	9	18835	67.65	6.65	74.3	0.1	6267	FINISH PITTED WHEEL RING HUB CAP WHEEL COVER REPLACE	LEFT FRONT HUB CAP PEALING	
2006	1FAHP28166G	9-Nov-05	12-Jan-06	VAN BORTEL	59412501 5K02 5G1Z	1130 BA	B65	81 E8	27-Jun-07	18	12868	60.2	14.61	74.81	0.2	7590	DI AUTHORIZED PAAHN TO REPLACE ALL 4 WHEEL COVERS	CUSTOMER STATES CLEAR COAT COMING OFF ALL HUB CAPS
2005	1FAHP28115G	16-Mar-05	30-Mar-05	DON SEELYE	75324901 5K02 5G1Z	1130 BA	B65	14 E8	23-Jul-07	29	30780	60.2	14.9	75.1	0.2	9708	REPLACED ALL 4 WHEEL COVERS	CUSTOMER STATES CLEAR COAT COMING OFF ALL HUB CAPS CENTER CAPS ON THE WHEELS DISCORDED

2005	1FAFP28125G	17-Dec-04	12-Apr-06	KINGS FORD	2281804	5K02	5G1Z	1130	BA	B66	D4	E8	22-Jun-07	15	31189	60.2	15.06	75.26	0.2	1970	REPLACE ALL 4 CENTER CAPS APPROVAL CODE PAA7N	CENTER CAPS ARE STARTING TO PIT
2005	1FAFP251X5G	25-Apr-05	20-Dec-05	BRONDES FC	15956801	5K02	5G1Z	1130	BA	B65	81	E8	26-Jul-07	20	14584	60.2	15.16	75.36	0.2	3010	REPLACED CENTER CAPS	CUSTOMER STATES CENTER CAPS ARE PEELING
2006	1FAFP251X6G	2-Nov-05	30-Nov-05	BRONDES FC	16051801	5K02	5G1Z	1130	BA	B65	81	E8	16-Aug-07	21	35784	60.2	15.16	75.36	0.2	3010	REPLACED 4 WHEEL COVERS REMOVE ALL 4WHEELS TO	ALL FOUR HUB CAPS ARE PEELING, SOP ALL 4 CENTER CAPS CORRODING
2006	4M2YU57186K	17-Oct-05	1-Feb-06	ELMHURST L	6481751	5K02	5E6Z	1130	AA	B65	D7	E8	24-Jul-07	18	35848	55.74	19.95	75.69	0.2	13660	REPLACE CENTER CAPS	C S THAT ALL 4 CEMTER CAPS ARE PEELING
2005	1FAFP25135G	29-Jun-05	28-Sep-05	ELYRIA FORI	086005C	5K02	5G1Z	1130	BA	B65	42	E8	18-Jun-07	21	12378	60.2	15.71	75.91	0.2	4163	INSPECT CENTER CAPS AND REPLACE	
2007	1FAHP24157G	1-Feb-07	20-Feb-07	GATOR FORI	093034A	5K02	5G1Z	1130	CA	T53	42	E8	24-Aug-07	7	12417	60.2	15.93	76.13	0.2	4917	12417 VERIFIED CONCERN CENTER CAPS ON WHEELS KEEP COMING LOOSE CUSTOMER STATES TWO CENTER CAPS HAD COME OFF VEHICLE WHILE DRIVING	C.S CENTER CAP WILL NOT STAY ON WHEELS...ADVISE ...T53
2005	1FAFP25165G	18-Jan-05	14-Sep-05	EWALD'S VEI	51696904	5K02	5G1Z	1130	BA	B65	D4	E8	3-Aug-07	23	35201	60.2	16.51	76.71	0.2	3774	PEELING REPLACE 4 CENTER CAPS APPROVAL CODE PAAUZ TECH CHECKED FOR THE NOISE IN THE LF WHEEL AREA. FOUND TSB 06 9 5.PLACED TAPE ON ALL HUB	CENTER CAPS ARE PEALING REPAIR FOR NOISE HEARD COMING FROM THE LF BRAKE SIDE.
2006	1FAFP31N76W	24-Oct-05	3-Feb-06	CAL WORTH	34804602	5K02	*	1130	*	N17	42	E8	6-Jun-07	17	4428	0	76.74	76.74	0.8	8619	CAPS ROADTESTED OK. DROVE VEHICLE VERIFY VIBRATION CONCERN. INSPECTED TIRES AND SPIN BALNCED FRONT AND REAR TIRES WAS OUT OF BALANCED CAUSE VIBRATION. SET TIRE PRESSURE. REROAD TEST VEHICLE OPERATING AS DESIGNED FLAG	C50 DIAGNOSE AND INSPECT ON CAUSE OF AT FREEWAY SPEEDS THERES A VIBRATION SEE EDDIE PER HIS ROAD TEST
2007	1ZVFT84N075	25-Sep-06	9-Oct-06	SANTA MARC	361148A	5K01	*	1007	*	N25	30	E8	3-Aug-07	10	12181	0	76.86	76.86	0.8	1597	TECH 449.	CUSTOMER STATES:ALL FOUR CENTER CAPS ARE TURING WHITE. CUSTOMER STATES ALL 4 CENTER CAPS TARNISHED
2005	1FAHP28145G	17-Nov-04	21-Jan-05	COLONY FOF	177647B	5K02	5G1Z	1130	BA	F36	81	E8	18-Jun-07	30	16905	60.2	17.13	77.33	0.2	1714	REPLACED WHEEL CAPS.ALL FOUR.	CUSTOMER STATES ALL 4 CENTER CAPS ARE PEELING,BUBBLING
2006	1FAFP25186G	21-Jul-05	16-Aug-05	FRIENDLY FC	148807A	5K02	5G1Z	1130	BA	B65	81	E8	15-Jun-07	23	14336	60.2	17.13	77.33	0.2	2662	14336 VERIFIED CONCERN. REMOVED AND REPLACED ALL FOUR WHEEL CENTER CAPS.	CUSTOMER STATES THAT EH CENTER CAPS ARE PEELING,STILL HEARS A CLICKING NOISE WHEN SITTING IN PASSENGER SEAT WITH WINDOWS DOWN AT SLOWER SPEEDS FROM FRONT TIRE AREA.
2006	1FAFP28136G	10-Nov-05	13-Feb-06	MULLINAX FC	166601D	5K02	5G1Z	1130	BA	B65	D4	E8	11-Jul-07	18	19528	60.2	17.15	77.35	0.2	2157	19528 ORDERED DIGITAL IMAGING APPROVAL# PAAVN INSTALLED SOP CENTER CAPS	PEELING,BUBBLING B01 ALL 4 CENTER CAPS PEELING
2005	1FAFP25125G	6-Jun-05	12-Oct-05	FAIRLANE FC	225014B	5K02	5G1Z	1130	BA	B65	D4	E8	26-Jul-07	22	31970	60.2	17.18	77.38	0.2	3050	31970 REPLACED ALL 4 CENTER WHEEL CAPS DUE TO PEELING	STILL HEARS A CLICKING NOISE WHEN SITTING IN PASSENGER SEAT WITH WINDOWS DOWN AT SLOWER SPEEDS FROM FRONT TIRE AREA.
2006	3MEFM07Z86F	14-Mar-06	26-Apr-06	TRI FORD-ME	321462E	5K02	7N7Z	1130	A	N57	7	E8	3-Jul-07	15	19728	61.02	17.45	78.47	0.2	8294	TRIED TO PUT RUBBER TO MAKE WHEEL COVERS FIT TIGHTER, DID NOT HELP, HAD TO REPLACE RIGHT SIDE HUBCAPS BECAUSE THEY DID NOT FIT PROPERLY, TEST DROVE AFTER NOISE IS GONE	PE08-060 1511

2004	1FDWE35L64H	22-Jun-04	6-Dec-04	ENFIELD FOF	16020401	5K02 *	1130 *	B65	42	E8	21-Aug-07	33	23350	0	78.81	78.81	1	8821	ROAD TEST FOR NOISE,FOUND NOISE COMING FROMT FRONT HUB CAPS	CUST STATES ROTATIONAL NOISE IN FRONT OF CAR, POSS FROM BRAKE SYSTEM CK AND ADV		
2005	1FAFP34N45W	31-May-05	25-Jun-05	EVERGREEN	32315301	5K02 *	1130 *	B65	42	E8	18-Jun-07	25	14547	0	79.41	79.41	0.9	8305	ROAD TESTED WITH CUSTOMER. VERIFIED SQUEAK NOISE FROM R H SIDE OF VEHICLE. CHECKED OASIS FOR TSB AND SSM, NONE APPLY AT THIS TIME. REMOVED R H WHEEL COVERS. ROAD TESTED, NOISE GONE. WHEEL COVERS H	ANED R F AND R R WHEEL COVERS AND WHEELS. LUBED CONTACT POINTS OF WHEEL COVERS. REINSTALLED. ROAD TESTED, OK AT THIS TIME. INSPECT FOR CLICKING NOISE THAT GETS LOUDER AND FASTER WITH SPEED SEE HISTORY SOME OF THE CENTER CAPS ARE LOSING THEIR FINISH WILL REQUIRE DIGITAL IMAGING ADVISE CHECK ALL FOUR CENTER CAPS PITTED CHECK FOR TIRE LIGHT ON		
2005	1FAHP28125G	15-Sep-04	18-Nov-04	HELLER FOR	18011201	5K02 5G1Z	1130	BA	F06	5	E8	12-Jul-07	33	34825	64.5	15.17	79.67	0.2	20054	TECH 676 REMOVED AND INSTALLED 4 CENTERCAPS FLAW IN CENTER CAPS WHEEL RING HUB CAP WHEEL COVER REPLACE CONFIRM TIRE LIGHT ON, RETRAIN SYSTEM AS PER TSB 06 03 07	CHECK FOR TIRE LIGHT ON	
2005	1FAFP25105G	15-Apr-05	30-Jul-05	RAY SKILLM/	2320051	5K02 5G1Z	1130	BA	B66	D4	E8	16-Jul-07	24	34942	64.5	15.54	80.04	0.2	4728	CONFIRM TIRE LIGHT ON, RETRAIN SYSTEM AS PER TSB 06 03 07	CHECK FOR TIRE LIGHT ON	
2006	2FMZA51676E	31-Jan-06	15-Jun-06	MILLER FORI	1023631	5K01 *	1007 *	G29	42	E8	14-Aug-07	15	12857	0	80.18	80.18	0.9	1336	INSTALLED PLASTIC WHEEL LUG NUT COVERS. 6 HAVE COME OFF AND WERE LOST W 20041 VERIFY LUG NUTS RUSTING, NESS TO REPLACE 15 LUGS WITH RUST 17546 DIAG. 2 OF 6 LUG NUTS SEIZED ONTO TO RIM, CHISELD OFF 2 LUG NUTS & REPLACED 4 DUE TO BEING ROUNDED OFF, DIAG. CUST HAS FLAT TIRE, INSTALLED SPARE ON TRUCK CUST WILL BRING BACK AT LATER DATE T	CUSTOMER STATES 6 LUG COVERS HAVE FALLEN OFF WHEELS CHECK FOR LUG NUTS RUSTING,		
2006	1FAFP34N86W	2-Sep-05	21-Mar-06	DITSCHMAN/	64098401	5K02 6S4Z	1K011	A	B65	33	E8	11-Jun-07	15	11467	33.44	47.05	80.49	0.5	4216	INSTALLED PLASTIC WHEEL LUG NUT COVERS. 6 HAVE COME OFF AND WERE LOST W 20041 VERIFY LUG NUTS RUSTING, NESS TO REPLACE 15 LUGS WITH RUST 17546 DIAG. 2 OF 6 LUG NUTS SEIZED ONTO TO RIM, CHISELD OFF 2 LUG NUTS & REPLACED 4 DUE TO BEING ROUNDED OFF, DIAG. CUST HAS FLAT TIRE, INSTALLED SPARE ON TRUCK CUST WILL BRING BACK AT LATER DATE T	CUSTOMER STATES 6 LUG COVERS HAVE FALLEN OFF WHEELS CHECK FOR LUG NUTS RUSTING,	
2005	1ZVFT85HX55	21-Jun-05	14-Oct-05	KRUG HILLT	1967304	5K01 6W7Z	1012	BA	B65	D4	E8	14-Aug-07	23	11800	64.68	16.64	81.32	0.2	1758	INSTALLED PLASTIC WHEEL LUG NUT COVERS. 6 HAVE COME OFF AND WERE LOST W 20041 VERIFY LUG NUTS RUSTING, NESS TO REPLACE 15 LUGS WITH RUST 17546 DIAG. 2 OF 6 LUG NUTS SEIZED ONTO TO RIM, CHISELD OFF 2 LUG NUTS & REPLACED 4 DUE TO BEING ROUNDED OFF, DIAG. CUST HAS FLAT TIRE, INSTALLED SPARE ON TRUCK CUST WILL BRING BACK AT LATER DATE T	CUSTOMER STATES 6 LUG COVERS HAVE FALLEN OFF WHEELS CHECK FOR LUG NUTS RUSTING,	
2007	1FTPW14V47F	30-Aug-06	9-Jan-07	TERREBONN	328812A	5K01 2L1Z	1012	AA	B65	69	E8	27-Jul-07	7	17546	6.27	75.73	82	1	6466	INSTALLED PLASTIC WHEEL LUG NUT COVERS. 6 HAVE COME OFF AND WERE LOST W 20041 VERIFY LUG NUTS RUSTING, NESS TO REPLACE 15 LUGS WITH RUST 17546 DIAG. 2 OF 6 LUG NUTS SEIZED ONTO TO RIM, CHISELD OFF 2 LUG NUTS & REPLACED 4 DUE TO BEING ROUNDED OFF, DIAG. CUST HAS FLAT TIRE, INSTALLED SPARE ON TRUCK CUST WILL BRING BACK AT LATER DATE T	CUSTOMER STATES 6 LUG COVERS HAVE FALLEN OFF WHEELS CHECK FOR LUG NUTS RUSTING,	
2004	1FTRX12W84N	12-Jan-04	18-Nov-04	LIBERTY LIN	115761C	5K02 4L1Z	1130	BA	B65	14	E8	31-Jul-07	33	27468	67	16.35	83.35	0.2	11000	REPLACE 2 WHEEL COVERS	CORROSION CUSTOMER STATES THAT PAINT IS PEELING ON HUB CAPS CENTER WHEEL COVERS ARE PEELING	
2007	1FAFP36NX7W	28-Nov-06	2-Jan-07	DEWEY FORI	43332601	5K02 6S4Z	1130	B	B65	D4	E8	10-Jul-07	7	35127	67.62	15.85	83.47	0.2	3540	1	REPLACED HUBCAPS	CAPS CENTER WHEEL COVERS ARE PEELING
2006	3MEFM08116F	7-Dec-05	19-Jun-06	LIBERTY LIN	114966A	5K02 5T5Z	1130	AA	B65	14	E8	27-Jun-07	13	8800	67.62	16.35	83.97	0.2	11000	REPLACE CENTER CAPS	PEELING	

2006	1FAHP34N16W	1-Feb-06	16-Mar-06	LIBERTY FOF	196174B 5K02 6S4Z	1130 B	B65 D1 E8	2-Jul-07	16	26878	67.62	17.05	84.67	0.2	2222	26878 3 OUT OF THE 4 WHEELS ARE PEELING. ORDERED.REPLACED 3 OUT OF 4 WHEEL COVERS,LEFT FRONT ONLY O.E. ONE.	C S PAINT COMING OFF WHEELCOVERS CUSTOMER STATES THERE IS A TICKING NOISE IN THE WHEEL AREA WHILE DRIVING PLEASE CHECK AND ADVISE
2006	3FAFP06Z26R	2-Jan-06	17-Jan-06	CHAPMAN FC	15600501 5K02 *	1130 *	B65 42 E8	7-Aug-07	19	20416	70	14.91	84.91	0.2	3955	REPLACE WHEEL COVERS 49903 FORCIBLE REMOVE SWOLLEN NUTS. REPLACE NINE LUG NUTS.	CHECK ALL LUG NUTS RUSTED AND SWELLED UP
2003	1LNHM87A53Y	23-Jan-03	15-Nov-03	LIBERTY LIN	116550A 5K01 3W4Z	1012 AA	B65 69 E8	30-Aug-07	47	49903	44.1	40.87	84.97	0.5	11000	WHEEL W HUB CAP WILL NOT STAY ATTACHED TO WHEEL. REPALCED WHEEL AND BALANCED, HUB CAP FITS CORRECTLY	THE PASSENGER FRONT HUB CAP IS CUTTING INTO THE VALVE STEM
2005	1FAFP34NX5W	1-Jul-05	21-Jul-05	RUSTY ECK I	32364401 5K01 4S4Z	1007 AA	B65 34 E8	19-Jun-07	24	17423	58.79	26.32	85.11	0.3	5319	WF 1130 CC42 HEARD CLICKING NOISE FROM 7 SPOKE WHEEL COVERS. INSTALLED SPECIAL ORDER WHEEL COVERS AND ROAD TESTED VEHICLE NO ABNORMAL NOISE HEARD AFTER NEW WHEEL COVERS WERE INSTALLED.	CUSTOMER STATES THERE IS A CLICKING NOISE FROM WHEELS WHEN DRIVING AT LOW SPEEDS. INSTALL SOP.
2006	1FAFP31N76W	18-Nov-05	17-Feb-06	CERRITOS FI	40578701 5K02 5S4Z	1130 AA	N59 33 E8	3-Jul-07	17	13456	67.62	18.55	86.17	0.2	5401	VALVE CAP SEIZED TO STEM BROKE TRYING TO REMOVE, R&R WHEEL ASSY R&R TIRE FROM WHEEL AND INST NEW STEM ASSY	C S VALVE STEM LEAKING ON LEFT FRONT TIRE
2005	1FTWW33P45E	8-Mar-05	28-Apr-05	DOWNS FOR	9129451 5K02 2C3Z	1700 CA	B65 69 E8	20-Jul-07	28	25244	33.75	53.8	87.55	0.6	20681	AND REBAL WHEEL ASSY RIGHT FROM RIM HAD METAL DEBREE ON HUB TEST DROVE NVH DIAG CHECK STEERING OMPONETS AND BALL JOINTS AND DRIVESHAFT CHECK WHEEL RUNOUT AND REMOVE WHEEL RIGHT FRONT AND SAND OFF METAL ON HUB AND RIM CAUS	CLIENT STATE STEERING WHEEL SHIMMIES AT ANY SPEED CUSTOMER STATES:LEFT AND RIGHT REAR WHEEL CENTER CAPS BLISTERING
2005	1FAFP34N85W	8-Dec-04	23-Apr-05	MOSSY FORI	15698301 5K01 *	1015 *	N23 42 E8	11-Jun-07	26	13100	0	87.85	87.85	1	5428	ING THE RIM NOT TO BE FLAT AGAINST HUB	CUSTOMER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING
2005	1MEFM55S25A	14-Oct-04	21-Oct-04	FERRARIO FI	027614A 5K02 3W3Z	1130 AA	B65 D4 E8	6-Jun-07	32	20310	75.35	12.95	88.3	0.2	3366	REPLACED LEFT REAR AND RIGHT REAR WHEEL CENTERS BLISTERING	CUSTOMER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING
2005	2MEFM75WX5X	27-May-05	12-Jun-05	LUNDGREN M	032535D 5K02 3W3Z	1130 AA	B65 D4 E8	24-Jul-07	26	35238	75.35	15.4	90.75	0.2	9304	REPLACED 2 CENTER CAPS	CUSTOMER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING
2006	2MEFM75V86X	20-Apr-06	6-May-06	VAN DRISSE	023351C 5K02 3W3Z	1130 AA	B65 70 E8	10-Aug-07	16	18305	75.35	16.04	91.39	0.2	12505	REPL 2 LEFT SIDE CENTER CAPS WPI	CUSTOMER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING
2005	1MEFM55S65A	11-Nov-04	12-Mar-05	LIBERTY LIN	115640E 5K02 3W3Z	1130 AA	B65 14 E8	25-Jul-07	29	32701	75.35	16.35	91.7	0.2	11000	32701 REPLACE BOTH RT SIDE HUB CAPS. PAINT WAS PEELING.	CUSTOMER STATED THAT THE FINISH ON TWO OF HIS WHEEL COVERS ARE COMING OFF, ADVISE CHECK RIGHT SIDE CENTER CAPS ARE PEELING

2005	1FAFP34NX5W	7-May-04	26-Mar-05	RICART FORI	241816A 5K02 6S4Z	1130 A	N50	14 E8	12-Jun-07 27	30819	45.08	46.76	91.84	0.6	2185	30831 NOISE FROM FRONT WHEELS TEST DROVE WITH CUSTEMER INSPECTED FRONT BRAKES TEST DROVE WITH FRONT WHEEL COVERS REMOVED NOISE GONE APLIED BLACK TAPE TO EDGE AND CLIPS ON FRONT WHEEL COVERS .NOISE	GONE FOR A FEW MILES REPLACE FRONT WHEEL COVERS .TEST DROVE NORMAL OPERATION	CUST STATES THERES A CLICKING NOISE IN THE FRT END TURNING , CAN HEAR IT ON BOTH SIDES
2005	1MEFM50U75A	2-Jul-04	31-May-05	SOUTHGATE	9931251 5K02 3W3Z	1130 AA	F19	5 E8	11-Jul-07 26	4995	75.35	17.32	92.67	0.2	10671	CENTER CAPS REPLACED REAR WHEEL CENTER CAPS DUE TO PEELING CON	CERN.	CUSTOMER STATES BACK GROUND ON CENTER CAPS IS PEELING PLEASE CK AND ADVISE. (RIGHT FRONT AND LEFT REAR)
2006	4M2EU48866L	13-Jan-06	24-Mar-06	METRO FORI	109672B 5K01 *	1007 *	B65	41 E8	13-Jun-07 15	17844	0	92.74	92.74	1.2	7616 17801	CUT OFF CAPS	VALVE STEM CAPS WONT COME OFF CHECK CENTER WHEE HUBS FOR PEELING	
2005	1FAHP28145G	3-Mar-05	30-Apr-05	LIBERTY LIN	115251H 5K02 5G1Z	1130 BA	B65	14 E8	10-Jul-07 27	28503	60.2	32.7	92.9	0.4	11000	28503 REPLACED CENTER WHEEL CAPS	CHECK CENTER CAPS ON ALL FOUR RIMS HAVE CORROSION ON THEM B65	
2005	1FMDK05105G	22-Oct-04	24-Nov-04	LYONS-RYAN	105435B 5K02 5F9Z	1130 AA	B65	5 E8	8-Jun-07 31	32210	74.7	18.96	93.66	0.2	1505	RPL PEELING HUB CAPS	CUSTOMER STATES ALL FOUR CENTER CAPS ARE DISCOLORED AND THE PAINT IS CRACKED AND PEELING.	
2004	1FTPX14524N	12-May-04	26-Jun-04	DAVIES FORI	12636503 5K02 4L3Z	1130 DD	B65	5 E8	5-Jun-07 36	25398	81.51	14.09	95.6	0.2	7329	FOUND TWO CENTER CAPS FINISH PEELING OFF. TOOK PICTURES AS PER FORD PRIOR APPROVAL. APPROVED PAANU. REMOVED AND REPLACED CENTER CAPS. 28322 REPLACED BOTH REAR CENTER CAPS FOR CORRODED DIGITAL IMAGE APPROVAL (PAALU)	BY MARK SAMPLES	2 CTR CAPS HAVE SURFACE PEELING (BOTH REAR CAPS)
2004	1FAFP40624F	21-Apr-04	5-Mar-05	MATHEWS F	240751A 5K02 3R3Z	1130 BA	B65	14 E8	26-Jul-07 30	28322	80.67	15.06	95.73	0.2	2265	VERIFIED CONCERN. PINPOINT TO HUB CAP. CHECK OA SIS SSM TSBS FOUND. TSB 060905 BACK ORDER AND INSTLED TAPE NOISE GONE	C S THERES A CLICKING NOISE COMING FROM FRONT TIRES WHEN DRIVING. CHECK AND ADVISE	
2006	1FAFP34N86W	13-Jan-06	22-Feb-06	VALLEY ISLE	368689B 5K02 *	1130 *	N50	33 E8	11-Jun-07 16	7095	15.4	80.84	96.24	0.8	7839	35294 0 INSTALLED 2 CENTER CAPS (#72402) SEIZED LUG NUTS M TIME, TIME TO REMOVE 4 SEIZED LUG NUTS & REPLACE	CUST STATES THAT 2 WHEEL CENTER CAP LOGOS ARE PEELING C S THAT WHEEL LUG NUT IS HARD TO GET OFF CK AN ADV	
2004	1FTRF14W24N	8-May-04	7-Aug-04	LITHIA FORD	353245A 5K02 4L3Z	1130 DD	B65	D4 E8	8-Jun-07 35	35294	81.51	16.53	98.04	0.2	3897	34271 ORDERED LEFT SIDE CENTER CAPS PER ASM 9. WILL CONTACT CUSTOMER WHEN THEY ARRIVE REPLACED TWO LEFT SIDE CENTER CAPS DUE TO PEELI	NG	CHECK CENTER CAPS ON LEFT SIDE OF VEHICLE (FRONT AND REAR) ARE PEELING.
2007	1FAFP34NX7W	4-Aug-06	22-Oct-06	HARRELSON	7382652 5K01 6S4Z	1012 BA	B65	69 E8	19-Jul-07 10	13027	19.26	78.81	98.07	1	1071			
2004	1FTPW14564K	4-Jun-04	21-Dec-04	ED MULLINA	267004C 5K02 4L3Z	1130 DD	B65	81 E8	20-Jul-07 32	34271	81.51	17.05	98.56	0.2	2283			





2006	3FAFP06ZX6F	16-Mar-06	26-Sep-06	LANDMARK F	670853C	5K02	7E5Z	1130	A	B65	42	E8	20-Jul-07	10	16817	91	19.28	110.28	0.2	8559	16817 WHEEL COVERS WARRANTY FOUND ROTATIONAL SQUEAK NOISE FROM WHEEL COVERS CALLED OASIS, FOUND TSB 6 21 13. PERFORMED DIGITAL IMAGING PRIOR APPROVAL PROCESS. RECEIVED APPROVAL, ACES CODE PAAKW. R	EPLACED ALL FOUR WHEEL COVERS. RETEST DROVE OK.	ROTATIONAL NOISE WHEN DRIVING SLOW NEXT TO WALL ALL 4 CENTER CAPS HAVE CORROSION. CUSTOMER STATES RIGHT FRONT CENTER CAP IS PEELING ORDER CORRODED HUB CAPS CENTER CAPS ARE PEELING ALL 4 WHEEL CENTER CAPS CLEAR COAT IS CRACKING C S CENTER CAPS ARE PEELING CK FOR CHROME LUG NUT COVERS FALLING OFF AUTH NUMBER PAADS METAL SOUND WHEN HITTING BUMPS NOISE COMING FROM WHEEL AREAS THREE OUT OF FOUR CENTER CAPS ARE LOSING THEIR FINISH WILL REQUIRE DIGITAL IMAGING ADVISE
2006	1FTPW145X6F	17-Jan-06	31-Mar-06	BOB GILLING	156023A	5K02	4L3Z	1130	JA	B66	5	E8	11-Jun-07	15	15459	111.5	0	111.5	0	2199	REPLACE 4 CENTER CAPS		
2004	1FTPX14594K	1-Sep-04	26-Oct-04	BEECHMONT	359287E	5K02	4L1Z	1130	BA	B65	33	E8	18-Jun-07	33	33599	100.51	14.93	115.44	0.2	2058	33599 REPLACED CENTER CAP 25073 REPLACED 2, IN STOCK. ORDERED THE THIRD		
2004	1FTRW12W24K	15-Apr-04	15-Jan-05	GRAND LEDC	064830C	5K02	4L1Z	1130	BA	B65	D7	E8	16-Jun-07	30	25073	100.51	15.32	115.83	0.2	9099			
2007	1FAFP34N67W	4-Aug-06	30-Oct-06	KINDLE FORI	32053901	5K02	6S4Z	1130	B	B65	D4	E8	9-Jul-07	9	20535	121.01	0	121.01	0	1237	REPLACE CENTER CAPS CRACKING REPLACED 4 CENTER CAPS DUE TO CRACKING CLEAR COAT 401 1283		
2006	1FTPX14V46N	11-Apr-06	24-Jun-06	KELLY FORD	12224501	5K02	4L3Z	1130	JA	B65	42	E8	28-Jun-07	13	12236	111.5	14.88	126.38	0.2	4808			
2006	1FTPX12596F	27-Mar-06	30-Aug-06	ELYRIA FORI	088590A	5K02	4L3Z	1130	JA	B65	42	E8	21-Aug-07	12	15300	111.5	16.6	128.1	0.2	4163	REPLACE ALL 4 CENTER CAPS		
2005	1FAHP38Z95W	23-Sep-04	24-Oct-04	TED BRITT F	60401003	5K01	6S4Z	1012	BA	B65	42	E8	7-Jun-07	32	20056	24.08	48.38	128.46	0.5	48	REPL SIX LUG NUTS TORQUE TO SPECS DIAG AND REPLACE WHEEL CENTER AS PER TSB		
2006	3MEFM07Z66F	28-Mar-06	23-May-06	NORTHLAND	3837901	5K02	7N7Z	1130	A	B65	D4	E8	12-Jun-07	13	3857	113.9	14.91	128.81	0.2	10638			
2006	3MEFM07ZX6F	1-Feb-06	5-Sep-06	WALLACE LI	089223A	5K02	7N7Z	1130	A	B65	42	E8	1-Aug-07	12	19500	113.9	15.59	129.49	0.2	10781	REPLACE ALL 4 WHEEL COVERS		
2006	1FTPW14V76K	7-Feb-06	4-Mar-06	HELLER FOR	18031701	5K02	4L3Z	1130	JA	B65	5	E8	20-Jul-07	17	15544	119.46	15.17	134.63	0.2	20054	782 REPLACE 4 CENTERCAPS HUB CAPS BLEMISHED WHEEL RING HUB CAP WHEEL COVER REPLACE 1 TEST DRIVE TO VERIFY VIBRATION LEFT FRONT WHEEL HAS EXCESSIVE RUN OUT REPLACE LEFT FRONT WHEEL AND REMOUNT TIRE AND BALANCE RETEST OK ...		
2006	2FMZA52226E	24-Oct-05	15-Nov-05	TOWN AND C	2528451	5K02	3F2Z	1130	BB	B65	81	E8	12-Jun-07	20	17631	121.02	14.75	135.77	0.2	5755			
2006	1FAFP34N36W	26-Apr-06	31-Jul-06	JOE MACHEN	50718801	5K01	4S4Z	1007	AA	N25	2	E8	8-Jun-07	11	29361	58.79	77.28	136.07	0.9	8006			
2004	1FTPW12574K	19-May-04	11-Oct-04	TOWN AND C	2503854	5K02	4L3Z	1130	DD	B65	81	E8	4-Jun-07	33	35944	122.26	14.75	137.01	0.2	5755	CAPS PEELING WHEEL RING HUB CAP WHEEL COVER REPLACE FAULTY WHEEL PAINT 1.6 M TIME TO STRIP AND PAINT ALL 4 WHEELS DIGITAL IMAGING ACES CODE# PAAKR, BY MARK, REFINISHED ALL FOUR WHEELS, VERIFIED REPAIR		
2006	3FAFP06Z06F	3-May-06	17-May-06	TERRY HOLM	5146901	5K01	*	1007	*	B65	81	E8	13-Jul-07	15	17972	19.76	117.87	137.63	1.6	3261			

2005	1FAFP34N95W	5-May-05	16-May-05	DARLING'S B	49265301	5K02	5S4Z	1130	AA	N50	42	E8	7-Jun-07	26	24193	63.21	75	138.21	1	9044	ROAD TESTED AT VARIOUS SPEEDS,CORNERING,STOPPING OVER BUMPS WITH WINDOW UP AND WITH WINDOW DOWN AND WAS UNABLE TO DUPLICATE CONCERN. CHECKED OASIS AND FOUND NO SSMS OR TSBS THAT APPLY. ON LIFT REPLAC	ED ALL FOUR HUB CAPS AND VERIFIED CONCERN IS REPAIRED.	CUSTOMER STATES THERE IS A SQUEAL NOISE COMING FROM FRONT END ALL OF THE TIME. PLEASE CHECK AND ADVISE C S THAT ALL FOUR CENTER CAPS ARE PEALING C S CENTER CAPS ON WHEELS ARE CORRODING CUST STATES L REAR HUBCAP FELL OFF WHILE DRIVING AUTHORIZED LOANER FOR 3 DAYS PER TAMMY.	
2005	1FMZU73K35U	18-Aug-04	16-Jul-05	EWALD'S VEI	51500004	5K02	4L2Z	1130	CA	B65	D4	E8	13-Jun-07	24	26325	124.49	16.51	141	0.2	3774	PEELING REPLACE 4 CENTER CAPS APPROVAL CODE PAALW			
2004	1FTPF12514N	16-Aug-04	8-Oct-04	FRIENDLY FC	149469B	5K02	4L1Z	1130	AA	B65	81	E8	2-Jul-07	34	29831	126.11	17.13	143.24	0.2	2662	29831	REPLACE ALL CENTER CAPS		
2005	3FAFP37NX5F	2-Dec-04	27-Dec-04	VISTA FORD	014952A	5K02	5S4Z	1130	AA	B65	33	E8	22-Jun-07	31	26976	22.54	9.08	143.62	0.1	7923	REPLACE THE LEFT REAR HUBCAP THAT FELL OFF WHILE DRIVING			
2006	1FTPW14526F	23-Jan-06	11-Sep-06	VALLEY ISLE	371019F	5K01	*	1007	*	L65	82	E8	16-Jul-07	11	17128	0	0	146.09	0	7839	\$146.09	LOANER AUTHORIZED FOR		
2005	1FAFP34N25W	20-Apr-05	5-May-05	AUFFENBERG	142248D	5K02	5S4Z	1130	AA	N59	33	E8	25-Jul-07	28	33833	48.3	99.4	147.7	1.1	8017	33833 DIAG TICK NOISE WHEN DRIVING,DRIVE ON STREET AND IN PARKING LOT TO CONFIRM NOISE,RAISE ON HOIST AND INSPECT SUSPENSION,STEERING AND TIRES.INSPECT TIRES FOR SCREWS AND FLAT SPOTS NO CONCERNS	FOUND,TEST DRIVE WITH CUST TO PINPOINT NOISE.NOIOSE IN LEFT FRONT WHEEL VARYS WITH TIRE SPEED,REMOVE WHEEL COVER AND TEST DRIVE NOISE GONE,INSULATE COVER LUGS WITH TAPE AND TEST	LOUD TICKING NOISE HEARD FROM FRONT DRIVERS SIDE TURN LEFT GOES AWAY RIGHT IT GETS LOUDER AND INCREASES WITH SPEED CUSTOMER STATES THE CENTER STORAGE COVER IN THE MIDDLE OF THE DASH IS DELAMINATING JUSTIN DIGITL IMAGED DI AUTH PAA2V	
2005	1FAHP281X5G	11-Mar-05	24-Mar-05	DON CHALMI	4496853	5K02	5G1Z	1130	BA	B02	33	E8	20-Aug-07	30	28113	104.2	43.98	148.18	0.5	1487	THE CENTER STORAGE COVER IS DELAMINATING. REPLACE THE COVER. PREAUTHORIZED PAAKR TO REPLACE WHEEL COVERS FROM DETERIOR ATION. REPL WHEEL COVERS ALL 4 RIMS. VERIFIED AND REPLACED WHEELS			
2004	1FTPX14514N	2-Apr-04	25-Oct-04	VAN BORTEL	59614202	5K02	4L1Z	1130	BA	B65	81	E8	3-Aug-07	34	26611	134.01	14.61	148.62	0.2	7590	COVERS ALL 4 RIMS. VERIFIED AND REPLACED WHEELS			
2004	1FTRX12W04N	17-Jun-04	11-May-05	DON TESTEF	2269602	5K02	4L1Z	1130	BA	B65	42	E8	6-Jun-07	26	25122	134.01	14.82	148.83	0.2	2335	COVERS			

2004	1FTPX14554N	██████████	4	30-Mar-04	28-Jun-04	BEECHMONT	359568A	5K02	4L1Z	1130	BA	B65	81	E8	22-Jun-07	37	29807	134.01	14.93	148.94	0.2	2058	29807 REPLACED CENTER CAPS REPLACE ENTER CAPS, OXIDATION ON CENTER CAPS, WAS TOLD NO APPROVAL	CUSTOMER STATES ALL 4 CENTER CAPS ARE CORREDED SEE RO 359561 APPROVAL CODE PAAEU BY ERIC PART 4L1Z 1130 BA CUSTOMER STATES FINISH ON CENTER CAPS ARE
2004	1FTRF14514N	██████████		14-Apr-04	5-Aug-04	LUNDGREN M	031538A	5K02	4L1Z	1130	BA	B65	5	E8	11-Jun-07	35	18100	134.01	15.4	149.41	0.2	9304	NEEDED FOR WHEELS,	CORRODING, ADVISE CUSTOMER STATES: CENTER CAPS APPEARS TO BE OXIDIZED. CHECK REPLACE ALL FOUR CENTER CAPS FINSH STARTING TO COME OFF AUTH # PAA7N C S WHEEL COVERS CORRODED AND DELAMINATING CUSTOMER STATES THAT THE CENTER CAPS ARE DISCOLORING C S CENTER CAPS ARE PEELING ALL 4 CENTER CAPS ARE PEELING
2004	1FTRF14W24N	██████████		2-Aug-04	31-Aug-04	NEW COUNT	235310C	5K02	4L1Z	1130	BA	B65	81	E8	20-Jun-07	35	11327	134.01	15.6	149.61	0.2	20551	REPLACED CENTER CAP OXIDIZED  REPLAXCED ALL 4 CENTER CAPS REPLACED CENTER CAPS FOR	
2004	1FTPX14574F	██████████		22-Sep-04	4-Oct-04	VARSITY FOF	30552201	5K02	4L1Z	1130	BA	B65	D4	E8	15-Aug-07	35	33866	134.01	17.03	151.04	0.2	2736	PEELING FINISH	
2004	1FTRF14W94N	██████████	4	9-Mar-04	4-Sep-04	COLONY FOF	177590A	5K02	4L1Z	1130	BA	B65	D4	E8	14-Jun-07	34	9565	134.01	17.13	151.14	0.2	1714	CK & INSTALL 4 CENTER CAPS  VERIFIED PROBLEM REPLACED CENTER CAPS, ALL OK AT THIS TIME.	
2004	1LNHM81W64Y	██████████		12-May-04	25-Jun-04	LAZARE LINC	34909803	5K02	4W1Z	1130	BA	B65	14	E8	11-Jun-07	37	26202	143.64	15.85	159.49	0.2	10243		
2003	1LNHM81W53Y	██████████		30-Apr-03	13-Aug-03	NORTH SHOI	181607D	5K02	4W1Z	1130	BA	B65	42	E8	5-Jun-07	47	24242	143.64	16.79	160.43	0.2	10004	. REPLACED HIUB CAP REMOVE WHEELS AND REPLACE ALL 4 CENTER CAPS	
2005	2MEFM75W45X	██████████		30-Jun-05	18-Jul-05	ELMHURST L	6494051	5K02	3W3Z	1130	AA	B65	D4	E8	28-Jul-07	25	14902	161.46	0	161.46	0	13660		
2004	1FTPX14534N	██████████		22-Oct-03	17-Sep-04	FERRARIO F	028741A	5K02	4L3Z	1130	GA	B65	D4	E8	25-Jul-07	35	31398	151.03	12.95	163.98	0.2	3366	ALL 4 WHEEL CENTER CAPS BLISTERING REPLACED CENTERCAPS D B65 VERIFIED CENTER CAPS ARE DISCOLORED. REPLACED CENTER CAPS. AUTH # PAA8W REPLACED 4 HUB CAPS	CUSTOMER STATES:ALL 4 WHEEL CENTER CAPS ARE BLISTERING CUSTOMER STATES THE CENTER CAPS ARE DISCOLORE HUB CAPS ARE PEELING ALL FOUR CENTERCAPS CORRODED AND PEALING CUSTOMER STATES FOUR CENTER CAPS ARE CORRODED PLEASE CK AND ADVISE.
2005	1MEFM50U85A	██████████		9-Nov-04	2-Jul-05	MORROW FC	2271101	5K02	3W3Z	1130	AA	B65	34	E8	28-Jun-07	25	9866	150.7	13.54	164.24	0.2	7327		
2005	1MEFM55SX5A	██████████		18-Aug-04	27-Sep-05	NEW HOLLAI	44536803	5K02	3W3Z	1130	AA	B65	D4	E8	3-Aug-07	23	16520	150.7	15.02	165.72	0.2	1360		
2005	1MEFM50U25A	██████████		16-Aug-04	26-Mar-05	VAN DRISSE	022724C	5K02	3W3Z	1130	AA	B65	5	E8	5-Jul-07	28	9165	150.7	16.04	166.74	0.2	12505	REPL ALL 4 HUB CAPS WPI	
2005	2MEHM75W75X	██████████		16-Aug-04	30-Nov-04	SOUTHGATE	9926456	5K02	3W3Z	1130	AA	F19	5	E8	10-Jul-07	32	28961	150.69	17.32	168.01	0.2	10671	WHEEL CENTER CAPS REPLACE 3 WHEEL CENTERS DUE TO PITTING CORROSION. CONFIRMED CUSTOMER CONCERN GOT APPROVEL FROM FORD TO REPLACE ALL 4 CENTER CAPS PAAEN REPLACED 4 CENTER CAPS BASIC # 1130 CENTER CAPS REPLACED ALL 4 CENTER CAPS DUE TO PEELING CONCERN.	
2005	2MEHM75W65X	██████████		28-Jun-05	27-Sep-05	SOUTHGATE	70151	5K02	3W3Z	1130	AA	B65	5	E8	16-Aug-07	23	18113	150.69	17.32	168.01	0.2	10671		WHEEL CENTER CAPS OK PER BILL COLLINS. CUSTOMER STATES ALL 4 CENTER CAPS ARE PEELING
2005	2MEHM75W65X	██████████		29-Oct-04	5-Jul-05	SOUTHGATE	9903751	5K02	3W3Z	1130	AA	B65	5	E8	3-Jul-07	25	31757	150.7	17.32	168.02	0.2	10671		

2005	2MEHM75W55X	5-Aug-04	30-Mar-05	SOUTHGATE	9788851	5K02	3W3Z	1130	AA	B65	5	E8	4-Jun-07	27	19264	150.7	17.32	168.02	0.2	10671	CONFIRMED CUSTOMER CONCERN REPLACED 4 CENTER CAPS	REPLACE CENTER CAPS ON ALL FOUR WHEELS REAR HUBCAPS HAS BLACK PAINT MISSING FROM CENTER AND LETTERS (PER SCOTT AT DI WHEEL AND CENTER CAPS DO NOT REQUIRE APPROVAL 4 30 07) SOP FROM RO 47102
2006	1LNHM82V66Y	13-Feb-06	22-Mar-06	LINCOLN MEI	5036701	5K02	6W1Z	1130	BA	B65	42	E8	12-Jun-07	15	10800	83.3	85.06	168.36	0.2	10981	BLACK WAS COMING OFF OF LETTERS ON CENTER CAPS 1130 CODE 42 REPL.BOTH REAR WHEEL CENTER CAPS QC GW DIGITAL IMAGE ACCES CODE PAA7T REPLACE ALL 4 WHEEL COVERS	C S ALL 4 WHEEL COVERS PEELING
2005	1MEFM50U95A	9-Aug-04	28-Jun-05	HERB CHAMI	7682203	5K02	3W3Z	1130	AA	B65	81	E8	20-Jun-07	25	14785	150.7	18.76	169.46	0.2	8828	16996 NVH DIAG, PIN POINT TEST, ROADTEST CONFIRM CUSTOMER CONCERN, ROTATE TIRES FRONT TO BACK AND REROADTEST, NEUTRALIZE EXHAUST, CHECK REBALANCE TIRES AND REROADTEST FOR RUNOUT, REINDEX ALL FOUR T	IRES AND REROAD TEST C S VIBRATION WHILE DRIVING
2007	1FAFP53U07A	11-Oct-06	26-Oct-06	MAXWELL FC	793594A	5K01	*	1007	*	N22	42	E8	31-Jul-07	10	16989	0	175.35	175.35	2.1	2923	APPROVAL CODE PAA1X WAITING ON WARRENTY APROVAL. REPLACED ALL 4 HUB CAPS.	CUST STATES LR HUB CAP HAS HAS CORROSION CHECK AND ADVISE CENTER CAP INSTALL S O WHEEL COVERS DUE TO PEELING SEE PART CAR, TECH 24 STICKERS ON RIMS PEELING BACK
2004	1FAFP40614F	13-Apr-04	14-Mar-05	SARAT FORC	26674302	5K02	3R3Z	1130	BA	B65	55	E8	25-Jul-07	29	22369	161.34	15.13	176.47	0.2	9137	REPLACE PEELING WHEEL COVERS	CHECK RIMS PEELING C S FINISH ON WHEEL CENTER CAPS PEELING CUSTOMER STATES ALL FOUR CENTER CAPS ARE CORRODED ADVISOR 160 ORDER PARTS AND PARTS ARE HERE
2004	1FAFP40424F	20-Aug-03	19-Aug-04	ENFIELD FOF	15280001	5K02	3R3Z	1130	BA	B65	D4	E8	21-Jun-07	35	28037	161.34	15.76	177.1	0.2	8821	REPLACED 4 CENTER CAPS 20025 REPLACED CENTER CAPS ALL 4 PERFORM DIGITAL IMAGING AUTH #PAACN	CUSTOMER STATES LEFT FRONT WHEEL MAKING NOISE ALL HUB CAPS PEELING PAINT
2004	1FTPW145X4K	1-Jun-04	3-Jul-04	BRONDES FC	15733207	5K02	4L3Z	1130	DD	B65	81	E8	4-Jun-07	36	31371	163.02	15.16	178.18	0.2	3010	35259 INSTALLED CENTER CAPS	PEELING PAINT PE08-060 1519
2004	1FAFP406X4F	4-Feb-04	7-Jun-04	YORK FORD	366065D	5K02	3R3Z	1130	BA	B65	68	E8	7-Jun-07	37	20025	161.34	17.5	178.84	0.2	8888	WHEEL COVERS WHEEL RING HUB CAP WHEEL COVER REPLACE CHECKED CONCERN FOUND COVER ON LF RIM MAKING LOUD SQUEAKING NOISE R&R RIM MOUNT AND BALANCE TIRE 1 REPLACE ALL CENTER CAPS. AUTH #PAAJV	
2004	1FTPX14594N	4-Jun-04	24-Jun-04	FRIENDLY FC	148936A	5K02	4L3Z	1130	DD	B62	81	E8	18-Jun-07	37	35259	163.02	17.13	180.15	0.2	2662		
2005	2MEFM75W65X	4-May-05	26-May-05	ELMHURST L	6378051	5K02	3W3Z	1130	AA	B65	81	E8	18-Jun-07	26	17890	161.46	19.95	181.41	0.2	13660		
2006	1FTPW14566K	6-Sep-05	7-Oct-05	SANDERS FC	15225501	5K01	7L3Z	1015	B	B65	42	E8	4-Jun-07	21	23829	162.02	21.53	183.55	0.3	6658		
2007	1LNHM82W47Y	6-Dec-06	31-Jan-07	GERVAIS LIN	12840203	5K02	6W1Z	1130	BA	B43	D4	E8	15-Aug-07	7	14501	166.6	17.27	183.87	0.2	13100		

2005	1FTRX14W85F	28-Jan-05	12-Mar-05	VAN BORTEL	59636504	5K01	7L3Z	1015	B	N25	13	E8	7-Aug-07	30	24655	162.02	21.92	183.94	0.3	7590	OUT OF ROUND RIM, PREAPPROVED, PAAMJ. REPLACE RIM, REINSTALLED WHEEL.	CHECK FOR LEFT REAR TIRE HOPPING AROUND 35 45MPH. CUSTOMER STATES THE EDGE OF 1 RIM IS RUSTING, DI APPROVAL TO REPLACE RIM APPROVAL CODE
2006	1FTRF12266N	15-Nov-05	20-Jun-06	BEECHMONT	360867A	5K01	4L1Z	1015	AA	B65	81	E8	19-Jul-07	14	10816	162.81	22.39	185.2	0.3	2058	10816 .5 REPLACED WHEEL 10818	PAAPZ CUSTOMER STATES WHEEL CENTER CAPS ARE OXIDIZING
2004	1LNHM86S74Y	13-Nov-03	12-Feb-04	DAYTONA LI	11066602	5K02	3W4Z	1130	DA	B65	30	E8	13-Aug-07	43	21609	171.58	15.13	186.71	0.2	10378	REPLACE ALL FOUR CENTER CAPS 33219 CUST STATES THE TIRE IS GOING FLAT OVER NIGHT. DROP TIRE INTO WATER TANK AND FOUND PINHOLE LEAK IN THE CENTER OF THE RIM. CONTACT DI ACES PAAGN AUTH TO REPL WHEEL. REMOVE TIRE AND REPLACE WHE	EL AND RECHECK FOR LEAKS. CS THE TIRE IS GOING DOWN OVER NIGHT. HUB CAPS MAKE A SQUEAKING TYPE NOISE WHILE DRIVING SOP HUB CAP INSTALL ALL FOUR WHEEL COVERS ARE DISCOLORED AND THE FINISH IS COMING OFF WILL REQUIRE DIGITAL IMAGING ADVISE
2005	1FAFP53U15A	2-Dec-04	6-Dec-04	CHAMPION F	524806A	5K01	4F1Z	1007	CA	B65	1	E8	10-Jul-07	32	33219	163.21	23.63	186.84	0.3	4617	LIGHT REPAIR NVH ROAD TESTED AND FOUND HUBCAP MAKING NOISE REPLACED ALL FOUR HUB CAPS AND RETESTED	
2006	3MEFM07ZX6P	9-Mar-06	8-Apr-06	ALBUQUERQ	11868101	5K02	7N7Z	1130	A	L69	42	E8	8-Jun-07	15	22298	113.9	75.28	189.18	0.8	10140		
2004	1FTPW14514K	29-Apr-04	14-Jul-04	HELLER FOR	17984501	5K02	4L3Z	1130	DD	B65	5	E8	2-Jul-07	37	15044	174.66	15.17	189.83	0.2	20054	TECH 676 REMOVED AND REPLACED ALL 4 HUBCAPS	WER CONTROL ARM REAR AXLE TRAILING LINKAGES INSP LISTEN TO STRUT BEARINGS LEFT TO RIGHT NO ABNOEMAL NOISES NOTED TESTED WITH OUT WHEEL COVERS AND THE NOISE S
2006	2FMDA51636E	16-Dec-05	12-Jan-06	SOUND FORI	15979903	5K02	*	1130	*	N51	7	E8	11-Jul-07	19	24955	0	193.91	193.91	2.2	8511	SHOCKS LO 37313 REPLACED ALL 4 CENTER CAPS PAATV 25712 CC81 VERIFIED CENTER CAP DELAMINATING ON PREVIOUS RO X HAD DIGITAL IMAGING APPROVAL X REPLACED 4 CENTER CAPS	CUST STATES THERE IS A HUMMING NOISE ESP WHEN TURNING, SEEMS LIKE FROM REAR LEFT ALL 4 CENTER CAPS PEELING
2004	1LNHM87A44Y	17-Oct-03	26-Dec-03	TASCA FORC	442099A	5K02	3W4Z	1130	CA	B65	D4	E8	5-Jul-07	43	37313	177.46	17.4	194.86	0.2	796		
2004	1FMPU16L24L	17-Mar-04	31-Aug-04	HOLMAN FOF	383121A	5K02	4L1Z	1130	BA	B65	81	E8	16-Aug-07	37	25712	181.58	17.68	199.26	0.2	1325		INSTALL SOP WHEEL COVERS

2005	1ZVFT82HX55	2-Apr-05	22-Apr-05	CRESTMONT	155623A 5K02 F42Z	1700 A H62 1 E8	16-Aug-07 29	11359	178.66	24.16	202.82	0.3	4369	REPLACED RIGHT FRONT TIRE FOR TIRE WENT FLAT CAUSED BY VALVE STEM, REPLACED VALVE STEM OLD DOT N9EKF6610905 NEW DOT N9EKF6614806	CUSTOMER WAS DRIVING ON HIGHWAY AND RIGHT FRONT TIRE WENT FLAT. STE
2007	1FAFP53U87A	4-May-06	13-Jun-06	CAL WORTH	35156704 5K01 YF1Z	1007 FA N24 42 E8	20-Jul-07 14	17358	90.44	124.7	215.14	1.3	8619	TEST DRIVE VERIFY CONCERN PERFORM WHEEL RUNOUT FOUND LEFT FR WHEEL HAD EXCESSIVE RADI RUN OUT. REPLACE WHEEL AND REBALCANCE RECHECK RUN OUT IS OK	C S STEERING WHEEL SHAKES WHEN AT 65 TO 70 MPH
2005	1FTZR15E65P	27-Aug-04	8-Dec-04	NEW HOLLAND	43899601 5K01 2L5Z	1007 BAC B65 D1 E8	11-Jun-07 31	25356	194.56	22.53	217.09	0.3	1360	L R RIM HAS A PIN HOLE ON IT I SUBMITTED 2 SETS OF IMAGING AND AM WAITING FOR RESULTS FROM FORD MOTOR CO DIG IMA. REPLACE LEFT REAR RIM AS NEEDED.	CUSTOMER STATES FRONT TIRE LOOSE A FEW PUNDS OF PRESSURE OVER NIGHT. TECH FOUND THE 4 CENTER CAPS PEELING
2004	5LMEU88H74Z	9-Dec-03	28-Apr-04	ED SHERLIN	8772504 5K02 2C5Z	1130 AA B65 81 E8	3-Aug-07 40	40770	212.86	12.53	225.39	0.2	401	ALL 4 CENTER CAPS PEELING REPLACED ALL 4 CENTER CAPS ACES CODE#PAA8V	CUSTOMER STATES ALL FOUR CENTER CAPS ARE PEELING
2004	5LMEU68H44Z	29-Oct-03	19-Dec-03	ISLAND LINC	7912353 5K02 2C5Z	1130 AA B65 81 E8	14-Jun-07 43	19211	212.86	14.86	227.72	0.2	11643	CENTER CAPS CORRODING REPLACED CENTER CAPS PER DI.	CORRODING DI APPROVAL PAAHW CUSTOMER STATES WHEELS AND CENTER CAPS ARE CORRODING
2004	5LMEU68H14Z	21-Nov-03	21-Aug-04	ISLAND LINC	7887856 5K02 2C5Z	1130 AA B65 81 E8	6-Jun-07 34	20243	212.86	14.86	227.72	0.2	11643	CENTER CAPS EXCESSIVE CORROSION REPLACE ALL 4 CENTER CAPS DUE TO EXCESSIVE CORROSION	ON 3 23 05 CUSTOMER STATE THE WHEEL COVERS ARE COMING APART
2003	5LMEU78H13Z	28-Jan-03	5-Aug-03	NEW HOLLAND	44540201 5K02 2C5Z	1130 AA B65 D4 E8	3-Aug-07 49	29913	212.86	15.02	227.88	0.2	1360	REPLACED CENTER CAPS	CUSTOMER STATES THE CLEAR COAT IS PEELING ON ALL 4 WHEELS. CHECK AND ADVISE.
2005	5LMEU68H25Z	26-Jul-05	3-Feb-06	DONLEY FOF	11194104 5K02 2C5Z	1130 AA B65 81 E8	27-Jul-07 18	40355	212.86	15.06	227.92	0.2	2263	VERIFIED CONCERN. REPLACED CENTER CAPS PER DIGITAL IMAGING CODE#PAAHU	CUSTOMER STATES CENTER CAP ARE DISCOLORED APPROVED BY JACKIE
2004	5LMEU68H04Z	9-Jan-04	9-Sep-04	DESOTO FOF	9452851 5K02 2C5Z	1130 AA B65 D4 E8	8-Jun-07 34	40976	212.86	15.11	227.97	0.2	4865	VERIFIED REPLACED ALL CENTER CAPS PER DIGITAL IMAGING RECHECKED OK	C STATES ALL 4 CENTER CAPS ARE CORRODING
2003	5LMEU78H63Z	13-Mar-03	26-Mar-04	NICK MAYER	15501901 5K02 2C5Z	1130 AA B65 42 E8	10-Aug-07 42	44517	212.86	17.04	229.9	0.2	10705	REPLACED CENTER CAPS, AUTH PAANN 34734 REPLACED ALL FOUR CENTER CAPS.	C S CENTER CAPS ON WHEELS PEELING
2004	5LMEU88H34Z	5-Sep-03	24-Jul-04	LIBERTY FOF	195815A 5K02 2C5Z	1130 AA B65 81 E8	21-Jun-07 36	34734	212.86	17.05	229.91	0.2	2222	VEH WAS IN SHOP AND ACTUAL MILES WERE CHECKED AND ENTERED. MILEAGE FROM THE OTHER DEALERSHIP PA CODE 03273 WAS RECORDED I	NCORRECT BUBBLING SOP IN

2004	5LMEU88H54Z	28-Jan-04	16-Aug-04	YORK FORD	368781A	5K02	2C5Z	1130	AA	B65	68	E8	23-Aug-07	37	41201	212.86	17.5	230.36	0.2	8888	41201 REMOVE & REPLACE CENTER CAPS	4 CENTER CAPS PITTED
2004	5LMEU88HX4Z	26-May-04	15-Oct-04	SUNSHINE FI	10624801	5K02	2C5Z	1130	AA	B65	D4	E8	24-Jul-07	34	40121	212.86	17.9	230.76	0.2	3605	DIGITA IMAGE APPROVED REPLACED 4 WHEEL CENTER CAPS AUTH # PAAZS VERIFY CONCERN. DIGITAL IMAGE PRIOR APPROVAL CODE PAAZS REPLACE ALL 4 CENTER CAPS DUE TO PEELING COROSION	CUST STATES WHEEL CTR CAPS PEELING, DIGITAL IMAGE APPROVED REPLACE 4 CENTER CAPS CUSTOMER STATES ALL FOUR WHEEL CENTER CAPS ARE EITHER PEELING OR RUSTING CENTER CAPS ARE PEELING
2004	5LMEU88H64Z	1-Jul-04	26-Aug-04	HERB CHAMI	7968403	5K02	2C5Z	1130	AA	B66	81	E8	6-Aug-07	36	36626	212.86	18.76	231.62	0.2	8828	REPLACED CENTER CAPS 32928 OUT OF ROUND NVH DIAG, CHECK TIRE WHEEL RUNOUT, RT RR WHEEL OUT OF ROUND, NO SIGNS OF DAMAGES R&R RT RR WHEEL BALANCED, OK.TECH 2519	C S THAT THERE ISA VIBRATION COMING FROM THE VEHICLE AT SPEEDS OVER 65 MPH. SEE HISTORY CK FRONT END/SUSPENSION CUSTOMER STATES THAT FINISH IS FLAKING OFF OF LEFT REAR WHEEL CUSTOMER, ALL 4 WHEEL COVERS ARE CORRODED CHROME PEELING LEFT REAR WHEEL
2004	5LMEU88H34Z	17-Nov-03	19-Jul-04	HAMMONAS	511902	5K02	2C5Z	1130	AA	B65	5	E8	23-Jun-07	36	38238	212.86	19.17	232.03	0.2	3617	WHEEL REPLACED R I G H T F R O N T WHEEL 9209	C S PAINT ON WHEELS BEHIND HUBCAPS IS COMING OFF CUSTOMER STATES THAT THEY HAVE BEEN LOSING AIR FROM THEIR TIRE, HAD IT CHECKED AND THE RIM SEEMS TO BE CRACKED AND LEAKING AIR, CHECK AND ADVISE RIGHT FRONT CUSTOMER , THERE IS NOISE WHILE DRIVING AT TTIMES CHECK LEFT FRONT WHEEL IS PEELING CLIENT STATES PASSENGER REAR WHEEL FINISH IS STARTING TO CRACK PE08-060 1522
2006	1ZVFT85H765	17-Oct-05	4-Nov-05	COOK-WHITE	013390A	5K01	6R3Z	1007	C	N25	D9	E8	10-Aug-07	22	32928	211.32	21.17	232.49	0.3	4910	WHEEL REPLACED R I G H T F R O N T WHEEL 9209	WHEEL REPLACED R I G H T F R O N T WHEEL 9209
2005	1FTRF14W95N	18-Feb-05	19-Mar-05	BLOOMINGT	1694401	5K01	4L3Z	1007	AB	B65	42	E8	22-Jun-07	28	22633	221.48	22.56	244.04	0.3	4691	WHEEL REPLACED R I G H T F R O N T WHEEL 9209	WHEEL REPLACED R I G H T F R O N T WHEEL 9209
2003	5LMEU88H93Z	26-Feb-03	9-Sep-03	ELMHURST L	6551751	5K02	2C5Z	1130	AA	B65	D7	E8	14-Aug-07	48	34221	228.06	19.95	248.01	0.2	13660	VERIFY AND REPLACE ALL FOUR WHEEL COVERS	VERIFY AND REPLACE ALL FOUR WHEEL COVERS
2006	1FTSW21PX6E	13-Dec-05	30-Dec-05	LINDQUIST F	233647C	5K01	5C3Z	1015	MA	P66	5	E8	7-Jun-07	18	16462	222.67	28.22	250.89	0.4	20238	16462 VERIFY AND REPLACE WHEEL ASSEMBLY POOR FINISH STEEL WHEELS ARE RUSTING, REPLACE FRONT AND REAR ON LEFT SIDE AND RIGHT REAR WHEELS	16462 VERIFY AND REPLACE WHEEL ASSEMBLY POOR FINISH STEEL WHEELS ARE RUSTING, REPLACE FRONT AND REAR ON LEFT SIDE AND RIGHT REAR WHEELS
2006	3FAFP06Z46R	25-Apr-06	20-May-06	METRO FORI	2280251	5K01	6E5Z	1015	BA	B65	81	E8	19-Jun-07	14	22650	204.79	50.89	255.68	0.8	5977	TIRE(S) OR WHEEL(S) REPLACE	TIRE(S) OR WHEEL(S) REPLACE
2005	1FTWF30545E	8-Dec-04	3-Jun-05	RUSTY ECK I	32478901	5K01	5C3Z	1015	PA	B65	1	E8	7-Jul-07	26	20670	222.67	35.09	257.76	0.4	5319	CRACKED WHEEL W;DIA AIR LEAK FROM WHEEL ASY;SOAP TESTED AND FOUND THE WHEEL WAS LEAKING FROM THE WELDED SEAM;REMOVED TIRES AND REPLACE D TIRE;REBALANCED OLD TIRE ON A NEW WHEEL AND REINSTALLED ON ROAD TEST VERIFY CONCERN DIAGNOSE AND REPLACE WHEEL COVERS	VEH. CRACKED WHEEL W;DIA AIR LEAK FROM WHEEL ASY;SOAP TESTED AND FOUND THE WHEEL WAS LEAKING FROM THE WELDED SEAM;REMOVED TIRES AND REPLACE D TIRE;REBALANCED OLD TIRE ON A NEW WHEEL AND REINSTALLED ON ROAD TEST VERIFY CONCERN DIAGNOSE AND REPLACE WHEEL COVERS
2006	2MEFM74V56X	4-May-06	15-Sep-06	ELMHURST L	6559051	5K02	5W3Z	1130	DA	N50	42	E8	17-Aug-07	12	18098	194.58	79.79	274.37	0.8	13660	REPL LF WHEEL ASM PEELING WPI	REPL LF WHEEL ASM PEELING WPI
2007	1MEFM40137G	17-May-06	2-Jun-06	VAN DRISSE	023190A	5K01	7G1Z	1007	B	B65	D4	E8	2-Aug-07	15	21546	251.29	24.06	275.35	0.3	12505	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE
2005	1FAFP27135G	29-Nov-04	5-Apr-06	MOSSY FORI	15909208	5K01	7G1Z	1007	B	B65	34	E8	18-Jul-07	16	15852	253.67	26.36	280.03	0.3	5428	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE	WHEELS DISTORED CRACKING REPLACE RI, AND SET TIRE PRESSURE



2005	1FAFP34NX5W	24-Sep-04	20-May-05	JARRETT-GC	11096801	5K01	4S4Z	1007	AA	B65	81	E8	10-Aug-07	28	27445	235.14	50.9	286.04	0.7	3781	APP CODE PAASR VERIFY CONCERN OF ALL 4 WHEELS RUSTING NECESSARY TO REPLACE WHEELS BREAK DOWN TIRES AND REMOUNT AND BALANCE ALL TIRES	C S VEHICLE WHEELS IS RUSTED . ALL 4 CUST STATES WHEELS ARE RUSTING PREMATURELY, ADVISE
2005	1FAFP34NX5W	31-Aug-04	7-Dec-04	WOODY AND	5309051	5K01	4S4Z	1007	AA	F25	42	E8	17-Jul-07	32	17154	235.15	53.54	288.69	0.7	5892	REPLACED ALL 4 RIMS, MOUNT AND BALANCE 4 TIRES	L SPARK PLUG W/ #7 CYL STLL MIESS ON #6 CYL INSTALL NOID LIGHT ON #6 CYL FOUND PIN #2 IN CONNECTOR 116 CIRCUIT 10125 DG YE WIRE PULLED OUT OF CONNECOT REFASTER PIN AND ROAD TEST FINAL TEST
2006	1ZVHT82H565	3-Feb-06	30-Mar-06	MOSSY FORI	16087501	5K01	*	1025	*	E29	X2	E8	15-Aug-07	17	11903	0	289.93	289.93	3.3	5428	S RUNNING ROUNG POOR CONNECTION AT #6 OIL CONNECTOR EEC TEST PIMPOINT TEST,MONITOR ROAD TEST INTERMITTANT MISFIRE ON #6 SWAPEED #6 COIL W CYL #7 STILL MISSES ON #6 POWER BLACNE ROAD TEST SWAPPED 36 CY	CLIENT STATES THAT THE CHECK ENGINE LIGHT IS LIT AND THE VEHICLE WA
2005	1FAFP34N25W	9-Sep-04	2-Jan-05	BEV SMITH F	47576903	5K01	4S4Z	1007	AA	B65	5	E8	1-Aug-07	32	13000	235.14	56.08	291.22	0.7	4909	1 DIAGNOSE WHEELS.ALL 4 RIMS HAS RUST ON THEM.DISMOUNT 4 TIRES .MOUNT 4 TIRES TO NEW RIMS.BALANCE 4 TIRES.	1 ALL 4 WHEELS RUSTED APPROVAL# PAAKT CUST STATES ALL FOUR 15 INCH BLACK STEEL WHEELS ARE RUSTING B65
2005	1FAFP36N25W	13-Oct-04	25-Feb-05	JORGENSEN	807502	5K01	4S4Z	1007	AA	B65	5	E8	19-Jul-07	30	12681	235.14	59.93	295.07	0.7	3523	BASIC 1007 CC 05 APP#PAA8R MOUNT AND BALANCED BLACK STEEL WHEELS	C S LEFT REAR TIRE GOES FLAT EVERY 3 DAYS DISCOUNT SAYS IT S BECAUSE THE FINISH ON THE RIM WHERE THE TIRES BEAD GOES IS FLAKING OFF CK AND REPORT APPROVAL CODE IS PAAXM
2004	1LNHM83W24Y	22-Mar-04	13-Oct-04	BLUEBONNE	47229601	5K01	4W1Z	1007	CA	B65	13	E8	29-Jun-07	33	33029	280.28	16.77	297.05	0.2	4570	REPLACED LEFT REAR RIM	CHECK AND ADVISE CUSTOMER STATES AIR IS LEAKING FROM PASSANGER FRONT RIM WHERE RIM IS WELDED TOGETHER ON INSIDE
2006	1FDAF56P26E	6-Aug-05	11-Apr-06	FRITTS FORI	9613651	5K01	6C3Z	1015	D	A85	D1	E8	5-Jun-07	15	19517	222.67	77.85	300.52	0.9	5557	FOUND LEAK IN RIM. REPLACED RIM. HAD TO TAKE OLD TIRE OFF OLD RIM. MOUNTED AND BALANCED OLD TIRE ON NEW RIM. INSTALLED HUB CAP.	PE08-060 1523

2005	1FTPW14545K	4-May-05	27-Jan-06	COUNTY MO	19002301	5K01	5L3Z	1007	BA	B65	81	E8	13-Aug-07	19	30327	281.67	20.47	302.14	0.3	944	REPLACED LEFT FRONT WHEEL	CHK CLEARCOAT PEELING ON LEFT FRNT WHEEL C S RF WHEEL CHROME PEELING NOT ALLOWING BEAD TO SEAL
2004	1LNHM83W24Y	22-Mar-04	13-Oct-04	BLUEBONNE	48044701	5K01	4W1Z	1007	CA	B65	2	E8	15-Aug-07	35	35263	280.28	25.16	305.44	0.3	4570	APPROVAL PAALX . 27221 APPROVAL CODE PAATZ. REPLACED LEFT FRONT WHEEL.	FRONT WHEEL FINISH IS PEELING OFF
2005	1FMZU67K25U	15-Nov-04	28-Feb-05	DIFFEE FORI	185326A	5K01	2L5Z	1007	AA	B65	42	E8	8-Aug-07	30	27221	284.16	21.79	305.95	0.3	6835	QC9623 25050	CUSTOMER STATES THE PASSENGER REAR WHEEL IS CORRODING CUSTOMER STATES DRIVERS REAR RIM IS BUBBLING CUSTOMER STATES RIGHT FRONT WHEEL CLEAR COAT PEELING
2005	1FMZU77K65U	25-Feb-05	30-Jun-05	MULLINAX FC	309888B	5K01	2L5Z	1007	AA	B65	42	E8	31-Jul-07	26	21770	284.16	24.17	308.33	0.3	2370	VERIFIED CONCERN,REPLACED WHEEL,RECHECKED,OK	CUSTOMER STATES DRIVERS REAR RIM IS BUBBLING CUSTOMER STATES RIGHT FRONT WHEEL CLEAR COAT PEELING
2005	1FTZR15E15P	29-Jul-05	25-Aug-05	JOHN LANCE	145089A	5K01	2L5Z	1007	BA	B65	5	E8	5-Jul-07	23	24859	283.01	25.98	308.99	0.3	2284	24859 REPLACE LEFT REAR RIM MOUNT AND BALANCE	CUSTOMER STATES RIGHT FRONT WHEEL CLEAR COAT PEELING
2005	1FTZR45E45P	15-Feb-05	18-Jun-05	JOHN LANCE	144995A	5K01	2L5Z	1007	AA	B65	D4	E8	3-Jul-07	25	9927	284.16	25.98	310.14	0.3	2284	9927 REPLACE WHEEL VALVE STEM BALANCE	CUSTOMER STATES PAINT PEALING FROM RIGHT FRONT, RIGHT REAR, AND LEFT REAR WHEELS ...
2005	1FTYR10D85F	26-Jul-05	28-Sep-05	JOE MACHEM	51379404	5K01	YL2Z	1015	AA	B65	P4	E8	6-Aug-07	23	25336	248.43	68.69	317.12	0.8	8006	REPLACE RIGHT FRONT AND RIGHT REAR AND LEFT REAR WHEELS	STEERING WHEEL VIBRATION SHIMMY ABOVE 45 MPH C S THAT VEH VIB REAL BAD AT SPPED OF 60 70 STEERING WHEEL MOVES SIDE TO SIDE CHECK LEFT REAR RIM CHROME PEELING
2005	1FTYR10UX5F	9-Jun-05	20-Aug-05	MAXWELL FC	791645A	5K01	*	1007	*	N24	42	E8	6-Jul-07	23	14415	0	317.3	317.3	3.8	2923	14415 NVH DIAG, PINPOINT VIBRATION TO FRONT WHEELS TIRES, PERFORM ROAD FORCE BALANCE ON BOTH FRONT TIRES, WELL WITHIN SPECS, 9 11LBS. REBALANCED AND RETEST, OK AT THIS TIME. T1147 CC42	HAVE RUST SHOWING THREW HUBCAPS STEERING SUSPENSION CONCERN
2006	1FMEU74E26U	8-Aug-05	20-Oct-05	B & B FORD	7689602	5K01	6L2Z	1007	EA	B65	5	E8	3-Jul-07	21	17863	301.5	20.78	322.28	0.3	6329	CHROME PEELING FROM WHEEL REPLACE WHEEL	REPLACED LEFT FRT WHEEL. SQUEAK.
2006	3FAFP06Z06R	31-Mar-06	29-Apr-06	METRO FORI	2477752	5K01	6E5Z	1015	BA	H62	D4	E8	1-Aug-07	16	21629	273.06	50.89	323.95	0.8	5977	WHEELS RUSTED TIRE(S) OR WHEEL(S) REPLACE	N50 CUSTOMER STATES HEARS SQUEAK WHILE DRIVING LEFT FRONT WHEEL IS MAKING NOISE SOP HERE APPROVAL CODE PAAUW
2007	1FMFU17577L	22-Nov-06	4-Jan-07	BOB TOMES	63458001	5K01	7L1Z	1007	D	B50	33	E8	12-Jul-07	7	14536	296.11	42.05	338.16	0.5	2531	REPLACED LEFT FRT WHEEL. SQUEAK.	

2004	1FMZU75W24Z	27-Aug-03	4-Oct-04	LINDQUIST F	233915B 5K01 3L2Z	1007 KA B65 42 E8	11-Jun-07 33	33701	315.62	35.28	350.9	0.5	20238	CONCERN. REPLACE RH REAR WHEEL, INCLUDES TRANSFERRING TIRE PRESSURE MONITOR SENSOR AND BALANCING THE COMPLETE ASSY. ROAD TEST TO VERIFY TPM SYSTEM	RIGHT REAR RIM CRACKING
2004	1FAFP45X44F	21-Feb-04	12-Nov-04	PARADISE FC	1772351 5K01 3R3Z	1007 CA B65 41 E8	4-Aug-07 34	2837	329.95	22.16	352.11	0.3	3942	FUNCTIONING PROPERLY. REPLACE RIM	REPLACE R R WHEEL EXCESSIVE RIM RUN OUT
2006	1FTRX14546F	19-Sep-05	15-Mar-06	ULRICH MOT	11652101 5K02 6L3Z	1120 BA F11 30 E8	4-Aug-07 17	16137	279.22	89.88	369.1	1.3	3457	LUGS NUTS ARE RUSTING. R&R ALL LUG NUTS.	R&R LUG NUTS
2004	2FTRF07314C	7-Apr-04	22-Jul-04	GARY YEOM, 57647503	5K01 3L3Z	1007 AA B65 D4 E8	15-Jun-07 36	35555	350.9	24	374.9	0.3	4790	CC 14 REPLACED AND REBALANCED RIGHT FRONT WHEEL.	PASSENGER FRONT RIM HAS A CASTING FLAW DI PAAMX
2005	1FAHP34N55W	4-Jan-05	22-Feb-05	HOLMAN FOF	380677C 5K01 4S4Z	1007 AA B65 81 E8	2-Jul-07 29	11955	318.62	61.87	380.49	0.7	1325	11955 VERIFIED CUST CONCERN ALL WHEELS RUSTED XX MOUNT AND BALANCED ALL FOUR TIRES ON NEW RIMS	CUST STATES ALL FOUR WHEELS RUSTED
2004	1FTYR10DX4F	1-Jun-04	5-Mar-05	L F DONNELL	419643A 5K01 YL2Z	1015 AA F06 D4 E8	28-Jul-07 30	15808	331.24	60.25	391.49	0.8	2220	REPLACED ALL 4 RIMS FROM PAINT PEELING	PELLING OFF ALL 4 RIMS
2006	1FTRE14W46D	8-Feb-06	21-Mar-06	OASIS FORD	1402251 5K02 4C2Z	1130 AB B65 42 E8	19-Jul-07 17	10755	379.81	19.29	399.1	0.2	3604	AUTH CODE: PAAYU WHEEL RING HUB CAP WHEEL COVER REPLACE	C S RATTLE NOISE COMING FROM RIMS OF THE VEHICLE
2006	1LNHM82V86Y	22-Nov-05	17-Mar-06	MATHEWS F	239447B 5K01 6W1Z	1007 DA B65 14 E8	3-Jul-07 16	13487	379.82	22.59	402.41	0.3	2265	13487 REPLACED RIM	RIGHT FRONT RIM IS PITTED
2006	1FMYU02Z36K	13-Jun-05	31-Aug-05	DEWEY FORI	43014701 5K01 6L8Z	1015 C F25 D4 E8	4-Jun-07 22	24429	341.26	63.41	404.67	0.8	3540	METAL ON WHEELS WERE NOT CORROSION PROTECTED BEFORE PAINTED, CAUSING METAL TO RUST THROUGH REPLACE ALL FOUR WHEELS PER WARRANTY. AUTHO CODE#PAAVE	CUSTOMER IS CONCERNED THAT HIS WHEELS ARE RUSTING. ALL WHEELS HAVE RUST CORROSION.
2005	1FMYU92Z75K	27-Feb-04	29-Mar-05	JOHN LANCE	145722A 5K01 6L8Z	1015 C B65 D7 E8	13-Jul-07 28	30653	341.26	69.28	410.54	0.8	2284	30000 VERIFY CONCERN REPLACE ALL FOUR RIMS	CUSTOMER STATES WHEELS ARE RUSTING
2005	1FTSW21P65E	22-Feb-05	16-Mar-05	ULRICH MOT	11517701 5K01 5C3Z	1007 DA B65 1 E8	27-Jun-07 28	31175	383.82	34.57	418.39	0.5	3457	MOUNT AND BALANCE TIRE ON NEW WHEEL. MOUNT SPARE BACK UNDER TRUCK. CHECK OPERATION OK	CHECK LEAK IN RIM ADVISE
2005	1FMYU93175K	4-Feb-05	14-Feb-05	LIBERTY LIN	115162H 5K01 5L8Z	1007 DB B65 14 E8	6-Jul-07 30	20289	391.44	40.87	432.31	0.5	11000	20289 REPLACED BOTH REAR WHEELS OKED DIGITAL IMAGING ACES #PAADU	BOTH REAR WHEELS FINISH IS CORRODING AROUND CENTER CAPS
2005	1FMYU93155K	28-Feb-05	26-Jul-05	BOB GILLING	155919D 5K01 5L8Z	1007 DB B66 5 E8	8-Jun-07 23	16534	391.44	47.4	438.84	0.6	2199	CK OUT REPLACE BOTH RIGHT SIDE RIMS CORRODING	CUST STATES BOTH RIGHT SIDE WHEELS CLEAR COAT IS BUBBLING NEAR CENTER CAP MUST DI
2006	1FMFU20546L	6-Sep-05	28-Jun-06	KENNY ROS	680809B 5K01 5L1Z	1007 AA B65 D4 E8	21-Jun-07 12	16759	393.31	53.49	446.8	0.7	7350	16759 RF WHEEL PITTING R&R RF TIRE & REPLACE WHEEL & SENSOR ASS BALANCE WHEEL & SET AIR PRESS RECALIBRATE TPM SYS	CUSTOMER STATES WHEELS PITTING

2005 1FTWF33P05E	9-Nov-04	6-Dec-04	EMERLING F	6815851	5K01	6C3Z	1007 B	B65	1 E8	26-Jul-07	33	22444	420.1	28.78	448.88	0.4	572	VERIFIED CONCERN AND REPLACED WHEEL TIRE(S) OR WHEEL(S) HOLE IN RIM	REPLACE HOLE IN THE RIM,REPLACED RIM LEFT REAR	CUST STATES THERE IS A CRACK IN RIGHT FRONT WHEEL BY VALVE STEM CUSTOMER STATES WHEEL PITTED LEAKING AIR CUST STTAAES PASS WHEELS PITTED AROUND WHEEL COVER AND VALAVE STEM CHROME PEELING FROM RIGHT REAR WHEEL CROME PEELING OFF 3 RIMS B65
2005 2MEHM75W15X	17-Sep-04	24-Feb-05	ISLAND LINC	7928251	5K01	5W3Z	1007 AA	B65	49 E8	19-Jun-07	29	30233	428.92	22.28	451.2	0.3	11643	20071 MOUNTED AND BALANCED 2 PASSENGER SIDE RIMS FOR PITTING.	16532 REPL RH REAR WHEEL. TRANSFER TIRE SENSOR & TRAIN ALL PRESSURE SENSORS. RPL LR WHEEL ASSY,,CHROME PEELING CK TIRE PRESSURE, TIRE PRESSURE LOW, OBTAINED DI PRIOR APPROVAL R&R RIGHT FRONT WHEEL, RECHECK	RIGHT FRONT TIRE KEEPS GOING FLAT CUSTOMER STATES PASSENGER FRONT RIM HAS RUST. REPLACE PER DIGITAL IMAGING INSPECT & REPORT ON PASSANGER FRONT WHEEL TIRE LEAK.. POSSIBLE CORROISION TO WHEEL BEAD
2005 1FMZU77K85U	3-Feb-05	4-Apr-05	LIBERTY FOF	195460A	5K01	3L2Z	1007 MA	B65	81 E8	13-Jun-07	27	20071	418.57	42.64	461.21	0.5	2222	REPLACED RF WHEEL FOR PITTING. APPROVAL CODE FOR WHEEL REPLACEMENT PAARR		
2005 5LMEU88H35Z	20-Jul-05	6-Jan-06	LIBERTY LINC	114624A	5K01	2C5Z	1007 DA	B65	14 E8	14-Jun-07	18	16532	388.19	73.57	461.76	0.9	11000	REPAIRED AND RETETEDO K VERIFIED LR TIRE LEAK. REMOVED LR TIRE NO PUNCTURES IN TIRE. REMOVED SPARE INSTALLED SPARE TIRE ON TRUCK CHROME RIM TIRE LOST AIR OVER NIGHT. REPLACED LR RIM ASM PUT ORIGINAL LR TIRE ON NEW RIM NOW O	K. REMOUNTED LR TIRE LOOSES 4 5 LBS OF AIR OVERNIGHT, NO INTRUSIONS IN TIRE. FINISH ON BOTH LEFT SIDE RIMS ARE PEELING SOP IS IN CODE PAALQ AUTH PAAAS STILL LEAKING AIR THROUGH LEFT REAR TIRE	
2003 5LMEU78H43Z	7-Aug-03	30-Sep-03	LYONS-RYAN	105749B	5K01	2C5Z	1007 DA	B65	5 E8	21-Jun-07	46	23149	414.65	47.4	462.05	0.5	1505			
2005 1LNHM87A45Y	10-Sep-04	8-Jan-05	CLINTON FAI	3706801	5K01	1W6Z	1007 CA	B65	42 E8	26-Jun-07	30	30960	444.92	45.24	490.16	0.6	1142			
2006 3LNHM261X6F	24-Feb-06	27-Mar-06	DONLEY FOF	11149301	5K01	6H6Z	1007 BA	B65	81 E8	29-Jun-07	16	5386	474.01	22.59	496.6	0.3	2263			
2006 3LNHM26136F	24-Jun-06	15-Oct-06	NORTH SHOI	182312A	5K01	6H6Z	1007 BA	B65	42 E8	3-Jul-07	9	13000	474.01	25.19	499.2	0.3	10004			
2006 1FMFU20566L	27-Jul-05	8-Apr-06	SMITH FORD	24470701	5K01	5L1Z	1007 AA	B65	42 E8	8-Aug-07	17	6294	431.45	82.96	514.41	1	1580			
2004 1FTRW12W64K	6-May-04	11-Sep-04	BLUEBONNE	47218501	5K01	4L3Z	1007 AA	B65	81 E8	28-Jun-07	35	20258	464.24	50.32	514.56	0.6	4570			
2005 1FAHP60A65Y	4-Aug-04	28-May-05	WORLD FOR	036365C	5K01	4W6Z	1007 AA	B65	D8 E8	9-Aug-07	27	4452	499.86	24.09	523.95	0.3	4920			
2004 1FTNW21P64E	3-Dec-03	23-Dec-04	MCPMAHON F	12113005	5K01	4C3Z	1007 AC	B65	16 E8	12-Jun-07	31	33382	491.81	37.99	529.8	0.4	4166			

2005	1FMZU74W25U	23-Nov-04	31-Aug-05	MULLINAX FC	167373A 5K01 5L2Z	1007 CA B65	5 E8	26-Jul-07 24	18830	448.78	85.76	534.54	1	2157	18830 ORDERED RIMS NOW LOCATED AT RR AND LF OF VEHICL	CUSTOMER STATES THERE BUBBLES IN CHROME RIMS RIGHT FRONT, REAR LEFT BOTH BUBBLING FROM CENTER PLEASE ADVISE CLEARCOAT PEELING ON BOTH LEFT SIDE WHEELS
2005	1FAFP24165G	29-Oct-04	31-Mar-05	LIBERTY LIN	115304A 5K01 7G1Z	1007 B B65	81 E8	11-Jul-07 28	17063	502.57	49.04	551.61	0.6	11000	17063 REPLACED BOTH LEFT SIDE FRT AND REAR RIMS VERIFIED CRACKS IN WHEEL, SENT PICS. TO D.I. FOR APPROVAL REPLACEMENT APPROVAL CODE PAAPS, REPLACED WHEEL	LEFT FRONT WHEEL HAS A HOLE IN IT. C S TIRE WILL NOT SEAT ON RIM BECAUSE OF CHROME IS PEELING FRON THE INSIDE OF THE RIM.
2004	1LNHM83WX4Y	22-Apr-04	30-Jun-04	HUB CITY FC	124483A 5K01 4W1Z	1007 AA B65	33 E8	17-Aug-07 39	38954	544.19	19.33	563.52	0.3	4918	REPLACED RT RR WHEEL RIM 44549 REPLACED AND BALANCED PASSENGER FRONT WHEEL DUE TO AIR LEAK IN WHEEL	C S RIM HAS SLOW LEAK SOP IN INSTALL SPECIAL ORDER WHEEL PER RO 221833
2004	1LNHM83WX4Y	6-Oct-03	28-Oct-03	BAY LINCOLN	220726A 5K01 4W1Z	1007 AA B65	D1 E8	1-Aug-07 46	44549	544.19	20.72	564.91	0.3	10248	36403 1 TIRE M T 1.0 LOCK FROZEN ON STUD DAMGEED RIM DURING REMOVAL TECH 58448 ROAD TEST REMOVE L.R. AXLE SHAFT WITH TIRE AS AN ASSEMBLY NESS TO HEAT AND CUST STUD OUT OF AXLE REPL RIM AND STUDS	C S THE WHEEL LOCKS WILL NOT COME OFF.SEE JOHN F. NEED ASAP C S THE LEFT REAR TIRE KEEPS LOOSING AIR
2004	1LNHM85W14Y	31-Mar-04	3-Jul-04	GOLDEN CIR	222395A 5K01 4W1Z	1007 AA B65	81 E8	20-Jun-07 37	36403	544.19	21.17	565.36	0.3	5885	REPLACED WHEEL AUTH NUMBER PAANV	DRIVERS FRONT WHEEL IS LOOSING AIR,CHROME PEELING OFF WHEEL. CUSTOMER STATES CHROME BUBBLING ON RT REAR WHEEL
2006	1ZVFT82H765	11-Mar-06	28-Jun-06	SAWGRASS	65205803 5K01 F2LY	1A043 A B65	42 E8	18-Jul-07 13	7219	397.94	170.75	568.69	2.1	4908	8280 WARRANTY LEAK TESTED, FOUND AIR LEAKING FROM BEAD. DISMOUNTED TIRE, FOUND CHROME COMING OFF INSIDE OF WHEEL. MOUNTED AND BALANCED TIRE ON NEW WHEEL, RETESTED, OK.	RT REAR WHEEL LOOSING AIR C S RT REAR TIRE HAS CHROME COMING OFF INSTALL ORDERED PART
2004	1LNHM83W14Y	28-Jun-04	31-Mar-05	NORTH SHO	182279B 5K01 4W1Z	1007 AA B65	55 E8	2-Jul-07 28	29991	544.19	25.19	569.38	0.3	10004	19132 . REPLACED L F RIM. MOUNTED & BALANCED TIRE	PEELING PART
2004	1LNHM83W34Y	5-May-04	4-Oct-04	NORTHGATE	139407D 5K01 4W1Z	1007 AA B65	D1 E8	17-Jul-07 34	19132	545.83	25.24	571.07	0.3	2663	INSTALLED SOP WHEEL	PEELING PART
2006	1FTRW14W86F	26-May-06	1-Jun-06	IMLAY CITY F	1969828 5K01 5L3Z	1007 HA B65	D4 E8	18-Jun-07 13	30549	569.83	25.52	595.35	0.3	2672		
2004	1FAFP48Y74F	6-Jan-04	7-Aug-04	LANDMARK F	667547C 5K01 3R3Z	1007 EA B65	42 E8	20-Jun-07 35	8280	570	28.91	598.91	0.3	8559		
2004	1FAFP48Y14F	14-Jan-04	17-Dec-04	DAVE SINCL	43722501 5K01 3R3Z	1007 EA B65	5 E8	21-Aug-07 33	12257	570	29.49	599.49	0.3	8199		

2005	1FTPW14575K	22-Jul-05	4-Mar-06	VAN BURKLE	115415A 5K01 5L3Z	1007 BA	B65	34 E8	8-Jun-07	16	20786	566.47	61.84	628.31	0.8	4241	GOOD	FOUND REAR RIMS PEELING DISCOLORED REPLACED AND REBALACE REAR RIMS ALL CHK	REAR WHEELS FADING CUSTOMER STATES CLICKING NOISE WHEN VEHICLE IN MOTION COMING FROM FRONT WHEELS.INSTALL S O PART AS PER DI AUTH (AUTH# PAA9X) REFER TO RO# 307727
2007	1FMEU65E37U	30-Nov-06	4-Feb-07	COURTESY F	309550A 5K01 7L2Z	1007 E	B65	33 E8	12-Jul-07	6	16473	603.01	38.59	641.6	0.5	1625	16474 33 ROAD TEST CLICKING NOISE COMING FROM FRONT WHEEL COVERS POOR FIT ON CHROME COVERS ON RIMS REMOVE AND REPLACE FRONT RIMS POST TEST OK	LH REAR WHEEL LOSEING AIR FROM AROUND VALVE STEM	
2003	1LNHM87A03Y6	9-May-03	20-Oct-03	TASCA FORC	447683G 5K01 3W4Z	1007 GA	B65	42 E8	15-Aug-07	47	34557	616.53	26.1	642.63	0.3	796	REPLACED LEFT REAR WHEEL 34506 BOTH REAR WHEELS PEELING ON EDGES REPLACE BOTH REAR WHEELS 2 MOUNT & BALANCE	BOTH REAR WHEELS ARE PEELING ALONG EDGES OF WHEELS CHECK RIGHT SIDE	
2005	1FTYR44U25F	13-Jan-05	26-Mar-05	ROBERTS FC	149222A 5K01 3L5Z	1007 AA	B65	34 E8	11-Jun-07	27	34506	627	45.73	672.73	0.5	9883	REPL RIGHT SIDE WHEELS WPI REPLACE BOTH REAR WHEEL THAT WERE FLAKING	WHEEL ARE PEELING BOTH REAR WHEEL ARE PEALING	
2006	5LTPW18566F	16-Feb-05	25-Mar-05	VAN DRISSE	022731A 5K01 2L7Z	1007 AB	B65	D4 E8	5-Jul-07	28	5043	692.24	48.12	740.36	0.6	12505	15468 C S THAT FRONT DRIVER RIM SPLIT INSPECTED RIM AND FOUND MAJOR SPLIT REMOVED TIRE FOR FURTHER INSPECTION. NO OBVIOUS IMPACT DAMAGE TO TIRE OR WHEEL. REPLACED WHEEL, REMOUNTED TIRE. DI APPROVAL	CUSTOMER STATES THAT THE DRIVERS FRONT RIM IS SPLIT	
2004	5LMFU28R44L	30-Jul-04	28-Dec-04	WALLACE LI	089192G 5K01 2L7Z	1007 AB	B65	42 E8	30-Jul-07	32	32366	692.24	54.57	746.81	0.7	10781	WHEELS REPLACED RIGHT AND LEFT FRONT WHEELS DUE TO PEELIN APPROVAL TO REPLACE AFFECTED RIMS ONLY RIMS ARE ON ORDER REPLACE 3 RIMS MOUNT AND BALANCE TIRES AUTH PAA7T PAUL APPLE APPLE SE VEN TOM	CUSTOMER STATES DRIVERS FRONT AND PASSENGER RIMS ARE PEELING PLEASE CK AND ADVISE.	
2004	1FTPW14594K	26-May-04	23-Sep-04	PORCARO F	64953802 5K01 4L3Z	1007 AA	B65	42 E8	26-Jun-07	34	29422	701.27	68	769.27	0.8	6190	WHEELS DISCOLORED TIRE(S) OR WHEEL(S) REPLACE REPLACED RIGHT REAR WHEEL FOR PEELING. 1007AB .4	PAALU CLOSED AT WPI PAINT FALLING OFF RIMS	
2005	1FMYU02Z95K	11-Aug-04	5-Sep-04	TOWN AND C	2530051 5K01 5L8Z	1007 CA	B65	81 E8	12-Jun-07	34	34989	734.81	44.24	779.05	0.6	5755		BOTH DRIVERS SIDE WHEELS ARE DISOLORED AND WILL NOCOME CLEAN WITH ANY CLEANER ALSO CENTER CAPS SOP WHEEL DELAMINATING R R	
2005	1FTSW21PX5E	23-Feb-05	24-Mar-05	PARADISE FC	1749951 5K01 5C3Z	1007 PA	B65	81 E8	31-Jul-07	29	34551	752.14	29.54	781.68	0.4	3942		PE08-060 1528	

2004	5LMFU28R54L	18-Jun-04	15-Oct-04	HEMPSTEAD	74551404	5K01	2L7Z	1007	AB	B65	D4	E8	18-Jun-07	33	14068	692.24	105.26	797.5	1	11208	L F & R R WHEELS PEELING. CHECK WHEELS PEELING. FOUND L F & R R WHEELS PEELING. REPLACE TWO WHEELS, MOUNT & BALANCE TIRES. REPLACE BOTH FRONT WHEELS. PLATING SEPERATING FROM BACK SIDE OF WHEELS.	CUSTOMER STATES.....CHECK LEFT FRONT RIM IS PEELING... PLEASE CHECK THE OTHER 3 C/S ROTATIONAL NOISE PASSENGER FRONT.
2004	5LMFU28R34L	16-Jan-04	21-Jul-04	BUSS FORD	1336371	5K01	2L7Z	1007	AB	N50	5	E8	5-Jun-07	35	37239	741.69	62.21	803.9	0.7	1857	35194 CHECK FOR WHEEL AT CENTER CAPS AREA RUTSING REPLACE RF WHEEL AND RR WHEEL AND LR WHEEL HAD TO INSTALL TIRE SENSOR ON LR WHEEL WAS UNABLE TO REMOVE SENSOR FROM OLD WHEEL CHRIS LOOKED AT ALL FOUR RIMS VERIFIED BUBBLING REPLACED ALL FOUR RIMS AND LOOKS GOOD NOW	CHECK FOR WHEEL AT CENTER CAPS AREA RUSTING CUSTOMER STATES ALL FOUR RIMS ARE BUBBLING AROUND CENTER CAPS CUSTOMER STATES WHEELS ARE BUBBLING SEEKING REIMBURSEMENT FOR TIRE REPLACEMENT CHECK WHEELS CORRODED AROUND CENTER CAPS ON ALL 4 WHEELS CUSTOMER STATES ALL FOUR RIMS ARE PITTING SOP FOUR RIMS CEHCK ALL FOUR RIM CLEAR COAT PEELING
2005	1FMDU74W75Z	6-Jan-05	22-Jan-05	BEECHMONT	361025C	5K01	5L2Z	1007	CA	B65	D7	E8	23-Jul-07	31	34957	740.45	89.57	830.02	1.2	2058	SEEKING REIMBURSEMENT FOR TIRE REPLACEMENT	
2005	1FMYU93165K	4-Feb-05	1-Aug-05	JOHN LANCE	142979A	5K01	5L8Z	1007	DB	B65	14	E8	6-Jun-07	23	28175	782.88	69.28	852.16	0.8	2284	35395 REPLACE 4 WHLS	
2005	1FMYU03175K	22-Jun-04	31-Jan-05	JOHN LANCE	149304E	5K01	5L8Z	1007	DB	B65	42	E8	27-Aug-07	32	35395	782.88	69.28	852.16	0.8	2284	35395 REPLACE 4 WHLS	
2006	1FTSW21P16E	13-Mar-06	4-Sep-06	MULLINAX FC	454007B	5K01	*	1012	*	C50	42	E8	16-Jun-07	10	19032	0	0	858.74	0	3073	PITTED,CORRODED TIRE(S) OR WHEEL(S) REPLACE	
2005	1FMYU94165K	27-Apr-05	19-Jul-05	RUSS MILNE	459251	5K01	2L8Z	1007	GA	B65	14	E8	24-Jul-07	25	32849	796.21	68.1	864.31	0.8	2890	REMOVED AND REPLACED ALL DEFECTED RIMS	
2005	1FMYU93165K	7-Jan-05	23-Jul-05	ISLAND FORI	276939A	5K01	5L8Z	1007	DB	B65	1	E8	21-Jul-07	25	14493	782.88	87.34	870.22	0.8	3650	WHEELS DISCOLORED TIRE(S) OR WHEEL(S) REPLACE W 20041 VERIFY ALL FOUR WHEELS DELAMINATING, REPLACEMENT APPROVED REMOVE CENTER CAPS AND UBOLT FOUR WHEELS FROM VEHICLE. DEPRESSER AND REMOVE TIRES FROM RIMS, INSTALL VALVE STEMS FOUR NEW WHEELS AN	D MOUNT FOUR TIRES, BALANCE AND REINSTALL WHEELS AND CENTER CAPS
2005	1FMZU67KX5U	1-Dec-04	15-Dec-04	TOWN AND C	2618151	5K01	3L2Z	1007	MA	F06	81	E8	10-Jul-07	32	22217	823.98	58.99	882.97	0.8	5755	31237 REPLACED ALL FOUR WHEELS,FINISH WAS PEELING OFF OTHER WHEELS. DRIVERS SIDE FRT AND REAR, PASS SIDE FRT, CLEARCOAT COMING OFF REPLACED WHEELS PER DI APPR #PAA8Q	CUSTOMER STATES CLEARCOAT COMING OFF WHEELS.
2005	1FTPX14535F	4-Apr-05	23-Sep-05	KRUG HILLT	1910001	5K01	4L3Z	1007	AB	B65	D4	E8	1-Aug-07	23	24432	833.28	66.57	899.85	0.8	1758		
2005	1FTPX125X5F	28-Apr-05	25-Jul-05	NORTHGATE	139146A	5K01	4L3Z	1007	AB	B65	D4	E8	3-Jul-07	24	31237	833.28	67.31	900.59	0.8	2663		
2005	1FTZR45E05P	2-Dec-04	15-Apr-05	DONLEY FOF	50911701	5K01	2L5Z	1007	BA	B65	81	E8	13-Aug-07	29	34319	849.03	56.66	905.69	0.8	8287		

2004	1FMDU74W54Z	12-May-04	24-Aug-04	DONS FORD, 61392501	5K01	2L2Z	1007	CA	B65	5	E8	22-Aug-07	37	21329	832.27	78.36	910.63	1.2	582	PAAYV	RETOR	VERIFIED. DISMOUNTED THE 3 TIRES AND REPLACED BOTH FRONT AND THE ONE REAR RIM, SWAPPED PRESSURE VALVE STEMS AND MOUNTED AND BALANCED THE TIRES, ALL OK AT THIS TIME ACES APPROVAL CODE	QUE WHEELS AFTER 50 MILES	CUSTOMER STATES THAT BOTH FRONT RIMS AND THE RIGHT REAR RIM IS CORRODED, SOP RIMS ARE IN, DIGITAL AUTHORIZATION APPROVED
2005	1FMZU77K25U	18-May-05	29-Jun-05	NEW COUNT 235604A	5K01	2L5Z	1007	AA	B65	D7	E8	28-Jun-07	25	22607	868.6	62.4	931	0.8	20551			REPLACED BOTH LEFT SIDE WHEELS AND RIGHT FRONT WHEEL DUE TO PREMATURE CORROSION AROUND CENTER CAP AND SPOKES		CUSTOMER STATES: BOTH LEFT SIDE WHEELS HAVE CORROSION AROUND CENTER CAP AND ON SPOKES
2004	1FMZU74K44U	26-Jan-04	16-Jul-04	FAIRLANE FC 223774C	5K01	2L2Z	1007	CA	B65	5	E8	26-Jun-07	36	19780	832.27	103.1	935.37	1.2	3050			19784 42 1007 REPLACE 3 WHEELS FOR PEELING		B65 ALL 4 WHEELS PAINT BUBBLING AROUND CENTERCAP .5 45.00
2006	1ZVFT85H665	31-Oct-05	4-Nov-05	RUSS MILNE 420752	5K01	6R3Z	1007	D	B65	D4	E8	17-Jul-07	21	17890	874.1	68.1	942.2	0.8	2890			PEELING TIRE(S) OR WHEEL(S) REPLACE		CK ALL FOUR WHEELS HAVE FLAWS ON THE SPOKES. CUST STATES THE WHEELS ARE MARKED NEAR THE CENTER CAPS
2005	1FTRX14W55N	2-Mar-05	30-Nov-05	MANGOLD FC 9321401	5K01	4L3Z	1007	AB	B65	5	E8	20-Jul-07	20	16236	891.96	60.7	952.66	0.8	20249			VER. CONCERN REMOVED AND REPLACED ALL FOUR RIMS WHEELS		CUSTOMER STATES BOTH REAR RIMS ARE PITTING
2006	3LNHM26196F	13-Mar-06	30-Mar-06	SOUTHGATE 52951	5K01	6H6Z	1007	BA	B65	5	E8	13-Aug-07	17	20939	948.02	43.29	991.31	0.5	10671			DUE TO METAL PITTING CONCERN.		CUSTOMER STATES PASSENGER SIDE WHEELS HAVE DULL SPOTS AND FINISH IS FADED
2006	1FTWF31P86E	27-Mar-06	31-May-06	NEW HOLLAND 44328601	5K01	5C3Z	1007	LA	B65	D4	E8	17-Jul-07	14	21145	952.64	45.07	997.71	0.6	1360			TARNISHED NECESSARY TIME TO GET DIG IMAGE AUTH PAATX AND REPLACE 2 WHEELS		
2004	1FTPX14584N	28-Jul-04	27-Sep-04	YORK FORD 366291A	5K01	4L3Z	1007	AA	B65	68	E8	13-Jun-07	33	23771	928.48	70.02	998.5	0.8	8888			23771 DISMOUNT MOUNT & BALANCE 4 WHEELS DIGITAL IMAGING PRIOR APPROVAL NUMBER PAAKW		RIMS PEELING CUSTOMER STATES ALL TIRES KEEP LOOSING AIR DI
2004	5LMEU88H94Z	11-Jun-04	30-Jun-04	DEMPEWOLF 1605751	5K01	2C5Z	1007	AA	B65	42	E8	22-Aug-07	39	47198	924.95	90.02	1015	1.1	5668			INSTALLED NEW WHEELS AND CENTER COVERS WPI		AUTH#PAAQX
2006	1FMDK05136G	11-Aug-05	9-Dec-05	WENDLE FOI 416932C	5K01	5F9Z	1007	AA	B65	A8	E8	14-Aug-07	21	28198	957.43	64.41	1021.8	0.8	8684			REPLACED WHEELS DUE TO PITTING		WHEELS ARE PITTING BADLY
2007	1FMEU31KX7U	12-Apr-06	26-Aug-07	MCCOTTER F 210097A	5K01	6L2Z	1007	AA	B65	42	E8	14-Aug-07	0	324	898.47	126.36	1024.8	1.7	4944			324 1.7 REPLACE ALL 4 WHEEL ANR SENSOR RESET TIRES SENSOR		THE COATING ON THE RIMS IS DEFECTIVE
2004	1FAFP42R34F	30-Sep-03	12-Aug-04	ROSEMURGH 20956001	5K01	3R3Z	1007	AA	B65	42	E8	23-Jul-07	36	25926	985.07	63.65	1048.7	0.8	6366			APPROVED TO REPLACE WHEELS PER CODE LACK OF CORROSION PROTECTION ON WHEELS. WPI		
2005	1ZVHT82H955	15-Sep-04	19-Nov-04	L F DONNELL 418465A	5K01	6R3Z	1007	D	B65	5	E8	16-Jun-07	32	19885	1010.7	60.25	1070.9	0.8	2220			DISMOUNTED 4 TIRES REMOUNT RETURN OLD RIMS TO PARTS CORRECTED CONCERN		CUSTOMER STATES ON ALL 4 WHEELS THE CHROME IS COMING OFF



2005 1MEFM42115	31-Jan-05	25-Feb-05	MORROW FC	2372601 5K01 7T5Z	1007 A	B65 D4 E8	4-Aug-07 30	25241	1058.8	54.14	1112.9	0.8	7327	B65 VERIFIED WHEELS PEELING. SENT DIGITAL IMAGES TO FORD. FORD APPROVED REPLACEMENT OF ALL FOUR WHEELS. MOUNT AND BALANCED TIRES ON NEW RIMS.	CUSTOMER STATES ALL THE WHEELS ARE PEELING.	
														E SENSOR BANDS ON NEW WHEELS. MOUNT AND BALANCE SAME TIRES ONTO ALL 4 NEW WHEELS. TRAIN TIRE PRESSURE SENSOR MODULE TO TIRE PRESSURE SENSORS. INSTALL NEW WHEEL CENTER CAPS. TRIM		
2007 4M2CU971X7K	9-May-06		ENERGY COI	251203 5K01 6E6Z	1007 C	B65 70 E8	26-Jun-07 -1	20	1010.6	131.56	1142.2	1.7	4517	WHEELS AND CENTER CAPS ARE SCRATCHED. CCCB65, CC70. REMOVE TIRES AND TIRE PRESSURE SENSORS FROM ALL 4 WHEELS. INSTALL NEW VALVE STEMS AND TIRE PRESSUR VERIFIED, PERFORMED INSPECTION, DI APPROVAL PAAZW, MOUNTED, BALANCED ALL FOUR TIRES, REPLACE TIRE SENSORS, INSTALLED FOUR TIRES AND RECHECKED, DELAY OF SUBMISSION DUE TO SPO, RO	O.K.	CUSTOMER STATES ALL WHEELS PITTED
															CHECK ALL FOUR RIMS SPIDER WEBBING IN CLAER COAT	
2007 1FMEU31K67U	2-Mar-06	3-Jul-06	WINDWARD	6078151 5K01 6L2Z	1007 BA	H45 42 E8	18-Jul-07 13	15528	1001.1	169.56	1170.6	1.7	7708	60394, 07 18 07 AT 15 B65 VERIFIED ALL WHEELS PEELING. SENT PHOTOS TO DIGITAL IMAGING. THEY APPROVED REPLACEMENT OF WHEELS. MOUNTED AND BALANCED TIRES ON NEW WHEELS AND REPLACED THE TIRE SENSORS.	528 MILES	SPO PARTS IN
															CUSTOMER STATES ALL FOUR WHEELS ARE PEELING. CUST STATES FINISH COMEING OFF AL 4 WHEELS	
2006 1FMJU94136K	11-Oct-05	9-Dec-05	MORROW FC	2292001 5K01 6L8Z	1007 A	B65 D4 E8	6-Jul-07 20	15820	1122.1	54.14	1176.2	0.8	7327			CUSTOMER STATES ALL FOUR WHEELS ARE PEELING. CUST STATES FINISH COMEING OFF AL 4 WHEELS
2005 1FTZR45E95P	3-Dec-04	24-Sep-05	DONLEY FOF	50856301 5K01 2L5Z	1007 BA	B65 81 E8	20-Jul-07 23	35074	1132	56.66	1188.7	0.8	8287	REPLACED ALL 4 WHEELS PER DI AUTH #PAAAW		CUSTOMER STATES ALL FOUR RIMS ARE CARRODING. SOP RIMS ARE IN DITIAL AURIZATION APPROVED
														ALL FOUR RIMS WERE CARRODED, DISMOUNTED 4 TIRES MOUNTED AND BALANCED 4 TIRES ON 4 NEW RIMS. RETORQUE WHEELS AFTER 50 MILES ACES AUTH CODE PAALX .		CUST STATES CORROSION ON ALL FOUR WHEELS
2005 1FTZR45E95P	5-Aug-04	24-May-05	DONS FORD,	61391301 5K01 2L5Z	1007 AA	B65 5 E8	22-Aug-07 28	19114	1136.6	52.24	1188.9	0.8	582			WHEELS ARE PEELING
														31484 REPLACED ALL FOUR WHEELS, REMOUNTED TIRES REPLACE FOUR WHEELS AND BALANCE.		PE08-060 1531
2005 1FMZU77K25U	14-Jan-05	29-Mar-05	LINDQUIST F	235043A 5K01 2L5Z	1007 AA	B65 D7 E8	26-Jun-07 28	31484	1136.6	56.45	1193.1	0.8	20238			
2005 1FMZU67KX5U	10-Sep-04	14-Mar-05	MIDLAND FO	23903504 5K01 2L5Z	1007 AA	B65 D4 E8	6-Jun-07 28	29242	1136.6	60.09	1196.7	0.8	9801			

2005	1FTZR15E45F	28-Sep-04	16-Aug-05	KENNY ROS	683022A 5K01 2L5Z	1007 AA B65 D4 E8	15-Aug-07 25	23716	1136.6	61.13	1197.8	0.8	7350	23716 REMOVED TIRES OFF ORIGINAL RIMS. INSTALLED TIRES ON NEW RIMS. INSTALLED NEW VALVE STEMS. SPIN BALANCED NEW WHEELS.		REPLACE ALL FOUR WHEELS (CORRODING) UTH# PAAKR CLEARCOAT APPEARS TO BE COMING OFF ALL 4 WHEELS....B65
2005	2MEFM75W05X	31-Jan-05	16-Feb-05	TRI FORD-ME	320530A 5K01 3W3Z	1007 AA B65 5 E8	19-Jun-07 29	30993	1129.6	69.78	1199.4	0.8	8294	ALL 4 WHEELS ARE CORRODED. REPLACED 4 WHEELS.	LL HAS DRIVELINE VIBRATION BALANCED DRIVESHAFT WITH NVH TESTER.BALANCED BOTH FRONT TIRES AND ALL FOUR REAR TIRES.ROAD TESTED STILL HAS 1ST ORDER TIRE VIBRATION.REINDEXED TIRES AND	C.S. THAT THERE IS A SEVERE VIBRATION AT 55 MPH (RECENTLY HAD NEW TIRES AND WHEELS REPLACED WHEELS APPROVED FOR REPLACEMENT BY DIGITAL IMAGING AUTH # PAAHX USE SPO 07207009..SOP WHEELS AND CENTER CAPS..CLEAR COAT LIFTING..DI APPROVAL PAAVZ
2005	1FDXF46Y45E	23-Dec-04	29-Dec-04	EXPRESSWA	075591A 5K01 6C3Z	1015 D N25 2 E8	18-Jun-07 31	28073	477.15	722.81	1200	9.9	5142	28073 VERIFIED CONCERN OF VIBRATION WHILE DRIVING.USED NVH TESTER SHOWS 1ST ORDER TIRE WHEEL VIBRATION AND 1ST ORDER DRIVE LINE VIBRATION.CHECKED RUNNOUT ON DRIVESHAFT IS OK REINDEXED DRIVESHAFT STI		
2003	5LMEU78H83Z	14-May-03	13-Sep-03	NICK MAYER	15479701 5K01 2C5Z	1007 AA B65 42 E8	3-Aug-07 48	28966	1137.8	68.14	1206	0.8	10705	REPLACE WHEELS PER DITAL IMA		
2005	2MEFM75W85X	6-May-05	10-Jun-05	ISLAND LINC	8094851 5K01 3W3Z	1007 CA B65 81 E8	9-Aug-07 27	12404	1151.6	59.42	1211	0.8	11643	CLEAR COAT LIFTING...SOP WHEELS AND CENTER CAPS BROKE DOWN 4 TIRES AND MOUNT AND BALANCED 4 TIRES	ON TO NEW RIMS AND INSTALLED ALL FOUR CENTER CAPS ND CENTER CAPS CORRODING DI APPROVAL	CUSTOMER STATES WHEELS ARE CORRODING DI APPROVAL PAAKU
2005	5LMEU68H25Z	17-Dec-04	29-Jan-06	ISLAND LINC	8069853 5K01 2C5Z	1007 AA B65 81 E8	2-Aug-07 19	26774	1137.8	81.71	1219.5	1.1	11643	SOP RIMS AND CENTER CAPS SOP RIMS AND CENTER CAPS REPLACE ALL FOUR RIMS A	REPLACED WHEELS PER AUTH # PAAJN	
2005	1FMDU77K45U	24-Jun-05	6-Jul-07	VALLEY ISLE	370312C 5K01 2L5Z	1007 AA B65 5 E8	5-Jul-07 0	69	1143.4	80.84	1224.2	0.8	7839			
2006	1FMYU93146K	7-Dec-05	7-Jul-06	NEMER FORI	017090A 5K01 6L8Z	1007 A B65 5 E8	3-Jul-07 13	21331	1115.4	114.34	1229.7	1.7	3608	2136 35		
2005	1FMZU77K85U	24-Aug-04	16-Feb-05	WORLD FOR	036600A 5K01 2L5Z	1007 AA B65 42 E8	13-Aug-07 31	24851	1143.4	96.36	1239.7	1.2	4920	24851 MT 1.6 H REPLACED ALL RIMS MOUNT AND BALANCE TIRES SET AIR PRESSURE TIRES ETC		CUSTOMER STATES REPLACE ALL RIMS AP #PAAMT

2005	1FTZR15E25F	6	29-Nov-04	23-Apr-05	ED MULLINA	267447A	5K01	2L5Z	1007	BA	B65	81	E8	31-Jul-07	28	31693	1138.8	68.22	1243	0.8	2283	31693 REPLACED 4X WHEEL, MOUNT & BALANCED OLD TIRES ON NEW WHEELS PER REQUEST. OTHER WHEEL WEIGHTS	CS, CLEAR COAT ON RIMS IS PEELING RIMS ARE PITTING SEE AARON FOR PARTS. CUST STATES THE THE ALUM WHEEL WHEEL ON DRIVER FRONT SLIP CODE B65 AUTH # PAACX CUSTOMER STATES THAT THE CHROME IS PEELING OFF OF INSIDE OF BOTH REAR WHEELS STATES CHROME PEELING FROM BOTH LEFT SIDE WHEELS..
2007	1FTSW21P77E		15-May-06	2-Feb-07	HUB CITY FC	11220701	5K01	5C3Z	1007	RA	B65	1	E8	18-Jul-07	6	16166	1264.9	0	1264.9	0	6481	CODE 01 REPLACE RIM AND TIRE ON THE LEFT FRONT CRACKED RIM RUINED TIRE	INSTALL SOP PER LAST VISIT
2004	1LNHM86S04Y		5-Jan-04	28-Oct-04	DONLEY FOF	50751701	5K01	4W4Z	1007	EA	B65	81	E8	4-Jun-07	32	45329	1240.5	35.42	1275.9	0.5	8287	CHROME PEELING REPLACED BOTH REAR WHEELS AUTH PAAUC	WHEELS DELAMINATING
2004	1LNHM86S94Y		5-Feb-04	26-Mar-04	JOE MACHEI	51205001	5K01	4W4Z	1007	EA	B65	D4	E8	23-Jul-07	41	37591	1240.5	51.52	1292	0.6	8006	REPLACE LEFT SIDE WHEELS AND BALANCE TIRES 35 PSI ... CONFIRMED WHEELS DELAMINATING, MOUNTED 4 NEW WHEELS	
2006	5LTPW18586F		27-Jun-05	13-Dec-05	KRUG HILLT	1740901	5K01	2L7Z	1007	AB	B65	D4	E8	20-Jun-07	19	44417	1384.5	66.57	1451.1	0.8	1758	45453 ACESII AUTHORIZATION CODE PAAVZ. REPLACED ALL 4 WHEELS. REPLACED 2 AIR PRESSURE SENSORS. BALANCED TIRES. RETEST OK. QCJC.	CHROME PEELING FROM WHEELS CHROME PLATING COMING OFF WHEELS AND RUBBING ON BACKING PLATES. C S, CHROME FINISH PEELING OFF FROM INNER EDGES OF ALL 4 WHEELS 8 SPOKE 18 INCH
2004	5LMFU28R94L	6	26-Sep-03	27-Dec-03	DIFEEE FORI	184994G	5K01	2L7Z	1007	AB	B65	5	E8	2-Aug-07	44	45453	1384.5	87.16	1471.7	1.2	6835	VERIFIED CONCERN. REPLACED ALL FOUR WHEELS. CHROME FINISH PEELING OFF FROM INNER EDGES OF ALL 4 WHEELS VERIFY MOUNT AND BALANCE TIRES ON 4 NEW WHEELS	
2004	5LMFU28R94L		13-Feb-04	4-Sep-04	WOODHOUS	767311	5K01	2L7Z	1007	AB	B65	42	E8	12-Jun-07	34	32850	1384.5	94.68	1479.2	1.2	10670	D7 1007 P02JN VERIFIED NOISE IN LF. DIAG., FOUND CHROME PEELING ON ALL 4 WHEELS. REPLACED ALL 4 WHEELS. VERIFIED REPAIR. 5562	LEFT FRONT WHEEL NOISY WHILE DRIVING CUSTOMER STATES ALL 4 RIMS ARE PEELING PLEASE CK AND ADVISE. (APPROVAL CODE# P121T)
2004	5LMFU28R64L		10-Oct-03	14-Nov-03	PURVIS FORI	077624A	5K01	2L7Z	1007	AB	B65	5	E8	18-Jul-07	45	32083	1384.5	97.88	1482.4	1.2	61	WHEELS TIRE(S) OR WHEEL(S) REPLACE 40990 4 RIMS PEALING DI AUTH PAAYX REPLACED ALL 4 RIMS BALANCE TIRES AND ROTATEED THEM THEN RETRAINED TIRE PRESSER SENSORS	B65 CUST STATE ALL 4 WHEELS CHROME IS COMING OFF PE08-060 1533
2004	5LMFU28R24L		1-Dec-03	29-Dec-03	KRUG HILLT	1668301	5K01	2L7Z	1007	AB	B65	D4	E8	4-Jun-07	42	49234	1384.5	99.85	1484.3	1.2	1758		
2004	5LMFU28R04		6-Aug-03	23-Dec-03	SOUTHGATE	9813451	5K01	2L7Z	1007	AB	F19	5	E8	11-Jun-07	43	24786	1384.5	103.9	1488.4	1.2	10671		
2004	5LMFU27R24L		7-Oct-03	19-Nov-03	AUTOWAY LI	323051B	5K01	2L7Z	1007	AB	B65	81	E8	1-Aug-07	46	40990	1391	100.21	1491.3	1.2	11605		

Year	Vehicle ID	Date	Customer	VIN	Year	Make	Model	Color	Engine	Transmission	Drive	MPG	Price	Options	Notes	Customer Comments					
2004	5LMFU28RX4L	13-Oct-03	APPLE VALLI	63732401	5K01	2L7Z	1007	AB	B65	42	E8	9-Jul-07	42	36215	1384.5	119.56	1504.1	1.2	9217	ACES CODE: PAANR INSPECTED AND CONFIRMS CUSTOMERS CONCERNS THAT RIM ARE PEELING AND NEED TO BE REPLACED.	CUSTOMER STATES THAT ALL 4 RIMS ARE PEELING. CUSTOMER CUST STATES ALL 4 WHEELS AND 4 CENTER CAPS ARE CORRODED MATERIAL FLAKING APART CUSTOMER STATES THAT ALL 4 WHEELS ARE HEAVILY CORRODED. PARTS ORDERED AND IN. REFER TO RO#63040 ON 052907 AT 34029 MILES CUSTOMER STATES ALL 4 CHROME WHEELS ARE PEELING
2004	1FTPW12504K	19-Dec-03	MCCOMBS W	8210251	5K01	4L3Z	1007	DA	B65	D4	E8	15-Jun-07	36	30610	1452	123.64	1575.7	1.6	4545	WHEELS DISCOLORED TIRE(S) OR WHEEL(S) REPLACE	
2004	4M2ZU86K64U	20-Aug-03	ELMHURST L	6369751	5K01	3L2Z	1007	TC	B65	14	E8	15-Jun-07	37	34519	1477.5	109.71	1587.2	1.1	13660	WHEELS TIRE(S) OR WHEEL(S) REPLACE	
2004	5LMFU28R84	1-May-04	ACTON LINCI	243015A	5K01	2L7Z	1007	AB	B65	81	E8	23-Jul-07	38	28169	1487.8	107.28	1595.1	1.2	13144	INSPOECT PEELING RIMS, OBTAIN APPROVAL CODE PAA VZ , REPLACE 4 RIMS DIAG VIBRATION, SUSPECT DRIVESHAFT, REPLACE, BETTER, BALANCE DRIVESHAFT, CHANGE VIBRATION RANGE, SWITCH TIRES FROM NEW TRUCK, OK, REPLACE TIRES, NO HELP, REPLACE WHEELS AND IT IS FIXED APP CODE TO REPLACE ALL 4 WHEELS PAA1Z VERIFY CONCERN AND REPLACE ALL 4 WHEELS	
2004	1FTRW14W84K	20-Dec-03	TRI FORD-ME	321144A	5K01	7L3Z	1015	B	N27	42	E8	28-Jun-07	32	32527	1049.7	549.54	1599.2	6.3	8294	WHEELS AND IT IS FIXED APP CODE TO REPLACE ALL 4 WHEELS PAA1Z VERIFY CONCERN AND REPLACE ALL 4 WHEELS	VIBRATION IN DRIVELINE 59 MPH
2005	1FMNU40L75E	1-Apr-05	JARRETT-GC	11104801	5K01	4C3Z	1007	JA	B65	81	E8	13-Aug-07	20	21970	1528.3	72.72	1601	1	3781	VERIFIED CUSTOMER CONCERN WHEELS ARE PEELING NECESSARY TO RE MOVE AND REPLACE ALL 4 WHEELS AND BALNCE AS NECESSARY PER DIGITAL IMAGING APPROVAL #PAAVW	C S WHEELS CORRODING AROUND HOLES
2003	5LMEU78H03Z	16-Jul-03	NICK MAYER	15500201	5K01	2C5Z	1007	DA	B65	42	E8	10-Aug-07	49	26379	1548	93.7	1641.7	1.1	10705	REPLACE ALL 4 RIMS MOUNT AND BALANCE TIRES REPLACE 4 PEELING AND PITTED RIMS.... ACES CODE....PAALM	CUSTOMER STATES THAT THE RIMS ARE PEELING CUSTOMER STATES.....CHECK RIMS ARE PITTED AND PEELLING.... CHECK ALL REPLACE 3 OF THE 4 CHROME WHEELS PER D.I. AUTHORIZATION #PAANV (REPLACE BOTH FRONT AND THE PASSENGHER SIDE REAR)
2003	5LMFU28R13L	17-Jul-03	HEMPSTEAD	74640701	5K01	2L7Z	1007	AB	B65	D4	E8	9-Jul-07	46	37170	1539.5	126.3	1665.8	1.2	11208	13757 REPLACED THREE OUT OF 4 TIRES	
2006	1FTPW14586F	26-Jul-06	FRIENDLY FC	148548A	5K01	5L3Z	1007	HA	B65	81	E8	8-Jun-07	11	13757	1709.5	94.2	1803.7	1.1	2662		

2005	5LMFU28555L	17-Dec-04	12-Jan-05	KRUG HILLT	1845801	5K01	5L7Z	1007	AA	N50	D4	E8	16-Jul-07	31	49635	1704	99.86	1803.8	1.2	1758	DECLINED 7921 CHECKED AND FOUNID ALL WHEELS CORRODED AND TIRE S KEEP LEAKING,REPLACED ALL WHEELS	NOISE LEFT FRONT BRAKES
2005	1LNHM87A55Y	12-Aug-04	15-Jul-05	ACTON LINC	242139A	5K01	1W6Z	1007	CA	B65	81	E8	26-Jun-07	24	23339	1779.7	71.52	1851.2	0.8	13144	42979 REPLACE WHEELS W BALANCE (4) REPLACE ALL FOUR WHEELS CENTERS	WHEELS CORRDOED INSTALL SOP CHECK WHEELS PEELING APPROVAL # PAAPS TO REPLACE RIMS ALL WHEEL CENTERS ARE PITTING
2004	1LNHM83WX4Y	12-Nov-03	22-Jan-04	LIBERTY LIN	116073F	5K01	3W1Z	1007	AA	B65	14	E8	13-Aug-07	44	42979	2098.4	65.39	2163.8	0.8	11000	7624 INSPECT WHEELS. SUMBIT DIGITAL IMAGE PHOTOS. ALL FOUR WHEEL CHROME IS PEELING. APPROVAL CODE PAACZ. REPLACED ALL 4 RIMS. BALANCED WHEELS	FINISH ON WHEELS IS PITTING CUSTOMER STATES CHROME PEELING OFF WHEELS
2004	1LNHM83W54Y	8-Oct-03	29-Jan-04	NORTHLAND	3889701	5K01	4W1Z	1007	AA	B65	14	E8	29-Jun-07	42	27167	2176.8	59.66	2236.4	0.8	10638	R R 4 WHEELS CLOSED BY WPI 15094 CUSTOMER STATES ALL WHEELS ARE RUSTING REPLACED FOUR WHEELS AND REBALENCED	CUSTOMER STATES ALL 4 RIMS ARE RUSTED WHEELS ARE PITTING AND RUSTING CHECK/ADVISE B65 APPROVAL TO REPLACE ALL 4 WHEELS #PAARV CUST ST INSTALL 4 WHEELS (VINNY PARTS R IN) CUST STATES THERE IS A TICKING NOISE IN PASS REAR WHEN STOPPING CUST STATES PASS FRONT RIM KEEPS LOOSING AIR ABOUT 22 LBS WEEKLY CUST WANTS ALL RIMS CHECKED ALL OTHERS ARE LOOSING AIR BUT NOT AS MUCH AS
2004	1LNHM83W24Y	8-Aug-03	15-Dec-03	NORTHGATE	139294C	5K01	4W1Z	1007	AA	B65	D4	E8	11-Jul-07	44	7624	2183.3	67.31	2250.6	0.8	2663		
2004	1LNHM83WX4Y	11-Aug-03	27-Feb-04	FAIRWAY FO	102053A	5K01	3W1Z	1007	AA	B65	D4	E8	11-Jun-07	41	29263	2248.3	64.05	2312.4	0.8	20050		
2006	1FTPW14V66F	24-Apr-06	31-Aug-06	BEECHMONT	359700A	5K01	5L3Z	1007	HA	B65	81	E8	25-Jun-07	10	13669	2279.3	59.71	2339	0.8	2058		
2006	5LMFU28566L	26-Sep-05	12-Oct-05	DOENGES FC	13817503	5K01	5L7Z	1007	CA	B65	42	E8	30-Jul-07	22	19750	2272	146.41	2418.4	2.1	6820	VERIFIED CONCERN, REPLACED ALL FOUR WHEELS AND REI NSTALLED PRESSURE SENSORS ON NEW WHEELS QC JWP	
2007	1FTPW14587F	15-Nov-06	30-Nov-06	OASIS FORD	1436152	5K01	7L3Z	1007	J	B65	14	E8	24-Jul-07	8	29102	2375	135.06	2510.1	1.4	3604	X TIRE(S) OR WHEEL(S) REPLACE	
2004	1LNHM86S14Y	2-Sep-03	3-Mar-05	GANLEY LINC	101504A	5K01	4W4Z	1007	EA	B65	5	E8	6-Jul-07	29	23920	2487.5	63.2	2550.7	0.8	10736	23834 DI RIMS REPLACE FOUR RIMS AND BALANCE TIRES	
2004	1LNHM86S14Y	5-Jan-04	27-Apr-04	LIBERTY LIN	115915A	5K01	4W4Z	1007	EA	B65	14	E8	6-Aug-07	40	33110	2487.5	65.39	2552.9	0.8	11000	33110 CK ALL RIMS LOOSING AIR, PITTED AND PEELING CHROME REPLACE ALL 4 WHEELS DI PAATZ	

2004	1LNHM86S04Y	17-Oct-03	24-Nov-03	KRUG HILLT	1877201	5K01	4W4Z	1007	EA	B65	D7	E8	24-Jul-07	45	34440	2487.5	66.57	2554.1	0.8	1758	W 20041 VIRIGY ALL FOUR WHEELS INSIDE PEELING AND CORRODED, CORROSIO NO SPREADING TO WHEEL SPOKES. REMOVE FOUR WHEELS FROM VEHICLE, REMOVE WEIGHTS AND DISMOUNT TIRES REM REPLACED ALL FOUR RIMS AND VALVE STEMS AND BALANCED THEN TEST DRIVE AFTER	OUNT ON NEW RIMS,BALANCE FOUR TIRES AND MOUNT ON VEHICLE	FACTORY RIMS HAVE SHEETS OF MATERIAL PEELING OFF OF INSIDE
2004	1LNHM86S24Y	8-Sep-03	15-Jul-04	DON TESTEF	2232001	5K01	4W4Z	1007	EA	B65	42	E8	6-Jun-07	36	32546	2481	118.56	2599.5	1.6	2335			CHROME PEELING OFF OF WHEELS CHECK CAUSE: CUST STATES WHEELS ARE PEELING
2006	5LMFU28576L	5-Aug-05	10-Oct-06	FAIRWAY FO	102466A	5K01	5L7Z	1007	AA	B65	D4	E8	23-Jun-07	9	22445	2575.8	96.07	2671.9	1.2	20050	REPL ALL 4 WHEELS CLOSED BY WPI VERIFIED CONCERN. PERFORMED DIGITAL IMAGING PRIOR APPROVAL P ROCESS. SUBLET TO TIRE FACTORY TO MOUNT AND BALANCE 4 WHEELS .		CUSTOMER STATES ALL FOUR WHEELS ARE DELIMINATING. CHECK AND ADVISE. SERVICE PART WARRANTY..WHEEL COVER STATES WHEEL COVERS WILL NOT STAY IN CENTER OF TIRES STATES TABS ON INSIDE OF WHEEL COVERS REPORT 3 LUG NUT COVERS STARTING TO PEEL AROUND EMBLEMS CENTER CAPS HAS DISCOLORATION. DURING SERVICE FOUND PROBLEM WITH NEW WHEEL STEERING SUSPENSION CONCERN SERVICE PART WARR BENT RIM AIR LEAKING FROM RIGHT REAR WHEEL RIM BENT. WAS NOTICED WHEN REPLACED UNDER WARRANTY. LUG NUT COVER KEEPS FALLING OFF CUSTOMER STATES LUG NUT COVERS KEEP FALLING OFF OF WHEELS REPLACE CENTER CAPS PER LAST RO
2006	1FTWW31P46E	21-Apr-06	29-Sep-06	NEWBERG FI	9322901	5K01	6C3Z	1007	A	B65	5	E8	3-Aug-07	11	22092	2859.1	77	2936.1	0	8465			
2007	1FAFP34N87W	28-Sep-06	30-Oct-06	BROADWAY	16846106	5K02	6S4Z	1130	A	B65	25	E9	8-Jun-07	8	20942	22.54	8.42	30.96	0.1	3850	R&R 1 WHEEL CENTER CAP . CONFIRM CONCERN. FOUND BROKEN SUPPRT TABS ON ALL FOUR WHEEL CENTER CAPS. R&R 4 HUB CAPS. FOUND BENT SUPPRT TAB ON NEW CAP. SERVICE PART REPLACEMENT		COVER STATES WHEEL COVERS WILL NOT STAY IN CENTER OF TIRES STATES TABS ON INSIDE OF WHEEL COVERS REPORT 3 LUG NUT COVERS STARTING TO PEEL AROUND EMBLEMS CENTER CAPS HAS DISCOLORATION. DURING SERVICE FOUND PROBLEM WITH NEW WHEEL STEERING SUSPENSION CONCERN SERVICE PART WARR BENT RIM AIR LEAKING FROM RIGHT REAR WHEEL RIM BENT. WAS NOTICED WHEN REPLACED UNDER WARRANTY. LUG NUT COVER KEEPS FALLING OFF CUSTOMER STATES LUG NUT COVERS KEEP FALLING OFF OF WHEELS REPLACE CENTER CAPS PER LAST RO
2007	1FAFP34N87W	28-Sep-06	30-Oct-06	BROADWAY	16846102	5K02	6S4Z	1130	A	B65	25	E9	8-Jun-07	8	20942	90.16	0	90.16	0	3850			
2006	1FTRX04W26K	3-Apr-06	30-Jun-06	ORCHID ISLE	4050352	5K02	4L3Z	1130	JA	B65	81	E9	6-Jul-07	13	21594	83.62	18.2	101.82	0.2	7761	REPLACED BOTH REAR & RIGHT FRONT WHEEL COVERS		
2004	1FTWW33P34E	27-May-04	29-Jul-04	WOODHOUS	773527	5K02	3C3Z	1130	DA	B65	42	E9	25-Jun-07	36	20010	99.74	15.78	115.52	0.2	10670	REPLACED CENTER CAPS.		
2005	1FMZU77K65U	25-Feb-05	30-Jun-05	MULLINAX FC	309888D	5K01	2L5Z	1007	AA	B65	42	E9	31-Jul-07	26	21770	284.16	0	284.16	0	2370	REPLACED WHEEL		
2007	1FMFU17577L	22-Nov-06	4-Jan-07	BOB TOMES	63567601	5K01	7L1Z	1007	D	N25	13	E9	24-Jul-07	7	14536	248.71	75.69	324.4	0.9	2531	REPL. WHEEL & WHEEL SENSOR. BENT RIM HAS DEFECT INDENT REPLACE RIM		
2004	5LMEU88H64Z	13-May-04	7-Oct-04	KINDLE FORI	31933001	5K01	2C5Z	1007	AA	B65	D4	E9	18-Jun-07	33	13794	310.35	42.35	352.7	0.5	1237			
2005	1FMZU75W55U	20-Oct-04	5-May-05	WILLIAMS MC	207103	5K01	4L2Z	1007	FA	B65	13	E9	5-Jun-07	26	32781	343.97	42.05	386.02	0.5	2173	REPLACE RIGHT REAR RIM RIM WAS SLIGHTLY BENT WHEN RELACED ON RO#053276 LUG NUT FELL OFF MISSING RPL ONE LUG NUT		
2007	1FAFP31N57W	16-Aug-06	9-May-07	GREENVILLE	1657551	5K02	6S4Z	1K011	A	L15	39	E9	11-Jun-07	2	4209	4.35	0	4.35	0	2484			
2007	1FAFP31N57W	16-Aug-06	9-May-07	GREENVILLE	1805351	5K02	6S4Z	1K011	A	B65	25	E9	16-Aug-07	4	6020	8.71	14.21	22.92	0.2	2484	MISSING LUG NUT COVERS ADDITIONAL MISC. REPAIRS RPL MISSING LUG NUT COV	ERS	
2006	3MEFM07146F	30-Jan-06	15-Feb-06	GANLEY LINC	103402A	5K02	6N7Z	1130	AA	B65	81	E9	23-Aug-07	19	19091	90.72	15.8	106.52	0.2	10736	19258	REPLACE CENTER CAPS	PL#08-060 1536

2007 1FMYU02Z57K	10-May-06	31-May-07	GRIFFIN FOF	010477B 5K01 6L8Z	1007 EA B65 42 E9	19-Jul-07	2	713	201.45	24.44	225.89	0.3	6360	MOUNTED AND BALANCED ONE NEW TIRE	BENT RIM FROM FACTORY
2006 1FMEU74E86U	18-May-06	9-Aug-06	LIBERTY LIN	115188F 5K01 6L2Z	1007 EA B65 34 E9	6-Jul-07	12	9406	301.5	0	301.5	0	11000	9406 AFTER MOUNTING AND BAL THE NEW RIM I FOUND IT TO BE BENT AND HAD TO DISSMOUNTED AND HAD TO GET ANOTHER RIM AND REMOUNT IT AND BAL IT	SERVICE PART WARRANTY WHEEL REPLACEMENT RIM BENT FROMFACTORY SOP
2007 1FMEU74E37U	12-Feb-07	7-Apr-07	EWALD'S VEI	51486603 5K01 7L2Z	1007 E B65 2 E9	11-Jun-07	3	3204	301.5	24.76	326.26	0.3	3774	SPW. REPLACED WHEEL AND SET SENSOR TO FACTORY SPEC	CUSTOMER STATES CHROME IS FLAKING PEELING RT LEFT WHEEL...SOP IS HERE IN STOCK FOR THIS REPAIR
2007 2FMDK39C07B	20-Oct-06	24-Mar-07	WALNUT CRI	542636A 5K01 7T4Z	1007 F B66 D4 E9	30-Aug-07	6	8273	279.17	57.93	337.1	0.5	7820	8273 REPLACED THE LEFT REAR WHEEL. BALANCED THE WHEEL OK.	INSTALL RIM AND TIRE WHEEL WAS DAMAGED WHEN CAME IN
2007 1FMEU658X7U	27-Mar-07	10-Apr-07	FAMILY FORI	1521651 5K01 7L2Z	1007 E B65 42 E9	11-Jul-07	4	4576	353.21	46.69	399.9	0.7	3085	INSTALLED LEFT FRONT RIM & SENSOR TIRE(S) OR WHEEL(S) REPLACE WHEELS BY APLICATION WILL NOT FIT EDGE, CATALOG ERRO, WHEELS WERE ALREADY MOUNTED BEFORE ERRO WAS NOTED.	NEW WHEELS DO NOT FIT,REASON CATALOG ERROR 2 WHEEL CENTER CAPS WERE INCORRECT,LEFT SIDE CAPS WERE FOR MERCURY
2007 2FMDK39C97B	17-Apr-07	16-May-07	TRI FORD-ME	320442B 5K01 7L2Z	1007 E B65 42 E9	18-Jun-07	2	1222	1495.3	139.56	1634.9	1.6	8294	VEHICLE, THIS IS AN FORD EXPLORER,REPLACED 2 WHEEL CENTER CAPS	
2007 1FMEU74E67U	31-May-07	29-Jun-07	SUNSHINE Fi	10527502 5K02 6L2Z	1130 AA B65 38 MV	7-Jun-07	0	5	11.51	17.9	29.41	0.2	3605	REPLACE LEFT SIDE LUG NUTS	
2008 1FAHP24W68G	25-Jul-07		COUNTY MO	18971402 5K01 6L2Z	1012 BA A99 38 MV	3-Aug-07	-1	8	43.12	13.64	56.76	0.2	944	REPLACED ALL LUG NUTS ON LEFT FRONT AND LEFT REAR SHOULD HAVE CHROME CAME WITH STANDARD	
2008 1FMDK06W88G	28-Jul-07		PURVIS FORI	079506A 5K01 6L2Z	1012 BA B65 38 MV	13-Aug-07	-1	3	43.12	24.47	67.59	0.3	61	WHEEL COVERS MISSING WHEEL RING HUB CAP WHEEL COVER	
2007 1FAFP34N97W	20-Jun-07		GREENVILLE	1704651 5K02 2M5Z	1130 AB A99 39 MV	3-Jul-07	-1	2	59.14	14.21	73.35	0.2	2484	REPLACE MISBUILT UNIT,VEHICLE COMES EQUIPPED WITH STEEL WHEELS AND WAS SHIPPED WITH SMALL CENTER CAPS BUT SHOULD HAVE BEEN SHIPPED WITH FULL SIZE WHEEL COVERS. NEC TO INSTALL FULL SIZE WHEEL COVERS.	
2007 1FAFP31N07W	2-Apr-07		PALM SPRIN	158980A 5K02 6S4Z	1130 B B65 38 MV	7-Jun-07	-1	5	90.16	0	90.16	0	5574	MISSING WRONG HUB CAPS ON VEHICLEWHEEL RING HUB CAP WHEEL COVER	
2007 2FAHP71W37X	29-Mar-07	12-Apr-07	MIKE DAVIDS	2928951 5K02 7W7Z	1130 A A99 38 MV	22-Jun-07	3	28	83.3	15.58	98.88	0.2	4864	REPLACE VEHICLE CAME WITH 2 CO MVC CLAIM, CENTER CAPS MISSING WHEN VEHICLE	
2008 5L1FL275X8L	20-Jul-07		RANCHO FOI	47730801 5K02 5L7Z	1130 A B65 39 MV	10-Aug-07	-1	9	103.43	0	103.43	0	5432	DELIVERED MVC CLAIM, CENTER CAPS MISSING WHEN DELIVERED	
2008 5L1FL275X8L	20-Jul-07		RANCHO FOI	47693301 5K02 5L7Z	1130 A B65 39 MV	6-Aug-07	-1	9	103.43	0	103.43	0	5432	MISSING WHEN DELIVERED MVC CLAIM, DELIVERED WITOUT CENTER CAPS	
2008 5L1FL27588L	20-Jul-07		RANCHO FOI	47730701 5K02 5L7Z	1130 A B65 39 MV	10-Aug-07	-1	9	103.43	0	103.43	0	5432	CENTER CAPS	PE08-060 1537

2008	5L1FL27518L		20-Jul-07		RANCHO FOI	47693201	5K02	5L7Z	1130	A	B65	39	MV	6-Aug-07	-1	9	103.43	0	103.43	0	5432	MVC CLAIM, CENTER CAPS MISSING WHEN DELIVRED	
2007	1FAHP34N47W		20-Jul-07	3-Sep-07	MORROW FC	2345601	5K02	6S4Z	1130	B	B65	38	MV	26-Jul-07	0	2	90.16	13.54	103.7	0.2	7327	WITH SMALL CENTER CAPS, SHOULD HAVE FULL SIZE	B65 WHEEL COVERS ARE INCORRECT, VEHICLE CAME WRONG WHEEL CAPS PROVIDED BY FACTORY
2008	1FMCU02Z98K		12-Jun-07	1-Aug-07	LEIF JOHNSC	60553101	5K02	8L8Z	1130	A	B65	38	MV	21-Jun-07	0	3	105.5	16.63	122.13	0.2	4483	REPLACED WHEEL CAPS VERIFIED WHEEL WAS EITHER MISBUILT OR WRONG WHEEL WAS PUT ON VEHICLE AT FACTORY, THE HOLE IN THE CENTER OF THE WHEEL THAT HOLDS THE CENTER CAP ON IS TOO BIG AND THE CENTER CAP JUST FALLS THRU ORDERED AND REPLACED WITH NEW WHEELS AND MOUNT AND BALANCED 2 TIRES 7.5.07	LEFT FRONT WHEEL CENTER HOLE FOR CENTER CAP IS TOO BIG MISBUILT
2008	1FMCU03Z98K		30-Jul-07		MULLINAX FC	310314A	5K01	8L8Z	1007	F	A99	38	MV	8-Aug-07	-1	10	137.54	0	137.54	0	2370	CENTER CAP JUST FALLS THRU ORDERED AND REPLACED WITH NEW WHEELS AND MOUNT AND BALANCED 2 TIRES 7.5.07 THIS VEH CAME IN WITH 2 STEEL WHEELS ON THE RIGHT SIDE AND 2 ALLOY WHEELS ON THE LEFT SIDE. WHEELS DID NOT MATCH. WHEELS ARE WRONG THE CENTER CAPS ARE RIGHT NOTHING WAS ORDERED YET WAITING ON INSTRUCTIONS FROM FORD	THE DRIVERS SIDE HAS ALLOY WHEEL AND THE PASS SIDE HAS STEEL WHEELS
2007	1FAFP34NX7W		11-Jun-07	31-Jul-07	BOB ALLEN F	735197A	5K01	YS4Z	1007	DA	B65	38	MV	20-Jun-07	0	2	477.99	50.98	528.97	0.6	5167	WHEELS ARE WRONG THE CENTER CAPS ARE RIGHT NOTHING WAS ORDERED YET WAITING ON INSTRUCTIONS FROM FORD	
2008	1FMCU02Z18K		1-Aug-07		SAWGRASS	65465101	5K01	8L8Z	1007	F	B65	38	MV	10-Aug-07	-1	4	550.14	65.05	615.19	0.8	4908	REMOVE TIRE AND WHEEL BALANCE AND INDEX AND REPLACE TIRE AND WHEEL GOODYEAR WRANGLER ATS LT275/65 R20	DRIVER SIDE FRT TIRE AND WHEEL DOES NOT MATCH OTHER 3 TIRE/WHEELS
2008	1FTSW21R58E		16-Jul-07	13-Aug-07	RONNIE WAT	159036A	5K01	7C3Z	1007	C	B65	38	MV	13-Aug-07	0	77	578.23	62.17	640.4	0.9	815	DISMOUNTED TIRES AND TRANSFER TO NEW SET OF RIMS REPROGRAM TPMS SENSORS ORDERED CORRECT RRIMS AND CHANGED ALL FOUR FOR CORRECT ONES. VEHICLE CAME IN WITH ARGENT WHEELS AND SHOULD HA REPLACE WHEEL COVER OVER THE COUNTER	LIGHT MECH REPAIRS ALL FOUR WHEELS WERE WRONG. REPLACE ALL FOUR WHEELS. UNIT WAS MISBUILT (A99) OVERCOUNTER PARTS WARRANTY OVER THE COUNTER PARTS WARRANTY, RIM IS DEFORMED INVOICE 74174, 06 07 2007
2008	1FTYR15E58P		19-Jun-07	23-Jul-07	J.C. LEWIS F	1190301	5K01	YL5Z	1015	BA	A99	38	MV	6-Jul-07	0	12	1173.3	61.39	1234.7	0.8	4927	VE HAD THE XLT BRIGHT METAL WHEELS.	OVERCOUNTER PARTS WARRANTY OVER THE COUNTER PARTS WARRANTY, RIM IS DEFORMED INVOICE 74174, 06 07 2007
2003	1MEFM50U03G		25-Mar-03	10-May-03	FIESTA LINCI	11402301	5K02	YF4Z	1130	AA	B65	42	OT	30-Jul-07	52	66327	33.42	0	33.42	0	11896		
2003	2FTRX17W63C		29-Nov-02	10-Dec-02	VAN BORTEL	59352101	5K01	YL3Z	1015	BB	N25	2	OT	15-Jun-07	55	46231	110.78	0	110.78	0	7590	EXCHANGED RIM, OVER THE COUNTER	
2003	1FMRU15W23L		7-Apr-03	24-May-03	PALMETTO T	678858A	5K01	2L1Z	1015	AB	B66	42	OT	20-Jul-07	51	65799	132.92	0	132.92	0	4856	WHEEL HAS A DENT ON BEAD CONFIRMED CUSTOMER CONCERN CONTACTED STEVE SMALL OUR FORD REP AND HE AGREED TO COVER UNDER P01 AUTHORIZATION REPLACED WHEEL AND TIRE TO CORRECT CONCERN OTHER IS DIFFERENCE IN OUR 40% MARKUP THAT WE AR	E ENTITLED TO ACCORDING TO STATE OF VA CODE AND THE 25% THAT THE SYSTEM PAYS. IS FOR A SPOKE.
2005	1FTSW21P35E		28-Jan-05	1-Apr-05	BERGLUND F	350730A	5K01	5C3Z	1007	PA	B65	42	P01	9-Aug-07	29	55037	910.27	34.8	964.04	0.4	6717		CUST STATES WHEEL IS FOR A SPOKE.



2003	1FMZU75W93U	8-May-03	1-Sep-03	APPLE VALLI	63849101	5K01	3L2Z	1007	KA	B65	42	P0!	12-Jul-07	48	77962	946.85	119.56	1066.4	1.2	9217	1007 CCD7 CLEAR COATING COMING OFF THE LEFT REAR AND BOTH FRONT RIMS. REPLACED THREE RIMS PER COLE D.	CUSTOMER STATES THE CLEAR IS PEELING ON ALL RIMS BUT THE RIGHT REAR CODE:B65 APPROVAL CODE IS K107H CUSTOMER STATES ALL 4 WHEELS ARE CRACKING AND BUBBLING UP AGAIN AFTER REPLACEMENT ON 11 18 2004 RO 045189 CUST STATES CENTER CAP KEEPS FALLING OFF CUST STATES FINSHI IS COMING OFF WHEEL CENTER CAP
2003	1FMZU75W03Z	29-Oct-02	22-Nov-02	GRAND FORI	061231A	5K01	3L2Z	1007	KA	B65	1	P0!	13-Jun-07	56	58386	1262.5	68.26	1330.7	1.1	7417	SERVICE DEPT CALLED SZR JOHN MORSE WHO GAVE APPROVAL K14XJ TO REPLACE ALL 4 RIMS ORDERED AND REPLACED RIMS CAP ASY WHEEL RING HUB CAP WHEEL COVER REPLACE	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2004	2FMDA576X4E	6-Nov-03	1-Dec-03	MCCOMBS W	8389952	5K02	3F2Z	1130	DA	B65	42	P0!	5-Jul-07	44	22566	11.37	7.73	19.1	0.1	4545	REPLACE CENTER CAP 35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2005	1FAFP25115G	15-Mar-05	4-May-05	HARBIN MOT	154548A	5K02	5G1Z	1130	BA	B65	81	P0!	27-Jun-07	27	38893	15.05	6.64	21.69	0.1	378	REPLACE CENTER CAP 35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2004	1FTPW14594K	14-May-04	5-Jun-04	LITHIA FORD	354579D	5K02	4L3Z	1130	DD	B65	42	P0!	21-Jun-07	38	35976	40.75	8.26	49.01	0.1	3897	REPLACE CENTER CAP 35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2004	1FTPX14564N	27-Feb-04	18-May-04	KENNY ROSC	682970A	5K02	4L3Z	1130	DD	B65	D4	P0!	14-Aug-07	40	21284	81.51	15.28	96.79	0.2	7350	21284 REPLACE REPLACE RIGHT FRONT AND RIGHT REAR CENTER CAP. PAINT IS BUBBLING. WHEEL WARR P05 FOUND 1 DEFECTIVE WHEEL. REPLACED WHEEL	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2005	2FAFP71W85X	2-May-05	2-Jun-05	LANDMARK F	67362501	5K01	5W7Z	1007	AA	H62	42	P0!	15-Aug-07	27	57987	68.21	77.1	145.31	0.8	8559	REPLACE CENTER CAP 35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2004	1FTPX145X4N	12-Mar-04	13-Jul-04	EWALD'S VEI	51682501	5K02	4L1Z	1130	BA	B65	D4	P0!	31-Jul-07	38	32200	134.01	16.51	150.52	0.2	3774	PEELING REPLACE ALL 4 CENTER CAPS P05	ALL 4 CENTER CAPS PEELING AND DISCOLORED CUST STATES TIRE GOING FLAT. WHEEL FOUND TO BE DEFECTIVE
2006	1FTPX14586N	21-Apr-06	5-May-06	MAGIC CITY	181438A	5K01	7L3Z	1015	B	B65	61	P0!	7-Aug-07	16	42400	162.02	0	162.02	0	6700	42400 REPLACED WHEEL, PART ONLY AS GOODWILL, WHEEL CRACKED IN WELD 36826 WHEELS WARR P05 FOUND 2 DEFECTIVE WHEELS. REPLACED 2 WHEELS. P05	CK TIRES FOR TIRE RECALL
2005	2FAFP71W85X	2-May-05	24-May-05	LANDMARK F	673578A	5K01	5W7Z	1007	AA	H62	42	P0!	15-Aug-07	28	36826	136.42	48.19	184.61	0.5	8559	REPLACE CENTER CAP 35976 HUBCAP PEELING C S HUBCAP PEELING VERIFY REPLACE HUBCAP	WHEEL WARPED B65 WHEEL COVERS ARE CLICKING. REPLACE COVERS AS PER TSB 04 21 01
2005	1FTSW21P95E	28-Oct-04	10-Mar-05	JONES FORC	7241901	5K01	5C3Z	1015	JA	B65	D4	P0!	23-Jul-07	29	50266	222.67	26.34	249.01	0.4	6721	REPLACE BAD RIM REPLACE RIM	REPLACE COVERS AS PER TSB 04 21 01 CUST STATES THE ALUMINUM WHEEL HAS A PIN HOLE IN IT.
2003	2MEFM74W93X	25-Jun-03	20-Oct-03	PAUL CERAM	293453A	5K02	5W3Z	1130	EA	B65	42	P0!	15-Aug-07	47	45457	201.26	40.99	254.48	0.4	12825	REPLACED ALL 4 WHEEL COVERS AS PER TSB 04 21 01 TECH VERIFIED THE CONCERN REMOVED AND REPLACED THE RIM CHECKS FINE.	CUSTOMER STATES LF HUBCAP PEELING CUSTOMER STATES THAT THE PAINT ON THE RIGHT FRONT AND REAR CENTER CAPS IS BUBBLING UP
2004	2MEFM75WX4X	1-Aug-03	11-Sep-03	MANGOLD FC	9421901	5K01	3W3Z	1007	AA	B65	D4	P0!	20-Aug-07	48	19582	284	22.76	306.76	0.3	20249	64030 WARR FOUND 4 WHEELS FAIL INSPECTION. REPLACED 4 WHEELS	CK ON WORN WHEELS
2005	2FAFP71WX5X	2-May-05	23-May-05	LANDMARK F	675473A	5K01	5W7Z	1007	AA	H62	34	P0!	29-Aug-07	28	64030	272.83	77.1	349.93	0.8	8559	66704 WHEELS WARR P05 FOUND 4 DEFECTIVE WHEELS. REPLACED 4 WHEELS	CK ON BAD WHEELS PER RECALL
2005	2FAFP71W65X	2-May-05	3-Jun-05	LANDMARK F	673748A	5K01	5W7Z	1007	AA	H62	42	P0!	16-Aug-07	27	66704	272.83	77.1	349.93	0.8	8559	66704 WHEELS WARR P05 FOUND 4 DEFECTIVE WHEELS. REPLACED 4 WHEELS	CK ON BAD WHEELS PER RECALL

2003	1FMZU75W43U	16-Jun-03	7-Aug-03	FRIENDLY FC	148533A	5K01	3L2Z	1007	KA	B65	1	P0!	8-Jun-07	47	53550	315.62	42.82	358.44	0.5	2662	REPLACE CHROME WHEEL FOR RIGHT REAR WHEEL ON CUSTOMERS VEHICLE	PASSENGER SIDE REAR WHEEL IS CRACKING AROUND THE CENTER CAP CLEAR COAT COMING OFF OF LEFT FRONT WHEEL	
2004	1FMDU65W24Z	24-May-04	19-Jun-04	JOE SARTAIN	24195801	5K01	4L2Z	1007	FA	B65	81	P0!	20-Jun-07	37	54523	343.97	34.66	378.63	0.5	5732	1 REPLACED LEFT FRONT WHEEL	GOODWILL REFUND TOWARD REPAIRS OFF INVOICE 637836 AS PER CAC REQUEST.CUST \$50.00 CO PAY REFUND TO BE \$405.82 FINISH PEELING ON R F WHEEL	
2004	1FMRU17W94L	27-May-04	13-Sep-04	SAWGRASS	65445501	5K01	*	1007	*	G29	42	P0!	9-Aug-07	36	39556	0	0	405.82	0	4908	GOODWILL REFUND FOR REPAIRS 637836		
2004	1FTZR45E24P	12-Nov-03	19-Feb-04	DEWEY FORI	43073801	5K01	1L5Z	1007	EB	B65	D4	P0!	11-Jun-07	41	42243	391.54	23.78	415.32	0.3	3540	1 REPLACED WHEEL	TIRE DOT MKB9 LRWV 3006, HAS 14 TO 15 32 TR REPLACE AND BALANCE	
2004	1FTRF145X4N	13-Jan-04	31-Jan-04	ED MULLINA	265182B	5K01	*	1007	*	N25	42	P0!	6-Jun-07	41	53510	246.6	187.59	444.19	2.2	2283	53517 P05 ROAD FORCE BALANCE 4 TIRES, FOUND L F TIRE FAILING ROADFORCE, REPLACE L F TIRE AND STEM. RIM OK PASSES, NEW TIRE FAILING BAL., HAS 38PSI AND 37PSI AFTER TURNING. ORDER 2ND NEW TIRE. OLD SMALL CRACK AT VALVE STEM. CHECK OUT & VERIFIED LEAK REPLACED VALVE STEM AND AIR TO DESIRED PRESSURE. RECHECK VERIFIED STRAIN CRACK AT VALVE STEM. NECESSARY TO REPLACE WHEEL	P05. VIBRATION WHEN DRIVING 55 70MPH OTHER WHEEL WEIGHTS MT ROAD FORCE BALANCE	
2006	1FTWW33PX6E	28-Jul-05	30-Aug-05	DAVE SINCLAIR	43687701	5K01	6C3Z	1007	B	TB6	1	P0!	16-Aug-07	24	51578	420.1	0	445.63	0	8199		C S WHEEL HAS A CRACK AT VALVE STEM OF ALUMINUM WHEEL CHECK AND ADVISE	
2005	1FDXF46P15E	9-Feb-05	3-Jun-05	DOWNS FOR	9231151	5K01	*	1007	*	N25	42	P0!	7-Aug-07	27	47945	62.85	403.51	466.36	4.5	20681		D TEST OK CK ABS SYSTEM FOUND CODE C1236, PERFORMED NEC PINPOINT TESTS FOUND OPEN IN REAR SPEED SENSOR, INST NEW SENSOR CLEARED CODES ROAD TEST OK	C S FEELS VIBRATION IS STEERING ALL THE TIME STEERING WHEEL SENSITIVE & ABS LIGHT IS ON CUST STS PASSENGER WHEELS ARE OUT OF ROUND. SOP IN PER BILL POSEY
2004	1FTRX12W84N	12-Mar-04	29-Jul-04	GARY YEOMAN	57875701	5K01	4L3Z	1007	AA	N25	D9	P0!	6-Jul-07	36	36473	464.24	48	512.24	0.6	4790	INSTALL 2 RIGHT SIDE WHEELS PER BILL POSEY NEW STEMS AND BALANCE CC42 M O 36473		

2004	1FTZR45E94P	3-Nov-03	28-Nov-03	BEECHMONT	360899A	5K01	*	1007	*	N50	82	P0!	20-Jul-07	45	27527	457.45	59.71	517.16	0.8	2058	TEST DROVE AND REPLACE ALL 4 TIRES PER TSB	CUSTOMER STATES HEARS WHOMPING NOISE AT HIGHWAY SPEEDS
2004	1FAHP60A24Y	13-Oct-03	13-May-04	PALM BAY FC	16311901	5K01	4W6Z	1007	AA	B65	D1	P0!	21-Jun-07	38	35396	499.86	22.28	522.14	0.3	2938	POROSITY R R RIGHT REAR WHEEL BALANCE TIRE P05	C S DEFECT IN R R WHEEL LOSING AIR INSTALL NEW GOODYEAR WRANGLER RT S 9001 1378400039. INSTALL TIRES DUE TO CUPPING, CK THE 2 FRONT CHROME 17 WHEELS ARE CORRODING NEAR THE CENTER CAPS. \$200.00
2004	1FTYR15E74P	29-Sep-03	10-Jun-04	BEECHMONT	359360A	5K01	*	1007	*	N25	42	P0!	19-Jun-07	37	28898	632.8	59.71	566.23	0.8	2058	28898 1.2 REPLACED 4 TIRES DOT#MDCU C6AR 2107(X4).	CUSTOMER STATES WHEELS PEELING STATES WHEELS PEELING CHROME.INSTALL 4 NEW WHEELS 20% DEDUCT CHG TO NEW CAR SALES PER LARRY SIDBERRY.. HAS BEEN INSPECTED BY RALPH DUMAS ... REPLACE WHEELS...CRACKED ALL AROUND CENTER HOLE AWA \$100 DEDUCT CUST STATES THE RIMS ARE PEELING APART CUSTOMER STATES ALL FOUR WHEELS ARE PEELING AND IS THE SECOND TIME NEEDS REPLACED
2004	1FMZU75W44U	4-Nov-03	19-Dec-03	RUSS MILNE	266851	5K01	3L2Z	1007	KA	B65	D4	P0!	15-Jun-07	43	26319	631.23	59.59	690.82	0.7	2890	CHROME PEELING TIRE(S) OR WHEEL(S) REPLACE 40025 CHROME IS PEELING FROM THE CENTERS OF THE WHEELS.REPLACE 4 RIMS MOUNT AND BALANCE 4 TIRES	
2003	1FMZU75K43U	21-Mar-03	21-Aug-03	KENNY ROS	680120A	5K01	3L2Z	1007	KA	B65	D4	P0!	5-Jun-07	47	40025	1262.5	84.05	1346.5	1.1	7350		CUSTOMER STATES WHEELS PEELING STATES WHEELS PEELING CHROME.INSTALL 4 NEW WHEELS 20% DEDUCT CHG TO NEW CAR SALES PER LARRY SIDBERRY.. HAS BEEN INSPECTED BY RALPH DUMAS ... REPLACE WHEELS...CRACKED ALL AROUND CENTER HOLE AWA \$100 DEDUCT CUST STATES THE RIMS ARE PEELING APART CUSTOMER STATES ALL FOUR WHEELS ARE PEELING AND IS THE SECOND TIME NEEDS REPLACED
2004	1FMZU85WX4U	31-Oct-03	29-Apr-04	JOE MACHE	50969301	5K01	3L2Z	1007	KA	B65	D7	P0!	30-Jun-07	39	35100	1262.5	94.45	1356.9	1.1	8006	1 REPLACE WHEELS AND MOUNT AND BALANCE TIRES ...	
2003	1FMDU85W03Z	21-Jul-03	18-Aug-03	MIDLAND FO	23983701	5K01	3L2Z	1007	KA	B65	1	P0!	5-Jul-07	48	71422	1306.8	82.62	1389.4	1.1	9801	1007 CC01 REPLACE FOUR WHEELS AND BALANCE	
2003	1FMZU75K73Z	6-Aug-03	24-Sep-03	BRONDES FC	16001201	5K01	3L2Z	1007	KA	B65	81	P0!	6-Aug-07	48	52421	1306.8	83.39	1390.2	1.1	3010	1 REPLACED 4 RIMS, MOUNTED & BALANCED TIRES	
2003	1FMDU75W43U	6-Dec-02	28-Dec-02	JOHN LANCE	144037E	5K01	3L2Z	1007	KA	B65	D4	P0!	20-Jun-07	55	57671	1306.8	112.58	1419.4	1.3	2284	57671 REPLACED ALL FOUR RIMS AND CAPS BECAUSE OF PEEL ING 1 PERFORM NVH DIAG FOUND BOTH FRONT WHEEL OUT OF ROUND USED HUNTER 9700 DIAG OVER SPEC LIMITS 1 VERIFY CONCERN, REPLACE ALL 4 WHEELS AND MOUNT AND BLANCED ALSO REPLACED 4 CENTER CAPS.	
2006	1FTSW21P96E	18-Jan-06	2-Mar-06	JOE SARTAIN	24137801	5K01	6C3Z	1007	A	B65	70	P0!	30-Jul-07	18	41504	1432.4	0	1432.4	0	5732		C S VIBRATION AT 65 MPH RIMS ARE SPLITTING AND CRACKING PO5 WITH 100\$ DEDUCTIBLE SERVICE PART WARRANTY, REPLACE BROKEN WHEEL CAPS
2004	1FMZU75W44U	18-Aug-03	6-Nov-03	ATCHLEY FO	36929102	5K01	3L2Z	1007	KA	B65	1	P0!	18-Jul-07	46	37125	1306.8	134.3	1441.1	1.7	7130		
2003	1FMFU18L03L	4-Apr-03	26-May-03	LANDMARK F	667179A	5K02	2L1Z	1130	CA	B65	42	P0!	16-Jun-07	50	38028	81.73	9.64	91.37	0.1	8559	38028 SPW WARRANTY KEEPERS ON HUB CAPS BROKEN REPLACED WITH NEW	

2005 1FAFP90S35Y	19-Nov-04	29-Mar-07	ENFIELD FOF	15339102	5K02	4G7Z	19L523	AA	A99	82 P5	5-Jul-07	4	2001	210	0	210	0	8821	FORD AUTH#J048R, PROGRAM CODE P53 1130 42 TECH 5719 REPLACE RIGHT FRONT HUBCAP AND CENTER CAP POST CHECK OK	CUST STATES TIRE INFLATION KIT MISSING FROM CAR REPLACE RIGHT FRONT HUB CAP P98 FORD PAYING FOR 80.00
2004 2MEFM74W34X	11-Nov-03	4-Jan-04	FIESTA LINC	11271101	5K02	5W3Z	1130	EA	A99	82 P9	20-Jun-07	43	55684	72.66	9.04	81.7	0.1	11896	1130A .1 1 REPLACED RIGHT REAR WHEEL	REPLACE RIGHT REAR WHEEL WHICH IS OUT OF ROUND CHECK STEEL WHEELS FOR CRACKING W04 PER FORD REP AS PER RECALL 07S48 CHECK STEEL WHEELS CRACKING POSS RELATED TO 07S48 NOT UNDER RECALL
2003 1FTNX21P73E	7-Apr-03	26-Aug-03	SUNSET AUT	3783101	5K01	1C3Z	1015	BAC	B65	13 SP	2-Aug-07	48	47562	140.46	38.64	179.1	0.4	8198	07S48G STEEL WHEEL	
2003 2FAFP73W93X	27-May-02	26-Jun-02	JORDAN FOF	4104351	5K01	5W7Z	1007	AA	A99	82 WC	5-Jun-07	61	66100	349.23	128.91	478.14	1.6	4546	RECALL STEEL WHEEL	
2003 2FAFP73W53X	2-Apr-03	24-Apr-03	JORDAN FOF	4159951	5K01	5W7Z	1007	AA	A99	82 WC	8-Jun-07	51	111388	349.23	128.91	478.14	1.6	4546	RECALL STEEL WHEEL	

MDL_YR	VIN_CD	PRODN_DT	WRTY_ST	NAME	DOC_NUM	WCC_M_CD	CAU_S_PR	UM_N	RT	ST_CO	NC_C	TXN_CD	RPR_DT	TI_S_L	MI_W	MTRL_COST	LBR_C	TOT_C	LBR_OST_G	LBR_HR	DLR	TECH_TXT1	TECH_TXT2	CUST_TXT
2007	1FMEU74E67U	31-May-07	29-Jun-07	SUNSHINE	10527502	5K02	6L2Z	1130	AA	B65	38	MVC	7-Jun-07	0	5	11.51	17.9	29.41	0.2	3605		VEHICLE, THIS IS AN FORD EXPLORER, REPLACED 2 WHEEL CENTER CAPS REPLACE LEFT SIDE LUG NUTS		2 WHEEL CENTER CAPS WERE INCORRECT, LEFT SIDE CAPS WERE FOR MERCURY
2008	1FAHP24W68G	25-Jul-07		COUNTY	18971402	5K01	6L2Z	1012	BA	A99	38	MVC	3-Aug-07	-1	8	43.12	13.64	56.76	0.2	944		REPLACED ALL LUG NUTS ON LEFT FRONT AND LEFT REAR SHOULD HAVE CHROME CAME WITH STANDARD WHEEL COVERS MISSING WHEEL RING HUB CAP WHEEL COVER REPLACE MISBUILT UNIT, VEHICLE COMES EQUIPPED WITH STEEL WHEELS AND WAS SHIPPED WITH SMALL CENTER CAPS BUT SHOULD HAVE BEEN SHIPPED WITH FULL SIZE WHEEL COVERS. NEC TO INSTALL FULL SIZE WHEEL COVERS.		
2008	1FMDK06W88G	28-Jul-07		PURVIS	079506A	5K01	6L2Z	1012	BA	B65	38	MVC	13-Aug-07	-1	3	43.12	24.47	67.59	0.3	61		WHEEL COVER REPLACE		
2007	1FAFP34N97W	20-Jun-07		GREENVILLE	1704651	5K02	2M5Z	1130	AB	A99	39	MVC	3-Jul-07	-1	2	59.14	14.21	73.35	0.2	2484		WHEEL COVER REPLACE MISBUILT UNIT, VEHICLE COMES EQUIPPED WITH STEEL WHEELS AND WAS SHIPPED WITH SMALL CENTER CAPS BUT SHOULD HAVE BEEN SHIPPED WITH FULL SIZE WHEEL COVERS. NEC TO INSTALL FULL SIZE WHEEL COVERS.		
2007	1FAFP31N07W	2-Apr-07		PALM SPRING	158980A	5K02	6S4Z	1130	B	B65	38	MVC	7-Jun-07	-1	5	90.16	0	90.16	0	5574		MISSING WRONG HUB CAPS ON VEHICLE WHEEL RING HUB CAP WHEEL COVER REPLACE VEHICLE CAME WITH 2 CO MVC CLAIM, CENTER CAPS MISSING WHEN VEHICLE DELIVERED		
2007	2FAHP71W37X	29-Mar-07	12-Apr-07	MIKE DAVIS	2928951	5K02	7W7Z	1130	A	A99	38	MVC	22-Jun-07	3	28	83.3	15.58	98.88	0.2	4864		WHEEL COVER REPLACE VEHICLE CAME WITH 2 CO MVC CLAIM, CENTER CAPS MISSING WHEN VEHICLE DELIVERED		
2008	5L1FL275X8L	20-Jul-07		RANCHO	47730801	5K02	5L7Z	1130	A	B65	39	MVC	10-Aug-07	-1	9	103.43	0	103.43	0	5432		MVC CLAIM, CENTER CAPS MISSING WHEN DELIVERED		
2008	5L1FL275X8L	20-Jul-07		RANCHO	47693301	5K02	5L7Z	1130	A	B65	39	MVC	6-Aug-07	-1	9	103.43	0	103.43	0	5432		MVC CLAIM, DELIVERED WITHOUT CENTER CAPS		
2008	5L1FL27588L	20-Jul-07		RANCHO	47730701	5K02	5L7Z	1130	A	B65	39	MVC	10-Aug-07	-1	9	103.43	0	103.43	0	5432		MVC CLAIM, CENTER CAPS MISSING WHEN DELIVERED		
2008	5L1FL27518L	20-Jul-07		RANCHO	47693201	5K02	5L7Z	1130	A	B65	39	MVC	6-Aug-07	-1	9	103.43	0	103.43	0	5432		WITH SMALL CENTER CAPS, SHOULD HAVE FULL SIZE		B65 WHEEL COVERS ARE INCORRECT, VEHICLE CAME WITH WRONG WHEEL CAPS PROVIDED BY FACTORY
2007	1FAHP34N47W	20-Jul-07	3-Sep-07	MORROW	2345601	5K02	6S4Z	1130	B	B65	38	MVC	26-Jul-07	0	2	90.16	13.54	103.7	0.2	7327		REPLACED WHEEL CAPS		
2008	1FMCU02Z98K	12-Jun-07	1-Aug-07	LEIF JOHN	60553101	5K02	8L8Z	1130	A	B65	38	MVC	21-Jun-07	0	3	105.5	16.63	122.13	0.2	4483				

2008 1FMCU03Z98K	30-Jul-07		MULLINA	310314A	5K01	8L8Z	1007 F	A99	38 MVC	8-Aug-07	-1	10	137.54	0	137.54	0	2370	VERIFIED WHEEL WAS EITHER MISBUILT OR WRONG WHEEL WAS PUT ON VEHICLE AT FACTORY, THE HOLE IN THE CENTER OF THE WHEEL THAT HOLDS THE CENTER CAP ON IS TOO BIG AND THE CENTER CAP JUST FALLS THRU ORDERED AND REPLACED WITH NEW WHEELS AND MOUNT AND BALANCED 2 TIRES 7.5.07 THIS VEH CAME IN WITH 2 STEEL WHEELS ON THE RIGHT SIDE AND 2 ALLOY WHEELS ON THE LEFT SIDE. WHEELS DID NOT MATCH. WHEELS ARE WRONG THE CENTER CAPS ARE RIGHT NOTHING WAS ORDERED YET WAITING ON INSTRUCTIONS FROM FORD REMOVE TIRE AND WHEEL BALANCE AND INDEX AND REPLACE TIRE AND WHEEL GOODYEAR WRANGLER ATS LT275/65 R20 DISMOUNTED TIRES AND TRANSFER TO NEW SET OF RIMS REPROGRAM TPMS SENSORS ORDERED CORRECT RRIMS AND CHANGED ALL FOUR FOR CORRECT ONES. VEHICLE CAME IN WITH ARGENT WHEELS AND SHOULD HA	LEFT FRONT WHEEL CENTER HOLE FOR CENTER CAP IS TOO BIG MISBUILT
2007 1FAFP34NX7W	11-Jun-07	31-Jul-07	BOB ALLE	735197A	5K01	YS4Z	1007 DA	B65	38 MVC	20-Jun-07	0	2	477.99	50.98	528.97	0.6	5167	THE DRIVERS SIDE HAS ALLOY WHEEL AND THE PASS SIDE HAS STEEL WHEELS	
2008 1FMCU02Z18K	1-Aug-07		SAWGRA	65465101	5K01	8L8Z	1007 F	B65	38 MVC	10-Aug-07	-1	4	550.14	65.05	615.19	0.8	4908	DRIVER SIDE FRT TIRE AND WHEEL DOES NOT MATCH OTHER 3 TIRE/WHEELS	
2008 1FTSW21R58E	16-Jul-07	13-Aug-07	RONNIE V	159036A	5K01	7C3Z	1007 C	B65	38 MVC	13-Aug-07	0	77	578.23	62.17	640.4	0.9	815	LIGHT MECH REPAIRS ALL FOUR WHEELS WERE WRONG. REPLACE ALL FOUR WHEELS. UNIT WAS MISBUILT (A99)	
2008 1FTYR15E58P	19-Jun-07	23-Jul-07	J.C. LEWI	1190301	5K01	YL5Z	1015 BA	A99	38 MVC	6-Jul-07	0	12	1173.3	61.39	1234.7	0.8	4927		

MDL_YR	VIN_CD	PRODN_DT	WRTY_STA_RT_DT	STA_NAME	DOC_NUM	WCC_CD	PAR_T_NUM	PART_NUM	PART_NUM	CUS_T_C	CO_CD	TIS_W	MILGE	MTRL_C	LBR_C	TOT_C	LBR	DLR	TECH_TXT1	T_C	CUST_TXT	
							AUS_AUS	S_SU	ONC_CD	TXN_CD		SD		OST	OST	ROSS	S	CD				
2003	1MEFM50U03G	25-Mar-03	10-May-03	FIESTA LINCOI	11402301	5K02	YF4Z	1130	AA	B65	42	OTC	30-Jul-07	52	66327	33.42	0	33.42	0	11896	REPLACE WHEEL COVER OVER THE COUNTER	OVERCOUNT PARTS WARRANTY OVER THE COUNTER PARTS WARRANTY, RIM IS DEFORMED INVOICE 74174, 06 07 2007
2003	2FTRX17W63C	29-Nov-02	10-Dec-02	VAN BORTEL F	59352101	5K01	YL3Z	1015	BB	N25	2	OTC	15-Jun-07	55	46231	110.78	0	110.78	0	7590	EXCHANGED RIM, OVER THE COUNTER WHEEL HAS A DENT ON BEAD	
2003	1FMRU15W23L	7-Apr-03	24-May-03	PALMETTO TR	678858A	5K01	2L1Z	1015	AB	B66	42	OTC	20-Jul-07	51	65799	132.92	0	132.92	0	4856		REPLACE RIGHT REAR WHEEL WHICH IS OUT OF ROUND
2003	1FTNX21P73E	7-Apr-03	26-Aug-03	SUNSET AUTO	3783101	5K01	1C3Z	1015	BACP	B65	13	SPW	2-Aug-07	48	47562	140.46	38.64	179.1	0.4	8198	1 REPLACED RIGHT REAR WHEEL	
2004	5LMEU88H64Z	13-May-04	7-Oct-04	KINDLE FORD	31933001	5K01	2C5Z	1007	AA	B65	D4	E90	18-Jun-07	33	13794	310.35	42.35	352.7	0.5	1237	RIM HAS DEFECT INDENT REPLACE RIM	AIR LEAKING FROM RIGHT REAR WHEEL STEERING SUSPENSION CONCERN SERVICE PART WARR BENT RIM
2007	1FMFU17577L	22-Nov-06	4-Jan-07	BOB TOMES F	63567601	5K01	7L1Z	1007	D	N25	13	E90	24-Jul-07	7	14536	248.71	75.69	324.4	0.9	2531	REPL. WHEEL & WHEEL SENSOR. BENT . CONFIRM CONCERN. FOUND BROKEN SUPPRT TABS ON ALL FOUR WHEEL CENTER CAPS. R&R 4 HUB CAPS. FOUND BENT SUPPRT TAB ON NEW CAP. SERVICE PART REPLACEMENT	STATES WHEEL COVERS WILL NOT STAY IN CENTER OF TIRES STATES TABS ON INSIDE OF WHEEL COVERS REPORT PE08-060 1545
2007	1FAFP34N87W	28-Sep-06	30-Oct-06	BROADWAY F	16846102	5K02	6S4Z	1130	A	B65	25	E90	8-Jun-07	8	20942	90.16	0	90.16	0	3850		

2006	1FTRX04W26K	3-Apr-06	30-Jun-06	ORCHID ISLE /	4050352	5K02	4L3Z	1130	JA	B65	81	E90	6-Jul-07	13	21594	83.62	18.2	101.82	0.2	7761	REPLACED BOTH REAR & RIGHT FRONT WHEEL COVERS	3 LUG NUT COVERS STARTING TO PEEL AROUND EMBLEMS DURING SERVICE FOUND PROBLEM WITH NEW WHEEL
2005	1FMZU77K65U	25-Feb-05	30-Jun-05	MULLINAX FOF	309888D	5K01	2L5Z	1007	AA	B65	42	E90	31-Jul-07	26	21770	284.16	0	284.16	0	2370	REPLACED WHEEL REPLACE RIGHT REAR RIM RIM WAS SLIGHTLY BENT WHEN RELACED ON RO#053276 MOUNTED AND BALANCED ONE NEW TIRE	RIM BENT. WAS NOTICED WHEN REPLACED UNDER WARRANTY. BENT RIM FROM FACTORY
2005	1FMZU75W55U	20-Oct-04	5-May-05	WILLIAMS MO1	207103	5K01	4L2Z	1007	FA	B65	13	E90	5-Jun-07	26	32781	343.97	42.05	386.02	0.5	2173	RO#053276 MOUNTED AND BALANCED ONE NEW TIRE	
2007	1FMYU02Z57K	10-May-06	31-May-07	GRIFFIN FORD	010477B	5K01	6L8Z	1007	EA	B65	42	E93	19-Jul-07	2	713	201.45	24.44	225.89	0.3	6360	WHEELS BY APLICATION WILL NOT FIT EDGE, CATALOG ERRO, WHEELS WERE ALREADY MOUNTED BEFORE ERRO WAS NOTED. SPW. REPLACED WHEEL AND SET SENSOR TO FACTORY SPEC INSTALLED LEFT FRONT RIM & SENSOR TIRE(S) OR WHEEL(S) REPLACE	NEW WHEELS DO NOT FIT,REASON CATALOG ERROR
2007	2FMDK39C97B	17-Apr-07	16-May-07	TRI FORD-MEF	320442B	5K01	7L2Z	1007	E	B65	42	E93	18-Jun-07	2	1222	1495.32	139.56	1634.9	1.6	8294	REPLACED WHEEL AND SET SENSOR TO FACTORY SPEC INSTALLED LEFT FRONT RIM & SENSOR TIRE(S) OR WHEEL(S) REPLACE	REPLACEMENT RIM BENT FROMFACTORY SOP INSTALL RIM AND TIRE WHEEL WAS DAMAGED WHEN CAME IN
2007	1FMEU74E37U	12-Feb-07	7-Apr-07	EWALD'S VENI	51486603	5K01	7L2Z	1007	E	B65	2	E93	11-Jun-07	3	3204	301.5	24.76	326.26	0.3	3774		
2007	1FMEU658X7U	27-Mar-07	10-Apr-07	FAMILY FORD	1521651	5K01	7L2Z	1007	E	B65	42	E93	11-Jul-07	4	4576	353.21	46.69	399.9	0.7	3085		



2007	2FMDK39C07E	20-Oct-06	24-Mar-07	WALNUT CREE	542636A 5K01	7T4Z	1007 F	B66	D4 E93	30-Aug-07	6	8273	279.17	57.93	337.1	0.5	7820	8273 REPLACED THE LEFT REAR WHEEL. BALANCED THE WHEEL L OK. 9406 AFTER MOUNTING AND BAL THE NEW RIM I FOUND IT TO BE BENT AND HAD TO DISSMOUNTED AND HAD TO GET ANOTHER RIM AND REMOUNT IT AND BAL IT	CUSTOMER STATES CHROME IS FLAKING PEELING RT LEFT WHEEL...SOP IS HERE IN STOCK FOR THIS REPAIR
2006	1FMEU74E86U	18-May-06	9-Aug-06	LIBERTY LINCC	115188F 5K01	6L2Z	1007 EA	B65	34 E93	6-Jul-07	12	9406	301.5	0	301.5	0	11000		SERVICE PART WARRANTY WHEEL REPLACE CENTER CAPS PER LAST RO AUTH #
2006	3MEFM07146F	30-Jan-06	15-Feb-06	GANLEY LINCC	103402A 5K02	6N7Z	1130 AA	B65	81 E93	23-Aug-07	19	19091	90.72	15.8	106.52	0.2	10736	19258 REPLACE CENTER CAPS	

MDL_YR	VIN_CD	PRODN_DT	WRTY_ST	DOC_NUM	WCC_CD	PART_NUM	PAR_CA	PA_RT	CU_ST	CO_CD	TXN_CD	RPR_DT	TIS_W	MILGE	MTRL_COST	LBR_COST	TOT_OST	LB_R	DLR_CD	TECH_TXT1	TECH_TXT2	CUST_TXT
2003	2FAFP72W93X	26-Jun-02	15-Oct-02	ISLAND F(277381A	5K01	*	*	*	*	*	04M05	31-Jul-07	59	18425	79.13	87.34	166.47	0.8	3650	FOUND 1 CRACKED RIM. REPLACED FOR THE CUSTOMER		PERFORM 04M05 TWO WHEELS ARE CRACKED AND LEAKING AIR CHECK RECALLS RT FRT AND RT REAR WHEELS FOR AIR LEAK
2003	2FAFP71W13X	16-Apr-03	24-Apr-03	PARK FOF 25311401	5K01	*	*	*	*	*	04M05	9-Jul-07	52	101282	139.7	78.48	218.18	1	3853	INSPECTED AND REPLACED TWO WHEELS PER PROGRAM 04M05		RECALLS RT FRT AND RT REAR WHEELS FOR AIR LEAK
2003	2FAFP71W03X	20-Jun-02	19-Jul-02	PARK FOF 25311301	5K01	*	*	*	*	*	04M05	9-Jul-07	61	149012	139.7	78.48	218.18	1	3853	REPLACED TWO WHEELS PER PROGRAM 04M05 132153 04M05F 1.5 CHECK ALL DATES AND INSPECT ALL RIMS HAD TO REPLACE ALL FOUR RIMS. INSPECTED SPARE.		RECALL 58B01 STEEL WHEELS
2003	2FAFP71W63X	3-Oct-02	29-Nov-02	RANDALL 322028A	5K01	*	*	*	*	*	04M05	7-Jun-07	56	132153	324.7	112.28	436.98	1.5	2524	PERFORMED RECALL 04M05G		RECALL ON WHEELS
2003	2FAFP71W23X	5-Jun-02	9-Jul-02	FORT MILI 118789A	5K01	*	*	*	*	*	04M05	20-Aug-07	63	44291	341.04	124.63	465.67	1.7	1015	49195 VEHICLE EQUIPPED WITH 4W73 RECOMMEND REPLACEMENT SOP PERFORMED RECALL 58B01 REPLACED ALL FIVE WHEELS REBALANCED AND TEST DROVE		RECALL 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS
2005	2FAFP71W75X	18-Oct-04	6-Jan-05	CASA FOF 677072A	5K01	*	*	*	*	*	04M05	20-Aug-07	32	49195	341.04	126.67	467.71	1.7	20455	62321 WHEELS HAVE PREFIX 4W73 THEY DO FALL UNDER RECALL, SOP PERFORMED RECALL 58B01 REPLACED ALL FRIVE STEEL WHEELS DISABLED ALL FIVE WHEELA 37275 INSPECTED WHEELS WHEELS MEET REQUIREMENT FOR RECALL SIMOUNTED TIRES FROM WHEELS MOUNTED TIRES TO NEW WHEELS ROAD TEST OK FORD RECALL		RECALL # 58B01 INSPECTION ON STEEL WHEELS
2005	2FAFP71W55X	15-Oct-04	6-Jan-05	CASA FOF 676749A	5K01	*	*	*	*	*	04M05	16-Aug-07	32	62321	341.04	126.67	467.71	1.7	20455			04M05 STEEL WHEEL INSPECTION AND REPLACEMENT
2005	2FAFP71W35X	15-Oct-04	6-Jan-05	CASA FOF 677302A	5K01	*	*	*	*	*	04M05	21-Aug-07	32	37275	341.04	126.67	467.71	1.7	20455			

2005	2FAFP71W15X	15-Oct-04	6-Jan-05	CASA FOF677295A	5K01	*	*	*	*	04M05	21-Aug-07	32	45824	341.04	126.67	467.71	1.7	20455	45824 INSPECTED WHEELS WHEELS MEET CRITERIA FOR RECALL DISMOUNTED TIRES FROM OLD WHEELS MOUNTED TIRES TO NEW WHEELS ROAD TEST OK 52111 58B01 STEERING NIBBLE VERIFIED. CHECKED DATE CODE AND PART NUMBER STAMPING PER RECALL AND REPLACED ALL FIVE WHEELS.	RECALL 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS
2004	2FAFP71W84X	11-Feb-04	22-Jul-04	AUTOWA\351864A	5K01	*	*	*	*	04M05	3-Aug-07	37	52111	348.88	132.94	481.82	1.7	4860	47211 58B01 VERIFIED CONCERN OF AIR LOSS IN RIGHT FRONT WHEEL. CHECKED DATE AND PART # STAMPING AND REPLACED ALL FIVE WHEELS PER RECALL.	RECALL 58B01 STEEL WHEEL INSPECTION
2004	2FAFP71W24X	11-May-04	27-Jul-04	AUTOWA\351861A	5K01	*	*	*	*	04M05	3-Aug-07	37	47211	348.88	132.94	481.82	1.7	4860	58B01 REFER TO 04M05 NEC TO REPLACE 5 WHEELS	58B01 INSPECTION OF STEEL WHEEL 58B01 ONE TIME INSPECTION FOR STEERL WHEEL RECALL
2003	2FAFP71W43X	19-Aug-02	23-Oct-02	HELFMAN 6232252	5K01	*	*	*	*	04M05	28-Aug-07	60	74427	349.23	135.39	484.62	1.7	4587	27642 RECALL 04M05 04M05G (1.7) INSPECTED RIMS WERE BAD DISMOUNTED 5 TIRES FROM RIMS AND MOUNTED TIRES TO NEW RIMS, BAL. ALL 5 TIRES ONP 04M05 ONP 04M05 STEEL WHEEL INSPECTION & REPLACEMENT	RECALL 04S28
2004	2FAHP71W04X	27-Apr-04	30-Jun-04	CAVALIEF934645A	5K01	*	*	*	*	04M05	22-Jun-07	37	27642	341.04	147.9	488.94	1.7	6633	31970 WHEEL RECALL 04M05 PERFORMED WHEEL REPLACEMENT RECALL 04M05. INSPECTED WHEELS AND DETERMINED THAT THEY WERE A PART OF THE RECALL. REPLACED ALL FIVE WHEELS AS STATED TO DUE IN THE RECALL. THE	ONP 04M05
2004	2FAFP71W24X	20-Aug-03	25-Aug-03	BILLY HO\ 1473453	5K01	*	*	*	*	04M05	10-Jul-07	48	19311	365.4	126.78	492.18	1.5	341		N DAMA GED THE ORIGI NAL WHEEL LS SO THAT THEY COULD NOT BE WHEEL REPLACEMENT RECALL
2003	2FAFP71WX3X	4-Dec-02	31-Dec-02	EXPRESS 076589A	5K01	*	*	*	*	04M05	24-Jul-07	56	31970	374.18	124.12	498.3	1.7	5142		RECALL 04M05

2005	2FAHP71W75X	16-Aug-04	30-Sep-05	TED BRIT	61479801	5K01	*	*	*	*	*	04M05	27-Aug-07	24	51628	342.68	164.49	507.17	1.7	48	PERFORMED RECALL 07S48G.	07S48 WHEEL INSPECTION REPLACE TIRES AS MARKED WITH X NOT IN OASIS VERIFY RIM REPLACEMENT ADVISE ME
2003	2FAFP71W23X	10-Apr-02	29-Apr-02	AUFFENB	141598D	5K01	*	*	*	*	*	04M05	27-Jun-07	63	53104	374.18	153.61	527.79	1.7	8017	53104 PERFORMED RECALL 04M05 INSP ALL FIVE RIMS FOUND ALL NEED REPLACED PERFORMED 04M05G REPLACE,BALANCE AND DISABLED FIVE WHEELS	RECALL ON WHEELS
2005	2FMZA57635B	29-Apr-05	18-May-05	LAFAYETI	4367051	5K01	6F2Z	1007	F	B43	1	0701D	4-Aug-07	27	50996	204.25	24	238.1	0.3	960	VEFIED CONCERN LEAKING RIM. REPLACED RIM MOUNT AND BALANCE RIGHT FRT TIRE TO RIM. SMALL CRACK AT INSIDE BEAD LOCK REPLACED ALL 4 WHEELS MOUNTED BALANCED TIRES	RIGHT FRT TIRE GOES FLAT CUSTOMER STATES FRONT WHEELS ROTTING
2003	1FMZU75K43U	28-Jan-03	4-Nov-03	FAMILY FC	21827604	5K01	3L2Z	1007	KA	B65	55	0701D	19-Jun-07	45	50806	1262.5	80.93	1343.4	1.1	3372		ROTATIONAL NOISE PRESENT FROM REAR OF VEHICLE, VEHICLE ROADTESTED WITH TONY POSS WHEEL BEARINGS
2004	3FAHP39574R	14-Nov-03	23-Aug-04	STAR FOF	70560801	5K01	*	1007	*	N50	42	0711D	14-Aug-07	37	38885	150.89	174.97	381.86	1.9	5537	REPLACED DRIVER AND PASS REAR WHEEL BEARINGS	
2003	1FAHP60A53Y	25-Mar-03	14-Nov-03	FORD OF	23357501	5K01	1W6Z	1007	CA	B65	42	0711D	16-Jun-07	44	17634	476.7	21	534.65	0.3	3337	VERIFY CONCERN TIRE LEAK DUE TO CHROME PLATEING PEELING UNDER THE BEAD AND MAKING IT SO THE BEAD WONT SEAL REPLACE RIM OK	CUSTOMER STATES THERE IS A SLOW LEAK
2003	1LNHM86S03Y	29-Apr-03	23-Aug-03	CENTRAL	3516846	5K01	3W4Z	1007	EA	B65	42	0711D	1-Aug-07	48	61370	645.81	63.79	709.6	0.8	10021	REMOVE WHEEL,TEST IN TIRE TUB,BOUND LEAK FROM INNER BEAD,DISMOUNT TIRE,REPLACE WHEEL,REMOUNT & BALANCE TIRE,RETEST OK	CUSTOMER STATES LR WHEEL KEEPS LOSING AIR CUSTOMER STATES HEARS LIGHT SCRAPPING NOISE WHEN ROLLING..SOUNDS LIKE COMMING FROM
2003	5LMFU27R83L	14-Apr-03	30-Sep-03	ISLAND LI	7880753	5K01	2L7Z	1007	AB	N50	81	0711D	4-Jun-07	45	79207	1384.5	89.14	1473.6	1.2	11643	CHROME PEELING OFF ALL WHEELS MAKING NOISE ROADTEST TO VERIFY NOISE AROUND WHEELS WHILE DRIVING	NG FOL WHEEL AREA...
2003	1LNHM83W93Y	24-Apr-02	25-Jun-02	LIBERTY L	115295A	5K01	3W1Z	1007	CA	B65	D7	0736D	11-Jul-07	62	55563	565.94	24.52	590.46	0.3	11000	55563 INSTALLED NEW DRIVERS REAR RIM	PE08-060 1550 SOP WHEEL ESP

2003	1LNHM83W93Y	24-Apr-02	25-Jun-02	LIBERTY L	115437B	5K01	3W1Z	1007	CA	B65	14	0736D	17-Jul-07	62	55651	1128.6	49.04	1177.6	0.6	11000	55651 BOTH PASSENGER SIDE WHEELS WERE PEELING BAD WITH HEAVY COROSSION AROUND THE VALVE STEM. I REPLACED BOTH PASSENGER SIDE WHEELS.	CHECK ALL WHEELS FOR CHROME PEELING CHECK TIRES FOR SLOW LEAK NAILS
2003	1FTYR44U83P	21-May-03	5-Sep-03	NORRIS F	9139151	5K01	*	1007	*	H19	42	0759D	13-Jul-07	47	12408	0	39.87	39.87	0.5	34	REPAIR R F TIRE 2567 ESP WARR FOUND TIRE GOING FLAT, DISMOUNTED TIRE AND FOUND CHROME FLAKING OFF OF WHEEL AND CAUSING AIR LEAK, REPLACED WHEEL WITH UPDATED PART, REMOUNTED TIRE, BALANCED ASSY, REMOUNTED ON VEHICL	E, CHECK LT REAR TIRE GOING FLAT
2004	1FAHP60AX4Y	17-Dec-03	14-May-04	LANDMAR	671498D	5K01	4W6Z	1007	AA	B65	42	0759D	27-Jul-07	39	2567	499.86	28.91	528.77	0.3	8559	REPAIR R F TIRE 2567 ESP WARR FOUND TIRE GOING FLAT, DISMOUNTED TIRE AND FOUND CHROME FLAKING OFF OF WHEEL AND CAUSING AIR LEAK, REPLACED WHEEL WITH UPDATED PART, REMOUNTED TIRE, BALANCED ASSY, REMOUNTED ON VEHICL	E, CHECK LT REAR TIRE GOING FLAT
2003	5LMFU27R73L	2-Jan-03	8-Feb-03	ISLAND LI	7929951	5K01	2L7Z	1007	AB	B65	81	0759D	20-Jun-07	54	69686	1384.5	89.14	1473.6	1.2	11643	CHROME ON WHEELS LIFTING UP DISMOUNTED 4 TIRES REMOVED 4 SENSORS FROM OLD RIMS	AND INSTAL LED ONTO NEW CUSTOMER STATES RIMS HEARS SCRAPING NOISE WHEN ROLLING SOP WHEELS CHROME LIFTING AND HITTING BRAKE CALIPERS... CUSTOMER STATES PS REAR TIRE SLOW LEAK PLEASE PERFORM TIRE ROTATION.(PLEASE ONLY ROTATE REAR TIRES.)SEE ME FOR MORE INFO.
2003	2FMZA524X3E	26-Feb-03	28-Feb-03	IMLAY CIT	1951424	5K01	*	1015	*	A99	82	0797D	11-Jun-07	53	36108	0.59	16.47	18.1	0	2672	PLUGGED TIRE	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2004	1FAFP33Z84W	16-Feb-04	27-Mar-04	FRITTS FC	9719852	5K01	*	1007	*	A85	82	0798D	13-Jun-07	40	64502	0	10.21	10.21	0	5557	TIRE ROTATION.	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2003	1FBSS31L53H	6-Dec-02	18-Dec-02	COOK-WF	013651B	5K01	*	1007	*	H62	30	0798D	15-Aug-07	57	451079	0	14.11	14.96	0	4910	451079 .5 ROTATE TIRES	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2003	1FTRF172X3N	20-Dec-02	6-Jan-03	TEXAN FC	398278C	5K01	*	1007	*	A99	42	0798D	30-Jul-07	56	116314	0	15	15	0	2488	CK DRIVERS TIRE LOOSING AIR	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2003	1FTNX20F23E	11-Sep-02	22-Feb-03	DON CHAI	3869924	5K01	*	1015	*	A99	82	0798D	13-Jun-07	53	91198	0	15	15	0	1487	REPAIRED TIRE AND REMOUNTED QUALITY CARE REPORT	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2003	1FTNE24L33H	29-Aug-03	19-Apr-04	RANCHO I	47734603	5K01	*	1007	*	A99	82	0798D	10-Aug-07	41	71206	0	15	15	0	5432	CARD	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2005	1FTSW21P55E	3-Mar-05	28-Jul-05	TEXAN FC	399662F	5K01	*	1007	*	A99	42	0798D	17-Aug-07	26	47549	0	15	15	0	2488	47549 A.5 REPAIED TIRE	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES
2005	1FTRF12W05N	3-Mar-05	23-Mar-05	MAC HAIK	222119D	5K01	*	1007	*	A99	82	0798D	23-Jul-07	29	80417	0	15	15	0	9936	80417 ROTATED TIRES	ROTATE TIRES CHECK DRIVERS REAR TIRE LOOSING AIR CUSTOMER REQUESTING TIRE REPAIRS QUALITY CARE REPORT CARD * TIRE REPAIR (230P) ROTATE TIRES

2006	1FTRF12246NE	23-Jan-06	1-Feb-06	TEXAN FC 398503B	5K01 *	1007 *	A99	42 0798D	2-Aug-07	19	33667	0	15	15	0	2488	33667 SCREW IN TREAD I PATCHED THE RR TIRE(A.5LABOR)	P REAR HAS NAIL IN TIRE
2005	1FTPW14575K	6-Jan-05	15-Apr-05	ROSEMUF 20887605	5K01 *	1007 *	A99	82 0798D	10-Jul-07	28	23527	0	15.95	15.95	0	6366	FRONT TIRES AT 12 32 AND REAR TIRES AT 9 32 TREAD DEPTH TECHNICIAN REMOVED ALL TIRES, INSPECTED FOR WEAR, ROTATED TIRES, AND REINSTALLED TO PROPER TORQUE SPECIFICATIONS.	
2005	1FAHP53235A	10-Nov-04	25-Nov-04	HOLMAN F381455F	5K01 *	1007 *	A99	82 0798D	17-Jul-07	33	47251	4.99	11	17.1	0	1325	47255 PERFORMED PLUG ONE TIRE XX	NAIL IN RIGHT REAR TIRE
2005	1FTRF12W95N	7-Jan-05	19-Jan-05	GRANDE 091277C	5K01 *	1007 *	H62	42 0798D	9-Aug-07	32	114138	0	18	18	0	4569	ROTATED TIRES	ROTATE TIRES C S RF TIRE WAS DOWN TO 65LBS ALL OTHERS READING 75LBS C S FT END FEELS LIKE HAS A FLAT TIRE FT END DARTS AND WANDERS??
2004	1FTSS34LX4H	22-Mar-04	29-Apr-04	DEMPEW( 1611151	5K02 6C3Z	1700 A	A99	82 0798D	23-Aug-07	41	178867	4.41	15	19.67	0	5668	REPLACE VALVE STEM WPI	PO#86006 CUSTOMER REQUESTS TIRE ROTATION CUSTOMER REQUESTS TIRE ROTATION
2003	1FTRE14293	13-Sep-02	21-Jan-04	RUSTY EC 8929004	5K01 *	1007 *	A99	42 0798D	3-Aug-07	44	122885	0	19.95	19.95	0	5319	ROTATED TIRES	* TIRE ROTATION
2005	1FDWE35L45H	24-Mar-05	29-Apr-05	RUSTY EC 32510701	5K01 *	1007 *	A99	42 0798D	12-Jul-07	27	114614	0	19.95	19.95	0	5319	ROTATE TIRES WARRANTY	
2006	1FTRF12226N	23-Jan-06	1-Feb-06	TEXAN FC 399770B	5K01 *	1007 *	A99	42 0798D	18-Aug-07	19	47617	0	19.95	19.95	0	2488	47617 REFER TO LINE G TECH 67680 .5 HRS QUALITY FLEET CARE ROTATED TIRES AND ADJUSTED TIRE PRESSURE AS PER MANUFACTURER SPECIFICATIONS	CUSTOMER REQUESTS TIRE ROTATION AND TIRE PRESSURE ADJUSTED AS PER MENU SEE ERIC FOR KEY FOUR TIRE ROTATION \$18.95 FIVE TIRES \$23.69 ROTATE 4 TIRES. INSPECT FOR UNEVEN WEAR.
2004	1FAHP53254A	10-Feb-04	27-Feb-04	SAWGRA 65036202	5K01 *	1007 *	H62	42 0798D	3-Jul-07	41	68300	0	20	20	0	4908	52262 ROTATED TIRES AND SET TIRE PRESSURES.	
2006	1FMEU74E26U	22-Sep-05	4-Oct-05	CRESTM 155943B	5K01 *	1007 *	A99	82 0798D	24-Aug-07	23	52262	0	18.95	20.09	0	4369	ROTATED TIRES TECH 623 SERVICE COMPLETED PERFORMED TIRE ROTATION.	
2004	1FAHP55U14A	7-Oct-03	22-Oct-03	PHIL SMIT 16684604	5K01 *	1007 *	A99	82 0798D	11-Jul-07	46	51963	0	19.95	21.14	0	4351	40605 FOUND NAIL IN TIRE. PATCHED TIRE. MOUNTED AND BALANCED TIRE.	ROTATE TIRES
2007	1FAHP241X7G	5-Dec-06	20-Dec-06	WORLD F080888C	5K01 *	1007 *	A99	82 0798D	22-Aug-07	9	26961	0	21.42	21.42	0	4962	RETESTED 204034 MOUNTED AND BALANCED TIRE ON 19.5 RIM	PATCH TIRE (INC MOUNT & BALANCE) INSTALL LEFT FRONT TIRE
2005	1FAHP53255A	10-Nov-04	1-Dec-04	HOLMAN F218679B	5K01 *	1007 *	A99	82 0798D	23-Jul-07	33	40605	0	33	35.31	0	2848		BACK OF VEHICILE
2003	1FDXF46P13E	2-Apr-03	30-Apr-03	GATOR FC089626A	5K01 *	1007 *	A99	82 0798D	12-Jun-07	51	204034	0	36	36	0	4917		

2006	1FMYU93196K	5-Aug-05	19-Aug-05	APPLE VA 64522406	5K01 *	1007 *	A99	82 0798D	7-Aug-07	24	47677	0	37.5	37.5	0	9217	REPAIRED TIRE PATCH KIT	TIRE REPAIR PATCH KIT
2005	1FAFP53U75A	18-Nov-04	1-Dec-04	FORT MILI 118425A	5K01 *	1007 *	A99	82 0798D	9-Aug-07	33	37710	0	39.24	39.24	0	1015	37710 .7 BALANCED TIRES, RR HAS HIGH ROAD FORCE	CK STATES HAS SHAKE IN CAR AT 60 MPH, STATES VERY BAD AT 80 MPH ADVISE PASS FRON HUB CAP MISSING
2004	2FTRF17204C	17-Feb-04	30-Aug-04	TEXAN FC 396833A	5K02 YL3Z	1130 AA	A99	42 0798D	11-Jul-07	35	72899	22.55	15.4	39.75	0	2488	72899 REPLACED CAP .1 ATUH HQ478147 TEST DROVE VEHICLE CONFIRMED VIBRATION, COULD NOT CONFIRM EXCESSIVE PLAY IN STEERING, BALANCED ALL FOUR TIRES ALL TIRES WAY OUT OF BALANCE AND SET TIRE PSI AT 60 FRONT 80 REAR	ES WERE C S FRT END LOW SHIMMYS AT HWY SPEEDS AND OR AT 40 EXCESSIVE PLAY IN STEERING
2003	1FTSS34L83H	12-Mar-03	4-Jun-03	KELLY FO 12486603	5K01 *	1007 *	A99	82 0798D	9-Aug-07	51	38868	0	39.95	39.95	0	4808	ALL TIR 77964 TK3127 A 5 CHECKED FOR EXHAUST LEAK FOUND MANIFOLD BOLTS LOOSE READJUSTED AND TIGHTENED BOLTS NO FURTHER LEAKS AFTER	CUSTOMER STATES...VEHICLE HAS AN EXHAUST LEAK
2005	1FTRE14W35	2-Sep-04	13-Jul-05	TEXAN FC 396040B	5K01 *	1007 *	A99	42 0798D	29-Jun-07	24	77964	0	40.4	40.4	0	2488	1 ROTATED TIRES FRONT TO BACK. BALANCED ALL 4 WHEELS TEST DROVE RECHECKED OK QUALITY	CUSTOMER REQUEST ROTATE TIRES CUSTOMER STATES THE VEHICLE VIBRATES ABOVE 65 MPH.
2006	1FTSW21P56E	23-Feb-06	31-Mar-06	KRUG HIL 1878301	5K01 *	1007 *	A99	82 0798D	25-Jul-07	17	29811	0	41.6	41.6	0	1758	FLEET CARE	ROTATE AND BALANCE TIRES PASSENGER CARS AND LIGHTTRUCKS LUG NUTS ROUNDED OFF
2005	1FAFP53205A	23-Mar-05	21-Apr-05	PHIL LON 77975505	5K01 *	1007 *	A99	82 0798D	27-Jun-07	27	29398	0	43.8	43.8	0	3140	CP:1007 TECH29 MENU ROTATE AND BALANCE COMPLETE VERFIED AND REPLACED LUG NUTS	ROTATE AND BALANCE TIRES PASSENGER CARS AND LIGHTTRUCKS LUG NUTS ROUNDED OFF
2004	1FMFU18L94L	2-Mar-04	31-Mar-04	BEACH FC 9589704	5K01 *	1007 *	H62	42 0798D	24-Jul-07	41	76105	0	47.8	47.8	0	6727	32450 I REPLACED THE DIESEL AIR FILTER	*REPLACE AIR FILTER 6.0 DIESEL
2003	1FAFP38393W	23-Apr-03	5-May-03	DON TES1 2349905	5K01 6S4Z	1012 BA	B65	42 0798D	11-Jul-07	51	85421	24.08	22.23	49.55	0.3	2335	A.5 33266 .8 PERFORMED BALANCE ON ALL 4 TIRES	ROTATE AND BAL 4 TIRES
2006	1FTSW21P26E	23-Jun-05	9-May-06	TEXAN FC 394860C	5K01 *	1007 *	A99	42 0798D	14-Jun-07	14	32450	0	49.95	49.95	0	2488	439384 PERF MAINT PER OWNER MANUAL	ROTATE AND BALANCE TIRES
2006	1FAHP53206A	21-Dec-05	6-Jan-06	COOK-WF 014350E	5K01 *	1007 *	H62	42 0798D	27-Aug-07	20	33266	0	56.45	57.4	0	4910	151363 NC REPLACED RIGHT FRONT WHEEL COVER	REPLACE RT FRT WHEEL COVERS
2003	1FBSS31L53H	6-Dec-02	18-Dec-02	COOK-WF 012072B	5K01 *	1007 *	H62	30 0798D	14-Jul-07	56	439384	0	56.45	59.84	0	4910		
2005	1FDWE35S05H	12-Aug-04	21-Jan-05	PAYTON-V 486073C	5K02 *	1130 *	N22	30 0798D	6-Jun-07	29	151363	69.95	0	75.72	0	2413		

2005	1FAFP53U75A	4-May-04	21-May-04	BEAVERT	047387A	5K02	*	1130	*	B65	82 0798D	21-Aug-07	40	30916	0	92.08	92.08	1	8729	30916 1.0 HR INSPECT FOR SQUEEKING NOISE WHEN DRIVING, VERIFY CONCERN, ISOLATE NOISE TO HUBCAPS, REMOVED HUBCAPS, CLEANED MOUNTING SURFACES, APPLIED SOUND DEADENING GREASE, REASSEMBLE ROAD TEST, A	LL OK NOW	CUSTOMER STATES WHILE DRIVING, WORSE COLD, THERE IS A SQUEAK TYPE NOISE, NOT ROTATION, GETS SOFTER WHEN REPLACE SPARE TIRE WHEEL
2005	2FAHP71W25X	19-Jan-05	22-Feb-05	EVERGRE	32719202	5K01	5W7Z	1007	AA	A99	82 0798D	27-Aug-07	31	53408	68.21	17.65	93.5	0	8305	ORDERD 1 WHEELS. TRANSFERED SPARE WHEEL ONTO VEHICLE BALLANCED ALL TIRES. ROAD TEST. ALL OK		NEED ONE WHEEL AT R R REPLACED BALANCE TIRES AND SWAP SPAIR RIM TO R R
2005	2FAHP71W25X	19-Jan-05	22-Feb-05	EVERGRE	32712101	5K01	*	1007	*	A99	82 0798D	25-Aug-07	31	53229	0	97.05	105.69	0	8305	53426 SENT TO QUICKLANE FOR WHEEL REPLACEMENT.		
2005	1FAFP53UX5A	27-Jan-05	11-Feb-05	BOWEN S	259878C	5K01	YF1Z	1007	FA	A99	82 0798D	12-Jul-07	30	53425	90.44	0	116.08	0	8588	143167 WHEL COVER MISING CP .5 HRS6583 INSTALL RIGHT REAR WHEL COVER.		REPLACE WHEEL
2005	1FDWE35S25H	21-Aug-04	21-Jan-05	PAYTON	1485969B	5K02	*	1130	*	B65	42 0798D	5-Jun-07	29	143167	69.95	40.51	116.23	0	2413			PASS OUTSIDE REAR TIRE WHEEL COVER IS MISSING CUSTOMER STATES THERE IS A SLOW LEAK IN THE RIGHT FRONT TIRE AND FASTER LEAK IN THE RIGHT REAR TIRE.
2006	1FAFP532X6A	16-Mar-06	6-Apr-06	PHIL LON	78109202	5K01	*	1007	*	A99	82 0798D	12-Jul-07	16	11934	95.2	27	122.2	0	3140	REPLACED RIGHT FRONT TIRE HAD NAIL IN SIDE WALL QUALITY FLEET CARE		CHK + ADV
2003	1FTRF17233N	20-Dec-02	6-Jan-03	TEXAN FC	399619A	5K01	*	1007	*	A99	42 0798D	16-Aug-07	57	111715	108.3	15	132.2	0	2488	111715 MOUNT AND BALANCE ONE TIRE A.5		*MOUNT AND BALANCE ONE TIRE
2004	1FDWF36PX4E	29-Jan-04	1-Mar-04	FORT MILI	116317A	5K01	*	1007	*	H62 D1	0798D	9-Jun-07	40	83802	107.6	28.03	146.18	0	1015	83802 50 CHECK TIRE FOR LEAK REPLACE TIRE MOUNT + BALANCE		CUST STATES DRIVERS SIDE REAR TIRE LEAKING FLAT REPAIR LEFT REAR AND PUT SPARE BACK
2006	1FTPW14596K	7-Oct-05	15-Feb-06	AUTOMAX	229768A	5K01	*	1007	*	H62	42 0798D	6-Jun-07	16	11914	141.85	23.82	165.67	0.3	9976	11914 30 MOUNT AND BAL X 1		CUST REQ REPL RT FRT WHEEL
2004	1FTPX145X4N	27-Jan-04	12-Feb-04	JOE COO	423136A	5K01	4L3Z	1015	CA	A99	82 0798D	12-Jun-07	41	70878	131.13	34	176.74	0	3036	REPL RT FRT WHEEL RIM ROAD TEST DIAG. MOUNT AND BALANCE TWO TIRES ROTATE TO FRONT.		SHIMMY IN FRONT END AT APPROX 65 MPH
2003	1FAFP53U43G	22-Jan-03	30-Jan-03	RANCHO I	47855801	5K01	*	1007	*	N27	42 0798D	27-Aug-07	56	71242	138.4	30	183.42	0	5432			BALANCE 4 WHEELS AND ROTATE/MOUNT AND BALANCE ONE TIRE
2005	1FTRF12255K	5-Aug-05	23-Aug-05	JORDAN F	4839851	5K01	*	1007	*	A99	82 0798D	6-Aug-07	24	91630	141.04	53.95	207.29	0	4546	COMPLETED BALANCE & ROTATE REPLACED 1 TIRE		
2003	1FTRF172X3N	20-Dec-02	6-Jan-03	TEXAN FC	398278F	5K01	*	1007	*	A99	42 0798D	30-Jul-07	56	116314	196.88	30	243.11	0	2488	116314 MOUNT AND BALANCE TWO NEW TIRES B.0		*MOUNT AND BALANCE TWO NEW TIRES



2003	1FAFP55U93G	22-Jan-03	30-Jan-03	SANTA M/358756B	5K02	F42Z	1700	A	A99	82 0798D	19-Jun-07	54	65937	198.22	63.6	277.18	0	1597	65937 060 REPLACED TWO TIRE,STEMS,SEALS,AND SPIN BALANCED AND MOUNTED TIRES.NEW DOT CODE:LLX8 3RJ 0707X2 FLAG TECH 415 1 COMPLETED REPLACED FRONT 2 TIRES	TIRE2 REPLACE TWO TIRES TO INCLUDE NEW STEM SEALS AND MOUNT AND BALANCE PO#ME171
2005	1FTPX12575N	4-Jan-05	8-Apr-05	BEV SMIT/47606906	5K02	*	1705	*	A99	82 0798D	6-Aug-07	29	32189	252.78	23.4	298.92	0	4909	84000 I MOUNTED AND BALANCE TWO NEW TIRES B.0 DOT	REPLACE TWO TIRES
2003	1FTRF17213N	20-Dec-02	15-Jan-03	TEXAN FC397388A	5K01	*	1007	*	A99	42 0798D	18-Jul-07	55	100248	246.5	30	302.7	0	2488	T79CP JNH 0607 INSTALLED NEW TIRE AND BALANCED	*MOUNT AND BALANCE TWO TIRES CHECK FOR SLASH IN TIRE CUSTOMER REQUESTS TIRES CHECKED MOUNT AND BALANCE TWO TIRES
2006	1LNF87AX6Y	9-Nov-05	12-Dec-05	TED BRIT/61196301	5K01	*	1007	*	A99	82 0798D	6-Aug-07	21	21142	282.05	29.03	325.18	0	48		
2003	1FMFU18L33L	11-Nov-02	18-Nov-02	L F DONN/418666A	5K01	*	1007	*	B65	82 0798D	25-Jun-07	57	172675	303.46	45.19	371.31	0	2220	REPLACED 2 REAR TIRES 57788 , MOUNT	
2004	1FTRF12W44N	21-Aug-03	5-Sep-03	JOE MYEF/560083B	5K01	*	1007	*	A99	82 0798D	23-Jul-07	48	57788	327.9	20	374.96	0	4402	BALANCED 2 TIRES . COMPLETED INSTALLATION OF TWO FRONT TIRES	REPLACE FRONT TIRES
2006	1FTWW33PX6E	29-Nov-05	12-Jul-06	BLUEBON/47642206	5K01	*	1007	*	B65	42 0798D	24-Jul-07	13	25902	270.28	20	429.61	0	4570	47617 I MOUNT AND BALANCED 3 TIRES(B.5LABOR) DOT	*MOUNT AND BALANCE THREE TIRES
2006	1FTRF12226N	23-Jan-06	1-Feb-06	TEXAN FC399770G	5K01	*	1015	*	A99	42 0798D	18-Aug-07	19	47617	369.75	45	445.05	0	2488	T79C PJNH 1807;3 TIRES 36345 I MOUNTYED AND BALANCE FOUR NEW TIRES C.0 DOT	
2006	1FAHP53226A	11-Jan-06	26-Jan-06	TEXAN FC396085C	5K01	*	1007	*	A99	42 0798D	30-Jun-07	18	36345	340	60	445.34	0	2488	1707 TWO TECH 48544 1.0 HR MOUNTED INDEX AND BALANCED 2 TIRES 108173 I MOUNT AND BALANCED 4 TIRES(C.0LABOR) DOT	*MOUNT AND BALANCE FOUR TIRES
2005	1FTRF12W15N	25-Feb-05	8-Mar-05	SAWGRA/65022805	5K01	*	1007	*	H62	42 0798D	2-Jul-07	29	56989	379.84	50	455.63	0	4908	AN08 B4UU 2107;ALL TIRES	REPLACE 2 TIRES
2003	1FTRF17233N	20-Dec-02	6-Jan-03	TEXAN FC397948A	5K01	*	1007	*	A99	42 0798D	26-Jul-07	56	108173	389.04	60	493.12	0	2488		*MOUNT AND BALANCE FOUR TIRES
2006	1FTRE14W66D	24-Mar-06	17-Aug-06	TEXAN FC398747A	5K01	*	1007	*	A99	42 0798D	6-Aug-07	12	49097	425	60	519.96	0	2488	MOUNT AND BALANCE FOUR TIRES	*MOUNT AND BALANCE FOUR TIRES
2003	1FDWE35L93H	19-Feb-03	31-Mar-03	TOWN & C/361525A	5K01	*	1007	*	A99	82 0798D	28-Jun-07	52	22427	442.42	79.49	561.73	1	3365	22427 MOUNTED AND BALANCED 2 TIRES AND PUT ON THE OUTSIDE REAR	MOUNT AND BALANCE TWO TIRES 225 75 R 16 MICH..LTX MIS ..PLEASE ORDER
2006	1FTRX12W46F	14-Sep-05	21-Feb-06	TEXAN FC394276D	5K01	*	1007	*	A99	42 0798D	5-Jun-07	16	48538	493	60	593.78	0	2488	MOUNT AND BALANCE FOUR TIRES	*MOUNT AND BALANCE FOUR TIRES

2004	2FAFP73W84X	18-Sep-03	14-Oct-03	JOE MYEF557697H	5K01 *	1007 *	A99	82 0798D	26-Jun-07	46	85925	523.8	40	607.02	0	4402	85925 CP 20.00 MOUNTED AND BALANCED FOUR TIRES.	MOUNT AND BALANCE FOUR TIRES PO FRANKGRAMEZ
2005	1FTRF12W25N	7-Jan-05	19-Jan-05	JORDAN F 4381252	5K01 *	1007 *	A99	82 0798D	27-Jun-07	30	121836	599.96	48	697.46	0	4546	MOUNTED AND BALANCED 4 TIRES	MOUNT AND BALANCE 4 TIRES
2005	1FTVX125X5N	10-Feb-05	15-Mar-05	HOLMAN I381608A	5K01 *	1007 *	A99	82 0798D	19-Jul-07	29	69262	588.4	82	717.32	0	1325	69262 MOUNTED AND BALANCED 4 NEW TIRES XX GENERAL GRABBER TR LT 245 70 R17 XX DOT#ADP846LB3904	MOUNT & BALANCE (4 WHEELS)
2006	1FTWF31P56	21-Mar-06	21-Apr-06	DAVE SIN 43214701	5K01 5C3Z	1015 JA	B65	42 0798D	25-Jun-07	15	63345	388.78	412.86	834.71	0	8199	REPLACE RIGHT REAR HUB AND SEAL, ROTOR AND WHEEL REPLACE ALL LUG NUTS ON RIGHT REAR ALSO MISSING NUTS ON R FRT&L REAR	CUST SAYS CHECK FOR CRACK IN REAR WHEEL AND ADVISE CUSTOMER REQUESTS TIRE ROTATION
2006	1FMEU73E86U	1-Dec-05	17-Dec-05	BILL ESTE 10618402	5K01 *	1007 *	A99	82 0799D	18-Jun-07	19	45408	0	0	0	0	3362	ROTATED TIRES.	TIRE TAX 2 TIRES
2006	2FMZA51686B	14-Dec-05	29-Dec-05	BEACH FC 9629802	5K01 *	1007 *	D50	42 0799D	27-Jul-07	20	71878	0	2	2	0	6727	CP:1007	TIRE TAX 2 TIRES
2006	2FMZA51686B	14-Dec-05	29-Dec-05	BEACH FC 9629806	5K01 *	1007 *	H62	42 0799D	27-Jul-07	20	71878	0	2	2	0	6727	CP:1007	CK RT FRT TIRE FOR LEAK
2006	1FMEU73E66ZA	20-Dec-05	9-Jan-06	JOE MYEF558624B	5K01 *	1007 *	A99	82 0799D	6-Jul-07	19	37557	0	10	10	0	4402	REPAIR RT FRT TIRE FOR LEAK	REPAIR TIRE R R
																	1 TIRES HAS NAIL. INSIDE EDGE AT SIDEWALL. RECOMMEND TIRE REPLACEMENT INSTALLED SPARE TIRE PER CUSTOMER REQUEST	CUSTOMER STATES THAT TIRE IS LOOSING AIR GOING FLAT LEFT FRONT
2007	3FAHP07Z97R	13-Feb-07	13-Mar-07	DEWEY F 43721901	5K01 *	1007 *	A99	82 0799D	21-Aug-07	6	12509	0	10	10.6	0	3540	3919 ROTATED THE TIRES . COMPLETED REPAIR	TIRE ROTATION
2007	5LMFU27537LJ	13-Dec-06	23-Dec-06	NORTHGA 139056B	5K01 *	1007 *	A99	82 0799D	28-Jun-07	7	3919	0	11	11	0	2663	4570 OF TIRE	REPAIR TIRE R R
2006	1FMEU73E46U	9-Feb-06	25-Feb-06	BLUEBON 47025202	5K01 *	1015 *	B65	42 0799D	16-Jun-07	16	42570	1.8	10	12.01	0	4570	15310 NAIL IN TIRE VERIFIED CONCERN XX NAIL IN MIDDLE OF TIRE TREAD XX REMOVED NAIL AND PLUGGED TIRE XX TIRE IS GOOD NO LEAKS AFTER PLUG XX REINSTALLED SPARE TIRE UNDER VEHICLE AND PLACED JACK IN	CARGO AREA OF CARGO AREA VEHIC LE XX PERFORM R FRONT FLAT REPAIR IN BACK OF CARGO AREA REINSTALL SPARE AND TIRE JACK
2007	1FMYU93Z97K	17-Nov-06	21-Nov-06	HOLMAN I380628B	5K01 *	1007 *	B65	82 0799D	30-Jun-07	8	15310	0.95	11	12.78	0	1325	6426 ROTATED TIRES	TIRE ROTATION
2007	1FTPW14V57K	10-Jan-07	19-Jan-07	BUTCH OI 158005B	5K01 *	1007 *	D50	82 0799D	22-Jun-07	6	6426	0	12.95	13.86	0	6422	6426 ROTATED TIRES	CK LEFT REAR TIRE
2006	1FMEU73E86Z	21-Dec-05	23-Jan-06	JOE MYEF555670B	5K01 *	1007 *	A99	82 0799D	4-Jun-07	17	31934	0	14.84	14.84	0	4402	REPAIR TIRE	KEEPS ADDING AIR
2006	2FMZA51656B	12-Dec-05	27-Dec-05	TEXAN FC 396835B	5K01 *	1007 *	A99	42 0799D	11-Jul-07	19	83706	0	15	15	0	2488	83706 D FRONT TIRE REPAR A.5	D FRONT HAS SCREW IN TIRE

2006	2FMZA51616	13-Dec-05	29-Dec-05	MIDLAND	23973304	5K01	*	1007	*	A99	82 0799D	2-Jul-07	19	36560	0	15	15	0	9801	TCARE CC82 DIRT BETWEEN WHEEL AND TIRE, REMOVE TIRE AND CLEAN BEAD RETEST OK.	PASSENGER FRONT TIRE LOOSES AIR CUSTOMER REQUESTS TIRE ROTATION
2006	1FMEU73E26U	8-Dec-05	24-Dec-05	COLE-WH	6621702	5K01	*	1007	*	A99	82 0799D	24-Aug-07	21	108772	0	15	15	0	8980	COMPLETED ROTATION. 1 ROTATED TIRES INSPECTED BRAKES	QUALITY FLEET CARE SERVICE
2007	1FTSW21P57E	22-Nov-06	6-Dec-06	PHIL LON	78113402	5K01	*	1007	*	A99	82 0799D	12-Jul-07	8	24941	0	15	15	0	3140	QUALITY FLEET CARE ROTATED TIRES QUALITY FLEET CARE	QUALITY FLEET CARE SERVICE
2007	1FMFK16557L	20-Mar-07	6-Apr-07	PHIL LON	78225002	5K01	*	1007	*	A99	82 0799D	26-Jul-07	4	5318	0	15	15	0	3140	FLEET CARE ROTATED TIRES INSPECTED BRAKES	QUALITY FLEET CARE SERVICE
2007	1FAHP24117G	4-Dec-06	19-Dec-06	PHIL LON	78193103	5K01	*	1007	*	A99	82 0799D	23-Jul-07	8	9830	0	15	15	0	3140	QUALITY FLEET CARE	QUALITY FLEET CARE SERVICE
2006	1FMEU73E26U	8-Dec-05	23-Dec-05	RUSS MIL	326026	5K01	*	1007	*	A99	82 0799D	27-Jun-07	19	52433	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	3FAHP08Z17R	11-Oct-06	19-Oct-06	RUSS MIL	527927	5K01	*	1007	*	A99	82 0799D	8-Aug-07	10	10165	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMDC49C57BA	10-Jan-07	19-Jan-07	RUSS MIL	638926	5K01	*	1007	*	A99	82 0799D	29-Aug-07	8	12386	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMDC49C17E	12-Oct-06	13-Feb-07	RUSS MIL	551026	5K01	*	1007	*	A99	82 0799D	13-Aug-07	7	14186	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMDC48C67E	16-Jan-07	19-Jan-07	RUSS MIL	424526	5K01	*	1007	*	A99	82 0799D	17-Jul-07	6	13629	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMYU04187KC	7-Dec-06	12-Dec-06	RUSS MIL	298826	5K01	*	1007	*	A99	82 0799D	21-Jun-07	7	10224	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMYU03137K	11-Dec-06	18-Dec-06	RUSS MIL	613226	5K01	*	1007	*	A99	82 0799D	24-Aug-07	9	20974	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMYU03137K	11-Dec-06	18-Dec-06	RUSS MIL	444626	5K01	*	1007	*	A99	82 0799D	23-Jul-07	8	9156	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMFU16537L	8-Dec-06	12-Dec-06	RUSS MIL	501126	5K01	*	1007	*	A99	82 0799D	2-Aug-07	8	5136	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES CK AND SET AIR PRESSURES
2007	1FMFK20547L	22-Dec-06	4-Jan-07	RUSS MIL	353125	5K01	*	1007	*	A99	82 0799D	2-Jul-07	6	10292	0	16	16	0	2890	SET AIR PRESSURES	PRESSURES
2007	1FMEU33857UA	19-Jan-06	3-Mar-06	RUSS MIL	317726	5K01	*	1007	*	A99	82 0799D	25-Jun-07	16	17429	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	1FMCU04107K	7-Aug-06	14-Aug-06	RUSS MIL	221726	5K01	*	1007	*	A99	82 0799D	6-Jun-07	10	15011	0	16	16	0	2890	ROTATE TIRES	ROTATE TIRES
2007	2FMDC36CX7	15-Jan-07	22-Jan-07	CRESTMC	154221C	5K01	*	1007	*	A99	82 0799D	30-Jun-07	6	11008	0	15.95	16.91	0	4369	11008 REMOVE NAIL FROM TIRE AND INSTALL PLUG	LEFT REAR TIRE LOOSING AIR LEFT REAR TIRE LOSS OF AIR CUSTOMER REQUESTS TIRE ROTATION
2007	2FMDC49C07E	10-Jan-07	12-Feb-07	IMLAY CIT	2175252	5K01	*	1015	*	A99	82 0799D	30-Aug-07	7	14628	0.59	17.01	18.67	0	2672	PLUGGED THE TIRE	CHECK RIGHT REAR TIRE CUSTOMER REQUESTS TIRE ROTATION
2005	2FMZA576X5E	5-Nov-04	29-Nov-04	BILL ESTE	10775505	5K01	*	1007	*	A99	82 0799D	13-Aug-07	33	116705	0	19.95	19.95	0	3362	COMPLETE TIRE ROTATION	ROTATION
2007	3FAHP07Z97R	22-Feb-07	10-Mar-07	VAN DRIS	022806A	5K01	*	1007	*	A99	82 0799D	11-Jul-07	5	14594	0	19.95	19.95	0	12505	REPAIRED NAIL IN RIGHT REAR TIRE. WPI	ROTATION
2007	1FBNE31L17D	19-Mar-07	3-Apr-07	BILL ESTE	10747402	5K01	*	1007	*	A99	82 0799D	2-Aug-07	5	12853	0	19.95	19.95	0	3362	ROTATION COMPLETE	CUSTOMER REQUESTS TIRE ROTATION
2007	2FMDC36CX7	15-Jan-07	22-Jan-07	CRESTMC	154221B	5K01	*	1007	*	A99	82 0799D	30-Jun-07	6	11008	0	18.95	20.09	0	4369	11008 ROTATE TIRES VERIFIED CONCERN. FOUND NAIL IN DRIVERS REAR TIRE. REPAIRED TIRE AND REINSTALLED SPARE TIRE.	ROTATION
2006	1FAFP53UX6	18-Nov-05	5-Dec-05	BUSS FOF	1336041	5K01	*	1007	*	H62	82 0799D	5-Jun-07	19	31152	2.25	17.77	20.17	0	1857	42286 REPAIRED RIGHTH REAR TIRE. QC9623	FOUR TIRE ROTATION \$18.95 FIVE TIRES \$23.69
2006	2FMZA516X6E	28-Nov-05	21-Dec-05	DIFTEE FC	182906A	5K01	*	1007	*	A99	82 0799D	20-Jun-07	19	42286	0	21.79	21.79	0	6835	REAR TIRE. QC9623	SLOW LEAK IN RIGHT REAR TIRE PE08-060 1557

Year	Plate	Reg Date	Exp Date	Agency	Unit	Class	Model	Year	Make	Model	Color	MPG	MSRP	Actual Price	Options	Notes	Comments				
2006	1FAHP34N06W	7-Dec-05	22-Dec-05	FORT MILI	117501B	5K01	*	1007	*	A99	82 0799D	13-Jul-07	19	38531	0	21.99	21.99	0	1015	38531 .3 TIRE REPAIR	CUST STATES CHECK LEFT REAR TIRE LEAKING, CHECK BOTH REAR ADV ROTATE TIRES 17
2007	2FMDK49C07E	13-Dec-06	28-Dec-06	FORT MILI	118673B	5K01	*	1007	*	A99	82 0799D	16-Aug-07	8	9092	0	21.99	21.99	0	1015	9092 30 ROT TIRES 11084 R.S.FRONT HAD A HOLE IN IT PLUGGED PATCH & BAL. & HAND TORQUED LUG NUTS TO 100 FT.LBS. PERFORMED TIRE ROTATION.	REPAIR RIGHT FRONT TIRE FOR NAIL PUNCTURE
2007	1FTZR15E47F	6-Dec-06	18-Dec-06	MATHEW	240415A	5K01	*	1007	*	B65	30 0799D	20-Jul-07	8	11084	0	22.59	22.59	0.3	2265	100 FT.LBS. PERFORMED TIRE ROTATION.	REPAIR RIGHT FRONT TIRE FOR NAIL PUNCTURE
2007	2FMDA51677E	6-Sep-06	23-Sep-06	WORLD F	079490B	5K01	*	1007	*	A99	82 0799D	30-Jul-07	11	37889	0	21.41	22.75	0	4962	A99 82 1007 COMPLETED TIRE REPAIR	ROTATE TIRES
2006	1FMEU73E66U	9-Dec-05	28-Dec-05	APPLE FC	48568104	5K01	*	1007	*	A99	82 0799D	13-Aug-07	20	32934	0	24.32	24.32	0	84	A99 82 1007 PLUGGED HOLE IN PASSENGER S REAR TIRE COMPLETE	REPAIR FLAT TIRE
2007	3FAHP07177R	4-Oct-06	3-Dec-06	APPLE FC	48487401	5K01	*	1007	*	A99	82 0799D	3-Aug-07	9	8184	0	24.32	24.32	0	84	REAR TIRE COMPLETE	C S RIGHT REAR TIRE HAS A SLOW LEAK TIRE LIGHT ON AND LEFT REAR TIRE NEEDS REPAIR CUSTOMER ADVISE ME TIRE LIGHT HAS BEEN COMMING ON BEFORE TIRE REPAIR WAS NEEDED ESP FLEET CARE
2005	2FMZA57615B	2-Feb-05	17-Feb-05	SAWGRA	64995103	5K01	*	1007	*	B65	42 0799D	29-Jun-07	29	45339	0	25	25	0	4908	TECH 88412 0.5 6319 060 FLAG 125 .6 REPAIRED RIGHT REAR TIRE REINSTALLED SPARE TIRE BACK IN TRUNK SET PSI	REPAIR FLAT TIRE
2007	1FAHP24147G1	9-Feb-07	7-Mar-07	SANTA M	361090A	5K01	*	1007	*	A99	82 0799D	2-Aug-07	5	6319	1.5	24.95	26.57	0	1597	N/C	REPAIR FLAT TIRE
2006	1FTRF12286N	23-Jan-06	2-Feb-06	BOB TOMI	63465102	5K02	4L3Z	1130	EA	A99	82 0799D	12-Jul-07	18	33122	26.67	0	26.67	0	2531	FOUND HAD 2 NAILS IN LEFT PLUGED NAIL HOLES WHEN TIRE WAS REMOVED HIT PRESSURE SENSOR AND BROKE BAND LOOSE HAD TO REPLACE BAND REPAIRED AND MOUNTED TIRE	CUSTOMER STATES THAT THE LOW TIRE LIGHT IS ON. POSSIBLE DRIVER FRONT TIRE HAS A SLOW LEAK. REPAIR AND MOUNT TIRE
2006	1FMEU73E86U	1-Dec-05	17-Dec-05	BILL ESTE	10618405	5K01	*	1007	*	A99	82 0799D	18-Jun-07	19	45408	4.49	22.5	26.99	0	3362	REPAIRED AND MOUNTED TIRE	REPAIR RT FRONT TIRE,
2007	2FMDK36C17E	17-Nov-06	24-Jan-07	IMLAY CIT	2024024	5K01	*	1015	*	A99	82 0799D	9-Jul-07	6	8543	0	25.52	27.05	0	2672	VERIFIEDS CUSTOMERS CONCERN,FOUND NAIL IN TIRE,REMOVED, PLUG PATCHED,REMOUNTEWD, RE CK OK.	REPAIR RT FRONT TIRE,
2007	3FAHP07Z77R1	5-Jan-07	20-Jan-07	KRUG HIL	1999402	5K01	*	1007	*	A99	82 0799D	21-Aug-07	8	19416	1.99	24.96	27.07	0	1758	RE CK OK.	REPAIR RT FRONT TIRE,
2006	1FMEU75E26U	30-Jan-06	21-Feb-06	ALBUQUE	12130303	5K01	*	1007	*	A99	82 0799D	1-Aug-07	18	43232	0	32	33.92	0	10140	CHECKED RIGHT SIDE TIRES FOUND SCREWS IN BOTH TIRES REPAIRED TIRES SET TO 35 PSI	CHECK RT SIDE TIRES THEY HAVE AIR LOSS PRETTY OFTEN TIRE PRESSURE LIGHT COMES ON PRETTY OFTEN

2007	1FTSW21P17	5-Jun-06	14-Jun-06	FORT MILI	117395C	5K01	*	1007	*	A99	82	0799D	10-Jul-07	14	50136	0	39.24	39.24	0	1015	ROAD FORCE BALANCED 4 TIRES	ROTATE AND BALANCE 16
2004	1FMDU62K24U	15-Apr-04	18-May-04	BLOOMIN	96243	5K01	*	1015	*	B65	42	0799D	18-Jun-07	38	56928	0	40	40	0	4691	ROTATED, BALANCED TIRES	BALANCE ALL FOUR TIRES
2007	1FMDK06187G	4-Dec-06	18-Dec-06	FORD OF	1113252	5K01	*	1007	*	A99	82	0799D	1-Aug-07	8	10164	0	38.42	41.11	0	8951	ROTATE TIRES ROTATED TIRES	CUSTOMER STATES TIRE ROTATION SERVICE
2007	1FAFP53U67A	17-Jul-06	3-Aug-06	DIFFEE F	185755A	5K02	5F1Z	1130	AA	B66	33	0799D	16-Aug-07	13	43302	41.12	7.26	51.92	0.1	6835	43302 LEFT FRONT HUB CAP FELL OFF. REPLACE HUB CAP AND BEAUTY BOLTS. RETEST OK. 37454 ROAD TEST. VERIFY SLIGHT VIBRATION. FOUND TIRES WERE OUT OF BALANCE. BALANCE ALL 4 TIRES. ROAD TEST OK. ALSO NOTED SOME CUPPING ON TIRES	ORDERED LF HUBCAP AND 5 ANCHOR BOLTS PER FORD COMM LENDING SERVICES AUTH HC4840
2006	1FMJU93166K	7-Nov-05	22-Nov-05	CRESTMC	154280C	5K01	*	1007	*	A99	82	0799D	3-Jul-07	20	37442	0	49.95	52.95	0	4369	CAUSING ROAD NOISE C P 24D .8 ROTATE AND BALANCE FOUR TIRES	CUSTOMER STATES VIBRATION HWY SPEEDS 50 MPH ELECTRONIC BALANCE AND ROTATE 4 WHEELS
2006	1FAFP53U26A	7-Mar-06	21-Mar-06	NORTH P	42973902	5K01	*	1007	*	A99	82	0799D	3-Jul-07	16	44829	0	54.95	65.89	0	6033	AND WHEELS NVH DIAG AND BALANCE	ROTATE 4 WHEELS VIBRATION AT HIGHWAY SPEEDS
2006	1FAFP53UX6	29-Nov-05	14-Dec-05	NORTHLA	4047803	5K01	*	1007	*	A99	82	0799D	24-Aug-07	21	49570	0	74.57	79.04	0	10638	ALL FOUR TIRES VERIFIED, THERE IS A SLASH IN THE INSIDE SIDE WALL NEED TO REPLACE THE THE TIRE...	
2006	1FAFP53U76A	18-Nov-05	3-Dec-05	THE FOR	214721	5K01	*	1007	*	A99	82	0799D	25-Jun-07	19	30406	81.38	0	88.07	0	4240	REPLACED AND BALCENCED TIRE. COMPLETED 4 WHEEL ALIGNMENT	LEFT REAR HAS A FLAT TIRE. PERFORM 4 WHEEL ALIGNMENT
2006	2FMZA51656B	23-Dec-05	13-Jan-06	FUTURE F	100941D	5K01	*	1007	*	A99	82	0799D	23-Jul-07	19	35506	0	99.95	99.95	0	4058	33238 MOUNT AND BALANCE 1 TIRE LEFT FRONT TIRE	MOUNT AND BALANCE 1 TIRE, THE LEFT FRONT IS
2006	1FAFP53U56A	23-Nov-05	8-Dec-05	COURTES	308460D	5K01	*	1007	*	A99	82	0799D	26-Jun-07	19	33238	79.95	15	104.22	0	1625	SEPARATED. OTHER IS DISPOSAL FEE ON TIRE. REPLACED TIRE BALANCED AND	SEPERATED CUSTOMER REQUESTING TIRE REPLACEMENT
2006	1FAFP53U56A	2-Dec-05	23-Dec-05	DON CHAI	3805524	5K01	*	1015	*	A99	82	0799D	6-Jun-07	18	13977	92.4	26.39	118.79	0	1487	MOUNTED MOUNT AND BALANCE	MOUNT BALANCE ONE TIRE
2005	1FAFP53U35A	21-Mar-05	6-Apr-05	WORLD F	079407I	5K01	*	1007	*	A99	82	0799D	27-Jul-07	29	33850	96.2	14.28	118.84	0	4962	ONE TIRE	
2006	1FAFP53U66A	1-Dec-05	16-Dec-05	TED BRIT	61233902	5K01	*	1007	*	A99	82	0799D	8-Aug-07	21	27623	92	29.03	121.03	0	48	REPLACED TIRE MOUNT AND BALANCED. MOUNT AND BALANCE ONE NEW TIRE RT FRT	CUST HAS FLAT TIRE SPARE ON DRIVERS REAR
2007	1FMJU03137K	11-Dec-06	18-Dec-06	RUSS MIL	444651	5K01	*	1007	*	A99	82	0799D	23-Jul-07	8	9156	0	116.95	123.24	0	2890	HAD NAIL IN IT	TIRES ARE LOW

2007	2LMDU88CX7B	8-Feb-07	9-Feb-07	KRUG HIL	1853902	5K01 *	1007 *	A99	82 0799D	18-Jul-07	6	24035	0	124.81	124.81	0	1758	1.5 PERFORMED ROAD FORCE DIAG AND TIRE BALANCE. SPECS; LF 2 LBS, RF 6, LR 13, RR 6, MAX SPEC 26 LBS. ROAD FORCE OK, TIRES OUT OF BALANCE. BALANCED ALL 4 TIRES. 5562	VIBRATION AT 60 MPH	
2006	1FAFP53U06A	2-Dec-05	6-Jan-06	SANTA M/	359956A	5K02 F42Z	1700 A	A99	82 0799D	11-Jul-07	19	25546	97.18	31.8	136.72	0	1597	25546 030 INSPECT TIRE VERIFY CONCERN UNABLE TO REPAIR TIRE REC. 1 TIRE REPLACED 1 TIRE MOUNTED & BALANCED TIRE SET TIRE PRESSURE REPLACED VALVE STEM SEAL OLD DOT CODE # ACX8 44P 4605 X 1 NEW DOT C 12742 MOUNTED AND BALANCED ONE TIRE OLD DOT CODE A3VD 46PD 4006 NEW DOT CODE A3VD 46PD 4506	ODE # A3X8 3PE 4206 X 1 FLAG 428	REPAIR FLAT TIRE
2007	2FMDK49C57E	12-Dec-06	16-Dec-06	CRESTM	154284A	5K01 *	1007 *	A99	82 0799D	3-Jul-07	7	12742	120.4	15.95	144.53	0	4369	MOUNT AND BALANCE 1 TIRE \$15.95		
2006	1FMEU75E26U	30-Jan-06	21-Feb-06	ALBUQUE	12203701	5K01 *	1007 *	A99	82 0799D	17-Aug-07	19	46041	121.46	28.23	158.67	0	10140	HOLE IN TIRE NON REPAIRABLE REPLACED RR TIRE AND BALANCED ALL TIRES SET TO 35 PSI FLEET REQUESTS CARE PERFORM REPAIRS PER FLEET CARE	CHECK AND REPLACE RT REAR TIRE IT CONTINUES TO LEAK AIR SEE JESSIE FOR NEW TIRE CHECK AIR PRESSURE I	
2006	2FMZA51666B	23-Nov-05	9-Dec-05	HEALEY F	17142901	5K01 *	1007 *	A99	82 0799D	11-Jul-07	20	27823	0	159.36	168.92	0	3615	FLEET CARE REQUIRED		
2006	1FTPW12V66F	3-May-06	19-May-06	JOE MYEF	559193B	5K01 *	1007 *	A99	82 0799D	13-Jul-07	15	32494	133.95	27.5	172.5	0	4402	32494 CP () R&R SPARE TIRE.BREAK DOWN SPARE & MOUNT ON RR WHEEL.BALANCE RR WHEEL.MOUNT NEW TIRE ON SPARE WHEEL & REPLACE UNDER VEHICLE.	MOUNT AND BALANCE ONE TIRE	
2006	1FAHP34N06W	5-Dec-05	21-Dec-05	EVERGRE	32694702	5K01 *	1007 *	A99	82 0799D	23-Aug-07	21	30493	0	149.99	191.34	1.7	8305	INSTALL TEST EQUIP RD TEST TIRE SHAKE RETURN TO SHOP 3 CHECK TIRE RUNOUT OK REBALANCE ALL TIRES THANK YOU TODD	VEHICLE VIBRATES AS DRIVE 60 70 MPH	
2006	2FMZA51666B	24-Nov-05	16-Dec-05	THE FORI	2227303	5K01 *	1007 *	A99	82 0799D	27-Jul-07	20	37095	131.72	56.16	198.75	0	4240	THE PUNCHER IS TO CLOSE TO THE EDGE NEED NEW TIRE. REPLACED THE TIRE PER CUSTOMERS REQUEST.	THE REAR RIG HAS A FLAT.	

2007 4M2EU488X7U	22-Jun-07	29-Jun-07	ED MULLII267830A	5K01 *	1007 *	A99	82 0799D	9-Aug-07	2	1018	195.95	12.95	208.9	0	2283	1018 REPLACE AND BALANCE R R TIRES, HAS NAIL IN OUTER SIDE WALL. 1 MOUNTED AND BALANCED NEW LEFT FRONT AND LEFT REAR TIRES QUALITY FLEET CARE REPLACE TWO TIRES CUPPED	CHECK NAIL IN SIDEWALL OF R R TIRE. QUALITY FLEET CARE SERVICE BOTH LEFT SIDE TIRES NEED TO BE REPLACED PER CUSTOMER REQUEST
2007 1FAFP53U57A	17-Aug-06	18-Sep-06	PHIL LON78350201	5K01 *	1007 *	A99	82 0799D	9-Aug-07	11	27000	170.86	42.28	213.14	0	3140		
2006 1FAFP53UX6A	29-Nov-05	14-Dec-05	NORTHLA 3928201	5K01 *	1007 *	A99	82 0799D	13-Jul-07	20	43929	167.9	37.28	216.18	0	10638		
2006 2FMZA516X6E	6-Dec-05	28-Dec-05	PHIL LON78445701	5K01 *	1007 *	B65	1 0799D	20-Aug-07	21	39089	209.64	12	221.64	0	3140	INSPECT UNABLE TO REPAIR REPLACED NEW RIM QUALITY FLEET CARE	NEED RIM TO REPLACE DAMAGE ONE IN THE TRUNK
2007 1FAHP24177G	1-Dec-06	19-Dec-06	JOE MYEF561191A	5K01 *	1007 *	A99	82 0799D	3-Aug-07	8	40022	216.9	10	244.8	0	4402	40022 CP \$5 REPLACE LR TIRE	CK CUSTOMER STATES THAT LEFT REAR TIRE BLOW OUT WHEN DRIVINGF
2006 1FAFP53U86A	21-Nov-05	7-Dec-05	SAWGRA64753202	5K01 *	1007 *	N22	42 0799D	8-Jun-07	19	22024	79.08	162.62	257.28	0	4908	TECH 48544 2.0 HR VERIFY CONCERN ROAD FORCED ALL TIRES INDEX TIRES 1 TIRE UNABLE TO INDEX MOUNTED 1 NEW TIRE MOUNTED INDEX BALANCED ALL TIRES VERIFY REPAIR REPLACE L FRONT TIRE,WHEEL & HUB CAP & REMOUNT SPAIR .5 HR.	CUSTOMER STATES VEHICLE VIBRATES AT SPEEDS OVER 50MPH ESP QUALITY FLEET REPLACE RIM, TIRE AND HUBCAP IN TRUNK
2006 1FAFP53U96A1	23-Nov-05	8-Dec-05	TED BRIT60640801	5K01 YF1Z	1007 FA	A99	82 0799D	25-Jun-07	19	59050	201.31	48.38	259.76	0	48		
2007 1FDXE45S37D	23-Jan-07	5-Jun-07	MCNELLY 181700A	5K01 *	1007 *	C50	30 0799D	10-Jul-07	2	4776	204.4	33.82	261.45	0	5733	REPLACED LR TIRE CP: 1015	MOUNT AND BALANCE ONE NEW TIRE
2007 1FMEU74857U	13-Feb-07	19-Feb-07	KINGS FO 2486803	5K01 *	1015 *	A99	82 0799D	8-Aug-07	6	14160	232.89	22.59	270.81	0	1970	0.4 REPLACED TIRE AND TRAINED TIRES	RIGHT REAR TIRE BLOWN





2006	1FAFP53U46A	17-Jan-06	1-Feb-06	OASIS FO	1625851	5K01 *	1007 *	A99	82 0799D	15-Aug-07	19	28245	167	137.85	304.85	0	3604	REPLACE, MOUNT AND BALANCE TWO TIRES AND PERFORM FRONT END ALIGNMENT RR WHEEL SLOOSE. INSPECT AND FOUND RR WHEEL HAS COME LOOSE RUINING ALL THE LUG NUTS,LUG STUDS AND WHEEL. MOUNT AND BALANCE 1 WHEEL.REPLACE LUG NUT	C/S FRONT END SHAKES ALOT WHILE DRIVING
2005	1FTRF12245N	16-Mar-05	31-Mar-05	DICK EDM	359612A	5K01 4L3Z	1015 CA	A99	82 0799D	30-Jul-07	29	54303	180.27	74	352.14	0	5205	CP:1007 MENU MOUNTED AND BALANCED 2 TIRES DOT AP8T TY81 1007 (2806)	CUSTOMER STATES RIGHT REAR IS LOOSE. MOUNT AND BALANCE TIRE(S) SUPERDUTY E/F STANDARDADD TIRE TAX FOR EACH TIRE
2006	1FMEU75816UE	2-Mar-06	7-Mar-06	BEACH FC	9574209	5K01 *	1007 *	H62	42 0799D	23-Jul-07	17	35355	340.08	37.2	377.28	0	6727	35449 060 REPLACED 2 TIRES MOUNTED & BALANCED TIRES SET TIRE PRESSURE REPLACED VALVE STEM SEALS OLD DOT CODES # B37P JE7X 4505 X 2 NEW DOT CODES # B37P PA7X 1307 X 1 # B37P PA7X 3706 X 1 FLAG 428	REPLACE 2 FRONT TIRES WITH MICHELIN CROSS TERRAIN 235 70R16, PER QFC BILLING
2006	1FMEU73E46U	5-Dec-05	6-Jan-06	SANTA M/	359244C	5K02 F42Z	1700 A	A99	82 0799D	28-Jun-07	18	35449	339.92	30	396.5	0	1597	MOUNT & BALANCE 1 TIRE & WHEEL 36806 1.0 REPALCED FOUR TIRES	C S REPAIR FLAT TIRE IN TRUNK OF VEH GOES TO FRONT RIGHT SIDE CK ANDADVISE TIRES ON FRONT ARE BALD ON EDGE MOUNT AND BALANCE 4 TIRES BFG LONGTRAIL T A \$105.95 EACH P235 70 R16
2007	1FAFP53U87A	5-Sep-06	28-Dec-06	HARRELS	7408151	5K01 YF1Z	1007 FA	A99	82 0799D	25-Jul-07	7	7732	146.08	260.07	415.52	0	1071	COMPLETED ALL FOUR TIRES AND BALANCED	REPLACE ALL FOUR TIRES HOWLING TYPE NOISE AT FREEWAY SPEEDS SEE ADVISOR 1ST \$439.80
2006	1FAFP36NX6W	9-Dec-05	28-Dec-05	FORT MILI	117336A	5K01 *	1007 *	A99	82 0799D	9-Jul-07	19	36806	343.8	56.05	420.48	0	1015	MOUNT AND BALANCE TIRES	TIRES IN NEED OF REPLACEMENT 235 70R 16 CONTINENTALS TIRES PE08-060 1563
2006	1FMEU73E26U	7-Dec-05	28-Dec-05	RANCHO I	47792604	5K01 *	1007 *	A99	82 0799D	18-Aug-07	20	60481	374.2	60	434.2	0	5432		
2006	1FMEU73E76Z	20-Dec-05	4-Jan-06	BLUEBON	47184205	5K01 *	1007 *	B65	42 0799D	26-Jun-07	18	64121	361.86	40	438.76	0	4570		
2006	1FMU93116K	3-Nov-05	12-Dec-05	FOLSOM I	51934403	5K01 *	1007 *	A99	82 0799D	30-Jul-07	20	28640	0	439.81	439.81	0	7727	REPLACED TIRES	
2006	1FMEU73E66ZA	20-Dec-05	10-Jan-06	FOLSOM I	51948203	5K01 *	1007 *	A99	82 0799D	31-Jul-07	19	40856	0	440	440	0	7727	WORN OR DAMAGED REPLACED 4 TIRES 440.00	

Year	Plate	Reg Date	Ins Date	Ins Co	Ins No	Ins Class	Ins Code	Ins Desc	Ins Val	Ins Type	Ins Amt	Ins Tax	Ins Fee	Ins Total	Ins Status	Ins Description	Ins Notes		
2007	2FMDK49C57E	12-Mar-07	10-Apr-07	MULLAHE	18032907	5K01	7L2Z	1007 E B65 42 0799D	23-Jul-07	4	10569	421.9	25.73	480.33	0	7944	MOUNT & BALANCED ONE TIRE.	MOUNT & BALANCE ONE TIRE & WHEEL (DAMAGED)	
																	104524 120 REPLACED ALL 4 TIRES MOUNTED & BALANCED TIRES SET TIRE PRESSURE REPLACED VALVE STEM SEALS OLD DOT CODES # B37P DH8X 0503 X 3 # B37P DH8X 3403 X 1 NEW DOT CODES # A308 46KW	8 46KW 1407 X 1 # A308 46KW 4506 X 1	
2003	1FMZU63K83Z	18-Feb-03	5-Mar-03	SANTA M/	358122D	5K02	F42Z	1700 A A99 30 0799D	7-Jun-07	52	104524	441.68	127.2	488.68	0	1597	4706 X 2 # A30	TIRE1 REPLACE ONE TIRE TO INCLUDE NEW STEM SEAL AND MOUNT AND BALANCE REPLACE THREE (3) TIRES MOUNT AND BALANCE	
2006	1FMEU73E26U	6-Dec-05	22-Dec-05	APPLE FC	48745302	5K01	*	1007 * A99 82 0799D	31-Aug-07	21	26598	405.87	97.28	509.91	0	84	A99 82 1007 COMPLETED 5133 REPLACED TIRE, WHEEL, PRESSURE SENSOR AND WHEEL STRAP. TRAINED TIRE PRESSURE SENSORS.	CUST STATES RT REAR TIRE HAS BUBBLE IN SIDEWALL HIT POTHOLE	
2007	1ZVHT85H1753	31-Jan-07	8-Feb-07	LIBERTY F	197175A	5K01	6R3Z	1007 H A99 82 0799D	31-Jul-07	6	5133	495.45	42.64	538.09	0.5	2222			
2006	1FMEU73E06U	7-Dec-05	22-Dec-05	DONLEY F	30333701	5K01	*	1015 * A99 82 0799D	27-Jun-07	19	50593	541.16	32	573.16	0	3383	DONE AUTH# RMSA	CUST STATES MOUNT AND BALANCE 4 TIRES C R ESTIMATE TO REPLACE 2 FRONT TIRES APPROVAL HENCUR07232014 MOUNT AND BAL 4 TIRES P22560R16 97S MICH. SYM BLACK DF 6 DR 5 1 2 PF 3 PR 4 4 NEW TIRES MICHELIN CROSS TERRAIN 235 70R16 ROTATE AND BALANCE 4 WHEELS C S GET PRICES FOR NEW TIRES AND GET TREAD MEASUREMENTS. HEWLETT PACKARD. TIRE4 REPLACE ALL FOUR TIRES TO INCLUDE NEW STEM SEALS AND MOUNT AND BALANCE	
2006	1FAFP27116G1	24-Apr-06	10-May-06	SAWGRA	65564202	5K01	*	1007 * H62 42 0799D	20-Aug-07	16	33699	487.2	81.31	597.75	0	4908	1 QUALITY FLEET CARE MOUNT AND BALANCE 4 TIRES 1.0		
2006	2FMZA51656B	12-Dec-05	28-Dec-05	COURTES	7045301	5K01	*	1007 * A99 82 0799D	19-Jun-07	18	63330	528.56	87.68	616.24	0	6743	REF NUMBER TRPC MOUNTED AND BALANCED 4 TIRES		
2006	1FMEU73E96U	7-Dec-05	31-Dec-05	PHIL LON	77939901	5K01	*	1007 * A99 82 0799D	22-Jun-07	18	20799	607.8	48	655.8	0	3140	REPLACED 4 TIRES QUALITY FLEET CARE A99 82 1007 REPLACED ALL 4 TIRES.		
2006	1FMEU73E76U	1-Dec-05	16-Dec-05	APPLE FC	48577102	5K01	*	1007 * A99 82 0799D	14-Aug-07	21	21924	541.16	121.61	669.53	0	84			
2006	1FMEU73E06U	7-Dec-05	23-Dec-05	APPLE FC	48732702	5K01	*	1007 * A99 82 0799D	30-Aug-07	21	43184	645.61	162.14	818.04	0	84	A99 82 1007 REPLACED ALL 4 TIRES AND PUT NEW BAND SENSOR ON		
2006	1FMEU73E16Z	12-Dec-05	29-Dec-05	SANTA M/	361152C	5K02	F42Z	1700 A A99 82 0799D	3-Aug-07	20	34997	735.85	127.2	920.91	0	1597	34997 120 FLAG 125 1.2 REPLACED 4 TIRES MOUNT AND BALANCE		
2003	2FAFP71W83X	17-Jul-02	15-Aug-02	WALNUT	(538416A	5K01	5W7Z	1007 AA B66 D9 07S48	12-Jul-07	60	17538	70.9	0	70.9	0	7820	1	OVER THE COUNTER PART INV#537802 07 05 07	OVER THE COUNTER PART INV537802 DATE 07 05 07 MILES 1
2004	2FAFP71W34X	2-Sep-03	16-Feb-04	WALNUT	(538415A	5K01	5W7Z	1007 AA B66 D9 07S48	12-Jul-07	42	59692	70.9	0	70.9	0	7820	OVER THE COUNTER PART 537926 07 09 07 1	OVER THE COUNTER PART 537926 07 09 07 1 MILES 1	

2003	2FAFP71W03X	6-May-02	8-Aug-02	WALNUT (542656A	5K01	5W7Z	1007	AA	B66	D8	07S48	30-Aug-07	62	92073	69.85	34.76	104.61	0.3	7820	92073 INSPECTED AND VERIFY CONCERN W94 FOUND RIM LEAKING INSIDE AT SEAM OF RIM REMOVED AND REPLACED RIM RECHECK FOR LEAKS ALL OK	CUST STATES TIRE IS LEAKING POSSIBLE BAD RIM	
2003	2FAFP71W53X	3-Feb-03	13-Feb-03	BUTCH OL 157812A	5K01	5W7Z	1007	AA	N23	13	07S48	19-Jun-07	53	66043	139.7	37.57	177.27	0.5	6422	66622 INPSECTED ALL RIMS AND FOUND FRONT RIMS TO BE WARPED. ORDERED AND REPLACED FRONT RIMS APP CODE WBBHS INSPEC FIVE WHEEL RIMS, FOUND NO DEFECTIVE WHEELS	CHECK SHIMMY AT INTERSTATE SPEEDS,CUSTOMER WAS TOLD BY OTHER REPAIR FACILITY RIMS LOOK TO BE WARPED	
2005	2FAFP71W85X	26-May-05	28-Sep-05	JORGENS	951102	5K01	*	*	*	*	*	29B01	29-Aug-07	24	20456	0	34.25	34.25	0.4	3523	29B01B APP CODE WBBKZ INSPEC FIVE WHEEL RIMS INSPEC OK	PERFORM RECALL PER INSTRUCTIONS 29B01B
2005	2FAFP71W65X	26-May-05	12-Oct-05	JORGENS	928602	5K01	*	*	*	*	*	29B01	22-Aug-07	23	15993	0	34.25	34.25	0.4	3523	29B01B APP CODE WBBKZ INSPEC FIVE WHEEL RIMS INSPEC OK	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	26-May-05	12-Oct-05	JORGENS	877801	5K01	*	*	*	*	*	29B01	8-Aug-07	23	18055	0	34.25	34.25	0.4	3523	29B04B APP CODE WBBJX RECALL PERFORMED 0 WHEELS AFFECTED	PERFORM WHEEL RECALL
2005	2FAHP71W05X	23-Jun-05	25-Apr-06	FIESTA FC	3948951	5K01	*	*	*	*	*	29B01	7-Aug-07	16	31833	68.21	56.92	125.13	0.7	5439	0 CHECK WHEELS REPLACE 1 WHEEL PER RECALL AND ROD TE 29B01C APP CODE WBBGN INSP & REPLACE 1 WHEEL	RECALL 07S28 POLICE INTERCEPTER WHEEL INSPECTION ***APPR CODE (WBBSX)*** PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	26-May-05	31-Aug-05	JORGENS	926702	5K01	*	*	*	*	*	29B01	22-Aug-07	25	54558	69.85	59.93	129.78	0.7	3523	29B01C OK CODE WBBVS INSPECT ALL WHEELS NECESSARY TO REPLACE 1 FOR PROGRAM 29B01 29B01C APP CODE WBBPN INSPECT 5 WHEELS NECESSARY TO REPLACE 1 WHEEL	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	27-May-05	11-Aug-05	JORGENS	879001	5K01	*	*	*	*	*	29B01	8-Aug-07	25	45700	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBB3U INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE ONE WHEEL RIM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X1	26-May-05	12-Oct-05	JORGENS	928502	5K01	*	*	*	*	*	29B01	22-Aug-07	23	13064	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBB3U INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE ONE WHEEL RIM	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	26-May-05	6-Oct-05	JORGENS	935702	5K01	*	*	*	*	*	29B01	24-Aug-07	23	48501	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBBJZ RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	25-May-05	15-Aug-05	JORGENS	937502	5K01	*	*	*	*	*	29B01	24-Aug-07	25	64214	69.85	59.93	129.78	0.7	3523	29B01C APP CODE WBBJZ RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS

2005	2FAFP71W25X	26-May-05	9-Sep-05	JORGENS	851201	5K01	*	*	*	*	*	29B01	1-Aug-07	24	80030	69.85	59.93	129.78	0.7	3523	29B01 INSPECT FIVE WHEEL RIM, REPLACE, BALANCE ONE WHEEL RIM	PERFORM WHEEL INSPECTION RECALL 29B01 FORD RECALL 29B01 RECALL WHEELS
2005	2FAFP71W35X	28-Feb-05	5-Apr-05	CLINTON	3680501	5K01	*	*	*	*	*	29B01	13-Jun-07	27	27523	136.42	75.41	211.83	1	1142	MOUNT AND BALANCED 2 WHEELS AUTH #WBB1U REPLACED 2 WHEELS. MOUNT & BALANCED 2 R S TIRES	RECALL 07S48 29B01 RIMS RECALL 07S48 CHUCK MUST CALL FORD BEFORE PUTTING ON RIMS S R 07S48:S#1 C 2003 2005 M Y C V P INTERCEPTOR CVPI VEHICLES 16 INCH WHEEL REPLACEMENT RECALL RIMS, CB MUST CALL FORD BEFORE INSTALLING RIMS NEED TO KNOW HOW MANY
2005	2FAHP71W85X	2-May-05	6-Jul-05	NEW HOL	43939001	5K01	*	*	*	*	*	29B01	14-Jun-07	24	98790	139.7	75.11	214.81	1	1360	RECALL 34 STEEL WHEEL	RECALL 07S48 29B01 RIMS RECALL 07S48 CHUCK MUST CALL FORD BEFORE PUTTING ON RIMS S R 07S48:S#1 C 2003 2005 M Y C V P INTERCEPTOR CVPI VEHICLES 16 INCH WHEEL REPLACEMENT RECALL RIMS, CB MUST CALL FORD BEFORE INSTALLING RIMS NEED TO KNOW HOW MANY
2005	2FAFP71W05X	2-May-05	25-May-05	NORRIS F	9122850	5K01	*	*	*	*	*	29B01	10-Jul-07	26	63960	136.42	79.74	216.16	1	34	INSPECTED AND REPLACED 2 WHEELS PER 29B01 PRIOR AUTH WBBWW	RECALL 34 STEEL WHEEL 29B01D APP CODE WBBYV INSPECT 5 WHEELS NECESSARY TO REPLACE 2 PER PROGRAM 29B01 29B01D APP CODE WBBLZ INSP & REPLACE 2 WHEELS 29B01D APP CODE WBB9N INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBQT INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBFR INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBB8T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS
2005	2FAFP71W75X	27-Jan-05	24-Feb-05	NEW COU	234961C	5K01	*	*	*	*	*	29B01	7-Jun-07	28	53660	139.7	78	217.7	1	20551	RECALL 34 STEEL WHEEL 29B01D APP CODE WBBYV INSPECT 5 WHEELS NECESSARY TO REPLACE 2 PER PROGRAM 29B01 29B01D APP CODE WBBLZ INSP & REPLACE 2 WHEELS 29B01D APP CODE WBB9N INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBQT INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBFR INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBB8T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W25X	3-May-05	1-Jun-05	NORRIS F	9117650	5K01	*	*	*	*	*	29B01	9-Jul-07	26	68859	139.7	79.74	219.44	1	34	RECALL 34 STEEL WHEEL 29B01D APP CODE WBBYV INSPECT 5 WHEELS NECESSARY TO REPLACE 2 PER PROGRAM 29B01 29B01D APP CODE WBBLZ INSP & REPLACE 2 WHEELS 29B01D APP CODE WBB9N INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBQT INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBBFR INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 29B01D APP CODE WBB8T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71WX5X	26-May-05	12-Oct-05	JORGENS	911401	5K01	*	*	*	*	*	29B01	17-Aug-07	23	36731	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71WX5X	26-May-05	29-Jul-05	JORGENS	955702	5K01	*	*	*	*	*	29B01	30-Aug-07	26	34613	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	26-May-05	31-Aug-05	JORGENS	916702	5K01	*	*	*	*	*	29B01	20-Aug-07	24	49088	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X	27-May-05	1-Sep-05	JORGENS	921002	5K01	*	*	*	*	*	29B01	21-Aug-07	24	51108	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	27-May-05	31-Aug-05	JORGENS	916902	5K01	*	*	*	*	*	29B01	20-Aug-07	24	55921	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	26-May-05	19-Aug-05	JORGENS	931502	5K01	*	*	*	*	*	29B01	23-Aug-07	25	57190	139.7	85.62	225.32	1	3523	PERFORM RECALL PER INSTRUCTIONS WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS

2005	2FAFP71W35X	26-May-05	31-Aug-05	JORGENS	907201	5K01	*	*	*	*	29B01	16-Aug-07	24	54386	139.7	85.62	225.32	1	3523	29B01D APP CODE WBB9T INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE TWO WHEEL RIMS 1 INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W25X	26-May-05	5-Oct-05	JORGENS	850801	5K01	*	*	*	*	29B01	1-Aug-07	23	27274	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBWS INSPECT 5 WHEELS NECESSARY TO REPLACE MOUNT AND BALANCE 2 AFFECTED WHEELS PER PROGRAM	PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005	2FAFP71W15X	27-May-05	31-Aug-05	JORGENS	959701	5K01	*	*	*	*	29B01	31-Aug-07	25	67521	139.7	85.62	225.32	1	3523	29B01 29B01D APP CODE WBBBU INSPEC FIVE WHEEL RIMS,REPLACE, BALANCE AND DISABLE	WHEEL RECALL.
2005	2FAFP71W05X	27-May-05	23-Aug-05	JORGENS	923502	5K01	*	*	*	*	29B01	21-Aug-07	25	45434	139.7	85.62	225.32	1	3523	TWO WHEEL RIMS  1 INSPECTED ALL WHEELS.REPLACED 2 WHEELS PER RECALL.	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS RECALL 07S48 WHEEL INSPECTION
2005	2FAFP71W05X1	26-May-05	11-Aug-05	JORGENS	850601	5K01	*	*	*	*	29B01	1-Aug-07	25	42271	139.7	85.62	225.32	1	3523	29B01D APP CODE WBBZN RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	25-May-05	17-Aug-05	JORGENS	882701	5K01	*	*	*	*	29B01	9-Aug-07	25	40729	139.7	85.62	225.32	1	3523	REPLACE TWO WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBRU REPLACE TWO WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBYU ...	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71WX5X	19-Apr-05	6-Oct-05	JOE MACI	51146401	5K01	*	*	*	*	29B01	17-Jul-07	22	54007	139.7	85.86	225.56	1	8006	...	RECALL 07S48 FORD PROGRAM 29B01 RECALL 07S48/29B01 WHEELS
2005	2FAHP71W75X	31-Jan-05	28-Feb-05	JOE MACI	50785401	5K01	*	*	*	*	29B01	14-Jun-07	28	54694	139.7	85.86	225.56	1	8006	LEFT FRONT TIRE HAS EXECIVE ROAD FORCENEED TIRES REMOVE AND REPLACE 3 WHEELS RECALL	NEED TO CALL IN FOR AUTH REF TO 29B07 AUTH #WBBGW FOR 302.20 1.2 LABOR HOURS CUST REQUESTS RECALL 07S48/29B01 WHEELS
2005	2FAFP71W15X	16-Feb-05	9-Mar-05	CLINTON	3686001	5K01	*	*	*	*	29B01	15-Jun-07	28	26200	204.62	90.49	295.11	1.2	1142	RECALL COMPLETED	STEEL WHEEL RECALL CHECK ONE IN TRUNK DONT PUT NEW VALVE STEM PER CUSTOMER
2005	2FAHP71WX5X	29-Apr-05	9-Aug-05	FIESTA FC	3835751	5K01	*	*	*	*	29B01	25-Jul-07	24	91586	204.62	97.57	302.19	1.2	5439	...	NEED TO CALL IN FOR AUTH REF TO 29B07 AUTH #WBBGW FOR 302.20 1.2 LABOR HOURS CUST REQUESTS RECALL 07S48/29B01 WHEELS
2005	2FAFP71W45X	26-Apr-05	18-May-05	NORRIS F	8978450	5K01	*	*	*	*	29B01	5-Jun-07	25	73465	209.53	95.69	305.22	1.2	34	STEEL WHEEL	RECALL 07S48/29B01 WHEELS

2005	2FAFP71W95X	26-May-05	12-Oct-05	JORGENS	906602	5K01	*	*	*	*	*	29B01	16-Aug-07	23	56466	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBWU INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W85X	26-May-05	23-Aug-05	JORGENS	941202	5K01	*	*	*	*	*	29B01	27-Aug-07	25	65218	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBSX RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W85X	25-May-05	29-Jul-05	JORGENS	920802	5K01	*	*	*	*	*	29B01	21-Aug-07	26	44261	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBBS INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W85X	26-May-05	17-Aug-05	JORGENS	907502	5K01	*	*	*	*	*	29B01	16-Aug-07	25	62956	209.53	102.74	312.27	1.2	3523	INSPECT WHEELS FOUND 3 WHEELS NEED REPLACE MOUNT AND BALANCE 3 WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W75X	27-May-05	31-Aug-05	JORGENS	917302	5K01	*	*	*	*	*	29B01	20-Aug-07	24	67130	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBBZ INSP & REPLACE 3 WHEELS. DISMOUNT & REMOUNT & BALANCE.	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W75X	26-May-05	23-Sep-05	JORGENS	900201	5K01	*	*	*	*	*	29B01	14-Aug-07	24	34369	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBSR INSPECT 5 WHEELS PER PROGRAM NECESSARY TO REPLACE 3 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W65X	26-May-05	19-Aug-05	JORGENS	932901	5K01	*	*	*	*	*	29B01	23-Aug-07	25	25000	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB8S INSPECT 5 WHEELS NECESSAY TO REPLACE MOUNT AND BALANCE 3	PERFORM RECALL PER INSTRUCTIONS WHEEL RECALL
2005	2FAFP71W65X	26-May-05	5-Oct-05	JORGENS	954301	5K01	*	*	*	*	*	29B01	30-Aug-07	24	11815	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBGN INSPECT NECESSARY TO REPLACE 3 AFFECTED WHEELS PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X	25-May-05	15-Aug-05	JORGENS	894802	5K01	*	*	*	*	*	29B01	13-Aug-07	25	47085	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBMV INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	26-May-05	3-Aug-05	JORGENS	902302	5K01	*	*	*	*	*	29B01	15-Aug-07	25	52126	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBPV INSPEC FIVE WHEEL RIMS REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	25-May-05	3-Aug-05	JORGENS	926101	5K01	*	*	*	*	*	29B01	22-Aug-07	25	54779	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBEU INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS

2005	2FAFP71W35X	26-May-05	18-Aug-05	JORGENS	883501	5K01	*	*	*	*	*	29B01	9-Aug-07	25	69734	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB1W INSPECT FIVE WHEEL RIMS, REPLACE BALANCE AND DISABLE THREE WHEEL RIMS 29B01E APP CODE WBBRU INSPEC FIVE WHEEL RIMS,REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS 29B01E APP CODE WBBRU RECALL PERFORMED	PERFORM WHEEL INSPECTON PER PROGRAM 07S48
2005	2FAFP71W35X	27-May-05	1-Sep-05	JORGENS	916002	5K01	*	*	*	*	*	29B01	20-Aug-07	24	65778	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBXX INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS 29B01E APP CODE WBB8R INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01 REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBZS	PERFORM RECALL PER INSTRUCTIONS WHEELS PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W35X	26-May-05	29-Sep-05	JORGENS	946202	5K01	*	*	*	*	*	29B01	28-Aug-07	24	18095	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBBXX INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE THREE WHEEL RIMS 29B01E APP CODE WBB8R INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01 REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBZS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W15X	25-May-05	17-Aug-05	JORGENS	915202	5K01	*	*	*	*	*	29B01	20-Aug-07	25	60319	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB8R INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01 REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBZS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	26-May-05	23-Aug-05	JORGENS	903702	5K01	*	*	*	*	*	29B01	15-Aug-07	25	36097	209.53	102.74	312.27	1.2	3523	29B01E APP CODE WBB8R INSPECT 5 WHEELS NECESSARY TO REPLACE 3 PER PROGRAM 29B01 REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBZS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2004	2FAFP71W14X	11-Feb-04	11-Jan-05	JOE MACI	51090001	5K01	*	*	*	*	*	29B01	12-Jul-07	31	54134	209.53	103.03	312.56	1.2	8006	... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBKZ	CUSTOMER STATES PERFORM RECALL 29B01
2005	2FAHP71WX5X	16-Dec-04	28-Mar-05	JOE MACI	51312001	5K01	*	*	*	*	*	29B01	31-Jul-07	29	54504	209.53	103.03	312.56	1.2	8006	... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBPW	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W75X	18-Apr-05	6-May-05	JOE MACI	51144201	5K01	*	*	*	*	*	29B01	17-Jul-07	27	54599	209.53	103.03	312.56	1.2	8006	... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBDF	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W25X	26-Apr-05	4-Oct-05	JOE MACI	51674001	5K01	*	*	*	*	*	29B01	29-Aug-07	24	53809	209.53	103.03	312.56	1.2	8006	... REPLACE THREE WHEELS AND DISABLE OLD WHEELS AS PER FOR DPROGRAM 29B01 APPROVAL CODE WBBYZ	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W05X	19-Apr-05	3-Jun-05	JOE MACI	51394001	5K01	*	*	*	*	*	29B01	7-Aug-07	27	54545	209.53	103.03	312.56	1.2	8006	...	RECALL 07S48 FORD PROGRAM 29B01 PE08-060 1569

2005	2FAFP71W35X	26-May-05	28-Sep-05	JORGENS	878901	5K01	*	*	*	*	*	29B01	8-Aug-07	23	55084	209.53	119.87	329.4	1.4	3523	29B01F CODE WBBEX REPLACE 3 WHEELS PER PROGRAM 29B01 29B01F APP CODE WBBKT INSPECT NECESSARY TO REPLACE 4 WHEELS PER PROGRAM 29B01	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	27-May-05	5-Oct-05	JORGENS	945902	5K01	*	*	*	*	*	29B01	28-Aug-07	24	3169	279.38	102.74	382.12	1.2	3523	29B01F APPROVAL CODE WBB9X INSPECT ALL 5 WHEELS NECESSARY TO REPLACE 4 PER PROGRAM 29B01 REPLACE FOUR WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBJN	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71WX5X	16-Feb-05	9-Mar-05	CLINTON	30562001	5K01	*	*	*	*	*	29B01	18-Jun-07	28	35483	279.38	105.57	384.95	1.4	1142	COMPLETED RECALL 29B01F APP CODE WBBTN INSPECT 5 WHEELS NECESSARY TO REPLACE MOUNT AND BALANCE 4 AFFECTED WHEELS PER PROGRAM 05S28	WHEEL RECALL 29B01
2005	2FAFP71W65X	27-May-05	27-Sep-05	JORGENS	955302	5K01	*	*	*	*	*	29B01	30-Aug-07	24	17959	279.38	119.87	399.25	1.4	3523	29B01F APPROVAL CODE WBBRX 4 WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W55X	26-May-05	11-Aug-05	JORGENS	881301	5K01	*	*	*	*	*	29B01	9-Aug-07	25	58832	279.38	119.87	399.25	1.4	3523	29B01F APP CODE WBB9X INSPECT ALL 5 WHEELS NECESSARY TO REPLACE 4 PER PROGRAM 29B01 REPLACE FOUR WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBJN	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W25X	26-May-05	28-Sep-05	JORGENS	911102	5K01	*	*	*	*	*	29B01	17-Aug-07	23	52009	279.38	119.87	399.25	1.4	3523	DISMOUNT TIRES ISALL ON NEW WHEELS WITH VALVE STEAMS AND REBALANCE TIRES OLD WHEEL #S R F 5W73 AA BA R R 4W73 1007 BA L F 5W73 AA BA L R 5W73 AA BA SPARE 3W73 1007 CD	PERFORM RECALL PER INSTRUCTIONS
2005	2FAHP71W65X	19-Apr-05	6-Dec-05	JOE MACI	51254301	5K01	*	*	*	*	*	29B01	26-Jul-07	20	35566	279.38	120.2	399.58	1.4	8006	CALL SPECIAL SUPPORT HAS FOUR 12 HOLE WHEELS ANS 1 SEVEN HOLE 2 OF THE 12 HOLE HAD STAMPS OTHER 2 DID NOT PER SPECIAL SUPPORT REPLACE ALL 5 WHEELS AUTH#WBBDU ALVE MOUNT AND BALANCE 5 WHEELS AND REPLACE V S	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W65X	23-Mar-05	13-Apr-05	TAMIAMI F	24191101	5K01	*	*	*	*	*	29B01	17-Jul-07	28	39374	349.23	123.25	472.48	1.6	1286	CALL SPECIAL SUPPORT HAS FOUR 12 HOLE WHEELS ANS 1 SEVEN HOLE 2 OF THE 12 HOLE HAD STAMPS OTHER 2 DID NOT PER SPECIAL SUPPORT REPLACE ALL 5 WHEELS AUTH#WBBDU ALVE MOUNT AND BALANCE 5 WHEELS AND REPLACE V S	29B01 RECALL CALL S.S.C. GAVE CODES ON WHEELS TOLD TO REPLACE ALL 5 WHEEL
2005	2FAHP71W05X	23-Mar-05	11-Apr-05	TAMIAMI F	24107801	5K01	*	*	*	*	*	29B01	6-Jul-07	28	49481	349.23	123.25	472.48	1.6	1286	CALL SPECIAL SUPPORT HAS FOUR 12 HOLE WHEELS ANS 1 SEVEN HOLE 2 OF THE 12 HOLE HAD STAMPS OTHER 2 DID NOT PER SPECIAL SUPPORT REPLACE ALL 5 WHEELS AUTH#WBBDU ALVE MOUNT AND BALANCE 5 WHEELS AND REPLACE V S	29B01 RECALL



2005 2FAHP71W95X	1-Apr-05	20-Apr-05	NORTHSI	133920A	5K01	*	*	*	*	*	29B01	21-Aug-07	29	77012	341.04	135.68	476.72	1.6	8622	COVERAGE, WF CONCERN, FSA07S48 CORRECTION, INSPECT ALL WHEELS TO INCLUDE SPARE , ORDERED 5 REPLACEMENTS PER RESULTS OF INSPECTION. DISSMOUNTED AND MOUNTED TIRES ON NEW RIMS. BALANCED AND	VEHICLE.	RECALL 29B01
2005 2FAFP71W95X	26-May-05	5-Oct-05	JORGENS	899101	5K01	*	*	*	*	*	29B01	14-Aug-07	23	17275	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBJT INSPECT NECESSARY TO REPLACE 5 WHEELS		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W95X	26-May-05	29-Jul-05	JORGENS	921401	5K01	*	*	*	*	*	29B01	21-Aug-07	26	37987	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBFT INSPECT 5 WHEELS NECESSARY TO REPLACE ALL FIVE WHEELS PER PROGRAM		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48 WHEELS REPLACEMENT
2005 2FAFP71W85X	27-May-05	28-Sep-05	JORGENS	882201	5K01	*	*	*	*	*	29B01	9-Aug-07	23	34384	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKV INSPECT REPLACE 5 WHEELS PER PROGRAM 29B01		PERFORM WHEEL INSPECTION RECALL 07S48
2005 2FAFP71W85X	26-May-05	29-Jul-05	JORGENS	889701	5K01	*	*	*	*	*	29B01	10-Aug-07	25	45821	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBFT INSPECT NECESSARY TO REPLACE 5 WHEELS PER PROGRAM 29B01		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W75X	27-May-05	1-Sep-05	JORGENS	955801	5K01	*	*	*	*	*	29B01	30-Aug-07	25	49107	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKS INSPECT NECESSARY TO REPLACE 5 AFFECTED WHEELS PER PROGRAM 29B01		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W75X	26-May-05	14-Sep-05	JORGENS	899201	5K01	*	*	*	*	*	29B01	14-Aug-07	24	18513	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKS INSPECT NECESSARY TO REPLACE 5 WHEELS		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48
2005 2FAFP71W75X	26-May-05	15-Aug-05	JORGENS	851801	5K01	*	*	*	*	*	29B01	1-Aug-07	24	38128	349.23	136.99	486.22	1.6	3523	07S48G INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE FIVE WHEEL RIMS		PERFORM RECALL PER INSTRUCTIONS
2005 2FAFP71W65X	27-May-05	31-Aug-05	JORGENS	882301	5K01	*	*	*	*	*	29B01	9-Aug-07	24	12914	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBYT INSPECT REPALCE 5 WHEELS PER PROGRAM 29B01		PERFORM WHEEL INSPECTION RECALL 07S48
2005 2FAFP71W55X	26-May-05	1-Sep-05	JORGENS	921501	5K01	*	*	*	*	*	29B01	21-Aug-07	24	23991	349.23	136.99	486.22	1.6	3523	29B01G APP CODE WBBKV RECALL PERFORMED		PERFORM RECALL PER INSTRUCTIONS RECALL 07S48 WHEEL REPLACEMENT

2005	2FAFP71W55X	25-May-05	15-Aug-05	JORGENS	845901	5K01	*	*	*	*	*	29B01	31-Jul-07	24	57900	349.23	136.99	486.22	1.6	3523	1 INSPEC FIVE WHEEL RIMS, REPLACE, BALANCE AND DISABLE FIVE WHEELS FIVE WHEEL RIMS	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	26-May-05	12-Oct-05	JORGENS	847801	5K01	*	*	*	*	*	29B01	31-Jul-07	22	59476	349.23	136.99	486.22	1.6	3523	1 INSPECT FIVE WHEELS REPLACE FIVE WHEELS AND BALANCE DISABLE 5 WHEELS	PERFORM RECALL PER INSTRUCTIONS WHEEL PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W45X	26-May-05	5-Oct-05	JORGENS	840301	5K01	*	*	*	*	*	29B01	30-Jul-07	23	27203	349.23	136.99	486.22	1.6	3523	29B01G APP#WBB2X RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEELS
2005	2FAFP71W05X	26-May-05	5-Oct-05	JORGENS	840601	5K01	*	*	*	*	*	29B01	30-Jul-07	23	50060	349.23	136.99	486.22	1.6	3523	29B01G APP#WBBFU RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEEL PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAFP71W05X	26-May-05	5-Oct-05	JORGENS	840401	5K01	*	*	*	*	*	29B01	30-Jul-07	23	29757	349.23	136.99	486.22	1.6	3523	29B01G APP#WBB7V RECALL PERFORMED	PERFORM RECALL PER INSTRUCTIONS WHEEL
2005	2FAHP71WX5X	12-Jan-05	29-Jul-05	JOE MAC†	51071001	5K01	*	*	*	*	*	29B01	10-Jul-07	24	54485	349.23	137.38	486.61	1.6	8006	REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD RPROGRAM 29B01 APPROVAL CODE WBBUV	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W65X	29-Mar-05	14-Apr-05	JOE MAC†	51391401	5K01	*	*	*	*	*	29B01	7-Aug-07	29	54538	349.23	137.38	486.61	1.6	8006	REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBRS	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W65X	14-Dec-04	29-Mar-05	JOE MAC†	51349301	5K01	*	*	*	*	*	29B01	3-Aug-07	29	54601	349.23	137.38	486.61	1.6	8006	REPLACE SIX WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBKU	RECALL 07S48 FORD PROGRAM 29B01
2005	2FAHP71W45X	31-Jan-05	17-Feb-05	JOE MAC†	51048101	5K01	*	*	*	*	*	29B01	9-Jul-07	30	54250	349.23	137.38	486.61	1.6	8006	REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FOR DPROGRAM 29B01 APPROVAL CODES IS WBB9X	FORD RECALL 07S48 PROGRAM 29B01 ...
2005	2FAHP71W15X	16-Dec-04	10-Mar-05	JOE MAC†	50855702	5K01	*	*	*	*	*	29B01	20-Jun-07	28	54356	349.23	137.38	486.61	1.6	8006	REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBFU	RECALL 07S48 FORD PROGRAM 29B01 ...
2005	2FAHP71W05X	30-Mar-05	14-Apr-05	JOE MAC†	50822301	5K01	*	*	*	*	*	29B01	18-Jun-07	27	54532	349.23	137.38	486.61	1.6	8006	REPLACE FIVE WHEELS AND DISABLE OLD WHEELS AS PER FORD PROGRAM 29B01 APPROVAL CODE WBBNN	RECALL 07S48 FORD PROGRAM 29B01

2005	2FAHP71W05X	██████████	14-Dec-04	30-Dec-04	TED BRIT	60646501	5K01	*	*	*	*	*	29B01	26-Jun-07	31	29249	344.99	154.82	499.81	1.6	48	PERFORM RECALL 07S48 INSPECT FIVE WHEELS REPL FIVE WHEELS MOUNT AND BALANCE FIVE TIRES RECALL 58B01	07S48 WHEEL INSPECTION ADDED BY GARY
2005	2FAFP71W05X	██████████	28-Sep-04	18-Mar-05	HUB CITY	124821B	5K01	*	*	*	*	*	58B01	29-Aug-07	30	65045	0	32.21	32.21	0.5	4918	COMPLETED 1 ONE TIME INSPECTION OF STEEL WHEELS OK	RECALL 58B01
2005	2FAFP71W35X	██████████	26-Oct-04	29-Nov-04	JONES FC	7271802	5K01	*	*	*	*	*	58B01	2-Aug-07	33	43956	0	32.93	32.93	0.5	6721	INSPECT THE ENGINEERING PART NUMBER SUFFIX ON A LL WHEELS INCLUDING SPARE, ALL OK INSPECTED WHEELS NO REPLACEMENT NECESSARY	RECALL 58B01
2005	2FAFP71W85X	██████████	8-Dec-04	5-Jan-05	COMMER(055451B	5K01	*	*	*	*	*	58B01	29-Jun-07	31	26144	0	34.05	34.05	0.5	4405	RECALL 07S48 INSPECT ONLY RECALL 07S48 PERFORMED RECALL 58B01	59B01 INSPECTION OF STEEL WHEELS A99 RECALL 58B01,INSPECTION OF RIMS RECALL 07S48 WHEEL INSPECTION REPLACEMENT PER DINO USE REF 58B01 RECALL 58B01 ONE TIME INSPECTION	
2004	2FAFP71W84X	██████████	19-Jan-04	4-Feb-04	GOLDEN (222549D	5K01	*	*	*	*	*	58B01	25-Jun-07	42	73764	0	35.28	35.28	0.5	5885	PERFORM 58 B01 INSPECTION .WHEELS ARE OF THE LATEST RELEASE. RECALL 04M05 VEHICLE DOES NOT APPLY BECAUSE IT SHOWS NONE OF THE SYMPTOMS LISTED IN THE CUSTOMER SATISFACTION PORTION OF THE RECALL, (INSPECTED ALL5 WHEELS FOR ENGINEERING PART AND BUILD CODE) 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WH	58B01 WHEEL INSPECTION	
2003	2FAFP71W83X	██████████	18-Nov-02	21-Mar-03	PARADISE	1588251	5K01	*	*	*	*	*	58B01	2-Jul-07	53	92936	0	36.93	36.93	0.5	3942	INSPECTED WHEELS AND FOUND WHEELS TO BE OK AA CODES . OK	
2003	2FAFP71W63X	██████████	3-Oct-02	29-Nov-02	RANDALL	322028B	5K01	*	*	*	*	*	58B01	7-Jun-07	56	132153	0	37.43	37.43	0.5	2524		
2004	2FAHP71W54X	██████████	13-Jan-04	2-Feb-04	DAYTONA	11071202	5K01	*	*	*	*	*	58B01	15-Aug-07	44	58074	0	37.84	37.84	0.5	10378		
2004	2FAFP71W04X	██████████	12-Feb-04	27-Feb-04	HELLER F	17970403	5K01	*	*	*	*	*	58B01	27-Jun-07	41	137084	0	37.94	37.94	0.5	20054		RECALL
2003	2FAFP71WX3X	██████████	3-Apr-03	30-May-03	FORD OF	1061341	5K01	*	*	*	*	*	58B01	19-Jul-07	51	106919	0	38.42	38.42	0.5	8951		58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B CUSTOMER STATES PERFORM RECALL 58 B 01 ONE TIME INSPECTION OF STEEL WHEELS
2003	2FAHP71W43X	██████████	25-Mar-03	16-Apr-03	ENFIELD F	15422105	5K01	*	*	*	*	*	58B01	27-Jul-07	53	85514	0	39.41	39.41	0.5	8821		

Year	Model	Start	End	Location	Code	Inspection	Notes	Year	Model	Start	End	Location	Code	Inspection	Notes	Year	Model	Start	End	Location	Code	Inspection	Notes	Year	Model	Start	End	Location	Code	Inspection	Notes
2005	2FAHP71W45X	29-Jul-04	26-Oct-04	ENFIELD F	15414203	5K01	*	*	*	*	*	58B01	25-Jul-07	34	71930	0	39.41	39.41	0.5	8821	CHECK RIMS PER TSBS . CODE AA NO FURTHER INSPECTION NEEDED	CUST STATES PERFORM RECALL 58 B 01 ONE TIME INSPECTION OF STEEL WHEELS PERFORM RECALL 07S248, INSPECTION OF STEEL WHEELS 58B01: STEEL WHEEL INSPECTION 58B01: ONE TIME STEEL WHEEL INSPECTION RECALL58B01 ELIGIBLE ONE TIME INSPECTION OF STEEL WHEELS , REQUESTED BY FLEET CO CUSTOMER REQUESTS RECALL 59B01 TO BE PERFORMED.STEEL WHEEL INSPECTION 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B									
2003	2FAHP71W93X	20-Jan-03	19-Feb-03	TOWN & C	364816B	5K01	*	*	*	*	*	58B01	22-Aug-07	55	120341	0	39.75	39.75	0.5	3365	120341 WHEELS HAVE TO BE REPLACED										
2003	2FAHP71W03X	20-Jan-03	19-Feb-03	TOWN & C	360486C	5K01	*	*	*	*	*	58B01	11-Jun-07	53	117029	0	39.75	39.75	0.5	3365	117029 COMPLETE										
2003	2FAFP71W03X	1-May-02	14-May-02	TOWN & C	361367D	5K01	*	*	*	*	*	58B01	26-Jun-07	63	131885	0	39.75	39.75	0.5	3365	131885 COMPLETED INSPECTION										
2003	2FAFP72W03X	30-May-02	26-Jul-02	JORDAN F	4153352	5K01	*	*	*	*	*	58B01	8-Jun-07	60	184626	0	40.29	40.29	0.5	4546	RECALL STEEL WHEEL REPLACE										
2003	2FAFP71WX3X	28-Jun-02	18-Jul-02	SAWGRA	64694701	5K01	*	*	*	*	*	58B01	4-Jun-07	60	64932	0	40.66	40.66	0.5	4908	TECH 48544 2 PREFORMED RECALL INSPECTED ALL WHEELS FAILED ONE TIME INSPECTION OF ALL FIVE (5) WHEELS FOR ENGINEERING PART # AND BUILD CODE NONE AFFECTED ONE TIME INSPECTION, OF ALL FIVE (5) WHEELS FOR ENGINEERING PART # AND BUILD CODE										
2003	2FAFP71W43X	30-May-02	17-Jun-02	DEMPEW	1576440	5K01	*	*	*	*	*	58B01	14-Aug-07	63	44314	0	40.92	40.92	0.5	5668	ONE TIME INSPECTION, OF ALL FIVE (5) WHEELS FOR ENGINEERING PART # AND BUILD CODE										
2004	2FAFP71W34X	5-Apr-04	16-Apr-04	DEMPEW	1583740	5K01	*	*	*	*	*	58B01	16-Aug-07	41	24074	0	40.92	40.92	0.5	5668	NONE AFFECTED WPI 112823 INSPECTED										
2003	2FAFP71WX3X	23-Apr-02	9-May-02	MAXWELL	789189F	5K01	*	*	*	*	*	58B01	7-Jun-07	62	112823	0	41.75	41.75	0.5	2923	58B01A	RECALL 58B01 RECALL 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEEL									
2003	2FAFP71W33X	25-Oct-02	21-Mar-03	MAXWELL	791263A	5K01	*	*	*	*	*	58B01	2-Jul-07	53	102683	0	41.75	41.75	0.5	2923	102683 58B01A .5HRS										
2003	2FAHP71W73	2-Apr-03	21-Apr-03	PORCARC	65034202	5K01	*	*	*	*	*	58B01	24-Jul-07	52	82666	0	42.5	42.5	0.5	6190	PERFORM RECALL FSA 58B01 INSPECT STEEL RIMS CLOSED AT WPI	RECALL FSA 58B01 58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B FIELD SERVICE ACTION 58B01 RECALL 58B01 STEEL WHEELS PE08-060 1574									
2003	2FAFP71W73X2	19-Jun-03	7-Jul-03	FRITTS FC	431340	5K01	*	*	*	*	*	58B01	24-Aug-07	51	38788	0	43.25	43.25	0.5	5557	CHECKED RIMS FOR CRACKS ALL WHEELS GOOD .										
2003	2FAHP71W93X	22-Apr-03	30-Apr-03	JOHN LAN	144960A	5K01	*	*	*	*	*	58B01	3-Jul-07	51	93130	0	43.3	43.3	0.5	2284	93130 DID RECALL ON RIMS INSPECT										
2003	2FAFP71WX3X	23-Jul-02	29-Jul-02	NORTH BF	204990D	5K01	*	*	*	*	*	58B01	2-Aug-07	62	1769	0	43.5	43.5	0.5	2975	1769 1007 58B01A 0.5 INSP OK AT THIS TIME										

Year	Model	Start	End	Brand	Code	Class	Count	Weight	Pressure	Temp	Notes	Recall		
2004	2FAFP71W04X	24-Sep-03	13-Aug-04	DON CHAI	3921041	5K01	*	*	*	*	*	58B01 19-Jun-07 35 85032 0 43.98 43.98 0.5 1487	ALL WHEELS HAVE CF STAMPED INTO WHEELS TECH INSPECTED ALL FIVE WHEELS AND MEET 04MO5 STELL WHEEL PROGRAM NO WHEELS EFFETCED	58B01 ELIGIBLE FOR ONE TIME INSPECTION OF STEEL WHEELS WHEN REQUESTED B
2003	2FAHP71W83X	5-Jun-03	23-Oct-03	FIESTA LII	11385006	5K01	*	*	*	*	*	58B01 24-Jul-07 46 79382 0 45.18 45.18 0.5 11896	PERFORM RECALL 58B01 STEEL WHEELS INSPECTION TECH. PERFORM STEEL WHEELS INSPECTION FOUND ALL STEEL WHEELS INCLUDING SPARE ENGINEERING PART NUMBER SUFFIXES END WITH CG. PROCEED TO INSPECT FOR LEAKS	STEEL WHEEL RECALL 07S48
2003	2FAHP70WX3X	1-May-02	3-Jun-02	FOLSOM I	51924203	5K01	*	*	*	*	*	58B01 28-Jul-07 63 21286 0 53.14 53.14 0.5 7727	OKAY NO LEAK. ALL TIRES PRESSURE AT 35 PSI SPECS ..VEHI CLE CUSTOMER STATES PASS RECALL 58B01 INSPECTION OF STEEL WHEELS	

MDL	PRODN_D	WRTY_ST	DOC_NUM	WCC	US_P	S_BA	M_ONC	ND_TXN	TIS	MTRL	LBR	OST_G	R_HR	DLR	TECH_TXT1	CH_T	CUST_TXT							
_YR	VIN_CD	ART_DT	RPR_DT	NAME	M	PH_NUM	_CD	REF	SE	CA	_CD	CD_CD	SD	CLM_KEY	MILGE	COST	COST	ROSS	S	CD	2			
2004	5LMFU28R34L	16-Jan-04	21-Jul-04	5-Jun-07	BUSS FOF	1336371	3852000	5K01	2L7Z	1007	AB	N50	5	E84	35	11731974	37239	741.69	62.21	803.9	0.7	1857	REPLACE BOTH FRONT WHEELS. PLATING SEPERATING FROM BACK SIDE OF WHEELS.	C/S ROTATIONAL NOISE PASSENGER FRONT.
2004	1FTPX145X4N	12-Mar-04	13-Jul-04	31-Jul-07	EWALD'S	51682501	4818500	5K02	4L1Z	1130	BA	B65	D4	P05	38	11905233	32200	134.01	16.51	150.52	0.2	3774	PEELING REPLACE ALL 4 CENTER CAPS P05	ALL 4 CENTER CAPS PEELING AND DISCOLORED
2007	1FAHP24117G	5-Jan-07	18-Jun-07	13-Jul-07	PALM CO/	4915003	4473380	5K02	5G1Z	1130	CA	B65	33	2	1	784135	3926	15.05	7.56	22.61	0.1	3326	1 REPLACED CENTER CAP	C S CENTER CAP ON LEFT REAR WHEEL FELL OUT WHILE DRIVING

Comment

DI overturned

AWA out of warranty

Under DI limit

Report Information	Request Status	Name	Description	Run Date	Completion Date	Job Size	Repair Dealer Code	Execut	Precalc	Current	General		
Result ID	Status=Finished	Name=Wh	ion=Jun	Time=18 Sep 2007	Time=18 Sep 2007	14.01	364.04	ion	Processing=03	cy	ated		
96950290:	nished	eels	e to Aug	13.47	2007 14.01			Time=14	VP:04 VP:05 VP:06 VP:07 VP:08 VP:	Cut Off Date=31 Aug 2007	Load Date=14 Sep 2007	Exchan IRCHE ge=v6 l	
Data Selection Criteria:							Model Year = MY_08[2008], MY_07[2007], MY_06[2006], MY_05[2005], MY_04[2004], MY_03[2003]	Country Sold / Repaired	Repair Date [typed]				
Data Selection Criteria:							Region = North America[N A]	Wcc = [USA, USA]	Between 04-JUN-2007, 31-AUG-2007				
Report Selection Criteria:							Model Year=2003, 2004, 2005, 2006, 2007, 2008	Destinat ion=DB	Order By=Grand Total	Tis Rows Selected=All			
Minimum Divisor Selected: 100							PROD_M						
MATRIX_NO	ONTH	TIS	R1000	REPAIRS	VEHICLES	COSTS	CPU	CPR	MODEL YEAR	LOGIC	Reported	Description	
1			0	0	0	3483800	0	0	0	2003 Corporate			
1			1	0	0	3483800	0	0	0	2003 Corporate			
1			2	0	0	3483800	0	0	0	2003 Corporate			
1			3	0	0	3483800	0	0	0	2003 Corporate			
1			4	0	0	3483800	0	0	0	2003 Corporate			
1			5	0	0	3483800	0	0	0	2003 Corporate			
1			6	0	0	3483800	0	0	0	2003 Corporate			
1			7	0	0	3483800	0	0	0	2003 Corporate			
1			8	0	0	3483800	0	0	0	2003 Corporate			
1			9	0	0	3483800	0	0	0	2003 Corporate			
1			10	0	0	3483800	0	0	0	2003 Corporate			
1			11	0	0	3483800	0	0	0	2003 Corporate			
1			12	0	0	3483800	0	0	0	2003 Corporate			
1			13	0	0	3483800	0	0	0	2003 Corporate			
1			14	0	0	3483800	0	0	0	2003 Corporate			
1			15	0	0	3483796	0	0	0	2003 Corporate			
1			16	0	0	3483796	0	0	0	2003 Corporate			
1			17	0	0	3483781	0	0	0	2003 Corporate			
1			18	0	0	3483748	0	0	0	2003 Corporate			
1			19	0	0	3483725	0	0	0	2003 Corporate			
1			20	0	0	3483696	0	0	0	2003 Corporate			
1			21	0	0	3483658	0	0	0	2003 Corporate			



1		22	0	0	3483617		0	0	0	2003 Corporate
1		23	0	0	3483554		0	0	0	2003 Corporate
1		24	0	0	3483487		0	0	0	2003 Corporate
1		25	0	0	3483371		0	0	0	2003 Corporate
1		26	0	0	3483213		0	0	0	2003 Corporate
1		27	0	0	3483043		0	0	0	2003 Corporate
1		28	0	0	3482798		0	0	0	2003 Corporate
1		29	0	0	3482537		0	0	0	2003 Corporate
1		30	0	0	3482170		0	0	0	2003 Corporate
1		31	0	0	3481752		0	0	0	2003 Corporate
1		32	0	0	3481298		0	0	0	2003 Corporate
1		33	0	0	3480755		0	0	0	2003 Corporate
1		34	0	0	3480100		0	0	0	2003 Corporate
1		35	0	0	3479237		0	0	0	2003 Corporate
1		36	0	0	3477823		0	0	0	2003 Corporate
1		37	0	0	3475766		0	0	0	2003 Corporate
1		38	0	0	3473197		0	0	0	2003 Corporate
1		39	0	0	3469542		0	0	0	2003 Corporate
1		40	0	0	3464586		0	0	0	2003 Corporate
1		41	0	0	3457578		0	0	0	2003 Corporate
1		42	0	0	3444801		0	0	0	2003 Corporate
1		43	0	0	3424792		0	0	0	2003 Corporate
1		44	0	1	3398311	534.65	0	534.65	0	2003 Corporate
1		45	0	4	3360886	3415.69	0	853.92	0	2003 Corporate
1		46	0	8	3305903	5622.94	0	702.87	0	2003 Corporate
1		47	0	14	3212821	8425.3	0	601.81	0	2003 Corporate
1		48	0.01	21	3024566	13264.49	0	631.64	0	2003 Corporate
1		49	0.01	22	2783942	13492.37	0	613.29	0	2003 Corporate
1		50	0.01	23	2463325	13583.74	0	590.6	0	2003 Corporate
1		51	0.01	30	2166335	14402.02	0	480.07	0	2003 Corporate
1		52	0.01	33	1876985	15485.85	0.01	469.27	0	2003 Corporate
1		53	0.02	39	1592375	15814.65	0.01	405.5	0	2003 Corporate
1		54	0.02	41	1327487	17565.46	0.01	428.43	0	2003 Corporate
1		55	0.02	44	1058715	19398.33	0.01	440.87	0	2003 Corporate
1		56	0.02	47	848989	21203.46	0.01	451.14	0	2003 Corporate
1		57	0.02	47	615491	21203.46	0.01	451.14	0	2003 Corporate
1		58	0.02	47	405711	21203.46	0.01	451.14	0	2003 Corporate
1		59	0.03	48	233644	21369.93	0.01	445.21	0	2003 Corporate
1		60	0.05	51	117531	21521.78	0.01	422	0	2003 Corporate
1		61	0.08	53	82795	22218.1	0.02	419.21	0	2003 Corporate
1		62	0.14	56	45666	24027.95	0.06	429.07	0	2003 Corporate
1		63	0.22	57	13633	24555.74	0.1	430.8	0	2003 Corporate
1		64	0.22	57	1686	24555.74	0.1	430.8	0	2003 Corporate
1		65	0.22	57	453	24555.74	0.1	430.8	0	2003 Corporate
1		66	0.22	57	298	24555.74	0.1	430.8	0	2003 Corporate
1	1/1/2002	0	0		264		0		0	2003 Corporate
1	1/1/2002	1	0		264		0		0	2003 Corporate
1	1/1/2002	2	0		264		0		0	2003 Corporate
1	1/1/2002	3	0		264		0		0	2003 Corporate
1	1/1/2002	4	0		264		0		0	2003 Corporate
1	1/1/2002	5	0		264		0		0	2003 Corporate
1	1/1/2002	6	0		264		0		0	2003 Corporate
1	1/1/2002	7	0		264		0		0	2003 Corporate
1	1/1/2002	8	0		264		0		0	2003 Corporate
1	1/1/2002	9	0		264		0		0	2003 Corporate
1	1/1/2002	10	0		264		0		0	2003 Corporate

1	1/1/2002	11	0	264	0	2003 Corporate
1	1/1/2002	12	0	264	0	2003 Corporate
1	1/1/2002	13	0	264	0	2003 Corporate
1	1/1/2002	14	0	264	0	2003 Corporate
1	1/1/2002	15	0	264	0	2003 Corporate
1	1/1/2002	16	0	264	0	2003 Corporate
1	1/1/2002	17	0	264	0	2003 Corporate
1	1/1/2002	18	0	264	0	2003 Corporate
1	1/1/2002	19	0	264	0	2003 Corporate
1	1/1/2002	20	0	264	0	2003 Corporate
1	1/1/2002	21	0	264	0	2003 Corporate
1	1/1/2002	22	0	264	0	2003 Corporate
1	1/1/2002	23	0	264	0	2003 Corporate
1	1/1/2002	24	0	264	0	2003 Corporate
1	1/1/2002	25	0	264	0	2003 Corporate
1	1/1/2002	26	0	264	0	2003 Corporate
1	1/1/2002	27	0	264	0	2003 Corporate
1	1/1/2002	28	0	264	0	2003 Corporate
1	1/1/2002	29	0	264	0	2003 Corporate
1	1/1/2002	30	0	264	0	2003 Corporate
1	1/1/2002	31	0	264	0	2003 Corporate
1	1/1/2002	32	0	264	0	2003 Corporate
1	1/1/2002	33	0	264	0	2003 Corporate
1	1/1/2002	34	0	264	0	2003 Corporate
1	1/1/2002	35	0	264	0	2003 Corporate
1	1/1/2002	36	0	264	0	2003 Corporate
1	1/1/2002	37	0	264	0	2003 Corporate
1	1/1/2002	38	0	264	0	2003 Corporate
1	1/1/2002	39	0	264	0	2003 Corporate
1	1/1/2002	40	0	264	0	2003 Corporate
1	1/1/2002	41	0	264	0	2003 Corporate
1	1/1/2002	42	0	263	0	2003 Corporate
1	1/1/2002	43	0	263	0	2003 Corporate
1	1/1/2002	44	0	263	0	2003 Corporate
1	1/1/2002	45	0	263	0	2003 Corporate
1	1/1/2002	46	0	262	0	2003 Corporate
1	1/1/2002	47	0	262	0	2003 Corporate
1	1/1/2002	48	0	262	0	2003 Corporate
1	1/1/2002	49	0	262	0	2003 Corporate
1	1/1/2002	50	0	262	0	2003 Corporate
1	1/1/2002	51	0	262	0	2003 Corporate
1	1/1/2002	52	0	262	0	2003 Corporate
1	1/1/2002	53	0	260	0	2003 Corporate
1	1/1/2002	54	0	260	0	2003 Corporate
1	1/1/2002	55	0	259	0	2003 Corporate
1	1/1/2002	56	0	258	0	2003 Corporate
1	1/1/2002	57	0	256	0	2003 Corporate
1	1/1/2002	58	0	256	0	2003 Corporate
1	1/1/2002	59	0	254	0	2003 Corporate
1	1/1/2002	60	0	248	0	2003 Corporate
1	1/1/2002	61	0	241	0	2003 Corporate
1	1/1/2002	62	0	234	0	2003 Corporate
1	1/1/2002	63	0	171	0	2003 Corporate
1	1/1/2002	64	0	154	0	2003 Corporate
1	1/1/2002	65	0	142	0	2003 Corporate
1	1/1/2002	66	0	135	0	2003 Corporate

1	2/1/2002	0	0	305	0	2003 Corporate
1	2/1/2002	1	0	305	0	2003 Corporate
1	2/1/2002	2	0	305	0	2003 Corporate
1	2/1/2002	3	0	305	0	2003 Corporate
1	2/1/2002	4	0	305	0	2003 Corporate
1	2/1/2002	5	0	305	0	2003 Corporate
1	2/1/2002	6	0	305	0	2003 Corporate
1	2/1/2002	7	0	305	0	2003 Corporate
1	2/1/2002	8	0	305	0	2003 Corporate
1	2/1/2002	9	0	305	0	2003 Corporate
1	2/1/2002	10	0	305	0	2003 Corporate
1	2/1/2002	11	0	305	0	2003 Corporate
1	2/1/2002	12	0	305	0	2003 Corporate
1	2/1/2002	13	0	305	0	2003 Corporate
1	2/1/2002	14	0	305	0	2003 Corporate
1	2/1/2002	15	0	305	0	2003 Corporate
1	2/1/2002	16	0	305	0	2003 Corporate
1	2/1/2002	17	0	305	0	2003 Corporate
1	2/1/2002	18	0	305	0	2003 Corporate
1	2/1/2002	19	0	305	0	2003 Corporate
1	2/1/2002	20	0	305	0	2003 Corporate
1	2/1/2002	21	0	305	0	2003 Corporate
1	2/1/2002	22	0	305	0	2003 Corporate
1	2/1/2002	23	0	305	0	2003 Corporate
1	2/1/2002	24	0	305	0	2003 Corporate
1	2/1/2002	25	0	305	0	2003 Corporate
1	2/1/2002	26	0	305	0	2003 Corporate
1	2/1/2002	27	0	305	0	2003 Corporate
1	2/1/2002	28	0	305	0	2003 Corporate
1	2/1/2002	29	0	305	0	2003 Corporate
1	2/1/2002	30	0	305	0	2003 Corporate
1	2/1/2002	31	0	305	0	2003 Corporate
1	2/1/2002	32	0	305	0	2003 Corporate
1	2/1/2002	33	0	305	0	2003 Corporate
1	2/1/2002	34	0	305	0	2003 Corporate
1	2/1/2002	35	0	305	0	2003 Corporate
1	2/1/2002	36	0	304	0	2003 Corporate
1	2/1/2002	37	0	304	0	2003 Corporate
1	2/1/2002	38	0	304	0	2003 Corporate
1	2/1/2002	39	0	304	0	2003 Corporate
1	2/1/2002	40	0	304	0	2003 Corporate
1	2/1/2002	41	0	304	0	2003 Corporate
1	2/1/2002	42	0	304	0	2003 Corporate
1	2/1/2002	43	0	304	0	2003 Corporate
1	2/1/2002	44	0	304	0	2003 Corporate
1	2/1/2002	45	0	303	0	2003 Corporate
1	2/1/2002	46	0	303	0	2003 Corporate
1	2/1/2002	47	0	303	0	2003 Corporate
1	2/1/2002	48	0	303	0	2003 Corporate
1	2/1/2002	49	0	303	0	2003 Corporate
1	2/1/2002	50	0	303	0	2003 Corporate
1	2/1/2002	51	0	302	0	2003 Corporate
1	2/1/2002	52	0	299	0	2003 Corporate
1	2/1/2002	53	0	296	0	2003 Corporate
1	2/1/2002	54	0	293	0	2003 Corporate
1	2/1/2002	55	0	288	0	2003 Corporate

1	2/1/2002	56	0	285	0	2003 Corporate
1	2/1/2002	57	0	279	0	2003 Corporate
1	2/1/2002	58	0	274	0	2003 Corporate
1	2/1/2002	59	0	269	0	2003 Corporate
1	2/1/2002	60	0	261	0	2003 Corporate
1	2/1/2002	61	0	251	0	2003 Corporate
1	2/1/2002	62	0	246	0	2003 Corporate
1	2/1/2002	63	0	174	0	2003 Corporate
1	2/1/2002	64	0	170	0	2003 Corporate
1	2/1/2002	65	0	148	0	2003 Corporate
1	3/1/2002	0	0	7028	0	2003 Corporate
1	3/1/2002	1	0	7028	0	2003 Corporate
1	3/1/2002	2	0	7028	0	2003 Corporate
1	3/1/2002	3	0	7028	0	2003 Corporate
1	3/1/2002	4	0	7028	0	2003 Corporate
1	3/1/2002	5	0	7028	0	2003 Corporate
1	3/1/2002	6	0	7028	0	2003 Corporate
1	3/1/2002	7	0	7028	0	2003 Corporate
1	3/1/2002	8	0	7028	0	2003 Corporate
1	3/1/2002	9	0	7028	0	2003 Corporate
1	3/1/2002	10	0	7028	0	2003 Corporate
1	3/1/2002	11	0	7028	0	2003 Corporate
1	3/1/2002	12	0	7028	0	2003 Corporate
1	3/1/2002	13	0	7028	0	2003 Corporate
1	3/1/2002	14	0	7028	0	2003 Corporate
1	3/1/2002	15	0	7028	0	2003 Corporate
1	3/1/2002	16	0	7028	0	2003 Corporate
1	3/1/2002	17	0	7028	0	2003 Corporate
1	3/1/2002	18	0	7028	0	2003 Corporate
1	3/1/2002	19	0	7028	0	2003 Corporate
1	3/1/2002	20	0	7028	0	2003 Corporate
1	3/1/2002	21	0	7028	0	2003 Corporate
1	3/1/2002	22	0	7028	0	2003 Corporate
1	3/1/2002	23	0	7028	0	2003 Corporate
1	3/1/2002	24	0	7028	0	2003 Corporate
1	3/1/2002	25	0	7028	0	2003 Corporate
1	3/1/2002	26	0	7028	0	2003 Corporate
1	3/1/2002	27	0	7028	0	2003 Corporate
1	3/1/2002	28	0	7028	0	2003 Corporate
1	3/1/2002	29	0	7028	0	2003 Corporate
1	3/1/2002	30	0	7028	0	2003 Corporate
1	3/1/2002	31	0	7028	0	2003 Corporate
1	3/1/2002	32	0	7027	0	2003 Corporate
1	3/1/2002	33	0	7027	0	2003 Corporate
1	3/1/2002	34	0	7027	0	2003 Corporate
1	3/1/2002	35	0	7027	0	2003 Corporate
1	3/1/2002	36	0	7027	0	2003 Corporate
1	3/1/2002	37	0	7026	0	2003 Corporate
1	3/1/2002	38	0	7023	0	2003 Corporate
1	3/1/2002	39	0	7022	0	2003 Corporate
1	3/1/2002	40	0	7019	0	2003 Corporate
1	3/1/2002	41	0	7017	0	2003 Corporate
1	3/1/2002	42	0	7013	0	2003 Corporate
1	3/1/2002	43	0	7007	0	2003 Corporate
1	3/1/2002	44	0	7004	0	2003 Corporate
1	3/1/2002	45	0	6999	0	2003 Corporate

1	3/1/2002	46	0	6991	0	0	2003 Corporate
1	3/1/2002	47	0	6978	0	0	2003 Corporate
1	3/1/2002	48	0	6944	0	0	2003 Corporate
1	3/1/2002	49	0	6892	0	0	2003 Corporate
1	3/1/2002	50	0	6827	0	0	2003 Corporate
1	3/1/2002	51	0	6751	0	0	2003 Corporate
1	3/1/2002	52	0	6685	0	0	2003 Corporate
1	3/1/2002	53	0	6578	0	0	2003 Corporate
1	3/1/2002	54	0	6445	0	0	2003 Corporate
1	3/1/2002	55	0	6319	0	0	2003 Corporate
1	3/1/2002	56	0	6205	0	0	2003 Corporate
1	3/1/2002	57	0	5998	0	0	2003 Corporate
1	3/1/2002	58	0	5765	0	0	2003 Corporate
1	3/1/2002	59	0	5469	0	0	2003 Corporate
1	3/1/2002	60	0	4970	0	0	2003 Corporate
1	3/1/2002	61	0	4378	0	0	2003 Corporate
1	3/1/2002	62	0	3412	0	0	2003 Corporate
1	3/1/2002	63	0	1958	0	0	2003 Corporate
1	3/1/2002	64	0	1197	0	0	2003 Corporate
1	4/1/2002	0	0	29012	0	0	2003 Corporate
1	4/1/2002	1	0	29012	0	0	2003 Corporate
1	4/1/2002	2	0	29012	0	0	2003 Corporate
1	4/1/2002	3	0	29012	0	0	2003 Corporate
1	4/1/2002	4	0	29012	0	0	2003 Corporate
1	4/1/2002	5	0	29012	0	0	2003 Corporate
1	4/1/2002	6	0	29012	0	0	2003 Corporate
1	4/1/2002	7	0	29012	0	0	2003 Corporate
1	4/1/2002	8	0	29012	0	0	2003 Corporate
1	4/1/2002	9	0	29012	0	0	2003 Corporate
1	4/1/2002	10	0	29012	0	0	2003 Corporate
1	4/1/2002	11	0	29012	0	0	2003 Corporate
1	4/1/2002	12	0	29012	0	0	2003 Corporate
1	4/1/2002	13	0	29012	0	0	2003 Corporate
1	4/1/2002	14	0	29012	0	0	2003 Corporate
1	4/1/2002	15	0	29012	0	0	2003 Corporate
1	4/1/2002	16	0	29012	0	0	2003 Corporate
1	4/1/2002	17	0	29012	0	0	2003 Corporate
1	4/1/2002	18	0	29012	0	0	2003 Corporate
1	4/1/2002	19	0	29012	0	0	2003 Corporate
1	4/1/2002	20	0	29012	0	0	2003 Corporate
1	4/1/2002	21	0	29012	0	0	2003 Corporate
1	4/1/2002	22	0	29012	0	0	2003 Corporate
1	4/1/2002	23	0	29012	0	0	2003 Corporate
1	4/1/2002	24	0	29011	0	0	2003 Corporate
1	4/1/2002	25	0	29011	0	0	2003 Corporate
1	4/1/2002	26	0	29010	0	0	2003 Corporate
1	4/1/2002	27	0	29009	0	0	2003 Corporate
1	4/1/2002	28	0	29007	0	0	2003 Corporate
1	4/1/2002	29	0	29007	0	0	2003 Corporate
1	4/1/2002	30	0	29007	0	0	2003 Corporate
1	4/1/2002	31	0	29006	0	0	2003 Corporate
1	4/1/2002	32	0	29005	0	0	2003 Corporate
1	4/1/2002	33	0	29003	0	0	2003 Corporate
1	4/1/2002	34	0	29002	0	0	2003 Corporate
1	4/1/2002	35	0	29000	0	0	2003 Corporate
1	4/1/2002	36	0	28995	0	0	2003 Corporate

1	4/1/2002	37	0	0	28993	0	0	0	2003 Corporate
1	4/1/2002	38	0	0	28990	0	0	0	2003 Corporate
1	4/1/2002	39	0	0	28987	0	0	0	2003 Corporate
1	4/1/2002	40	0	0	28982	0	0	0	2003 Corporate
1	4/1/2002	41	0	0	28971	0	0	0	2003 Corporate
1	4/1/2002	42	0	0	28953	0	0	0	2003 Corporate
1	4/1/2002	43	0	0	28934	0	0	0	2003 Corporate
1	4/1/2002	44	0	0	28900	0	0	0	2003 Corporate
1	4/1/2002	45	0	0	28862	0	0	0	2003 Corporate
1	4/1/2002	46	0	0	28814	0	0	0	2003 Corporate
1	4/1/2002	47	0	0	28744	0	0	0	2003 Corporate
1	4/1/2002	48	0	0	28621	0	0	0	2003 Corporate
1	4/1/2002	49	0	0	28431	0	0	0	2003 Corporate
1	4/1/2002	50	0	0	28210	0	0	0	2003 Corporate
1	4/1/2002	51	0	0	27949	0	0	0	2003 Corporate
1	4/1/2002	52	0	0	27680	0	0	0	2003 Corporate
1	4/1/2002	53	0	0	27311	0	0	0	2003 Corporate
1	4/1/2002	54	0	0	26907	0	0	0	2003 Corporate
1	4/1/2002	55	0	0	26419	0	0	0	2003 Corporate
1	4/1/2002	56	0	0	25932	0	0	0	2003 Corporate
1	4/1/2002	57	0	0	25196	0	0	0	2003 Corporate
1	4/1/2002	58	0	0	24364	0	0	0	2003 Corporate
1	4/1/2002	59	0	0	23175	0	0	0	2003 Corporate
1	4/1/2002	60	0	0	21275	0	0	0	2003 Corporate
1	4/1/2002	61	0	0	18862	0	0	0	2003 Corporate
1	4/1/2002	62	0.19	3	15511	1809.85	0.12	603.28	2003 Corporate
1	4/1/2002	63	0.28	4	11165	2337.64	0.16	584.41	2003 Corporate
1	5/1/2002	0	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	1	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	2	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	3	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	4	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	5	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	6	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	7	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	8	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	9	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	10	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	11	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	12	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	13	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	14	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	15	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	16	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	17	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	18	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	19	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	20	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	21	0	0	38139	0	0	0	2003 Corporate
1	5/1/2002	22	0	0	38138	0	0	0	2003 Corporate
1	5/1/2002	23	0	0	38138	0	0	0	2003 Corporate
1	5/1/2002	24	0	0	38138	0	0	0	2003 Corporate
1	5/1/2002	25	0	0	38138	0	0	0	2003 Corporate
1	5/1/2002	26	0	0	38138	0	0	0	2003 Corporate
1	5/1/2002	27	0	0	38136	0	0	0	2003 Corporate
1	5/1/2002	28	0	0	38133	0	0	0	2003 Corporate

1	5/1/2002	29	0	0	38133	0	0	0	2003 Corporate
1	5/1/2002	30	0	0	38133	0	0	0	2003 Corporate
1	5/1/2002	31	0	0	38132	0	0	0	2003 Corporate
1	5/1/2002	32	0	0	38128	0	0	0	2003 Corporate
1	5/1/2002	33	0	0	38128	0	0	0	2003 Corporate
1	5/1/2002	34	0	0	38122	0	0	0	2003 Corporate
1	5/1/2002	35	0	0	38120	0	0	0	2003 Corporate
1	5/1/2002	36	0	0	38115	0	0	0	2003 Corporate
1	5/1/2002	37	0	0	38112	0	0	0	2003 Corporate
1	5/1/2002	38	0	0	38106	0	0	0	2003 Corporate
1	5/1/2002	39	0	0	38099	0	0	0	2003 Corporate
1	5/1/2002	40	0	0	38091	0	0	0	2003 Corporate
1	5/1/2002	41	0	0	38079	0	0	0	2003 Corporate
1	5/1/2002	42	0	0	38063	0	0	0	2003 Corporate
1	5/1/2002	43	0	0	38037	0	0	0	2003 Corporate
1	5/1/2002	44	0	0	38009	0	0	0	2003 Corporate
1	5/1/2002	45	0	0	37981	0	0	0	2003 Corporate
1	5/1/2002	46	0	0	37937	0	0	0	2003 Corporate
1	5/1/2002	47	0	0	37868	0	0	0	2003 Corporate
1	5/1/2002	48	0	0	37744	0	0	0	2003 Corporate
1	5/1/2002	49	0	0	37597	0	0	0	2003 Corporate
1	5/1/2002	50	0	0	37376	0	0	0	2003 Corporate
1	5/1/2002	51	0	0	37161	0	0	0	2003 Corporate
1	5/1/2002	52	0	0	36909	0	0	0	2003 Corporate
1	5/1/2002	53	0	0	36612	0	0	0	2003 Corporate
1	5/1/2002	54	0	0	36213	0	0	0	2003 Corporate
1	5/1/2002	55	0	0	35803	0	0	0	2003 Corporate
1	5/1/2002	56	0	0	35368	0	0	0	2003 Corporate
1	5/1/2002	57	0	0	34713	0	0	0	2003 Corporate
1	5/1/2002	58	0	0	34003	0	0	0	2003 Corporate
1	5/1/2002	59	0	0	32942	0	0	0	2003 Corporate
1	5/1/2002	60	0.03	1	31349	40.29	0	40.29	2003 Corporate
1	5/1/2002	61	0.07	2	29192	518.43	0.02	259.22	2003 Corporate
1	5/1/2002	62	0.07	2	26032	518.43	0.02	259.22	2003 Corporate
1	6/1/2002	0	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	1	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	2	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	3	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	4	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	5	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	6	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	7	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	8	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	9	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	10	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	11	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	12	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	13	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	14	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	15	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	16	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	17	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	18	0	0	45954	0	0	0	2003 Corporate
1	6/1/2002	19	0	0	45953	0	0	0	2003 Corporate
1	6/1/2002	20	0	0	45953	0	0	0	2003 Corporate
1	6/1/2002	21	0	0	45952	0	0	0	2003 Corporate

1	6/1/2002	22	0	0	45952	0	0	0	2003 Corporate
1	6/1/2002	23	0	0	45952	0	0	0	2003 Corporate
1	6/1/2002	24	0	0	45951	0	0	0	2003 Corporate
1	6/1/2002	25	0	0	45947	0	0	0	2003 Corporate
1	6/1/2002	26	0	0	45946	0	0	0	2003 Corporate
1	6/1/2002	27	0	0	45946	0	0	0	2003 Corporate
1	6/1/2002	28	0	0	45946	0	0	0	2003 Corporate
1	6/1/2002	29	0	0	45943	0	0	0	2003 Corporate
1	6/1/2002	30	0	0	45920	0	0	0	2003 Corporate
1	6/1/2002	31	0	0	45892	0	0	0	2003 Corporate
1	6/1/2002	32	0	0	45887	0	0	0	2003 Corporate
1	6/1/2002	33	0	0	45885	0	0	0	2003 Corporate
1	6/1/2002	34	0	0	45882	0	0	0	2003 Corporate
1	6/1/2002	35	0	0	45879	0	0	0	2003 Corporate
1	6/1/2002	36	0	0	45860	0	0	0	2003 Corporate
1	6/1/2002	37	0	0	45845	0	0	0	2003 Corporate
1	6/1/2002	38	0	0	45835	0	0	0	2003 Corporate
1	6/1/2002	39	0	0	45825	0	0	0	2003 Corporate
1	6/1/2002	40	0	0	45808	0	0	0	2003 Corporate
1	6/1/2002	41	0	0	45792	0	0	0	2003 Corporate
1	6/1/2002	42	0	0	45759	0	0	0	2003 Corporate
1	6/1/2002	43	0	0	45714	0	0	0	2003 Corporate
1	6/1/2002	44	0	0	45626	0	0	0	2003 Corporate
1	6/1/2002	45	0	0	45571	0	0	0	2003 Corporate
1	6/1/2002	46	0	0	45465	0	0	0	2003 Corporate
1	6/1/2002	47	0	0	45297	0	0	0	2003 Corporate
1	6/1/2002	48	0	0	45038	0	0	0	2003 Corporate
1	6/1/2002	49	0	0	44659	0	0	0	2003 Corporate
1	6/1/2002	50	0	0	44216	0	0	0	2003 Corporate
1	6/1/2002	51	0	0	43775	0	0	0	2003 Corporate
1	6/1/2002	52	0	0	43286	0	0	0	2003 Corporate
1	6/1/2002	53	0	0	42687	0	0	0	2003 Corporate
1	6/1/2002	54	0	0	41972	0	0	0	2003 Corporate
1	6/1/2002	55	0	0	41215	0	0	0	2003 Corporate
1	6/1/2002	56	0	0	40428	0	0	0	2003 Corporate
1	6/1/2002	57	0	0	39237	0	0	0	2003 Corporate
1	6/1/2002	58	0	0	37981	0	0	0	2003 Corporate
1	6/1/2002	59	0.03	1	36126	166.47	0	166.47	2003 Corporate
1	6/1/2002	60	0.06	2	33410	207.13	0.01	103.57	2003 Corporate
1	6/1/2002	61	0.09	3	29640	425.31	0.01	141.77	2003 Corporate
1	7/1/2002	0	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	1	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	2	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	3	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	4	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	5	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	6	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	7	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	8	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	9	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	10	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	11	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	12	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	13	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	14	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	15	0	0	54503	0	0	0	2003 Corporate



1	7/1/2002	16	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	17	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	18	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	19	0	0	54503	0	0	0	2003 Corporate
1	7/1/2002	20	0	0	54502	0	0	0	2003 Corporate
1	7/1/2002	21	0	0	54502	0	0	0	2003 Corporate
1	7/1/2002	22	0	0	54502	0	0	0	2003 Corporate
1	7/1/2002	23	0	0	54502	0	0	0	2003 Corporate
1	7/1/2002	24	0	0	54501	0	0	0	2003 Corporate
1	7/1/2002	25	0	0	54500	0	0	0	2003 Corporate
1	7/1/2002	26	0	0	54500	0	0	0	2003 Corporate
1	7/1/2002	27	0	0	54499	0	0	0	2003 Corporate
1	7/1/2002	28	0	0	54499	0	0	0	2003 Corporate
1	7/1/2002	29	0	0	54498	0	0	0	2003 Corporate
1	7/1/2002	30	0	0	54498	0	0	0	2003 Corporate
1	7/1/2002	31	0	0	54497	0	0	0	2003 Corporate
1	7/1/2002	32	0	0	54488	0	0	0	2003 Corporate
1	7/1/2002	33	0	0	54486	0	0	0	2003 Corporate
1	7/1/2002	34	0	0	54484	0	0	0	2003 Corporate
1	7/1/2002	35	0	0	54480	0	0	0	2003 Corporate
1	7/1/2002	36	0	0	54474	0	0	0	2003 Corporate
1	7/1/2002	37	0	0	54467	0	0	0	2003 Corporate
1	7/1/2002	38	0	0	54457	0	0	0	2003 Corporate
1	7/1/2002	39	0	0	54445	0	0	0	2003 Corporate
1	7/1/2002	40	0	0	54434	0	0	0	2003 Corporate
1	7/1/2002	41	0	0	54411	0	0	0	2003 Corporate
1	7/1/2002	42	0	0	54372	0	0	0	2003 Corporate
1	7/1/2002	43	0	0	54308	0	0	0	2003 Corporate
1	7/1/2002	44	0	0	54236	0	0	0	2003 Corporate
1	7/1/2002	45	0	0	54152	0	0	0	2003 Corporate
1	7/1/2002	46	0	0	53999	0	0	0	2003 Corporate
1	7/1/2002	47	0	0	53768	0	0	0	2003 Corporate
1	7/1/2002	48	0	0	53316	0	0	0	2003 Corporate
1	7/1/2002	49	0	0	52714	0	0	0	2003 Corporate
1	7/1/2002	50	0	0	51985	0	0	0	2003 Corporate
1	7/1/2002	51	0	0	51112	0	0	0	2003 Corporate
1	7/1/2002	52	0	0	50103	0	0	0	2003 Corporate
1	7/1/2002	53	0	0	48807	0	0	0	2003 Corporate
1	7/1/2002	54	0	0	47184	0	0	0	2003 Corporate
1	7/1/2002	55	0	0	45237	0	0	0	2003 Corporate
1	7/1/2002	56	0	0	43079	0	0	0	2003 Corporate
1	7/1/2002	57	0	0	40036	0	0	0	2003 Corporate
1	7/1/2002	58	0	0	36647	0	0	0	2003 Corporate
1	7/1/2002	59	0	0	32096	0	0	0	2003 Corporate
1	7/1/2002	60	0.04	1	25786	70.9	0	70.9	2003 Corporate
1	8/1/2002	0	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	1	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	2	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	3	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	4	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	5	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	6	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	7	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	8	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	9	0	0	243972	0	0	0	2003 Corporate
1	8/1/2002	10	0	0	243972	0	0	0	2003 Corporate

1	8/1/2002	11	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	12	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	13	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	14	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	15	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	16	0	243972	0	0	0	2003 Corporate	
1	8/1/2002	17	0	243971	0	0	0	2003 Corporate	
1	8/1/2002	18	0	243970	0	0	0	2003 Corporate	
1	8/1/2002	19	0	243970	0	0	0	2003 Corporate	
1	8/1/2002	20	0	243968	0	0	0	2003 Corporate	
1	8/1/2002	21	0	243966	0	0	0	2003 Corporate	
1	8/1/2002	22	0	243965	0	0	0	2003 Corporate	
1	8/1/2002	23	0	243959	0	0	0	2003 Corporate	
1	8/1/2002	24	0	243948	0	0	0	2003 Corporate	
1	8/1/2002	25	0	243920	0	0	0	2003 Corporate	
1	8/1/2002	26	0	243889	0	0	0	2003 Corporate	
1	8/1/2002	27	0	243877	0	0	0	2003 Corporate	
1	8/1/2002	28	0	243843	0	0	0	2003 Corporate	
1	8/1/2002	29	0	243810	0	0	0	2003 Corporate	
1	8/1/2002	30	0	243783	0	0	0	2003 Corporate	
1	8/1/2002	31	0	243761	0	0	0	2003 Corporate	
1	8/1/2002	32	0	243746	0	0	0	2003 Corporate	
1	8/1/2002	33	0	243731	0	0	0	2003 Corporate	
1	8/1/2002	34	0	243714	0	0	0	2003 Corporate	
1	8/1/2002	35	0	243693	0	0	0	2003 Corporate	
1	8/1/2002	36	0	243654	0	0	0	2003 Corporate	
1	8/1/2002	37	0	243607	0	0	0	2003 Corporate	
1	8/1/2002	38	0	243543	0	0	0	2003 Corporate	
1	8/1/2002	39	0	243445	0	0	0	2003 Corporate	
1	8/1/2002	40	0	243338	0	0	0	2003 Corporate	
1	8/1/2002	41	0	243183	0	0	0	2003 Corporate	
1	8/1/2002	42	0	242891	0	0	0	2003 Corporate	
1	8/1/2002	43	0	242440	0	0	0	2003 Corporate	
1	8/1/2002	44	0	241932	0	0	0	2003 Corporate	
1	8/1/2002	45	0	241231	0	0	0	2003 Corporate	
1	8/1/2002	46	0	240206	0	0	0	2003 Corporate	
1	8/1/2002	47	0	238555	0	0	0	2003 Corporate	
1	8/1/2002	48	0	235762	0	0	0	2003 Corporate	
1	8/1/2002	49	0	231957	0	0	0	2003 Corporate	
1	8/1/2002	50	0	227152	0	0	0	2003 Corporate	
1	8/1/2002	51	0	221645	0	0	0	2003 Corporate	
1	8/1/2002	52	0	214778	0	0	0	2003 Corporate	
1	8/1/2002	53	0	205769	0	0	0	2003 Corporate	
1	8/1/2002	54	0	195034	0	0	0	2003 Corporate	
1	8/1/2002	55	0	182273	0	0	0	2003 Corporate	
1	8/1/2002	56	0	167275	0	0	0	2003 Corporate	
1	8/1/2002	57	0	147053	0	0	0	2003 Corporate	
1	8/1/2002	58	0	127566	0	0	0	2003 Corporate	
1	8/1/2002	59	0	103081	0	0	0	2003 Corporate	
1	9/1/2002	0	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	1	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	2	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	3	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	4	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	5	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	6	0	0	310565	0	0	0	2003 Corporate

1	9/1/2002	7	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	8	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	9	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	10	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	11	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	12	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	13	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	14	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	15	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	16	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	17	0	0	310565	0	0	0	2003 Corporate
1	9/1/2002	18	0	0	310555	0	0	0	2003 Corporate
1	9/1/2002	19	0	0	310553	0	0	0	2003 Corporate
1	9/1/2002	20	0	0	310552	0	0	0	2003 Corporate
1	9/1/2002	21	0	0	310548	0	0	0	2003 Corporate
1	9/1/2002	22	0	0	310547	0	0	0	2003 Corporate
1	9/1/2002	23	0	0	310543	0	0	0	2003 Corporate
1	9/1/2002	24	0	0	310541	0	0	0	2003 Corporate
1	9/1/2002	25	0	0	310538	0	0	0	2003 Corporate
1	9/1/2002	26	0	0	310531	0	0	0	2003 Corporate
1	9/1/2002	27	0	0	310528	0	0	0	2003 Corporate
1	9/1/2002	28	0	0	310519	0	0	0	2003 Corporate
1	9/1/2002	29	0	0	310504	0	0	0	2003 Corporate
1	9/1/2002	30	0	0	310491	0	0	0	2003 Corporate
1	9/1/2002	31	0	0	310470	0	0	0	2003 Corporate
1	9/1/2002	32	0	0	310446	0	0	0	2003 Corporate
1	9/1/2002	33	0	0	310428	0	0	0	2003 Corporate
1	9/1/2002	34	0	0	310394	0	0	0	2003 Corporate
1	9/1/2002	35	0	0	310376	0	0	0	2003 Corporate
1	9/1/2002	36	0	0	310316	0	0	0	2003 Corporate
1	9/1/2002	37	0	0	310241	0	0	0	2003 Corporate
1	9/1/2002	38	0	0	310128	0	0	0	2003 Corporate
1	9/1/2002	39	0	0	310009	0	0	0	2003 Corporate
1	9/1/2002	40	0	0	309854	0	0	0	2003 Corporate
1	9/1/2002	41	0	0	309615	0	0	0	2003 Corporate
1	9/1/2002	42	0	0	309269	0	0	0	2003 Corporate
1	9/1/2002	43	0	0	308698	0	0	0	2003 Corporate
1	9/1/2002	44	0	0	307974	0	0	0	2003 Corporate
1	9/1/2002	45	0	0	307024	0	0	0	2003 Corporate
1	9/1/2002	46	0	0	305623	0	0	0	2003 Corporate
1	9/1/2002	47	0	0	303240	0	0	0	2003 Corporate
1	9/1/2002	48	0	0	299221	0	0	0	2003 Corporate
1	9/1/2002	49	0	0	293825	0	0	0	2003 Corporate
1	9/1/2002	50	0	0	287118	0	0	0	2003 Corporate
1	9/1/2002	51	0	0	279256	0	0	0	2003 Corporate
1	9/1/2002	52	0	0	269467	0	0	0	2003 Corporate
1	9/1/2002	53	0	1	256647	15	0	15	2003 Corporate
1	9/1/2002	54	0	1	241133	15	0	15	2003 Corporate
1	9/1/2002	55	0	1	222444	15	0	15	2003 Corporate
1	9/1/2002	56	0	1	200181	15	0	15	2003 Corporate
1	9/1/2002	57	0	1	169265	15	0	15	2003 Corporate
1	9/1/2002	58	0	1	138623	15	0	15	2003 Corporate
1	10/1/2002	0	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	1	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	2	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	3	0	0	350954	0	0	0	2003 Corporate

1	10/1/2002	4	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	5	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	6	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	7	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	8	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	9	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	10	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	11	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	12	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	13	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	14	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	15	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	16	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	17	0	0	350954	0	0	0	2003 Corporate
1	10/1/2002	18	0	0	350952	0	0	0	2003 Corporate
1	10/1/2002	19	0	0	350951	0	0	0	2003 Corporate
1	10/1/2002	20	0	0	350951	0	0	0	2003 Corporate
1	10/1/2002	21	0	0	350950	0	0	0	2003 Corporate
1	10/1/2002	22	0	0	350949	0	0	0	2003 Corporate
1	10/1/2002	23	0	0	350949	0	0	0	2003 Corporate
1	10/1/2002	24	0	0	350946	0	0	0	2003 Corporate
1	10/1/2002	25	0	0	350940	0	0	0	2003 Corporate
1	10/1/2002	26	0	0	350935	0	0	0	2003 Corporate
1	10/1/2002	27	0	0	350929	0	0	0	2003 Corporate
1	10/1/2002	28	0	0	350918	0	0	0	2003 Corporate
1	10/1/2002	29	0	0	350906	0	0	0	2003 Corporate
1	10/1/2002	30	0	0	350880	0	0	0	2003 Corporate
1	10/1/2002	31	0	0	350851	0	0	0	2003 Corporate
1	10/1/2002	32	0	0	350831	0	0	0	2003 Corporate
1	10/1/2002	33	0	0	350799	0	0	0	2003 Corporate
1	10/1/2002	34	0	0	350780	0	0	0	2003 Corporate
1	10/1/2002	35	0	0	350728	0	0	0	2003 Corporate
1	10/1/2002	36	0	0	350678	0	0	0	2003 Corporate
1	10/1/2002	37	0	0	350603	0	0	0	2003 Corporate
1	10/1/2002	38	0	0	350521	0	0	0	2003 Corporate
1	10/1/2002	39	0	0	350366	0	0	0	2003 Corporate
1	10/1/2002	40	0	0	350173	0	0	0	2003 Corporate
1	10/1/2002	41	0	0	349918	0	0	0	2003 Corporate
1	10/1/2002	42	0	0	349449	0	0	0	2003 Corporate
1	10/1/2002	43	0	0	348664	0	0	0	2003 Corporate
1	10/1/2002	44	0	0	347665	0	0	0	2003 Corporate
1	10/1/2002	45	0	0	346282	0	0	0	2003 Corporate
1	10/1/2002	46	0	0	344263	0	0	0	2003 Corporate
1	10/1/2002	47	0	0	340783	0	0	0	2003 Corporate
1	10/1/2002	48	0	0	334139	0	0	0	2003 Corporate
1	10/1/2002	49	0	0	325615	0	0	0	2003 Corporate
1	10/1/2002	50	0	0	315504	0	0	0	2003 Corporate
1	10/1/2002	51	0	0	304161	0	0	0	2003 Corporate
1	10/1/2002	52	0	0	289852	0	0	0	2003 Corporate
1	10/1/2002	53	0	1	272210	41.75	0	41.75	2003 Corporate
1	10/1/2002	54	0	1	250980	41.75	0	41.75	2003 Corporate
1	10/1/2002	55	0	1	225102	41.75	0	41.75	2003 Corporate
1	10/1/2002	56	0.02	4	194553	1846.88	0.01	461.72	2003 Corporate
1	10/1/2002	57	0.02	4	153226	1846.88	0.01	461.72	2003 Corporate
1	11/1/2002	0	0	0	261553	0	0	0	2003 Corporate
1	11/1/2002	1	0	0	261553	0	0	0	2003 Corporate

1 11/1/2002	2	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	3	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	4	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	5	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	6	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	7	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	8	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	9	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	10	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	11	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	12	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	13	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	14	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	15	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	16	0	0	261553	0	0	0	2003 Corporate
1 11/1/2002	17	0	0	261551	0	0	0	2003 Corporate
1 11/1/2002	18	0	0	261551	0	0	0	2003 Corporate
1 11/1/2002	19	0	0	261551	0	0	0	2003 Corporate
1 11/1/2002	20	0	0	261550	0	0	0	2003 Corporate
1 11/1/2002	21	0	0	261549	0	0	0	2003 Corporate
1 11/1/2002	22	0	0	261549	0	0	0	2003 Corporate
1 11/1/2002	23	0	0	261549	0	0	0	2003 Corporate
1 11/1/2002	24	0	0	261548	0	0	0	2003 Corporate
1 11/1/2002	25	0	0	261545	0	0	0	2003 Corporate
1 11/1/2002	26	0	0	261538	0	0	0	2003 Corporate
1 11/1/2002	27	0	0	261531	0	0	0	2003 Corporate
1 11/1/2002	28	0	0	261527	0	0	0	2003 Corporate
1 11/1/2002	29	0	0	261521	0	0	0	2003 Corporate
1 11/1/2002	30	0	0	261511	0	0	0	2003 Corporate
1 11/1/2002	31	0	0	261498	0	0	0	2003 Corporate
1 11/1/2002	32	0	0	261480	0	0	0	2003 Corporate
1 11/1/2002	33	0	0	261457	0	0	0	2003 Corporate
1 11/1/2002	34	0	0	261431	0	0	0	2003 Corporate
1 11/1/2002	35	0	0	261396	0	0	0	2003 Corporate
1 11/1/2002	36	0	0	261342	0	0	0	2003 Corporate
1 11/1/2002	37	0	0	261249	0	0	0	2003 Corporate
1 11/1/2002	38	0	0	261136	0	0	0	2003 Corporate
1 11/1/2002	39	0	0	261000	0	0	0	2003 Corporate
1 11/1/2002	40	0	0	260829	0	0	0	2003 Corporate
1 11/1/2002	41	0	0	260607	0	0	0	2003 Corporate
1 11/1/2002	42	0	0	260176	0	0	0	2003 Corporate
1 11/1/2002	43	0	0	259464	0	0	0	2003 Corporate
1 11/1/2002	44	0	0	258580	0	0	0	2003 Corporate
1 11/1/2002	45	0	0	257359	0	0	0	2003 Corporate
1 11/1/2002	46	0	0	255660	0	0	0	2003 Corporate
1 11/1/2002	47	0	0	252697	0	0	0	2003 Corporate
1 11/1/2002	48	0	0	247313	0	0	0	2003 Corporate
1 11/1/2002	49	0	0	240074	0	0	0	2003 Corporate
1 11/1/2002	50	0	0	231718	0	0	0	2003 Corporate
1 11/1/2002	51	0	0	222341	0	0	0	2003 Corporate
1 11/1/2002	52	0	0	211001	0	0	0	2003 Corporate
1 11/1/2002	53	0.01	1	196616	36.93	0	36.93	2003 Corporate
1 11/1/2002	54	0.01	1	179590	36.93	0	36.93	2003 Corporate
1 11/1/2002	55	0.01	2	159232	147.71	0	73.86	2003 Corporate
1 11/1/2002	56	0.01	2	135193	147.71	0	73.86	2003 Corporate
1 12/1/2002	0	0	0	205335	0	0	0	2003 Corporate

1	12/1/2002	1	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	2	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	3	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	4	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	5	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	6	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	7	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	8	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	9	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	10	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	11	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	12	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	13	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	14	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	15	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	16	0	0	205335	0	0	0	2003 Corporate
1	12/1/2002	17	0	0	205334	0	0	0	2003 Corporate
1	12/1/2002	18	0	0	205332	0	0	0	2003 Corporate
1	12/1/2002	19	0	0	205332	0	0	0	2003 Corporate
1	12/1/2002	20	0	0	205330	0	0	0	2003 Corporate
1	12/1/2002	21	0	0	205327	0	0	0	2003 Corporate
1	12/1/2002	22	0	0	205324	0	0	0	2003 Corporate
1	12/1/2002	23	0	0	205319	0	0	0	2003 Corporate
1	12/1/2002	24	0	0	205317	0	0	0	2003 Corporate
1	12/1/2002	25	0	0	205314	0	0	0	2003 Corporate
1	12/1/2002	26	0	0	205304	0	0	0	2003 Corporate
1	12/1/2002	27	0	0	205298	0	0	0	2003 Corporate
1	12/1/2002	28	0	0	205292	0	0	0	2003 Corporate
1	12/1/2002	29	0	0	205287	0	0	0	2003 Corporate
1	12/1/2002	30	0	0	205265	0	0	0	2003 Corporate
1	12/1/2002	31	0	0	205246	0	0	0	2003 Corporate
1	12/1/2002	32	0	0	205226	0	0	0	2003 Corporate
1	12/1/2002	33	0	0	205211	0	0	0	2003 Corporate
1	12/1/2002	34	0	0	205178	0	0	0	2003 Corporate
1	12/1/2002	35	0	0	205154	0	0	0	2003 Corporate
1	12/1/2002	36	0	0	205108	0	0	0	2003 Corporate
1	12/1/2002	37	0	0	205038	0	0	0	2003 Corporate
1	12/1/2002	38	0	0	204945	0	0	0	2003 Corporate
1	12/1/2002	39	0	0	204841	0	0	0	2003 Corporate
1	12/1/2002	40	0	0	204685	0	0	0	2003 Corporate
1	12/1/2002	41	0	0	204468	0	0	0	2003 Corporate
1	12/1/2002	42	0	0	204085	0	0	0	2003 Corporate
1	12/1/2002	43	0	0	203512	0	0	0	2003 Corporate
1	12/1/2002	44	0	0	202763	0	0	0	2003 Corporate
1	12/1/2002	45	0	0	201718	0	0	0	2003 Corporate
1	12/1/2002	46	0	0	200234	0	0	0	2003 Corporate
1	12/1/2002	47	0	0	197814	0	0	0	2003 Corporate
1	12/1/2002	48	0	0	192901	0	0	0	2003 Corporate
1	12/1/2002	49	0	0	186537	0	0	0	2003 Corporate
1	12/1/2002	50	0	0	179247	0	0	0	2003 Corporate
1	12/1/2002	51	0	0	171051	0	0	0	2003 Corporate
1	12/1/2002	52	0	0	161007	0	0	0	2003 Corporate
1	12/1/2002	53	0	0	148170	0	0	0	2003 Corporate
1	12/1/2002	54	0	0	133329	0	0	0	2003 Corporate
1	12/1/2002	55	0.02	2	113892	1722.09	0.02	861.05	2003 Corporate
1	1/1/2003	0	0	0	318058	0	0	0	2003 Corporate

1	1/1/2003	1	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	2	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	3	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	4	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	5	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	6	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	7	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	8	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	9	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	10	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	11	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	12	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	13	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	14	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	15	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	16	0	0	318058	0	0	0	2003 Corporate
1	1/1/2003	17	0	0	318057	0	0	0	2003 Corporate
1	1/1/2003	18	0	0	318056	0	0	0	2003 Corporate
1	1/1/2003	19	0	0	318056	0	0	0	2003 Corporate
1	1/1/2003	20	0	0	318053	0	0	0	2003 Corporate
1	1/1/2003	21	0	0	318053	0	0	0	2003 Corporate
1	1/1/2003	22	0	0	318045	0	0	0	2003 Corporate
1	1/1/2003	23	0	0	318035	0	0	0	2003 Corporate
1	1/1/2003	24	0	0	318030	0	0	0	2003 Corporate
1	1/1/2003	25	0	0	318024	0	0	0	2003 Corporate
1	1/1/2003	26	0	0	318019	0	0	0	2003 Corporate
1	1/1/2003	27	0	0	318007	0	0	0	2003 Corporate
1	1/1/2003	28	0	0	317990	0	0	0	2003 Corporate
1	1/1/2003	29	0	0	317976	0	0	0	2003 Corporate
1	1/1/2003	30	0	0	317957	0	0	0	2003 Corporate
1	1/1/2003	31	0	0	317935	0	0	0	2003 Corporate
1	1/1/2003	32	0	0	317902	0	0	0	2003 Corporate
1	1/1/2003	33	0	0	317869	0	0	0	2003 Corporate
1	1/1/2003	34	0	0	317827	0	0	0	2003 Corporate
1	1/1/2003	35	0	0	317758	0	0	0	2003 Corporate
1	1/1/2003	36	0	0	317655	0	0	0	2003 Corporate
1	1/1/2003	37	0	0	317542	0	0	0	2003 Corporate
1	1/1/2003	38	0	0	317381	0	0	0	2003 Corporate
1	1/1/2003	39	0	0	317140	0	0	0	2003 Corporate
1	1/1/2003	40	0	0	316825	0	0	0	2003 Corporate
1	1/1/2003	41	0	0	316459	0	0	0	2003 Corporate
1	1/1/2003	42	0	0	315624	0	0	0	2003 Corporate
1	1/1/2003	43	0	0	314328	0	0	0	2003 Corporate
1	1/1/2003	44	0	0	312691	0	0	0	2003 Corporate
1	1/1/2003	45	0	1	310290	1343.39	0	1343.39	2003 Corporate
1	1/1/2003	46	0	1	306659	1343.39	0	1343.39	2003 Corporate
1	1/1/2003	47	0	1	300871	1343.39	0	1343.39	2003 Corporate
1	1/1/2003	48	0	1	289977	1343.39	0	1343.39	2003 Corporate
1	1/1/2003	49	0.01	2	276177	1571.27	0.01	785.64	2003 Corporate
1	1/1/2003	50	0.01	2	260983	1571.27	0.01	785.64	2003 Corporate
1	1/1/2003	51	0.01	2	244175	1571.27	0.01	785.64	2003 Corporate
1	1/1/2003	52	0.01	2	223913	1571.27	0.01	785.64	2003 Corporate
1	1/1/2003	53	0.01	3	198761	1611.02	0.01	537.01	2003 Corporate
1	1/1/2003	54	0.02	5	167915	3361.83	0.02	672.37	2003 Corporate
1	2/1/2003	0	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	1	0	0	284313	0	0	0	2003 Corporate

1	2/1/2003	2	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	3	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	4	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	5	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	6	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	7	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	8	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	9	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	10	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	11	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	12	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	13	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	14	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	15	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	16	0	0	284313	0	0	0	2003 Corporate
1	2/1/2003	17	0	0	284310	0	0	0	2003 Corporate
1	2/1/2003	18	0	0	284308	0	0	0	2003 Corporate
1	2/1/2003	19	0	0	284306	0	0	0	2003 Corporate
1	2/1/2003	20	0	0	284303	0	0	0	2003 Corporate
1	2/1/2003	21	0	0	284299	0	0	0	2003 Corporate
1	2/1/2003	22	0	0	284295	0	0	0	2003 Corporate
1	2/1/2003	23	0	0	284289	0	0	0	2003 Corporate
1	2/1/2003	24	0	0	284286	0	0	0	2003 Corporate
1	2/1/2003	25	0	0	284281	0	0	0	2003 Corporate
1	2/1/2003	26	0	0	284268	0	0	0	2003 Corporate
1	2/1/2003	27	0	0	284261	0	0	0	2003 Corporate
1	2/1/2003	28	0	0	284243	0	0	0	2003 Corporate
1	2/1/2003	29	0	0	284219	0	0	0	2003 Corporate
1	2/1/2003	30	0	0	284202	0	0	0	2003 Corporate
1	2/1/2003	31	0	0	284180	0	0	0	2003 Corporate
1	2/1/2003	32	0	0	284155	0	0	0	2003 Corporate
1	2/1/2003	33	0	0	284107	0	0	0	2003 Corporate
1	2/1/2003	34	0	0	284061	0	0	0	2003 Corporate
1	2/1/2003	35	0	0	284009	0	0	0	2003 Corporate
1	2/1/2003	36	0	0	283928	0	0	0	2003 Corporate
1	2/1/2003	37	0	0	283786	0	0	0	2003 Corporate
1	2/1/2003	38	0	0	283623	0	0	0	2003 Corporate
1	2/1/2003	39	0	0	283367	0	0	0	2003 Corporate
1	2/1/2003	40	0	0	283065	0	0	0	2003 Corporate
1	2/1/2003	41	0	0	282606	0	0	0	2003 Corporate
1	2/1/2003	42	0	0	281771	0	0	0	2003 Corporate
1	2/1/2003	43	0	0	280522	0	0	0	2003 Corporate
1	2/1/2003	44	0	0	278836	0	0	0	2003 Corporate
1	2/1/2003	45	0	0	276313	0	0	0	2003 Corporate
1	2/1/2003	46	0	0	272705	0	0	0	2003 Corporate
1	2/1/2003	47	0	0	266617	0	0	0	2003 Corporate
1	2/1/2003	48	0	1	254683	248.01	0	248.01	2003 Corporate
1	2/1/2003	49	0	1	239675	248.01	0	248.01	2003 Corporate
1	2/1/2003	50	0	1	223070	248.01	0	248.01	2003 Corporate
1	2/1/2003	51	0	1	204449	248.01	0	248.01	2003 Corporate
1	2/1/2003	52	0.01	3	181211	1298.42	0.01	432.81	2003 Corporate
1	2/1/2003	53	0.03	5	151419	1493.79	0.01	298.76	2003 Corporate
1	3/1/2003	0	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	1	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	2	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	3	0	0	301743	0	0	0	2003 Corporate



1	3/1/2003	4	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	5	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	6	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	7	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	8	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	9	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	10	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	11	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	12	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	13	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	14	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	15	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	16	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	17	0	0	301743	0	0	0	2003 Corporate
1	3/1/2003	18	0	0	301739	0	0	0	2003 Corporate
1	3/1/2003	19	0	0	301736	0	0	0	2003 Corporate
1	3/1/2003	20	0	0	301734	0	0	0	2003 Corporate
1	3/1/2003	21	0	0	301729	0	0	0	2003 Corporate
1	3/1/2003	22	0	0	301726	0	0	0	2003 Corporate
1	3/1/2003	23	0	0	301719	0	0	0	2003 Corporate
1	3/1/2003	24	0	0	301713	0	0	0	2003 Corporate
1	3/1/2003	25	0	0	301704	0	0	0	2003 Corporate
1	3/1/2003	26	0	0	301691	0	0	0	2003 Corporate
1	3/1/2003	27	0	0	301675	0	0	0	2003 Corporate
1	3/1/2003	28	0	0	301656	0	0	0	2003 Corporate
1	3/1/2003	29	0	0	301627	0	0	0	2003 Corporate
1	3/1/2003	30	0	0	301597	0	0	0	2003 Corporate
1	3/1/2003	31	0	0	301551	0	0	0	2003 Corporate
1	3/1/2003	32	0	0	301509	0	0	0	2003 Corporate
1	3/1/2003	33	0	0	301465	0	0	0	2003 Corporate
1	3/1/2003	34	0	0	301382	0	0	0	2003 Corporate
1	3/1/2003	35	0	0	301280	0	0	0	2003 Corporate
1	3/1/2003	36	0	0	301167	0	0	0	2003 Corporate
1	3/1/2003	37	0	0	300983	0	0	0	2003 Corporate
1	3/1/2003	38	0	0	300745	0	0	0	2003 Corporate
1	3/1/2003	39	0	0	300458	0	0	0	2003 Corporate
1	3/1/2003	40	0	0	300029	0	0	0	2003 Corporate
1	3/1/2003	41	0	0	299402	0	0	0	2003 Corporate
1	3/1/2003	42	0	0	298263	0	0	0	2003 Corporate
1	3/1/2003	43	0	0	296429	0	0	0	2003 Corporate
1	3/1/2003	44	0	1	293984	534.65	0	534.65	2003 Corporate
1	3/1/2003	45	0	1	290487	534.65	0	534.65	2003 Corporate
1	3/1/2003	46	0	1	285232	534.65	0	534.65	2003 Corporate
1	3/1/2003	47	0.01	2	276529	1881.16	0.01	940.58	2003 Corporate
1	3/1/2003	48	0.01	2	259938	1881.16	0.01	940.58	2003 Corporate
1	3/1/2003	49	0.01	2	239398	1881.16	0.01	940.58	2003 Corporate
1	3/1/2003	50	0.01	2	216736	1881.16	0.01	940.58	2003 Corporate
1	3/1/2003	51	0.01	3	191674	1921.11	0.01	640.37	2003 Corporate
1	3/1/2003	52	0.02	4	160300	1954.53	0.01	488.63	2003 Corporate
1	4/1/2003	0	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	1	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	2	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	3	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	4	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	5	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	6	0	0	294260	0	0	0	2003 Corporate

1	4/1/2003	7	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	8	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	9	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	10	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	11	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	12	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	13	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	14	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	15	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	16	0	0	294260	0	0	0	2003 Corporate
1	4/1/2003	17	0	0	294258	0	0	0	2003 Corporate
1	4/1/2003	18	0	0	294255	0	0	0	2003 Corporate
1	4/1/2003	19	0	0	294252	0	0	0	2003 Corporate
1	4/1/2003	20	0	0	294249	0	0	0	2003 Corporate
1	4/1/2003	21	0	0	294245	0	0	0	2003 Corporate
1	4/1/2003	22	0	0	294245	0	0	0	2003 Corporate
1	4/1/2003	23	0	0	294238	0	0	0	2003 Corporate
1	4/1/2003	24	0	0	294234	0	0	0	2003 Corporate
1	4/1/2003	25	0	0	294224	0	0	0	2003 Corporate
1	4/1/2003	26	0	0	294211	0	0	0	2003 Corporate
1	4/1/2003	27	0	0	294201	0	0	0	2003 Corporate
1	4/1/2003	28	0	0	294187	0	0	0	2003 Corporate
1	4/1/2003	29	0	0	294162	0	0	0	2003 Corporate
1	4/1/2003	30	0	0	294132	0	0	0	2003 Corporate
1	4/1/2003	31	0	0	294093	0	0	0	2003 Corporate
1	4/1/2003	32	0	0	294051	0	0	0	2003 Corporate
1	4/1/2003	33	0	0	293998	0	0	0	2003 Corporate
1	4/1/2003	34	0	0	293929	0	0	0	2003 Corporate
1	4/1/2003	35	0	0	293844	0	0	0	2003 Corporate
1	4/1/2003	36	0	0	293648	0	0	0	2003 Corporate
1	4/1/2003	37	0	0	293446	0	0	0	2003 Corporate
1	4/1/2003	38	0	0	293149	0	0	0	2003 Corporate
1	4/1/2003	39	0	0	292733	0	0	0	2003 Corporate
1	4/1/2003	40	0	0	292195	0	0	0	2003 Corporate
1	4/1/2003	41	0	0	291470	0	0	0	2003 Corporate
1	4/1/2003	42	0	0	290162	0	0	0	2003 Corporate
1	4/1/2003	43	0	0	288104	0	0	0	2003 Corporate
1	4/1/2003	44	0	0	285306	0	0	0	2003 Corporate
1	4/1/2003	45	0	1	281377	1473.63	0.01	1473.63	2003 Corporate
1	4/1/2003	46	0	1	275386	1473.63	0.01	1473.63	2003 Corporate
1	4/1/2003	47	0.01	2	265334	1634.06	0.01	817.03	2003 Corporate
1	4/1/2003	48	0.02	4	246447	2522.76	0.01	630.69	2003 Corporate
1	4/1/2003	49	0.02	4	221531	2522.76	0.01	630.69	2003 Corporate
1	4/1/2003	50	0.02	5	192857	2614.13	0.01	522.83	2003 Corporate
1	4/1/2003	51	0.06	11	160039	3392.46	0.01	308.41	2003 Corporate
1	5/1/2003	0	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	1	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	2	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	3	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	4	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	5	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	6	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	7	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	8	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	9	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	10	0	0	288204	0	0	0	2003 Corporate

1	5/1/2003	11	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	12	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	13	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	14	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	15	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	16	0	0	288204	0	0	0	2003 Corporate
1	5/1/2003	17	0	0	288203	0	0	0	2003 Corporate
1	5/1/2003	18	0	0	288201	0	0	0	2003 Corporate
1	5/1/2003	19	0	0	288196	0	0	0	2003 Corporate
1	5/1/2003	20	0	0	288194	0	0	0	2003 Corporate
1	5/1/2003	21	0	0	288189	0	0	0	2003 Corporate
1	5/1/2003	22	0	0	288177	0	0	0	2003 Corporate
1	5/1/2003	23	0	0	288166	0	0	0	2003 Corporate
1	5/1/2003	24	0	0	288152	0	0	0	2003 Corporate
1	5/1/2003	25	0	0	288141	0	0	0	2003 Corporate
1	5/1/2003	26	0	0	288126	0	0	0	2003 Corporate
1	5/1/2003	27	0	0	288102	0	0	0	2003 Corporate
1	5/1/2003	28	0	0	288075	0	0	0	2003 Corporate
1	5/1/2003	29	0	0	288052	0	0	0	2003 Corporate
1	5/1/2003	30	0	0	288012	0	0	0	2003 Corporate
1	5/1/2003	31	0	0	287972	0	0	0	2003 Corporate
1	5/1/2003	32	0	0	287913	0	0	0	2003 Corporate
1	5/1/2003	33	0	0	287836	0	0	0	2003 Corporate
1	5/1/2003	34	0	0	287769	0	0	0	2003 Corporate
1	5/1/2003	35	0	0	287674	0	0	0	2003 Corporate
1	5/1/2003	36	0	0	287511	0	0	0	2003 Corporate
1	5/1/2003	37	0	0	287234	0	0	0	2003 Corporate
1	5/1/2003	38	0	0	286930	0	0	0	2003 Corporate
1	5/1/2003	39	0	0	286491	0	0	0	2003 Corporate
1	5/1/2003	40	0	0	285818	0	0	0	2003 Corporate
1	5/1/2003	41	0	0	284918	0	0	0	2003 Corporate
1	5/1/2003	42	0	0	283175	0	0	0	2003 Corporate
1	5/1/2003	43	0	0	280476	0	0	0	2003 Corporate
1	5/1/2003	44	0	0	276725	0	0	0	2003 Corporate
1	5/1/2003	45	0	0	271550	0	0	0	2003 Corporate
1	5/1/2003	46	0	0	263901	0	0	0	2003 Corporate
1	5/1/2003	47	0.01	2	251540	682.5	0	341.25	2003 Corporate
1	5/1/2003	48	0.02	4	227843	2954.86	0.01	738.72	2003 Corporate
1	5/1/2003	49	0.02	4	196727	2954.86	0.01	738.72	2003 Corporate
1	5/1/2003	50	0.02	4	159529	2954.86	0.01	738.72	2003 Corporate
1	6/1/2003	0	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	1	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	2	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	3	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	4	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	5	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	6	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	7	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	8	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	9	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	10	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	11	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	12	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	13	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	14	0	0	268815	0	0	0	2003 Corporate
1	6/1/2003	15	0	0	268811	0	0	0	2003 Corporate

1	6/1/2003	16	0	0	268811	0	0	0	2003 Corporate
1	6/1/2003	17	0	0	268810	0	0	0	2003 Corporate
1	6/1/2003	18	0	0	268806	0	0	0	2003 Corporate
1	6/1/2003	19	0	0	268803	0	0	0	2003 Corporate
1	6/1/2003	20	0	0	268800	0	0	0	2003 Corporate
1	6/1/2003	21	0	0	268793	0	0	0	2003 Corporate
1	6/1/2003	22	0	0	268790	0	0	0	2003 Corporate
1	6/1/2003	23	0	0	268787	0	0	0	2003 Corporate
1	6/1/2003	24	0	0	268781	0	0	0	2003 Corporate
1	6/1/2003	25	0	0	268773	0	0	0	2003 Corporate
1	6/1/2003	26	0	0	268759	0	0	0	2003 Corporate
1	6/1/2003	27	0	0	268734	0	0	0	2003 Corporate
1	6/1/2003	28	0	0	268699	0	0	0	2003 Corporate
1	6/1/2003	29	0	0	268673	0	0	0	2003 Corporate
1	6/1/2003	30	0	0	268625	0	0	0	2003 Corporate
1	6/1/2003	31	0	0	268576	0	0	0	2003 Corporate
1	6/1/2003	32	0	0	268512	0	0	0	2003 Corporate
1	6/1/2003	33	0	0	268428	0	0	0	2003 Corporate
1	6/1/2003	34	0	0	268329	0	0	0	2003 Corporate
1	6/1/2003	35	0	0	268162	0	0	0	2003 Corporate
1	6/1/2003	36	0	0	267922	0	0	0	2003 Corporate
1	6/1/2003	37	0	0	267587	0	0	0	2003 Corporate
1	6/1/2003	38	0	0	267145	0	0	0	2003 Corporate
1	6/1/2003	39	0	0	266581	0	0	0	2003 Corporate
1	6/1/2003	40	0	0	265828	0	0	0	2003 Corporate
1	6/1/2003	41	0	0	264634	0	0	0	2003 Corporate
1	6/1/2003	42	0	0	262554	0	0	0	2003 Corporate
1	6/1/2003	43	0	0	259587	0	0	0	2003 Corporate
1	6/1/2003	44	0	0	255595	0	0	0	2003 Corporate
1	6/1/2003	45	0	1	249836	64.02	0	64.02	2003 Corporate
1	6/1/2003	46	0.01	2	241467	109.2	0	54.6	2003 Corporate
1	6/1/2003	47	0.02	4	227373	722.12	0	180.53	2003 Corporate
1	6/1/2003	48	0.02	4	199411	722.12	0	180.53	2003 Corporate
1	6/1/2003	49	0.02	4	161336	722.12	0	180.53	2003 Corporate
1	7/1/2003	0	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	1	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	2	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	3	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	4	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	5	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	6	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	7	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	8	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	9	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	10	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	11	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	12	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	13	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	14	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	15	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	16	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	17	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	18	0	0	106711	0	0	0	2003 Corporate
1	7/1/2003	19	0	0	106709	0	0	0	2003 Corporate
1	7/1/2003	20	0	0	106707	0	0	0	2003 Corporate
1	7/1/2003	21	0	0	106707	0	0	0	2003 Corporate

1	7/1/2003	22	0	0	106704	0	0	0	2003 Corporate
1	7/1/2003	23	0	0	106702	0	0	0	2003 Corporate
1	7/1/2003	24	0	0	106699	0	0	0	2003 Corporate
1	7/1/2003	25	0	0	106695	0	0	0	2003 Corporate
1	7/1/2003	26	0	0	106689	0	0	0	2003 Corporate
1	7/1/2003	27	0	0	106677	0	0	0	2003 Corporate
1	7/1/2003	28	0	0	106658	0	0	0	2003 Corporate
1	7/1/2003	29	0	0	106648	0	0	0	2003 Corporate
1	7/1/2003	30	0	0	106626	0	0	0	2003 Corporate
1	7/1/2003	31	0	0	106596	0	0	0	2003 Corporate
1	7/1/2003	32	0	0	106565	0	0	0	2003 Corporate
1	7/1/2003	33	0	0	106511	0	0	0	2003 Corporate
1	7/1/2003	34	0	0	106454	0	0	0	2003 Corporate
1	7/1/2003	35	0	0	106382	0	0	0	2003 Corporate
1	7/1/2003	36	0	0	106286	0	0	0	2003 Corporate
1	7/1/2003	37	0	0	106128	0	0	0	2003 Corporate
1	7/1/2003	38	0	0	105928	0	0	0	2003 Corporate
1	7/1/2003	39	0	0	105609	0	0	0	2003 Corporate
1	7/1/2003	40	0	0	105199	0	0	0	2003 Corporate
1	7/1/2003	41	0	0	104601	0	0	0	2003 Corporate
1	7/1/2003	42	0	0	103640	0	0	0	2003 Corporate
1	7/1/2003	43	0	0	102026	0	0	0	2003 Corporate
1	7/1/2003	44	0	0	99881	0	0	0	2003 Corporate
1	7/1/2003	45	0	0	96816	0	0	0	2003 Corporate
1	7/1/2003	46	0.02	2	91858	1700.02	0.02	850.01	2003 Corporate
1	7/1/2003	47	0.02	2	83063	1700.02	0.02	850.01	2003 Corporate
1	7/1/2003	48	0.05	4	64471	3130.14	0.04	782.54	2003 Corporate
1	8/1/2003	0	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	1	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	2	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	3	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	4	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	5	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	6	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	7	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	8	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	9	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	10	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	11	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	12	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	13	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	14	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	15	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	16	0	0	60791	0	0	0	2003 Corporate
1	8/1/2003	17	0	0	60788	0	0	0	2003 Corporate
1	8/1/2003	18	0	0	60786	0	0	0	2003 Corporate
1	8/1/2003	19	0	0	60785	0	0	0	2003 Corporate
1	8/1/2003	20	0	0	60782	0	0	0	2003 Corporate
1	8/1/2003	21	0	0	60782	0	0	0	2003 Corporate
1	8/1/2003	22	0	0	60782	0	0	0	2003 Corporate
1	8/1/2003	23	0	0	60780	0	0	0	2003 Corporate
1	8/1/2003	24	0	0	60778	0	0	0	2003 Corporate
1	8/1/2003	25	0	0	60764	0	0	0	2003 Corporate
1	8/1/2003	26	0	0	60755	0	0	0	2003 Corporate
1	8/1/2003	27	0	0	60737	0	0	0	2003 Corporate
1	8/1/2003	28	0	0	60719	0	0	0	2003 Corporate

1	8/1/2003	29	0	0	60697	0	0	0	2003 Corporate
1	8/1/2003	30	0	0	60668	0	0	0	2003 Corporate
1	8/1/2003	31	0	0	60640	0	0	0	2003 Corporate
1	8/1/2003	32	0	0	60612	0	0	0	2003 Corporate
1	8/1/2003	33	0	0	60582	0	0	0	2003 Corporate
1	8/1/2003	34	0	0	60548	0	0	0	2003 Corporate
1	8/1/2003	35	0	0	60505	0	0	0	2003 Corporate
1	8/1/2003	36	0	0	60410	0	0	0	2003 Corporate
1	8/1/2003	37	0	0	60237	0	0	0	2003 Corporate
1	8/1/2003	38	0	0	60050	0	0	0	2003 Corporate
1	8/1/2003	39	0	0	59697	0	0	0	2003 Corporate
1	8/1/2003	40	0	0	59209	0	0	0	2003 Corporate
1	8/1/2003	41	0	0	58523	0	0	0	2003 Corporate
1	8/1/2003	42	0	0	57290	0	0	0	2003 Corporate
1	8/1/2003	43	0	0	55155	0	0	0	2003 Corporate
1	8/1/2003	44	0	0	52350	0	0	0	2003 Corporate
1	8/1/2003	45	0	0	48406	0	0	0	2003 Corporate
1	8/1/2003	46	0.02	1	42889	462.05	0.01	462.05	2003 Corporate
1	8/1/2003	47	0.02	1	34953	462.05	0.01	462.05	2003 Corporate
1	9/1/2003	0	0	0	13088			0	2003 Corporate
1	9/1/2003	1	0	0	13088			0	2003 Corporate
1	9/1/2003	2	0	0	13088			0	2003 Corporate
1	9/1/2003	3	0	0	13088			0	2003 Corporate
1	9/1/2003	4	0	0	13088			0	2003 Corporate
1	9/1/2003	5	0	0	13088			0	2003 Corporate
1	9/1/2003	6	0	0	13088			0	2003 Corporate
1	9/1/2003	7	0	0	13088			0	2003 Corporate
1	9/1/2003	8	0	0	13088			0	2003 Corporate
1	9/1/2003	9	0	0	13088			0	2003 Corporate
1	9/1/2003	10	0	0	13088			0	2003 Corporate
1	9/1/2003	11	0	0	13088			0	2003 Corporate
1	9/1/2003	12	0	0	13088			0	2003 Corporate
1	9/1/2003	13	0	0	13088			0	2003 Corporate
1	9/1/2003	14	0	0	13088			0	2003 Corporate
1	9/1/2003	15	0	0	13088			0	2003 Corporate
1	9/1/2003	16	0	0	13088			0	2003 Corporate
1	9/1/2003	17	0	0	13088			0	2003 Corporate
1	9/1/2003	18	0	0	13088			0	2003 Corporate
1	9/1/2003	19	0	0	13088			0	2003 Corporate
1	9/1/2003	20	0	0	13087			0	2003 Corporate
1	9/1/2003	21	0	0	13086			0	2003 Corporate
1	9/1/2003	22	0	0	13085			0	2003 Corporate
1	9/1/2003	23	0	0	13085			0	2003 Corporate
1	9/1/2003	24	0	0	13083			0	2003 Corporate
1	9/1/2003	25	0	0	13082			0	2003 Corporate
1	9/1/2003	26	0	0	13074			0	2003 Corporate
1	9/1/2003	27	0	0	13066			0	2003 Corporate
1	9/1/2003	28	0	0	13057			0	2003 Corporate
1	9/1/2003	29	0	0	13044			0	2003 Corporate
1	9/1/2003	30	0	0	13033			0	2003 Corporate
1	9/1/2003	31	0	0	13026			0	2003 Corporate
1	9/1/2003	32	0	0	13013			0	2003 Corporate
1	9/1/2003	33	0	0	13002			0	2003 Corporate
1	9/1/2003	34	0	0	12985			0	2003 Corporate
1	9/1/2003	35	0	0	12968			0	2003 Corporate
1	9/1/2003	36	0	0	12926			0	2003 Corporate

1	9/1/2003	37	0	12841				2003 Corporate
1	9/1/2003	38	0	12761				2003 Corporate
1	9/1/2003	39	0	12626				2003 Corporate
1	9/1/2003	40	0	12404				2003 Corporate
1	9/1/2003	41	0	12103				2003 Corporate
1	9/1/2003	42	0	11492				2003 Corporate
1	9/1/2003	43	0	10588				2003 Corporate
1	9/1/2003	44	0	9455				2003 Corporate
1	9/1/2003	45	0	7834				2003 Corporate
1	9/1/2003	46	0	5817				2003 Corporate
2		0	0	2980608	0	0	0	2004 Corporate
2		1	0	2980608	0	0	0	2004 Corporate
2		2	0	2980608	0	0	0	2004 Corporate
2		3	0	2980608	0	0	0	2004 Corporate
2		4	0	2980600	0	0	0	2004 Corporate
2		5	0	2980572	0	0	0	2004 Corporate
2		6	0	2980520	0	0	0	2004 Corporate
2		7	0	2980474	0	0	0	2004 Corporate
2		8	0	2980419	0	0	0	2004 Corporate
2		9	0	2980358	0	0	0	2004 Corporate
2		10	0	2980277	0	0	0	2004 Corporate
2		11	0	2980128	0	0	0	2004 Corporate
2		12	0	2979945	0	0	0	2004 Corporate
2		13	0	2979768	0	0	0	2004 Corporate
2		14	0	2979580	0	0	0	2004 Corporate
2		15	0	2979348	0	0	0	2004 Corporate
2		16	0	2979048	0	0	0	2004 Corporate
2		17	0	2978546	0	0	0	2004 Corporate
2		18	0	2978027	68.73	0	68.73	2004 Corporate
2		19	0	2977495	68.73	0	68.73	2004 Corporate
2		20	0	2976840	68.73	0	68.73	2004 Corporate
2		21	0	2976189	68.73	0	68.73	2004 Corporate
2		22	0	2975384	68.73	0	68.73	2004 Corporate
2		23	0	2974284	68.73	0	68.73	2004 Corporate
2		24	0	2972694	68.73	0	68.73	2004 Corporate
2		25	0	2970123	68.73	0	68.73	2004 Corporate
2		26	0	2966824	217.56	0	108.78	2004 Corporate
2		27	0	2963156	217.56	0	108.78	2004 Corporate
2		28	0	2957896	786.94	0	262.31	2004 Corporate
2		29	0	2949090	3613.14	0	602.19	2004 Corporate
2		30	0	2934704	4216.19	0	468.47	2004 Corporate
2		31	0	2914636	5098.93	0	424.91	2004 Corporate
2		32	0.01	2888078	8874.21	0	522.01	2004 Corporate
2		33	0.01	2838259	12130.8	0	449.29	2004 Corporate
2		34	0.01	2771431	16565.02	0.01	424.74	2004 Corporate
2		35	0.02	2673185	19876.38	0.01	361.39	2004 Corporate
2		36	0.03	2491264	28722.8	0.01	388.15	2004 Corporate
2		37	0.03	2301396	34486.07	0.01	383.18	2004 Corporate
2		38	0.04	2060590	36842.86	0.01	387.82	2004 Corporate
2		39	0.04	1822586	38728.54	0.02	399.26	2004 Corporate
2		40	0.04	1565138	41760.02	0.02	409.41	2004 Corporate
2		41	0.05	1298905	47211.43	0.02	429.19	2004 Corporate
2		42	0.05	1043693	52542.44	0.03	456.89	2004 Corporate
2		43	0.06	806845	55412.64	0.03	457.96	2004 Corporate
2		44	0.06	617908	59154.03	0.04	477.05	2004 Corporate
2		45	0.07	422557	63190.49	0.05	501.51	2004 Corporate

2	46	0.08	128	227423	65238.62	0.05	509.68	2004 Corporate
2	47	0.08	128	97275	65238.62	0.05	509.68	2004 Corporate
2	48	0.08	128	27071	65238.62	0.05	509.68	2004 Corporate
2	49	0.08	128	8900	65238.62	0.05	509.68	2004 Corporate
2	50	0.08	128	1940	65238.62	0.05	509.68	2004 Corporate
2	51	0.08	128	1148	65238.62	0.05	509.68	2004 Corporate
2	52	0.08	128	488	65238.62	0.05	509.68	2004 Corporate
2	53	0.08	128	176	65238.62	0.05	509.68	2004 Corporate
2 12/1/2002	0	0		244		0		2004 Corporate
2 12/1/2002	1	0		244		0		2004 Corporate
2 12/1/2002	2	0		244		0		2004 Corporate
2 12/1/2002	3	0		244		0		2004 Corporate
2 12/1/2002	4	0		244		0		2004 Corporate
2 12/1/2002	5	0		244		0		2004 Corporate
2 12/1/2002	6	0		244		0		2004 Corporate
2 12/1/2002	7	0		244		0		2004 Corporate
2 12/1/2002	8	0		244		0		2004 Corporate
2 12/1/2002	9	0		244		0		2004 Corporate
2 12/1/2002	10	0		244		0		2004 Corporate
2 12/1/2002	11	0		244		0		2004 Corporate
2 12/1/2002	12	0		244		0		2004 Corporate
2 12/1/2002	13	0		244		0		2004 Corporate
2 12/1/2002	14	0		244		0		2004 Corporate
2 12/1/2002	15	0		244		0		2004 Corporate
2 12/1/2002	16	0		244		0		2004 Corporate
2 12/1/2002	17	0		244		0		2004 Corporate
2 12/1/2002	18	0		244		0		2004 Corporate
2 12/1/2002	19	0		244		0		2004 Corporate
2 12/1/2002	20	0		244		0		2004 Corporate
2 12/1/2002	21	0		244		0		2004 Corporate
2 12/1/2002	22	0		244		0		2004 Corporate
2 12/1/2002	23	0		244		0		2004 Corporate
2 12/1/2002	24	0		244		0		2004 Corporate
2 12/1/2002	25	0		243		0		2004 Corporate
2 12/1/2002	26	0		243		0		2004 Corporate
2 12/1/2002	27	0		243		0		2004 Corporate
2 12/1/2002	28	0		243		0		2004 Corporate
2 12/1/2002	29	0		243		0		2004 Corporate
2 12/1/2002	30	0		242		0		2004 Corporate
2 12/1/2002	31	0		242		0		2004 Corporate
2 12/1/2002	32	0		241		0		2004 Corporate
2 12/1/2002	33	0		241		0		2004 Corporate
2 12/1/2002	34	0		239		0		2004 Corporate
2 12/1/2002	35	0		238		0		2004 Corporate
2 12/1/2002	36	0		236		0		2004 Corporate
2 12/1/2002	37	0		235		0		2004 Corporate
2 12/1/2002	38	0		228		0		2004 Corporate
2 12/1/2002	39	0		222		0		2004 Corporate
2 12/1/2002	40	0		215		0		2004 Corporate
2 12/1/2002	41	0		209		0		2004 Corporate
2 12/1/2002	42	0		198		0		2004 Corporate
2 12/1/2002	43	0		186		0		2004 Corporate
2 12/1/2002	44	0		173		0		2004 Corporate
2 12/1/2002	45	0		159		0		2004 Corporate
2 12/1/2002	46	0		146		0		2004 Corporate
2 12/1/2002	47	0		128		0		2004 Corporate



2 12/1/2002	48	0	120	0	2004 Corporate
2 12/1/2002	49	0	101	0	2004 Corporate
2 1/1/2003	0	0	396	0	2004 Corporate
2 1/1/2003	1	0	396	0	2004 Corporate
2 1/1/2003	2	0	396	0	2004 Corporate
2 1/1/2003	3	0	396	0	2004 Corporate
2 1/1/2003	4	0	396	0	2004 Corporate
2 1/1/2003	5	0	396	0	2004 Corporate
2 1/1/2003	6	0	396	0	2004 Corporate
2 1/1/2003	7	0	396	0	2004 Corporate
2 1/1/2003	8	0	396	0	2004 Corporate
2 1/1/2003	9	0	396	0	2004 Corporate
2 1/1/2003	10	0	396	0	2004 Corporate
2 1/1/2003	11	0	396	0	2004 Corporate
2 1/1/2003	12	0	396	0	2004 Corporate
2 1/1/2003	13	0	396	0	2004 Corporate
2 1/1/2003	14	0	396	0	2004 Corporate
2 1/1/2003	15	0	396	0	2004 Corporate
2 1/1/2003	16	0	396	0	2004 Corporate
2 1/1/2003	17	0	396	0	2004 Corporate
2 1/1/2003	18	0	395	0	2004 Corporate
2 1/1/2003	19	0	395	0	2004 Corporate
2 1/1/2003	20	0	395	0	2004 Corporate
2 1/1/2003	21	0	395	0	2004 Corporate
2 1/1/2003	22	0	395	0	2004 Corporate
2 1/1/2003	23	0	395	0	2004 Corporate
2 1/1/2003	24	0	395	0	2004 Corporate
2 1/1/2003	25	0	394	0	2004 Corporate
2 1/1/2003	26	0	394	0	2004 Corporate
2 1/1/2003	27	0	394	0	2004 Corporate
2 1/1/2003	28	0	394	0	2004 Corporate
2 1/1/2003	29	0	394	0	2004 Corporate
2 1/1/2003	30	0	390	0	2004 Corporate
2 1/1/2003	31	0	388	0	2004 Corporate
2 1/1/2003	32	0	388	0	2004 Corporate
2 1/1/2003	33	0	384	0	2004 Corporate
2 1/1/2003	34	0	382	0	2004 Corporate
2 1/1/2003	35	0	378	0	2004 Corporate
2 1/1/2003	36	0	374	0	2004 Corporate
2 1/1/2003	37	0	372	0	2004 Corporate
2 1/1/2003	38	0	362	0	2004 Corporate
2 1/1/2003	39	0	355	0	2004 Corporate
2 1/1/2003	40	0	344	0	2004 Corporate
2 1/1/2003	41	0	328	0	2004 Corporate
2 1/1/2003	42	0	316	0	2004 Corporate
2 1/1/2003	43	0	294	0	2004 Corporate
2 1/1/2003	44	0	279	0	2004 Corporate
2 1/1/2003	45	0	260	0	2004 Corporate
2 1/1/2003	46	0	236	0	2004 Corporate
2 1/1/2003	47	0	224	0	2004 Corporate
2 1/1/2003	48	0	198	0	2004 Corporate
2 1/1/2003	49	0	186	0	2004 Corporate
2 1/1/2003	50	0	148	0	2004 Corporate
2 1/1/2003	51	0	123	0	2004 Corporate
2 2/1/2003	0	0	443	0	2004 Corporate
2 2/1/2003	1	0	443	0	2004 Corporate

2	2/1/2003	2	0	443	0	2004 Corporate
2	2/1/2003	3	0	443	0	2004 Corporate
2	2/1/2003	4	0	443	0	2004 Corporate
2	2/1/2003	5	0	443	0	2004 Corporate
2	2/1/2003	6	0	443	0	2004 Corporate
2	2/1/2003	7	0	443	0	2004 Corporate
2	2/1/2003	8	0	443	0	2004 Corporate
2	2/1/2003	9	0	443	0	2004 Corporate
2	2/1/2003	10	0	443	0	2004 Corporate
2	2/1/2003	11	0	443	0	2004 Corporate
2	2/1/2003	12	0	443	0	2004 Corporate
2	2/1/2003	13	0	443	0	2004 Corporate
2	2/1/2003	14	0	443	0	2004 Corporate
2	2/1/2003	15	0	443	0	2004 Corporate
2	2/1/2003	16	0	443	0	2004 Corporate
2	2/1/2003	17	0	443	0	2004 Corporate
2	2/1/2003	18	0	443	0	2004 Corporate
2	2/1/2003	19	0	443	0	2004 Corporate
2	2/1/2003	20	0	443	0	2004 Corporate
2	2/1/2003	21	0	443	0	2004 Corporate
2	2/1/2003	22	0	442	0	2004 Corporate
2	2/1/2003	23	0	442	0	2004 Corporate
2	2/1/2003	24	0	442	0	2004 Corporate
2	2/1/2003	25	0	442	0	2004 Corporate
2	2/1/2003	26	0	442	0	2004 Corporate
2	2/1/2003	27	0	441	0	2004 Corporate
2	2/1/2003	28	0	441	0	2004 Corporate
2	2/1/2003	29	0	441	0	2004 Corporate
2	2/1/2003	30	0	440	0	2004 Corporate
2	2/1/2003	31	0	440	0	2004 Corporate
2	2/1/2003	32	0	439	0	2004 Corporate
2	2/1/2003	33	0	435	0	2004 Corporate
2	2/1/2003	34	0	432	0	2004 Corporate
2	2/1/2003	35	0	431	0	2004 Corporate
2	2/1/2003	36	0	427	0	2004 Corporate
2	2/1/2003	37	0	424	0	2004 Corporate
2	2/1/2003	38	0	422	0	2004 Corporate
2	2/1/2003	39	0	421	0	2004 Corporate
2	2/1/2003	40	0	416	0	2004 Corporate
2	2/1/2003	41	0	409	0	2004 Corporate
2	2/1/2003	42	0	398	0	2004 Corporate
2	2/1/2003	43	0	388	0	2004 Corporate
2	2/1/2003	44	0	373	0	2004 Corporate
2	2/1/2003	45	0	365	0	2004 Corporate
2	2/1/2003	46	0	348	0	2004 Corporate
2	2/1/2003	47	0	339	0	2004 Corporate
2	2/1/2003	48	0	252	0	2004 Corporate
2	2/1/2003	49	0	234	0	2004 Corporate
2	2/1/2003	50	0	209	0	2004 Corporate
2	2/1/2003	51	0	171	0	2004 Corporate
2	2/1/2003	52	0	131	0	2004 Corporate
2	3/1/2003	0	0	679	0	2004 Corporate
2	3/1/2003	1	0	679	0	2004 Corporate
2	3/1/2003	2	0	679	0	2004 Corporate
2	3/1/2003	3	0	679	0	2004 Corporate
2	3/1/2003	4	0	679	0	2004 Corporate

2	3/1/2003	5	0	679	0	2004 Corporate
2	3/1/2003	6	0	679	0	2004 Corporate
2	3/1/2003	7	0	679	0	2004 Corporate
2	3/1/2003	8	0	679	0	2004 Corporate
2	3/1/2003	9	0	679	0	2004 Corporate
2	3/1/2003	10	0	679	0	2004 Corporate
2	3/1/2003	11	0	679	0	2004 Corporate
2	3/1/2003	12	0	679	0	2004 Corporate
2	3/1/2003	13	0	679	0	2004 Corporate
2	3/1/2003	14	0	679	0	2004 Corporate
2	3/1/2003	15	0	679	0	2004 Corporate
2	3/1/2003	16	0	679	0	2004 Corporate
2	3/1/2003	17	0	679	0	2004 Corporate
2	3/1/2003	18	0	679	0	2004 Corporate
2	3/1/2003	19	0	679	0	2004 Corporate
2	3/1/2003	20	0	678	0	2004 Corporate
2	3/1/2003	21	0	678	0	2004 Corporate
2	3/1/2003	22	0	678	0	2004 Corporate
2	3/1/2003	23	0	677	0	2004 Corporate
2	3/1/2003	24	0	677	0	2004 Corporate
2	3/1/2003	25	0	677	0	2004 Corporate
2	3/1/2003	26	0	677	0	2004 Corporate
2	3/1/2003	27	0	676	0	2004 Corporate
2	3/1/2003	28	0	676	0	2004 Corporate
2	3/1/2003	29	0	674	0	2004 Corporate
2	3/1/2003	30	0	669	0	2004 Corporate
2	3/1/2003	31	0	669	0	2004 Corporate
2	3/1/2003	32	0	668	0	2004 Corporate
2	3/1/2003	33	0	665	0	2004 Corporate
2	3/1/2003	34	0	664	0	2004 Corporate
2	3/1/2003	35	0	659	0	2004 Corporate
2	3/1/2003	36	0	657	0	2004 Corporate
2	3/1/2003	37	0	654	0	2004 Corporate
2	3/1/2003	38	0	648	0	2004 Corporate
2	3/1/2003	39	0	641	0	2004 Corporate
2	3/1/2003	40	0	629	0	2004 Corporate
2	3/1/2003	41	0	610	0	2004 Corporate
2	3/1/2003	42	0	596	0	2004 Corporate
2	3/1/2003	43	0	576	0	2004 Corporate
2	3/1/2003	44	0	559	0	2004 Corporate
2	3/1/2003	45	0	542	0	2004 Corporate
2	3/1/2003	46	0	523	0	2004 Corporate
2	3/1/2003	47	0	501	0	2004 Corporate
2	3/1/2003	48	0	393	0	2004 Corporate
2	3/1/2003	49	0	353	0	2004 Corporate
2	3/1/2003	50	0	305	0	2004 Corporate
2	3/1/2003	51	0	249	0	2004 Corporate
2	3/1/2003	52	0	204	0	2004 Corporate
2	4/1/2003	0	0	1413	0	2004 Corporate
2	4/1/2003	1	0	1413	0	2004 Corporate
2	4/1/2003	2	0	1413	0	2004 Corporate
2	4/1/2003	3	0	1413	0	2004 Corporate
2	4/1/2003	4	0	1413	0	2004 Corporate
2	4/1/2003	5	0	1413	0	2004 Corporate
2	4/1/2003	6	0	1413	0	2004 Corporate
2	4/1/2003	7	0	1413	0	2004 Corporate

2	4/1/2003	8	0	1413	0	2004 Corporate
2	4/1/2003	9	0	1413	0	2004 Corporate
2	4/1/2003	10	0	1413	0	2004 Corporate
2	4/1/2003	11	0	1413	0	2004 Corporate
2	4/1/2003	12	0	1413	0	2004 Corporate
2	4/1/2003	13	0	1413	0	2004 Corporate
2	4/1/2003	14	0	1413	0	2004 Corporate
2	4/1/2003	15	0	1413	0	2004 Corporate
2	4/1/2003	16	0	1413	0	2004 Corporate
2	4/1/2003	17	0	1413	0	2004 Corporate
2	4/1/2003	18	0	1413	0	2004 Corporate
2	4/1/2003	19	0	1413	0	2004 Corporate
2	4/1/2003	20	0	1413	0	2004 Corporate
2	4/1/2003	21	0	1412	0	2004 Corporate
2	4/1/2003	22	0	1412	0	2004 Corporate
2	4/1/2003	23	0	1411	0	2004 Corporate
2	4/1/2003	24	0	1410	0	2004 Corporate
2	4/1/2003	25	0	1410	0	2004 Corporate
2	4/1/2003	26	0	1410	0	2004 Corporate
2	4/1/2003	27	0	1407	0	2004 Corporate
2	4/1/2003	28	0	1406	0	2004 Corporate
2	4/1/2003	29	0	1404	0	2004 Corporate
2	4/1/2003	30	0	1402	0	2004 Corporate
2	4/1/2003	31	0	1399	0	2004 Corporate
2	4/1/2003	32	0	1398	0	2004 Corporate
2	4/1/2003	33	0	1393	0	2004 Corporate
2	4/1/2003	34	0	1388	0	2004 Corporate
2	4/1/2003	35	0	1380	0	2004 Corporate
2	4/1/2003	36	0	1363	0	2004 Corporate
2	4/1/2003	37	0	1355	0	2004 Corporate
2	4/1/2003	38	0	1343	0	2004 Corporate
2	4/1/2003	39	0	1328	0	2004 Corporate
2	4/1/2003	40	0	1303	0	2004 Corporate
2	4/1/2003	41	0	1262	0	2004 Corporate
2	4/1/2003	42	0	1222	0	2004 Corporate
2	4/1/2003	43	0	1180	0	2004 Corporate
2	4/1/2003	44	0	1151	0	2004 Corporate
2	4/1/2003	45	0	1112	0	2004 Corporate
2	4/1/2003	46	0	1050	0	2004 Corporate
2	4/1/2003	47	0	998	0	2004 Corporate
2	4/1/2003	48	0	852	0	2004 Corporate
2	4/1/2003	49	0	758	0	2004 Corporate
2	4/1/2003	50	0	646	0	2004 Corporate
2	4/1/2003	51	0	517	0	2004 Corporate
2	5/1/2003	0	0	1817	0	2004 Corporate
2	5/1/2003	1	0	1817	0	2004 Corporate
2	5/1/2003	2	0	1817	0	2004 Corporate
2	5/1/2003	3	0	1817	0	2004 Corporate
2	5/1/2003	4	0	1817	0	2004 Corporate
2	5/1/2003	5	0	1817	0	2004 Corporate
2	5/1/2003	6	0	1817	0	2004 Corporate
2	5/1/2003	7	0	1817	0	2004 Corporate
2	5/1/2003	8	0	1817	0	2004 Corporate
2	5/1/2003	9	0	1817	0	2004 Corporate
2	5/1/2003	10	0	1817	0	2004 Corporate
2	5/1/2003	11	0	1816	0	2004 Corporate

2	5/1/2003	12	0	1816	0	2004 Corporate
2	5/1/2003	13	0	1816	0	2004 Corporate
2	5/1/2003	14	0	1816	0	2004 Corporate
2	5/1/2003	15	0	1815	0	2004 Corporate
2	5/1/2003	16	0	1815	0	2004 Corporate
2	5/1/2003	17	0	1815	0	2004 Corporate
2	5/1/2003	18	0	1814	0	2004 Corporate
2	5/1/2003	19	0	1813	0	2004 Corporate
2	5/1/2003	20	0	1812	0	2004 Corporate
2	5/1/2003	21	0	1812	0	2004 Corporate
2	5/1/2003	22	0	1812	0	2004 Corporate
2	5/1/2003	23	0	1812	0	2004 Corporate
2	5/1/2003	24	0	1812	0	2004 Corporate
2	5/1/2003	25	0	1811	0	2004 Corporate
2	5/1/2003	26	0	1811	0	2004 Corporate
2	5/1/2003	27	0	1811	0	2004 Corporate
2	5/1/2003	28	0	1808	0	2004 Corporate
2	5/1/2003	29	0	1806	0	2004 Corporate
2	5/1/2003	30	0	1804	0	2004 Corporate
2	5/1/2003	31	0	1801	0	2004 Corporate
2	5/1/2003	32	0	1796	0	2004 Corporate
2	5/1/2003	33	0	1778	0	2004 Corporate
2	5/1/2003	34	0	1769	0	2004 Corporate
2	5/1/2003	35	0	1749	0	2004 Corporate
2	5/1/2003	36	0	1735	0	2004 Corporate
2	5/1/2003	37	0	1707	0	2004 Corporate
2	5/1/2003	38	0	1680	0	2004 Corporate
2	5/1/2003	39	0	1654	0	2004 Corporate
2	5/1/2003	40	0	1606	0	2004 Corporate
2	5/1/2003	41	0	1568	0	2004 Corporate
2	5/1/2003	42	0	1507	0	2004 Corporate
2	5/1/2003	43	0	1450	0	2004 Corporate
2	5/1/2003	44	0	1389	0	2004 Corporate
2	5/1/2003	45	0	1317	0	2004 Corporate
2	5/1/2003	46	0	1226	0	2004 Corporate
2	5/1/2003	47	0	1098	0	2004 Corporate
2	5/1/2003	48	0	867	0	2004 Corporate
2	5/1/2003	49	0	730	0	2004 Corporate
2	5/1/2003	50	0	520	0	2004 Corporate
2	6/1/2003	0	0	16543	0	2004 Corporate
2	6/1/2003	1	0	16543	0	2004 Corporate
2	6/1/2003	2	0	16543	0	2004 Corporate
2	6/1/2003	3	0	16543	0	2004 Corporate
2	6/1/2003	4	0	16543	0	2004 Corporate
2	6/1/2003	5	0	16543	0	2004 Corporate
2	6/1/2003	6	0	16543	0	2004 Corporate
2	6/1/2003	7	0	16543	0	2004 Corporate
2	6/1/2003	8	0	16543	0	2004 Corporate
2	6/1/2003	9	0	16543	0	2004 Corporate
2	6/1/2003	10	0	16543	0	2004 Corporate
2	6/1/2003	11	0	16543	0	2004 Corporate
2	6/1/2003	12	0	16543	0	2004 Corporate
2	6/1/2003	13	0	16543	0	2004 Corporate
2	6/1/2003	14	0	16543	0	2004 Corporate
2	6/1/2003	15	0	16543	0	2004 Corporate
2	6/1/2003	16	0	16543	0	2004 Corporate

2	6/1/2003	17	0	16543	0	2004 Corporate
2	6/1/2003	18	0	16543	0	2004 Corporate
2	6/1/2003	19	0	16543	0	2004 Corporate
2	6/1/2003	20	0	16543	0	2004 Corporate
2	6/1/2003	21	0	16543	0	2004 Corporate
2	6/1/2003	22	0	16543	0	2004 Corporate
2	6/1/2003	23	0	16542	0	2004 Corporate
2	6/1/2003	24	0	16540	0	2004 Corporate
2	6/1/2003	25	0	16536	0	2004 Corporate
2	6/1/2003	26	0	16534	0	2004 Corporate
2	6/1/2003	27	0	16529	0	2004 Corporate
2	6/1/2003	28	0	16524	0	2004 Corporate
2	6/1/2003	29	0	16512	0	2004 Corporate
2	6/1/2003	30	0	16498	0	2004 Corporate
2	6/1/2003	31	0	16482	0	2004 Corporate
2	6/1/2003	32	0	16459	0	2004 Corporate
2	6/1/2003	33	0	16408	0	2004 Corporate
2	6/1/2003	34	0	16336	0	2004 Corporate
2	6/1/2003	35	0	16248	0	2004 Corporate
2	6/1/2003	36	0	16064	0	2004 Corporate
2	6/1/2003	37	0	15864	0	2004 Corporate
2	6/1/2003	38	0	15634	0	2004 Corporate
2	6/1/2003	39	0	15365	0	2004 Corporate
2	6/1/2003	40	0	14984	0	2004 Corporate
2	6/1/2003	41	0	14494	0	2004 Corporate
2	6/1/2003	42	0	13940	0	2004 Corporate
2	6/1/2003	43	0	13151	0	2004 Corporate
2	6/1/2003	44	0	12338	0	2004 Corporate
2	6/1/2003	45	0	11382	0	2004 Corporate
2	6/1/2003	46	0	10258	0	2004 Corporate
2	6/1/2003	47	0	9083	0	2004 Corporate
2	6/1/2003	48	0	7777	0	2004 Corporate
2	6/1/2003	49	0	6508	0	2004 Corporate
2	7/1/2003	0	0	54224	0	2004 Corporate
2	7/1/2003	1	0	54224	0	2004 Corporate
2	7/1/2003	2	0	54224	0	2004 Corporate
2	7/1/2003	3	0	54224	0	2004 Corporate
2	7/1/2003	4	0	54224	0	2004 Corporate
2	7/1/2003	5	0	54224	0	2004 Corporate
2	7/1/2003	6	0	54224	0	2004 Corporate
2	7/1/2003	7	0	54224	0	2004 Corporate
2	7/1/2003	8	0	54224	0	2004 Corporate
2	7/1/2003	9	0	54224	0	2004 Corporate
2	7/1/2003	10	0	54224	0	2004 Corporate
2	7/1/2003	11	0	54224	0	2004 Corporate
2	7/1/2003	12	0	54223	0	2004 Corporate
2	7/1/2003	13	0	54221	0	2004 Corporate
2	7/1/2003	14	0	54220	0	2004 Corporate
2	7/1/2003	15	0	54220	0	2004 Corporate
2	7/1/2003	16	0	54218	0	2004 Corporate
2	7/1/2003	17	0	54217	0	2004 Corporate
2	7/1/2003	18	0	54214	0	2004 Corporate
2	7/1/2003	19	0	54211	0	2004 Corporate
2	7/1/2003	20	0	54207	0	2004 Corporate
2	7/1/2003	21	0	54207	0	2004 Corporate
2	7/1/2003	22	0	54205	0	2004 Corporate

2	7/1/2003	23	0	54198	0	0	2004 Corporate
2	7/1/2003	24	0	54187	0	0	2004 Corporate
2	7/1/2003	25	0	54170	0	0	2004 Corporate
2	7/1/2003	26	0	54152	0	0	2004 Corporate
2	7/1/2003	27	0	54129	0	0	2004 Corporate
2	7/1/2003	28	0	54095	0	0	2004 Corporate
2	7/1/2003	29	0	54050	0	0	2004 Corporate
2	7/1/2003	30	0	53969	0	0	2004 Corporate
2	7/1/2003	31	0	53887	0	0	2004 Corporate
2	7/1/2003	32	0	53775	0	0	2004 Corporate
2	7/1/2003	33	0	53561	0	0	2004 Corporate
2	7/1/2003	34	0	53254	0	0	2004 Corporate
2	7/1/2003	35	0	52849	0	0	2004 Corporate
2	7/1/2003	36	0	51982	0	0	2004 Corporate
2	7/1/2003	37	0	51057	0	0	2004 Corporate
2	7/1/2003	38	0	50016	0	0	2004 Corporate
2	7/1/2003	39	0	48908	0	0	2004 Corporate
2	7/1/2003	40	0	47433	0	0	2004 Corporate
2	7/1/2003	41	0	45744	0	0	2004 Corporate
2	7/1/2003	42	0	43571	0	0	2004 Corporate
2	7/1/2003	43	0	40734	0	0	2004 Corporate
2	7/1/2003	44	0	37642	0	0	2004 Corporate
2	7/1/2003	45	0	33812	0	0	2004 Corporate
2	7/1/2003	46	0	28899	0	0	2004 Corporate
2	7/1/2003	47	0	23343	0	0	2004 Corporate
2	7/1/2003	48	0	16580	0	0	2004 Corporate
2	8/1/2003	0	0	180834	0	0	2004 Corporate
2	8/1/2003	1	0	180834	0	0	2004 Corporate
2	8/1/2003	2	0	180834	0	0	2004 Corporate
2	8/1/2003	3	0	180834	0	0	2004 Corporate
2	8/1/2003	4	0	180834	0	0	2004 Corporate
2	8/1/2003	5	0	180834	0	0	2004 Corporate
2	8/1/2003	6	0	180832	0	0	2004 Corporate
2	8/1/2003	7	0	180830	0	0	2004 Corporate
2	8/1/2003	8	0	180827	0	0	2004 Corporate
2	8/1/2003	9	0	180825	0	0	2004 Corporate
2	8/1/2003	10	0	180822	0	0	2004 Corporate
2	8/1/2003	11	0	180819	0	0	2004 Corporate
2	8/1/2003	12	0	180817	0	0	2004 Corporate
2	8/1/2003	13	0	180815	0	0	2004 Corporate
2	8/1/2003	14	0	180812	0	0	2004 Corporate
2	8/1/2003	15	0	180809	0	0	2004 Corporate
2	8/1/2003	16	0	180805	0	0	2004 Corporate
2	8/1/2003	17	0	180794	0	0	2004 Corporate
2	8/1/2003	18	0	180786	0	0	2004 Corporate
2	8/1/2003	19	0	180775	0	0	2004 Corporate
2	8/1/2003	20	0	180762	0	0	2004 Corporate
2	8/1/2003	21	0	180739	0	0	2004 Corporate
2	8/1/2003	22	0	180723	0	0	2004 Corporate
2	8/1/2003	23	0	180706	0	0	2004 Corporate
2	8/1/2003	24	0	180671	0	0	2004 Corporate
2	8/1/2003	25	0	180626	0	0	2004 Corporate
2	8/1/2003	26	0	180562	0	0	2004 Corporate
2	8/1/2003	27	0	180493	0	0	2004 Corporate
2	8/1/2003	28	0	180388	0	0	2004 Corporate
2	8/1/2003	29	0	180184	0	0	2004 Corporate

2	8/1/2003	30	0	0	179790	0	0	0	2004 Corporate
2	8/1/2003	31	0	0	179280	0	0	0	2004 Corporate
2	8/1/2003	32	0	0	178678	0	0	0	2004 Corporate
2	8/1/2003	33	0.01	1	177593	350.9	0	350.9	2004 Corporate
2	8/1/2003	34	0.01	1	176163	350.9	0	350.9	2004 Corporate
2	8/1/2003	35	0.01	2	174184	528	0	264	2004 Corporate
2	8/1/2003	36	0.01	2	170782	528	0	264	2004 Corporate
2	8/1/2003	37	0.02	3	167008	2115.21	0.01	705.07	2004 Corporate
2	8/1/2003	38	0.02	3	162655	2115.21	0.01	705.07	2004 Corporate
2	8/1/2003	39	0.02	3	157561	2115.21	0.01	705.07	2004 Corporate
2	8/1/2003	40	0.02	3	151757	2115.21	0.01	705.07	2004 Corporate
2	8/1/2003	41	0.02	4	144483	4427.58	0.03	1106.9	2004 Corporate
2	8/1/2003	42	0.02	4	135356	4427.58	0.03	1106.9	2004 Corporate
2	8/1/2003	43	0.03	5	124495	5915.97	0.04	1183.19	2004 Corporate
2	8/1/2003	44	0.04	6	113112	8166.61	0.06	1361.1	2004 Corporate
2	8/1/2003	45	0.04	6	97841	8166.61	0.06	1361.1	2004 Corporate
2	8/1/2003	46	0.05	7	80166	9607.72	0.08	1372.53	2004 Corporate
2	8/1/2003	47	0.05	7	61525	9607.72	0.08	1372.53	2004 Corporate
2	9/1/2003	0	0	0	274108	0	0	0	2004 Corporate
2	9/1/2003	1	0	0	274108	0	0	0	2004 Corporate
2	9/1/2003	2	0	0	274108	0	0	0	2004 Corporate
2	9/1/2003	3	0	0	274108	0	0	0	2004 Corporate
2	9/1/2003	4	0	0	274107	0	0	0	2004 Corporate
2	9/1/2003	5	0	0	274107	0	0	0	2004 Corporate
2	9/1/2003	6	0	0	274107	0	0	0	2004 Corporate
2	9/1/2003	7	0	0	274107	0	0	0	2004 Corporate
2	9/1/2003	8	0	0	274105	0	0	0	2004 Corporate
2	9/1/2003	9	0	0	274105	0	0	0	2004 Corporate
2	9/1/2003	10	0	0	274102	0	0	0	2004 Corporate
2	9/1/2003	11	0	0	274096	0	0	0	2004 Corporate
2	9/1/2003	12	0	0	274092	0	0	0	2004 Corporate
2	9/1/2003	13	0	0	274087	0	0	0	2004 Corporate
2	9/1/2003	14	0	0	274082	0	0	0	2004 Corporate
2	9/1/2003	15	0	0	274076	0	0	0	2004 Corporate
2	9/1/2003	16	0	0	274061	0	0	0	2004 Corporate
2	9/1/2003	17	0	0	274016	0	0	0	2004 Corporate
2	9/1/2003	18	0	0	273997	0	0	0	2004 Corporate
2	9/1/2003	19	0	0	273983	0	0	0	2004 Corporate
2	9/1/2003	20	0	0	273960	0	0	0	2004 Corporate
2	9/1/2003	21	0	0	273932	0	0	0	2004 Corporate
2	9/1/2003	22	0	0	273880	0	0	0	2004 Corporate
2	9/1/2003	23	0	0	273811	0	0	0	2004 Corporate
2	9/1/2003	24	0	0	273725	0	0	0	2004 Corporate
2	9/1/2003	25	0	0	273634	0	0	0	2004 Corporate
2	9/1/2003	26	0	0	273511	0	0	0	2004 Corporate
2	9/1/2003	27	0	0	273370	0	0	0	2004 Corporate
2	9/1/2003	28	0	0	273172	0	0	0	2004 Corporate
2	9/1/2003	29	0	1	272820	2550.72	0.01	2550.72	2004 Corporate
2	9/1/2003	30	0	1	272196	2550.72	0.01	2550.72	2004 Corporate
2	9/1/2003	31	0	1	271441	2550.72	0.01	2550.72	2004 Corporate
2	9/1/2003	32	0	1	270420	2550.72	0.01	2550.72	2004 Corporate
2	9/1/2003	33	0	1	268663	2550.72	0.01	2550.72	2004 Corporate
2	9/1/2003	34	0.01	2	266380	2619.88	0.01	1309.94	2004 Corporate
2	9/1/2003	35	0.01	3	263218	2663.86	0.01	887.95	2004 Corporate
2	9/1/2003	36	0.02	6	257619	6542.02	0.02	1090.34	2004 Corporate
2	9/1/2003	37	0.03	7	251353	7108.25	0.03	1015.46	2004 Corporate



2	9/1/2003	38	0.03	7	243879	7108.25	0.03	1015.46	2004 Corporate
2	9/1/2003	39	0.03	7	235088	7108.25	0.03	1015.46	2004 Corporate
2	9/1/2003	40	0.03	7	225020	7108.25	0.03	1015.46	2004 Corporate
2	9/1/2003	41	0.03	7	213024	7108.25	0.03	1015.46	2004 Corporate
2	9/1/2003	42	0.03	8	198108	7179.15	0.03	897.39	2004 Corporate
2	9/1/2003	43	0.03	8	179755	7179.15	0.03	897.39	2004 Corporate
2	9/1/2003	44	0.04	9	159981	8650.8	0.04	961.2	2004 Corporate
2	9/1/2003	45	0.04	9	134936	8650.8	0.04	961.2	2004 Corporate
2	9/1/2003	46	0.05	10	104534	9257.82	0.04	925.78	2004 Corporate
2	10/1/2003	0	0	0	324130	0	0	0	2004 Corporate
2	10/1/2003	1	0	0	324130	0	0	0	2004 Corporate
2	10/1/2003	2	0	0	324130	0	0	0	2004 Corporate
2	10/1/2003	3	0	0	324130	0	0	0	2004 Corporate
2	10/1/2003	4	0	0	324130	0	0	0	2004 Corporate
2	10/1/2003	5	0	0	324129	0	0	0	2004 Corporate
2	10/1/2003	6	0	0	324123	0	0	0	2004 Corporate
2	10/1/2003	7	0	0	324123	0	0	0	2004 Corporate
2	10/1/2003	8	0	0	324122	0	0	0	2004 Corporate
2	10/1/2003	9	0	0	324119	0	0	0	2004 Corporate
2	10/1/2003	10	0	0	324115	0	0	0	2004 Corporate
2	10/1/2003	11	0	0	324114	0	0	0	2004 Corporate
2	10/1/2003	12	0	0	324106	0	0	0	2004 Corporate
2	10/1/2003	13	0	0	324098	0	0	0	2004 Corporate
2	10/1/2003	14	0	0	324089	0	0	0	2004 Corporate
2	10/1/2003	15	0	0	324076	0	0	0	2004 Corporate
2	10/1/2003	16	0	0	324067	0	0	0	2004 Corporate
2	10/1/2003	17	0	0	324009	0	0	0	2004 Corporate
2	10/1/2003	18	0	0	323994	0	0	0	2004 Corporate
2	10/1/2003	19	0	0	323973	0	0	0	2004 Corporate
2	10/1/2003	20	0	0	323950	0	0	0	2004 Corporate
2	10/1/2003	21	0	0	323921	0	0	0	2004 Corporate
2	10/1/2003	22	0	0	323870	0	0	0	2004 Corporate
2	10/1/2003	23	0	0	323827	0	0	0	2004 Corporate
2	10/1/2003	24	0	0	323747	0	0	0	2004 Corporate
2	10/1/2003	25	0	0	323618	0	0	0	2004 Corporate
2	10/1/2003	26	0	0	323447	0	0	0	2004 Corporate
2	10/1/2003	27	0	0	323254	0	0	0	2004 Corporate
2	10/1/2003	28	0	0	322974	0	0	0	2004 Corporate
2	10/1/2003	29	0	0	322497	0	0	0	2004 Corporate
2	10/1/2003	30	0	0	321762	0	0	0	2004 Corporate
2	10/1/2003	31	0	0	320722	0	0	0	2004 Corporate
2	10/1/2003	32	0	0	319383	0	0	0	2004 Corporate
2	10/1/2003	33	0	0	317144	0	0	0	2004 Corporate
2	10/1/2003	34	0	0	314252	0	0	0	2004 Corporate
2	10/1/2003	35	0	1	310301	163.98	0	163.98	2004 Corporate
2	10/1/2003	36	0	1	303107	163.98	0	163.98	2004 Corporate
2	10/1/2003	37	0	1	294740	163.98	0	163.98	2004 Corporate
2	10/1/2003	38	0.01	2	284732	686.12	0	343.06	2004 Corporate
2	10/1/2003	39	0.01	3	272642	2043.03	0.01	681.01	2004 Corporate
2	10/1/2003	40	0.01	3	258825	2043.03	0.01	681.01	2004 Corporate
2	10/1/2003	41	0.01	3	242721	2043.03	0.01	681.01	2004 Corporate
2	10/1/2003	42	0.02	5	223469	5783.52	0.02	1156.7	2004 Corporate
2	10/1/2003	43	0.03	7	199738	6206.1	0.03	886.59	2004 Corporate
2	10/1/2003	44	0.03	7	174419	6206.1	0.03	886.59	2004 Corporate
2	10/1/2003	45	0.04	9	140792	10242.56	0.05	1138.06	2004 Corporate
2	11/1/2003	0	0	0	246332	0	0	0	2004 Corporate

2 11/1/2003	1	0	0	246332	0	0	0	2004 Corporate
2 11/1/2003	2	0	0	246332	0	0	0	2004 Corporate
2 11/1/2003	3	0	0	246332	0	0	0	2004 Corporate
2 11/1/2003	4	0	0	246332	0	0	0	2004 Corporate
2 11/1/2003	5	0	0	246332	0	0	0	2004 Corporate
2 11/1/2003	6	0	0	246330	0	0	0	2004 Corporate
2 11/1/2003	7	0	0	246327	0	0	0	2004 Corporate
2 11/1/2003	8	0	0	246326	0	0	0	2004 Corporate
2 11/1/2003	9	0	0	246324	0	0	0	2004 Corporate
2 11/1/2003	10	0	0	246322	0	0	0	2004 Corporate
2 11/1/2003	11	0	0	246322	0	0	0	2004 Corporate
2 11/1/2003	12	0	0	246317	0	0	0	2004 Corporate
2 11/1/2003	13	0	0	246314	0	0	0	2004 Corporate
2 11/1/2003	14	0	0	246309	0	0	0	2004 Corporate
2 11/1/2003	15	0	0	246304	0	0	0	2004 Corporate
2 11/1/2003	16	0	0	246288	0	0	0	2004 Corporate
2 11/1/2003	17	0	0	246251	0	0	0	2004 Corporate
2 11/1/2003	18	0	0	246236	0	0	0	2004 Corporate
2 11/1/2003	19	0	0	246221	0	0	0	2004 Corporate
2 11/1/2003	20	0	0	246177	0	0	0	2004 Corporate
2 11/1/2003	21	0	0	246150	0	0	0	2004 Corporate
2 11/1/2003	22	0	0	246119	0	0	0	2004 Corporate
2 11/1/2003	23	0	0	246072	0	0	0	2004 Corporate
2 11/1/2003	24	0	0	246009	0	0	0	2004 Corporate
2 11/1/2003	25	0	0	245860	0	0	0	2004 Corporate
2 11/1/2003	26	0	0	245725	0	0	0	2004 Corporate
2 11/1/2003	27	0	0	245583	0	0	0	2004 Corporate
2 11/1/2003	28	0	0	245333	0	0	0	2004 Corporate
2 11/1/2003	29	0	0	244904	0	0	0	2004 Corporate
2 11/1/2003	30	0	0	244195	0	0	0	2004 Corporate
2 11/1/2003	31	0	0	243298	0	0	0	2004 Corporate
2 11/1/2003	32	0	0	242167	0	0	0	2004 Corporate
2 11/1/2003	33	0	1	240217	45.33	0	45.33	2004 Corporate
2 11/1/2003	34	0.01	2	237677	273.05	0	136.53	2004 Corporate
2 11/1/2003	35	0.01	2	234308	273.05	0	136.53	2004 Corporate
2 11/1/2003	36	0.02	4	228017	579.33	0	144.83	2004 Corporate
2 11/1/2003	37	0.02	4	220901	579.33	0	144.83	2004 Corporate
2 11/1/2003	38	0.02	4	212434	579.33	0	144.83	2004 Corporate
2 11/1/2003	39	0.02	4	202258	579.33	0	144.83	2004 Corporate
2 11/1/2003	40	0.02	4	190508	579.33	0	144.83	2004 Corporate
2 11/1/2003	41	0.02	5	176838	994.65	0	198.93	2004 Corporate
2 11/1/2003	42	0.02	5	160629	994.65	0	198.93	2004 Corporate
2 11/1/2003	43	0.04	8	139658	1953.88	0.01	244.24	2004 Corporate
2 11/1/2003	44	0.05	9	116449	1972.98	0.01	219.22	2004 Corporate
2 12/1/2003	0	0	0	226127	0	0	0	2004 Corporate
2 12/1/2003	1	0	0	226127	0	0	0	2004 Corporate
2 12/1/2003	2	0	0	226127	0	0	0	2004 Corporate
2 12/1/2003	3	0	0	226127	0	0	0	2004 Corporate
2 12/1/2003	4	0	0	226127	0	0	0	2004 Corporate
2 12/1/2003	5	0	0	226123	0	0	0	2004 Corporate
2 12/1/2003	6	0	0	226121	0	0	0	2004 Corporate
2 12/1/2003	7	0	0	226119	0	0	0	2004 Corporate
2 12/1/2003	8	0	0	226115	0	0	0	2004 Corporate
2 12/1/2003	9	0	0	226111	0	0	0	2004 Corporate
2 12/1/2003	10	0	0	226103	0	0	0	2004 Corporate
2 12/1/2003	11	0	0	226095	0	0	0	2004 Corporate

2 12/1/2003	12	0	0	226088	0	0	0	2004 Corporate
2 12/1/2003	13	0	0	226083	0	0	0	2004 Corporate
2 12/1/2003	14	0	0	226080	0	0	0	2004 Corporate
2 12/1/2003	15	0	0	226070	0	0	0	2004 Corporate
2 12/1/2003	16	0	0	226062	0	0	0	2004 Corporate
2 12/1/2003	17	0	0	226046	0	0	0	2004 Corporate
2 12/1/2003	18	0	0	226029	0	0	0	2004 Corporate
2 12/1/2003	19	0	0	226006	0	0	0	2004 Corporate
2 12/1/2003	20	0	0	225988	0	0	0	2004 Corporate
2 12/1/2003	21	0	0	225953	0	0	0	2004 Corporate
2 12/1/2003	22	0	0	225926	0	0	0	2004 Corporate
2 12/1/2003	23	0	0	225883	0	0	0	2004 Corporate
2 12/1/2003	24	0	0	225805	0	0	0	2004 Corporate
2 12/1/2003	25	0	0	225709	0	0	0	2004 Corporate
2 12/1/2003	26	0	0	225583	0	0	0	2004 Corporate
2 12/1/2003	27	0	0	225428	0	0	0	2004 Corporate
2 12/1/2003	28	0	0	225198	0	0	0	2004 Corporate
2 12/1/2003	29	0	0	224839	0	0	0	2004 Corporate
2 12/1/2003	30	0	0	224205	0	0	0	2004 Corporate
2 12/1/2003	31	0.01	2	223246	570.18	0	285.09	2004 Corporate
2 12/1/2003	32	0.01	3	222014	2169.41	0.01	723.14	2004 Corporate
2 12/1/2003	33	0.01	3	219849	2169.41	0.01	723.14	2004 Corporate
2 12/1/2003	34	0.01	3	217030	2169.41	0.01	723.14	2004 Corporate
2 12/1/2003	35	0.01	3	213254	2169.41	0.01	723.14	2004 Corporate
2 12/1/2003	36	0.02	4	206374	3745.06	0.02	936.27	2004 Corporate
2 12/1/2003	37	0.02	5	198561	3788.08	0.02	757.62	2004 Corporate
2 12/1/2003	38	0.02	5	189330	3788.08	0.02	757.62	2004 Corporate
2 12/1/2003	39	0.03	6	178342	4316.85	0.02	719.48	2004 Corporate
2 12/1/2003	40	0.04	7	165268	4542.24	0.02	648.89	2004 Corporate
2 12/1/2003	41	0.04	8	149605	5295.09	0.03	661.89	2004 Corporate
2 12/1/2003	42	0.05	9	130319	6779.43	0.04	753.27	2004 Corporate
2 12/1/2003	43	0.05	9	105192	6779.43	0.04	753.27	2004 Corporate
2 1/1/2004	0	0	0	277278	0	0	0	2004 Corporate
2 1/1/2004	1	0	0	277278	0	0	0	2004 Corporate
2 1/1/2004	2	0	0	277278	0	0	0	2004 Corporate
2 1/1/2004	3	0	0	277278	0	0	0	2004 Corporate
2 1/1/2004	4	0	0	277277	0	0	0	2004 Corporate
2 1/1/2004	5	0	0	277277	0	0	0	2004 Corporate
2 1/1/2004	6	0	0	277275	0	0	0	2004 Corporate
2 1/1/2004	7	0	0	277271	0	0	0	2004 Corporate
2 1/1/2004	8	0	0	277266	0	0	0	2004 Corporate
2 1/1/2004	9	0	0	277260	0	0	0	2004 Corporate
2 1/1/2004	10	0	0	277256	0	0	0	2004 Corporate
2 1/1/2004	11	0	0	277250	0	0	0	2004 Corporate
2 1/1/2004	12	0	0	277243	0	0	0	2004 Corporate
2 1/1/2004	13	0	0	277228	0	0	0	2004 Corporate
2 1/1/2004	14	0	0	277218	0	0	0	2004 Corporate
2 1/1/2004	15	0	0	277197	0	0	0	2004 Corporate
2 1/1/2004	16	0	0	277175	0	0	0	2004 Corporate
2 1/1/2004	17	0	0	277105	0	0	0	2004 Corporate
2 1/1/2004	18	0	0	277068	0	0	0	2004 Corporate
2 1/1/2004	19	0	0	277023	0	0	0	2004 Corporate
2 1/1/2004	20	0	0	276970	0	0	0	2004 Corporate
2 1/1/2004	21	0	0	276929	0	0	0	2004 Corporate
2 1/1/2004	22	0	0	276852	0	0	0	2004 Corporate
2 1/1/2004	23	0	0	276772	0	0	0	2004 Corporate

2	1/1/2004	24	0	0	276664	0	0	0	2004 Corporate
2	1/1/2004	25	0	0	276508	0	0	0	2004 Corporate
2	1/1/2004	26	0	0	276274	0	0	0	2004 Corporate
2	1/1/2004	27	0	0	276019	0	0	0	2004 Corporate
2	1/1/2004	28	0	0	275642	0	0	0	2004 Corporate
2	1/1/2004	29	0	0	274999	0	0	0	2004 Corporate
2	1/1/2004	30	0	0	273860	0	0	0	2004 Corporate
2	1/1/2004	31	0	0	272387	0	0	0	2004 Corporate
2	1/1/2004	32	0	1	270504	1275.9	0	1275.9	2004 Corporate
2	1/1/2004	33	0.01	2	267014	1359.25	0.01	679.63	2004 Corporate
2	1/1/2004	34	0.01	3	262674	1587.22	0.01	529.07	2004 Corporate
2	1/1/2004	35	0.02	5	256918	2990.03	0.01	598.01	2004 Corporate
2	1/1/2004	36	0.03	8	246268	4029.52	0.02	503.69	2004 Corporate
2	1/1/2004	37	0.04	9	234070	4259.88	0.02	473.32	2004 Corporate
2	1/1/2004	38	0.04	9	220146	4259.88	0.02	473.32	2004 Corporate
2	1/1/2004	39	0.04	9	203558	4259.88	0.02	473.32	2004 Corporate
2	1/1/2004	40	0.05	11	184523	6958.97	0.03	632.63	2004 Corporate
2	1/1/2004	41	0.06	13	162291	7579.9	0.04	583.07	2004 Corporate
2	1/1/2004	42	0.07	14	134010	7615.18	0.04	543.94	2004 Corporate
2	2/1/2004	0	0	0	279531	0	0	0	2004 Corporate
2	2/1/2004	1	0	0	279531	0	0	0	2004 Corporate
2	2/1/2004	2	0	0	279531	0	0	0	2004 Corporate
2	2/1/2004	3	0	0	279531	0	0	0	2004 Corporate
2	2/1/2004	4	0	0	279530	0	0	0	2004 Corporate
2	2/1/2004	5	0	0	279529	0	0	0	2004 Corporate
2	2/1/2004	6	0	0	279524	0	0	0	2004 Corporate
2	2/1/2004	7	0	0	279521	0	0	0	2004 Corporate
2	2/1/2004	8	0	0	279518	0	0	0	2004 Corporate
2	2/1/2004	9	0	0	279510	0	0	0	2004 Corporate
2	2/1/2004	10	0	0	279498	0	0	0	2004 Corporate
2	2/1/2004	11	0	0	279491	0	0	0	2004 Corporate
2	2/1/2004	12	0	0	279482	0	0	0	2004 Corporate
2	2/1/2004	13	0	0	279474	0	0	0	2004 Corporate
2	2/1/2004	14	0	0	279463	0	0	0	2004 Corporate
2	2/1/2004	15	0	0	279451	0	0	0	2004 Corporate
2	2/1/2004	16	0	0	279429	0	0	0	2004 Corporate
2	2/1/2004	17	0	0	279402	0	0	0	2004 Corporate
2	2/1/2004	18	0	0	279365	0	0	0	2004 Corporate
2	2/1/2004	19	0	0	279323	0	0	0	2004 Corporate
2	2/1/2004	20	0	0	279271	0	0	0	2004 Corporate
2	2/1/2004	21	0	0	279218	0	0	0	2004 Corporate
2	2/1/2004	22	0	0	279170	0	0	0	2004 Corporate
2	2/1/2004	23	0	0	279102	0	0	0	2004 Corporate
2	2/1/2004	24	0	0	278991	0	0	0	2004 Corporate
2	2/1/2004	25	0	0	278796	0	0	0	2004 Corporate
2	2/1/2004	26	0	0	278551	0	0	0	2004 Corporate
2	2/1/2004	27	0	0	278280	0	0	0	2004 Corporate
2	2/1/2004	28	0	0	277928	0	0	0	2004 Corporate
2	2/1/2004	29	0	0	277234	0	0	0	2004 Corporate
2	2/1/2004	30	0	0	276083	0	0	0	2004 Corporate
2	2/1/2004	31	0	1	274479	312.56	0	312.56	2004 Corporate
2	2/1/2004	32	0	1	272443	312.56	0	312.56	2004 Corporate
2	2/1/2004	33	0	1	268714	312.56	0	312.56	2004 Corporate
2	2/1/2004	34	0.01	3	263626	2143.84	0.01	714.61	2004 Corporate
2	2/1/2004	35	0.02	4	256894	2183.59	0.01	545.9	2004 Corporate
2	2/1/2004	36	0.02	4	244705	2183.59	0.01	545.9	2004 Corporate

2	2/1/2004	37	0.03	7	230515	2881.55	0.01	411.65	2004 Corporate
2	2/1/2004	38	0.03	7	214586	2881.55	0.01	411.65	2004 Corporate
2	2/1/2004	39	0.03	7	195695	2881.55	0.01	411.65	2004 Corporate
2	2/1/2004	40	0.04	9	172928	2988.55	0.01	332.06	2004 Corporate
2	2/1/2004	41	0.06	12	145262	4338.49	0.02	361.54	2004 Corporate
2	3/1/2004	0	0	0	309239	0	0	0	2004 Corporate
2	3/1/2004	1	0	0	309239	0	0	0	2004 Corporate
2	3/1/2004	2	0	0	309239	0	0	0	2004 Corporate
2	3/1/2004	3	0	0	309239	0	0	0	2004 Corporate
2	3/1/2004	4	0	0	309239	0	0	0	2004 Corporate
2	3/1/2004	5	0	0	309235	0	0	0	2004 Corporate
2	3/1/2004	6	0	0	309230	0	0	0	2004 Corporate
2	3/1/2004	7	0	0	309228	0	0	0	2004 Corporate
2	3/1/2004	8	0	0	309223	0	0	0	2004 Corporate
2	3/1/2004	9	0	0	309218	0	0	0	2004 Corporate
2	3/1/2004	10	0	0	309210	0	0	0	2004 Corporate
2	3/1/2004	11	0	0	309185	0	0	0	2004 Corporate
2	3/1/2004	12	0	0	309173	0	0	0	2004 Corporate
2	3/1/2004	13	0	0	309156	0	0	0	2004 Corporate
2	3/1/2004	14	0	0	309140	0	0	0	2004 Corporate
2	3/1/2004	15	0	0	309119	0	0	0	2004 Corporate
2	3/1/2004	16	0	0	309089	0	0	0	2004 Corporate
2	3/1/2004	17	0	0	309066	0	0	0	2004 Corporate
2	3/1/2004	18	0	1	309022	68.73	0	68.73	2004 Corporate
2	3/1/2004	19	0	1	308972	68.73	0	68.73	2004 Corporate
2	3/1/2004	20	0	1	308912	68.73	0	68.73	2004 Corporate
2	3/1/2004	21	0	1	308827	68.73	0	68.73	2004 Corporate
2	3/1/2004	22	0	1	308742	68.73	0	68.73	2004 Corporate
2	3/1/2004	23	0	1	308590	68.73	0	68.73	2004 Corporate
2	3/1/2004	24	0	1	308392	68.73	0	68.73	2004 Corporate
2	3/1/2004	25	0	1	308145	68.73	0	68.73	2004 Corporate
2	3/1/2004	26	0	1	307774	68.73	0	68.73	2004 Corporate
2	3/1/2004	27	0	1	307407	68.73	0	68.73	2004 Corporate
2	3/1/2004	28	0	1	306848	68.73	0	68.73	2004 Corporate
2	3/1/2004	29	0.01	2	305887	167.74	0	83.87	2004 Corporate
2	3/1/2004	30	0.01	2	304144	167.74	0	83.87	2004 Corporate
2	3/1/2004	31	0.01	2	301722	167.74	0	83.87	2004 Corporate
2	3/1/2004	32	0.01	2	298623	167.74	0	83.87	2004 Corporate
2	3/1/2004	33	0.01	3	292924	464.79	0	154.93	2004 Corporate
2	3/1/2004	34	0.02	5	285578	679.92	0	135.98	2004 Corporate
2	3/1/2004	35	0.02	6	275754	985.36	0	164.23	2004 Corporate
2	3/1/2004	36	0.02	7	257297	1497.6	0.01	213.94	2004 Corporate
2	3/1/2004	37	0.03	9	235852	2211.9	0.01	245.77	2004 Corporate
2	3/1/2004	38	0.04	10	211621	2362.42	0.01	236.24	2004 Corporate
2	3/1/2004	39	0.04	10	182955	2362.42	0.01	236.24	2004 Corporate
2	3/1/2004	40	0.04	10	149316	2362.42	0.01	236.24	2004 Corporate
2	4/1/2004	0	0	0	254291	0	0	0	2004 Corporate
2	4/1/2004	1	0	0	254291	0	0	0	2004 Corporate
2	4/1/2004	2	0	0	254291	0	0	0	2004 Corporate
2	4/1/2004	3	0	0	254291	0	0	0	2004 Corporate
2	4/1/2004	4	0	0	254290	0	0	0	2004 Corporate
2	4/1/2004	5	0	0	254284	0	0	0	2004 Corporate
2	4/1/2004	6	0	0	254280	0	0	0	2004 Corporate
2	4/1/2004	7	0	0	254275	0	0	0	2004 Corporate
2	4/1/2004	8	0	0	254270	0	0	0	2004 Corporate
2	4/1/2004	9	0	0	254263	0	0	0	2004 Corporate

2	4/1/2004	10	0	0	254252	0	0	0	2004 Corporate
2	4/1/2004	11	0	0	254223	0	0	0	2004 Corporate
2	4/1/2004	12	0	0	254181	0	0	0	2004 Corporate
2	4/1/2004	13	0	0	254155	0	0	0	2004 Corporate
2	4/1/2004	14	0	0	254125	0	0	0	2004 Corporate
2	4/1/2004	15	0	0	254091	0	0	0	2004 Corporate
2	4/1/2004	16	0	0	254049	0	0	0	2004 Corporate
2	4/1/2004	17	0	0	254016	0	0	0	2004 Corporate
2	4/1/2004	18	0	0	253958	0	0	0	2004 Corporate
2	4/1/2004	19	0	0	253915	0	0	0	2004 Corporate
2	4/1/2004	20	0	0	253842	0	0	0	2004 Corporate
2	4/1/2004	21	0	0	253771	0	0	0	2004 Corporate
2	4/1/2004	22	0	0	253707	0	0	0	2004 Corporate
2	4/1/2004	23	0	0	253614	0	0	0	2004 Corporate
2	4/1/2004	24	0	0	253454	0	0	0	2004 Corporate
2	4/1/2004	25	0	0	253198	0	0	0	2004 Corporate
2	4/1/2004	26	0	0	252838	0	0	0	2004 Corporate
2	4/1/2004	27	0	0	252430	0	0	0	2004 Corporate
2	4/1/2004	28	0	0	251797	0	0	0	2004 Corporate
2	4/1/2004	29	0	1	250674	176.47	0	176.47	2004 Corporate
2	4/1/2004	30	0.01	3	248892	388.03	0	129.34	2004 Corporate
2	4/1/2004	31	0.01	3	246420	388.03	0	129.34	2004 Corporate
2	4/1/2004	32	0.01	3	243209	388.03	0	129.34	2004 Corporate
2	4/1/2004	33	0.01	3	237392	388.03	0	129.34	2004 Corporate
2	4/1/2004	34	0.02	4	229736	536.65	0	134.16	2004 Corporate
2	4/1/2004	35	0.02	5	219679	686.06	0	137.21	2004 Corporate
2	4/1/2004	36	0.03	6	201138	1060.96	0	176.83	2004 Corporate
2	4/1/2004	37	0.04	8	179780	1739.73	0.01	217.47	2004 Corporate
2	4/1/2004	38	0.04	9	155191	1779.73	0.01	197.75	2004 Corporate
2	4/1/2004	39	0.04	9	125524	1779.73	0.01	197.75	2004 Corporate
2	5/1/2004	0	0	0	196585	0	0	0	2004 Corporate
2	5/1/2004	1	0	0	196585	0	0	0	2004 Corporate
2	5/1/2004	2	0	0	196585	0	0	0	2004 Corporate
2	5/1/2004	3	0	0	196585	0	0	0	2004 Corporate
2	5/1/2004	4	0	0	196584	0	0	0	2004 Corporate
2	5/1/2004	5	0	0	196581	0	0	0	2004 Corporate
2	5/1/2004	6	0	0	196575	0	0	0	2004 Corporate
2	5/1/2004	7	0	0	196572	0	0	0	2004 Corporate
2	5/1/2004	8	0	0	196567	0	0	0	2004 Corporate
2	5/1/2004	9	0	0	196560	0	0	0	2004 Corporate
2	5/1/2004	10	0	0	196553	0	0	0	2004 Corporate
2	5/1/2004	11	0	0	196544	0	0	0	2004 Corporate
2	5/1/2004	12	0	0	196523	0	0	0	2004 Corporate
2	5/1/2004	13	0	0	196507	0	0	0	2004 Corporate
2	5/1/2004	14	0	0	196491	0	0	0	2004 Corporate
2	5/1/2004	15	0	0	196473	0	0	0	2004 Corporate
2	5/1/2004	16	0	0	196451	0	0	0	2004 Corporate
2	5/1/2004	17	0	0	196398	0	0	0	2004 Corporate
2	5/1/2004	18	0	0	196338	0	0	0	2004 Corporate
2	5/1/2004	19	0	0	196266	0	0	0	2004 Corporate
2	5/1/2004	20	0	0	196179	0	0	0	2004 Corporate
2	5/1/2004	21	0	0	196110	0	0	0	2004 Corporate
2	5/1/2004	22	0	0	196012	0	0	0	2004 Corporate
2	5/1/2004	23	0	0	195871	0	0	0	2004 Corporate
2	5/1/2004	24	0	0	195700	0	0	0	2004 Corporate
2	5/1/2004	25	0	0	195413	0	0	0	2004 Corporate

2	5/1/2004	26	0	0	195035	0	0	0	2004 Corporate
2	5/1/2004	27	0	0	194614	0	0	0	2004 Corporate
2	5/1/2004	28	0	0	194071	0	0	0	2004 Corporate
2	5/1/2004	29	0	0	193132	0	0	0	2004 Corporate
2	5/1/2004	30	0	0	191642	0	0	0	2004 Corporate
2	5/1/2004	31	0	0	189479	0	0	0	2004 Corporate
2	5/1/2004	32	0	0	186545	0	0	0	2004 Corporate
2	5/1/2004	33	0.01	2	181087	489.71	0	244.86	2004 Corporate
2	5/1/2004	34	0.03	5	174005	2060.81	0.01	412.16	2004 Corporate
2	5/1/2004	35	0.05	8	164136	2720.93	0.02	340.12	2004 Corporate
2	5/1/2004	36	0.08	13	144684	3439.79	0.02	264.6	2004 Corporate
2	5/1/2004	37	0.11	16	122067	4459.73	0.03	278.73	2004 Corporate
2	5/1/2004	38	0.13	18	95609	6103.86	0.05	339.1	2004 Corporate
2	6/1/2004	0	0	0	205884	0	0	0	2004 Corporate
2	6/1/2004	1	0	0	205884	0	0	0	2004 Corporate
2	6/1/2004	2	0	0	205884	0	0	0	2004 Corporate
2	6/1/2004	3	0	0	205884	0	0	0	2004 Corporate
2	6/1/2004	4	0	0	205883	0	0	0	2004 Corporate
2	6/1/2004	5	0	0	205880	0	0	0	2004 Corporate
2	6/1/2004	6	0	0	205872	0	0	0	2004 Corporate
2	6/1/2004	7	0	0	205863	0	0	0	2004 Corporate
2	6/1/2004	8	0	0	205857	0	0	0	2004 Corporate
2	6/1/2004	9	0	0	205852	0	0	0	2004 Corporate
2	6/1/2004	10	0	0	205843	0	0	0	2004 Corporate
2	6/1/2004	11	0	0	205831	0	0	0	2004 Corporate
2	6/1/2004	12	0	0	205812	0	0	0	2004 Corporate
2	6/1/2004	13	0	0	205779	0	0	0	2004 Corporate
2	6/1/2004	14	0	0	205754	0	0	0	2004 Corporate
2	6/1/2004	15	0	0	205719	0	0	0	2004 Corporate
2	6/1/2004	16	0	0	205681	0	0	0	2004 Corporate
2	6/1/2004	17	0	0	205644	0	0	0	2004 Corporate
2	6/1/2004	18	0	0	205581	0	0	0	2004 Corporate
2	6/1/2004	19	0	0	205514	0	0	0	2004 Corporate
2	6/1/2004	20	0	0	205431	0	0	0	2004 Corporate
2	6/1/2004	21	0	0	205349	0	0	0	2004 Corporate
2	6/1/2004	22	0	0	205219	0	0	0	2004 Corporate
2	6/1/2004	23	0	0	205060	0	0	0	2004 Corporate
2	6/1/2004	24	0	0	204854	0	0	0	2004 Corporate
2	6/1/2004	25	0	0	204463	0	0	0	2004 Corporate
2	6/1/2004	26	0	1	203917	148.83	0	148.83	2004 Corporate
2	6/1/2004	27	0	1	203384	148.83	0	148.83	2004 Corporate
2	6/1/2004	28	0.01	2	202586	718.21	0	359.11	2004 Corporate
2	6/1/2004	29	0.01	2	201288	718.21	0	359.11	2004 Corporate
2	6/1/2004	30	0.01	3	199220	1109.7	0.01	369.9	2004 Corporate
2	6/1/2004	31	0.01	3	196168	1109.7	0.01	369.9	2004 Corporate
2	6/1/2004	32	0.03	5	192061	1263.04	0.01	252.61	2004 Corporate
2	6/1/2004	33	0.04	7	184348	2139.35	0.01	305.62	2004 Corporate
2	6/1/2004	34	0.04	7	173703	2139.35	0.01	305.62	2004 Corporate
2	6/1/2004	35	0.05	10	159112	2259.41	0.01	225.94	2004 Corporate
2	6/1/2004	36	0.07	12	130051	2468.63	0.01	205.72	2004 Corporate
2	6/1/2004	37	0.09	14	94807	2694.11	0.02	192.44	2004 Corporate
2	7/1/2004	0	0	0	61940	0	0	0	2004 Corporate
2	7/1/2004	1	0	0	61940	0	0	0	2004 Corporate
2	7/1/2004	2	0	0	61940	0	0	0	2004 Corporate
2	7/1/2004	3	0	0	61940	0	0	0	2004 Corporate
2	7/1/2004	4	0	0	61939	0	0	0	2004 Corporate

2	7/1/2004	5	0	0	61936	0	0	0	2004 Corporate
2	7/1/2004	6	0	0	61931	0	0	0	2004 Corporate
2	7/1/2004	7	0	0	61927	0	0	0	2004 Corporate
2	7/1/2004	8	0	0	61923	0	0	0	2004 Corporate
2	7/1/2004	9	0	0	61921	0	0	0	2004 Corporate
2	7/1/2004	10	0	0	61916	0	0	0	2004 Corporate
2	7/1/2004	11	0	0	61904	0	0	0	2004 Corporate
2	7/1/2004	12	0	0	61887	0	0	0	2004 Corporate
2	7/1/2004	13	0	0	61875	0	0	0	2004 Corporate
2	7/1/2004	14	0	0	61854	0	0	0	2004 Corporate
2	7/1/2004	15	0	0	61833	0	0	0	2004 Corporate
2	7/1/2004	16	0	0	61815	0	0	0	2004 Corporate
2	7/1/2004	17	0	0	61787	0	0	0	2004 Corporate
2	7/1/2004	18	0	0	61736	0	0	0	2004 Corporate
2	7/1/2004	19	0	0	61699	0	0	0	2004 Corporate
2	7/1/2004	20	0	0	61656	0	0	0	2004 Corporate
2	7/1/2004	21	0	0	61612	0	0	0	2004 Corporate
2	7/1/2004	22	0	0	61567	0	0	0	2004 Corporate
2	7/1/2004	23	0	0	61497	0	0	0	2004 Corporate
2	7/1/2004	24	0	0	61406	0	0	0	2004 Corporate
2	7/1/2004	25	0	0	61147	0	0	0	2004 Corporate
2	7/1/2004	26	0	0	60909	0	0	0	2004 Corporate
2	7/1/2004	27	0	0	60619	0	0	0	2004 Corporate
2	7/1/2004	28	0	0	60240	0	0	0	2004 Corporate
2	7/1/2004	29	0	0	59682	0	0	0	2004 Corporate
2	7/1/2004	30	0	0	58767	0	0	0	2004 Corporate
2	7/1/2004	31	0	0	57475	0	0	0	2004 Corporate
2	7/1/2004	32	0.02	1	55691	746.81	0.01	746.81	2004 Corporate
2	7/1/2004	33	0.04	2	52300	1745.31	0.03	872.66	2004 Corporate
2	7/1/2004	34	0.04	2	47635	1745.31	0.03	872.66	2004 Corporate
2	7/1/2004	35	0.06	3	41027	1844.41	0.03	614.8	2004 Corporate
2	7/1/2004	36	0.1	4	28308	2076.03	0.04	519.01	2004 Corporate
2	8/1/2004	0	0	0	50249	0	0	0	2004 Corporate
2	8/1/2004	1	0	0	50249	0	0	0	2004 Corporate
2	8/1/2004	2	0	0	50249	0	0	0	2004 Corporate
2	8/1/2004	3	0	0	50249	0	0	0	2004 Corporate
2	8/1/2004	4	0	0	50249	0	0	0	2004 Corporate
2	8/1/2004	5	0	0	50248	0	0	0	2004 Corporate
2	8/1/2004	6	0	0	50248	0	0	0	2004 Corporate
2	8/1/2004	7	0	0	50247	0	0	0	2004 Corporate
2	8/1/2004	8	0	0	50245	0	0	0	2004 Corporate
2	8/1/2004	9	0	0	50243	0	0	0	2004 Corporate
2	8/1/2004	10	0	0	50241	0	0	0	2004 Corporate
2	8/1/2004	11	0	0	50234	0	0	0	2004 Corporate
2	8/1/2004	12	0	0	50232	0	0	0	2004 Corporate
2	8/1/2004	13	0	0	50226	0	0	0	2004 Corporate
2	8/1/2004	14	0	0	50221	0	0	0	2004 Corporate
2	8/1/2004	15	0	0	50214	0	0	0	2004 Corporate
2	8/1/2004	16	0	0	50199	0	0	0	2004 Corporate
2	8/1/2004	17	0	0	50189	0	0	0	2004 Corporate
2	8/1/2004	18	0	0	50171	0	0	0	2004 Corporate
2	8/1/2004	19	0	0	50145	0	0	0	2004 Corporate
2	8/1/2004	20	0	0	50129	0	0	0	2004 Corporate
2	8/1/2004	21	0	0	50107	0	0	0	2004 Corporate
2	8/1/2004	22	0	0	50081	0	0	0	2004 Corporate
2	8/1/2004	23	0	0	50054	0	0	0	2004 Corporate



2	8/1/2004	24	0	0	49992	0	0	0	2004 Corporate
2	8/1/2004	25	0	0	49912	0	0	0	2004 Corporate
2	8/1/2004	26	0	0	49834	0	0	0	2004 Corporate
2	8/1/2004	27	0	0	49715	0	0	0	2004 Corporate
2	8/1/2004	28	0	0	49525	0	0	0	2004 Corporate
2	8/1/2004	29	0	0	49241	0	0	0	2004 Corporate
2	8/1/2004	30	0	0	48769	0	0	0	2004 Corporate
2	8/1/2004	31	0	0	47952	0	0	0	2004 Corporate
2	8/1/2004	32	0	0	46641	0	0	0	2004 Corporate
2	8/1/2004	33	0	0	43305	0	0	0	2004 Corporate
2	8/1/2004	34	0.03	1	38100	143.24	0	143.24	2004 Corporate
2	8/1/2004	35	0.06	2	30387	292.85	0.01	146.43	2004 Corporate
2	9/1/2004	0	0	0	15915	0	0	0	2004 Corporate
2	9/1/2004	1	0	0	15915	0	0	0	2004 Corporate
2	9/1/2004	2	0	0	15915	0	0	0	2004 Corporate
2	9/1/2004	3	0	0	15915	0	0	0	2004 Corporate
2	9/1/2004	4	0	0	15915	0	0	0	2004 Corporate
2	9/1/2004	5	0	0	15914	0	0	0	2004 Corporate
2	9/1/2004	6	0	0	15913	0	0	0	2004 Corporate
2	9/1/2004	7	0	0	15913	0	0	0	2004 Corporate
2	9/1/2004	8	0	0	15912	0	0	0	2004 Corporate
2	9/1/2004	9	0	0	15911	0	0	0	2004 Corporate
2	9/1/2004	10	0	0	15911	0	0	0	2004 Corporate
2	9/1/2004	11	0	0	15906	0	0	0	2004 Corporate
2	9/1/2004	12	0	0	15897	0	0	0	2004 Corporate
2	9/1/2004	13	0	0	15890	0	0	0	2004 Corporate
2	9/1/2004	14	0	0	15881	0	0	0	2004 Corporate
2	9/1/2004	15	0	0	15878	0	0	0	2004 Corporate
2	9/1/2004	16	0	0	15867	0	0	0	2004 Corporate
2	9/1/2004	17	0	0	15848	0	0	0	2004 Corporate
2	9/1/2004	18	0	0	15825	0	0	0	2004 Corporate
2	9/1/2004	19	0	0	15811	0	0	0	2004 Corporate
2	9/1/2004	20	0	0	15795	0	0	0	2004 Corporate
2	9/1/2004	21	0	0	15778	0	0	0	2004 Corporate
2	9/1/2004	22	0	0	15764	0	0	0	2004 Corporate
2	9/1/2004	23	0	0	15739	0	0	0	2004 Corporate
2	9/1/2004	24	0	0	15692	0	0	0	2004 Corporate
2	9/1/2004	25	0	0	15640	0	0	0	2004 Corporate
2	9/1/2004	26	0	0	15597	0	0	0	2004 Corporate
2	9/1/2004	27	0	0	15531	0	0	0	2004 Corporate
2	9/1/2004	28	0	0	15420	0	0	0	2004 Corporate
2	9/1/2004	29	0	0	15264	0	0	0	2004 Corporate
2	9/1/2004	30	0	0	15042	0	0	0	2004 Corporate
2	9/1/2004	31	0	0	14729	0	0	0	2004 Corporate
2	9/1/2004	32	0	0	14195	0	0	0	2004 Corporate
2	9/1/2004	33	0.08	1	12680	115.44	0.01	115.44	2004 Corporate
2	9/1/2004	34	0.08	1	10326	115.44	0.01	115.44	2004 Corporate
2	10/1/2004	0	0	0	830		0		2004 Corporate
2	10/1/2004	1	0	0	830		0		2004 Corporate
2	10/1/2004	2	0	0	830		0		2004 Corporate
2	10/1/2004	3	0	0	830		0		2004 Corporate
2	10/1/2004	4	0	0	830		0		2004 Corporate
2	10/1/2004	5	0	0	830		0		2004 Corporate
2	10/1/2004	6	0	0	828		0		2004 Corporate
2	10/1/2004	7	0	0	827		0		2004 Corporate
2	10/1/2004	8	0	0	826		0		2004 Corporate

2 10/1/2004	9	0	824	0	2004 Corporate
2 10/1/2004	10	0	824	0	2004 Corporate
2 10/1/2004	11	0	822	0	2004 Corporate
2 10/1/2004	12	0	818	0	2004 Corporate
2 10/1/2004	13	0	818	0	2004 Corporate
2 10/1/2004	14	0	811	0	2004 Corporate
2 10/1/2004	15	0	805	0	2004 Corporate
2 10/1/2004	16	0	796	0	2004 Corporate
2 10/1/2004	17	0	782	0	2004 Corporate
2 10/1/2004	18	0	765	0	2004 Corporate
2 10/1/2004	19	0	751	0	2004 Corporate
2 10/1/2004	20	0	732	0	2004 Corporate
2 10/1/2004	21	0	725	0	2004 Corporate
2 10/1/2004	22	0	713	0	2004 Corporate
2 10/1/2004	23	0	693	0	2004 Corporate
2 10/1/2004	24	0	668	0	2004 Corporate
2 10/1/2004	25	0	638	0	2004 Corporate
2 10/1/2004	26	0	584	0	2004 Corporate
2 10/1/2004	27	0	526	0	2004 Corporate
2 10/1/2004	28	0	463	0	2004 Corporate
2 10/1/2004	29	0	376	0	2004 Corporate
2 10/1/2004	30	0	286	0	2004 Corporate
2 10/1/2004	31	0	182	0	2004 Corporate
2 10/1/2004	32	0	117	0	2004 Corporate
2 11/1/2004	0	0	960	0	2004 Corporate
2 11/1/2004	1	0	960	0	2004 Corporate
2 11/1/2004	2	0	960	0	2004 Corporate
2 11/1/2004	3	0	960	0	2004 Corporate
2 11/1/2004	4	0	960	0	2004 Corporate
2 11/1/2004	5	0	959	0	2004 Corporate
2 11/1/2004	6	0	958	0	2004 Corporate
2 11/1/2004	7	0	957	0	2004 Corporate
2 11/1/2004	8	0	952	0	2004 Corporate
2 11/1/2004	9	0	950	0	2004 Corporate
2 11/1/2004	10	0	949	0	2004 Corporate
2 11/1/2004	11	0	944	0	2004 Corporate
2 11/1/2004	12	0	938	0	2004 Corporate
2 11/1/2004	13	0	931	0	2004 Corporate
2 11/1/2004	14	0	922	0	2004 Corporate
2 11/1/2004	15	0	914	0	2004 Corporate
2 11/1/2004	16	0	903	0	2004 Corporate
2 11/1/2004	17	0	889	0	2004 Corporate
2 11/1/2004	18	0	872	0	2004 Corporate
2 11/1/2004	19	0	851	0	2004 Corporate
2 11/1/2004	20	0	833	0	2004 Corporate
2 11/1/2004	21	0	820	0	2004 Corporate
2 11/1/2004	22	0	799	0	2004 Corporate
2 11/1/2004	23	0	776	0	2004 Corporate
2 11/1/2004	24	0	746	0	2004 Corporate
2 11/1/2004	25	0	698	0	2004 Corporate
2 11/1/2004	26	0	635	0	2004 Corporate
2 11/1/2004	27	0	546	0	2004 Corporate
2 11/1/2004	28	0	450	0	2004 Corporate
2 11/1/2004	29	0	327	0	2004 Corporate
2 11/1/2004	30	0	237	0	2004 Corporate
2 11/1/2004	31	0	158	0	2004 Corporate

2	11/1/2004	32	0		137				0	2004 Corporate
2	12/1/2004	0	0		520				0	2004 Corporate
2	12/1/2004	1	0		520				0	2004 Corporate
2	12/1/2004	2	0		520				0	2004 Corporate
2	12/1/2004	3	0		520				0	2004 Corporate
2	12/1/2004	4	0		519				0	2004 Corporate
2	12/1/2004	5	0		519				0	2004 Corporate
2	12/1/2004	6	0		518				0	2004 Corporate
2	12/1/2004	7	0		512				0	2004 Corporate
2	12/1/2004	8	0		510				0	2004 Corporate
2	12/1/2004	9	0		507				0	2004 Corporate
2	12/1/2004	10	0		505				0	2004 Corporate
2	12/1/2004	11	0		498				0	2004 Corporate
2	12/1/2004	12	0		490				0	2004 Corporate
2	12/1/2004	13	0		485				0	2004 Corporate
2	12/1/2004	14	0		482				0	2004 Corporate
2	12/1/2004	15	0		474				0	2004 Corporate
2	12/1/2004	16	0		468				0	2004 Corporate
2	12/1/2004	17	0		462				0	2004 Corporate
2	12/1/2004	18	0		447				0	2004 Corporate
2	12/1/2004	19	0		434				0	2004 Corporate
2	12/1/2004	20	0		426				0	2004 Corporate
2	12/1/2004	21	0		422				0	2004 Corporate
2	12/1/2004	22	0		418				0	2004 Corporate
2	12/1/2004	23	0		405				0	2004 Corporate
2	12/1/2004	24	0		380				0	2004 Corporate
2	12/1/2004	25	0		344				0	2004 Corporate
2	12/1/2004	26	0		294				0	2004 Corporate
2	12/1/2004	27	0		236				0	2004 Corporate
2	12/1/2004	28	0		184				0	2004 Corporate
2	12/1/2004	29	0		130				0	2004 Corporate
2	12/1/2004	30	0		113				0	2004 Corporate
2	12/1/2004	31	0		103				0	2004 Corporate
3		0	0	1	2925868	1224.19	0	1224.19	0	2005 Corporate
3		1	0	1	2925868	1224.19	0	1224.19	0	2005 Corporate
3		2	0	1	2925746	1224.19	0	1224.19	0	2005 Corporate
3		3	0	1	2925609	1224.19	0	1224.19	0	2005 Corporate
3		4	0	2	2925412	1434.19	0	717.1	0	2005 Corporate
3		5	0	2	2925171	1434.19	0	717.1	0	2005 Corporate
3		6	0	2	2924813	1434.19	0	717.1	0	2005 Corporate
3		7	0	2	2924421	1434.19	0	717.1	0	2005 Corporate
3		8	0	2	2923947	1434.19	0	717.1	0	2005 Corporate
3		9	0	2	2923333	1434.19	0	717.1	0	2005 Corporate
3		10	0	2	2922636	1434.19	0	717.1	0	2005 Corporate
3		11	0	2	2921580	1434.19	0	717.1	0	2005 Corporate
3		12	0	2	2920196	1434.19	0	717.1	0	2005 Corporate
3		13	0	2	2918431	1434.19	0	717.1	0	2005 Corporate
3		14	0	3	2916108	1467.63	0	489.21	0	2005 Corporate
3		15	0	4	2913117	1542.89	0	385.72	0	2005 Corporate
3		16	0	8	2909197	2595.57	0	324.45	0	2005 Corporate
3		17	0	8	2903332	2595.57	0	324.45	0	2005 Corporate
3		18	0	10	2889848	3285.25	0	328.53	0	2005 Corporate
3		19	0	14	2876694	4886.41	0	349.03	0	2005 Corporate
3		20	0.01	18	2861085	7915.03	0	439.72	0	2005 Corporate
3		21	0.01	22	2831692	8067.32	0	366.7	0	2005 Corporate
3		22	0.01	25	2795900	8856.48	0	354.26	0	2005 Corporate

3	23	0.02	52	2750355	17546.62	0.01	337.44	2005 Corporate
3	24	0.03	83	2653013	26354.52	0.01	317.52	2005 Corporate
3	25	0.04	111	2486651	32774.91	0.01	295.27	2005 Corporate
3	26	0.05	130	2150081	35416.85	0.01	272.44	2005 Corporate
3	27	0.06	156	1900923	40046.06	0.02	256.71	2005 Corporate
3	28	0.08	177	1638222	48286.12	0.02	272.8	2005 Corporate
3	29	0.09	201	1384884	55371.44	0.03	275.48	2005 Corporate
3	30	0.11	215	1128853	59451.99	0.03	276.52	2005 Corporate
3	31	0.12	229	894591	63752.53	0.03	278.4	2005 Corporate
3	32	0.14	242	716954	67777.79	0.04	280.07	2005 Corporate
3	33	0.15	245	542400	67915.56	0.04	277.21	2005 Corporate
3	34	0.16	250	391361	68879.03	0.04	275.52	2005 Corporate
3	35	0.16	251	272143	68910.27	0.04	274.54	2005 Corporate
3	36	0.16	251	191002	68910.27	0.04	274.54	2005 Corporate
3	37	0.16	251	156818	68910.27	0.04	274.54	2005 Corporate
3	38	0.16	251	103584	68910.27	0.04	274.54	2005 Corporate
3	39	0.16	251	54706	68910.27	0.04	274.54	2005 Corporate
3	40	0.16	251	23978	68910.27	0.04	274.54	2005 Corporate
3	41	0.16	251	12384	68910.27	0.04	274.54	2005 Corporate
3	42	0.16	251	4448	68910.27	0.04	274.54	2005 Corporate
3	43	0.16	251	188	68910.27	0.04	274.54	2005 Corporate
3 11/1/2003	0	0		124		0		2005 Corporate
3 11/1/2003	1	0		124		0		2005 Corporate
3 11/1/2003	2	0		124		0		2005 Corporate
3 11/1/2003	3	0		124		0		2005 Corporate
3 11/1/2003	4	0		124		0		2005 Corporate
3 11/1/2003	5	0		124		0		2005 Corporate
3 11/1/2003	6	0		124		0		2005 Corporate
3 11/1/2003	7	0		124		0		2005 Corporate
3 11/1/2003	8	0		124		0		2005 Corporate
3 11/1/2003	9	0		124		0		2005 Corporate
3 11/1/2003	10	0		124		0		2005 Corporate
3 11/1/2003	11	0		124		0		2005 Corporate
3 11/1/2003	12	0		124		0		2005 Corporate
3 11/1/2003	13	0		124		0		2005 Corporate
3 11/1/2003	14	0		124		0		2005 Corporate
3 11/1/2003	15	0		124		0		2005 Corporate
3 11/1/2003	16	0		124		0		2005 Corporate
3 11/1/2003	17	0		124		0		2005 Corporate
3 11/1/2003	18	0		124		0		2005 Corporate
3 11/1/2003	19	0		124		0		2005 Corporate
3 11/1/2003	20	0		124		0		2005 Corporate
3 11/1/2003	21	0		123		0		2005 Corporate
3 11/1/2003	22	0		123		0		2005 Corporate
3 11/1/2003	23	0		123		0		2005 Corporate
3 11/1/2003	24	0		123		0		2005 Corporate
3 11/1/2003	25	0		123		0		2005 Corporate
3 11/1/2003	26	0		122		0		2005 Corporate
3 11/1/2003	27	0		122		0		2005 Corporate
3 11/1/2003	28	0		122		0		2005 Corporate
3 11/1/2003	29	0		122		0		2005 Corporate
3 11/1/2003	30	0		120		0		2005 Corporate
3 11/1/2003	31	0		120		0		2005 Corporate
3 11/1/2003	32	0		118		0		2005 Corporate
3 11/1/2003	33	0		117		0		2005 Corporate
3 11/1/2003	34	0		113		0		2005 Corporate

3 11/1/2003	35	0	112	0	2005 Corporate
3 11/1/2003	36	0	111	0	2005 Corporate
3 11/1/2003	37	0	109	0	2005 Corporate
3 11/1/2003	38	0	107	0	2005 Corporate
3 11/1/2003	39	0	104	0	2005 Corporate
3 12/1/2003	0	0	764	0	2005 Corporate
3 12/1/2003	1	0	764	0	2005 Corporate
3 12/1/2003	2	0	764	0	2005 Corporate
3 12/1/2003	3	0	764	0	2005 Corporate
3 12/1/2003	4	0	764	0	2005 Corporate
3 12/1/2003	5	0	764	0	2005 Corporate
3 12/1/2003	6	0	764	0	2005 Corporate
3 12/1/2003	7	0	764	0	2005 Corporate
3 12/1/2003	8	0	764	0	2005 Corporate
3 12/1/2003	9	0	764	0	2005 Corporate
3 12/1/2003	10	0	764	0	2005 Corporate
3 12/1/2003	11	0	764	0	2005 Corporate
3 12/1/2003	12	0	764	0	2005 Corporate
3 12/1/2003	13	0	764	0	2005 Corporate
3 12/1/2003	14	0	764	0	2005 Corporate
3 12/1/2003	15	0	764	0	2005 Corporate
3 12/1/2003	16	0	764	0	2005 Corporate
3 12/1/2003	17	0	764	0	2005 Corporate
3 12/1/2003	18	0	764	0	2005 Corporate
3 12/1/2003	19	0	764	0	2005 Corporate
3 12/1/2003	20	0	764	0	2005 Corporate
3 12/1/2003	21	0	764	0	2005 Corporate
3 12/1/2003	22	0	764	0	2005 Corporate
3 12/1/2003	23	0	764	0	2005 Corporate
3 12/1/2003	24	0	764	0	2005 Corporate
3 12/1/2003	25	0	762	0	2005 Corporate
3 12/1/2003	26	0	751	0	2005 Corporate
3 12/1/2003	27	0	744	0	2005 Corporate
3 12/1/2003	28	0	737	0	2005 Corporate
3 12/1/2003	29	0	734	0	2005 Corporate
3 12/1/2003	30	0	723	0	2005 Corporate
3 12/1/2003	31	0	716	0	2005 Corporate
3 12/1/2003	32	0	706	0	2005 Corporate
3 12/1/2003	33	0	694	0	2005 Corporate
3 12/1/2003	34	0	685	0	2005 Corporate
3 12/1/2003	35	0	676	0	2005 Corporate
3 12/1/2003	36	0	656	0	2005 Corporate
3 12/1/2003	37	0	627	0	2005 Corporate
3 12/1/2003	38	0	593	0	2005 Corporate
3 12/1/2003	39	0	546	0	2005 Corporate
3 12/1/2003	40	0	480	0	2005 Corporate
3 12/1/2003	41	0	381	0	2005 Corporate
3 12/1/2003	42	0	255	0	2005 Corporate
3 1/1/2004	0	0	8648	0	2005 Corporate
3 1/1/2004	1	0	8648	0	2005 Corporate
3 1/1/2004	2	0	8648	0	2005 Corporate
3 1/1/2004	3	0	8648	0	2005 Corporate
3 1/1/2004	4	0	8648	0	2005 Corporate
3 1/1/2004	5	0	8648	0	2005 Corporate
3 1/1/2004	6	0	8648	0	2005 Corporate
3 1/1/2004	7	0	8648	0	2005 Corporate

3	1/1/2004	8	0	8648	0	2005 Corporate
3	1/1/2004	9	0	8648	0	2005 Corporate
3	1/1/2004	10	0	8648	0	2005 Corporate
3	1/1/2004	11	0	8648	0	2005 Corporate
3	1/1/2004	12	0	8647	0	2005 Corporate
3	1/1/2004	13	0	8647	0	2005 Corporate
3	1/1/2004	14	0	8647	0	2005 Corporate
3	1/1/2004	15	0	8647	0	2005 Corporate
3	1/1/2004	16	0	8647	0	2005 Corporate
3	1/1/2004	17	0	8646	0	2005 Corporate
3	1/1/2004	18	0	8646	0	2005 Corporate
3	1/1/2004	19	0	8646	0	2005 Corporate
3	1/1/2004	20	0	8646	0	2005 Corporate
3	1/1/2004	21	0	8645	0	2005 Corporate
3	1/1/2004	22	0	8644	0	2005 Corporate
3	1/1/2004	23	0	8641	0	2005 Corporate
3	1/1/2004	24	0	8635	0	2005 Corporate
3	1/1/2004	25	0	8614	0	2005 Corporate
3	1/1/2004	26	0	8538	0	2005 Corporate
3	1/1/2004	27	0	8474	0	2005 Corporate
3	1/1/2004	28	0	8431	0	2005 Corporate
3	1/1/2004	29	0	8374	0	2005 Corporate
3	1/1/2004	30	0	8299	0	2005 Corporate
3	1/1/2004	31	0	8222	0	2005 Corporate
3	1/1/2004	32	0	8122	0	2005 Corporate
3	1/1/2004	33	0	8019	0	2005 Corporate
3	1/1/2004	34	0	7909	0	2005 Corporate
3	1/1/2004	35	0	7761	0	2005 Corporate
3	1/1/2004	36	0	7555	0	2005 Corporate
3	1/1/2004	37	0	7312	0	2005 Corporate
3	1/1/2004	38	0	7003	0	2005 Corporate
3	1/1/2004	39	0	6557	0	2005 Corporate
3	1/1/2004	40	0	6008	0	2005 Corporate
3	1/1/2004	41	0	5191	0	2005 Corporate
3	1/1/2004	42	0	4058	0	2005 Corporate
3	2/1/2004	0	0	14240	0	2005 Corporate
3	2/1/2004	1	0	14240	0	2005 Corporate
3	2/1/2004	2	0	14240	0	2005 Corporate
3	2/1/2004	3	0	14240	0	2005 Corporate
3	2/1/2004	4	0	14240	0	2005 Corporate
3	2/1/2004	5	0	14240	0	2005 Corporate
3	2/1/2004	6	0	14240	0	2005 Corporate
3	2/1/2004	7	0	14240	0	2005 Corporate
3	2/1/2004	8	0	14240	0	2005 Corporate
3	2/1/2004	9	0	14240	0	2005 Corporate
3	2/1/2004	10	0	14240	0	2005 Corporate
3	2/1/2004	11	0	14240	0	2005 Corporate
3	2/1/2004	12	0	14239	0	2005 Corporate
3	2/1/2004	13	0	14238	0	2005 Corporate
3	2/1/2004	14	0	14238	0	2005 Corporate
3	2/1/2004	15	0	14237	0	2005 Corporate
3	2/1/2004	16	0	14236	0	2005 Corporate
3	2/1/2004	17	0	14233	0	2005 Corporate
3	2/1/2004	18	0	14233	0	2005 Corporate
3	2/1/2004	19	0	14232	0	2005 Corporate
3	2/1/2004	20	0	14231	0	2005 Corporate

3	2/1/2004	21	0	0	14226	0	0	0	2005 Corporate
3	2/1/2004	22	0	0	14225	0	0	0	2005 Corporate
3	2/1/2004	23	0	0	14223	0	0	0	2005 Corporate
3	2/1/2004	24	0	0	14209	0	0	0	2005 Corporate
3	2/1/2004	25	0	0	14181	0	0	0	2005 Corporate
3	2/1/2004	26	0	0	14029	0	0	0	2005 Corporate
3	2/1/2004	27	0	0	13939	0	0	0	2005 Corporate
3	2/1/2004	28	0.07	1	13838	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	29	0.07	1	13744	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	30	0.07	1	13585	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	31	0.07	1	13410	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	32	0.07	1	13213	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	33	0.07	1	12996	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	34	0.07	1	12736	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	35	0.07	1	12355	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	36	0.07	1	11966	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	37	0.07	1	11414	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	38	0.07	1	10717	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	39	0.07	1	9849	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	40	0.07	1	8492	410.54	0.03	410.54	2005 Corporate
3	2/1/2004	41	0.07	1	6562	410.54	0.03	410.54	2005 Corporate
3	3/1/2004	0	0		19298		0		2005 Corporate
3	3/1/2004	1	0		19298		0		2005 Corporate
3	3/1/2004	2	0		19298		0		2005 Corporate
3	3/1/2004	3	0		19298		0		2005 Corporate
3	3/1/2004	4	0		19298		0		2005 Corporate
3	3/1/2004	5	0		19298		0		2005 Corporate
3	3/1/2004	6	0		19297		0		2005 Corporate
3	3/1/2004	7	0		19296		0		2005 Corporate
3	3/1/2004	8	0		19296		0		2005 Corporate
3	3/1/2004	9	0		19296		0		2005 Corporate
3	3/1/2004	10	0		19296		0		2005 Corporate
3	3/1/2004	11	0		19296		0		2005 Corporate
3	3/1/2004	12	0		19296		0		2005 Corporate
3	3/1/2004	13	0		19295		0		2005 Corporate
3	3/1/2004	14	0		19294		0		2005 Corporate
3	3/1/2004	15	0		19294		0		2005 Corporate
3	3/1/2004	16	0		19294		0		2005 Corporate
3	3/1/2004	17	0		19294		0		2005 Corporate
3	3/1/2004	18	0		19290		0		2005 Corporate
3	3/1/2004	19	0		19288		0		2005 Corporate
3	3/1/2004	20	0		19288		0		2005 Corporate
3	3/1/2004	21	0		19283		0		2005 Corporate
3	3/1/2004	22	0		19276		0		2005 Corporate
3	3/1/2004	23	0		19265		0		2005 Corporate
3	3/1/2004	24	0		19240		0		2005 Corporate
3	3/1/2004	25	0		19178		0		2005 Corporate
3	3/1/2004	26	0		18885		0		2005 Corporate
3	3/1/2004	27	0		18698		0		2005 Corporate
3	3/1/2004	28	0		18560		0		2005 Corporate
3	3/1/2004	29	0		18395		0		2005 Corporate
3	3/1/2004	30	0		18165		0		2005 Corporate
3	3/1/2004	31	0		17873		0		2005 Corporate
3	3/1/2004	32	0		17546		0		2005 Corporate
3	3/1/2004	33	0		17134		0		2005 Corporate
3	3/1/2004	34	0		16700		0		2005 Corporate

3	3/1/2004	35	0		16066				0	2005 Corporate
3	3/1/2004	36	0		15231				0	2005 Corporate
3	3/1/2004	37	0		14220				0	2005 Corporate
3	3/1/2004	38	0		12950				0	2005 Corporate
3	3/1/2004	39	0		11318				0	2005 Corporate
3	3/1/2004	40	0		8743				0	2005 Corporate
3	4/1/2004	0	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	1	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	2	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	3	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	4	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	5	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	6	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	7	0	0	40246		0	0	0	2005 Corporate
3	4/1/2004	8	0	0	40245		0	0	0	2005 Corporate
3	4/1/2004	9	0	0	40245		0	0	0	2005 Corporate
3	4/1/2004	10	0	0	40244		0	0	0	2005 Corporate
3	4/1/2004	11	0	0	40243		0	0	0	2005 Corporate
3	4/1/2004	12	0	0	40241		0	0	0	2005 Corporate
3	4/1/2004	13	0	0	40241		0	0	0	2005 Corporate
3	4/1/2004	14	0	0	40237		0	0	0	2005 Corporate
3	4/1/2004	15	0	0	40235		0	0	0	2005 Corporate
3	4/1/2004	16	0	0	40232		0	0	0	2005 Corporate
3	4/1/2004	17	0	0	40229		0	0	0	2005 Corporate
3	4/1/2004	18	0	0	40223		0	0	0	2005 Corporate
3	4/1/2004	19	0	0	40216		0	0	0	2005 Corporate
3	4/1/2004	20	0	0	40208		0	0	0	2005 Corporate
3	4/1/2004	21	0	0	40199		0	0	0	2005 Corporate
3	4/1/2004	22	0	0	40192		0	0	0	2005 Corporate
3	4/1/2004	23	0	0	40185		0	0	0	2005 Corporate
3	4/1/2004	24	0	0	40151		0	0	0	2005 Corporate
3	4/1/2004	25	0	0	39968		0	0	0	2005 Corporate
3	4/1/2004	26	0.03	1	39575		62.58	0	62.58	2005 Corporate
3	4/1/2004	27	0.03	1	39262		62.58	0	62.58	2005 Corporate
3	4/1/2004	28	0.03	1	38996		62.58	0	62.58	2005 Corporate
3	4/1/2004	29	0.03	1	38635		62.58	0	62.58	2005 Corporate
3	4/1/2004	30	0.03	1	38144		62.58	0	62.58	2005 Corporate
3	4/1/2004	31	0.03	1	37613		62.58	0	62.58	2005 Corporate
3	4/1/2004	32	0.03	1	37129		62.58	0	62.58	2005 Corporate
3	4/1/2004	33	0.03	1	36554		62.58	0	62.58	2005 Corporate
3	4/1/2004	34	0.03	1	35896		62.58	0	62.58	2005 Corporate
3	4/1/2004	35	0.03	1	34941		62.58	0	62.58	2005 Corporate
3	4/1/2004	36	0.03	1	33547		62.58	0	62.58	2005 Corporate
3	4/1/2004	37	0.03	1	31619		62.58	0	62.58	2005 Corporate
3	4/1/2004	38	0.03	1	29321		62.58	0	62.58	2005 Corporate
3	4/1/2004	39	0.03	1	26176		62.58	0	62.58	2005 Corporate
3	5/1/2004	0	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	1	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	2	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	3	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	4	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	5	0	0	64300		0	0	0	2005 Corporate
3	5/1/2004	6	0	0	64298		0	0	0	2005 Corporate
3	5/1/2004	7	0	0	64296		0	0	0	2005 Corporate
3	5/1/2004	8	0	0	64296		0	0	0	2005 Corporate
3	5/1/2004	9	0	0	64296		0	0	0	2005 Corporate



3	5/1/2004	10	0	0	64294	0	0	0	2005 Corporate
3	5/1/2004	11	0	0	64292	0	0	0	2005 Corporate
3	5/1/2004	12	0	0	64289	0	0	0	2005 Corporate
3	5/1/2004	13	0	0	64285	0	0	0	2005 Corporate
3	5/1/2004	14	0	0	64279	0	0	0	2005 Corporate
3	5/1/2004	15	0	0	64277	0	0	0	2005 Corporate
3	5/1/2004	16	0	0	64271	0	0	0	2005 Corporate
3	5/1/2004	17	0	0	64262	0	0	0	2005 Corporate
3	5/1/2004	18	0	0	64252	0	0	0	2005 Corporate
3	5/1/2004	19	0	0	64239	0	0	0	2005 Corporate
3	5/1/2004	20	0	0	64225	0	0	0	2005 Corporate
3	5/1/2004	21	0	0	64187	0	0	0	2005 Corporate
3	5/1/2004	22	0	0	64157	0	0	0	2005 Corporate
3	5/1/2004	23	0	0	64115	0	0	0	2005 Corporate
3	5/1/2004	24	0	0	63998	0	0	0	2005 Corporate
3	5/1/2004	25	0	0	63584	0	0	0	2005 Corporate
3	5/1/2004	26	0	0	62819	0	0	0	2005 Corporate
3	5/1/2004	27	0.02	1	62227	91.84	0	91.84	2005 Corporate
3	5/1/2004	28	0.02	1	61612	91.84	0	91.84	2005 Corporate
3	5/1/2004	29	0.02	1	60884	91.84	0	91.84	2005 Corporate
3	5/1/2004	30	0.02	1	59778	91.84	0	91.84	2005 Corporate
3	5/1/2004	31	0.02	1	58683	91.84	0	91.84	2005 Corporate
3	5/1/2004	32	0.02	1	57791	91.84	0	91.84	2005 Corporate
3	5/1/2004	33	0.02	1	56636	91.84	0	91.84	2005 Corporate
3	5/1/2004	34	0.03	2	55397	157.95	0	78.98	2005 Corporate
3	5/1/2004	35	0.03	2	53700	157.95	0	78.98	2005 Corporate
3	5/1/2004	36	0.03	2	51186	157.95	0	78.98	2005 Corporate
3	5/1/2004	37	0.03	2	47468	157.95	0	78.98	2005 Corporate
3	5/1/2004	38	0.03	2	42737	157.95	0	78.98	2005 Corporate
3	6/1/2004	0	0	0	77493	0	0	0	2005 Corporate
3	6/1/2004	1	0	0	77493	0	0	0	2005 Corporate
3	6/1/2004	2	0	0	77493	0	0	0	2005 Corporate
3	6/1/2004	3	0	0	77492	0	0	0	2005 Corporate
3	6/1/2004	4	0	0	77489	0	0	0	2005 Corporate
3	6/1/2004	5	0	0	77488	0	0	0	2005 Corporate
3	6/1/2004	6	0	0	77486	0	0	0	2005 Corporate
3	6/1/2004	7	0	0	77482	0	0	0	2005 Corporate
3	6/1/2004	8	0	0	77475	0	0	0	2005 Corporate
3	6/1/2004	9	0	0	77471	0	0	0	2005 Corporate
3	6/1/2004	10	0	0	77467	0	0	0	2005 Corporate
3	6/1/2004	11	0	0	77461	0	0	0	2005 Corporate
3	6/1/2004	12	0	0	77453	0	0	0	2005 Corporate
3	6/1/2004	13	0	0	77445	0	0	0	2005 Corporate
3	6/1/2004	14	0	0	77432	0	0	0	2005 Corporate
3	6/1/2004	15	0	0	77414	0	0	0	2005 Corporate
3	6/1/2004	16	0	0	77389	0	0	0	2005 Corporate
3	6/1/2004	17	0	0	77365	0	0	0	2005 Corporate
3	6/1/2004	18	0	0	77332	0	0	0	2005 Corporate
3	6/1/2004	19	0	0	77294	0	0	0	2005 Corporate
3	6/1/2004	20	0	0	77261	0	0	0	2005 Corporate
3	6/1/2004	21	0	0	77169	0	0	0	2005 Corporate
3	6/1/2004	22	0	0	77079	0	0	0	2005 Corporate
3	6/1/2004	23	0	0	76923	0	0	0	2005 Corporate
3	6/1/2004	24	0	0	76423	0	0	0	2005 Corporate
3	6/1/2004	25	0.01	1	74990	9.15	0	9.15	2005 Corporate
3	6/1/2004	26	0.01	1	72628	9.15	0	9.15	2005 Corporate

3	6/1/2004	27	0.01	1	71240	9.15	0	9.15	2005 Corporate
3	6/1/2004	28	0.01	1	70005	9.15	0	9.15	2005 Corporate
3	6/1/2004	29	0.03	2	68496	54.84	0	27.42	2005 Corporate
3	6/1/2004	30	0.03	2	66332	54.84	0	27.42	2005 Corporate
3	6/1/2004	31	0.03	2	64332	54.84	0	27.42	2005 Corporate
3	6/1/2004	32	0.03	2	62198	54.84	0	27.42	2005 Corporate
3	6/1/2004	33	0.03	2	59923	54.84	0	27.42	2005 Corporate
3	6/1/2004	34	0.03	2	57500	54.84	0	27.42	2005 Corporate
3	6/1/2004	35	0.05	3	54427	86.08	0	28.69	2005 Corporate
3	6/1/2004	36	0.05	3	50085	86.08	0	28.69	2005 Corporate
3	6/1/2004	37	0.05	3	43893	86.08	0	28.69	2005 Corporate
3	7/1/2004	0	0	0	53092	0	0	0	2005 Corporate
3	7/1/2004	1	0	0	53092	0	0	0	2005 Corporate
3	7/1/2004	2	0	0	53091	0	0	0	2005 Corporate
3	7/1/2004	3	0	0	53090	0	0	0	2005 Corporate
3	7/1/2004	4	0	0	53088	0	0	0	2005 Corporate
3	7/1/2004	5	0	0	53086	0	0	0	2005 Corporate
3	7/1/2004	6	0	0	53082	0	0	0	2005 Corporate
3	7/1/2004	7	0	0	53079	0	0	0	2005 Corporate
3	7/1/2004	8	0	0	53076	0	0	0	2005 Corporate
3	7/1/2004	9	0	0	53071	0	0	0	2005 Corporate
3	7/1/2004	10	0	0	53062	0	0	0	2005 Corporate
3	7/1/2004	11	0	0	53049	0	0	0	2005 Corporate
3	7/1/2004	12	0	0	53039	0	0	0	2005 Corporate
3	7/1/2004	13	0	0	53020	0	0	0	2005 Corporate
3	7/1/2004	14	0	0	52996	0	0	0	2005 Corporate
3	7/1/2004	15	0	0	52969	0	0	0	2005 Corporate
3	7/1/2004	16	0	0	52938	0	0	0	2005 Corporate
3	7/1/2004	17	0	0	52891	0	0	0	2005 Corporate
3	7/1/2004	18	0	0	52807	0	0	0	2005 Corporate
3	7/1/2004	19	0	0	52737	0	0	0	2005 Corporate
3	7/1/2004	20	0	0	52646	0	0	0	2005 Corporate
3	7/1/2004	21	0	0	52480	0	0	0	2005 Corporate
3	7/1/2004	22	0	0	52277	0	0	0	2005 Corporate
3	7/1/2004	23	0	0	51995	0	0	0	2005 Corporate
3	7/1/2004	24	0	0	51427	0	0	0	2005 Corporate
3	7/1/2004	25	0	0	50109	0	0	0	2005 Corporate
3	7/1/2004	26	0.02	1	47936	92.67	0	92.67	2005 Corporate
3	7/1/2004	27	0.02	1	46373	92.67	0	92.67	2005 Corporate
3	7/1/2004	28	0.02	1	44913	92.67	0	92.67	2005 Corporate
3	7/1/2004	29	0.02	1	43106	92.67	0	92.67	2005 Corporate
3	7/1/2004	30	0.02	1	40658	92.67	0	92.67	2005 Corporate
3	7/1/2004	31	0.07	3	38318	172.73	0	57.58	2005 Corporate
3	7/1/2004	32	0.07	3	36087	172.73	0	57.58	2005 Corporate
3	7/1/2004	33	0.07	3	32771	172.73	0	57.58	2005 Corporate
3	7/1/2004	34	0.11	4	29581	212.14	0.01	53.04	2005 Corporate
3	7/1/2004	35	0.11	4	25902	212.14	0.01	53.04	2005 Corporate
3	7/1/2004	36	0.11	4	20509	212.14	0.01	53.04	2005 Corporate
3	8/1/2004	0	0	0	214513	0	0	0	2005 Corporate
3	8/1/2004	1	0	0	214513	0	0	0	2005 Corporate
3	8/1/2004	2	0	0	214503	0	0	0	2005 Corporate
3	8/1/2004	3	0	0	214489	0	0	0	2005 Corporate
3	8/1/2004	4	0	0	214478	0	0	0	2005 Corporate
3	8/1/2004	5	0	0	214458	0	0	0	2005 Corporate
3	8/1/2004	6	0	0	214436	0	0	0	2005 Corporate
3	8/1/2004	7	0	0	214414	0	0	0	2005 Corporate

3	8/1/2004	8	0	0	214378	0	0	0	2005 Corporate
3	8/1/2004	9	0	0	214332	0	0	0	2005 Corporate
3	8/1/2004	10	0	0	214284	0	0	0	2005 Corporate
3	8/1/2004	11	0	0	214211	0	0	0	2005 Corporate
3	8/1/2004	12	0	0	214118	0	0	0	2005 Corporate
3	8/1/2004	13	0	0	214001	0	0	0	2005 Corporate
3	8/1/2004	14	0	0	213861	0	0	0	2005 Corporate
3	8/1/2004	15	0	0	213693	0	0	0	2005 Corporate
3	8/1/2004	16	0	0	213481	0	0	0	2005 Corporate
3	8/1/2004	17	0	0	213227	0	0	0	2005 Corporate
3	8/1/2004	18	0	0	212619	0	0	0	2005 Corporate
3	8/1/2004	19	0	0	212129	0	0	0	2005 Corporate
3	8/1/2004	20	0	0	211549	0	0	0	2005 Corporate
3	8/1/2004	21	0	0	210461	0	0	0	2005 Corporate
3	8/1/2004	22	0	0	209300	0	0	0	2005 Corporate
3	8/1/2004	23	0	1	207837	165.72	0	165.72	2005 Corporate
3	8/1/2004	24	0.01	3	204527	2157.92	0.01	719.31	2005 Corporate
3	8/1/2004	25	0.03	7	197150	2390.25	0.01	341.46	2005 Corporate
3	8/1/2004	26	0.03	7	183279	2390.25	0.01	341.46	2005 Corporate
3	8/1/2004	27	0.06	12	173437	3204.49	0.02	267.04	2005 Corporate
3	8/1/2004	28	0.07	13	164091	3371.23	0.02	259.33	2005 Corporate
3	8/1/2004	29	0.08	15	153523	3563.18	0.02	237.55	2005 Corporate
3	8/1/2004	30	0.08	15	141029	3563.18	0.02	237.55	2005 Corporate
3	8/1/2004	31	0.11	18	128286	3856.65	0.02	214.26	2005 Corporate
3	8/1/2004	32	0.13	21	116840	4377.62	0.03	208.46	2005 Corporate
3	8/1/2004	33	0.13	21	101183	4377.62	0.03	208.46	2005 Corporate
3	8/1/2004	34	0.17	24	84955	5235.57	0.04	218.15	2005 Corporate
3	8/1/2004	35	0.17	24	66047	5235.57	0.04	218.15	2005 Corporate
3	9/1/2004	0	0	0	254907	0	0	0	2005 Corporate
3	9/1/2004	1	0	0	254907	0	0	0	2005 Corporate
3	9/1/2004	2	0	0	254898	0	0	0	2005 Corporate
3	9/1/2004	3	0	0	254887	0	0	0	2005 Corporate
3	9/1/2004	4	0	0	254874	0	0	0	2005 Corporate
3	9/1/2004	5	0	0	254856	0	0	0	2005 Corporate
3	9/1/2004	6	0	0	254832	0	0	0	2005 Corporate
3	9/1/2004	7	0	0	254804	0	0	0	2005 Corporate
3	9/1/2004	8	0	0	254775	0	0	0	2005 Corporate
3	9/1/2004	9	0	0	254723	0	0	0	2005 Corporate
3	9/1/2004	10	0	0	254678	0	0	0	2005 Corporate
3	9/1/2004	11	0	0	254602	0	0	0	2005 Corporate
3	9/1/2004	12	0	0	254518	0	0	0	2005 Corporate
3	9/1/2004	13	0	0	254402	0	0	0	2005 Corporate
3	9/1/2004	14	0	0	254235	0	0	0	2005 Corporate
3	9/1/2004	15	0	0	254033	0	0	0	2005 Corporate
3	9/1/2004	16	0	1	253759	19.21	0	19.21	2005 Corporate
3	9/1/2004	17	0	1	253406	19.21	0	19.21	2005 Corporate
3	9/1/2004	18	0	1	252680	19.21	0	19.21	2005 Corporate
3	9/1/2004	19	0	1	251996	19.21	0	19.21	2005 Corporate
3	9/1/2004	20	0	1	251247	19.21	0	19.21	2005 Corporate
3	9/1/2004	21	0	1	249840	19.21	0	19.21	2005 Corporate
3	9/1/2004	22	0	1	248201	19.21	0	19.21	2005 Corporate
3	9/1/2004	23	0	1	246153	19.21	0	19.21	2005 Corporate
3	9/1/2004	24	0.02	4	242159	182.22	0	45.56	2005 Corporate
3	9/1/2004	25	0.02	5	233284	250.04	0	50.01	2005 Corporate
3	9/1/2004	26	0.02	5	216259	250.04	0	50.01	2005 Corporate
3	9/1/2004	27	0.03	6	204019	314.47	0	52.41	2005 Corporate

3	9/1/2004	28	0.03	7	192459	1511.19	0.01	215.88	2005 Corporate
3	9/1/2004	29	0.04	9	180036	2024.73	0.01	224.97	2005 Corporate
3	9/1/2004	30	0.05	11	165005	2551.8	0.01	231.98	2005 Corporate
3	9/1/2004	31	0.05	11	149051	2551.8	0.01	231.98	2005 Corporate
3	9/1/2004	32	0.08	15	134202	4074	0.02	271.6	2005 Corporate
3	9/1/2004	33	0.1	17	112777	4178.84	0.03	245.81	2005 Corporate
3	9/1/2004	34	0.1	17	89733	4178.84	0.03	245.81	2005 Corporate
3	10/1/2004	0	0	0	271490	0	0	0	2005 Corporate
3	10/1/2004	1	0	0	271490	0	0	0	2005 Corporate
3	10/1/2004	2	0	0	271477	0	0	0	2005 Corporate
3	10/1/2004	3	0	0	271462	0	0	0	2005 Corporate
3	10/1/2004	4	0	0	271448	0	0	0	2005 Corporate
3	10/1/2004	5	0	0	271427	0	0	0	2005 Corporate
3	10/1/2004	6	0	0	271399	0	0	0	2005 Corporate
3	10/1/2004	7	0	0	271363	0	0	0	2005 Corporate
3	10/1/2004	8	0	0	271309	0	0	0	2005 Corporate
3	10/1/2004	9	0	0	271270	0	0	0	2005 Corporate
3	10/1/2004	10	0	0	271221	0	0	0	2005 Corporate
3	10/1/2004	11	0	0	271131	0	0	0	2005 Corporate
3	10/1/2004	12	0	0	271020	0	0	0	2005 Corporate
3	10/1/2004	13	0	0	270886	0	0	0	2005 Corporate
3	10/1/2004	14	0	0	270725	0	0	0	2005 Corporate
3	10/1/2004	15	0	0	270513	0	0	0	2005 Corporate
3	10/1/2004	16	0	0	270259	0	0	0	2005 Corporate
3	10/1/2004	17	0	0	269878	0	0	0	2005 Corporate
3	10/1/2004	18	0	0	269069	0	0	0	2005 Corporate
3	10/1/2004	19	0	0	268329	0	0	0	2005 Corporate
3	10/1/2004	20	0	0	267447	0	0	0	2005 Corporate
3	10/1/2004	21	0	0	265871	0	0	0	2005 Corporate
3	10/1/2004	22	0	0	264028	0	0	0	2005 Corporate
3	10/1/2004	23	0	1	261787	35.82	0	35.82	2005 Corporate
3	10/1/2004	24	0	1	257305	35.82	0	35.82	2005 Corporate
3	10/1/2004	25	0.01	2	247496	203.84	0	101.92	2005 Corporate
3	10/1/2004	26	0.01	3	229014	589.86	0	196.62	2005 Corporate
3	10/1/2004	27	0.02	4	215331	609.81	0	152.45	2005 Corporate
3	10/1/2004	28	0.02	5	202676	1161.42	0.01	232.28	2005 Corporate
3	10/1/2004	29	0.03	7	188551	1450.11	0.01	207.16	2005 Corporate
3	10/1/2004	30	0.04	8	171181	1745.18	0.01	218.15	2005 Corporate
3	10/1/2004	31	0.04	9	152223	1838.84	0.01	204.32	2005 Corporate
3	10/1/2004	32	0.09	15	133609	3820.93	0.02	254.73	2005 Corporate
3	10/1/2004	33	0.1	16	103440	3853.86	0.02	240.87	2005 Corporate
3	11/1/2004	0	0	0	211610	0	0	0	2005 Corporate
3	11/1/2004	1	0	0	211610	0	0	0	2005 Corporate
3	11/1/2004	2	0	0	211602	0	0	0	2005 Corporate
3	11/1/2004	3	0	0	211592	0	0	0	2005 Corporate
3	11/1/2004	4	0	1	211580	210	0	210	2005 Corporate
3	11/1/2004	5	0	1	211558	210	0	210	2005 Corporate
3	11/1/2004	6	0	1	211536	210	0	210	2005 Corporate
3	11/1/2004	7	0	1	211505	210	0	210	2005 Corporate
3	11/1/2004	8	0	1	211474	210	0	210	2005 Corporate
3	11/1/2004	9	0	1	211432	210	0	210	2005 Corporate
3	11/1/2004	10	0	1	211383	210	0	210	2005 Corporate
3	11/1/2004	11	0	1	211311	210	0	210	2005 Corporate
3	11/1/2004	12	0	1	211220	210	0	210	2005 Corporate
3	11/1/2004	13	0	1	211129	210	0	210	2005 Corporate
3	11/1/2004	14	0	1	210981	210	0	210	2005 Corporate

3 11/1/2004	15	0	1	210797	210	0	210	2005 Corporate
3 11/1/2004	16	0.01	2	210567	490.03	0	245.02	2005 Corporate
3 11/1/2004	17	0.01	2	210282	490.03	0	245.02	2005 Corporate
3 11/1/2004	18	0.01	2	209674	490.03	0	245.02	2005 Corporate
3 11/1/2004	19	0.01	2	209040	490.03	0	245.02	2005 Corporate
3 11/1/2004	20	0.01	2	208282	490.03	0	245.02	2005 Corporate
3 11/1/2004	21	0.01	2	207041	490.03	0	245.02	2005 Corporate
3 11/1/2004	22	0.01	2	205635	490.03	0	245.02	2005 Corporate
3 11/1/2004	23	0.02	4	203931	607.01	0	151.75	2005 Corporate
3 11/1/2004	24	0.02	5	200508	1141.55	0.01	228.31	2005 Corporate
3 11/1/2004	25	0.03	6	193592	1305.79	0.01	217.63	2005 Corporate
3 11/1/2004	26	0.03	6	179607	1305.79	0.01	217.63	2005 Corporate
3 11/1/2004	27	0.03	6	169323	1305.79	0.01	217.63	2005 Corporate
3 11/1/2004	28	0.04	8	159257	2572.62	0.01	321.58	2005 Corporate
3 11/1/2004	29	0.06	11	148116	2785.46	0.02	253.22	2005 Corporate
3 11/1/2004	30	0.08	14	133594	3236.54	0.02	231.18	2005 Corporate
3 11/1/2004	31	0.08	14	117006	3236.54	0.02	231.18	2005 Corporate
3 11/1/2004	32	0.08	14	99237	3236.54	0.02	231.18	2005 Corporate
3 12/1/2004	0	0	0	235204	0	0	0	2005 Corporate
3 12/1/2004	1	0	0	235204	0	0	0	2005 Corporate
3 12/1/2004	2	0	0	235192	0	0	0	2005 Corporate
3 12/1/2004	3	0	0	235185	0	0	0	2005 Corporate
3 12/1/2004	4	0	0	235175	0	0	0	2005 Corporate
3 12/1/2004	5	0	0	235157	0	0	0	2005 Corporate
3 12/1/2004	6	0	0	235132	0	0	0	2005 Corporate
3 12/1/2004	7	0	0	235095	0	0	0	2005 Corporate
3 12/1/2004	8	0	0	235055	0	0	0	2005 Corporate
3 12/1/2004	9	0	0	235015	0	0	0	2005 Corporate
3 12/1/2004	10	0	0	234955	0	0	0	2005 Corporate
3 12/1/2004	11	0	0	234882	0	0	0	2005 Corporate
3 12/1/2004	12	0	0	234788	0	0	0	2005 Corporate
3 12/1/2004	13	0	0	234674	0	0	0	2005 Corporate
3 12/1/2004	14	0	0	234507	0	0	0	2005 Corporate
3 12/1/2004	15	0	1	234332	75.26	0	75.26	2005 Corporate
3 12/1/2004	16	0	1	234099	75.26	0	75.26	2005 Corporate
3 12/1/2004	17	0	1	233768	75.26	0	75.26	2005 Corporate
3 12/1/2004	18	0	1	232996	75.26	0	75.26	2005 Corporate
3 12/1/2004	19	0.01	2	232225	1294.78	0.01	647.39	2005 Corporate
3 12/1/2004	20	0.01	2	231334	1294.78	0.01	647.39	2005 Corporate
3 12/1/2004	21	0.01	3	229765	1315.51	0.01	438.5	2005 Corporate
3 12/1/2004	22	0.01	3	227903	1315.51	0.01	438.5	2005 Corporate
3 12/1/2004	23	0.02	4	225701	2504.21	0.01	626.05	2005 Corporate
3 12/1/2004	24	0.02	4	221501	2504.21	0.01	626.05	2005 Corporate
3 12/1/2004	25	0.02	4	212830	2504.21	0.01	626.05	2005 Corporate
3 12/1/2004	26	0.03	7	194898	2883	0.01	411.86	2005 Corporate
3 12/1/2004	27	0.04	8	181405	2890.56	0.01	361.32	2005 Corporate
3 12/1/2004	28	0.04	9	167957	3377.17	0.02	375.24	2005 Corporate
3 12/1/2004	29	0.06	11	152494	4176.34	0.02	379.67	2005 Corporate
3 12/1/2004	30	0.07	13	132467	4320.25	0.02	332.33	2005 Corporate
3 12/1/2004	31	0.15	21	108582	8153.6	0.06	388.27	2005 Corporate
3 1/1/2005	0	0	0	273814	0	0	0	2005 Corporate
3 1/1/2005	1	0	0	273814	0	0	0	2005 Corporate
3 1/1/2005	2	0	0	273803	0	0	0	2005 Corporate
3 1/1/2005	3	0	0	273784	0	0	0	2005 Corporate
3 1/1/2005	4	0	0	273758	0	0	0	2005 Corporate
3 1/1/2005	5	0	0	273742	0	0	0	2005 Corporate

3	1/1/2005	6	0	0	273711	0	0	0	2005 Corporate
3	1/1/2005	7	0	0	273669	0	0	0	2005 Corporate
3	1/1/2005	8	0	0	273629	0	0	0	2005 Corporate
3	1/1/2005	9	0	0	273562	0	0	0	2005 Corporate
3	1/1/2005	10	0	0	273496	0	0	0	2005 Corporate
3	1/1/2005	11	0	0	273399	0	0	0	2005 Corporate
3	1/1/2005	12	0	0	273270	0	0	0	2005 Corporate
3	1/1/2005	13	0	0	273092	0	0	0	2005 Corporate
3	1/1/2005	14	0	0	272873	0	0	0	2005 Corporate
3	1/1/2005	15	0	0	272604	0	0	0	2005 Corporate
3	1/1/2005	16	0	0	272274	0	0	0	2005 Corporate
3	1/1/2005	17	0	0	271827	0	0	0	2005 Corporate
3	1/1/2005	18	0	0	270870	0	0	0	2005 Corporate
3	1/1/2005	19	0	0	269863	0	0	0	2005 Corporate
3	1/1/2005	20	0	0	268677	0	0	0	2005 Corporate
3	1/1/2005	21	0	0	266608	0	0	0	2005 Corporate
3	1/1/2005	22	0	0	264200	0	0	0	2005 Corporate
3	1/1/2005	23	0	1	261378	76.71	0	76.71	2005 Corporate
3	1/1/2005	24	0.01	2	256073	563.32	0	281.66	2005 Corporate
3	1/1/2005	25	0.02	6	245328	1613.35	0.01	268.89	2005 Corporate
3	1/1/2005	26	0.02	6	223066	1613.35	0.01	268.89	2005 Corporate
3	1/1/2005	27	0.03	8	205938	2324.58	0.01	290.57	2005 Corporate
3	1/1/2005	28	0.06	13	188925	4044.78	0.02	311.14	2005 Corporate
3	1/1/2005	29	0.1	19	168879	6981.66	0.04	367.46	2005 Corporate
3	1/1/2005	30	0.14	25	139617	9645.08	0.06	385.8	2005 Corporate
3	2/1/2005	0	0	0	261108	0	0	0	2005 Corporate
3	2/1/2005	1	0	0	261108	0	0	0	2005 Corporate
3	2/1/2005	2	0	0	261095	0	0	0	2005 Corporate
3	2/1/2005	3	0	0	261081	0	0	0	2005 Corporate
3	2/1/2005	4	0	0	261051	0	0	0	2005 Corporate
3	2/1/2005	5	0	0	261023	0	0	0	2005 Corporate
3	2/1/2005	6	0	0	260980	0	0	0	2005 Corporate
3	2/1/2005	7	0	0	260940	0	0	0	2005 Corporate
3	2/1/2005	8	0	0	260911	0	0	0	2005 Corporate
3	2/1/2005	9	0	0	260866	0	0	0	2005 Corporate
3	2/1/2005	10	0	0	260795	0	0	0	2005 Corporate
3	2/1/2005	11	0	0	260709	0	0	0	2005 Corporate
3	2/1/2005	12	0	0	260584	0	0	0	2005 Corporate
3	2/1/2005	13	0	0	260404	0	0	0	2005 Corporate
3	2/1/2005	14	0	0	260176	0	0	0	2005 Corporate
3	2/1/2005	15	0	0	259939	0	0	0	2005 Corporate
3	2/1/2005	16	0	0	259607	0	0	0	2005 Corporate
3	2/1/2005	17	0	0	259116	0	0	0	2005 Corporate
3	2/1/2005	18	0	0	258057	0	0	0	2005 Corporate
3	2/1/2005	19	0	1	257022	17.75	0	17.75	2005 Corporate
3	2/1/2005	20	0	1	255734	17.75	0	17.75	2005 Corporate
3	2/1/2005	21	0	1	253334	17.75	0	17.75	2005 Corporate
3	2/1/2005	22	0	1	250469	17.75	0	17.75	2005 Corporate
3	2/1/2005	23	0.01	3	247130	1308.75	0.01	436.25	2005 Corporate
3	2/1/2005	24	0.02	6	241446	1538.05	0.01	256.34	2005 Corporate
3	2/1/2005	25	0.03	7	229949	1848.19	0.01	264.03	2005 Corporate
3	2/1/2005	26	0.04	9	205884	2440.68	0.01	271.19	2005 Corporate
3	2/1/2005	27	0.06	13	186199	3650.59	0.02	280.81	2005 Corporate
3	2/1/2005	28	0.08	17	166071	4993.08	0.03	293.71	2005 Corporate
3	2/1/2005	29	0.13	23	140639	7089.64	0.04	308.25	2005 Corporate
3	3/1/2005	0	0	0	261701	0	0	0	2005 Corporate

3	3/1/2005	1	0	0	261701	0	0	0	2005 Corporate
3	3/1/2005	2	0	0	261682	0	0	0	2005 Corporate
3	3/1/2005	3	0	0	261669	0	0	0	2005 Corporate
3	3/1/2005	4	0	0	261644	0	0	0	2005 Corporate
3	3/1/2005	5	0	0	261609	0	0	0	2005 Corporate
3	3/1/2005	6	0	0	261571	0	0	0	2005 Corporate
3	3/1/2005	7	0	0	261528	0	0	0	2005 Corporate
3	3/1/2005	8	0	0	261476	0	0	0	2005 Corporate
3	3/1/2005	9	0	0	261400	0	0	0	2005 Corporate
3	3/1/2005	10	0	0	261331	0	0	0	2005 Corporate
3	3/1/2005	11	0	0	261212	0	0	0	2005 Corporate
3	3/1/2005	12	0	0	261058	0	0	0	2005 Corporate
3	3/1/2005	13	0	0	260900	0	0	0	2005 Corporate
3	3/1/2005	14	0	0	260689	0	0	0	2005 Corporate
3	3/1/2005	15	0	0	260379	0	0	0	2005 Corporate
3	3/1/2005	16	0	0	260002	0	0	0	2005 Corporate
3	3/1/2005	17	0	0	259434	0	0	0	2005 Corporate
3	3/1/2005	18	0	0	258216	0	0	0	2005 Corporate
3	3/1/2005	19	0	0	257045	0	0	0	2005 Corporate
3	3/1/2005	20	0	1	255398	952.66	0	952.66	2005 Corporate
3	3/1/2005	21	0.01	2	252492	975.01	0	487.51	2005 Corporate
3	3/1/2005	22	0.01	2	249143	975.01	0	487.51	2005 Corporate
3	3/1/2005	23	0.01	3	244952	1041.94	0	347.31	2005 Corporate
3	3/1/2005	24	0.01	3	237525	1041.94	0	347.31	2005 Corporate
3	3/1/2005	25	0.01	3	223217	1041.94	0	347.31	2005 Corporate
3	3/1/2005	26	0.01	3	192914	1041.94	0	347.31	2005 Corporate
3	3/1/2005	27	0.04	8	167046	1706.89	0.01	213.36	2005 Corporate
3	3/1/2005	28	0.08	13	139416	2805.21	0.02	215.79	2005 Corporate
3	4/1/2005	0	0	0	244622	0	0	0	2005 Corporate
3	4/1/2005	1	0	0	244622	0	0	0	2005 Corporate
3	4/1/2005	2	0	0	244615	0	0	0	2005 Corporate
3	4/1/2005	3	0	0	244601	0	0	0	2005 Corporate
3	4/1/2005	4	0	0	244581	0	0	0	2005 Corporate
3	4/1/2005	5	0	0	244559	0	0	0	2005 Corporate
3	4/1/2005	6	0	0	244516	0	0	0	2005 Corporate
3	4/1/2005	7	0	0	244480	0	0	0	2005 Corporate
3	4/1/2005	8	0	0	244424	0	0	0	2005 Corporate
3	4/1/2005	9	0	0	244337	0	0	0	2005 Corporate
3	4/1/2005	10	0	0	244264	0	0	0	2005 Corporate
3	4/1/2005	11	0	0	244149	0	0	0	2005 Corporate
3	4/1/2005	12	0	0	243968	0	0	0	2005 Corporate
3	4/1/2005	13	0	0	243783	0	0	0	2005 Corporate
3	4/1/2005	14	0	0	243553	0	0	0	2005 Corporate
3	4/1/2005	15	0	0	243239	0	0	0	2005 Corporate
3	4/1/2005	16	0	0	242807	0	0	0	2005 Corporate
3	4/1/2005	17	0	0	242185	0	0	0	2005 Corporate
3	4/1/2005	18	0	0	240833	0	0	0	2005 Corporate
3	4/1/2005	19	0	0	239412	0	0	0	2005 Corporate
3	4/1/2005	20	0.01	3	237811	2075.96	0.01	691.99	2005 Corporate
3	4/1/2005	21	0.01	3	234615	2075.96	0.01	691.99	2005 Corporate
3	4/1/2005	22	0.02	4	231074	2301.52	0.01	575.38	2005 Corporate
3	4/1/2005	23	0.02	5	226962	3201.37	0.01	640.27	2005 Corporate
3	4/1/2005	24	0.04	10	219465	4573.17	0.02	457.32	2005 Corporate
3	4/1/2005	25	0.05	12	204024	5742.7	0.03	478.56	2005 Corporate
3	4/1/2005	26	0.09	18	169157	6026.12	0.03	334.78	2005 Corporate
3	4/1/2005	27	0.13	24	136990	7071.22	0.03	294.63	2005 Corporate

3	5/1/2005	0	0	0	157637	0	0	0	2005 Corporate
3	5/1/2005	1	0	0	157637	0	0	0	2005 Corporate
3	5/1/2005	2	0	0	157630	0	0	0	2005 Corporate
3	5/1/2005	3	0	0	157625	0	0	0	2005 Corporate
3	5/1/2005	4	0	0	157612	0	0	0	2005 Corporate
3	5/1/2005	5	0	0	157595	0	0	0	2005 Corporate
3	5/1/2005	6	0	0	157564	0	0	0	2005 Corporate
3	5/1/2005	7	0	0	157531	0	0	0	2005 Corporate
3	5/1/2005	8	0	0	157485	0	0	0	2005 Corporate
3	5/1/2005	9	0	0	157447	0	0	0	2005 Corporate
3	5/1/2005	10	0	0	157376	0	0	0	2005 Corporate
3	5/1/2005	11	0	0	157293	0	0	0	2005 Corporate
3	5/1/2005	12	0	0	157178	0	0	0	2005 Corporate
3	5/1/2005	13	0	0	157011	0	0	0	2005 Corporate
3	5/1/2005	14	0	0	156815	0	0	0	2005 Corporate
3	5/1/2005	15	0	0	156554	0	0	0	2005 Corporate
3	5/1/2005	16	0	0	156217	0	0	0	2005 Corporate
3	5/1/2005	17	0	0	155736	0	0	0	2005 Corporate
3	5/1/2005	18	0	0	154503	0	0	0	2005 Corporate
3	5/1/2005	19	0.01	1	153286	302.14	0	302.14	2005 Corporate
3	5/1/2005	20	0.01	1	151943	302.14	0	302.14	2005 Corporate
3	5/1/2005	21	0.01	1	149315	302.14	0	302.14	2005 Corporate
3	5/1/2005	22	0.01	2	146164	788.36	0.01	394.18	2005 Corporate
3	5/1/2005	23	0.08	12	142237	4377.24	0.03	364.77	2005 Corporate
3	5/1/2005	24	0.19	26	134948	8262.32	0.06	317.78	2005 Corporate
3	5/1/2005	25	0.26	35	120664	11195.11	0.08	319.86	2005 Corporate
3	5/1/2005	26	0.32	40	90564	12041.08	0.09	301.03	2005 Corporate
3	6/1/2005	0	0.01	1	168907	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	1	0.01	1	168907	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	2	0.01	1	168899	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	3	0.01	1	168890	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	4	0.01	1	168880	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	5	0.01	1	168868	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	6	0.01	1	168846	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	7	0.01	1	168827	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	8	0.01	1	168792	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	9	0.01	1	168748	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	10	0.01	1	168703	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	11	0.01	1	168604	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	12	0.01	1	168485	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	13	0.01	1	168290	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	14	0.01	1	168026	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	15	0.01	1	167628	1224.19	0.01	1224.19	2005 Corporate
3	6/1/2005	16	0.01	2	167126	1349.32	0.01	674.66	2005 Corporate
3	6/1/2005	17	0.01	2	166217	1349.32	0.01	674.66	2005 Corporate
3	6/1/2005	18	0.01	2	164131	1349.32	0.01	674.66	2005 Corporate
3	6/1/2005	19	0.02	3	162202	1411.07	0.01	470.36	2005 Corporate
3	6/1/2005	20	0.02	3	159975	1411.07	0.01	470.36	2005 Corporate
3	6/1/2005	21	0.02	4	156194	1486.98	0.01	371.75	2005 Corporate
3	6/1/2005	22	0.03	5	151382	1564.36	0.01	312.87	2005 Corporate
3	6/1/2005	23	0.06	9	144925	2124.88	0.01	236.1	2005 Corporate
3	6/1/2005	24	0.07	10	133110	2185.13	0.01	218.51	2005 Corporate
3	6/1/2005	25	0.1	14	107452	2501.47	0.02	178.68	2005 Corporate
3	7/1/2005	0	0	0	50862	0	0	0	2005 Corporate
3	7/1/2005	1	0	0	50862	0	0	0	2005 Corporate
3	7/1/2005	2	0	0	50860	0	0	0	2005 Corporate



3	7/1/2005	3	0	0	50859	0	0	0	2005 Corporate
3	7/1/2005	4	0	0	50856	0	0	0	2005 Corporate
3	7/1/2005	5	0	0	50850	0	0	0	2005 Corporate
3	7/1/2005	6	0	0	50839	0	0	0	2005 Corporate
3	7/1/2005	7	0	0	50832	0	0	0	2005 Corporate
3	7/1/2005	8	0	0	50823	0	0	0	2005 Corporate
3	7/1/2005	9	0	0	50811	0	0	0	2005 Corporate
3	7/1/2005	10	0	0	50795	0	0	0	2005 Corporate
3	7/1/2005	11	0	0	50768	0	0	0	2005 Corporate
3	7/1/2005	12	0	0	50731	0	0	0	2005 Corporate
3	7/1/2005	13	0	0	50671	0	0	0	2005 Corporate
3	7/1/2005	14	0.02	1	50582	33.44	0	33.44	2005 Corporate
3	7/1/2005	15	0.02	1	50445	33.44	0	33.44	2005 Corporate
3	7/1/2005	16	0.04	2	50208	661.75	0.01	330.88	2005 Corporate
3	7/1/2005	17	0.04	2	49742	661.75	0.01	330.88	2005 Corporate
3	7/1/2005	18	0.08	4	48502	1351.43	0.03	337.86	2005 Corporate
3	7/1/2005	19	0.08	4	47404	1351.43	0.03	337.86	2005 Corporate
3	7/1/2005	20	0.08	4	46184	1351.43	0.03	337.86	2005 Corporate
3	7/1/2005	21	0.1	5	43884	1384.73	0.03	276.95	2005 Corporate
3	7/1/2005	22	0.1	5	40848	1384.73	0.03	276.95	2005 Corporate
3	7/1/2005	23	0.19	8	36831	2083.76	0.05	260.47	2005 Corporate
3	7/1/2005	24	0.22	9	29320	2168.87	0.05	240.99	2005 Corporate
3	8/1/2005	0	0	0	39116		0		2005 Corporate
3	8/1/2005	1	0	0	39116		0		2005 Corporate
3	8/1/2005	2	0	0	39116		0		2005 Corporate
3	8/1/2005	3	0	0	39114		0		2005 Corporate
3	8/1/2005	4	0	0	39112		0		2005 Corporate
3	8/1/2005	5	0	0	39111		0		2005 Corporate
3	8/1/2005	6	0	0	39107		0		2005 Corporate
3	8/1/2005	7	0	0	39104		0		2005 Corporate
3	8/1/2005	8	0	0	39100		0		2005 Corporate
3	8/1/2005	9	0	0	39086		0		2005 Corporate
3	8/1/2005	10	0	0	39074		0		2005 Corporate
3	8/1/2005	11	0	0	39056		0		2005 Corporate
3	8/1/2005	12	0	0	39032		0		2005 Corporate
3	8/1/2005	13	0	0	39004		0		2005 Corporate
3	8/1/2005	14	0	0	38954		0		2005 Corporate
3	8/1/2005	15	0	0	38892		0		2005 Corporate
3	8/1/2005	16	0	0	38814		0		2005 Corporate
3	8/1/2005	17	0	0	38659		0		2005 Corporate
3	8/1/2005	18	0	0	38042		0		2005 Corporate
3	8/1/2005	19	0	0	37276		0		2005 Corporate
3	8/1/2005	20	0	0	36281		0		2005 Corporate
3	8/1/2005	21	0	0	33613		0		2005 Corporate
3	8/1/2005	22	0	0	29617		0		2005 Corporate
3	8/1/2005	23	0	0	24141		0		2005 Corporate
3	9/1/2005	0	0	0	1860		0		2005 Corporate
3	9/1/2005	1	0	0	1860		0		2005 Corporate
3	9/1/2005	2	0	0	1860		0		2005 Corporate
3	9/1/2005	3	0	0	1859		0		2005 Corporate
3	9/1/2005	4	0	0	1856		0		2005 Corporate
3	9/1/2005	5	0	0	1854		0		2005 Corporate
3	9/1/2005	6	0	0	1851		0		2005 Corporate
3	9/1/2005	7	0	0	1847		0		2005 Corporate
3	9/1/2005	8	0	0	1847		0		2005 Corporate
3	9/1/2005	9	0	0	1845		0		2005 Corporate

3	9/1/2005	10	0	1842				0	2005 Corporate
3	9/1/2005	11	0	1838				0	2005 Corporate
3	9/1/2005	12	0	1837				0	2005 Corporate
3	9/1/2005	13	0	1831				0	2005 Corporate
3	9/1/2005	14	0	1828				0	2005 Corporate
3	9/1/2005	15	0	1817				0	2005 Corporate
3	9/1/2005	16	0	1795				0	2005 Corporate
3	9/1/2005	17	0	1764				0	2005 Corporate
3	9/1/2005	18	0	1712				0	2005 Corporate
3	9/1/2005	19	0	1663				0	2005 Corporate
3	9/1/2005	20	0	1580				0	2005 Corporate
3	9/1/2005	21	0	1360				0	2005 Corporate
3	9/1/2005	22	0	1043				0	2005 Corporate
3	10/1/2005	0	0	156				0	2005 Corporate
3	10/1/2005	1	0	156				0	2005 Corporate
3	10/1/2005	2	0	154				0	2005 Corporate
3	10/1/2005	3	0	154				0	2005 Corporate
3	10/1/2005	4	0	154				0	2005 Corporate
3	10/1/2005	5	0	154				0	2005 Corporate
3	10/1/2005	6	0	152				0	2005 Corporate
3	10/1/2005	7	0	151				0	2005 Corporate
3	10/1/2005	8	0	149				0	2005 Corporate
3	10/1/2005	9	0	148				0	2005 Corporate
3	10/1/2005	10	0	144				0	2005 Corporate
3	10/1/2005	11	0	142				0	2005 Corporate
3	10/1/2005	12	0	141				0	2005 Corporate
3	10/1/2005	13	0	138				0	2005 Corporate
3	10/1/2005	14	0	136				0	2005 Corporate
3	10/1/2005	15	0	135				0	2005 Corporate
3	10/1/2005	16	0	131				0	2005 Corporate
3	10/1/2005	17	0	127				0	2005 Corporate
3	10/1/2005	18	0	117				0	2005 Corporate
3	10/1/2005	19	0	106				0	2005 Corporate
4		0	0	2772807		0	0	0	2006 Corporate
4		1	0	2772807		0	0	0	2006 Corporate
4		2	0	2770405		585.73	0	195.24	2006 Corporate
4		3	0	2767288		585.73	0	195.24	2006 Corporate
4		4	0	2762842		585.73	0	195.24	2006 Corporate
4		5	0	2756733		631.94	0	126.39	2006 Corporate
4		6	0	2744306		777.83	0	111.12	2006 Corporate
4		7	0	2729984		2129.4	0	193.58	2006 Corporate
4		8	0.01	2708895		2842.69	0	189.51	2006 Corporate
4		9	0.01	2668282		8134.2	0	406.71	2006 Corporate
4		10	0.01	2620371		11957.47	0	412.33	2006 Corporate
4		11	0.02	2555051		18027.44	0.01	419.24	2006 Corporate
4		12	0.02	2480453		20254.5	0.01	326.69	2006 Corporate
4		13	0.03	2264272		23837.74	0.01	305.61	2006 Corporate
4		14	0.04	2087562		25660.94	0.01	294.95	2006 Corporate
4		15	0.04	1872106		28005.65	0.01	269.29	2006 Corporate
4		16	0.06	1644838		30654.21	0.01	251.26	2006 Corporate
4		17	0.07	1394876		32879.39	0.01	241.76	2006 Corporate
4		18	0.08	1141183		37869.92	0.02	244.32	2006 Corporate
4		19	0.11	913368		42203.11	0.02	235.77	2006 Corporate
4		20	0.12	728475		44725.6	0.03	237.9	2006 Corporate
4		21	0.14	554949		47404.22	0.03	240.63	2006 Corporate
4		22	0.15	395935		50371.5	0.04	249.36	2006 Corporate

4		23	0.16	206	265015					2006	Corporate
4		24	0.18	208	166249	51092.42	0.04	248.02		2006	Corporate
4		25	0.18	208	112584	51574.28	0.05	247.95		2006	Corporate
4		26	0.18	208	52622	51574.28	0.05	247.95		2006	Corporate
4		27	0.18	208	6682	51574.28	0.05	247.95		2006	Corporate
4		28	0.65	209	2134	52314.64	0.39	250.31		2006	Corporate
4		29	0.65	209	968	52314.64	0.39	250.31		2006	Corporate
4		30	0.65	209	178	52314.64	0.39	250.31		2006	Corporate
4	1/1/2005	0	0		596		0			2006	Corporate
4	1/1/2005	1	0		596		0			2006	Corporate
4	1/1/2005	2	0		595		0			2006	Corporate
4	1/1/2005	3	0		595		0			2006	Corporate
4	1/1/2005	4	0		593		0			2006	Corporate
4	1/1/2005	5	0		590		0			2006	Corporate
4	1/1/2005	6	0		588		0			2006	Corporate
4	1/1/2005	7	0		585		0			2006	Corporate
4	1/1/2005	8	0		582		0			2006	Corporate
4	1/1/2005	9	0		580		0			2006	Corporate
4	1/1/2005	10	0		575		0			2006	Corporate
4	1/1/2005	11	0		568		0			2006	Corporate
4	1/1/2005	12	0		564		0			2006	Corporate
4	1/1/2005	13	0		555		0			2006	Corporate
4	1/1/2005	14	0		548		0			2006	Corporate
4	1/1/2005	15	0		533		0			2006	Corporate
4	1/1/2005	16	0		522		0			2006	Corporate
4	1/1/2005	17	0		508		0			2006	Corporate
4	1/1/2005	18	0		497		0			2006	Corporate
4	1/1/2005	19	0		474		0			2006	Corporate
4	1/1/2005	20	0		465		0			2006	Corporate
4	1/1/2005	21	0		452		0			2006	Corporate
4	1/1/2005	22	0		434		0			2006	Corporate
4	1/1/2005	23	0		404		0			2006	Corporate
4	1/1/2005	24	0		383		0			2006	Corporate
4	1/1/2005	25	0		360		0			2006	Corporate
4	1/1/2005	26	0		322		0			2006	Corporate
4	1/1/2005	27	0		276		0			2006	Corporate
4	1/1/2005	28	0		233		0			2006	Corporate
4	1/1/2005	29	0		185		0			2006	Corporate
4	1/1/2005	30	0		135		0			2006	Corporate
4	2/1/2005	0	0	0	2348	0	0	0		2006	Corporate
4	2/1/2005	1	0	0	2348	0	0	0		2006	Corporate
4	2/1/2005	2	0	0	2343	0	0	0		2006	Corporate
4	2/1/2005	3	0	0	2336	0	0	0		2006	Corporate
4	2/1/2005	4	0	0	2328	0	0	0		2006	Corporate
4	2/1/2005	5	0	0	2325	0	0	0		2006	Corporate
4	2/1/2005	6	0	0	2317	0	0	0		2006	Corporate
4	2/1/2005	7	0	0	2308	0	0	0		2006	Corporate
4	2/1/2005	8	0	0	2303	0	0	0		2006	Corporate
4	2/1/2005	9	0	0	2293	0	0	0		2006	Corporate
4	2/1/2005	10	0	0	2283	0	0	0		2006	Corporate
4	2/1/2005	11	0	0	2277	0	0	0		2006	Corporate
4	2/1/2005	12	0	0	2262	0	0	0		2006	Corporate
4	2/1/2005	13	0	0	2239	0	0	0		2006	Corporate
4	2/1/2005	14	0	0	2219	0	0	0		2006	Corporate
4	2/1/2005	15	0	0	2183	0	0	0		2006	Corporate
4	2/1/2005	16	0	0	2162	0	0	0		2006	Corporate

4	2/1/2005	17	0	0	2135	0	0	0	2006 Corporate
4	2/1/2005	18	0	0	2057	0	0	0	2006 Corporate
4	2/1/2005	19	0	0	1988	0	0	0	2006 Corporate
4	2/1/2005	20	0	0	1924	0	0	0	2006 Corporate
4	2/1/2005	21	0	0	1855	0	0	0	2006 Corporate
4	2/1/2005	22	0	0	1764	0	0	0	2006 Corporate
4	2/1/2005	23	0	0	1676	0	0	0	2006 Corporate
4	2/1/2005	24	0	0	1573	0	0	0	2006 Corporate
4	2/1/2005	25	0	0	1454	0	0	0	2006 Corporate
4	2/1/2005	26	0	0	1300	0	0	0	2006 Corporate
4	2/1/2005	27	0	0	1130	0	0	0	2006 Corporate
4	2/1/2005	28	1.02	1	979	740.36	0.76	740.36	2006 Corporate
4	2/1/2005	29	1.02	1	740	740.36	0.76	740.36	2006 Corporate
4	3/1/2005	0	0	0	2161		0		2006 Corporate
4	3/1/2005	1	0	0	2161		0		2006 Corporate
4	3/1/2005	2	0	0	2159		0		2006 Corporate
4	3/1/2005	3	0	0	2157		0		2006 Corporate
4	3/1/2005	4	0	0	2155		0		2006 Corporate
4	3/1/2005	5	0	0	2153		0		2006 Corporate
4	3/1/2005	6	0	0	2148		0		2006 Corporate
4	3/1/2005	7	0	0	2142		0		2006 Corporate
4	3/1/2005	8	0	0	2137		0		2006 Corporate
4	3/1/2005	9	0	0	2133		0		2006 Corporate
4	3/1/2005	10	0	0	2128		0		2006 Corporate
4	3/1/2005	11	0	0	2119		0		2006 Corporate
4	3/1/2005	12	0	0	2114		0		2006 Corporate
4	3/1/2005	13	0	0	2107		0		2006 Corporate
4	3/1/2005	14	0	0	2093		0		2006 Corporate
4	3/1/2005	15	0	0	2084		0		2006 Corporate
4	3/1/2005	16	0	0	2068		0		2006 Corporate
4	3/1/2005	17	0	0	2034		0		2006 Corporate
4	3/1/2005	18	0	0	1962		0		2006 Corporate
4	3/1/2005	19	0	0	1916		0		2006 Corporate
4	3/1/2005	20	0	0	1871		0		2006 Corporate
4	3/1/2005	21	0	0	1785		0		2006 Corporate
4	3/1/2005	22	0	0	1717		0		2006 Corporate
4	3/1/2005	23	0	0	1642		0		2006 Corporate
4	3/1/2005	24	0	0	1538		0		2006 Corporate
4	3/1/2005	25	0	0	1432		0		2006 Corporate
4	3/1/2005	26	0	0	1261		0		2006 Corporate
4	3/1/2005	27	0	0	1081		0		2006 Corporate
4	3/1/2005	28	0	0	877		0		2006 Corporate
4	4/1/2005	0	0	0	10486		0		2006 Corporate
4	4/1/2005	1	0	0	10486		0		2006 Corporate
4	4/1/2005	2	0	0	10446		0		2006 Corporate
4	4/1/2005	3	0	0	10432		0		2006 Corporate
4	4/1/2005	4	0	0	10419		0		2006 Corporate
4	4/1/2005	5	0	0	10391		0		2006 Corporate
4	4/1/2005	6	0	0	10367		0		2006 Corporate
4	4/1/2005	7	0	0	10338		0		2006 Corporate
4	4/1/2005	8	0	0	10302		0		2006 Corporate
4	4/1/2005	9	0	0	10254		0		2006 Corporate
4	4/1/2005	10	0	0	10200		0		2006 Corporate
4	4/1/2005	11	0	0	10143		0		2006 Corporate
4	4/1/2005	12	0	0	10065		0		2006 Corporate
4	4/1/2005	13	0	0	9941		0		2006 Corporate

4	4/1/2005	14	0	9819				2006 Corporate
4	4/1/2005	15	0	9667				2006 Corporate
4	4/1/2005	16	0	9540				2006 Corporate
4	4/1/2005	17	0	9368				2006 Corporate
4	4/1/2005	18	0	9087				2006 Corporate
4	4/1/2005	19	0	8834				2006 Corporate
4	4/1/2005	20	0	8592				2006 Corporate
4	4/1/2005	21	0	8221				2006 Corporate
4	4/1/2005	22	0	7826				2006 Corporate
4	4/1/2005	23	0	7380				2006 Corporate
4	4/1/2005	24	0	6788				2006 Corporate
4	4/1/2005	25	0	5972				2006 Corporate
4	4/1/2005	26	0	5080				2006 Corporate
4	4/1/2005	27	0	4149				2006 Corporate
4	5/1/2005	0	0	93802	0	0	0	2006 Corporate
4	5/1/2005	1	0	93802	0	0	0	2006 Corporate
4	5/1/2005	2	0	93758	0	0	0	2006 Corporate
4	5/1/2005	3	0	93725	0	0	0	2006 Corporate
4	5/1/2005	4	0	93688	0	0	0	2006 Corporate
4	5/1/2005	5	0	93617	0	0	0	2006 Corporate
4	5/1/2005	6	0	93434	0	0	0	2006 Corporate
4	5/1/2005	7	0	93254	0	0	0	2006 Corporate
4	5/1/2005	8	0	92996	0	0	0	2006 Corporate
4	5/1/2005	9	0	92570	0	0	0	2006 Corporate
4	5/1/2005	10	0	92108	0	0	0	2006 Corporate
4	5/1/2005	11	0	91527	0	0	0	2006 Corporate
4	5/1/2005	12	0	90892	0	0	0	2006 Corporate
4	5/1/2005	13	0	89517	0	0	0	2006 Corporate
4	5/1/2005	14	0	88463	0	0	0	2006 Corporate
4	5/1/2005	15	0	87054	0	0	0	2006 Corporate
4	5/1/2005	16	0	85504	0	0	0	2006 Corporate
4	5/1/2005	17	0	83760	0	0	0	2006 Corporate
4	5/1/2005	18	0	81260	0	0	0	2006 Corporate
4	5/1/2005	19	0	78852	0	0	0	2006 Corporate
4	5/1/2005	20	0	76777	0	0	0	2006 Corporate
4	5/1/2005	21	0	73310	0	0	0	2006 Corporate
4	5/1/2005	22	0	70050	0	0	0	2006 Corporate
4	5/1/2005	23	0.02	66580	563.66	0.01	563.66	2006 Corporate
4	5/1/2005	24	0.02	61990	563.66	0.01	563.66	2006 Corporate
4	5/1/2005	25	0.02	52945	563.66	0.01	563.66	2006 Corporate
4	5/1/2005	26	0.02	44611	563.66	0.01	563.66	2006 Corporate
4	6/1/2005	0	0	109011	0	0	0	2006 Corporate
4	6/1/2005	1	0	109011	0	0	0	2006 Corporate
4	6/1/2005	2	0	108964	0	0	0	2006 Corporate
4	6/1/2005	3	0	108878	0	0	0	2006 Corporate
4	6/1/2005	4	0	108809	0	0	0	2006 Corporate
4	6/1/2005	5	0	108690	0	0	0	2006 Corporate
4	6/1/2005	6	0	108432	0	0	0	2006 Corporate
4	6/1/2005	7	0	108159	0	0	0	2006 Corporate
4	6/1/2005	8	0	107760	0	0	0	2006 Corporate
4	6/1/2005	9	0	107195	0	0	0	2006 Corporate
4	6/1/2005	10	0	106589	0	0	0	2006 Corporate
4	6/1/2005	11	0	105847	0	0	0	2006 Corporate
4	6/1/2005	12	0	105071	0	0	0	2006 Corporate
4	6/1/2005	13	0	102999	0	0	0	2006 Corporate
4	6/1/2005	14	0.01	101410	49.95	0	49.95	2006 Corporate

4	6/1/2005	15	0.01	1	99471	49.95	0	49.95	2006 Corporate
4	6/1/2005	16	0.02	2	97405	78.01	0	39.01	2006 Corporate
4	6/1/2005	17	0.02	2	95043	78.01	0	39.01	2006 Corporate
4	6/1/2005	18	0.02	2	91552	78.01	0	39.01	2006 Corporate
4	6/1/2005	19	0.03	3	88585	1529.07	0.02	509.69	2006 Corporate
4	6/1/2005	20	0.03	3	85659	1529.07	0.02	509.69	2006 Corporate
4	6/1/2005	21	0.03	3	80954	1529.07	0.02	509.69	2006 Corporate
4	6/1/2005	22	0.04	4	76189	1933.74	0.02	483.44	2006 Corporate
4	6/1/2005	23	0.06	5	71087	1990.14	0.02	398.03	2006 Corporate
4	6/1/2005	24	0.07	6	64414	2026.37	0.02	337.73	2006 Corporate
4	6/1/2005	25	0.07	6	50368	2026.37	0.02	337.73	2006 Corporate
4	7/1/2005	0	0	0	66586	0	0	0	2006 Corporate
4	7/1/2005	1	0	0	66586	0	0	0	2006 Corporate
4	7/1/2005	2	0	0	66557	0	0	0	2006 Corporate
4	7/1/2005	3	0	0	66504	0	0	0	2006 Corporate
4	7/1/2005	4	0	0	66437	0	0	0	2006 Corporate
4	7/1/2005	5	0	0	66359	0	0	0	2006 Corporate
4	7/1/2005	6	0	0	66161	0	0	0	2006 Corporate
4	7/1/2005	7	0	0	65963	0	0	0	2006 Corporate
4	7/1/2005	8	0	0	65697	0	0	0	2006 Corporate
4	7/1/2005	9	0	0	65250	0	0	0	2006 Corporate
4	7/1/2005	10	0	0	64814	0	0	0	2006 Corporate
4	7/1/2005	11	0	0	64330	0	0	0	2006 Corporate
4	7/1/2005	12	0	0	63716	0	0	0	2006 Corporate
4	7/1/2005	13	0	0	61778	0	0	0	2006 Corporate
4	7/1/2005	14	0	0	60448	0	0	0	2006 Corporate
4	7/1/2005	15	0	0	58765	0	0	0	2006 Corporate
4	7/1/2005	16	0	0	57138	0	0	0	2006 Corporate
4	7/1/2005	17	0.02	1	55329	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	18	0.02	1	52768	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	19	0.02	1	50391	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	20	0.02	1	48036	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	21	0.02	1	44377	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	22	0.02	1	40676	514.41	0.01	514.41	2006 Corporate
4	7/1/2005	23	0.05	2	36143	591.74	0.01	295.87	2006 Corporate
4	7/1/2005	24	0.08	3	29508	1037.37	0.03	345.79	2006 Corporate
4	8/1/2005	0	0	0	212870	0	0	0	2006 Corporate
4	8/1/2005	1	0	0	212870	0	0	0	2006 Corporate
4	8/1/2005	2	0	0	212760	0	0	0	2006 Corporate
4	8/1/2005	3	0	0	212608	0	0	0	2006 Corporate
4	8/1/2005	4	0	0	212421	0	0	0	2006 Corporate
4	8/1/2005	5	0	0	212160	0	0	0	2006 Corporate
4	8/1/2005	6	0	0	211594	0	0	0	2006 Corporate
4	8/1/2005	7	0	0	210998	0	0	0	2006 Corporate
4	8/1/2005	8	0	0	210107	0	0	0	2006 Corporate
4	8/1/2005	9	0	1	208671	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	10	0	1	207159	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	11	0	1	205133	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	12	0	1	202523	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	13	0	1	194866	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	14	0	1	189431	2671.87	0.01	2671.87	2006 Corporate
4	8/1/2005	15	0.01	2	182738	2972.39	0.01	1486.2	2006 Corporate
4	8/1/2005	16	0.01	2	175809	2972.39	0.01	1486.2	2006 Corporate
4	8/1/2005	17	0.01	2	167840	2972.39	0.01	1486.2	2006 Corporate
4	8/1/2005	18	0.01	2	157501	2972.39	0.01	1486.2	2006 Corporate
4	8/1/2005	19	0.01	2	146476	2972.39	0.01	1486.2	2006 Corporate

4	8/1/2005	20	0.02	3	135659	3076.9	0.02	1025.63	2006 Corporate
4	8/1/2005	21	0.04	6	119442	4449.41	0.03	741.57	2006 Corporate
4	8/1/2005	22	0.05	7	101838	4476.41	0.03	639.49	2006 Corporate
4	8/1/2005	23	0.07	8	80045	4499.94	0.03	562.49	2006 Corporate
4	9/1/2005	0	0	0	259682	0	0	0	2006 Corporate
4	9/1/2005	1	0	0	259682	0	0	0	2006 Corporate
4	9/1/2005	2	0	0	259545	0	0	0	2006 Corporate
4	9/1/2005	3	0	0	259397	0	0	0	2006 Corporate
4	9/1/2005	4	0	0	259150	0	0	0	2006 Corporate
4	9/1/2005	5	0	0	258808	0	0	0	2006 Corporate
4	9/1/2005	6	0	0	258110	0	0	0	2006 Corporate
4	9/1/2005	7	0	1	257289	1209.54	0	1209.54	2006 Corporate
4	9/1/2005	8	0	1	256146	1209.54	0	1209.54	2006 Corporate
4	9/1/2005	9	0	1	253749	1209.54	0	1209.54	2006 Corporate
4	9/1/2005	10	0.01	2	251262	1393.93	0.01	696.97	2006 Corporate
4	9/1/2005	11	0.01	3	247962	1450.33	0.01	483.44	2006 Corporate
4	9/1/2005	12	0.02	4	244029	1897.13	0.01	474.28	2006 Corporate
4	9/1/2005	13	0.02	4	233129	1897.13	0.01	474.28	2006 Corporate
4	9/1/2005	14	0.02	4	225975	1897.13	0.01	474.28	2006 Corporate
4	9/1/2005	15	0.02	5	216864	1977.62	0.01	395.52	2006 Corporate
4	9/1/2005	16	0.03	6	207429	2571.4	0.01	428.57	2006 Corporate
4	9/1/2005	17	0.04	8	196757	2981.89	0.01	372.74	2006 Corporate
4	9/1/2005	18	0.04	8	182156	2981.89	0.01	372.74	2006 Corporate
4	9/1/2005	19	0.04	8	166225	2981.89	0.01	372.74	2006 Corporate
4	9/1/2005	20	0.04	8	150573	2981.89	0.01	372.74	2006 Corporate
4	9/1/2005	21	0.05	10	124586	3206.17	0.01	320.62	2006 Corporate
4	9/1/2005	22	0.08	13	95380	5741.78	0.04	441.68	2006 Corporate
4	10/1/2005	0	0	0	258360	0	0	0	2006 Corporate
4	10/1/2005	1	0	0	258360	0	0	0	2006 Corporate
4	10/1/2005	2	0	0	258206	0	0	0	2006 Corporate
4	10/1/2005	3	0	0	258022	0	0	0	2006 Corporate
4	10/1/2005	4	0	0	257729	0	0	0	2006 Corporate
4	10/1/2005	5	0	0	257352	0	0	0	2006 Corporate
4	10/1/2005	6	0	0	256475	0	0	0	2006 Corporate
4	10/1/2005	7	0	0	255457	0	0	0	2006 Corporate
4	10/1/2005	8	0	1	254036	539.08	0	539.08	2006 Corporate
4	10/1/2005	9	0	1	251239	539.08	0	539.08	2006 Corporate
4	10/1/2005	10	0	1	248223	539.08	0	539.08	2006 Corporate
4	10/1/2005	11	0.01	2	244358	613.41	0	306.71	2006 Corporate
4	10/1/2005	12	0.01	2	240079	613.41	0	306.71	2006 Corporate
4	10/1/2005	13	0.01	2	227939	613.41	0	306.71	2006 Corporate
4	10/1/2005	14	0.01	2	220256	613.41	0	306.71	2006 Corporate
4	10/1/2005	15	0.01	2	210506	613.41	0	306.71	2006 Corporate
4	10/1/2005	16	0.02	4	200083	808.99	0	202.25	2006 Corporate
4	10/1/2005	17	0.03	6	188108	954.22	0	159.04	2006 Corporate
4	10/1/2005	18	0.04	8	171247	1138.11	0.01	142.26	2006 Corporate
4	10/1/2005	19	0.05	9	153114	1195.13	0.01	132.79	2006 Corporate
4	10/1/2005	20	0.07	12	133846	2536.5	0.02	211.38	2006 Corporate
4	10/1/2005	21	0.11	16	99903	3618.33	0.03	226.15	2006 Corporate
4	11/1/2005	0	0	0	212251	0	0	0	2006 Corporate
4	11/1/2005	1	0	0	212251	0	0	0	2006 Corporate
4	11/1/2005	2	0	0	212133	0	0	0	2006 Corporate
4	11/1/2005	3	0	0	211981	0	0	0	2006 Corporate
4	11/1/2005	4	0	0	211757	0	0	0	2006 Corporate
4	11/1/2005	5	0	0	211471	0	0	0	2006 Corporate
4	11/1/2005	6	0	1	210816	75.96	0	75.96	2006 Corporate

4 11/1/2005	7	0	1	209940	75.96	0	75.96	2006 Corporate
4 11/1/2005	8	0	1	208613	75.96	0	75.96	2006 Corporate
4 11/1/2005	9	0	1	206110	75.96	0	75.96	2006 Corporate
4 11/1/2005	10	0.01	3	203439	167.99	0	56	2006 Corporate
4 11/1/2005	11	0.02	5	200106	421.46	0	84.29	2006 Corporate
4 11/1/2005	12	0.02	5	196485	421.46	0	84.29	2006 Corporate
4 11/1/2005	13	0.04	7	184906	892.39	0	127.48	2006 Corporate
4 11/1/2005	14	0.05	10	177591	1158.17	0.01	115.82	2006 Corporate
4 11/1/2005	15	0.05	10	168476	1158.17	0.01	115.82	2006 Corporate
4 11/1/2005	16	0.06	11	158246	1560.58	0.01	141.87	2006 Corporate
4 11/1/2005	17	0.08	14	146269	1803.68	0.01	128.83	2006 Corporate
4 11/1/2005	18	0.1	17	128708	2065.12	0.01	121.48	2006 Corporate
4 11/1/2005	19	0.17	24	108758	2845.23	0.02	118.55	2006 Corporate
4 11/1/2005	20	0.23	29	85008	3921.84	0.03	135.24	2006 Corporate
4 12/1/2005	0	0	0	225739	0	0	0	2006 Corporate
4 12/1/2005	1	0	0	225739	0	0	0	2006 Corporate
4 12/1/2005	2	0	0	225624	0	0	0	2006 Corporate
4 12/1/2005	3	0	0	225465	0	0	0	2006 Corporate
4 12/1/2005	4	0	0	225195	0	0	0	2006 Corporate
4 12/1/2005	5	0	0	224875	0	0	0	2006 Corporate
4 12/1/2005	6	0	0	224009	0	0	0	2006 Corporate
4 12/1/2005	7	0	0	223055	0	0	0	2006 Corporate
4 12/1/2005	8	0	0	221688	0	0	0	2006 Corporate
4 12/1/2005	9	0	0	219111	0	0	0	2006 Corporate
4 12/1/2005	10	0	0	216400	0	0	0	2006 Corporate
4 12/1/2005	11	0	0	212838	0	0	0	2006 Corporate
4 12/1/2005	12	0	1	208962	55.34	0	55.34	2006 Corporate
4 12/1/2005	13	0.01	3	196677	1369.01	0.01	456.34	2006 Corporate
4 12/1/2005	14	0.02	4	188839	1384.67	0.01	346.17	2006 Corporate
4 12/1/2005	15	0.03	5	178760	1436.85	0.01	287.37	2006 Corporate
4 12/1/2005	16	0.04	7	167448	1557.89	0.01	222.56	2006 Corporate
4 12/1/2005	17	0.04	8	153812	1572.73	0.01	196.59	2006 Corporate
4 12/1/2005	18	0.1	16	133569	4106.06	0.03	256.63	2006 Corporate
4 12/1/2005	19	0.24	31	107690	6151.06	0.05	198.42	2006 Corporate
4 1/1/2006	0	0	0	230510	0	0	0	2006 Corporate
4 1/1/2006	1	0	0	230510	0	0	0	2006 Corporate
4 1/1/2006	2	0	0	230393	0	0	0	2006 Corporate
4 1/1/2006	3	0	0	230234	0	0	0	2006 Corporate
4 1/1/2006	4	0	0	229989	0	0	0	2006 Corporate
4 1/1/2006	5	0	1	229624	21.98	0	21.98	2006 Corporate
4 1/1/2006	6	0	1	228892	21.98	0	21.98	2006 Corporate
4 1/1/2006	7	0.01	2	228016	73.29	0	36.65	2006 Corporate
4 1/1/2006	8	0.01	2	226806	73.29	0	36.65	2006 Corporate
4 1/1/2006	9	0.01	2	224373	73.29	0	36.65	2006 Corporate
4 1/1/2006	10	0.01	2	221869	73.29	0	36.65	2006 Corporate
4 1/1/2006	11	0.01	3	218511	219.38	0	73.13	2006 Corporate
4 1/1/2006	12	0.03	6	214885	286.02	0	47.67	2006 Corporate
4 1/1/2006	13	0.03	6	202338	286.02	0	47.67	2006 Corporate
4 1/1/2006	14	0.03	6	194441	286.02	0	47.67	2006 Corporate
4 1/1/2006	15	0.04	9	183617	562.01	0	62.45	2006 Corporate
4 1/1/2006	16	0.06	11	171094	686.62	0	62.42	2006 Corporate
4 1/1/2006	17	0.06	12	155375	718.47	0	59.87	2006 Corporate
4 1/1/2006	18	0.11	18	128753	2730.34	0.02	151.69	2006 Corporate
4 2/1/2006	0	0	0	239722	0	0	0	2006 Corporate
4 2/1/2006	1	0	0	239722	0	0	0	2006 Corporate
4 2/1/2006	2	0	1	239586	69.36	0	69.36	2006 Corporate



4	2/1/2006	3	0	1	239421	69.36	0	69.36	2006 Corporate
4	2/1/2006	4	0	1	239143	69.36	0	69.36	2006 Corporate
4	2/1/2006	5	0.01	2	238763	93.59	0	46.8	2006 Corporate
4	2/1/2006	6	0.01	3	237978	163.52	0	54.51	2006 Corporate
4	2/1/2006	7	0.02	4	237126	223.08	0	55.77	2006 Corporate
4	2/1/2006	8	0.02	4	235777	223.08	0	55.77	2006 Corporate
4	2/1/2006	9	0.02	4	233128	223.08	0	55.77	2006 Corporate
4	2/1/2006	10	0.02	5	230284	337.99	0	67.6	2006 Corporate
4	2/1/2006	11	0.02	5	226439	337.99	0	67.6	2006 Corporate
4	2/1/2006	12	0.03	6	222255	467.48	0	77.91	2006 Corporate
4	2/1/2006	13	0.03	7	207029	519.8	0	74.26	2006 Corporate
4	2/1/2006	14	0.03	7	196703	519.8	0	74.26	2006 Corporate
4	2/1/2006	15	0.05	10	182588	773.48	0	77.35	2006 Corporate
4	2/1/2006	16	0.07	14	164337	1401.46	0.01	100.1	2006 Corporate
4	2/1/2006	17	0.1	18	138470	2266.72	0.01	125.93	2006 Corporate
4	3/1/2006	0	0	0	269001	0	0	0	2006 Corporate
4	3/1/2006	1	0	0	269001	0	0	0	2006 Corporate
4	3/1/2006	2	0	0	268814	0	0	0	2006 Corporate
4	3/1/2006	3	0	0	268566	0	0	0	2006 Corporate
4	3/1/2006	4	0	0	268156	0	0	0	2006 Corporate
4	3/1/2006	5	0	0	267693	0	0	0	2006 Corporate
4	3/1/2006	6	0	0	266635	0	0	0	2006 Corporate
4	3/1/2006	7	0	0	265345	0	0	0	2006 Corporate
4	3/1/2006	8	0	0	263452	0	0	0	2006 Corporate
4	3/1/2006	9	0	1	259774	2022.49	0.01	2022.49	2006 Corporate
4	3/1/2006	10	0.01	3	255923	2991.51	0.01	997.17	2006 Corporate
4	3/1/2006	11	0.01	3	250475	2991.51	0.01	997.17	2006 Corporate
4	3/1/2006	12	0.03	7	244130	3855.37	0.02	550.77	2006 Corporate
4	3/1/2006	13	0.05	12	221085	4664.92	0.02	388.74	2006 Corporate
4	3/1/2006	14	0.06	14	204724	5850.19	0.02	417.87	2006 Corporate
4	3/1/2006	15	0.09	20	180894	7139.93	0.03	357	2006 Corporate
4	3/1/2006	16	0.13	25	145984	7695.03	0.04	307.8	2006 Corporate
4	4/1/2006	0	0	0	201114	0	0	0	2006 Corporate
4	4/1/2006	1	0	0	201114	0	0	0	2006 Corporate
4	4/1/2006	2	0	1	200925	454.53	0	454.53	2006 Corporate
4	4/1/2006	3	0	1	200706	454.53	0	454.53	2006 Corporate
4	4/1/2006	4	0	1	200375	454.53	0	454.53	2006 Corporate
4	4/1/2006	5	0	1	199919	454.53	0	454.53	2006 Corporate
4	4/1/2006	6	0	1	198844	454.53	0	454.53	2006 Corporate
4	4/1/2006	7	0	1	197637	454.53	0	454.53	2006 Corporate
4	4/1/2006	8	0	1	195696	454.53	0	454.53	2006 Corporate
4	4/1/2006	9	0.01	2	192190	519.91	0	259.96	2006 Corporate
4	4/1/2006	10	0.02	3	188386	2858.93	0.02	952.98	2006 Corporate
4	4/1/2006	11	0.03	6	183018	5957.56	0.03	992.93	2006 Corporate
4	4/1/2006	12	0.03	6	176562	5957.56	0.03	992.93	2006 Corporate
4	4/1/2006	13	0.04	8	153244	6185.76	0.03	773.22	2006 Corporate
4	4/1/2006	14	0.06	10	135604	6492.3	0.04	649.23	2006 Corporate
4	4/1/2006	15	0.08	12	107836	6584.41	0.04	548.7	2006 Corporate
4	5/1/2006	0	0	0	173002	0	0	0	2006 Corporate
4	5/1/2006	1	0	0	173002	0	0	0	2006 Corporate
4	5/1/2006	2	0	0	172829	0	0	0	2006 Corporate
4	5/1/2006	3	0	0	172565	0	0	0	2006 Corporate
4	5/1/2006	4	0	0	172237	0	0	0	2006 Corporate
4	5/1/2006	5	0	0	171778	0	0	0	2006 Corporate
4	5/1/2006	6	0	0	170738	0	0	0	2006 Corporate
4	5/1/2006	7	0.01	1	169363	31.16	0	31.16	2006 Corporate

4	5/1/2006	8	0.02	3	167382	168.26	0	56.09	2006 Corporate
4	5/1/2006	9	0.02	4	163111	200.83	0	50.21	2006 Corporate
4	5/1/2006	10	0.02	4	158126	200.83	0	50.21	2006 Corporate
4	5/1/2006	11	0.04	6	150794	667.18	0	111.2	2006 Corporate
4	5/1/2006	12	0.09	13	141994	1184.78	0.01	91.14	2006 Corporate
4	5/1/2006	13	0.12	17	112834	1893.35	0.01	111.37	2006 Corporate
4	5/1/2006	14	0.12	17	88923	1893.35	0.01	111.37	2006 Corporate
4	6/1/2006	0	0	0	130761	0	0	0	2006 Corporate
4	6/1/2006	1	0	0	130761	0	0	0	2006 Corporate
4	6/1/2006	2	0.01	1	130585	61.84	0	61.84	2006 Corporate
4	6/1/2006	3	0.01	1	130349	61.84	0	61.84	2006 Corporate
4	6/1/2006	4	0.01	1	130033	61.84	0	61.84	2006 Corporate
4	6/1/2006	5	0.01	1	129615	61.84	0	61.84	2006 Corporate
4	6/1/2006	6	0.01	1	128733	61.84	0	61.84	2006 Corporate
4	6/1/2006	7	0.01	1	127488	61.84	0	61.84	2006 Corporate
4	6/1/2006	8	0.02	2	125573	98.95	0	49.48	2006 Corporate
4	6/1/2006	9	0.02	3	121035	598.15	0	199.38	2006 Corporate
4	6/1/2006	10	0.02	3	115365	598.15	0	199.38	2006 Corporate
4	6/1/2006	11	0.04	5	106497	695.36	0.01	139.07	2006 Corporate
4	6/1/2006	12	0.06	7	96068	842.69	0.01	120.38	2006 Corporate
4	6/1/2006	13	0.06	7	61011	842.69	0.01	120.38	2006 Corporate
4	7/1/2006	0	0	0	31475	0	0	0	2006 Corporate
4	7/1/2006	1	0	0	31475	0	0	0	2006 Corporate
4	7/1/2006	2	0	0	31411	0	0	0	2006 Corporate
4	7/1/2006	3	0	0	31332	0	0	0	2006 Corporate
4	7/1/2006	4	0	0	31205	0	0	0	2006 Corporate
4	7/1/2006	5	0	0	31022	0	0	0	2006 Corporate
4	7/1/2006	6	0	0	30570	0	0	0	2006 Corporate
4	7/1/2006	7	0	0	30132	0	0	0	2006 Corporate
4	7/1/2006	8	0	0	29358	0	0	0	2006 Corporate
4	7/1/2006	9	0	0	27556	0	0	0	2006 Corporate
4	7/1/2006	10	0.04	1	25624	66.88	0	66.88	2006 Corporate
4	7/1/2006	11	0.13	3	22653	1944.37	0.09	648.12	2006 Corporate
4	7/1/2006	12	0.13	3	17719	1944.37	0.09	648.12	2006 Corporate
4	8/1/2006	0	0		18850		0		2006 Corporate
4	8/1/2006	1	0		18850		0		2006 Corporate
4	8/1/2006	2	0		18697		0		2006 Corporate
4	8/1/2006	3	0		18476		0		2006 Corporate
4	8/1/2006	4	0		18162		0		2006 Corporate
4	8/1/2006	5	0		17792		0		2006 Corporate
4	8/1/2006	6	0		17272		0		2006 Corporate
4	8/1/2006	7	0		16672		0		2006 Corporate
4	8/1/2006	8	0		15788		0		2006 Corporate
4	8/1/2006	9	0		14465		0		2006 Corporate
4	8/1/2006	10	0		12868		0		2006 Corporate
4	8/1/2006	11	0		9375		0		2006 Corporate
4	9/1/2006	0	0	0	14728	0	0	0	2006 Corporate
4	9/1/2006	1	0	0	14728	0	0	0	2006 Corporate
4	9/1/2006	2	0	0	14538	0	0	0	2006 Corporate
4	9/1/2006	3	0	0	14294	0	0	0	2006 Corporate
4	9/1/2006	4	0	0	13980	0	0	0	2006 Corporate
4	9/1/2006	5	0	0	13432	0	0	0	2006 Corporate
4	9/1/2006	6	0	0	12669	0	0	0	2006 Corporate
4	9/1/2006	7	0	0	11838	0	0	0	2006 Corporate
4	9/1/2006	8	0	0	10571	0	0	0	2006 Corporate
4	9/1/2006	9	0	0	9041	0	0	0	2006 Corporate

4	9/1/2006	10	0.15	1	6662	57.02	0.01	57.02	2006 Corporate
4	10/1/2006	0	0		8577			0	2006 Corporate
4	10/1/2006	1	0		8577			0	2006 Corporate
4	10/1/2006	2	0		8420			0	2006 Corporate
4	10/1/2006	3	0		8202			0	2006 Corporate
4	10/1/2006	4	0		7912			0	2006 Corporate
4	10/1/2006	5	0		7431			0	2006 Corporate
4	10/1/2006	6	0		6736			0	2006 Corporate
4	10/1/2006	7	0		6178			0	2006 Corporate
4	10/1/2006	8	0		5495			0	2006 Corporate
4	10/1/2006	9	0		4369			0	2006 Corporate
4	11/1/2006	0	0		1030			0	2006 Corporate
4	11/1/2006	1	0		1030			0	2006 Corporate
4	11/1/2006	2	0		976			0	2006 Corporate
4	11/1/2006	3	0		905			0	2006 Corporate
4	11/1/2006	4	0		833			0	2006 Corporate
4	11/1/2006	5	0		748			0	2006 Corporate
4	11/1/2006	6	0		670			0	2006 Corporate
4	11/1/2006	7	0		583			0	2006 Corporate
4	11/1/2006	8	0		545			0	2006 Corporate
5		0	0	8	1963888	2123.65	0	265.46	2007 Corporate
5		1	0.02	37	1963888	6370.11	0	172.17	2007 Corporate
5		2	0.03	59	1802826	16244.1	0.01	275.32	2007 Corporate
5		3	0.05	88	1622074	24213.49	0.01	275.15	2007 Corporate
5		4	0.06	107	1424193	30859.09	0.02	288.4	2007 Corporate
5		5	0.07	122	1230065	32946.98	0.02	270.06	2007 Corporate
5		6	0.1	151	1027954	40099.92	0.03	265.56	2007 Corporate
5		7	0.12	169	851377	45423.32	0.03	268.78	2007 Corporate
5		8	0.14	183	698167	52044.7	0.04	284.4	2007 Corporate
5		9	0.16	194	548182	52526.57	0.04	270.76	2007 Corporate
5		10	0.18	199	421513	52774.13	0.04	265.2	2007 Corporate
5		11	0.19	204	307654	53400.18	0.05	261.77	2007 Corporate
5		12	0.21	207	208855	53753.75	0.05	259.68	2007 Corporate
5		13	0.22	209	154133	55029.54	0.06	263.3	2007 Corporate
5		14	0.23	210	75737	55244.68	0.06	263.07	2007 Corporate
5		15	0.23	210	21865	55244.68	0.06	263.07	2007 Corporate
5		16	0.46	211	4338	55260.68	0.06	261.9	2007 Corporate
5		17	0.46	211	1225	55260.68	0.06	261.9	2007 Corporate
5		18	0.46	211	246	55260.68	0.06	261.9	2007 Corporate
5	1/1/2006	0	0	0	277	0	0	0	2007 Corporate
5	1/1/2006	1	0	0	277	0	0	0	2007 Corporate
5	1/1/2006	2	0	0	275	0	0	0	2007 Corporate
5	1/1/2006	3	0	0	273	0	0	0	2007 Corporate
5	1/1/2006	4	0	0	273	0	0	0	2007 Corporate
5	1/1/2006	5	0	0	270	0	0	0	2007 Corporate
5	1/1/2006	6	0	0	269	0	0	0	2007 Corporate
5	1/1/2006	7	0	0	266	0	0	0	2007 Corporate
5	1/1/2006	8	0	0	265	0	0	0	2007 Corporate
5	1/1/2006	9	0	0	265	0	0	0	2007 Corporate
5	1/1/2006	10	0	0	265	0	0	0	2007 Corporate
5	1/1/2006	11	0	0	263	0	0	0	2007 Corporate
5	1/1/2006	12	0	0	263	0	0	0	2007 Corporate
5	1/1/2006	13	0	0	255	0	0	0	2007 Corporate
5	1/1/2006	14	0	0	253	0	0	0	2007 Corporate
5	1/1/2006	15	0	0	248	0	0	0	2007 Corporate
5	1/1/2006	16	4.18	1	239	16	0.07	16	2007 Corporate

5	1/1/2006	17	4.18	1	194			16	0.07	16	2007 Corporate
5	1/1/2006	18	4.18	1	162			16	0.07	16	2007 Corporate
5	2/1/2006	0	0	0	2212			0	0	0	2007 Corporate
5	2/1/2006	1	0	0	2212			0	0	0	2007 Corporate
5	2/1/2006	2	0	0	2176			0	0	0	2007 Corporate
5	2/1/2006	3	0	0	2154			0	0	0	2007 Corporate
5	2/1/2006	4	0	0	2106			0	0	0	2007 Corporate
5	2/1/2006	5	0	0	2064			0	0	0	2007 Corporate
5	2/1/2006	6	0	0	2036			0	0	0	2007 Corporate
5	2/1/2006	7	0	0	2005			0	0	0	2007 Corporate
5	2/1/2006	8	0	0	1969			0	0	0	2007 Corporate
5	2/1/2006	9	0	0	1933			0	0	0	2007 Corporate
5	2/1/2006	10	0	0	1889			0	0	0	2007 Corporate
5	2/1/2006	11	0.54	1	1835			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	12	0.54	1	1765			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	13	0.54	1	1680			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	14	0.54	1	1595			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	15	0.54	1	1473			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	16	0.54	1	1269			51.87	0.03	51.87	2007 Corporate
5	2/1/2006	17	0.54	1	947			51.87	0.03	51.87	2007 Corporate
5	3/1/2006	0	0	0	6487			0	0	0	2007 Corporate
5	3/1/2006	1	0	0	6487			0	0	0	2007 Corporate
5	3/1/2006	2	0	0	6383			0	0	0	2007 Corporate
5	3/1/2006	3	0	0	6284			0	0	0	2007 Corporate
5	3/1/2006	4	0	0	6168			0	0	0	2007 Corporate
5	3/1/2006	5	0	0	6054			0	0	0	2007 Corporate
5	3/1/2006	6	0	0	5920			0	0	0	2007 Corporate
5	3/1/2006	7	0	0	5797			0	0	0	2007 Corporate
5	3/1/2006	8	0	0	5655			0	0	0	2007 Corporate
5	3/1/2006	9	0	0	5501			0	0	0	2007 Corporate
5	3/1/2006	10	0	0	5328			0	0	0	2007 Corporate
5	3/1/2006	11	0	0	5151			0	0	0	2007 Corporate
5	3/1/2006	12	0	0	4916			0	0	0	2007 Corporate
5	3/1/2006	13	0.22	1	4585			1170.62	0.26	1170.62	2007 Corporate
5	3/1/2006	14	0.22	1	4155			1170.62	0.26	1170.62	2007 Corporate
5	3/1/2006	15	0.22	1	3544			1170.62	0.26	1170.62	2007 Corporate
5	3/1/2006	16	0.22	1	2746			1170.62	0.26	1170.62	2007 Corporate
5	4/1/2006	0	0	0	21135			0	0	0	2007 Corporate
5	4/1/2006	1	0	0	21135			0	0	0	2007 Corporate
5	4/1/2006	2	0.05	1	21020			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	3	0.05	1	20909			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	4	0.05	1	20748			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	5	0.05	1	20581			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	6	0.05	1	20390			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	7	0.05	1	20212			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	8	0.05	1	20050			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	9	0.05	1	19816			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	10	0.05	1	19595			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	11	0.05	1	19308			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	12	0.05	1	18976			1060.59	0.05	1060.59	2007 Corporate
5	4/1/2006	13	0.1	2	18556			1165.76	0.06	582.88	2007 Corporate
5	4/1/2006	14	0.1	2	17849			1165.76	0.06	582.88	2007 Corporate
5	4/1/2006	15	0.1	2	16516			1165.76	0.06	582.88	2007 Corporate
5	5/1/2006	0	0	0	100293			0	0	0	2007 Corporate
5	5/1/2006	1	0.01	1	100293			508.34	0.01	508.34	2007 Corporate
5	5/1/2006	2	0.02	2	99221			734.23	0.01	367.12	2007 Corporate

5	5/1/2006	3	0.02	2	97855	734.23	0.01	367.12	2007 Corporate
5	5/1/2006	4	0.02	2	95833	734.23	0.01	367.12	2007 Corporate
5	5/1/2006	5	0.02	2	93543	734.23	0.01	367.12	2007 Corporate
5	5/1/2006	6	0.04	4	90595	2018.67	0.02	504.67	2007 Corporate
5	5/1/2006	7	0.04	4	87313	2018.67	0.02	504.67	2007 Corporate
5	5/1/2006	8	0.04	4	84445	2018.67	0.02	504.67	2007 Corporate
5	5/1/2006	9	0.04	4	80328	2018.67	0.02	504.67	2007 Corporate
5	5/1/2006	10	0.04	4	76764	2018.67	0.02	504.67	2007 Corporate
5	5/1/2006	11	0.06	5	72726	2045.99	0.02	409.2	2007 Corporate
5	5/1/2006	12	0.07	6	67638	2082.51	0.02	347.09	2007 Corporate
5	5/1/2006	13	0.07	6	60106	2082.51	0.02	347.09	2007 Corporate
5	5/1/2006	14	0.09	7	51801	2297.65	0.03	328.24	2007 Corporate
5	6/1/2006	0	0	0	142510	0	0	0	2007 Corporate
5	6/1/2006	1	0	0	142510	0	0	0	2007 Corporate
5	6/1/2006	2	0	0	140735	0	0	0	2007 Corporate
5	6/1/2006	3	0.01	1	138313	29.17	0	29.17	2007 Corporate
5	6/1/2006	4	0.01	1	134925	29.17	0	29.17	2007 Corporate
5	6/1/2006	5	0.01	2	130867	49.87	0	24.94	2007 Corporate
5	6/1/2006	6	0.02	3	125622	93.6	0	31.2	2007 Corporate
5	6/1/2006	7	0.02	3	120186	93.6	0	31.2	2007 Corporate
5	6/1/2006	8	0.03	4	114966	114.3	0	28.58	2007 Corporate
5	6/1/2006	9	0.03	4	107422	114.3	0	28.58	2007 Corporate
5	6/1/2006	10	0.03	4	100624	114.3	0	28.58	2007 Corporate
5	6/1/2006	11	0.05	6	93054	448.02	0	74.67	2007 Corporate
5	6/1/2006	12	0.08	8	83176	765.07	0.01	95.63	2007 Corporate
5	6/1/2006	13	0.08	8	68867	765.07	0.01	95.63	2007 Corporate
5	7/1/2006	0	0	0	68964	0	0	0	2007 Corporate
5	7/1/2006	1	0	0	68964	0	0	0	2007 Corporate
5	7/1/2006	2	0.01	1	68051	50.67	0	50.67	2007 Corporate
5	7/1/2006	3	0.01	1	66852	50.67	0	50.67	2007 Corporate
5	7/1/2006	4	0.01	1	64925	50.67	0	50.67	2007 Corporate
5	7/1/2006	5	0.01	1	62795	50.67	0	50.67	2007 Corporate
5	7/1/2006	6	0.01	1	59697	50.67	0	50.67	2007 Corporate
5	7/1/2006	7	0.01	1	56492	50.67	0	50.67	2007 Corporate
5	7/1/2006	8	0.01	1	53332	50.67	0	50.67	2007 Corporate
5	7/1/2006	9	0.06	3	48496	139.31	0	46.44	2007 Corporate
5	7/1/2006	10	0.06	3	44151	139.31	0	46.44	2007 Corporate
5	7/1/2006	11	0.06	3	39252	139.31	0	46.44	2007 Corporate
5	7/1/2006	12	0.06	3	32037	139.31	0	46.44	2007 Corporate
5	8/1/2006	0	0	1	203829	966.59	0	966.59	2007 Corporate
5	8/1/2006	1	0.02	4	203829	1064.02	0.01	266.01	2007 Corporate
5	8/1/2006	2	0.02	5	199266	1068.37	0.01	213.67	2007 Corporate
5	8/1/2006	3	0.04	8	193655	1498.02	0.01	187.25	2007 Corporate
5	8/1/2006	4	0.06	12	185481	1684.52	0.01	140.38	2007 Corporate
5	8/1/2006	5	0.06	12	176052	1684.52	0.01	140.38	2007 Corporate
5	8/1/2006	6	0.07	13	162484	1747.2	0.01	134.4	2007 Corporate
5	8/1/2006	7	0.09	16	149034	1956.99	0.01	122.31	2007 Corporate
5	8/1/2006	8	0.1	18	135773	2018.65	0.01	112.15	2007 Corporate
5	8/1/2006	9	0.15	23	116120	2323.66	0.01	101.03	2007 Corporate
5	8/1/2006	10	0.18	26	97771	2457.71	0.01	94.53	2007 Corporate
5	8/1/2006	11	0.19	27	75981	2670.85	0.02	98.92	2007 Corporate
5	9/1/2006	0	0	0	185184	0	0	0	2007 Corporate
5	9/1/2006	1	0	0	185184	0	0	0	2007 Corporate
5	9/1/2006	2	0.01	1	180406	1256.4	0.01	1256.4	2007 Corporate
5	9/1/2006	3	0.02	3	174273	1894.3	0.01	631.43	2007 Corporate
5	9/1/2006	4	0.02	3	165852	1894.3	0.01	631.43	2007 Corporate

5	9/1/2006	5	0.04	6	156500	2599.22	0.02	433.2	2007 Corporate
5	9/1/2006	6	0.06	10	143374	4284.37	0.03	428.44	2007 Corporate
5	9/1/2006	7	0.09	14	130045	5538.98	0.04	395.64	2007 Corporate
5	9/1/2006	8	0.14	19	116931	6209.49	0.04	326.82	2007 Corporate
5	9/1/2006	9	0.16	21	96518	6246.94	0.04	297.47	2007 Corporate
5	9/1/2006	10	0.18	23	75042	6360.45	0.04	276.54	2007 Corporate
5	10/1/2006	0	0	0	163286	0	0	0	2007 Corporate
5	10/1/2006	1	0.01	2	163286	877.99	0.01	439	2007 Corporate
5	10/1/2006	2	0.02	4	158923	2882.69	0.02	720.67	2007 Corporate
5	10/1/2006	3	0.04	6	153147	3223.47	0.02	537.25	2007 Corporate
5	10/1/2006	4	0.04	7	145063	3245.82	0.02	463.69	2007 Corporate
5	10/1/2006	5	0.04	7	135636	3245.82	0.02	463.69	2007 Corporate
5	10/1/2006	6	0.06	9	122484	3312.24	0.02	368.03	2007 Corporate
5	10/1/2006	7	0.07	10	107854	5968.66	0.05	596.87	2007 Corporate
5	10/1/2006	8	0.07	10	94270	5968.66	0.05	596.87	2007 Corporate
5	10/1/2006	9	0.1	12	71699	6019.43	0.05	501.62	2007 Corporate
5	11/1/2006	0	0.01	1	158736	46.58	0	46.58	2007 Corporate
5	11/1/2006	1	0.01	1	158736	46.58	0	46.58	2007 Corporate
5	11/1/2006	2	0.01	1	153688	46.58	0	46.58	2007 Corporate
5	11/1/2006	3	0.02	3	147311	120.6	0	40.2	2007 Corporate
5	11/1/2006	4	0.03	5	138021	908.19	0.01	181.64	2007 Corporate
5	11/1/2006	5	0.06	8	126799	1284.73	0.01	160.59	2007 Corporate
5	11/1/2006	6	0.1	13	109991	2493.81	0.02	191.83	2007 Corporate
5	11/1/2006	7	0.16	18	91612	3317.47	0.03	184.3	2007 Corporate
5	11/1/2006	8	0.24	24	70427	9185.98	0.11	382.75	2007 Corporate
5	12/1/2006	0	0	0	154727	0	0	0	2007 Corporate
5	12/1/2006	1	0.02	3	154727	280.01	0	93.34	2007 Corporate
5	12/1/2006	2	0.03	4	149343	305.9	0	76.48	2007 Corporate
5	12/1/2006	3	0.04	6	142393	370.96	0	61.83	2007 Corporate
5	12/1/2006	4	0.06	8	132355	422.69	0	52.84	2007 Corporate
5	12/1/2006	5	0.06	8	120754	422.69	0	52.84	2007 Corporate
5	12/1/2006	6	0.1	13	102541	2398.37	0.02	184.49	2007 Corporate
5	12/1/2006	7	0.17	18	80477	2777.29	0.03	154.29	2007 Corporate
5	1/1/2007	0	0	0	144630	0	0	0	2007 Corporate
5	1/1/2007	1	0.01	2	144630	71.13	0	35.57	2007 Corporate
5	1/1/2007	2	0.02	3	138638	332.58	0	110.86	2007 Corporate
5	1/1/2007	3	0.02	3	131738	332.58	0	110.86	2007 Corporate
5	1/1/2007	4	0.03	4	121156	408.58	0	102.15	2007 Corporate
5	1/1/2007	5	0.06	7	108198	1109.5	0.01	158.5	2007 Corporate
5	1/1/2007	6	0.17	16	82467	1935.26	0.02	120.95	2007 Corporate
5	2/1/2007	0	0	0	143267	0	0	0	2007 Corporate
5	2/1/2007	1	0.02	3	143267	197.52	0	65.84	2007 Corporate
5	2/1/2007	2	0.04	5	135748	294.69	0	58.94	2007 Corporate
5	2/1/2007	3	0.08	11	126410	4034.64	0.03	366.79	2007 Corporate
5	2/1/2007	4	0.1	13	111863	7597.69	0.06	584.44	2007 Corporate
5	2/1/2007	5	0.16	18	89868	7882.5	0.07	437.92	2007 Corporate
5	3/1/2007	0	0	0	147839	0	0	0	2007 Corporate
5	3/1/2007	1	0.02	3	147839	181.12	0	60.37	2007 Corporate
5	3/1/2007	2	0.03	5	137774	396.2	0	79.24	2007 Corporate
5	3/1/2007	3	0.1	13	124490	1206.91	0.01	92.84	2007 Corporate
5	3/1/2007	4	0.17	20	99340	3165.29	0.03	158.26	2007 Corporate
5	4/1/2007	0	0.01	1	130064	39.09	0	39.09	2007 Corporate
5	4/1/2007	1	0.05	7	130064	797.71	0.01	113.96	2007 Corporate
5	4/1/2007	2	0.09	11	116402	2527.87	0.02	229.81	2007 Corporate
5	4/1/2007	3	0.12	14	95933	4370.02	0.04	312.14	2007 Corporate
5	5/1/2007	0	0.02	2	119725	63.59	0	31.8	2007 Corporate

5	5/1/2007	1	0.05	6	119725	901.29	0.01	150.22	2007 Corporate
5	5/1/2007	2	0.1	11	94693	3842.93	0.04	349.36	2007 Corporate
5	6/1/2007	0	0.04	3	70639	1007.8	0.01	335.93	2007 Corporate
5	6/1/2007	1	0.07	5	70639	1444.4	0.02	288.88	2007 Corporate
6		0	0.01	2	202330	1356.82	0.01	678.41	2008 Corporate
6		1	0.06	12	202330	3557	0.02	296.42	2008 Corporate
6		2	0.06	12	140891	3557	0.02	296.42	2008 Corporate
6		3	0.1	16	91236	3751.98	0.02	234.5	2008 Corporate
6		4	0.14	18	56547	3827.76	0.02	212.65	2008 Corporate
6		5	0.14	18	29736	3827.76	0.02	212.65	2008 Corporate
6		6	0.14	18	8423	3827.76	0.02	212.65	2008 Corporate
6		7	0.14	18	537	3827.76	0.02	212.65	2008 Corporate
6	8/1/2006	0	0		108		0		2008 Corporate
6	8/1/2006	1	0		108		0		2008 Corporate
6	8/1/2006	2	0		108		0		2008 Corporate
6	8/1/2006	3	0		108		0		2008 Corporate
6	8/1/2006	4	0		108		0		2008 Corporate
6	8/1/2006	5	0		108		0		2008 Corporate
6	8/1/2006	6	0		108		0		2008 Corporate
6	8/1/2006	7	0		108		0		2008 Corporate
6	10/1/2006	0	0		203		0		2008 Corporate
6	10/1/2006	1	0		203		0		2008 Corporate
6	10/1/2006	2	0		203		0		2008 Corporate
6	10/1/2006	3	0		203		0		2008 Corporate
6	10/1/2006	4	0		203		0		2008 Corporate
6	10/1/2006	5	0		203		0		2008 Corporate
6	10/1/2006	6	0		203		0		2008 Corporate
6	10/1/2006	7	0		203		0		2008 Corporate
6	12/1/2006	0	0		1335		0		2008 Corporate
6	12/1/2006	1	0		1335		0		2008 Corporate
6	12/1/2006	2	0		1261		0		2008 Corporate
6	12/1/2006	3	0		1201		0		2008 Corporate
6	12/1/2006	4	0		1127		0		2008 Corporate
6	12/1/2006	5	0		983		0		2008 Corporate
6	12/1/2006	6	0		710		0		2008 Corporate
6	12/1/2006	7	0		121		0		2008 Corporate
6	1/1/2007	0	0		19102		0		2008 Corporate
6	1/1/2007	1	0		19102		0		2008 Corporate
6	1/1/2007	2	0		18039		0		2008 Corporate
6	1/1/2007	3	0		16559		0		2008 Corporate
6	1/1/2007	4	0		14293		0		2008 Corporate
6	1/1/2007	5	0		11542		0		2008 Corporate
6	1/1/2007	6	0		7289		0		2008 Corporate
6	2/1/2007	0	0	0	30435	0	0	0	2008 Corporate
6	2/1/2007	1	0	0	30435	0	0	0	2008 Corporate
6	2/1/2007	2	0	0	28465	0	0	0	2008 Corporate
6	2/1/2007	3	0.04	1	25658	26.03	0	26.03	2008 Corporate
6	2/1/2007	4	0.13	3	21855	101.81	0	33.94	2008 Corporate
6	2/1/2007	5	0.13	3	16778	101.81	0	33.94	2008 Corporate
6	3/1/2007	0	0	0	31036	0	0	0	2008 Corporate
6	3/1/2007	1	0	0	31036	0	0	0	2008 Corporate
6	3/1/2007	2	0	0	28562	0	0	0	2008 Corporate
6	3/1/2007	3	0.04	1	24804	26.03	0	26.03	2008 Corporate
6	3/1/2007	4	0.04	1	18839	26.03	0	26.03	2008 Corporate
6	4/1/2007	0	0	0	32614	0	0	0	2008 Corporate
6	4/1/2007	1	0.09	3	32614	789.27	0.02	263.09	2008 Corporate

6	4/1/2007	2	0.09	3	28675	789.27	0.02	263.09	2008 Corporate
6	4/1/2007	3	0.18	5	22565	932.19	0.03	186.44	2008 Corporate
6	5/1/2007	0	0	0	45339	0	0	0	2008 Corporate
6	5/1/2007	1	0.13	6	45339	1363.47	0.03	227.25	2008 Corporate
6	5/1/2007	2	0.13	6	35440	1363.47	0.03	227.25	2008 Corporate
6	6/1/2007	0	0.05	2	42020	1356.82	0.03	678.41	2008 Corporate
6	6/1/2007	1	0.07	3	42020	1404.26	0.03	468.09	2008 Corporate



1FTNE14L27DA52346  
1FTWW31P66ED42134  
5LMFU28R34LJ19137  
1FMFU19547LA80894  
1ZVFT82HX75249709  
1FTPW14526FA05280  
1FDNE24L96HA88950  
1LNHM87A84Y605228  
1FTWW33P76EB08968  
1LNHM82W43Y615773  
1FMFK18507LA14611  
1FMEU75806UA35815  
1FMFU19527LA90307  
1FTSW31P06ED45934  
3LNHM26T07R664440  
1FMZU74W64ZA17451  
1FTPX145X4NB65696  
1FAHP28147G113089  
1FTPW12V67KD20529  
1FTRW12W97KC70596  
1ZVFT82H265157671  
2FMDK39C77BB18674  
1FMCU93105KA65125  
1FTSX21R98EA05001  
1FAHP34N17W245649  
1FTXW43R38EB14863  
1FMEU53887UB02119  
1FTRF12266NB72426  
1FTWW31P17EA18879  
1FAHP24117G152115  
1FAHP25W78G110589  
2MRZA21255BJ01022  
1FMCU94175KA84771  
1FAFP56U16A221709  
1FAHP24117G157329  
1FAHP37N27W296637  
1MEHM42W78G603657  
1FAHP241X7G153764  
3LNHM26T37R671494  
1FTYR14U35PB05559  
1FTRW12547FA03088  
3MEHM07197R623910  
5LMFU28R84LJ31994  
1ZVFT82H255134566  
3FAHP06Z47R164310  
1FTSW21P46EA06202  
3FAFP31N05R143867  
1FMDU74W04ZA32098  
1FMFU20508LA06232  
1FTSW21R08EA09733  
1FDAF56P07EA03865  
1FTPX145X6FA29209

Rpt Nbr	PGM	Rpt Date	Prod Date	Car Strt Date	SA Cod	Dealer Name	Lim Num	Year	Vin	Mileage	ym Cod	Addl Sym	CDSID	Comments
7HUAL299	HD	20070821	20070314	20070331	01237	Kindle Ford Merc		2007	1FMFU16507LA	4936	306511	Approved	GSTAVROF	<b>REPAIR:</b> CUSTOMER STATES THAT THE FORD EMBLEM CAME OFF CENTER CAP ORDER AND REPLACE <b>RECOMM:</b> GVS AUTH TO REPLACE R/F WHEEL CENTER CAP T/Y GEORGE
7HTAV008	HD	20070820	20061108	20070411	12210	Dick Barker, Inc.	121094	2007	1LNHM82V27Y	2751	306704	Approved	GBUSH5	<b>REPAIR:</b> CUST STATES ALL 4 CENTER CAPS ARE PEELING THE REASON FOR THE PICS TAKEN WITH CAPS OFF IS THAT I COUGH THE ADVISOR LETTING THE CUST LEAVEAFTER REPLACING CAPS WITHOUT IMAGE APPROVAL(SHE THOUGHT IT HAD ALREADY BEEN APPROVED) SO I WENT GET THE PARTS RETURN AND SHOT THE PICS OFF OFTHE CAR I DIDNT WANT TO INCONVIENCE THE CUST WITH THE ADDITIONAL WAITING <b>RECOMM:</b> APPROVED TO REPLACE CENTER CAPS.
7HWAP025	HD	20070823	20040128	20040816	08888	York Ford Inc		2004	5LMEU88H54Z	41201	306513	Approved	GSTAVROF	<b>REPAIR:</b> ALL FOUR CENTER CAPS ON WHEELS ARE PITTING AND FINISH COMING OFF <b>RECOMM:</b> GVS APPROVED TO REPLACE CENTER CAPS ON ALL WHEELS
7HQAO118	HD	20070817	20070508	20070727	02975	North Bros. Ford,		2007	1FTPW14V37F	776	306704	Approved	GSTAVROF	<b>REPAIR:</b> LEFT REAR CROME RIM ,CROME PLATING IS FLAKING OFF ,NEEDS REPLACING, NODAMAGE ON WHEEL, RIM IS PEELING ON INNER EDGE. THANX PAT. <b>RECOMM:</b> GVS AUTH TO REPLACE L/R WHEEL
7HTBD033	HD	20070820	20070326	20070331	20639	Toms Ford, Inc.		2007	1FMEU74E67U	2974	306704	Approved	GSTAVROF	<b>REPAIR:</b> RIM IS PEELING, NO VISIBLE EVIDENCE OF DAMAGE FROM OUTSIDE SOURCE, ONLY ONE AREA AFFECTED ON RIM GVS NOT SURE WHERE AREA OF CONCERN IS AT WITH THE ONE CLOSE UP YOU HAVE PROVIDED PLEASE WIPE OFF WHEEL ANDADD NEW CLEAR CLOSE UPS SHOWING THE CONCERN AREA T/Y GEROGE RC TRIED WITH FLASS TO GIVE MORE LIGHT TO MAKE MORE VISIBLE HOPE IT HELPS-ADDED ARROWS TO ALL PHOTOS TOO <b>RECOMM:</b> GVS YES, EXCELLENT APPROVED TO REPLACE RIM T/Y GEORGE
7HUAL370	HD	20070821	20030509	20031020	00796	Tasca Ford		2003	1LNHM87A03Y	34565	306200	Approved	GSTAVROF	<b>REPAIR:</b> DEB CAR NEEDS LEFT REAR WHEEL REPLACED DUE TO AIR LEAKING OUT AT VALVESTEM,STEM IS OK CORROSION AT VALVE STEM HOLE <b>RECOMM:</b> GVS APPROVED TO REPLACE L/R WHEEL T/Y GEORGE
7H1A2017	HD	20070827	20050802	20061220	05732	Joe Sartain Ford,		2006	1FTWF30P06E	15124	306201	Approved	GSTAVROF	<b>REPAIR:</b> 2 WHEELS ARE CRACKED, BOTH ARE SEPARATING AT THE WELD ON THE VALVE STEM, THE WHEELS ARE ON THE LEFT AND RIGHT REAR OF THE TRUCK, BOTH WHEELS NEED REPLACED GVS PLEASE ADD CLEAR CLOSE UP IMAGES OF CONCERNAREA AND THE REQUIRED OVERALL VIEWS T/Y GEORGE BP HERE IS 2 MOREPICTURES <b>RECOMM:</b> GVS APPROVED TO REPLACE TWO WHEELS AS PER YOUR REQUEST T/Y GEORGE
7H1A2030	HD	20070827	20051208	20060120	12210	Dick Barker, Inc.		2006	3LNHM26136F	19646	306704	Approved	GSTAVROF	<b>REPAIR:</b> BM DIAG LFT REAR RIM COATING BUBBLING REC. TO REPLACE LFT REAR RIM GVS AUTH TO REPLACE L/R RIM
7H4AQ036	HD	20070830	20040818	20040830	11208	Hempstead Linco	748708	2005	1FMDU74W55U	29555	306799	Approved	ENEILSON	<b>REPAIR:</b> CUST STATES RIMS ARE BUBBLING. VERIFIED THE INNER EDGES OF RIMS BY LUGS ARE BUBBLING UP. HARD TO SPOT IN PICTURES BUT TOOK BEST SHOTS POSSIBLE. NO SIGNS OF PHYSICAL IMPACT OR DAMAGE TO AREA. <b>RECOMM:</b> APPROVED TO REPLACE WHEELS.
7HWAZ005	HD	20070823	20060726	20060810	04163	Elyria Ford		2007	1ZVHT85H075	17616	306704	Approved	SYERK	<b>REPAIR:</b> C-S THAT ALL FOUR RIMS ARE PITTING AND OXIDIZED AROUND THE CENTER CAP,REQUEST TO REPLACE 4 RIMS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7HUAL279	HD	20070821	20070521	20070608	13144	Acton Lincoln Mei	243918	2007	4M2EU48EX7U	5243	306401	Approved	ENEILSON	<b>REPAIR:</b> CUSTOMER STATES ROTATIONAL CLICKING TICKING SOUND FROM THE SIDES OF THE TRUCK HEARD IN MOTION. VERIFIED AND ISOLATED THE SOURCE OF THE NOISE TO THE LF AND RR WHEELS. THE CLADDING IS TICKING. WE TRIED TO REPOSITION THE WHEEL WEIGHTS TO BETER SECURE THE CLADDING BUT IT WAS UNSUCCESSFULL. THE RIMS NEED TO BE REPLACED. THE OUTER CLADDING IS LOOSE. <b>RECOMM:</b> APPROVED TO REPLACE 2 WHEELS.
7HWBA152	HD	20070823	20060508	0	05432	RANCHO FORD		2007	4M2CU97137K	117	306704	Approved	SYERK	<b>REPAIR:</b> ALL 4 WHEELS CRACKING ON FINISH. NEED TO REPLACE WHEELS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7H4AQ028	HD	20070830	20061106	20070629	12505	Van Drisse Lincol	23701	2007	1LNHM82VX7Y	1951	306513	Approved	ENEILSON	<b>REPAIR:</b> ALL FOUR CENTER CAPS ARE PEELING THE BLACK PAINT INSIDE THE LINCOLN STAR EMBLEM. THE REST OF THE CENTER CAP IS OK. REQUEST AUTH TO REPLACED ALL 4 CENTER CAPS. <b>RECOMM:</b> APPROVED TO REPLACE ALL 4 CENTER CAPS.
7HQAL025	HD	20070817	20050628	20050727	09217	Apple Valley Ford		2005	1FAHP251X5G	35919	306513	Approved	SYERK	<b>REPAIR:</b> CUST STATES THE CENTER CAPS OF ALL 4 WHEELS ARE GETTING WHITE SPOTS ONTHEM AND ARE PEELING A LITTLE. VERRIFIED PEELING AND WHAT LOOKS TO BE A START TO COOROSION. RECOMMEND REPLACING ALL 4 CENTER CAPS. <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7HXAW041	HD	20070824	20060130	20060215	10736	Ganley Lincoln-M		2006	3MEFM07146F	19091	306513	Approved	SYERK	<b>REPAIR:</b> ALL CENTER CAPS ON WHEELS CORRODING NEED TO REPLACE ALL 4 CENTER CAPS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7H2AY005	HD	20070828	20070816	0	07417	Grand Ford, Inc.		2007	2FMDK49C07E	5	306705	Approved	BKIRCHEI	<b>REPAIR:</b> CUSTOMER STATES CHROME ON LEFT FRONT WHEEL BUBBLING INT <b>RECOMM:</b> APPROVED TO REPLACE 1 WHEEL.

7H5AQ035	HD	20070831	20051130	20060103	10243	Lazare Lincoln-Mr	2006	3MEFM07Z96F	17701	306512	Approved	SYERK	<b>REPAIR:</b> BOTH REAR WHEEL COVERS MAKING NOISE. SEEKING APPROVAL TO REPLACE. <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE BOTH REAR WHEEL COVERS, REFER TO TSB # 06-21-13.
7HOAO070	HD	20070815	20061206	20070131	13100	Gervais Lincoln-Iv	2007	1LNHM82W47Y	14501	306513	Approved	SYERK	<b>REPAIR:</b> THE BLACK INSERT ON ALL 4 CENTER CAPS IS PEELING OFF WE NEED TO REPLACE CENTER CAPS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7HWAO024	HD	20070823	20070801	20070822	02934	Roy O'Brien, Inc. 422694	2008	1FAHP25W08G	56	306705	Approved	ENEILSON	<b>REPAIR:</b> PASSENGER REAR CHROME WHEEL HAD CONSEALED DAMAGE ON IT DISCOVERED WHEN PREPPING THE VEHICLE. THESE WHEELS COME FROM FACTORY WITH PROTECTIVE PLASTIC COVERS ON THEM. THERE WAS NO DAMAGE ON THE PLASTIC COVER. REPLACE THEPASSENGER REAR WHEEL. <b>RECOMM:</b> APPROVED TO REPLACE RIGHT REAR WHEEL.
7H2AS020	HD	20070828	20040622	20050131	02284	John Lance Ford	2005	1FMYU03175K	35395	306704	Approved	SYERK	<b>REPAIR:</b> CUSTOMER SAY WHEELS ARE BUBBLING BY CENTER CAPS WOULD NEED TO REPLACE WHEELS TO CORRECT <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7HOAO089	HD	20070815	20040928	20050816	07350	Kenny Ross Ford	2005	1FTZR15E45P	23716	306704	Approved	SYERK	<b>REPAIR:</b> CUST STATES ALL FOUR WHEELS AT THE CENTER ARE CORRODING. REPLACE ALL FOUR WHEELS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7HOAT033	HD	20070815	20070420	20070531	08828	Herb Chambers F 80242	2007	1FMEU75E87U	3270	306401	Approved	LLOMBAR1	<b>REPAIR:</b> LF WHEEL CLICKS DIAG NOISE CROME COVERING LOOSE MAKING NOISE RECOMMENDREPLACING RIM <b>RECOMM:</b> APPROVAL TO REPLACE LEFT FRONT WHEEL TO CORRECT NOISCE CONCERN.
7H4AS025	HD	20070830	20060518	20060711	06145	Mosinee Ford	2006	1FTPX14V66F	33187	306513	Approved	SYERK	<b>REPAIR:</b> CONCERN FOR LINE 01 IS CORRODED WHEEL CENTERS. REPAIR IS REPLACEMENT OF 4 WHEEL CENTERS. <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7H1AR168	HD	20070827	20070619	0	03372	Family Ford, Inc.	2007	2FMDK49CX7B	49	306702	Approved	SYERK	<b>REPAIR:</b> CUSTOMER STATES ALL 4 WHEELS OXIDIZING REPLACE WHEELS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7HOAR019	HD	20070815	20040203	20040913	10638	Northland Lincoln 40211	2004	1LNHM81W44Y	44302	306513	Approved	ENEILSON	<b>REPAIR:</b> ALL FOUR WHEEL CENTERS ARE PEELING REQUEST TO REPLACE ALL FOUR CENTERS <b>RECOMM:</b> APPROVED TO REPLACE ALL 4 CENTER CAPS.
7HPBE120	HD	20070816	20031022	20040917	03366	Ferrario Ford Linc	2004	1FTPX14534N	32337	306513	Approved	SYERK	<b>REPAIR:</b> ALL 4 WHEEL CENTER CAPS ARE BLISTERING-NEED TO REPLACE <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7HXAW050	HD	20070824	20040330	20040925	00572	EMERLING FORI	2004	1FTPX14544N	25849	306513	Approved	SYERK	<b>REPAIR:</b> CUST IS COMPLAINING OF BOTH FRONT HUB CAPS DEFORMING <b>RECOMM:</b> WARRANTY APPROVEDTO REPLACE BOTH FRT WHEEL CENTER CAPS.
7HTAT003	HD	20070820	20060411	0	07839	VALLEY ISLE MC 373270	2006	1FTYR44U06P	67	306701	Approved	LLOMBAR1	<b>REPAIR:</b> ALL 4 RIMS ARE DISCOLORING AND CORRODING. REQUEST TO REPLACE ALL 4 RIMS. <b>RECOMM:</b> APPROVAL TO REPLACE 4 WHEELS DUE TO CORROSION.
7HTBB023	HD	20070820	20050311	20050324	01487	Don Chalmers Fo	2005	1FAHP281X5G	28113	306513	Approved	SYERK	<b>REPAIR:</b> ALL 4 WHEEL CENTER CAPS ARE DELAMINATING, NEED TO REPLACE ALL FOUR CENTER CAPS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7HXAW064	HD	20070824	20040803	20040828	09304	Lundgren Motors,	2004	1FTPX14554N	28245	306513	Approved	SYERK	<b>REPAIR:</b> CUSTOMER NOTICES THAT PASSENGER FRONT WHEEL NUT COVER IS BUBBLING AND WOULD LIKE IT REPLACED UNDER WARRANTY. <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE THE RT FRT WHEEL CENTER CAP.
7HTBB015	HD	20070820	20051012	20051020	08294	Tri Ford-Mercury,	2006	1FAFP25156G	15938	306513	Approved	SYERK	<b>REPAIR:</b> HUB CAPS ARE PEELING. ALL FOUR CENTER CAPS ARE LOOSING THE CLEARCOAT OFF OF THEM. NEED TO REPLACE THE 4 CENTER CAPS. <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEEL CENTER CAPS.
7HXAW007	HD	20070824	20050613	20060417	07708	Windward Ford	2005	1FMZU77KX5U	20692	306704	Approved	SYERK	<b>REPAIR:</b> CUSTOMER STATES ALL FOURR RIMS BY VALVE STEM AREA CLEAR COAT DISCOLORING OR CRACKING, RECOMMEND TO REPLACED ALL FOUR TIRESS <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE ALL FOUR WHEELS.
7HVBO074	HD	20070822	20050630	20050811	09708	Don Seelye Ford, 757435	2006	4M2YU57176D	29404	306513	Approved	ENEILSON	<b>REPAIR:</b> ALL 4 CENTER CAPS ON THE WHEELS ARE CORODED ON THE OUTSIDE EDGES WILL NEED 4 NEW CAPS <b>RECOMM:</b> APPROVED TO REPLACE ALL 4 CENTER CAPS.
7HWAO027	HD	20070823	20060322	20060407	02484	Greenville Ford Li 18238	2006	1LNHM82V76Y	25715	306513	Approved	ENEILSON	<b>REPAIR:</b> CUSTOMER STATES CENTER CAP IS LOSING PAINT NEED APPROVAL FOR REPLACEMENT <b>RECOMM:</b> APPROVED TO REPLACE CENTER CAP.
7HPBE094	HD	20070816	20040517	20040903	03028	Willey Ford - Boui	2004	1FTPW14554F	25187	306513	Approved	SYERK	<b>REPAIR:</b> GUEST STATES LUG NUT CAP FINISH IS COMING OFF INTEND TO REPLACE CAP <b>RECOMM:</b> WARRANTY APPROVED TO REPLACE THE LT FRT WHEEL CENTER CAP.
7HQAO158	HD	20070817	20041117	20050528	04918	Hub City Ford-Me	2005	1FTRF02WX5K	38955	306704	Approved	GSTAVROF	<b>REPAIR:</b> TIRE WILL NOT SEAT ON THE RIM, BECAUSE OF CHROME IS PEELING FROM THE INSIDE. RECOMMEND REPLACING THE RIM. <b>RECOMM:</b> GVS APPROVED TO REPLACE R/R RIM T/Y GEORGE

7H1A2014	HD	20070827	20060206	20060524	04790	Gary Yeomans Fc	2006	4M2EU38816U	4790	306704	Approved	GSTAVROF	<b>REPAIR:</b> CUSTOMER STATES ALL FOUR WHEELS THE CLEAR COAT IS PEELING OFF, ALSO THE DRIVERS REAR CENTER RIMS CAP IN THE MNIDDLE IS CRACKED AND PEELINGSMOOTH TO THE TOUCH BUT CRACKING ALONG WITH SEVERAL SPOTS REMAINED AFTER THE SERVICE MANAGER INSTRUCTED I ATTEMPT TO CLEAN AND POLISH ALLFOUJR RIMS WITH MOTHERS CHROME RIMS POLISH, INTEND TO REPLACE ALL FOUR RIMS <b>RECOMM:</b> GVS PLEASE BE SURE WE HAVE A VALID CLEAR COAT PEELING ISSUE BEFORE RELACING WHEELS STAIN ISSUES OR BRAKE DUST BUILD UP FROM LACK OF MAINTENACE IS NOT A WARRANTABLE ISSUE APPROVED TO REPLACE DEFECTIVE CLEAR COAT PEELING WHEELS & CENTER CAP T/Y GEORGE
7HXBD029	HD	20070824	20070221	20070403	07761	Orchid Isle Auto C	2007	5LMFU28527U	2540	306799	Approved	GSTAVROF	<b>REPAIR:</b> CHROME ON WHEELS HAS PITTING <b>RECOMM:</b> REQUEST TO REPALCE LEFT SIDE WHEELS IS APPROVED PER BRYCE
7HTBD068	HD	20070820	20040512	20040824	00582	Dons Ford, Inc.	2004	1FMDU74W54	21289	306704	Approved	GSTAVROF	<b>REPAIR:</b> CUSTOMER STATES THREE OF FOUR RIMS HAVE COROSION. INTENDED REPAIR WOULD BE TO REPLACE RT FRONT LT FRONT AND RT REAR RIMS <b>RECOMM:</b> GVS APPROVED TO REPLACE RT FRONT LT FRONT AND RT REAR RIMS T/Y GEO. <b>REPAIR:</b> ADDING IMAGE
7HQBR013	HD	20070817	20050502	20050616	10671	Southgate Lincolr 737	2005	1LNHM87A25Y	18315	306704	Approved	GBUSH5	<b>REPAIR:</b> CUSTOMER STATES THAT VEHICLE RIM IS PEELING AND WILL NOT HOLD AIR. REPLACE RIGHT REAR RIM <b>RECOMM:</b> APPROVED TO REPLACE THE RR WHEEL.
7HXBD035	HD	20070824	20040727	20040828	07708	Windward Ford	2004	1FTPX14574N	29738	306704	Approved	GSTAVROF	<b>REPAIR:</b> ALL WHEELS HAVE CLEAR COAT PEELING <b>RECOMM:</b> APPROVED TO REPLACE ALL WHEELS
7FRAF189	HD	20070618	20070515	20070530	02700	Skalnek Ford Inc 101580	2007	2FMDK38C27E	993	306700	Approved - MSAMPLE1	ENEILSON	<b>CONCER:</b> cust states lt frt wheel chrome distorted <b>RECOMM:</b> Warranty approved to replace all four wheels.
7HHAG177	HD	20070808	20050727	20060408	01580	Smith Ford of Lov 244707	2006	1FMFU20566L	6294	306201	Approved -	ENEILSON	<b>CONCER:</b> no damage at wheel, tire looses 4-5 lbs overnight. no leaks in a dunk tank present , we have bead sealed the bead tire still leaks , tire that is shown on rim is the spare,still losses the air overnight,no vlv stem leak, next step is to replace rim asm. <b>RECOMM:</b> Approved to replace wheel. Thanks, Eric
7FFAL142	HD	20070606	20040617	20050511	02335	Don Tester Ford l 22696	2004	1FTRX12W04NO	26494	306702	Approved -	ENEILSON	<b>CONCER:</b> corrosion developing under clearcoat on center caps of all four centerwheel caps <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric
7FNAL090	HD	20070614	20030811	20040227	20050	Fairway Ford Linc 102053	2004	1LNHM83WX4Y	29405	306704	Approved -	LLOMBAR1	<b>CONCER:</b> chrome is coming off wheels, two of them have large spots peeling and cracking. also will not hold air, keep leaking a bead. need to replace all four wheels. thanks.sue <b>RECOMM:</b> approval to replace all 4 wheels due to chrome peeling. Be advised, ifon part return, damage is determined, repair will be charged back to dealer. thnx Loretta 6-14-07
7FMAH140	HD	20070613	20050203	20050404	02222	Liberty Ford Linc 195460	2005	1FMZU77K85U	20071	306702	Approved -	GBUSH5	<b>CONCER:</b> cust states pass wheels have pitts arounf the valve stem and hub cover <b>RECOMM:</b> approved to replace both rt side wheels. thanks gary
7GQAE038	HD	20070717	20050225	20050705	00572	EMERLING FORI 67637	2005	1FMZU73E35U	19336	306704	Approved -	GSTAVROF	<b>CONCER:</b> cust states all wheels are corroded around center caps. recommend replacement of all 4 wheels <b>RECOMM:</b> Please add the required overall view of these items t/y georg approved to replace wheels t/v george
7GTAJ138	HD	20070720	20060302	20060703	07708	Windward Ford 60394	2007	1FMEU31K67U	15529	306704	Approved -	MSAMPLE1	<b>CONCER:</b> customer states all four rims spider webbing in clear coat. recommend to repl four rims. thanks lou <b>RECOMM:</b> Please provide the required 3/4 picture of the entire vehicle.
7GXAK037	HD	20070724	20070504	20070626	03010	Brondes Ford Inc. 159307	2007	2FMDK36C27E	672	306700	Approved -	SYERK	<b>CONCER:</b> CUSTOMER STATES IMPERFECTIONS IN WHEEL ON LEFT REAR. IMPERFECTIONS ARE UNDER THE CLEAR COAT ON THE WHEEL & YOU CAN NOT FEEL THEM ON THE SURFACE OF THE WHEEL. REPAIR :REPLACE WHEEL <b>RECOMM:</b> warranty approved to replace the lt rear wheel. thanks Scott
7FLCL197	HD	20070612	20070212	20070407	03774	Ewald's Venus Fc 514866	2007	1FMEU74E37U	3204	306401	Approved -	GSTAVROF	<b>CONCER:</b> customer states a clicking noise on acceleration and turning.. well first we heard the noise instantly and had the tech put vehicle in air. then he tried the 4x4 and we could not hear the noise, so we got vehicle back on the floor and noise was there. we hit the rim and you can hear a clicking noise coming from the cover of both front rims. then i had him perform a tire rotation so i can see if the noise went to the rear, and yes it did and louder, but the rear tires are doing the same.. so we need to replace all 4 rims. its pretty weird but it is a weird design. i understand! there is no damage to any of rims and i do feel that this will fix the concern. thanks <b>RECOMM:</b> if you are requesting four wheels we would require four overall views of each wheel, at least four close ups of rim edges to ensure damage is not cause, you should also inspect rims for damage and advise us on damage if any is found, In addition, these wheels are subject to charge back if damage is found, even if we approve Please add images and advise Thank you, approved to replace all four wheels thank you, george <b>ADD-ON:</b> THIS IS A KNOWN ISSUE THAT IS CURRENTLY UNDER INVESTIGATION
7GWAI255	HD	20070723	20031219	20040223	10671	Southgate Lincolr 51	2004	5LMFU28R94L	48950	306704	Approved -	GSTAVROF	<b>CONCER:</b> customer states drivers front and passenger rear chrome is peeling off of rims. replace left front and right rear rim. also note that d.i pictures were sent 7/5/07 and the senior service consultant was dealing w/ gary and gave permission to order rims, but just wanted a few more pictures, mileage at that time was 48,950 <b>RECOMM:</b> approved to replace drivers front and passenger rear rims t/y george

7GJAE031	HD	20070710	20060210	20060703	02157	Mullinax Ford Eas 166497	2006	1FTPW14516K	20677	306513	Approved - SYERK	<b>CONCER:</b> customer states that the drivers front wheel center cap oval is peeling recommend replacing center cap thanks, Justin Higgins <b>RECOMM:</b> warranty approved to replace the lt frt wheel center cap. thanks. Scott
7GXAK117	HD	20070724	20050502	20050822	20249	MANGOLD FORI 93301	2005	1FAFP25105G	17362	306704	Approved - LLOMBAR1	<b>CONCER:</b> right rear center cap is peeling(rec. replacing center cap) <b>RECOMM:</b> Please provide a clear, legible photo of concern for auth. thnx Loretta 7-24-07 approval to replace right rear center cap due to peeling. thnx Loretta7-24-07
7FUAE177	HD	20070621	20030807	20030930	01505	Lyons-Ryan Ford 105749	2003	5LMEU78H43Z	23149	306704	Approved - GBUSH5	<b>CONCER:</b> customer concern--left rear wheel chrome is bubbling. inspect--chromebubble just below valve stem. repair would be left rear wheel replacement. thank you Ken <b>RECOMM:</b> approved to replace the lr wheel. thanks garv
7GEAB027	HD	20070705	20070531	20070630	02744	Campbell Ford Lir 29333	2008	2MEHM75V68X6	400	306704	Approved - GSTAVROF	<b>CONCER:</b> customer states clear coat on rim peeling requesting to replace rim <b>RECOMM:</b> approved to replace rear wheel t/y george
7FVAC046	HD	20070622	20041217	20060412	01970	Kings Ford Inc 022818	2005	1FAFP28125G	31189	306704	Approved - GSTAVROF	<b>CONCER:</b> all 4 center caps are starting to pit, request to replace center caps,thanks james <b>RECOMM:</b> approved to replace center caps to correct pitting peeling on edges t/y george
7GTAJ147	HD	20070720	20060207	20060304	20054	Heller Ford Sales 180317	2006	1FTPW14V76K	15544	306513	Approved - MSAMPLE1	<b>CONCER:</b> three out of the four center caps are losing their finish. seeking approval to replace 3 center caps after having customer piont out which three are peeling. the customernoticed it is happening on all four center caps. please review pictures of full view and close up of all four center caps. would like approval to replace all four center caps <b>RECOMM:</b> We only received one overall and one close up image. Please add the overall and close up images for the remaining two wheels. Also, please state which wheels are affected. Warranty approved to replace all four center caps.
7G5AI175	HD	20070731	20061018	20070702	01505	Lyons-Ryan Ford 106744	2007	5LTPW18507F	623	306702	Approved - GBUSH5	<b>CONCER:</b> right rear rim has alot of corrsion in between all slots in rim [ rec changing rim] did attempt to clean area but damage is to severe rags where snagging on high spots <b>RECOMM:</b> approved to replace the rr wheel. thanks garv
7HAAT262	HD	20070801	20060331	20060429	05977	Metro Ford Auto 24777	2006	3FAFP06Z06F	21629	306701	Approved - MSAMPLE1	<b>CONCER:</b> c/s all four wheels are rusting--right rear and both left side wheels are badly rusted, right front is starting to rust; we would have to replace the wheels <b>RECOMM:</b> Warranty approved to replace all four wheels.
7HBAN095	HD	20070802	20051219	20060415	01857	Buss Ford Sales 136248	2006	4M2YU98H06K	20850	306702	Approved - GBUSH5	<b>CONCER:</b> c/s corrosion/bubbles on all 4 rims around the center caps - pictures are of each of the tires - recommend replacing all 4 rims - thanks todd mathis buss ford service writer after talking to gary verified passenger rear tire has small corrosionstarting but no visible in picture - customer had business meeting to go to so unable to take another picture did mark on picture for passenger rear tire where corrosion is starting but bubbles no appearing yet - so recommend replacing 3 with the 4th so to be <b>RECOMM:</b> Todd, the close-ups are out of focus. I can see concern for the wheelswith the heavy bubbles, but not on the others. Try holding a pen closeto and pointing at the concern. Then focus the camera on the end of the pen. Make sure camera is in close-up mode, flower setting. Thanks gary approved to replace 3 wheels. thanks gary
7FVAC200	HD	20070622	20040809	20050628	08828	Herb Chambers F 76822	2005	1MEFM50U95A	14883	306704	Approved - GSTAVROF	<b>CONCER:</b> customer states paint peeling off of all 4 center caps.....intended repair is to replace all center caps <b>RECOMM:</b> APPROVED TO REPLACE CENTER CAPS T/Y GEROG
7FZAH058	HD	20070626	20040526	20040923	06190	Towne Ford 649538	2004	1FTPW14594K	29422	306704	Approved - SYERK	<b>CONCER:</b> OWNER STATES PAINT IS FALLING OFF RIMS, REQUESTING NEW RIMS THANK YOU <b>RECOMM:</b> need clear and focused close up images of the concern and overall images of all wheels. thanks, Scott warranty approved to replace all four wheels. Please note that all wheels are returned to warranty parts return center, and if any damageand/or no problem found this will result in a charge back to the dealer. Thanks, Scott
7GXAK189	HD	20070724	20061026	20070113	12505	Van Drisse Lincol 23013	2007	5LTPW18507F	9327	306701	Approved - MSAMPLE1	<b>CONCER:</b> all four wheels have corrosion and pit spots betwwen spokes request auth for wheel replacement thanks don <b>RECOMM:</b> Warranty approved to replace all four wheels.
7GSAF660	HD	20070719	20050729	20050825	02284	John Lance Ford 145089	2005	1FTZR15E15P	24859	306704	Approved - SYERK	<b>CONCER:</b> left rear vwheel is pitting bad need to replace wheel <b>RECOMM:</b> warranty approved to replace the lt rear wheel. thanks, Scott
7GBAJ132	HD	20070702	20050104	20050222	01325	Holman Ford-Mot 380677	2005	1FAHP34N55W	11955	306701	Approved - MSAMPLE1	<b>CONCER:</b> verified concern-all 4 wheels rusted -will to repaint or replace <b>RECOMM:</b> Warranty approved to replace all four wheels.
7GSAF690	HD	20070719	20041013	20050225	03523	Jorgensen Ford S 8075	2005	1FAFP36N25W	12681	306702	Approved - ENEILSON	<b>CONCER:</b> cust states all 4 steel 15 inch wheels are rusting and is requesting replacement <b>RECOMM:</b> Approved to replace all 4 wheels. Thanks, Eric
7GBAJ103	HD	20070702	20050216	20050314	03850	Broadway Ford 166012	2005	1FMYU93165K	17806	306704	Approved - MSAMPLE1	<b>CONCER:</b> all four of the wheels on this vehicle are bubbled and peeling no signof any abuse clean vehicle - thanks joann <b>RECOMM:</b> Warranty approved to replace all four wheels.
7GFAJ035	HD	20070706	20070417	20070609	03010	Brondes Ford Inc. 158723	2007	1ZVHT88S775	715	306700	Approved - SYERK	<b>CONCER:</b> passenger front rim has imperfection possible sparkle over spray from factory <b>RECOMM:</b> warranty approved to replace the rt frt wheel. thanks, Scott
7F2AP152	HD	20070628	20050518	20050629	20551	New Country Forc 235604	2005	1FMZU77K25U	22106	306702	Approved - ENEILSON	<b>CONCER:</b> 3 wheels clear coat is pitting, flaking. One Arrow-Left front, sever at center cap and in spokes. Two Arrows-Left Rear, sever at center cap. Three Arrows-Right Front, minor at center cap Need to replace 3 wheels. <b>RECOMM:</b> Approved to replace 3 wheels. Thanks, Eric

7GEAB229	HD	20070705	20050216	20050325	12505	Van Drisse Lincol 22731	2006	5LTPW18566F	5043	306704	Approved - MSAMPLE1	<b>CONCER:</b> cust has 2 wheels on right side that are peeling arrows indicate peeling near spoke area of wheels request auth for wheel replacement additional picture requested ion right rear wheel <b>RECOMM:</b> Please provide the required overall photo of the right rear wheel and a clear close up of the peeling concern. Only one of the two close upimages is clear enough to be used. Warranty approved to replace the right front and right rear wheels.
7HHAG156	HD	20070808	20031209	20040428	00401	Ed Sherling Ford, 087725	2004	5LMEU88H74Z	40773	306513	Approved - SYERK	<b>CONCER:</b> check center caps peeling will need to replace. <b>RECOMM:</b> warranty approved to replace 3 wheel center caps. thanks. Scott
7GTAJ124	HD	20070720	20041013	20050616	07590	Van Bortel Ford, 1595209	2005	1FMDU75W85U	30461	306799	Approved - LLOMBAR1	<b>CONCER:</b> customer states driver front, passenger front, and driver rear wheels warping. request replacement with authorizations. sending back claim for authorization <b>RECOMM:</b> I am sending photos to the engineer. We have not seen this before. I will call when I need claim sent back when I find out response. I willcall before the day is done. thnx much. Any questions, contact me direct at 313-248-3721. Loretta 7-17-07 KEEP CLAIM ON YOUR END TILL ICALL. THNX AGAIN
7GIAC202	HD	20070709	20050811	20051123	09668	Grand Traverse A276013	2006	1FAHP34N36W	29899	306513	Approved - BKIRCHEI	<b>CONCER:</b> PAINT IS CHIPPING OF AND TURNING YELLOW ON WHEEL COVERS - REPLACE ALL 4 WHEEL COVERS DRIVERS SIDE PICK ARE CHIPPED/PASSENGER SIDE ARE YELLOW SEE NEW PHOTOS <b>RECOMM:</b> Please add a photo of each cover that needs to be replaced. Thanks Bryce Approved to replace 4 hub caps. thanks Bryce
7GQAE138	HD	20070717	20060928	20070228	02199	BOB GILLINGHA 157209	2007	1ZVFT80N075	6424	306704	Approved - GSTAVROF	<b>CONCER:</b> BOTH REAR RIMS ARE CORRODING AROUND CENTER CAPS CORRECTION-REPLACE BOTH REAR RIMS <b>RECOMM:</b> Approved to replace rear wheels t/y george
7HBAN212	HD	20070802	20070426	20070730	07761	Orchid Isle Auto C 41208	2007	2FMDK38C07E	154	306703	Approved - GSTAVROF	<b>CONCER:</b> left rear rim distorted - need to replace rim <b>RECOMM:</b> Please add the required overall view of this rim t/v george
7GYAH177	HD	20070725	20050420	20050505	08017	Auffenberg Ford, 142248	2005	1FAFP34N25W	33859	306512	Approved - GSTAVROF	<b>CONCER:</b> loud ticking noise heard from front end found noise coming from both front hub caps if caps are removed noise goes away tried to clean and lube but noise still there needs hub caps replaced <b>RECOMM:</b> approved to replace front hub caps t/y george
7FMAH222	HD	20070613	20061130	20070204	01625	Courtesy Ford 306694	2007	1FMEU65E37U	13914	306401	Approved - ENEILSON	<b>CONCER:</b> TICKING, CLICKING SOUND WHEN VEHICLE IN MOTION GOING FORWARD OR BACKWARD BEST HEARD WHEN GOING SLOW COMING FROM LEFT AND RIGHT SIDE FRONT WHEELS. CHROME OUTER SKIN LOOSE CAUSING NOISE- NEEDS BOTH FRONTWHEELS REPLACED. <b>RECOMM:</b> Approved to replace left and right front wheels. Thanks, Eric <b>ADD-ON:</b> HOT REQUEST SUBMITTED FOR THE 2 FRONT 18" WHEELS (7L2Z- 1007-E).
7G5AI038	HD	20070731	20060904	20070115	03897	Lithia Ford Lincoln 355746	2007	3FAHP06Z67P	5276	306512	Approved - GSTAVROF	<b>CONCER:</b> CUSTOMER STATES SQUEEKING NOISE FROM WHEEL AREA-ALL HOB CAPS HAVE A POOR FIT NEED TO REPLACE PRT TSB 6-21-13 <b>RECOMM:</b> APPROVED TO REPLACE WHEEL COVERS WITH REVISED CAPS T/Y GEORGE
7GQAE173	HD	20070717	20070130	20070221	03850	Broadway Ford 172490	2007	1FTPX14V77F	9101	306700	Approved - GBUSH5	<b>CONCER:</b> RT Front wheel has small imperfecion in chrome - no sign of damage - wheel would need to be replaced thanks JoAnn <b>RECOMM:</b> approved to replace the rf wheel. thanks gary
7FHAD150	HD	20070608	20030806	20031113	02848	Holman Ford Linc 216606	2004	5LMFU28R04L	41078	306701	Approved - GBUSH5	<b>CONCER:</b> c/s rust build up on rims and finish is flaking off. we would need to replace the rims. thanks <b>RECOMM:</b> approved to replace the rims. thanks gary
7GZAH134	HD	20070726	20041123	20050831	02157	Mullinax Ford Eas 167373	2005	1FMZU74W25U	18830	306704	Approved - SYERK	<b>CONCER:</b> CUST STATES THAT RIGHT FRONT RIM AND LEFT REAR RIM ARE BUBBLING AT CENTER BY CAP RECOMMEND RIM REPLACEMENT THANKS LAURA <b>RECOMM:</b> warranty approved to replace the rt frt and lt rear wheels. thanks, Scott
7GFAJ056	HD	20070706	20041203	20050924	08287	Donley Ford-Linc 508295	2005	1FTZR45E95P	34209	306704	Approved - SYERK	<b>CONCER:</b> customer states that the clearcoat is coming off of wheels,request to replace 4 wheels <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7FOAE019	HD	20070615	20061129	20061214	03781	Jarrett-Gordon Fc 108561	2007	1FTYR11U27P	1482	306800	Approved - SYERK	<b>CONCER:</b> customer came in for vibration when checking tires for balance and road force found right rear rim in excess of runout nesarary to replace rim <b>RECOMM:</b> please add clear and focused images of the face of the wheel. thanks, Scott warranty approved to replace the rt rear wheel, also refer to tsb # 07-04-05. Please note that all wheels are returned to warranty parts return center, and if any damage and/or no problem found this will result in a charge back to the dealer. Thanks, Scott
7FYA6221	HD	20070625	20060424	20060831	02058	BEECHMONT FC 359700	2006	1FTPW14V66F	13669	306703	Approved - ENEILSON	<b>CONCER:</b> customer states all 4 rims are rusting has been cleaned with metal brite. This is the customers second trip pf 75 miles one way and is very upset, he also has 6 fords and 2 lincolns and feels as if gettingthe run around. the rims were cleaned last visit but i did not know if it was with metal brite or not. Metal brite does not help. these need replaced <b>RECOMM:</b> Approved to replace all 4 wheels if unable to clean. Thanks, Eric
7HCAD160	HD	20070803	20060421	20060929	08465	Newberg Ford Me 93229	2006	1FTWW31P46E	22121	306704	Approved - SYERK	<b>CONCER:</b> Need to replace all 4 king ranch wheels due to delamination. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott

7FHAD142	HD	20070608	20040204	20040607	08888	York Ford Inc	366065	2004	1FAFP406X4F	14606	306704	Approved - GSTAVROF	<b>CONCER:</b> Finish on all four center cap peeling and pitting requesting approval to replace all four. Also see image of ro opened yesterday 6/7/2007 <b>RECOMM:</b> approved to replace center caps warranty is valid thru today t/v aeo.
7GIAC077	HD	20070709	20040629	20040830	06360	Griffin Ford Lincol	11256	2004	1FTYR10D94F	7301	306704	Approved - GSTAVROF	<b>CONCER:</b> c/s that all four center caps are pitting and corroding, looking to replace all four center caps thanks. area <b>RECOMM:</b> approved to replace center caps t/v aeo
7GLAE122	HD	20070712	20041215	20050103	02265	Mathews Ford Lin	239981	2005	4M2YU57165D	31500	306702	Approved - GBUSH5	<b>CONCER:</b> all center caps have corroded surfaces req auth to replace all caps thanks//rob <b>RECOMM:</b> Please add clear close-up pictures of concern of each center cap. Lay/hold a pen close to and pointing at the concern. Then focus the camera on the end of the pen. Make sure camera is in close-up mode, flower setting. Thanks gary approved to replace 4 center caps. thanks gary
7GTAJ059	HD	20070720	20050916	20060926	13304	CREST LINCOLN	206812	2006	1LNHM82V26Y	8026	306513	Approved - LLOMBAR1	<b>CONCER:</b> customer states black lettering coming off all 4 hub caps 4 caps need to be replaced <b>RECOMM:</b> approval to replace 4 center caps. Lettering peeling off. thnx Loretta7-20-07
7FVAC130	HD	20070622	20040915	20041119	02220	L F DONNELL IN	418465	2005	1ZVHT82H955	19885	306702	Approved - BKIRCHEI	<b>CONCER:</b> customer states the chrome is coming off the wheels. verified concern,will need to replace wheels to correct concern. thank you connie the customer took wheels off of the vehicle so we could take better close up shots needs 3 wheels and 4 center covers for concern <b>RECOMM:</b> Please add closer close-ups of concerns. thanks gary
7GRAN196	HD	20070718	20060515	20070202	06481	Hub City Ford, Inc	112207	2007	1FTSW21P77E	16166	306999	Approved - LLOMBAR1	<b>CONCER:</b> cust states that driving on interstate felt shake in front wheels stopped and the driver front rim was split at the lip cust request newwheel and tire and rubber on bead cut <b>RECOMM:</b> Per conversation with George, you have approval to replace left front wheel. Split. thnx Loretta 7-18-07
7FYA6039	HD	20070625	20060616	20060704	10736	Ganley Lincoln-M	101144	2006	2MEFM75V66X	16959	306704	Approved - MSAMPLE1	<b>CONCER:</b> center cap mssing part of mercury emblem missing need to replace center cap thanks dave drivers side front wheel <b>RECOMM:</b> Which wheel is this? Warranty approved to replace the left front center cap.
7GKAI065	HD	20070711	20030808	20031215	02663	Northgate Ford, Ir	139294	2004	1LNHM83W24Y	7624	306701	Approved - LLOMBAR1	<b>CONCER:</b> finish on wheels and center caps is pitting and peeling. nec to replace 4 wheels and center caps. <b>RECOMM:</b> CENTER CAPS ARE DENIED. This appears to be damage from an outside source, not manufacturer defect. The area on the INSIDE OF WHEELS where it is bubbling, is warrantable. you have approval to replace wheels only. thnx Loretta 7-11-07
7HAAT014	HD	20070801	20060522	20060606	08588	Bowen Scarff For	44749	2007	1FAFP53U87A	13213	306201	Approved - BKIRCHEI	<b>CONCER:</b> Right front tire/wheel had a slow leak. Inspection found small casting flaw in middle of wheel that was leaking air. No physical damage noted on tire or wheel. Need to replace wheel to complete repair, please advise. <b>RECOMM:</b> Approved to replace the rt front wheel. thanks Bryce
7GMAC159	HD	20070713	20050210	20050312	10705	Nick Mayer Lincol	154238	2005	4M2CU57115D	28603	306704	Approved - MSAMPLE1	<b>CONCER:</b> C/STATES ALL 4 CENTER CAPS BADLY CORRODED WOULD LIKE THEM REPLACED <b>RECOMM:</b> Warranty approved to replace all four center caps.
7FHAD070	HD	20070608	20040923	20041024	00048	Ted Britt Ford Sal	604010	2005	1FAHP38Z95W	20056	306301	Approved - BKIRCHEI	<b>CONCER:</b> customer concern is 6 of his chrome lug nut covers have fallin off, recommened repair is to replace kugs thanks <b>RECOMM:</b> Please add a photo of each lugnut. thanks Bryce Approved to replace the lug nuts. thanks Bryce
7FUAE122	HD	20070621	20050131	20050216	08294	Tri Ford-Mercury,	320530	2005	2MEFM75W05X	30749	306799	Approved - LLOMBAR1	<b>CONCER:</b> clear coat coming off all 4 wheels request auth. to replace all 4 wheels <b>RECOMM:</b> approval to replace 4 wheels due to filiform corrosion. thnx Loretta 6-19-07
7FHAD094	HD	20070608	20070426	20070531	06481	Hub City Ford, Inc	109476	2008	1FTSW21R38E	293	306000	Approved - GSTAVROF	<b>CONCER:</b> CUST STATES KNOCKIING NOISE FROM REAR WHEEL AREA / FOUND LFT REAR LUGSLOOSE / RIM HOLES WODDLED AND STUDS NEED REPLACEMENT <b>RECOMM:</b> auth to replace l/r wheel t/v aeo
7FYA6118	HD	20070625	20040917	20050224	11643	Island Lincoln Me	79282	2005	2MEHM75W15X	30391	306201	Approved - GSTAVROF	<b>CONCER:</b> c/s l/r tire losing air- wheel pitted on inside. hole in wheel, necessary to replace wheel. <b>RECOMM:</b> approved to replace l/r wheel t/v aeo
7GKAI036	HD	20070711	20040702	20050531	10671	Southgate Lincolr	99312	2005	1MEFM50U75A	4995	306513	Approved - GBUSH5	<b>CONCER:</b> customer states center cap backing is peeling, right front and left rear. replace center caps <b>RECOMM:</b> approved to replace right front and left rear wheel center caps. thanks gary
7GTAJ008	HD	20070720	20050204	20050214	11000	Liberty Lincoln M	115162	2005	1FMYU93175K	20614	306701	Approved - MSAMPLE1	<b>CONCER:</b> TWO OF THE FOUR WHEELS THE FINISH IS CORRODING AROUND CENTER WHEEL CAPS.ON BADLY THE OTHER IS JUST STARTING,ITS VERY MINOR BUT IT IS THERE.MAY I REPLACE ? <b>RECOMM:</b> Warranty approved to replace both rear wheels.
7FNAL144	HD	20070614	20060930	20061116	02157	Mullinax Ford Eas	165167	2007	1FAFP34NX7W	14687	306513	Approved - ENEILSON	<b>CONCER:</b> Customer states that all wheel covers, the finish is peeling off. recommend replacing all four wheel covers. Thanks, Justin Higgins <b>RECOMM:</b> Approved to replace all 4 hubcaps. Thanks, Eric
7HDAB017	HD	20070804	20030128	20030805	01360	NEW HOLLAND	1445402	2003	5LMEU78H13Z	29913	306513	Approved - ENEILSON	<b>CONCER:</b> customer states the center caps are peeling parts are \$53 ea.recommend replacing caps. <b>RECOMM:</b> Approved to replace center caps. Thanks, Eric
7GIAC071	HD	20070709	20061108	20061209	01237	Kindle Ford Merc	320539	2007	4M2EU48E27U	20535	306513	Approved - BKIRCHEI	<b>CONCER:</b> customer states that the hubcaps are peeling. confirm that the hubcap are peeling need to replace <b>RECOMM:</b> Approved to replace the wheel covers. thanks Bryce
7GFAJ096	HD	20070706	20040816	20050326	12505	Van Drisse Lincol	22724	2005	1MEFM50U25A	9165	306513	Approved - SYERK	<b>CONCER:</b> All Four center caps are corroded and peeling. Request replacement of all four. Thank you. <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott

7GTAJ198	HD	20070720	20050302	20051130	20249	MANGOLD FORL 93214	2005	1FTRX14W55NE	16236	306704	Approved - ENEILSON	<b>CONCER:</b> cust states all 4 wheels have clearcoat peeling and lifting up(replace all wheels) thanks <b>RECOMM:</b> Approved to replace wheels, please be advised pictures showing concern in center cap area appears to be damage from prying off center cap and would not be warrantable. Thanks, Eric
7F1AM198	HD	20070627	20070514	20070620	06209	Dahl Ford La Cro: 149138	2008	1FTXW43R98E	331	306700	Approved - GBUSH5	<b>CONCER:</b> customers concern is that there is an imperfection in the right rear rim - appears to be set right into the chrome of rim. you can not feel any grooves or indents in it. I would like to replace this rim for customer. he is a good customer and purchases a lot of trucks from us. thank you. i am sorry gary this is the closest i can get while staying in focus, the camera is on the flower <b>RECOMM:</b> Please add clear close-up pictures of concern. Lay/hold a pen close to and pointing at the concern. Then focus the camera on the end of the pen. Make sure camera is in close-up mode, flower setting. Thanks gary approved to replace the rr wheel. (within 7 days of delivery) Please note that this wheel is subject for return to Warranty Parts Analysis Center. If damage is determined as the cause, this will result in a charge back to the dealer. Thanks Gary
7FZAH209	HD	20070626	20040910	20050108	01142	Clinton Family Fo 037068	2005	1LNHM87A45Y	30960	306201	Approved - GBUSH5	<b>CONCER:</b> The right front wheel keeps going flat. We removed wheel from the car and inspected the tire and rim-no apparent damage. We inflated the tire to 60 psi and submerged the wheel in soapy water. We found a tiny leak on the inside of the back of the wheel (can be seen by the bubbles) We cannot physically see a hole. Recommend replacement of the wheel. <b>RECOMM:</b> see line 03. thanks gary approved to replace the rf wheel. thanks gary
7FVAC085	HD	20070622	20051130	20060930	07327	Morrow Ford Linc 22532	2006	1FTPX145X6F	1547	306704	Approved - LLOMBAR1	<b>CONCER:</b> the left front rim has a sliver of chrome missing off the lip of the rim, the rim would need replaced to correct, thank you this light grey area is missing chrome <b>RECOMM:</b> You need to provide a full, overall photo of wheel and You need to provide a clear, legible close up photo of concern. These are too blurry. Be sure to turn the dial on top of the camera to the flower setting and take a step or 2 back for clearer close up. thnx Loretta 6-22-07 In the future, It is a DI requirement to provide full, overall photos of entire concern area. I had asked for a photo of the entire wheel. Approval to replace left front wheel, missing a strip of chrome. thnx Loretta 6-22-07
7GZAH020	HD	20070726	20031006	20031028	10248	Bay Lincoln-Merc 220505	2004	1LNHM83WX4Y	44468	306201	Approved - SYERK	<b>CONCER:</b> cust states right front tire has slow leak. cust installed new tires on vehicle same rim still has slow leak. broke down wheel/tire and reset. air leak still present. soap test revealed leak in rim. small pin hole causing air leak. replace right front wheel. <b>RECOMM:</b> please add a clear and focused overall image of the entire outside of the wheel. thanks, Scott did not receive the overall image of the outside of the wheel. please add image. thanks, Scott warranty approved to replace the right front wheel. thanks, Scott
7FVAC029	HD	20070622	20040330	20040628	02058	BEECHMONT FC 359561	2004	1FTPX14554N	29807	306513	Approved - ENEILSON	<b>CONCER:</b> states all 4 of the center caps are corroded and need replaced. <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric
7GLAE195	HD	20070712	20070620	0	05513	Citrus Ford 614512	2008	1FTXW43RX8E	12	306513	Approved - SYERK	<b>CONCER:</b> the right front hub cap chrome is peeling and needs to be replaced thanks. <b>RECOMM:</b> warranty approved to replace the right front wheel center cap. thanks, Scott
7GWAI062	HD	20070723	20070320	20070326	09930	Donley Ford-Linc 207135	2007	1FMEU74877U	4892	306401	Approved - LLOMBAR1	<b>CONCER:</b> customer states there is something clicking in left front wheel when moving. verified noise by moving wheel to left rear, noise traveled to rear. dis-mounted tire and verified nothing loose inside tire. noise appears to be coming from outer cover of 2 piece rim. <b>RECOMM:</b> approval to replace left front wheel to correct clicking noise. thnx Loretta 7-23-07
7FRAF224	HD	20070618	20040901	20041026	02058	BEECHMONT FC 359287	2004	1FTPX14594K	33602	306513	Approved - ENEILSON	<b>CONCER:</b> passenger front rim center cap is peeling need to replace <b>RECOMM:</b> Approved to replace right front center cap. Thanks, Eric
7HCAD154	HD	20070803	20061121	20070217	20700	JACK BYRNE FC 354540	2007	1FTWW31P57E	7867	306401	Approved - LLOMBAR1	<b>CONCER:</b> All wheel covers are making popping noises. Recommend replacement. Wheel covers have been checked and indexed per SSM 19673 without eliminating concern. Recommend replacement. <b>RECOMM:</b> are you referring to the center caps? Also, please read SSM 19673 BEFORE doing repair. Please clarify with comment. thnx Loretta 8-3-07 approval to replace center caps to correct noise concern. thnx Loretta 8-3-07
7GWAI231	HD	20070723	20030930	20040812	06366	Rosemurgy Motor 209560	2004	1FAFP42R34F	25926	306702	Approved - GSTAVROF	<b>CONCER:</b> CUSTOMER STATES LEFT FRONT, RIGHT FRONT, LEFT REAR WHEELS ARE CORRODING. NEED TO REPLACE ALL 3 WHEELS <b>RECOMM:</b> approved to replace 3 wheels t/y george
7FKAD085	HD	20070611	20060821	20070401	01625	Courtesy Ford 307514	2007	1FAFP31N17W	3464	306513	Approved - LLOMBAR1	<b>CONCER:</b> hub caps causing vibration, customer concern is that the hub caps look like a circus car when driving by. customer thinks they are all bent because they are all wobbly./ intend to replace all 4 hub caps. we checked all 4 hub caps are on correctly no damage to hub cap, have confirmed that while driving they look out of round and are adding to customer's vibration. <b>RECOMM:</b> approval to replace 4 wheel covers. warped. thnx Loretta 6-11-07
7FXAI001	HD	20070624	20040618	20041015	11208	Hempstead Linco 745514	2004	5LMFU28R54L	14068	306704	Approved - ENEILSON	<b>CONCER:</b> both left front and right rear rims are peeling...need to be replaced... no damage of any kind..truck is clean...thank you ok eric this is the best i can do...i hope it is good enough <b>RECOMM:</b> Please add overall pictures of both wheels. Thanks, Eric Approved to replace left front and right rear wheels. Thanks, Eric



7G4AC146	HD	20070730	20040601	20050305	02220	L F DONNELL IN 419643	2004	1FTYR10DX4P	7	15808	306704	Approved - ENEILSON	<b>CONCER:</b> customer state the paint is peeling off all 4 rims. verified concern, will need to replace rims to correct concern. thanks paul <b>RECOMM:</b> Approved to replace all 4 wheels. Thanks, Eric
7GLAE186	HD	20070712	20050301	20050401	03140	Phil Long Ford, LI 781041	2005	1ZVFT82H955		27144	306513	Approved - GSTAVROF	<b>CONCER:</b> CUSTOMER STATES THAT THE FORD EMBLEMS ON THE DRIVER FRT TIRE IS PEELING UP AND THE REAR TIRE THE EMBLEM IS BROKEN OFF. <b>RECOMM:</b> approved to replace wheel center caps on l/f & rear t/v george
7FMAH071	HD	20070613	20051213	20051230	20238	Lindquist Ford, In 233647	2006	1FTSW21PX6E		17007	306700	Approved - GSTAVROF	<b>CONCER:</b> CUST states lh rear wheel chrome is cracking and coming apart,intend to replace wheel asy.Thanks Kevin <b>RECOMM:</b> Please inspect the wheel in question for curb rash / curb scrape damage that may have caused this concern and advice of your findings Wheels are subject to charge back if damage is found to be the cause upon return review of wheels, Even if we approve your request to replace it does not prevent charge backs Thank you, George per your phone call into Bryce indicating no damage was found on lip edge, your request is approved to replace l/r wheel t/y george
7FTAH185	HD	20070620	20070221	20070403	07761	Orchid Isle Auto C 40108	2007	5LMFU28527L		1500	306704	Approved - BKIRCHEI	<b>CONCER:</b> In 51 both rh frt & rear rims chrome plating peeling off need to replace both frt & rear wheels advise. <b>RECOMM:</b> Approved to replace 2 rt side wheels. thanks Bryce
7GLAE074	HD	20070712	20041202	20041206	04617	Champion Ford K 524806	2005	1FAFP53U15A		33219	306201	Approved - GBUSH5	<b>CONCER:</b> the front left tire is going flat overnight. checked and found rim leaking. found no damage inside or outside. needs new rim. PIC WITH BLACK (X) AND RED CIRCLE ARE WERE LEAK IS LOCATED INSIDE & OUT SIDE OF RIM. THANK YOU SAM KISER <b>RECOMM:</b> approved to replace the lf wheel. thanks gary
7F1AM114	HD	20070627	20050222	20050316	03457	Ulrich Motor Co. 115177	2005	1FTSW21P65E		31175	306201	Approved - ENEILSON	<b>CONCER:</b> dealership seeking prior approval to replace wheel assembly. wheel hasabout a 1" small crack leaking air. wheel does not appear damaged. <b>RECOMM:</b> Approved to replace left rear wheel if no signs of impact are present.Thanks, Eric
7HHAG072	HD	20070808	20031010	20031114	00061	Purvis Ford, Inc. 77624	2004	5LMFU28R64L		32083	306704	Approved - ENEILSON	<b>CONCER:</b> c/s wheels all 4 wheels are peeling. we have dismantled all wheels - there are no indications that these have been rechromed or repaired inany way. need to replace. thanks. <b>RECOMM:</b> Approved to replace all 4 wheels. Thanks, Eric
7FFAL190	HD	20070606	20040805	20050330	10671	Southgate Lincolr 97888	2005	2MEHM75W55X		19264	306513	Approved - SYERK	<b>CONCER:</b> all four center caps are showing oxidization recomend replacing all four center caps <b>RECOMM:</b> please correct the mileage. thanks, Scott warranty approvedto replace all four wheel center caps, Please note that all wheel center caps are returned to warranty parts return center, and if any damage and/or no problem found this will result in a charge back to the dealer. Thanks, Scott
7FHAD160	HD	20070608	20040109	20040909	04865	Desoto Ford-Merx 94528	2004	5LMEU68H04Z		40976	306704	Approved - GBUSH5	<b>CONCER:</b> all four wheel cap covers peeling need to replace all four <b>RECOMM:</b> approved to replace 4 wheel center caps. thanks gary
7GSAF859	HD	20070719	20040505	20041004	02663	Northgate Ford, Ir 139407	2004	1LNHM83W34Y		19132	306201	Approved - BKIRCHEI	<b>CONCER:</b> drivers front wheel chrome is peeling where tire bead seats causing air leaks. unable to seal tire on rim. nec. to replace rim. <b>RECOMM:</b> Approved to replace the lf front wheel. Thanks Bryce
7GBAJ200	HD	20070702	20070103	20070626	10671	Southgate Lincolr 98989	2007	3LNHM28T87F		269	306513	Approved - SYERK	<b>CONCER:</b> customer states center cap lettering isnt painted. replace center cap.left front center cap , if your sitting in vehicle. <b>RECOMM:</b> please specify which wheel. thanks, Scott warranty approved to replace the lf frt wheel center cap. thanks, Scott
7F2AP044	HD	20070628	20051109	20060112	07590	Van Bortel Ford, l 594125	2006	1FAHP28166G		12867	306704	Approved - GSTAVROF	<b>CONCER:</b> customer states clear coat wearing off of all wheel covers <b>RECOMM:</b> approved to replace center wheel cap covers t/v george
7G4AC080	HD	20070730	20060116	20060329	10705	Nick Mayer Lincol 154675	2006	3MEFM07186F		10593	306513	Approved - BKIRCHEI	<b>CONCER:</b> c/status all four center caps have corrosion on them would like these replaced <b>RECOMM:</b> Approved to replace the center caps. thanks Bryce
7GBAJ154	HD	20070702	20040429	20040714	20054	Heller Ford Sales 179845	2004	1FTPW14514K		15044	306513	Approved - SYERK	<b>CONCER:</b> all four wheel covers are discolored and the finish is coming off. would like approval to replace all four wheel covers. <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7G1A3057	HD	20070727	20061205	20061226	05537	STAR FORD 704597	2007	2FMDK39C77E		17653	306704	Approved - LLOMBAR1	<b>CONCER:</b> If front wheel chrome is bubbling and peeling rec to replace rim... here are better pictures <b>RECOMM:</b> close up photos are too blurry to see concern. You need to provide a clear, legible close up photo of concern. These are too blurry. Be sure to turn the dial on top of the camera to the flower setting and take a step or 2 back for clearer close up. thnx Loretta 7-26-07 GREAT JOB ON THE PICS! Approval to replace left front wheel. Bubbling,peeling. thnx much. Loretta 7-26-07
7G1A3169	HD	20070727	20050726	20060203	02263	Donley Ford Lincx 111941	2005	5LMEU68H25Z		40355	306513	Approved - BKIRCHEI	<b>CONCER:</b> CUSTOMER STATES CLEAR COAT IS PEELING ON ALL 4 CENTER CAPS. RECOMMEND REPLACING CENTER CAPS. THANKS -JOEL <b>RECOMM:</b> Approved to replace the center caps. thanks Bryce
7GSAF731	HD	20070719	20050415	20050730	04728	Ray Skillman Perl 23200	2005	1FAFP25105G		34942	306513	Approved - GSTAVROF	<b>CONCER:</b> due to black dust build up from premiture rear brake wear it has pitted all four center caps sorry here are four close ups <b>RECOMM:</b> you have three close up supporting images on a four cap request? PLEASE ADD FOURTH IMAGE THAT SHOWS A CONCERN TO SUPPORT YOUR 4 CAP REQUEST T/Y GEORGE APPROVED TO REPLACE ALL FOUR CENTER CAPS T/Y GEORGE
7FNAL210	HD	20070614	20031029	20031219	11643	Island Lincoln Me 79123	2004	5LMEU68H44Z		19211	306513	Approved - ENEILSON	<b>CONCER:</b> customer states all four center caps are corroding, necessary to replace all n4 center caps <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric
7FKAD055	HD	20070611	20060514	20070531	00796	Tasca Ford 438815	2007	1FTWF31P07E		502	306701	Approved - GSTAVROF	<b>CONCER:</b> spare tire wheel finish is peeling on outside will need new rim to repair <b>RECOMM:</b> Please add a side view of this vehicle thank you, George approved to replace spare wheel t/y george

7GFAJ032	HD	20070706	20030514	20030913	10705	Nick Mayer Lincol	154096	2003	5LMEU78H83Z	26896	306704	Approved - SYERK	<b>CONCER:</b> customer states wheels are peeling on the outer edges on all 4 wheels <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7GGAA004	HD	20070707	20050215	20050618	02284	John Lance Ford	144995	2005	1FTZR45E45P	9927	306704	Approved - GSTAVROF	<b>CONCER:</b> Customer states right/front wheel clear coat peeling. Verified customer concern, rec replace wheel. <b>RECOMM:</b> auth to replace r/f wheel t/y george
7GHAH009	HD	20070708	20031219	20040223	10671	Southgate Lincolr	99078	2004	5LMFU28R94L	49864	306704	Approved - GSTAVROF	<b>CONCER:</b> left ft wheel,and right rear wheel are peeling on the inside causing aclicking noise..rec replace wheels 2 <b>RECOMM:</b> looks like we only have one close up of one wheels concern? if you are requesting two wheels we would need to see two clear close ups of concerns on each wheel Please add 2nd supporting close up image that shows concern on 2nd wheel t/y george
7GFAJ140	HD	20070706	20050624	0	07839	VALLEY ISLE MC	370312	2005	1FMDU77K45U	69	306704	Approved - SYERK	<b>CONCER:</b> ALL 4 RIMS ARE DISCOLORING. REQUEST TO REPLACE 4 RIMS DUE TO CORROSION. MAHALO, PETER. <b>RECOMM:</b> need clear and focused close up images of the concern, For close up imaging make sure the camera dial is set on the flower icon, push the shutter button half way allow the camera to focus once the image is focused push the shutter button all the way down to capture the image.Thanks, Scott
7FNAL032	HD	20070614	20050720	20060106	11000	Liberty Lincoln M	114624	2005	5LMEU88H35Z	16532	306704	Approved - GBUSH5	<b>CONCER:</b> customer complaining of chrome peeling from right rear wheel all otherwheels ok.may i replace one wheel? here is the picture of the entire wheel <b>RECOMM:</b> Please add a close-up of the entire wheel. thanks gary new pic a no show, please try again. thanks gary approved to replace the rr wheel. thanks gary
7G4AC033	HD	20070730	20070611	20070727	02736	Varsity Ford	304366	2007	2FMDK38C57E	316	306704	Approved - MSAMPLE1	<b>CONCER:</b> the passenger rear rim is starting to bubble need auth to replace rim thankyou mike <b>RECOMM:</b> Warranty approved to replace the right rear wheel.
7GJAE111	HD	20070710	20060721	20060930	10638	Northland Lincoln	39161	2006	4M2EU47E16U	6740	306702	Approved - GBUSH5	<b>CONCER:</b> all four wheel centers are corrodingrequest to replace all wheel centers <b>RECOMM:</b> approved to replace all 4 center caps. thanks gary
7FDAC085	HD	20070604	20060102	20060102	00572	EMERLING FORI	65378	2006	3FAHP07196P	14680	306512	Approved - GBUSH5	<b>CONCER:</b> attention Bryce.....as per phone conversation, all 4 hub caps are loose and making squeeking noise. customer lost driver side rear hub cap while order was being placed. dealer recomends replacement of all 4 hub caps per tsb num 06-21-13. tahnk you <b>RECOMM:</b> approved to replace 4 hub caps. thanks gary
7FHAD024	HD	20070608	20050228	20050726	02199	BOB GILLINGHA	155919	2005	1FMYU93155K	16534	306704	Approved - GSTAVROF	<b>CONCER:</b> cust states both side wheels around center cap are bubbling up rec replace both pass side wheel assys thnx mindy <b>RECOMM:</b> auth to replace pass side wheels t/y george
7FLCL190	HD	20070612	20060221	20061130	06360	Griffin Ford Lincol	10632	2006	1LNHM83V26Y	13	306704	Approved - ENEILSON	<b>CONCER:</b> CONCERN IS THAT THE LEFT SIDE CENTER CAPS --FRONT AND REAR--THE BLACK PAINT IN THE LINCOLN EMBLEM IS PEELIN SEE PICS THANKS <b>RECOMM:</b> Approved to replace left front and rear center caps. Thanks, Eric
7GMAC116	HD	20070713	20060503	20060517	03261	Terry Holmes For	51469	2006	3FAFP06Z06P	17972	306701	Approved - MSAMPLE1	<b>CONCER:</b> cleaned rims with metal cleaner as per loretta,resubmitted new images/suggest to paint or replace rims <b>RECOMM:</b> Thank you for the additional photos. Warranty approved to replace all four wheels.
7HBAN235	HD	20070802	20040730	20040929	01487	Don Chalmers Fo	43165	2004	1FTPW14554K	10591	306513	Approved - SYERK	<b>CONCER:</b> both wheel covers on drivers side are starting to peel, need to replace both wheel covers <b>RECOMM:</b> warranty approved to replace the lt frt and rear wheel center caps. thanks, Scott
7FZAH223	HD	20070626	20050114	20050329	20238	Lindquist Ford, In	235043	2005	1FMZU77K25U	31484	306704	Approved - GSTAVROF	<b>CONCER:</b> intend to replace all four wheels due to corrsion.thanks kevin <b>RECOMM:</b> approved to replace wheels t/y george
7G1A3100	HD	20070727	20051021	20060224	11056	Landmark Lincoln	43905	2006	3MEHM07116P	20688	306513	Approved - ENEILSON	<b>CONCER:</b> all four wheel cap plastic lamination is peeling off would like to repalce caps thanks danen <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric
7FHAD139	HD	20070608	20061017	20070424	08287	Donley Ford-Linc	507610	2007	5LTPW18517F	3275	306702	Approved - BKIRCHEI	<b>CONCER:</b> customer states that all 4 wheels are pitted,confirmed both front wheels and 1 rear.request to replace 3 wheels. <b>RECOMM:</b> Approved to replace 3 wheels. Thanks Bryce
7HAAT164	HD	20070801	20040909	20050102	04909	Bev Smith Ford	475769	2005	1FAFP34N25W	13000	306701	Approved - ENEILSON	<b>CONCER:</b> customer states all four wheel are rusted can not be cleaned up need to be replaced. glendae p.s this is the worst that I've have seen. <b>RECOMM:</b> Approved to replace all 4 wheels. Thanks, Eric
7FLCL041	HD	20070612	20041215	20041230	04944	McCotter Ford - N	208264	2005	5LMEU88H25Z	34866	306704	Approved - MSAMPLE1	<b>CONCER:</b> a Customer states the lf center cap is etching. Rec. replacement of the center cap <b>RECOMM:</b> Please provide the required overall photo of the entire wheel. Warranty approved to replace the left front wheel center cap.
7GCAK118	HD	20070703	20070612	0	08651	Korum Ford, Inc.	544308	2008	1FTWW31R78E	27	306703	Approved - ENEILSON	<b>CONCER:</b> this is a new vehicle we just got. the drivers side wheel has orange/yellow color to it in spots. we need to replace it. thank you. <b>RECOMM:</b> Approved to replace left front wheel. Thanks, Eric
7FMAH181	HD	20070613	20040728	20040927	08888	York Ford Inc	366291	2004	1FTPX14584N	24002	306704	Approved - LLOMBAR1	<b>CONCER:</b> finish on all four rims peeling and flaking. requesting approval to replace. <b>RECOMM:</b> approval to replace 4 wheels due to peelina. thnx Loretta 6-13-07
7G1A3133	HD	20070727	20060316	20060926	08559	Landmark Ford, Ir	670853	2006	3FAFP06ZX6P	16817	306512	Approved - MSAMPLE1	<b>CONCER:</b> found wheel covers making noise, found tsb 06-21-13. appears all fourcovers making noise/squeeking. thanks. <b>RECOMM:</b> Warranty approved to perform TSB.
7GKAI253	HD	20070711	20030717	20030930	11208	Hempstead Linco	746407	2003	5LMFU28R13L	37170	306704	Approved - MSAMPLE1	<b>CONCER:</b> all four wheels are pitted and pelling...all four need replacing.....thank you sorry about that..hope this is what you need ..thanks again <b>RECOMM:</b> Based on your comments, there is a concern with all four wheels but weonly received three close up images. Please provide the required overall photo for each affected wheel and the additional close up. Thank you for the additional photos. Warranty approved to replace allfour wheels.

7F2AP034	HD	20070628	20050302	20050818	10638	Northland Lincoln 38843	2005	4M2YU57135D	23539	306513	Approved - ENEILSON	<b>CONCER:</b> all four centers are peeling all four tires and wheels are photoed request to replace all four centers <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric
7FGAL206	HD	20070607	20040331	20040703	05885	Golden Circle For 221833	2004	1LNHM85W14Y	35835	306703	Approved - ENEILSON	<b>CONCER:</b> The pass rear rim has some dark spots on the edge near wheel. Rim has several spots around edge, no other rims have them. Would need to replace pass rear rim. Thanks Michael. <b>RECOMM:</b> Approved to replace right rear wheel. Thanks, Eric
7FKAD093	HD	20070611	20030806	20031223	10671	Southgate Lincoln 97664	2004	5LMFU28R04L	24787	306704	Approved - GSTAVROF	<b>CONCER:</b> all four wheels have pitted,and are peeling and bubbling up...rec..replace 4 wheels <b>RECOMM:</b> approved to replace wheels t/v george
7GQAE185	HD	20070717	20040831	20041207	05892	Woody Anderson 53090	2005	1FAFP34NX5W	17154	306701	Approved - SYERK	<b>CONCER:</b> cust states wheels are rusting. Advise to replace 4 wheels. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7GTAJ095	HD	20070720	20031220	20041119	08294	Tri Ford-Mercury, 321144	2004	1FTRW14W84K	32527	306801	Approved - BKIRCHEI	<b>CONCER:</b> vib in driveline and stg wheel at 59mph,verified concern,ck oasis,preform tsb 07 04 05,roadforce bal tire and wheel,rim lateral run out0.025,radial runout 0.022,remove driveshaft,preform tsb 07 10 09,still has concern,remove wheels and tires from like vehicle,condition corrected,switch tires back,rpl rf tire and wheel,still has vib with orig wheels,ck tsb 07 10 08,not same symtom,would like to rpl wheelsf <b>RECOMM:</b> Approved to replace the wheels per recomendation of the hotline 7GRBG049. thanks Bryce
7F2AP218	HD	20070628	20040506	20040911	04570	Bluebonnet Motor 472185	2004	1FTRW12W64K	20258	306704	Approved - MSAMPLE1	<b>CONCER:</b> FINISH PEELING ON BOTH LEFT SIDE WHEELS ONLY - NEED TO REPLACE <b>RECOMM:</b> Warrantv approved to replace the left front and left rear wheels.
7GGAA002	HD	20070707	20050428	20050725	02663	Northgate Ford, Ir 139146	2005	1FTPX125X5F	31237	306702	Approved - ENEILSON	<b>CONCER:</b> all four rims finish is peeling. nec to replace 4 rims. <b>RECOMM:</b> Approved to replace all 4 wheels. Thanks, Eric
7GLAE105	HD	20070712	20040915	20041118	20054	Heller Ford Sales 180112	2005	1FAHP28125G	34825	306513	Approved - GSTAVROF	<b>CONCER:</b> customer states the center caps on every wheel finish is flaking off. we verified the clear coat is peeling off. needs 4 new center caps. thanks <b>RECOMM:</b> approved to replace wheel center caps t/y george
7FEAN129	HD	20070605	20060201	20070419	13660	Elmhurst Lincoln- 63301	2006	2MEFM74V96X	1343	306513	Approved - MSAMPLE1	<b>CONCER:</b> both rear wheel covers chrome finish is cracking and peeling we intendon replacing as necessary thanks much ed :) <b>RECOMM:</b> Warranty approved to replace both rear wheel covers.
7GJAE160	HD	20070710	20051012	20061116	09883	Roberts Ford 149814	2006	1FTPW14506F	6075	306704	Approved - SYERK	<b>CONCER:</b> cust states drv front wheel, both rear wheels chrome peeling Replace wheels-all 3 peeling on all 3 wheels <b>RECOMM:</b> need clear and focused close up images of the concern. thanks, Scott warranty approved to replace the lt frt and both rear wheels. thanks, Scott
7GZAH199	HD	20070726	20050427	20050719	02890	Russ Milne Ford, 04592	2005	1FMYU94165K	32849	306704	Approved - GSTAVROF	<b>CONCER:</b> check all 4 wheels are corroding around center caps,request replacing rims,does not appear to be any damage to wheels <b>RECOMM:</b> approved to replace wheels t/y george
7FLCL024	HD	20070612	20060117	20060331	02199	BOB GILLINGHA 156023	2006	1FTPW145X6F	15459	306513	Approved - SYERK	<b>CONCER:</b> All 4 wheel center caps have corrosion on them around outer edge. Correction: replace 4 center caps. David Zuber <b>RECOMM:</b> warranty approved to replace all four wheel center caaps. thanks, Scott
7FNAL095	HD	20070614	20060818	20070529	03540	Dewey Ford, Inc. 431021	2007	1FAHP28197G	914	306513	Approved - GBUSH5	<b>CONCER:</b> customer states right front and right rear wheel center caps have clear coat peeling. intend to replace as needed. thank you. <b>RECOMM:</b> approved to replace both rt center caps. thanks gary
7G4AC190	HD	20070730	20061120	20061222	04617	Champion Ford K 526369	2007	1FTSW21P17E	15468	306700	Approved - GBUSH5	<b>CONCER:</b> Customer states that the drivers front rim split. (no visible damage to rim other than split, no visible damage to original tire which is still mounted and on the ground) <b>RECOMM:</b> approved to replace the lf wheel. thanks garv
7GZAH164	HD	20070726	20040421	20050305	02265	Mathews Ford Lin 240751	2004	1FAFP40624F	28322	306513	Approved - MSAMPLE1	<b>CONCER:</b> both rear wheel caps are corroding requ repl thanyou dkw <b>RECOMM:</b> Please provide the required overall photo of the entire wheel for eachaffected wheel. Warranty approved to replace both rear wheel center caaps.
7FPAA032	HD	20070616	20040818	20050716	03774	Ewald's Venus Fc 515000	2005	1FMZU73K35U	26325	306513	Approved - GBUSH5	<b>CONCER:</b> c/s that her center cap logo's are all peeling off and claims it is a defect, if it was just 1 it may be a defect but not all four, she claims she doesnt use anything but carwash soap, she would like new stickers or caps under warranty <b>RECOMM:</b> approved to replace 4 center caps. thanks gary
7GUAA016	HD	20070721	20070102	20070120	20050	Fairway Ford Linc 103071	2007	2FMDK49C07E	18477	306704	Approved - BKIRCHEI	<b>CONCER:</b> the clearcoat on the outside rim of three of the wheels is coming off.need to replace 3 wheels. these are really bad pictures, i hope you can tell..thanks.sue <b>RECOMM:</b> Approved to replace 3 wheels. thanks Brvce
7HBAN157	HD	20070802	20060517	20060602	12505	Van Drisse Lincol 23190	2007	1MEFM40137G	21546	306704	Approved - SYERK	<b>CONCER:</b> left front wheel is peeling. area does not show any impact marks that could have caused concern. other 3 wheels appear ok. request auth to replace left front wheel. thanks don <b>RECOMM:</b> warranty approved to replace the lt frt wheel. thanks, Scott
7F3AH087	HD	20070629	20031008	20040129	10638	Northland Lincoln 38897	2004	1LNHM83W54Y	27167	306704	Approved - GSTAVROF	<b>CONCER:</b> all four wheels are peeling and blistering request to replace wheels <b>RECOMM:</b> approved to replace wheels t/y george
7FEAN244	HD	20070605	20021121	20030731	06145	Smith Brothers Fc 55912	2003	5LMEU78H73Z	49854	306513	Approved - GBUSH5	<b>CONCER:</b> Concern for line 51 is 3 corroded wheel centers. Repair is replacement of wheel centers. Please note! Repair order written whilevehicle was under 50,000 miles on 5/30/07. Now wheels and parts are subject to Digital Imaging and vehicle is over mileage. Thank you foryour consideration. <b>RECOMM:</b> Please fax a copy of ro to me for verification. return this clarification after fax is sent for the approval code. thanks gary approved to replace 3 wheel center covers. thanks gary

7FUAE152	HD	20070621	20041223	20041227	05142	Expressway Ford 75591	2005	1FDXF46Y45E	28073	306900	Approved - ENEILSON	<b>CONCER:</b> BOTH REAR OUTSIDE WHEELS (DUALLY) ARE OUT OF ROUND OR MIS-SHAPED IN THE BOLT PATTERN AREA OF THE WHEEL, THIS HAS BEEN VARIED BY OUT WHEEL FORCE BALANCER, OBVIOUSLY THIS WILL NOT BE VISIBLE IN THESE PICTURES. HELP. BOTH LEFT REAR WHEELS ARE OUT OF ROUND, RIGHT SIDE OK. MY MISTAKE. BUT IT IS JUST ONE SIDE. <b>RECOMM:</b> Are both wheels on left side or is it both outer wheels on left and right side? Please clarify and add new pics if nec. Thanks, Eric <b>Approved to replace both left rear wheels. Thanks, Eric</b>
7FDAC041	HD	20070604	20050923	20051019	11056	Landmark Lincoln 41857	2006	1LNHM83V46Y	9144	306513	Approved - SYERK	<b>CONCER:</b> two center caps on pass side. have the black fill finish coming off of center lincoln emblem. recommend replacing both. thanks <b>RECOMM:</b> warranty approved to replace the rt frt and rear wheel center caps. thanks. Scott
7FYA6059	HD	20070625	20040824	20050216	04920	World Ford/Kend: 34001	2005	1FMZU77K85U	23204	306702	Approved - BKIRCHEI	<b>CONCER:</b> tire rims pitted need replacement ALL 4 RIMS PITTED NEED REPLACEMENT THANKS <b>RECOMM:</b> How many wheels? I need close up and overall photo of each wheel that needs to be replaced. Approved to replace 4 wheels. thanks Bryce
7GWAI096	HD	20070723	20070221	20070518	08198	Sunset Auto Co Ir 37025	2007	1FMEU75E57U	3202	306401	Approved - BKIRCHEI	<b>CONCER:</b> customer states that the left rear wheel is making a clicking noise while driving need to replace wheel because plastic wheel shin cover is flexing and making a noise when hitting the aluminum wheel. <b>RECOMM:</b> Approved to replace the lf rear wheel. thanks Bryce
7FTAH208	HD	20070620	20040106	20040807	08559	Landmark Ford, Ir 667547	2004	1FAFP48Y74F	8280	306704	Approved - LLOMBAR1	<b>CONCER:</b> RIGHT REAR WHEEL KEEPS LOOSING AIR, FOUND CHROME PEELING FROM INNER SIDE OF WHEEL FLAKING OFF AT BEAD ALLOWING AIR TO LEAK OUT. NEEDS NEW WHEEL. <b>RECOMM:</b> approval to replace right rear wheel Peeling. thnx Loretta 6-20-07
7G4AC111	HD	20070730	20070122	20070317	10489	TOMS RIVER LIN 34387	2007	2MEFM74V87X	8027	306513	Approved - LLOMBAR1	<b>CONCER:</b> customer states left front and left rear and right front wheel covers fading cannot clean off want to replace wheel covers <b>RECOMM:</b> approval to replace both left and right front wheel covers. discolored. thnx Loretta 7-30-07
7GXAK265	HD	20070724	20031017	20031124	01758	Krug Hilltop Ford- 18772	2004	1LNHM86S04Y	34440	306704	Approved - SYERK	<b>CONCER:</b> All 4 rims peeling material, customer brought entire envelope of chrome in for show, needs 4 rims to correct. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7F3AH190	HD	20070629	20040219	20040930	00582	Dons Ford, Inc. 596519	2004	1FTRX14W54N	21323	306513	Approved - SYERK	<b>CONCER:</b> customer states all four wheel caps have corosion intended repairs would be to replace all four caps <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7FYA6042	HD	20070625	20070606	20070623	02684	Carl Gregory Forc 09818	2007	1ZVHT88S075	18	306700	Approved - BKIRCHEI	<b>CONCER:</b> during cleanup found right front rim has defect in material, rough, rugged area. recommend replacement <b>RECOMM:</b> Approved to replace the rt front wheel. Thanks Bryce
7FSAH185	HD	20070619	20040407	20040722	04790	Gary Yeomans Fr 576475	2004	2FTRF07314C	35558	306700	Approved - GBUSH5	<b>CONCER:</b> cust sts casting flaw on passenger front wheel. req to replace. right front wheel <b>RECOMM:</b> which front wheel? advise approved to replace the rf wheel. thanks gary
7FGAL041	HD	20070607	20040910	20050314	09801	Midland Ford Linc 239035	2005	1FMZU67KX5U	29242	306700	Approved - SYERK	<b>CONCER:</b> four wheels corrodng underneath coating,will need to replace four wheels.tires marked w/yellow chalk 1,11,111,1V for lf,lr,rf,rr. <b>RECOMM:</b> warranty approved to replace all four wheels, Please note that all wheels are returned to warranty parts return center, and if any damageand/or no problem found this will result in a charge back to the dealer. Thanks, Scott
7G1A3215	HD	20070727	20051207	20060707	03608	NEMER FORD 17090	2006	1FMYU93146K	21331	306704	Approved - SYERK	<b>CONCER:</b> previously submitted, however, did not have enough photos. cust statethe clear coat is peeling off all 4 wheels and it is bubbling up around center cap area.intent of repair would be to replace. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7GCAK026	HD	20070703	20051122	20060317	02265	Mathews Ford Lin 239447	2006	1LNHM82V86Y	13487	306704	Approved - GSTAVROF	<b>CONCER:</b> right front chrome rim is corroded and rust pitted bad. request replacing rim thanks jim <b>RECOMM:</b> approved to repalce r/f wheel
7FLCL064	HD	20070612	20051024	20051108	05755	Town and Countr 25284	2006	2FMZA52226E	17631	306513	Approved - SYERK	<b>CONCER:</b> all 4 hub caps are marked on front exactly where seam meet on back of hub cap. wanting to replace <b>RECOMM:</b> warranty approved to replace all four wheel center caps. Please note that all wheels covers are returned to warranty parts return center, and if any damage and/or no problem found this will result in a chargeback to the dealer. Thanks, Scott
7FHAD224	HD	20070608	20040512	20040626	07329	Davies Ford 126365	2004	1FTPX14524N	25398	306513	Approved - GBUSH5	<b>CONCER:</b> customer states the two center caps on the rear wheels the paint is peeling off. customer requests two new center caps. <b>RECOMM:</b> approved to replace both rear wheel center caps. thanks gary
7HAAT058	HD	20070801	20070430	20070519	02744	Campbell Ford Lir 30458	2007	2FMDK49C37E	4160	306401	Approved - MSAMPLE1	<b>CONCER:</b> customer states hearing a rattle in her front end when driving. after contacting tech hotline they advised to replace both front wheels due to numerous complaints on this issue. requesting two front wheel. thanks <b>RECOMM:</b> Warranty approved to replace both front wheels.

7FHAD066	HD	20070608	20060726	20060727	02662	Friendly Ford, Inc 148548	2006	1FTPW14586F	13757	306701	Approved - GBUSH5	<b>CONCER:</b> c customer says 3 out his his four wheels (both front and the passengerside rear) have developed a dark spotty corrosion (for lack of a better term) that will not wash off no matter what the customer uses...he is asking that these 3 wheels be replaced with new ones...mark gary....customer advises bright metal cleaner has been tried...no go...and customer agrees with you that discoloration does appear to be on the surface...but if you run your fingers over the discolored areasthe surface is no longer smooth but rough and pitted....mark <b>RECOMM:</b> Mark, has the bright metal cleaner been tried? Looks to be on the surface. advise thanks gary approved to replace 3 wheels. thanks gary
7FRAF248	HD	20070618	20060526	20060601	02672	Imlay City Ford Li 19698	2006	1FTRW14W86F	30549	306704	Approved - ENEILSON	<b>CONCER:</b> customer states chrome bubbling on rt wheel, request replacement <b>RECOMM:</b> Approved to replace right wheel. Thanks, Eric
7HGAF192	HD	20070807	20051220	20061229	01804	Midpac Auto Cenl 194000	2006	1FMEU62E06ZA	1558	306704	Approved - ENEILSON	<b>CONCER:</b> requesting to replace rims due to spider webbing of the clear coat. thanks
7FRAF041	HD	20070618	20050629	20050928	04163	Elyria Ford 86005	2005	1FAFP25135G	12378	306704	Approved - GSTAVROF	Grant <b>RECOMM:</b> Approved to replace all 4 wheels as per TSB 07-12-02. Thanks, Eric
7FKAD075	HD	20070611	20050113	20050326	09883	Roberts Ford 149222	2005	1FTYR44U25P	34506	306702	Approved - BKIRCHEI	<b>CONCER:</b> c-s that all 4 center caps are peeling <b>RECOMM:</b> approved to repalce center caps
7FKAD075	HD	20070611	20050113	20050326	09883	Roberts Ford 149222	2005	1FTYR44U25P	34506	306702	Approved - BKIRCHEI	<b>CONCER:</b> cust states both rear wheels peeling clearcoat on the edges Replace both rear wheels <b>RECOMM:</b> Approved to replace the rear wheels. thanks Brvce
7GCAK208	HD	20070703	20061117	20070204	01487	Don Chalmers Fo 40480	2007	1FAFP31N17W	2746	306800	Approved - BKIRCHEI	<b>CONCER:</b> customer complaing of vibration at 40-45 mph, wheel has .026 runout and will not balance proper, need to replace wheel to correct concern <b>RECOMM:</b> Approved to replace the lf front wheel. thanks Brvce
7G1A3141	HD	20070727	20050105	20050801	03617	Hammonasset Fo 5973	2005	4M2YU57195D	33505	306513	Approved - SYERK	<b>CONCER:</b> cust states that center caps are peeling need to replace Thanks SJSALAFIA <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7FTA039	HD	20070620	20040802	20040831	20551	New Country Forc 235310	2004	1FTRF14W24N	11328	306513	Approved - BKIRCHEI	<b>CONCER:</b> customer stated that all wheel center caps chrome paint is flaking offand oxidizing. we verified. we need to replace all four center caps. <b>RECOMM:</b> Approved to replace 4 center caps. Thank Bryce
7GZAH150	HD	20070726	20040903	20050124	00716	RILEY FORD INC 62974	2005	1FTRF14555N	30242	306513	Approved - SYERK	<b>CONCER:</b> CUSTOMER STATES THAT STICKERS ON THE WHEEL COVERS ARE COMING OFF. CONFIRMED THAT EMBLEMS ON CENTER CAPS ARE FALLING OFF ON THE DRIVERS SIDE AND ARE GONE ON THE PASSENGER SIDE. <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7GQAE040	HD	20070717	20040526	20041015	03605	Sunshine Ford Lir 106085	2004	5LMEU88HX4Z	39921	306513	Approved - SYERK	<b>CONCER:</b> customer states all four center caps are peeling,all must be replaced.Thanks John V. <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7FOAE117	HD	20070615	20031219	20040714	04545	Gillespie Ford 82102	2004	1FTPW12504K	30610	306702	Approved - ENEILSON	<b>CONCER:</b> all 4 alloy wheels and 4 center caps are corroded/flaking apart.need to replace 4 alloy wheels and 4 center caps. <b>RECOMM:</b> Approved to replace all 4 wheels and center caps. Thanks, Eric
7GSAF679	HD	20070719	20051115	20060620	02058	BEECHMONT FC 360863	2006	1FTRF12266N	10816	306702	Approved - ENEILSON	<b>CONCER:</b> Request replace right rear rim due to rusting on the edge. Thanks! <b>RECOMM:</b> Please add clear close up pictures of concern. Thanks, Eric Approved to replace right rear wheel. Thanks, Eric
7GFAJ135	HD	20070706	20050218	20050319	04691	Bloomington Ford 016944	2005	1FTRF14W95N	22633	306704	Approved - MSAMPLE1	<b>CONCER:</b> customer states that finish is flaking off left rear wheel. fix: replace wheel see arrows for details <b>RECOMM:</b> Warranty approved to replace the left rear wheel.
7G1A3102	HD	20070727	20061211	20070105	09708	Don Seelye Ford, 754021	2007	1FMCU94197K	2707	306704	Approved - LLOMBAR1	<b>CONCER:</b> wheels peeling at the center holes on all 4 wheels wheels will need to be replaced <b>RECOMM:</b> Please review photos before sending. Next time, this will be a clarification for you to add more photos that are not blurry. For clear, close up photos, Be sure to turn the dial on top of the camera to the flower setting and take a step or 2 back for clearer close up. approval to replace 4 wheels due to peeling. thnx Loretta 7-27-07
7FNAL079	HD	20070614	20040213	20040904	10670	Woodhouse Lincc 076731	2004	5LMFU28R94L	32850	306704	Approved - GSTAVROF	<b>CONCER:</b> all four wheels are flaking apart on the inside of the wheels, replaceall 4 wheels. <b>RECOMM:</b> replacement of wheels that have no concern will be charged back you are approved to replace all defective wheels with peeling issues t/vaeorae
7GBAJ053	HD	20070702	20050519	20050602	03365	Town & Country F 361720	2005	1FMZU64K45U	23487	306704	Approved - MSAMPLE1	<b>CONCER:</b> customer state that the rear pass rim is peeling to fix need to be replaced <b>RECOMM:</b> Warranty approved to replace the right rear wheel.
7FDAC155	HD	20070604	20040601	20040703	03010	Brondes Ford Inc. 157332	2004	1FTPW145X4K	31371	306511	Approved - LLOMBAR1	<b>CONCER:</b> cust states all 4 hub cap/wheel covers are peeling off the ford part <b>RECOMM:</b> You need to provide a clear legible photo of 4 wheel covers. There is only 3 thnx Loretta 6-4-07 approval to replace 4 center caps due to peeling. thnx Loretta 6-4-07
7G5AI071	HD	20070731	20060921	20061124	06209	Dahl Ford La Cro: 150464	2007	1FTRW12567F	8785	306704	Approved - MSAMPLE1	<b>CONCER:</b> CUSTOMER STATES THAT THE RIGHT FRONT WHEEL CLEAR COAT IS PEELING OFF, CONFIRMED COMPLAINT RECOMMED REPLACING THE RIM THANK-YOU DEB <b>RECOMM:</b> Warranty approved to replace the right front wheel.
7FYA6136	HD	20070625	20031117	20040719	03617	Hammonasset Fo 05119	2004	5LMEU88H34Z	38238	306704	Approved - MSAMPLE1	<b>CONCER:</b> all 4 center caps are delaminating/peeling need to replace all 4 Thanks SJSALAFIA <b>RECOMM:</b> Warranty approved to replace all four center caps.
7GFAJ003	HD	20070706	20030902	20050303	10736	Ganley Lincoln-M 101504	2004	1LNHM86S14Y6	23834	306704	Approved - SYERK	<b>CONCER:</b> cust states there is a ticking noise when driving and stopping. insiderrims are flaking cust would like them replaced all four wheels are flaking thank you annette <b>RECOMM:</b> warranty approved to replace all four wheels. thanks. Scott

7GQAE135	HD	20070717	20070228	20070412	10638	Northland Lincoln	39299	2007	4M2EU48E97U	3559	306401	Approved - GSTAVROF	<b>CONCER:</b> loretta these are the picture of the wheels we diacussed on the phone noise from rocks all four wheel request to replace wheels i quest is the only why to fix issue <b>RECOMM:</b> approved to replace all wheels
7GTAJ207	HD	20070720	20040816	20041130	10671	Southgate Lincoln	99264	2005	2MEHM75W75X	28961	306513	Approved - LLOMBAR1	<b>CONCER:</b> customer states all four center caps finish is fading and peeling. replace all four caps. here you are all four caps <b>RECOMM:</b> You need to provide 4 photos of center caps to get auth to replace 4. thnx Loretta 7-20-07 thanx much. Approval to replace 4 center caps due to finish peeling. thnx Loretta 7-20-07
7FSAH039	HD	20070619	20060425	20060520	05977	Metro Ford Auto	22802	2006	3FAFP06Z46	22650	306701	Approved - MSAMPLE1	<b>CONCER:</b> c/s three of the four steel wheels are rusting/paint wearing off, would have to replace wheels sorry, am relearning this--left front wheel, left rear wheel and rightrear wheel are all rusting, left front and rear are worse than right rear <b>RECOMM:</b> Your comments indicate you want to replace three wheels but you did not state which wheels nor did we receive all the required images. For each wheel you must include an overall photo of the entire wheel as well as a close up of the customer's concern. Please state which wheels you need to replace and provide the missing photos. Thank you for the additional photos and information. Warranty approved to replace the left front, left rear and right rear wheels.
7FSAH077	HD	20070619	20060224	20060327	02263	Donley Ford Linc	111299	2006	3LNHM261X6F	5342	306702	Approved - MSAMPLE1	<b>CONCER:</b> rf wheel is pitting, cust washes vehicle once a week. all other wheelsare fine. sugg replacing rf wheel. thanks <b>RECOMM:</b> Warranty approved to replace the right front wheel.
7GJAE235	HD	20070710	20061102	20061114	01758	Krug Hilltop Ford-	18244	2007	1ZVFT85H175	9972	306704	Approved - SYERK	<b>CONCER:</b> All rims exhibiting flaking off aluminum, possibly filiform corrosion around areas where center caps install, needs 4 rims to correct. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7HAAT049	HD	20070801	20050404	20050923	01758	Krug Hilltop Ford-	19100	2005	1FTPX14535F	24432	306704	Approved - GBUSH5	<b>CONCER:</b> Delamination/corrosion present in varied extents and forms on all 4 rims, needs new rims all around to correct. <b>RECOMM:</b> approved to replace 4 rims. these wheels may be called back for inspection. thanks darv
7G4AC255	HD	20070730	20050926	20051012	06820	Doenges Ford	138175	2006	5LMFU28566L	19750	306702	Approved - MSAMPLE1	<b>CONCER:</b> all 4 wheels are pitting and rusting customer requesting that they be replaced. <b>RECOMM:</b> Warrantv approved to replace all four wheels.
7FTAHO24	HD	20070620	20050627	20051213	01758	Krug Hilltop Ford-	17409	2006	5LTPW18586F	44417	306704	Approved - LLOMBAR1	<b>CONCER:</b> Chrome bubbling and flaking off of all chrome rims, small pieces coming off of edges and corrosion occurring near valve stems, all rims exhibit some level, suggest replacement of rims to correct. <b>RECOMM:</b> approval to replace 4 wheels due to corroding and flaking. thnx Loretta 6-20-07 b.k.
7HHAG166	HD	20070808	20060411	20060613	09883	Roberts Ford	150432	2006	2FAHP71W76X	12810	306513	Approved - MSAMPLE1	<b>CONCER:</b> cust sates ford emblem fell off rear drv hub cap replace hub cap w/ emblem <b>RECOMM:</b> Warranty approved to replace the left rear wheel cover.
7FLCL169	HD	20070612	20060306	20060331	11441	Regency Lincoln-l	91364	2006	4M2EU47E86U	32045	306513	Approved - SYERK	<b>CONCER:</b> all four wheel center caps are peeling around the edges <b>RECOMM:</b> warranty approved to replace all four wheels center caps. thanks, Scott
7GIAC175	HD	20070709	20060329	20060421	01505	Lyons-Ryan Ford	106145	2006	2MHFM75V76X	33836	306513	Approved - SYERK	<b>CONCER:</b> paint peeling off both l/s center caps need to replace center caps thank you ken <b>RECOMM:</b> warranty approved to replace the lt frt and rear wheel center caps. thanks, Scott
7GYAH108	HD	20070725	20051103	20060905	09304	Lundgren Motors,	32564	2006	1FTPW14596K	27566	306513	Approved - SYERK	<b>CONCER:</b> customer notices peeled coating on both left hub caps requests that they be replaced under the bumper to bumper warranty please advise thanks russ <b>RECOMM:</b> warranty approved to replace the lt frt and rear wheel center caps. thanks, Scott
7GJAE054	HD	20070710	20041201	20041215	05755	Town and Countr	26181	2005	1FMZU67KX5U	22217	306704	Approved - SYERK	<b>CONCER:</b> check all four rims clear coat is peeling / need to replace all four rims <b>RECOMM:</b> warranty approved to replace all four wheels. thanks. Scott
7FGAL238	HD	20070607	20061117	20070326	11000	Liberty Lincoln M	114479	2007	5LMFU28587L	2530	306704	Approved - MSAMPLE1	<b>CONCER:</b> chrome is peeling from all four wheels.between spokes on exterior of wheel and between spokes on inside of wheel but can be seen very well standing next to truck customer requesting all new rims and all rims are bad <b>RECOMM:</b> Warranty approved to replace all four wheels.
7HPAH021	HD	20070816	20041101	20050715	12505	Van Drisse Lincol	23448	2005	5LMEU88H15Z	44593	306513	Approved - BKIRCHEI	<b>CONCER:</b> all 4 center caps have corrosion forming under clear coat on all 4 wheels.you can run your finger over the spots and feel that the clear coat is intact and corrosion is under clear coat. request auth to replace 4 center caps <b>RECOMM:</b> Approved to replace the center caps. Thanks Bryce
7GIAC169	HD	20070709	20050421	20050524	04369	Crestmont Ford, l	154454	2005	1MEFM55S45A	33973	306513	Approved - SYERK	<b>CONCER:</b> All four center caps are pitting and need replaced. <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks. Scott
7FKAD189	HD	20070611	20040512	20040625	10243	Lazare Lincoln-M	349098	2004	1LNHM81W64Y	26202	306513	Approved - BKIRCHEI	<b>CONCER:</b> all 4 wheel center caps are peeling.seeking approval to replace 4 wheels center caps <b>RECOMM:</b> Approved to replace 4 center caps. thanks Bryce
7GRAJ617	HD	20070718	20060831	20070531	02890	Russ Milne Ford,	4006	2007	3FAHP071X7F	3244	306703	Approved - SYERK	<b>CONCER:</b> discoloration/spot on right front wheel spoke, will not clean up or rubout, request wheel replacement. <b>RECOMM:</b> warranty approved to replace the rt frt wheel. thanks, Scott
7GWAI065	HD	20070723	20060914	20070615	00341	Billy Howell Ford	15289	2007	1FMFU19517L	4141	306401	Approved - GSTAVROF	<b>CONCER:</b> Customer states clicking noise in left front wheel area. DEALER NOTE: We rotated tires, now noise is in the left rear, need to replace the wheel. <b>RECOMM:</b> approved to replace l/r wheel t/y george
7GEAB100	HD	20070705	20031017	20031226	00796	Tasca Ford	442099	2004	1LNHM87A44Y	37313	306513	Approved - ENEILSON	<b>CONCER:</b> THESE PICTURES ARE BEING SUBMITTED FOR APPROVAL TO REPLACE THE 4 CENTER CAPS DUE TO FINISH DELAMINATING THANK-YOU <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks. Eric

7GQAE205	HD	20070717	20060327	20060531	01360	NEW HOLLAND I443286	2006	1FTWF31P86E	21145	306703	Approved - LLOMBAR1	<b>CONCER:</b> CUST STATES PASSENGER SIDE WHEELS HAVE DISCOLORATION/DULLING ON EACH WHEEL CUSTOMER REQUEST REPLACEMENT WHEELS THANKS JOE <b>RECOMM:</b> approval to replace both right wheels due to discoloration. thnx Loretta 7-17-07
7G2AB017	HD	20070728	20041109	20041206	00572	EMERLING FORI68158	2005	1FTWF33P05E	22444	306999	Approved - LLOMBAR1	<b>CONCER:</b> cust states there is a crack in the right front wheel by valve stem. recommend replacement of wheel <b>RECOMM:</b> approval to replace right front wheel. cracked at valve stem. thnx Loretta 7-26-07
7F1AM091	HD	20070627	20060117	20060117	20249	MANGOLD FORI92200	2006	3LNHM26186R6	20794	306513	Approved - ENEILSON	<b>CONCER:</b> cust states the clear is peeling on rt rear center cap(recommend replacement) thanks have a good weekend <b>RECOMM:</b> Approved to replace right rear center cap. Thanks, Eric
7FDAC190	HD	20070604	20040105	20041028	08287	Donley Ford-Linc507517	2004	1LNHM86S04Y	45329	306704	Approved - SYERK	<b>CONCER:</b> customer states inside of 2 rims, chrome peeling off. prev. replaced other 2 rims. requests replace these 2 rims. parts ordered last week and are in. both rear <b>RECOMM:</b> please specify which 2 wheels these might be. thanks, Scott warranty approved to replace both rear wheels, Please note that all wheels are returned to warranty parts return center, and if any damageand/or no problem found this will result in a charge back to the dealer. Thanks, Scott
7FNAL167	HD	20070614	20060726	20060804	08017	Auffenberg Ford, 141317	2006	4M2EU47E76U	17743	306513	Approved - ENEILSON	<b>CONCER:</b> all 4 center hub caps have poor appearance like clear coat is coming loose need all 4 center hub caps replaced <b>RECOMM:</b> Approved to replace all 4 center caps. Thanks, Eric <b>ADD-ON:</b> MERCURY WHEEL CENTER CAPS (5E6Z-1130-AA) RECEIVED FROM THE DEALER & GIVEN TO CHRIS GREGORCHIK FOR ANALYSIS.
7HCAD140	HD	20070803	20070423	20070427	02934	Roy O'Brien, Inc. 421643	2007	1FMEU74E07U	4957	306401	Approved - ENEILSON	<b>CONCER:</b> rotational noise pinpointed to left rear wheel internal. no visable damage. replace wheel <b>RECOMM:</b> Approved to replace left rear wheel. Thanks, Eric
7FKAD160	HD	20070611	20030827	20041004	20238	Lindquist Ford, In233915	2004	1FMZU75W24Z	33701	306704	Approved - GBUSH5	<b>CONCER:</b> intend to replace rh rear wheel asy.thanks kevin cust states rh rear wheel chrome is cracking.thanks kevin <b>RECOMM:</b> Please add required close-up picture of the entire wheel. also, add customer concern comments. thanks gary approved to replace the rr wheel. thanks gary
7GLAE059	HD	20070712	20061122	20070104	02531	Bob Tomes Ford, 634580	2007	1FMFU17577L	14536	306401	Approved - GSTAVROF	<b>CONCER:</b> hi, the left front wheel makes a loud squeak while driving. the wheel rim flexes and squeaks, will have to replace, there is no damage to the wheel. thanks, joe <b>RECOMM:</b> approved to replace l/f wheel t/y george
7FDAC209	HD	20070604	20050613	20050831	03540	Dewey Ford, Inc. 430147	2006	1FMYU02Z36K	24429	306701	Approved - MSAMPLE1	<b>CONCER:</b> Good Afternoon I have a customer that has a 2006 Ford Escape. The customer is concerned about the rust spots forming on the wheel. The car has 24,429 miles on the vehicle. I tried to clean off the wheels but since the wheels are painted I cannot use a light scotch bright onthe wheel like used on chrome. The rust has broken all the way throughthe paint & on the metal so it could be a problem in the future. Please take a look, it is on all of the wheels so it is not just one wheel. Please check and advise. Sincerely Karl Szary <b>RECOMM:</b> Warranty approved to replace all four wheels.
7GKAI148	HD	20070711	20051110	20060213	02157	Mullinax Ford Eas166601	2006	1FAFP28136G	19528	306704	Approved - MSAMPLE1	<b>CONCER:</b> Customer states that all four wheel center caps are peeling, some worse than others. recommend replacing all four center caps Thanks, Justin Higgins <b>RECOMM:</b> Warranty approved to replace all four center caps.
7FOAE002	HD	20070615	20050721	20050816	02662	Friendly Ford, Inc148807	2006	1FAFP25186G	14336	306513	Approved - MSAMPLE1	<b>CONCER:</b> CUSTOMER STATES ALL 4 CENTER CAPS TARNISHED. VERIFIED CONCERN. RECOMMEND REPLACEMENT OF ALL 4 CENTER CAPS. JAG <b>RECOMM:</b> Warranty approved to replace all four center caps.
7GRAN134	HD	20070718	20070515	20070530	10243	Lazare Lincoln-Mr350320	2007	4M2EU48847U	3811	306401	Approved - SYERK	<b>CONCER:</b> customer states the left rear wheel makes a clicking noise.we have verified.the only repair we can make is to replace wheel.seeking approval code. <b>RECOMM:</b> warranty approved to replace the lt rear wheel. thanks, Scott
7FDAC124	HD	20070604	20060518	20061127	03955	Chapman Ford S:153492	2006	1ZVFT82H165	5926	306513	Approved - SYERK	<b>CONCER:</b> customer states:the center pony emblem came of the right front center cap recommend replacement of center cap <b>RECOMM:</b> warranty approved to replace the rt frt wheel center cap. thanks, Scott
7GRAN158	HD	20070718	20041217	20050112	01758	Krug Hilltop Ford-18458	2005	5LMFU28555L	49635	306704	Approved - GSTAVROF	<b>CONCER:</b> Customer complaining of brake noise, found 3 of 4 rims deteriorating and making clicking sounds against calipers when driving, suggest replacement of all rims as customer is nearly beyond warranty in the interest of customer satisfaction. <b>RECOMM:</b> approved to replace 3 wheels to correct inner peeling issue making contact with calipers t/y george
7G5AI101	HD	20070731	20061120	20070425	02672	Imlay City Ford Li20830	2007	1FAHP24177G	3037	306704	Approved - GSTAVROF	<b>CONCER:</b> customer states spots on wheels, this is jeremie not reed already polished wheels spots still there need to replace wheels only 2 rear wheels <b>RECOMM:</b> PLEASE ADD THER REQUIRED OVERALL VIEW OF EACH WHEEL AND ADVISE US ON YOUR INTENDED REPAIR? T/Y GEORGE ARE YOU ASKING FOR ALL WHEELS? WE ONLY HAVE TWO OVERALL VIEWS / PLEASE ADVISE T/Y GEORGE approved to replace 2 wheels t/y george
7GCAK150	HD	20070703	20041029	20050705	10671	Southgate Lincoln99037	2005	2MEHM75W65X	31757	306513	Approved - SYERK	<b>CONCER:</b> customer states all center caps (pic's provided on all 4) are peeling..rec replace all 4 caps <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7GBAJ076	HD	20070702	20061115	20061130	03604	Oasis Ford 12784	2007	1FTPW14587F	26852	306702	Approved - BKIRCHEI	<b>CONCER:</b> c/s all 4 wheels are pitting <b>RECOMM:</b> Approved to replace 4 wheels. thanks Bryce

7GKAI087	HD	20070711	20060821	20070203	07327	Morrow Ford Linc 23040	2007	4M2CU91147K	6538	306513	Approved - GBUSH5	<b>CONCER:</b> b65 customer states all 4 center caps on wheels are corroded. requires replacement to correct. thank you. <b>RECOMM:</b> only received 2 pictures. need pictures of the remaining 2 center caps. thanks gary approved to replace 4 center caps. thanks gary
7GZAH156	HD	20070726	20070522	20070523	01758	Krug Hilltop Ford- 18778	2007	1FMEU53817U	4075	306401	Approved - LLOMBAR1	<b>CONCER:</b> Clicking noise from wheel area, more when slowing down, noise emanating from debris trapped in between aluminum rim and plastic moulded cap for chrome upgrade, needs new rim to correct. <b>RECOMM:</b> approval to replace left front wheel to correct noise. thnx Loretta 7-26-07
7GFAJ046	HD	20070706	20051011	20051209	07327	Morrow Ford Linc 22920	2006	1FMYU94136K	15820	306704	Approved - SYERK	<b>CONCER:</b> b65 customer states all four wheels are peeling. verified wheels peeling. recommend replacement of wheels. <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7GWAI239	HD	20070723	20040501	20040611	13144	Acton Lincoln Mei 243015	2004	5LMFU28R84L	28165	306704	Approved - GSTAVROF	<b>CONCER:</b> CUSTOMER STATES THAT ALL 4 CHROME WHEELS ARE PEELING. INSPECT ALL WHEELS, THEY ALL HAVE SOME BLISTERING/PEELING/COROSION IN VARIOUS PLACES. ALL 4 WHEELS NEED REPLACEMENT <b>RECOMM:</b> approved to replace wheels t/y george
7GZAH050	HD	20070726	20050506	20050610	11643	Island Lincoln Me 80483	2005	2MEFM75W85X	12123	306704	Approved - GSTAVROF	<b>CONCER:</b> all four wheels and center caps,clear coat is etching..need to replace all four wheels and center caps <b>RECOMM:</b> approved to replace all four wheels & center caps t/y Geo,
7HBAN131	HD	20070802	20030926	20031227	06835	Diffie Ford Linc-1 184994	2004	5LMFU28R94L	45453	306704	Approved - ENEILSON	<b>CONCER:</b> CHROME PEELING ON BOTH REAR WHEELS <b>RECOMM:</b> Approved to replace both rear wheels. Thanks, Eric <b>ADD-ON:</b> DEALER SUBMITTED FOR SAME CONCERN ON BOTH FRT WHEELS
7FRAF119	HD	20070618	20070530	20070613	05732	Joe Sartain Ford, 241853	2008	1FTNX20508E	462	306705	Approved - ENEILSON	<b>CONCER:</b> the right rear wheel has a dent in it. customer states the wheel was dented upon delivery <b>RECOMM:</b> Approved to replace right rear wheel due to concern noted within 1st week of delivery. Thanks, Eric
7HAAT170	HD	20070801	20060822	20070412	04351	Phil Smith Ford ol 167495	2007	1ZVFT85HX75	1333	306704	Approved - BKIRCHEI	<b>CONCER:</b> C/S DRIVER SIDE FRONT RIM HAS PAINT PEELING OFF ABOVE THE CENTER CAP,SUGGEST REPLACEMENT <b>RECOMM:</b> Approved to replace 1 wheel. Thanks Bryce
7GTAJ015	HD	20070720	20021206	20040112	10243	Lazare Lincoln-Mr 350470	2003	5LMEU78H03Z	29972	306513	Approved - ENEILSON	<b>CONCER:</b> customer states 2 wheel center caps are delaminating.seeking approval to replace 2 center caps. <b>RECOMM:</b> Approved to replace 2 center caps. Thanks, Eric
7GTAJ234	HD	20070720	20051031	20051104	02890	Russ Milne Ford, 04207	2006	1ZVFT85H665	17890	306704	Approved - GSTAVROF	<b>CONCER:</b> All 4 wheels (the right front is the least affected) have bubbling at the back edge of the spokes and have spidering under the clear at the front of some of the spokes. I took several pictures of each wheel. Most of the spidering at the front of the spokes are even with the bubbling at the rear edges of the spokes. If it wasn't for the bubbling, I would say the spidering was caused by a chemical. Not sure though. Thank you, Ryan. <b>RECOMM:</b> Approved to replace wheels t/y George
7F1AM009	HD	20070627	20050805	20061010	20050	Fairway Ford Linc 102466	2006	5LMFU28576L	22445	306704	Approved - ENEILSON	<b>CONCER:</b> chrome is peeling off rims request replacement rims thank todd <b>RECOMM:</b> Please add close up pictures showing peeling concern. Thanks, Eric
7FLCL196	HD	20070612	20031203	20041223	04166	McMahon Ford 121130	2004	1FTNW21P64E	33382	306511	Approved - MSAMPLE1	<b>CONCER:</b> cust states front drivers center cap loose. retaining tabs are intact. center cap does not fit snugly as it should. need to replace center cap. <b>RECOMM:</b> Please advise as to the cause of the concern and your intended repair.Are the retaining tabs broken? Warranty approved to replace the left front wheel center cap
7FUAE114	HD	20070621	20060517	20060824	04405	Commercial Moto 55252	2006	1FTRW12W26F	8111	306702	Approved - MSAMPLE1	<b>CONCER:</b> all four wheels have corrosion starting under clear coat finish. Request to replace wheels. request to replace two front wheels <b>RECOMM:</b> We received five close up images and two overall images. Please provide the overall photos for the other two wheels so your claim can be completed. Warranty approved to replace both front wheels.
7F1AM039	HD	20070627	20060509	0	04517	Energy Country F 2512	2007	4M2CU971X7K	20	306704	Approved - GSTAVROF	<b>CONCER:</b> found all 4 wheels pitted. replace all 4 wheels <b>RECOMM:</b> approved to replace all wheels t/y george
7GLAE144	HD	20070712	20031203	20041223	04166	McMahon Ford 121130	2004	1FTNW21P64E	33382	306511	Approved - GBUSH5	<b>CONCER:</b> new center cap was intalled, does not fit tight. dealer believes it is an issue with the rim, that the holes the the center cap fit into are elongated by 1/8 of an inch i had to let customer go. had prob with digital image system again. Ref.# is 1-A6EV0F. system kept shutting down. however if you need to see pics of center caps you can look at them on claim number 121130 repair line 01. was approved by mark samples on 06/12/07. pls advise how to continue on this claim <b>RECOMM:</b> Please add close-up pictures of the new center cap, both sides. thanksgary
7HGAF084	HD	20070807	20070226	20070802	06469	All Star Ford Linc 324367	2007	1FMFU17587L	292	306705	Approved - MSAMPLE1	<b>CONCER:</b> c/s the lf wheel was bent on his veh upon delivery. Wheel is bent at the bead lip. Chrome cap is slightly bent where the wheel lip push it. There is no evidence of damage to the tire. Need to replace the wheel. <b>RECOMM:</b> Warranty approved to replace the left front wheel. Please note this approval is given only because the concern was reported within the first seven days from delivery.
7HGAF189	HD	20070807	20050926	0	01804	Midpac Auto Cenl 193992	2006	1FMEU62E96Z	54	306704	Approved - SYERK	<b>CONCER:</b> request r/r rims due to clear coat spider webbing. thanks Grant <b>RECOMM:</b> warranty approved to replace all four wheels. thanks, Scott
7F3AH160	HD	20070629	20040322	20041013	04570	Bluebonnet Motor 472296	2004	1LNHM83W24Y	33029	306704	Approved - GSTAVROF	<b>CONCER:</b> c/s left rear tire goes flat every 3 days - found tire to be leaking where it beads up to the rim - pulled tire off and found chrome strip around inside edge of rim to be flaking - need to replace this one rim <b>RECOMM:</b> approved to replace l/r wheel t/y george



7FOAE126	HD	20070615	20060830	20070115	10671	Southgate Lincoln	98362	2007	3MEHM07147R	██████████	4121	306513	Approved - ENEILSON	<b>CONCER:</b> two center caps are oxidizing <b>RECOMM:</b> Approved to replace 2 center caps.
7GMAC135	HD	20070713	20040227	20050329	02284	John Lance Ford	145722	2005	1FMYU92Z75K	██████████	30558	306701	Approved - LLOMBAR1	<b>CONCER:</b> Customer states all wheels are rusting. Verified concern, rec replace all 4 wheels <b>RECOMM:</b> approval to replace 4 wheels due to rust. thnx Loretta 7-13-07
7GYAH210	HD	20070725	20050106	20050122	02058	BEECHMONT FC	361025	2005	1FMDU74W75Z	██████████	34960	306701	Approved - MSAMPLE1	<b>CONCER:</b> request replacement of 3 wheels due to corrosion at center cap area. Thanks! <b>RECOMM:</b> Warranty approved to replace three wheels.
7GKAI177	HD	20070711	20041029	20050331	11000	Liberty Lincoln M	115304	2005	1FAFP24165G	██████████	17063	306704	Approved - GSTAVROF	<b>CONCER:</b> clear coat peeling on lt front,lt rear wheels,replace lt front,lt rearwheels <b>RECOMM:</b> approved to replace l/f & l/r wheels t/y george
7GSAF761	HD	20070719	20060208	20060321	03604	Oasis Ford	14022	2006	1FTRE14W46D	██████████	10755	306512	Approved - MSAMPLE1	<b>CONCER:</b> c/s rattle noise while driving on both p/s and d/s - verified noise - removed wheel cover and all are rattling - rec repaire is to replacedwheel cover thank you pat <b>RECOMM:</b> Warranty approved to replace all four wheel covers.
7FHAD088	HD	20070608	20050914	20061130	06360	Griffin Ford Lincol	10462	2006	1LNHM82VX6Y	██████████	1601	306704	Approved - GSTAVROF	<b>CONCER:</b> customer is concerned the left front,left rear and right rear wheels are peeling-looking to replace 3 wheel assemblies thanks,greg george,to the right of the pen tip you will notice a mark-it is very sunny out and hard to get a decent picture,but the spot is about an eighth of an inch squared where it is delaminating-thanks,greg <b>RECOMM:</b> Greg, if you are asking for three wheels we would need three supporting photos. you only provided two Please add one more clear close up that shows a warrantable issue t/y george approved to replace three wheels t/y george
7FUAE230	HD	20070621	20051107	20060113	08559	Landmark Ford, Ir	667675	2006	1FAFP31N66W	██████████	18395	306512	Approved - ENEILSON	<b>CONCER:</b> LEFT FRONT HUB CAP MAKES ROTATIONAL SQUEAK NOISE WHILE DRIVING. ATTEMPTED TO REINSTALL CAP. NOISE STILL THERE APPLIED FOAM TAPE TO BACK SIDE OF CAP, NOISE STILL THERE. SUGGEST REPLACEMENT OF HUB CAP. <b>RECOMM:</b> Approved to replace left front hubcap. Thanks, Eric
7HAAT134	HD	20070801	20031007	20031119	11605	AutoWay Lincoln	323051	2004	5LMFU27R24L	██████████	40990	306704	Approved - GSTAVROF	<b>CONCER:</b> CUST STATE ALL 4 WHEELS CHROME IS PILLING OFF TECH RECOM REPLACEMENT <b>RECOMM:</b> you only have two close up supporting images on a four wheel request, please add the other two clear close ups that show a concen on the other two wheels t/y george APPROVED TO REPI ACF WHFFI S T/Y GFORGFF
7GSAF718	HD	20070719	20040414	20040805	09304	Lundgren Motors,	31538	2004	1FTRF14514N	██████████	18966	306513	Approved - SYERK	<b>CONCER:</b> all 4 center caps have poor finish, corroding near ford emblem. customer would like all replaced <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7GJAE073	HD	20070710	20050303	20050430	11000	Liberty Lincoln M	115251	2005	1FAHP28145G	██████████	28503	306513	Approved - SYERK	<b>CONCER:</b> cust coplaining all four center wheel caps are discoloring.the clear finish on all four caps are discoloring what looks like dirt is discoloring.all four caps clearcoat finish is corroding.may i replace caps ? <b>RECOMM:</b> warranty approved to replace all four wheel center caps. thanks, Scott
7GYAH063	HD	20070725	20070516	20070606	20700	JACK BYRNE FC	353885	2007	4M2EU48847U	██████████	2302	306400	Approved - GSTAVROF	<b>CONCER:</b> Hotline has recommended rim replacement due to chrome face on wheels making a clicking noise. Rims show no sign of damage. Request warranty approval for repalcement. <b>RECOMM:</b> approved to replace wheels t/v georae
7HPAH015	HD	20070816	20070530	0	05574	Palm Springs For	160358	2007	2LMDU88C47E	██████████	20	306401	Approved - BKIRCHEI	<b>CONCER:</b> THERE IS A CRUNCHING/RUBBING TYPE NOISE WHILE DRIVING AT SLOW OR HIGH SPEEDS. TEST DROVE VEHICLE FOUND NOISE COMING FROM WHEEL AREA, WE HAD TO SWAP WHEELS WITH OTHER STOCK UNIT AND NOISE WENT AWAY, NOISE IS COMING FROM CHROME CAP ON WHEEL, CAP IS GLUED/ATTACHED TO WHEEL, NEED TO REPLACE FOUR WHEELS. THANKS <b>RECOMM:</b> Approved to replace 4 wheels. thanks Bryce
7FNAL205	HD	20070614	20040309	20040904	01714	Colony Ford, L.L.	177590	2004	1FTRF14W94NE	██████████	9565	306513	Approved - ENEILSON	<b>CONCER:</b> CUSTOMER STATES: ALL 4 WHEEL COVERS ARE CORRODED AND DELAMINATING, EMBLEM WEARING OFF, WANTS 4 WHEEL COVERS REPLACED added 4 pictures - One of each wheel <b>RECOMM:</b> Please add picture of 4th center cap. Thanks, Eric Approved to replace all 4 center caps. Thanks Eric
7GEAB015	HD	20070705	20060830	20061014	11208	Hempstead Linco	746125	2007	4M2CU97117K	██████████	3551	306513	Approved - LLOMBAR1	<b>CONCER:</b> cust states center caps paint is peeling. all 4 center caps have paintpeeling on outside edges. no signs of physical damage. need to replacecenter caps. <b>RECOMM:</b> approval to replace all 4 center caps. cracking, peeling. thnx Loretta7-1-07 G.S.
7FGAL032	HD	20070607	20061020	20070324	07820	Walnut Creek For	535019	2007	2FMDK39C07E	██████████	4081	306704	Approved - BKIRCHEI	<b>CONCER:</b> left rear wheel chrome plating flaking off at spoke recommend to replace wheel <b>RECOMM:</b> approved to replace the lr wheel.
7G1A3206	HD	20070727	20060515	20070202	06481	Hub City Ford, Inc	112207	2007	1FTSW21P77E	██████████	16166	306999	Approved - SYERK	<b>CONCER:</b> please ck the ro for cust still open but now split on the right front rim about 11/2 inches on the rim cust has driven about 600 miles sincetire and rims ordered request replacement of 2nd rim thank you mike <b>RECOMM:</b> need the required overall image of the entire wheel, also the repair line can be numeric or alpha not both. thanks, Scott warranty approved to replace the rt frt wheel. thanks, Scott
7G1A3219	HD	20070727	20060831	20060921	01487	Don Chalmers Fo	42789	2007	1FTRW12527F	██████████	8879	306704	Approved - SYERK	<b>CONCER:</b> paasenger front wheel is peeling, need to replace whhel <b>RECOMM:</b> warranty approved to replace the rt frt wheel. thanks. Scott
7GKAI094	HD	20070711	20060921	20061016	08198	Sunset Auto Co Ir	36661	2007	1FAHP37N07W	██████████	10278	306513	Approved - GSTAVROF	<b>CONCER:</b> customer states: the left front hubcap paint is flaking. need to replace hubcap. <b>RECOMM:</b> approved to replace l/f hub cap if concern is damage related it shouldnot be claimed as warrtv t/v georae
7GBAJ011	HD	20070702	20040816	20041008	02662	Friendly Ford, Inc	149469	2004	1FTPF12514N	██████████	29831	306704	Approved - MSAMPLE1	<b>CONCER:</b> all four wheel center caps are corroding markedly...will need replacing...have enclosed a shot of every wheel center cap plus a closeup of one for you...mark <b>RECOMM:</b> Warranty approved to replace all four center caps.

7FMAH196	HD	20070613	20060221	20061130	06360	Griffin Ford Lincol	10632	2006	1LNHM83V26Y	[REDACTED]	13	306702	Approved -	LLOMBAR1	<b>CONCER:</b> HI ---I HAD FILED A PRIOR APPROVAL FOR THIS VEHICLE YESTERDAY FOR THE LEFT SIDE CENTER CAPS--THE PAINT IS PEELING OFF--WE ARE TRYING TO SELLVEHICLE AND CUSTOMER NOTICED THAT THERE IS PITTING ON ALL 4 RIMS --AT EDGE OF RIMS -TOWARDS INSIDE WHEN LOOKING AT THEM FROM THE OUTSIDE -SEE PICTURES--LOOKING TO REPLACE ALL 4 RIMS <b>RECOMM:</b> approval to replace 4 rims due to pitting. YOUR UPDATED CODE THAT WILLINCLUDE RIMS AND CENTER CAPS IS P11KR. thnx Loretta 6-13-07 B.K.	
7F1AM028	HD	20070627	20070111	20070618	02934	Roy O'Brien, Inc.	419993	2007	1FTNE14L27D	[REDACTED]	920	306511	Denied	GSTAVROF	<b>CONCER:</b> right rear wheel cover fell off. replace wheel cover <b>RECOMM:</b> missing parts are not warrantable denied request to replace r/r wheelcover t/v george	
7FDAC218	HD	20070604	20060328	20060606	01625	Courtesy Ford	307142	2006	1FTWW31P66E	[REDACTED]	28893	306511	Denied	LLOMBAR1	<b>CONCER:</b> both right hand hub caps are missing intend to replace <b>RECOMM:</b> warranty assistance denied to repl missing hub caps. Missing parts arenot warrantable per the W&P Manual. thnx Loretta 6-4-07	
7FEAN181	HD	20070605	20040116	20040721	01857	Buss Ford Sales	133637	2004	5LMFU28R34L	[REDACTED]	37239	306704	Denied	ENEILSON	<b>CONCER:</b> customer concern was for noise on passenger front - visual inspection found chrome coating peeling on the inside of the passenger front tire- the coating is hitting the bolt on the lower balljoint causing the rotational noise - after inspecting the rest of the wheels per customer's request we found the driver front tire chrome coating peeling at the inner edge of the outside wheel (pictures with pen marking the spot) - both rear tires good at this time - recommending replacing both front wheels - thanks Todd Mathis - Service Writer - Buss Ford <b>RECOMM:</b> Vehicle did not come from factory with chrome wheels. From pictures provided wheels appear to have aftermarket chrome. Thanks, Eric	
7FFAL234	HD	20070606	20070420	20070522	20323	Power Ford North	45075	2007	1FMFU19547L	[REDACTED]	32092	306705	Denied	SYERK	<b>CONCER:</b> DRIVER REAR WHEEL IS BENT ADVISE <b>RECOMM:</b> warranty denied to replace the lt rear wheel, concern appears to be damage from an outside source. thanks, Scott	
7FGAL087	HD	20070607	20060928	20070607	09893	Able Ford, Inc.	270254	2007	1ZVFT82HX75	[REDACTED]	16	306705	Denied	SYERK	<b>CONCER:</b> seeking approval to replace defective right front wheel for blem thankyou <b>RECOMM:</b> warranty denied to replace the rt frt wheel, concern appears to be damage from an outside source. thanks, Scott	
7FHAD099	HD	20070608	20050901	20060311	04728	Ray Skillman Perl	21278	2006	1FTPW14526F	[REDACTED]	32807	306703	Denied	GSTAVROF	<b>CONCER:</b> request to replace for wheels for discoloration coming through crome on all 4 wheels- Thanks <b>RECOMM:</b> Brake dust deposits on rims are not a warrantable issues thank you, George Thank you, Geora e	
7FIAA009	HD	20070609	20050907	20060728	00582	Dons Ford, Inc.	589142	2006	1FDNE24L96H	[REDACTED]	3648	306700	Denied	GBUSH5	<b>CONCER:</b> customer states the wheels are pitting <b>RECOMM:</b> These are not OEM wheels. Ford warranty does not cover aftermarket wheels. thanks garv	
7FKAD198	HD	20070611	20030730	20031215	10736	Ganley Lincoln-M	100672	2004	1LNHM87A84Y	[REDACTED]	49235	306705	Denied	ENEILSON	<b>CONCER:</b> left rear wheel chrome is peeling off wheel need to replace wheel assembly <b>RECOMM:</b> From pictures provided concern appears to be damage from an outside source, concern does not appear to be a manufacturina defect. Thanks.Eric	
7FLCL215	HD	20070612	20050829	20060905	09976	Automax Ford	230117	2006	1FTWW33P76E	[REDACTED]	31439	306705	Denied	SYERK	<b>CONCER:</b> four outside wheels are delaminating <b>RECOMM:</b> warranty denied to replace the four outside wheels, concern appears tobe damage from an outside source. thanks, Scott	
7FMAH041	HD	20070613	20020530	20020614	00796	Tasca Ford	439193	2003	1LNHM82W43Y	[REDACTED]	49730	306704	Denied	GBUSH5	<b>CONCER:</b> all 4 rimes & center caps the finish is lifting . need to replace all rims & center caps. thank you larry <b>RECOMM:</b> request denied. B-B warranty has expired by time. thanks gary	
7FMAH203	HD	20070613	20060928	20061209	20681	Downs Ford, Inc.	89026	2007	1FMFK18507L	[REDACTED]	1	10285	306704	Denied	GSTAVROF	<b>CONCER:</b> clrareification sending additional pictures for driver side rear wheelchrome finish peeling <b>RECOMM:</b> Denied request to replace l/r wheel, images show damage on edge, thus compromising the chrome finish t/v George
7FSAH017	HD	20070619	20050927	20051006	05702	BYERLY FORD II	375131	2006	1FMEU75806U	[REDACTED]	9243	306705	Denied	MSAMPLE1	<b>CONCER:</b> c/s chrome is flaking off of left rear wheel need to replace wheel <b>RECOMM:</b> Warranty denied to replace the left rear wheel. Based on the providedimages, this is damage.	
7FYA6012	HD	20070625	20070510	20070603	04790	Gary Yeomans Fr	577389	2007	1FMFU19527L	[REDACTED]	2541	306705	Denied	MSAMPLE1	<b>CONCER:</b> customer just purchased veh 06-05-07, washed veh for first time sat. saw drs side rear wheel lip bent. no tire damage. it is our intent to replace the wheel. <b>RECOMM:</b> Warranty denied to replace the left rear wheel. This is damage. As per the Warranty & Policy Manual, the customer has seven days from delivery to report pre-existing damage. This vehicle is beyond that time frame.	
7FYA6185	HD	20070625	20060413	20060614	07839	VALLEY ISLE MC	369523	2006	1FTSW31P06E	[REDACTED]	12370	306703	Denied	BKIRCHEI	<b>CONCER:</b> CUSTOMER STATES ALL FOUR RIMS ARE RUSTING. <b>RECOMM:</b> Denied to replace the wheels. These wheels are covered in brake dust and need to be cleaned and maintained using ford bright metal polish. Thanks Bryce	
7FZAH104	HD	20070626	20070522	20070607	10671	Southgate Lincolr	98748	2007	3LNHM26T07R	[REDACTED]	325	306705	Denied	BKIRCHEI	<b>CONCER:</b> customer states left ft wheel has developed some chipping,since he purchased it last wk.. rec replace wheel <b>RECOMM:</b> Denied to replace the lf front wheel. This appears to be curb/road damage, not a warrantable concern. This can only be covered if reported within the first week of delivery. Thanks Bryce	
7G4AC134	HD	20070730	20031013	20041213	09044	Darling's Bangor I	501511	2004	1FMZU74W64Z	[REDACTED]	42170	306702	Denied	BKIRCHEI	<b>CONCER:</b> c/s the paint is bubbling up on left rear wheel neer center. <b>RECOMM:</b> Denied to replace the wheel. the vehicle is out of warranty by milage.thanks Bryce	

7G5AI098	HD	20070731	20040312	20040713	03774	Ewald's Venus Fc 515910	2004	1FTPX145X4N	29517	306513	Denied	MSAMPLE1	<b>CONCER:</b> ALL 4 HUCAPS ARE PEELING AND DISCOLORED. REQUEST TO REPLACE 4 HUBCAPS <b>RECOMM:</b> Warranty denied to replace all four wheel covers. This vehicle is out of warranty. Also, keep in mind that since this is a prior approval program the images must be taken with the affected components still in place on the vehicle. Even if the vehicle had been under warranty we would not have been able to approve this repair.
7G5AI234	HD	20070731	20060622	20060913	08684	Wendle Ford Sale 415682	2007	1FAHP28147G	13206	306705	Denied	GBUSH5	<b>CONCER:</b> Customer statesw there is a crack in the spoke on the rt front wheel <b>RECOMM:</b> Please add a close-up of the entire wheel from directly at it, not from above. thanks gary
7GBAJ241	HD	20070702	20070619	0	02684	Carl Gregory Forc 094068	2007	1FTPW12V67K	1001	306705	Denied	MSAMPLE1	<b>CONCER:</b> on pre-delivery inspection, we found bad tire written on left front wheel along with areas of where the chrome is peeling off of the rim. this vehicle was dropped shipped on 5/29/07. contacted transport company, they stated that the vehicle came to them with bad tire written on the rim. suggest replacement of rim. <b>RECOMM:</b> Warranty denied to replace the left front wheel. As per the Warranty & Policy Manual, damaged wheels are considered transportation damage and must be noted on the bill of lading at carrier drop off.
7GCAK132	HD	20070703	20070321	20070623	07908	Cutter Ford, Inc. 404513	2007	1FTRW12W97K	253	306705	Denied	ENEILSON	<b>CONCER:</b> CK L/F TIRE RIM HAS A DENT AT THE EDGE,NO VISUAL SIGNS OF ANY TIRE DAMAGE THAT CAN BE SEEN..PLEASE ADVISE,CUSTOMER REQUEST TO HAVE THIS TAKEN CARE OF BY REPLACING... THANKS, RENEE <b>RECOMM:</b> From pictures provided concern appears to be damage from impact. Thanks, Eric
7GCAK190	HD	20070703	20051121	20060131	08951	Ford of Clermont, 09970	2006	1ZVFT82H265	20752	306704	Denied	ENEILSON	<b>CONCER:</b> cust states drivers front and rear wheels have chrome flaking off - requesting to replace rims and will need to replace air pressure sensor bands <b>RECOMM:</b> From pictures provided wheels appear to be aftermarket. Thanks, Eric
7GEAB031	HD	20070705	20070601	20070625	01286	Tamiami Ford, Inc 240927	2007	2FMDK39C77E	213	306705	Denied	GSTAVROF	<b>CONCER:</b> c/s the driver side rear and the pass side front and rear wheels are damaged. approval needed to replace three wheels. <b>RECOMM:</b> damage related issues are not warrantable (damaged wheels) transportation damage related claims are exempt from this program damage related issues need to be documented within set time lines as per the W&P WARRANTY START DATE 06/25/2007 t/y George
7GFAJ020	HD	20070706	20040426	20040426	07327	Morrow Ford Linc 22914	2005	1FMCU93105K	34699	306704	Denied	GSTAVROF	<b>CONCER:</b> all four rims have corrosion and pitting on lip of rim, two have corrosion around center caps. the wheels would need replaced to properly repair, thank you. <b>RECOMM:</b> denied wheel replacements vehicle is out of warranty WARRANTY START DATE 04/26/2004
7GIAC249	HD	20070709	20070110	20070308	07839	VALLEY ISLE MC 370514	2008	1FTSX21R98E	3768	306705	Denied	MSAMPLE1	<b>CONCER:</b> rf wheel is pitted, thanks john <b>RECOMM:</b> Keep in mind you are required to state your intended repair for every concern you submit. Warranty denied to replace the right front wheel.Based on the provided images, this is damage from an outside source.
7GJAE091	HD	20070710	20061218	20070317	09217	Apple Valley Ford 637612	2007	1FAHP34N17W	3897	306513	Denied	GSTAVROF	<b>CONCER:</b> CUSTOMER STATES THE LEFT FRONT HUB CAP IS CRACKED - RECOMMEND REPLACING HUB CAP <b>RECOMM:</b> cracked or broken l/f hub cap items are not warrantable t/y george
7GKAI216	HD	20070711	20070430	0	07839	VALLEY ISLE MC 913946	2008	1FTXW43R38E	71	306705	Denied	GBUSH5	<b>CONCER:</b> request permission to replace left front rim and right rear rim. both have etch marks. request permission to buff tailgate paint found dullspot on top of tailgate. thanks ann <b>RECOMM:</b> from pictures provided the lf and rr rim have been damaged from an outside source. warranty replacement denied. On dealers lot since 06-09-07. Paint claim needs to be on separate repair line. please resubmit. thanks gary
7GLAE178	HD	20070712	20070131	20070309	03140	Phil Long Ford, LI 780950	2007	1FMEU53887U	557	306705	Denied	GSTAVROF	<b>CONCER:</b> customer states that the drivers frt rim have a dent in the lip of their rim. no visible damage to the rim. dealer rec replace driver frt rim. <b>RECOMM:</b> damaged rims are not warrantable *WARRANTY START DATE 03/09/2007 t/v george
7GMAC043	HD	20070713	20060531	20060830	03326	Palm Coast Ford 49131	2006	1FTRF12266N	15919	306704	Denied	GBUSH5	<b>CONCER:</b> C/s the paint on all 4 wheels is chipping and rims are starting to rust. Intend to replace rims. Thanks, Mike. <b>RECOMM:</b> from pictures provided the OE tires have been replaced. chip paint on wheels result of new tire replacement. warranty repair denied. thanks gary
7GMAC162	HD	20070713	20060602	20061109	02484	Greenville Ford Li 17285	2007	1FTWW31P17E	28979	306705	Denied	MSAMPLE1	<b>CONCER:</b> customer states vehicle was sitting in a parking lot with a trailer on it and the tire blew out. There is no apparent damage to the tire possibly a defected wheel.need approval for wheel replacement <b>RECOMM:</b> Warranty denied to replace the left rear wheel. This is damage.
7GMAC172	HD	20070713	20070105	20070618	03326	Palm Coast Ford 49150	2007	1FAHP24117G	3926	306511	Denied	GBUSH5	<b>CONCER:</b> C/s the center cap on the left rear wheel fell out while driving. C/s could not find part. Intend to replace. Thanks. <b>RECOMM:</b> from pictures provided the lr tire shows impact witness marks. warranty replacement of the center cap denied.
7GUAA003	HD	20070721	20070524	20070713	02662	Friendly Ford, Inc 150047	2008	1FAHP25W78G	125	306705	Denied	LLOMBAR1	<b>CONCER:</b> customer says she has noticed a flaw in the driver side front wheel today she did not see two days ago when she took delivery...will need new wheel...mark <b>RECOMM:</b> Warranty assistance denied to repl left front wheel. This should have been caught on PDI and appears to be damage not manufacturer defect. I reviewed claim with my team leader. thnx Loretta 7-16-07

7GWAI154	HD	20070723	20040831	20050728	06267	Copper Country F 66014	2005	2MRZA21255B	27447	306705	Denied	LLOMBAR1	<b>CONCER:</b> inside right rear rim is wearing out the inside of tire do to roughness of on the rim also not sealing properly would need to replace the right rear rim <b>RECOMM:</b> Warranty assistance denied to repl right rear wheel. This appears to be damage not manufacturer defect. Possibly from driving on a flat. I reviewed claim with my Group Leader. thnx Loretta 7-23-07
7GXAK075	HD	20070724	20040603	20040628	09708	Don Seelye Ford, 753431	2005	1FMCU94175K	63210	306701	Denied	LLOMBAR1	<b>CONCER:</b> All 4 wheels have corrosion around where the center caps attach. Wouldrequire replacement of all 4 wheels. Thanks, Brock <b>RECOMM:</b> denied to replace 4 wheels. vehicle is out of warranty. thnx Loretta 7-24-07
7GXAK247	HD	20070724	20060125	20060209	03073	Mullinax Ford 456321	2006	1FAFP56U16A	22018	306511	Denied	MSAMPLE1	<b>CONCER:</b> cust states went to patch tire and rotate tires all four center caps broke coming off the metal rings stayed in grove in center of rim need to replace center caps <b>RECOMM:</b> Warranty denied to replace all four center caps. Based on the provided images, this is damage.
7GXAK254	HD	20070724	20070202	20070217	09217	Apple Valley Ford 641404	2007	1FAHP24117G	16861	306511	Denied	MSAMPLE1	<b>CONCER:</b> CUST STATES THE CENTER CAPS ARE FALLING OFF THE WHEELS, HAS ONLY ONE WHEEL WITH CAP REMAINING ON IT,CUST WANTS THEM REPLACED <b>RECOMM:</b> Warranty denied to replace three center caps. Missing parts are not covered under warranty.
7H5AQ001	HD	20070831	20070411	20070816	07908	Cutter Ford, Inc.	2007	1FAHP37N27W	365	306700	DENIED	SYERK	<b>REPAIR:</b> CUSTOMER'S CONCERN IS THAT BOTH FRT & REAR TIRE RIMS,HAS BLACK SPECKS WHEN HE RECEIVED DELIVERY OF VEHICLE. AND THAT THE SPECKS ARE NOT ROUGH TO THE FEEL BUT SMOOTH LIKE ITS UNDER THE CLEAR COAT..CONCERNED IF MAY CAUSE RUSTING IN THE FUTURE.... WILL TRY TO HAVE TECHNICIAN SEE IF CAN BE CLEANED AND POLISHED OUT,IF NOT, RECOMMEND TO REPLACE.. <b>RECOMM:</b> WARRANTY DENIED TO ADDRES THE OVERSPRAY CONCERN ON ALL FOUR WHEELS, CONCERN APPEARS TO BE FROM AN OUTSIDE SOURCE.
7HAAT071	HD	20070801	20070611	20070709	02744	Campbell Ford Lir 30488	2008	1MEHM42W78G	1656	306705	Denied	GSTAVROF	<b>CONCER:</b> customer states clear coat on front wheel is peeling. requesting to replace wheel. thanks customer noticed it when he was drying off his wheels the other day. the piece snagged his glove as he wiped it off. <b>RECOMM:</b> Looks like chip related is this correct? Please inspect & advise t/y george denied wheel replacement damaged realted issues not reported within 7days from warranty start date are not warrantable concerns WARRANTY START DATE 07/09/2007 t/y george
7HAAT142	HD	20070801	20070123	20070207	06469	All Star Ford Linc 324100	2007	1FAHP241X7G	17746	306511	Denied	GSTAVROF	<b>CONCER:</b> C/S 3 CENTER CAPS HAVE FALLEN OFF (LEFT FRONT AND REAR AND RIGHT FRONT). RECOMMEND REPLACEMENT <b>RECOMM:</b> NO SSM'S OR TSB'S FOUND ON THIS CONCERN TO SUPPORT COVERAGE MISSING PARTS ARE NOT WARRANTABLE DENIED CENTER CAP
7HBAN196	HD	20070802	20070620	0	10671	Southgate Lincoln 00190	2007	3LNHM26T37F	5	306705	Denied	GBUSH5	<b>CONCER:</b> we began the prep the vehicle and noticed there are 2 chunks missing from the wheel (lr) rec replace rear wheel <b>RECOMM:</b> this is either transportation damage or lot damage, neither are covered under defect warranty. vehicle on dealers lot since June 29, 2007. thanks gary
7HGAF085	HD	20070807	20050627	20050830	09883	Roberts Ford 150395	2005	1FTYR14U35P	12053	306704	Denied	SYERK	<b>CONCER:</b> Both drv side wheels peeling Replace both wheels <b>RECOMM:</b> warranty denied to replace the lt frt and rear wheels, concern appearsto be damage from an outside source. thanks, Scott
7HHAG125	HD	20070808	20060907	20061114	20323	Power Ford North 50574	2007	1FTRW12547F	18458	306704	Denied	ENEILSON	<b>CONCER:</b> FINISH ON ON RIGHT FRONT WHEEL IS PEELING <b>RECOMM:</b> From pictures provided concern appears to be damage from a previous repair as there is color underneath peeling area indicating prior repair. Thanks. Eric
7HOAO120	HD	20070815	20061102	20070806	11441	Regency Lincoln-l	2007	3MEHM07197F	490	306705	DENIED	SYERK	<b>REPAIR:</b> CUSTOMER STATES THE COATING ON L/FRONT IS PEELING. WILL NEED NEW WHEEL <b>RECOMM:</b> WARRANTY DENIED TO REPLACE THE LT FRT WHEEL, CONCERN APPEARS TO BE DAMAGE FROM AN OUTSIDE SOURCE.
7HOAO258	HD	20070815	20040415	20040527	01505	Lyons-Ryan Ford	2004	5LMFU28R84L	43244	306513	DENIED	SYERK	<b>REPAIR:</b> VEHICLE EQUIPPED WITH A GOLD TRIM PACKAGE TWO CENTER CAPS HAVE MATERIAL THAT CAME OFF REC. CHANGING THE TWO CENTER CAPS FOR CONCERN <b>RECOMM:</b> WARRANTY DENIED TO REPLACE 2 WHEEL CENTER CAPS, THIS IS NOT A FACTORY TRIM PACKAGE.
7HPBE041	HD	20070816	20041210	20041221	06727	Beach Ford, Inc.	2005	1ZVFT82H255	20531	306704	DENIED	SYERK	<b>REPAIR:</b> THE CLEAR COAT IS COMING OFF ON THE RIGHT REAR WHEEL, NEED TO REPLACE THE RIGHT REAR WHEEL <b>RECOMM:</b> WARRANTY DENIED TO REPLACE THE RT REAR WHEEL, CONCERN APPEARS TO BE DAMAGE FROM AN OUTSIDE SOURCE.
7HTAT007	HD	20070820	20061102	20070316	06717	Berglund Ford 351239	2007	3FAHP06Z47F	8828	306511	DENIED	LLOMBAR1	<b>REPAIR:</b> CUSTOMER STATES AFTER LAST TIRE ROTATION, DURING DRIVE, HER RIGHT FRONT WHEEL COVER CAME OFF AND A CAR RAN OVER IT, RECOMMENDING REPLACEMENT OF WHEEL COVER TO CURE CONCERN, <b>RECOMM:</b> THIS SOUNDS TO BE A WORKMANSHIP ISSUE NOT MANUFACTURER DEFECT. WARRANTY DENIED TO REPLACE RIGHT WHEEL COVER DUE TO FELL OFF AFTER LAST TIRE ROTATION.
7HTBB043	HD	20070820	20050518	20060130	04369	Crestmont Ford, l	2006	1FTSW21P46E	24265	306705	DENIED	SYERK	<b>REPAIR:</b> CUST STATES THE PASSENGER REAR RIM HAS LOST ITS SHINNY FINISH. TRIED CLEANING WITH MOTORCRAFT SHINNY METAL CLEANER. NO EFFECT TO CONDITION OF RIM <b>RECOMM:</b> WARRANTY DENIED TO REPLACE THE RT REAR WHEEL, CONCERN APPEARS TO BE DAMAGE FROM AN OUTSIDE SOURCE.

7HVAU065	HD	20070822	20050203	20050511	07839	VALLEY ISLE MC		2005	3FAFP31N05P		10896	306512	DENIED	SYERK	<b>REPAIR:</b> RIGHT FRONT WHEEL MAKES A CLICKING NOISE. REQUEST TO REPLACE RIGHT FRONT HUB CAP. <b>RECOMM:</b> WARRANTY DENIED TO REPLACE THE RT FRT WHEEL COVER, CONCERN APPEARS TO BE DAMAGE FROM AN OUTSIDE SOURCE.
7H1AY016	HD	20070827	20031125	20040522	03383	Donley Ford of Be 303867		2004	1FMDU74W04Z		24213	306700	Denied	GBUSH5	<b>REPAIR:</b> ALL 4 WHEELS ARE SHOWING PAINT BUBBLES AROUND CENTER CAPS. L/F IS THE WORST. WOULD REQUIRE WHEEL REPLACEMENT. <b>RECOMM:</b> B-B WARRANTY HAS EXPIRED. REQUEST TO REPLACE 4 WHEELS IS DENIED.
7H1A2011	HD	20070827	20070719	20070811	04728	Ray Skillman Perl		2008	1FMFU20508L		766	306705	DENIED P/	GSTAVROF	<b>REPAIR:</b> CP REQUEST TO REPLACE BOTH PASS SIDE WHEELS AND ONE TIRE DUE TO LIP OF BOTH WHEELS BEING WARPED THANKS CURTIS <b>RECOMM:</b> GVS IMAGES SUGGEST DAMAGE / DENIED BOTH PASSANGERS SIDE WHEELS T/Y GEORGE
7HVAZ008	HD	20070822	20070119	20070514	04909	Bev Smith Ford 477174		2008	1FTSW21R08E		7506	306700	DENIED R/	ENEILSON	<b>REPAIR:</b> CUST STATES THREE RIMS ARE STARTING TO PIT. RECCOMDED REPLACING THREE RIMS. <b>RECOMM:</b> FROM PICTURES PROVIDED WHEELS ARE AFTERMARKET.
7HVAZ003	HD	20070822	20060522	20060807	02199	BOB GILLINGHA 158377		2007	1FDAF56P07E		26329	306800	DENIED R/	ENEILSON	<b>REPAIR:</b> RIM HAS TOO MUCH RUNOUT .065 OF AN INCH APPR NO PHYSICAL DAMAGE ON TIRE OR RIM REC REPLACING RIM TOOK WHEEL OFF RIM TO TRY AND BALANCE STILL TOO MUCH RUNOUT HERE ARE MORE PICTURES OF RIM <b>RECOMM:</b> PLEASE ADD OVERALL PICTURES OF OUTSIDE OF WHEEL AND PICTURES SHOWING WHICH WHEEL CONCERN IS ON. FROM PICTURES PROVIDED UNABLE TO VERIFY ORIGINAL TIRES WERE ON WHEEL AS RUNOUT IS MOSTLY DUE TO IMPROPER BEAD SEAL ON TIRE. ALSO UNABLE TO VERIFY NO DAMAGE TO WHEEL FROM PICTURES PROVIDED.
7H4AQ010	HD	20070830	20051013	20060128	09044	Darling's Bangor 1507054		2006	1FTPX145X6F		31677	306704	DENIED W	ENEILSON	<b>REPAIR:</b> CUSTOMER STATS THAT ALL FOUR WHEELS ARE BUBBLING/PEELING <b>RECOMM:</b> FROM PICTURES PROVIDED WHEELS APPEAR TO BE PART OF UPFIT PACKAGE, PLEASE CONTACT UPFIT COMPANY REGARDING WARRANTY COVERAGE.
7FFAL172	HD	20070606	20060522	20061203	04918	Hub City Ford-Me 123051		2006	1FTPW14V16F		15529	306705	Processed	ENEILSON	<b>CONCER:</b> C/S THERE IS A TEAR IN THE SIDEWALL FRONT LEFT HAND TIRE. <b>RECOMM:</b> Tires do not require DI approval. Thanks, Eric
7FOAE028	HD	20070615	20070525	0	03030	Henry Day Ford, 1812426		2008	1FTWW31R78E		2 4	306511	Processed	BKIRCHEI	<b>CONCER:</b> Good Morning all we have received delivery of a 2008 super duty with a wheel issues in the pics i have attached you can see both rear wheels have been produced without a full lip to hold center caps on need to repalce both rear wheels please inspect pics and advise thanksfor your consideration .Butch <b>RECOMM:</b> The wheel cap mounts to the lug nuts, the wheels no longer have a lip to retain the center caps. SSM 19714. Thanks Bryce
7FRAF190	HD	20070618	20070515	20070530	02700	Skalnek Ford Inc 101580		2007	2FMDK38C27E		993	306700	Processed	MSAMPLE1	<b>CONCER:</b> cust states rt frt wheel chrome distorted <b>RECOMM:</b> This line is closed.
7FRAF191	HD	20070618	20070515	20070530	02700	Skalnek Ford Inc 101580		2007	2FMDK38C27E		993	306700	Processed	MSAMPLE1	<b>CONCER:</b> cust states rt rear wheel chrome distorted <b>RECOMM:</b> This line is closed.
7FRAF192	HD	20070618	20070515	20070530	02700	Skalnek Ford Inc 101580		2007	2FMDK38C27E		2 993	306700	Processed	MSAMPLE1	<b>CONCER:</b> cust states lt rear wheel chrome distorted <b>RECOMM:</b> This line is closed.
7FWAA019	HD	20070623	20040430	20041109	06717	Berglund Ford 348265		2004	1FTPX14544K		7509	306700	Processed	GBUSH5	<b>CONCER:</b> cust stated tires are all dry rotted and they are. request replacementof tires <b>RECOMM:</b> Tires are not on the di program. your call.
7G4AC044	HD	20070730	20061211	0	02484	Greenville Ford Li 17551		2007	1LNHM81V57Y		20719	306604	Processed	LLOMBAR1	<b>CONCER:</b> customer states all four tires are dryrotting on the sidewalls need approval for replacement <b>RECOMM:</b> Tires are not on the DI program. Only the wheels and center caps. thnxLoretta 7-30-07
7GEAB247	HD	20070705	20051022	20051201	01505	Lyons-Ryan Ford 106020		2006	1FTSW21P76E		22424	306705	Processed	ENEILSON	<b>CONCER:</b> customer brought vehicle in for grinding type noise while braking. right rear caliper failed, pads worn and pistons hit rotor. completedrepair and cleaned rim from all brake dust, but due to hot brake cust chrome rim is stained, pitted and damaged. Repair would be replacement of right rear rim. thank you--- chris <b>RECOMM:</b> Wheel will need to go under caliper repair as consequential damage. Caliper will not require DI approval. Thanks, Eric
7GJAE065	HD	20070710	20060131	20060228	11092	Super Lincoln Me 65466		2006	3LNHM26106R		12972	306603	Processed	SYERK	<b>CONCER:</b> customer states bubble on rt rear tire. <b>RECOMM:</b> tires do not require di approval. thanks, Scott
7GLAE154	HD	20070712	20070515	20070704	03028	Willey Ford - Bou 601227		2008	1FTWW31R98E		529	306600	Processed	SYERK	<b>CONCER:</b> GUEST STATES: TIRE WENT FLAT. THERE IS A CRACK ON THE SIDEWALL. NO APPARENT IMPACT DAMAGE. INTENT TO REPLACE TIRE <b>RECOMM:</b> tires do not require di approval. thanks. Scott
7GMAC110	HD	20070713	20060503	20060517	03261	Terry Holmes For 51469		2006	3FAFP06Z06R		17972	306000	Processed	LLOMBAR1	<b>CONCER:</b> customer states all four rims are rusted,have poor apperance/suggest to replace all four rims <b>RECOMM:</b> clean with Ford Metal Brite. If this does not correct concern, resubmit with photos showing concern. What I am seeing appears to be brake dust. thnx Loretta 7-13-07

7GRAN201 HD 20070718 20060311 20060628 04908 Sawgrass Ford 652058 2006 1ZVFT82H765 [REDACTED] 7219 306900 Processed SYERK

**CONCER:**customer came in for his 2nd oil change and first tire rotation. we went to remove the wheel locks and they were stuck so they tried with more force and 1 broke. all are extremely tight and may also brake off if we keep going. i took pictures to show that if the rims are damaged it is because of a factory issue. installation of the locking wheel locks is to tight. we are requesting authorization to go ahead and remove the rest of the wheel locks and stop and take more pictures if damage does come about to the wheels. I just want to cover myself and the dealership to were if the wheels do get damaged ford will cover the replacement of them. thank you teddy. i have supplied pictures of both the wheel lock key and broken lug nut. **RECOMM:**di does not provide approval to correct a concern that may not exist, dealer is responsible to provide proper care and protect componants when providing service on a customers vehicle. thanks, Scott

7HDAB020 HD 20070804 20061025 20070608 07329 Davies Ford 10617 2007 1FTSW21P27E [REDACTED] 5346 306602 Processed SYERK

**CONCER:**customer states right rear tire blew and cause wheel damage. customer requests new wheel and tire. please advise. **RECOMM:**tires do not require di approval, if the tire is defective the wheel needs to be on the tire repair as consequential damage. thanks, Scott